INSTALLATION RESTORATION PROGRAM
TWIN CITIES ARMY AMMUNITION PLANT

FISCAL YEAR 2007 ANNUAL PERFORMANCE REPORT

Distribution is limited to U.S. Government Agencies only for protection of privileged information. Other requests for the document must be referred to:

Commander
Twin Cities Army Ammunition Plant
470 West Highway 96, Suite 100
Shoreview, Minnesota
55126-3218

Prepared for:

Commander
Twin Cities Army Ammunition Plant
470 West Highway 96, Suite 100
ATTN: DAIM-BD-TW
Shoreview, Minnesota 55126-3218

WENCK ASSOCIATES, INC.

ALLIANT TECHSYSTEMS INC.
CONESTOGA-ROVERS & ASSOCIATES, INC.
SECOR INTERNATIONAL, INC.

July 2008
FINAL REPORT

UNITED STATES ENVIRONMENTAL PROTECTION AGENCY
REGION 5
77 WEST JACKSON BOULEVARD
CHICAGO, IL 60604-3590

July 10, 2008

REPLY TO THE ATTENTION SR-6J

Mr. Michael R. Fix
Remedial Project Manager
Twin Cities Army Ammunition Plant
470 West Highway 96, Suite 100
Shoreview, MN 55126

RE: Consistency Test for the Fiscal Year 2007 Annual Performance Report, Twin Cities Army Ammunition Plant, Arden Hills, Minnesota

Dear Mr. Fix:

Staff at the U.S. Environmental Protection Agency (U.S. EPA) and the Minnesota Pollution Control Agency (MPCA) have completed review of the Fiscal Year 2007 Annual Performance Report for the Twin Cities Army Ammunition Plant (FY07 APR). Our review of the FY07 APR included the following documents and communications:

- Fiscal Year 2007 Annual Performance Report, Draft Report, Prepared for the Commander, Twin Cities Army Ammunition Plant by Wenck Associates, Inc., Alliant Techsystems, Inc., Conestoga-Rovers, Inc., and Secor International, Inc., February 2008;
- Minnesota Pollution Control Agency (MPCA) and U.S. EPA comments on the Draft FY07 APR (April 22, 2008 and April 23, 2008);
- U.S. Army (Army) responses to U.S. EPA and MPCA comments and redline changes (May 21 and 22, 2008);
- Additional change pages requested by U.S. EPA and provided by Army (June 25, 2008);
- MPCA acceptance of responses to comments and redlines (July 1, 2008);
- U.S. EPA acceptance of responses to comments and redlines (July 10, 2008).

Based upon our review, you are hereby advised that, in accordance with Chapter XIV of the Federal Facility Agreement, the Fiscal Year 2007 Annual Performance Report passes the Consistency Test.

If you have any questions, please contact Dagmar Romano at (651) 296-7776 or Tom Barounis at (312) 353-5577.

Sincerely

Tom Barounis

Tom Barounis
Remedial Project Manager
U.S. Environmental Protection Agency
Region 5

Tom Barounis for

Dagmar Romano
Project Manager
Superfund Unit 2
Majors and Remediation Division
Minnesota Pollution Control Agency

Recycled/Recyclable • Printed with Vegetable Oil Based Inks on 100% Recycled Paper (50% Postconsumer)

Table of Contents
TCAAP
Fiscal Year 2007 Annual Performance Report

1.0 EXECUTIVE SUMMARY 1-1

2.0 INTRODUCTION 2-1

2.1 Purpose 2-1
2.2 Site Description 2-4
2.3 Hydrogeologic Units and Well Nomenclature 2-5
2.4 Data Collection, Management, and Presentation 2-6

3.0 OPERABLE UNIT 1: DEEP GROUNDWATER 3-1

3.1 Remedy Component #1: Alternate Water Supply/Well Abandonment 3-3
3.2 Remedy Component #2: Drilling Advisories 3-7
3.3 Remedy Component #3: Groundwater Recovery 3-8
3.4 Remedy Component #4: Removal of VOCs by GAC 3-11
3.5 Remedy Component #5: Discharge of Treated Water 3-13
3.6 Remedy Component #6: Groundwater Monitoring 3-13
3.7 Overall Remedy for OU1 Deep Groundwater 3-15

4.0 OPERABLE UNIT 2: SHALLOW SOIL SITES 4-1

4.1 Remedy Components #1 through 7: Soil Remediation 4-1
4.2 Remedy Component #8: Groundwater Monitoring 4-2
4.3 Remedy Component #9: Characterization of Dumps 4-6

5.0 OPERABLE UNIT 2: DEEP SOIL SITES 5-1

5.1 Remedy Component #1: Groundwater Monitoring 5-1
5.2 Remedy Component #2: Restrict Site Access 5-3
5.3 Remedy Component #3: SVE Systems 5-3
5.4 Remedy Component #4: Enhancements to the SVE Systems 5-4
5.5 Remedy Component #5: Maintain Existing Site Caps 5-5
5.6 Remedy Component #6: Maintain Surface Drainage Controls 5-5
5.7 Remedy Component #7: Characterize Shallow Soils and Dump 5-6
5.8 Overall Remedy for Deep Soil Sites 5-7

Table of Contents (cont'd.)

6.0 OPERABLE UNIT 2: SITE A SHALLOW GROUNDWATER 6-1

6.1 Remedy Component #1: Groundwater Monitoring 6-1
6.2 Remedy Component #2: Groundwater Containment and Mass Removal 6-2
6.3 Remedy Component #3: Drilling Advisory/Alternate Water Supply/ Well Abandonment 6-4
6.4 Remedy Component #4: Discharge of Extracted Water 6-6
6.5 Remedy Component #5: Source Characterization/ Remediation 6-7
6.6 Overall Remedy for Site A Shallow Groundwater 6-8
6.7 Other Activities in FY 2007 6-10

7.0 SITE C GROUNDWATER RESPONSE ACTION 7-1

7.1 Background 7-1
7.2 Remedy Component #1: Groundwater Monitoring 7-4
7.3 Remedy Component #2: Surface Water Monitoring 7-5
7.4 Remedy Component #3: Groundwater Containment 7-5
7.5 Remedy Component #4: Extracted Water Treatment and Discharge 7-6
7.6 Remedy Component #5: Contingency Plan for Groundwater 7-7
7.7 Remedy Component #6: Contingency Plan for Surface Water 7-8
7.8 Overall Remedy For Site C Shallow Groundwater 7-9

8.0 OPERABLE UNIT 2: SITE I SHALLOW GROUNDWATER 8-1

8.1 Remedy Component #1: Groundwater Monitoring 8-2
8.2 Remedy Component #2: Groundwater Extraction 8-4
8.3 Remedy Component #3: POTW Discharge 8-5
8.4 Remedy Component #4: Additional Investigation 8-5
8.5 Other Activity 8-7

9.0 OPERABLE UNIT 2: SITE K SHALLOW GROUNDWATER 9-1

9.1 Remedy Component #1: Groundwater Monitoring 9-1
9.2 Remedy Component #2: Sentinel Wells 9-2
9.3 Remedy Component #3: Hydraulic Containment 9-3
9.4 Remedy Component #4: Groundwater Treatment 9-5
9.5 Remedy Component #5: Treated Water Discharge 9-6
9.6 Remedy Component #6: Discharge Monitoring 9-6
9.7 Remedy Component #7: Additional Investigation 9-7
9.8 Overall Remedy for Site K 9-7
9.9 Other Activity 9-8

Table of Contents (cont'd.)

10.0 OPERABLE UNIT 2: DEEP GROUNDWATER 10-1

10.1 Remedy Component #1: Hydraulic Containment and Contaminant Removal From the Source Area 10-4
10.2 Remedy Component # 2: Groundwater Treatment 10-17
10.3 Remedy Component #3: Treated Water Discharge 10-18
10.4 Remedy Component #4: Institutional Controls 10-18
10.5 Remedy Component #5: Review of New Technologies 10-19
10.6 Remedy Component #6: Groundwater Monitoring 10-21
10.7 Overall Remedy for Deep Groundwater 10-23

11.0 OPERABLE UNIT 3: DEEP GROUNDWATER 11-1

11.1 Remedy Component #1: Monitored Natural Attenuation 11-3
11.2 Remedy Component #2: Groundwater Monitoring 11-3
11.3 Remedy Component #3: Drilling Advisories 11-7
11.4 Overall Remedy for OU3 11-7

12.0 LAND USE CONTROLS 12-1

13.0 OTHER INSTALLATION RESTORATION ACTIVITIES DURING FY 2007 .. 13-1

13.1 Building 102 13-1

14.0 REFERENCES 14-1

Table of Contents (cont'd.)

TABLES

1-1 Status of Remedial Actions

3-1 OU1 Pumping/VOC Mass Removal Data
3-2 TCAAP – OU1 Groundwater Elevations
3-3 OU1, PGAC Effluent Water Quality
3-4 Summary of OU1 Monitoring Requirements
3-5 OU1 Groundwater Quality Data
3-6 Group 1, 2, 3, 5, and 6 Mann-Kendall Summary and MAROS Conclusion

4-1 Groundwater Quality Data for OU2 Shallow Soil Site 5-Year Groundwater Monitoring

5-1 Deep Groundwater Data Near Sites D and G

6-1 Summary of Site A Shallow Groundwater Monitoring Requirements
6-2 Site A Groundwater Quality Data
6-3 Site A Removal Action Pumping Data
6-4 Site A Groundwater Level Data
6-5 Site A Removal Action Monthly Operation and Maintenance Notes
6-6 Site A Effluent Water Quality
6-7 Site A Removal Action Monthly VOC Removal

7-1 Site C Extraction Well/Effluent Data
7-2 Water Quality Data for Site C Groundwater
7-3 Water Quality Data for Site C Surface Water
7-4 Site C Removal Action Monthly Lead Removal

8-1 Groundwater Quality Data, Site I, TCAAP
8-2 Summary of Groundwater Monitoring Requirements, Site I, TCAAP

9-1 Groundwater Quality Data, Site K, TCAAP
9-2 Groundwater Elevation Monitoring, Site K, TCAAP
9-3 Treatment System Concentrations (Organics), Site K, TCAAP
9-4 Treatment System Concentrations (Inorganics), Site K, TCAAP
9-5 Summary of Monthly VOC Removal, Site K, TCAAP
9-6 Summary of Groundwater Monitoring Requirements, Site K, TCAAP

Table of Contents (cont'd.)

TABLES (continued)

10-1 Groundwater Cleanup Levels, TGRS, TCAAP
10-2 Extraction Well Water Pumped, TGRS, TCAAP
10-3 Treatment Center Water Meter Totals, TGRS, TCAAP
10-4 Pumphouse Down Time (Days), TGRS, TCAAP
10-5 Down Time (Days) By Category, TGRS, TCAAP
10-6 VOC Mass Loading Summary, TGRS, TCAAP
10-7 VOC Concentrations in TGRS Extraction Wells (µg/l), TGRS, TCAAP
10-8 Groundwater Quality Data (µg/l), TGRS, TCAAP
10-9 Summary of OU2 Deep Groundwater Monitoring Requirements, TGRS, TCAAP

11-1 Groundwater Quality Data, PGRS, TCAAP
11-2 Mann-Kendall Statistical Summary, PGRS, TCAAP
11-3 Summary of Groundwater Monitoring Requirements, PGRS, TCAAP

13-1 Building 102 Groundwater Quality Data

Table of Contents (cont'd.)

FIGURES

2-1 Site Location Map
2-2 TCAAP Site Boundaries

3-1 Upper Unit 4, 1 µg/l Trichloroethene Isoconcentration Map
3-2 OU1 Well Pumping Rates vs. Targets
3-3 OU1 & OU3, Upper Unit 4, Potentiometric Map, Summer 2005
3-4 New Brighton Municipal Wells: Trichloroethene Water Quality Trends
3-5 OU1 & OU3, Upper Unit 3, Trichloroethene Isoconcentration Map, Summer 2007
3-6 OU1 & OU3, Lower Unit 3, Trichloroethene Isoconcentration Map, Summer 2007
3-7 OU1 & OU3, Upper Unit 4, Trichloroethene Isoconcentration Map, Summer 2007
3-8 OU1 Trichloroethene Cross-Section A-A′ (North Half), Summer 2007
3-9 OU1 Trichloroethene Cross-Section A-A′ (South Half), Summer 2007
3-10 OU1 Trichloroethene Cross-Section B-B′, Summer 2007
3-11 Upper Unit 4, 100 µg/l Trichloroethene Isoconcentration Map
3-12 OU1, NBCGRS Mass Removal History

5-1 Location of Wells Nearest to Sites D and G
5-2 Site D, Well 03U093, Trichloroethene Water Quality Trends
5-3 Site G, Well 03U094, Trichloroethene Water Quality Trends

6-1 Site A, Well Location Map
6-2 Site A, cis-1,2-Dichloroethene Cross Sections A-A′, B-B′, C-C′ and D-D′ June 2007
6-3 Site A, Unit 1, Potentiometric Map – Summer 2007
6-4 Site A, Unit 1, cis-1,2-Dichloroethene Isoconcentration Map, Summer 2007
6-5 Site A, Unit 1 Tetrachloroethene Isoconcentration Map, Summer 2007
6-6 Site A, Well 01U902, Tetrachloroethene, Trichloroethene, cis-1,2-Dichloroethene Water Quality Trends
6-7 Site A, cis-1,2-Dichloroethene Water Quality Trends: Recovery Wells
6-8 Site A, Well 01U108, Tetrachloroethene, Trichloroethene, cis-1,2-Dichloroethene Water Quality Trends

7-1 Site C: Site Plan and Cross Section Locations
7-2 Surface Water Monitoring Locations Related to Site C
7-3 Site C: Cross-Section A-A′
7-4 Site C: Cross-Section B-B′
7-5 Site C: June 2007 Groundwater Elevation Contours
7-6 Site C Lead in Groundwater July 2007

Table of Contents (cont'd.)

FIGURES (continued)

8-1 Site I, Unit 1 Groundwater Quality Monitoring Locations
8-2 Site I, Unit 1 Groundwater Elevation Map, 6/5/07

9-1 Site K, Unit 1 and Unit 3 Groundwater Monitoring Locations
9-2 Site K, Unit 1 and Unit 3 Groundwater Elevation Data, 6/5/07
9-3 Site K Hydrogeologic Cross Section A-A′, 6/5/07 (Q95)
9-4 Site K, Unit 1 and Unit 3 Trichloroethene Concentration Map, 6/5/07 (Q95)

10-1 TGRS Layout
10-2 TGRS FY2007 Total Daily Flow Rates
10-3 OU2, Upper Unit 3, Potentiometric Map, 6/1/07 (Q95)
10-4 OU2, Lower Unit 3, Potentiometric Map, 6/1/07 (Q95)
10-5 OU2, Upper Unit 4, Potentiometric Map, 6/1/07 (Q95)
10-6 TGRS Treatment System Performance
10-7 OU2, Upper Unit 3, Trichloroethene Isoconcentration Map, Summer 2007
10-8 OU2, Lower Unit 3, Trichloroethene Isoconcentration Map, Summer 2007
10-9 OU2, Upper Unit 4, Trichloroethene Isoconcentration Map, Summer 2007
10-10 June 2007 Groundwater TRCLE Data Cross Section C′-C″
10-11 June 2007 Groundwater TRCLE Data Cross Section C′-C″
10-12 TGRS Annual Monitoring Data – West Portion, TRCLE Concentrations (ug/L) June 2007

11-1 OU3 (PGRS) Site Plan

13-1 Location of Building 102
13-2 Trichloroethene Results
13-3 Building 102 Groundwater Elevation Contours

Table of Contents (cont'd.)

APPENDICES

A FY 2007 – FY 2011 Monitoring Plans
- A.1 Groundwater Monitoring Wells
- A.2 Remedial Treatment Systems
- A.3 Surface Water
- A.4 Site Specific Lists of Required Analytes
- A.5 Site C Monitoring Plan

B Description of Hydrogeologic Units/Well Nomenclature and Trichloroethene Trends (Trichloroethene Trend Graphs are located at the end of this Appendix)

C FY 2007 Data Collection and Management
- C.1 Data Collection, Management, and Presentation
- C.2 Deviations from Monitoring Program
- C.3 Regulatory Approvals for Data Assessments and Validation

D Comprehensive Groundwater Quality and Groundwater Level Databases
- D.1 Comprehensive Groundwater Quality and Groundwater Level Databases
- D.2 Operable Unit 1 Statistical Analysis
  - D.2.1 Well Groups and Statistical Evaluation Criteria Tables
  - D.2.2 Group 1 Kriging Evaluation
  - D.2.3 Group 1, 2, 3, 5, and 6 Mann-Kendall Evaluations
  - D.2.4 Group 3 and Group 5 Kriging Evaluation
  - D.2.5 Group 6 New Brighton Municipal Well Regression Analysis
- D.3 Site C Analytical and Water Level Database

E TCAAP Well Inventory Update, FY 2007

F Site K, TGRS, and PGRS Operational Data
- F.1 Inspection and Maintenance Activities, Fiscal Year 2007, Site K, TCAAP
- F.2 Maintenance Activities, Fiscal Year 2007, TGRS, TCAAP
- F.3 Maintenance Activities by Location, Fiscal Year 2007, TGRS, TCAAP

G TGRS Chemical Data
- G.1 TGRS Extraction Wells – TRCLE Versus Time
- G.2 Influent/Effluent Database, Fiscal Year 2007, TGRS, TCAAP

H Operable Unit 3 Statistical Analysis

I Other Installation Restoration Activities During FY 2007

J Annual Site Inspection Checklist for Land Use Controls

List of Acronyms

Alliant	-	Alliant Techsystems Inc.
APR	-	Annual Performance Report
Army	-	United States Army
AWC	-	Area Weighted Concentration
Barr	-	Barr Engineering
BGRS	-	Boundary Groundwater Recovery System
COC	-	Chemical of Concern
CRA	-	Conestoga-Rovers & Associates, Inc.
DNAPL	-	Dense Non-Aqueous Phase Liquid
EE/CA	-	Engineering Evaluation/Cost Analysis
ERIS	-	Environmental Restoration Information System
EW	-	Extraction Well
FFA	-	Federal Facilities Agreement
FY	-	Fiscal Year
GAC	-	Granular Activated Carbon
GOS	-	TGRS Global Operation Strategy
gpm	-	gallons per minute
HRC	-	Hydrogen Release Compound
HRL	-	Health Risk Limits
IRA	-	Interim Remedial Action
IRP	-	Installation Restoration Program
LUC	-	Land Use Control
LUCIP	-	Land Use Control Implementation Plan
MCES	-	Metropolitan Council Environmental Services
MCLs	-	Maximum Contaminant Levels
MCLGs	-	Maximum Contaminant Level Goals
MDH	-	Minnesota Department of Health

List of Acronyms (Cont.)

MOS	-	TGRS Micro Operation Strategy
MPCA	-	Minnesota Pollution Control Agency
MW	-	Monitoring Well
NBCGRS	-	New Brighton Contaminated Groundwater Recovery System
NBM	-	New Brighton Municipal
O&M	-	Operation and Maintenance
OM	-	Operating Minimum
OS	-	TGRS Operating Strategy
OU	-	Operable Unit
OU1TG	-	OU1 Technical Group
PAR	-	Performance Assessment Report
PCBs	-	Polychlorinated Biphenyls
PGAC	-	Permanent Granular Activated Carbon
PGRS	-	Plume Groundwater Recovery System
PLC	-	Programmable Logic Controller
PM	-	Preventative Maintenance
POTW	-	Publicly-Owned Treatment Works
ppb	-	parts per billion
QAPP	-	Quality Assurance Project Plan
RD	-	Remedial Design
RD/RA	-	Remedial Design/Remedial Action
ROD	-	Records of Decision
scfm	-	Standard Cubic Feet per Minute
SDWA	-	Safe Drinking Water Act
SECOR	-	SECOR International, Inc.
Shaw	-	Shaw Environmental & Infrastructure, Inc. (formerly Stone & Webster)
SVE	-	Soil Vapor Extraction

List of Acronyms (Cont.)

SW	-	Surface Water
TCAAP	-	Twin Cities Army Ammunition Plant
Tecumseh	-	Tecumseh Professional Associates, Inc.
TGRS	-	TCAAP Groundwater Recovery System
TWISS	-	Tecumseh/Wenck Installation Support Services
µg/l	-	Micrograms per liter
USAEC	-	United States Army Environmental Center
USACHPPM	-	US Army Center for Health Promotion & Preventive Medicine
USEPA	-	United States Environmental Protection Agency
VOC	-	Volatile Organic Compound
Wenck	-	Wenck Associates, Inc.
WWP	-	Wet Well Pump

List of Chemical Abbreviations

Note: The abbreviations below are those that were required for data entry into the U.S. Army Environmental Center (USAEC) Installation Restoration Data Management Information System (IRDMIS), which was replaced by the USAEC Environmental Restoration Information System (ERIS) in November 2001. These abbreviations, though not used in ERIS, are still used in some tables and appendices presented in this report.

111TCE	-	1,1,1-Trichloroethane
112TCE	-	1,1,2-Trichloroethane
11DCE	-	1,1-Dichloroethene
11DCLE	-	1,1-Dichloroethane
12DCE	-	1,2-Dichloroethenes (*cis* and *trans* isomers)
12DCLB	-	1,2-Dichlorobenzene
12DCLE	-	1,2-Dichloroethane
12DCLP	-	1,2-Dichloropropane
13DCLB	-	1,3-Dichlorobenzene
14DCLB	-	1,4-Dichlorobenzene
2CLEVE	-	2-Chloroethyl vinyl ether
AG	-	Silver
BRDCLM	-	Bromodichloromethane
C12DCE	-	cis-1,2-Dichloroethene
C13DCP	-	cis-1,3-Dichloropropene
C2H3CL	-	Vinyl chloride
C2H5CL	-	Chloroethane
C6H6	-	Benzene
CCL3F	-	Trichlorofluoromethane
CCL4	-	Carbon tetrachloride
CH2CL2	-	Methylene chloride
CH3CL	-	Chloromethane
CHBR3	-	Bromoform

List of Chemical Abbreviations (Cont.)

CHCL3	-	Chloroform
CLC6H5	-	Chlorobenzene
CU	-	Copper
CYN	-	Cyanide
DBRCLM	-	Dibromochloromethane
EDTA	-	Ethylenediaminetetraacetic Acid
ETC6H5	-	Ethylbenzene
HG	-	Mercury
MEC6H5	-	Toluene
P4	-	Phosphorus
PB	-	Lead
SB	-	Antimony
T12DCE	-	trans-1,2-Dichloroethene
T13DCP	-	trans-1,3-Dichloropropene
TCLEA	-	Tetrachloroethane
TCLEE	-	Tetrachloroethene
TCLTFE	-	1,1,2-Trichloro-1,2,2-trifluoroethane
TRCLE	-	Trichloroethene
XYLEN	-	Xylenes
ZN	-	Zinc

1.0 Executive Summary

This Fiscal Year 2007 (FY 2007) Annual Performance Report:

- Summarizes the status of remedy implementation; and
- Addresses how the remedies are performing,

for each of the three operable units related to the Twin Cities Army Ammunition Plant (TCAAP). Fiscal Year 2007 is defined as the period from October 1, 2006 through September 30, 2007.

Records of Decision (RODs) have been signed for each of the three operable units (OUs):

- OU1 ROD signed 1993, Amended 2006
- OU2 ROD signed 1997, Amended (to include Site C-2) 2007
- OU3 ROD signed 1992, Amended 2006

The RODs present the major components of the final remedies for the media of concern. This report looks at each of the major components and addresses:

1. *Are the remedies being implemented? (Compliance check with the RODs and ROD Amendments)*
2. *Are the remedies doing what they are supposed to?*

Table 1-1, at the end of this section, summarizes the status of remedial actions at the end of FY 2007. Following are highlights of the accomplishments for each operable unit.

Operable Unit 1 (OU1): Deep Groundwater

OU1 consists of the "north" plume of Volatile Organic Compound (VOC) groundwater contamination off the TCAAP installation. The final remedy for OU1 consists of pumping three primary municipal wells (New Brighton Municipal wells NBM #4, #14, and #15) and treating the extracted groundwater through the Permanent Granular Activated Carbon (PGAC) system. Treated water is piped to the New Brighton water supply system for distribution as potable water. Other remedy components include providing alternate water supply and/or well abandonment to affected private wells, and drilling advisories for new well construction. Highlights for FY 2007 are:

- The Minnesota Department of Health (MDH) Special Well Construction Area remains in effect. The MDH has the regulatory responsibility to assure that wells constructed in the advisory area meet appropriate well construction and human health requirements. In FY 2007, there were no new recommendations for abandonment or alternate water supply needed.
- In 2006, the United States Environmental Protection Agency (USEPA) and the Minnesota Pollution Control Agency (MPCA) signed the OU1 ROD Amendment. The ROD amendment formalized the use of the statistical analysis of groundwater quality trends included in the Annual Performance Reports since FY 2003. The amended ROD requires demonstration of decreasing contaminant trends and a stable or shrinking geographic plume extent using the statistical analysis developed by the OU1 Technical Group (OU1TG) in 2003.

Highlights of the OU1 remediation activities are:

- The PGAC treated 1.44 billion gallons of water and removed 658 pounds of VOCs during FY 2007. Approximately 19,567 pounds of VOCs have been removed since system startup.

- The effluent of the PGAC was in compliance with the applicable Safe Drinking Water Act criteria for the OU1 chemicals of concern.
- The treated groundwater was beneficially used in the New Brighton and Fridley municipal water supply systems.
- The overall chemical monitoring data, using the statistical analysis as developed by the OU1TG, indicate that aquifer restoration is occurring and that the extent and magnitude of contamination in the Prairie du Chien aquifer are stable or improving. Jordan well 04J822, midway between the TGRS and NBCGRS, shows an increasing trend from 2005 through 2007. This well is in the central part of the plume and downgradient of the hot spot at well nest 04U847 to the northeast. The trend appears to suggest the hot spot is migrating to the southwest. The annual monitoring planned for this well through FY 2007 remains appropriate to further examine this trend.

Operable Unit 2 (OU2): On-Site Contamination

OU2 is defined as the original TCAAP property, including the groundwater beneath it. The OU2 ROD, signed in 1997, documents the final remedies. ROD Amendments and Explanations of Significant Differences (ESDs) are being prepared for individual sites within OU2. The ROD Amendments await resolution of land use controls related to the re-development portions of TCAAP.

Highlights for activities within OU2 during FY 2007 are:

- Shallow Soil Sites
  - Closeout Reports for Sites A (including VOC-contaminated soils), E, H, 129-3, 129-5, and 129-15 (which received regulatory approval prior to FY 2005) continued to await final consistency based on resolution of land use controls.
  - Except for Site H, groundwater monitoring at the shallow soil sites showed no contaminant concentrations of concern. FY 2007 was the last year (the final of

the required 5 years) of groundwater monitoring at these sites. Site H will continue to be monitored to address the copper detected.

- In FY 2004, the USEPA, MPCA, and United States Army (Army) agreed to incorporate the shallow groundwater response action at Site C into the TCAAP Federal Facilities Agreement (FFA). The groundwater contamination was an inadvertent result from a demonstration project for phytoremediation of soils. In 2007, an amendment to the Record of Decision (ROD) for Operable Unit 2 was signed. The amendment modified the soil, sediment, surface water, and groundwater remedies. The modified remedy included filling in the drainage ditches west and north of the Site to eliminate the surface water exposure points and cover contaminated sediment to prevent direct exposure. Construction was completed near the end of FY 2007 so FY 2008 will be the first year of operation under the modified remedy.
- In 2007, the groundwater extraction system extracted 684,480 gallons of groundwater and removed 0.18 pounds of lead. The total lead mass removed is 101.79 pounds. The monitoring requirements for demonstrating containment were met. A ROD Amendment was completed and construction is anticipated.

- Deep Soil Sites
  - The Site D Closeout Report received regulatory approval (in FY 2004), but final consistency will not be provided until concurrence of the land use control section of the report is reached between the Army and the regulators. A modification to the OU2 ROD documenting the remedy selection for Site D shallow soils was being prepared at the end of FY 2007.
  - Cover construction was completed over the Site G dump in early FY 2004. The Site G Closeout Report received regulatory approval (in FY 2004), but final consistency will not be provided until concurrence of the land use control section of the report is reached between the Army and the regulators.

A modification to the OU2 ROD documenting the remedy selection for Site G was being prepared at the end of FY 2007.

- Site A Shallow Groundwater
  - Four extraction wells continued to provide containment and mass removal.
  - The system pumped at an average rate of 16.9 gallons per minute (gpm), just above the 15 gpm target rate.
  - The system removed approximately 2.64 pounds of VOCs during FY 2007, with a cumulative mass removal of 52.42 pounds since system start-up on May 31, 1994.
  - The extracted water was discharged to the sanitary sewer system in compliance with all discharge criteria.
  - Overall, the groundwater extraction system has reduced contaminant concentrations in groundwater. The area where chemicals of concern exceed cleanup levels is between monitoring well 01U108 (source area) and 01U126 for tetrachloroethene, and at extraction well 01U352 for cis-1,2-dichloroethene.

- Site I Shallow Groundwater
  - Sampling at Site I indicated no significant changes in VOC concentrations in Unit 1 monitoring wells in FY 2007. USEPA requested monitoring four additional wells (01U632, 01U666, 01U667, and 01U668) during FY 2004; sampling has been completed for wells 01U632 and 01U667. Seven of the thirteen wells scheduled for sampling and hydraulic monitoring were dry.
  - A Five-Year Review was performed during FY 2004. The review concluded that the remedy was functioning as intended, and that the components of the remedy remain protective of human health and the environment.

- Site K Shallow Groundwater
  - At Site K, the groundwater extraction trench and treatment system continued to operate as designed. The system captured and treated 5,484,637 gallons of water and maintained a continuous zone of capture downgradient of Building 103. A total of 23.6 pounds of VOCs were removed in FY 2007.
  - The extracted water was treated and discharged to Rice Creek in compliance with all discharge criteria.
  - A Five-Year Review was performed during FY 2004. The review concluded that the remedy was functioning as intended, and that the components of the remedy remain protective of human health and the environment.

- Deep Groundwater
  - The TCAAP Groundwater Recovery System (TGRS) operated in accordance with the OU2 ROD.
  - The TGRS operated at a rate sufficient to support the conclusion that the 5 µg/l TRCLE contour is hydraulically contained. In FY 2007, the total extraction well water pumped averaged 1,799 gpm, greater than the Global Operation Strategy (GOS) Operating Minimum (OM) (1,745 gpm).
  - In FY 2007, the TGRS extracted and treated approximately 945,317,300 gallons of water. The mass of VOCs removed was 2,481 pounds and is slightly less than that achieved in FY 2006. The total VOC mass removed by the TGRS through FY 2007 is 196,965 pounds.
  - The TGRS Operating Strategy (OS) was approved by the regulatory agencies and finalized in FY 2003 with the latest modification (#3) implemented in 2004. The OS presents a GOS for the entire TGRS extraction system and a Micro Operation Strategy (MOS) for well groups.
  - Groundwater analytical data of the source area shows a general decrease in TRCLE concentration. This demonstrates that the TGRS is effectively removing VOC mass from the aquifer.

- Effluent VOC concentrations were below contaminant-specific requirements for all sampling events.

Operable Unit 3 (OU3): Deep Groundwater

- A ROD Amendment was finalized in 2006 that eliminates the requirement for groundwater extraction and treatment by the Plume Groundwater Recovery System (PGRS).
- Groundwater monitoring in FY 2007 was conducted during this annual event. Overall, the statistical evaluation showed the South Plume is decreasing in concentration at its center and stable at its edge. In addition, there is evidence of the North Plume commingling with the South Plume at the boundary between the two plumes.

Building 102 Groundwater Monitoring

Building 102 is not part of the OU2 ROD or Quality Assurance Project Plan (QAPP), so there are no specific requirements for the Site. Quarterly monitoring was started in June 2006 to begin creating a groundwater database on the Unit 1 VOC plume at Building 102. An Engineering Evaluation/Cost Analysis (EE/CA) was started in FY 2007, and the QAPP was finalized to address the monitoring and remedial requirements at this Site.

Voluntary Rice Creek Sampling

In FY 2007, the Army discontinued the voluntary monitoring of Rice Creek as it enters and leaves TCAAP. Sampling was conducted since before 1990. The purpose of this sampling was to establish a set of baseline data for Rice Creek. This objective was achieved to the Army's satisfaction. There were no data of concern resulting from this sampling effort.

Table 1-1

Status of Remedial Actions: FY 2007

Remedy Component	Is the component being implemented?	Is the component doing what it is supposed to?	Has the component undergone final closeout?	Comments
Operable Unit 1: Deep Groundwater				
#1: Alternate Water Supply/Well Abandonment	Yes	Yes	No	
#2: Drilling Advisories	Yes	Yes	No	
#3: Extracting Groundwater from the North Plume using the NBCGRS	Yes	Yes	No	Consistent with 2006 ROD Amendment
#4: Removal of VOCs by GAC (Discharge Quality)	Yes	Yes	No	
#5: Discharge of Treated Water	Yes	Yes	No	
#6: Groundwater Monitoring	Yes	Yes	No	
Overall Remedy	Yes	Yes	No	
Operable Unit 2: Shallow Soil Sites				
#1-7: Soil Remediation				
Site A	Yes	Yes	Partially	Closeout Report for metals was partially approved; however, see Note 1 at the end of the OU2 section of this table. See OU2 Site A Shallow Groundwater (below) for status on VOC soils.
Site C	Yes	Partially	No	The system is operating under the existing agreements with the MPCA. A ROD amendment to include the groundwater remediation under OU2 was signed in July 2007. Remedy construction (filling the ditches) was completed in late FY 2007. The Monitoring and Contingeny plan will be revised in FY2008
Site E	Yes	Yes	Partially	Closeout Report was partially approved; however, see Note 1 at the end of the OU2 section of this table.

Table 1-1 (continued)

Status of Remedial Actions: FY 2007

Remedy Component	Is the component being implemented?	Is the component doing what it is supposed to?	Has the component undergone final closeout?	Comments
Operable Unit 2: Shallow Soil Sites (continued)				
#1-7: Soil Remediation (continued)				
Site H	Yes	Yes	Partially	Closeout Report was partially approved; however, see Note 1 at the end of the OU2 section of this table.
Site 129-3	Yes	Yes	Partially	Closeout Report was partially approved; however, see Note 1 at the end of the OU2 section of this table.
Site 129-5	Yes	Yes	Partially	Closeout Report was partially approved; however, see Note 1 at the end of the OU2 section of this table.
#8: Groundwater Monitoring	Yes	Yes	No	The 5-year monitoring ended in FY 2007. Site H monitoring to continue to address copper
#9: Characterization of Dumps:				
Site B	Yes	Yes	Yes	
Site 129-15	Yes	Yes	Partially	Closeout Report was partially approved in FY 2003; however, see Note 1 at the end of the OU2 section of this table. A modification to the ROD was being prepared at end of FY 2004.
Overall Remedy	Yes	Yes	Partially	

<u>Note 1:</u> Closeout report has been approved, but final consistency will not be provided until concurrence on the land use control section of the report has been reached between the Army and the regulators.

Table 1-1 (continued)

Status of Remedial Actions: FY 2007

Remedy Component	Is the component being implemented?	Is the component doing what it is supposed to?	Has the component undergone final closeout?	Comments
Operable Unit 2: Deep Soil Sites				
#1: Groundwater Monitoring	Yes	Yes	No	
#2: Restrict Site Access	Yes	Yes	No	
#3: SVE Systems (Deep)	NA	NA	Partially	Deep SVE systems will not be required at Sites D or G. The Site D VOC Closeout Report received consistency in FY 2002. The Site G VOC Closeout Report is in progress.
#4: Enhancements to SVE Systems	NA	NA	Yes	Neither system required operation with enhancements. The Site D SVE system was dismantled in FY 2001. The Site G SVE was dismantled in FY 2003.
#5: Maintain Existing Site Caps	Yes	Yes	No	
#6: Maintain Surface Drainage Controls	Yes	Yes	No	
#7: Characterize Shallow Soils and Dump	Yes	Partially	No	For Site D and G, a Closeout Report and a modification to the ROD were under review at the end of FY 2007. For Site G, cover construction was completed in FY 2004.
Overall Remedy	Yes	Yes	No	

Table 1-1 (continued)

Status of Remedial Actions: FY 2007

Remedy Component		Is the component being implemented?	Is the component doing what it is supposed to?	Has the component undergone final closeout?	Comments
Operable Unit 2: Site A Shallow Groundwater					
#1:	Groundwater Monitoring	Yes	Yes	No	
#2:	Groundwater Containment/Mass Removal	Yes	Yes	No	Subject to ten year review in FY2008
#3:	Drilling Advisory/Alternate Water Supply/Well Abandonment	Yes	Yes	No	
#4:	Discharge of Extracted Water	Yes	Yes	No	
#5:	Source Characterization/Remediation	Yes	Yes	No	SVE system operation was ceased near the end of FY 2002, due to minimal VOC removal rates. In FY 2003, a work plan to excavate the contaminated soil received regulatory approval. The SVE system was removed and 688 cubic yards of contaminated soil were excavated and transported off-site for disposal. A Closeout Report for the Former 1945 Trench soils received regulatory approval in FY 2004.
Overall Remedy		Yes	Yes	No	

Table 1-1 (continued)

Status of Remedial Actions: FY 2007

Remedy Component	Is the component being implemented?	Is the component doing what it is supposed to?	Has the component undergone final closeout?	Comments
Operable Unit 2: Site I Shallow Groundwater				
#1: Groundwater Monitoring	Yes	Yes	No	
#2: Groundwater Extraction	No	No	No	Pilot study determined that extraction remedies are not feasible. An amendment to the OU2 ROD is being pursued to change to a monitoring based remedy.
#3: POTW Discharge	No	No	No	See above.
#4: Additional Investigation	NA	NA	No	See above.
Overall Remedy	NA	NA	No	See above.
Operable Unit 2: Site K Shallow Groundwater				
#1: Groundwater Monitoring	Yes	Yes	No	
#2: Sentinel Wells	Yes	Yes	NA	
#3: Hydraulic Containment	Yes	Yes	No	
#4: Groundwater Treatment	Yes	Yes	No	
#5: Treated Water Discharge	Yes	Yes	No	
#6: Discharge Monitoring	Yes	Yes	No	
#7: Additional Investigation	Yes	Yes	Yes	Well 03U621 was added as a sentinel well and is sampled annually, as listed in the monitoring plan
Overall Remedy	Yes	Yes	No	

Table 1-1 (continued)

Status of Remedial Actions: FY 2007

Remedy Component	Is the component being implemented?	Is the component doing what it is supposed to?	Has the component undergone final closeout?	Comments
Operable Unit 2: Deep Groundwater				
#1: Hydraulic Containment and Contaminant Mass Removal	Yes	Yes	No	
#2: Groundwater Treatment	Yes	Yes	No	
#3: Treated Water Discharge	Yes	Yes	No	
#4: Institutional Controls	Yes	Yes	No	
#5: Review of New Technologies	Yes	Yes	No	
#6: Groundwater Monitoring	Yes	Yes	No	
Overall Remedy	Yes	Yes	No	
Operable Unit 3: Deep Groundwater				
#1: Monitored Natural Attenuation	Yes	Yes	No	
#2: Groundwater Monitoring	Yes	Yes	No	
#3: Drilling Advisories	Yes	Yes	No	
Overall Remedy	Yes	Yes	No	

2.0 Introduction

2.1 PURPOSE

This Fiscal Year 2007 Annual Performance Report is intended to:

- Summarize the status of remedy implementation; and
- Address how the remedies are doing,

for remedial actions at the New Brighton/Arden Hills Superfund Site. Fiscal Year 2007 (FY 2007) extended from October 1, 2006 through September 30, 2007.

For purposes of remediation, the areas contaminated by activities at TCAAP have been divided into three areas designated "Operable Units." Operable Unit 1 (OU1) encompasses the deep groundwater "North Plume" of off-TCAAP contaminated groundwater. Operable Unit 2 (OU2) includes all soil, sediment, and groundwater contamination on the original TCAAP property. OU2 also includes the shallow Site A plume that extends off the north end of TCAAP in the Unit 1 aquifer. Operable Unit 3 (OU3) consists of the deep groundwater "South Plume" of off-TCAAP contaminated groundwater.

The report addresses remedial actions for the following media as prescribed in the Record of Decision (ROD) for each Operable Unit:

- Operable Unit 1
  - Deep Groundwater

- Operable Unit 2
  - Shallow Soil Sites
  - Deep Soil Sites
  - Site A Shallow Groundwater
  - Site C-2 Shallow Groundwater
  - Site I Shallow Groundwater
  - Site K Shallow Groundwater
  - Deep Groundwater

- Operable Unit 3
  - Deep Groundwater

In 2007, an amendment to the Record of Decision (ROD) for Operable Unit 2 of the Twin Cities Army Ammunition Plant (TCAAP) was signed. The Amendment modified the soil, sediment, surface water, and groundwater remedies for Site C-2 (Site) on TCAAP. The modified remedy included filling in the drainage ditches west and north of the Site to eliminate the surface water exposure points and cover contaminated sediment to prevent direct exposure.

Monitoring activities and submittal of this report are in fulfillment of the Federal Facilities Agreement (FFA) signed August 12, 1987, between the United States Army (Army), United States Environmental Protection Agency (USEPA), and Minnesota Pollution Control Agency (MPCA). These parties agreed to minor modifications to the FFA on:

- October 12, 1990
- February 5, 1992
- March 3, 1992
- November 23, 1993
- January 9, 1998
- May 12, 1998
- June 30, 1998

The requirements have been fulfilled for FFA Attachment 2 (Interim Remedial Actions), Attachment 3 (Remedial Investigation), and Attachment 4 (Feasibility Study). Activities are now geared towards fulfilling the requirements of FFA Attachment 5 (Remedial Design and Remedial Action).

Assessment of performance is answered with two questions:

1. *Are all of the remedies being implemented? (Compliance check with the RODs)*
2. *Are the remedies doing what they are supposed to?*

To address these two questions, this report is broken into the three Operable Units. Using each ROD, the report is broken down to the major components of the selected remedy for each of the media described previously. Performance standards are then presented for each of the major remedy components. The performance standards are the "what they are supposed to" part of the question, "Are the remedies doing what they are supposed to?" The performance standards are the yardstick against which performance is measured, and are used to determine when a remedy component has been successfully implemented and/or completed.

For some of the remedy components, the performance standards are clearly defined in the RODs (e.g., soil or groundwater cleanup levels). For other remedy components (e.g., alternate water supply) the performance standards are less clear in the RODs, but may have been agreed to through Work Plans or design documents.

With the performance standards identified, this report then addresses the two questions described above, often through a series of sub-questions. The questions are written in the text in an attempt to make the report focused, streamlined, and user friendly. To the extent possible, answers are in the form of pictures (figures, graphs, etc.) versus words.

In addition to the performance evaluation, another objective of making the report focused is to make the monitoring program focused and efficient. With specific questions identified, it is

easier to develop the monitoring needs. In addition to reporting on FY 2007, this document presents proposed monitoring for future years (Appendix A). Monitoring locations or frequencies that are new in this year's report are shown in red color. The monitoring plan shows FY 2007 through FY 2011. The FY 2007 monitoring plan indicates the work that generated the results presented in this report. The monitoring plan covers a moving 5-year time span (i.e., next year FY 2007 will drop off and FY 2012 will be added).

This report represents the collaboration of work performed by the Army and Alliant Techsystems Inc. (Alliant). On behalf of the Army, Wenck Associates, Inc. (Wenck) prepared Sections 2.0 through 7.0, 12.0 and 13.0 of this report. On behalf of Alliant, SECOR International, Inc. (SECOR) prepared Sections 8.0 and 9.0, and Conestoga-Rovers & Associates, Inc. (CRA) prepared Sections 10.0 and 11.0. Wenck, SECOR, and CRA all contributed to Section 1.0.

2.2 SITE DESCRIPTION

The Twin Cities Army Ammunition Plant is a government-owned facility located in the northern portion of the Minneapolis – St. Paul metropolitan area, in Ramsey County, and is surrounded by the cities of New Brighton, Arden Hills, Mounds View, and Shoreview, Minnesota (Figure 2-1). For purposes of the TCAAP restoration program, the facility occupied approximately a four square mile area (approximately 2,370 acres) immediately east of U.S. Interstate Highway 35W and north of Ramsey County Highway 96 (i.e., this was the original TCAAP boundary). Alliant has been the prime tenant on the installation; however, they discontinued manufacturing operations at TCAAP in 2004. Wenck was the contracted operator for FY 2007.

TCAAP was constructed between August 1941 and January 1943, and formerly included 323 buildings with associated utilities and services to support production activities. TCAAP produced small-caliber ammunition and related materials, proof-tested small-caliber ammunition and items as required, and handled/stored strategic and critical materials for other government agencies. Production began in 1941 and then alternated between periods of activity and standby.

The size of TCAAP has periodically shrunk as a result of property transfers. Most recently, between 2000 and 2002, approximately 1,521 acres were reassigned to the National Guard Bureau. Approximately 750 acres of the original TCAAP have been determined to be surplus to the needs of the federal government and are in the process of being transferred out of federal control.

During periods of activity, solvents were utilized as part of the manufacturing process. Disposal of solvents and other wastes at the TCAAP site resulted in soil contamination and also groundwater contamination, which has migrated beyond the site boundary. Groundwater contamination was first discovered in July 1981, and the site was placed on the National Priorities List (NPL) in 1983.

A number of known and potential contaminant source areas have been identified on the TCAAP property: Sites A, B, C, D, E, F, G, H, I, J, K, 129-3, 129-5, and 129-15 (see Figure 2-2 for locations). Site F was remediated and Site J was determined not to have a release prior to the 1997 OU2 ROD, while the remaining sites are addressed in the OU2 ROD. Surface water and sediment on TCAAP are being addressed separately from the OU2 ROD.

Five other sites (the Grenade Range, the Outdoor Firing Range, the Trap Range, and the 135 and 535 Primer/Tracer Areas) are being addressed as Removal Actions separate from the OU2 ROD.

2.3 HYDROGEOLOGIC UNITS AND WELL NOMENCLATURE

On- and off-post wells have been installed in four hydrogeologic units beneath the site: Unit 1 through Unit 4. Descriptions of these four units are presented in Appendix B, along with a description of the nomenclature system used for well designations (e.g., 03U704). A well-designation cross-reference guide (sorted two different ways) is included in Tables B-1 and B-2 in Appendix B. The well index lists wells of concern, including the TCAAP designation, Minnesota unique number, and any other name(s) the wells may have. Locations of wells that are

included in the TCAAP monitoring plan are shown on Figure B-2 (off-TCAAP wells) and Figure B-3 (on-TCAAP wells) in Appendix B (on the included CD). With a known well name, the location of that well can be determined using the "Edit, Find" or "Edit, Search" function and typing in the well name, which will highlight the desired well name on the figure. Available well logs can be viewed by selecting the well of interest in Table B-3 (on-TCAAP wells) and Table B-4 (off-TCAAP wells) in Appendix B (click on the well name with the mouse).

See the instructions on the attached CD for more information on using Appendix B.

2.4 DATA COLLECTION, MANAGEMENT, AND PRESENTATION

Performance monitoring data was collected in accordance with the:

- FY 2007 Monitoring Plan for Groundwater Monitoring Wells
- FY 2007 Monitoring Plan for Remedial Treatment Systems
- FY 2007 Monitoring Plan for Surface Water
- New Brighton Water System Sampling and Analysis Plan

Data was collected principally by four parties: Wenck on behalf of the Army, SECOR, and CRA on behalf of Alliant, and Barr Engineering (Barr) on behalf of the City of New Brighton. Appendix C presents information on data collection, management, and presentation. Tables showing FY 2007 data are presented following the text at the end of each section in which it is referenced. The comprehensive groundwater level and groundwater quality databases from 1987 to present are contained in Appendix D.1. Groundwater quality trend graphs for the primary chemical of concern (trichloroethene) can be viewed by selecting the well of interest on Figure B-2 (off-TCAAP wells) and B-3 (on-TCAAP wells) in Appendix B (click on the well name with the mouse). The trend graphs for Site A also include tetrachloroethene and cis-1,2-dichloroethene, in addition to trichloroethene.

Is the data complete and representative (are we making decisions based on complete and technically-sound information)?

Yes. The data was collected in accordance with the FY 2007 Monitoring Plan. Data was collected, assessed, and validated in accordance with the "Quality Assurance Project Plan for Performance Monitoring, Revision 3, December 10, 2003, (TWISS, 2003).

The data tables in the various report sections and the comprehensive water quality databases (Appendix D.1) show the data qualifiers and flagging codes that were assigned to the data as a result of data assessment/validation. The data qualifiers and flagging codes applied to FY 2007 data are explained in footnotes on the data tables in the various report sections. Data assessments (performed on 100 percent of the data) and "full validation" (performed on at least 10 percent of the data) were provided to the USEPA and MPCA in submittals during FY 2007. USEPA and MPCA approval letters for these submittals are included in Appendix C.3.

With regard to completeness, Appendix C.2 summarizes a few minor deviations from the FY 2007 Monitoring Plan. The completeness goals are the same in both the 1996 and 2003 Quality Assurance Project Plans (QAPPs). Field completeness for FY 2007 was 100% and laboratory completeness was 100% (wells that were dry or inoperative were not considered as missed samples), meeting the QAPP completeness goal of 95%. Field duplicates, equipment rinse blanks, and matrix spike/matrix spike duplicates were collected at overall frequencies of exceeding the QAPP-specified frequencies of 10%, 10%, and 5%, respectively. For the subset of metals analyses, matrix spike/matrix spike duplicates were collected at an overall frequency of 10.4%, also meeting the QAPP-specified frequency. Data validation was performed on 23.6% of the data, exceeding the QAPP-specified requirement of 10%. No problems with analytical procedures/reporting were identified in the data validations.

The 2003 QAPP additionally identified critical samples and set a completeness goal of 100%. The critical samples are: TGRS effluent, Site K effluent, and well inventory sampling. These were all complete in FY 2007.

The data for FY 2007 is deemed to be representative and meet data quality objectives based on: 1) adherence to QAPP-specified sampling and laboratory analytical procedures; 2) completion of data assessments and data validation; and 3) comparability to historical results (any substantial deviations from historical/anticipated results are discussed within the site-specific sections of this report).

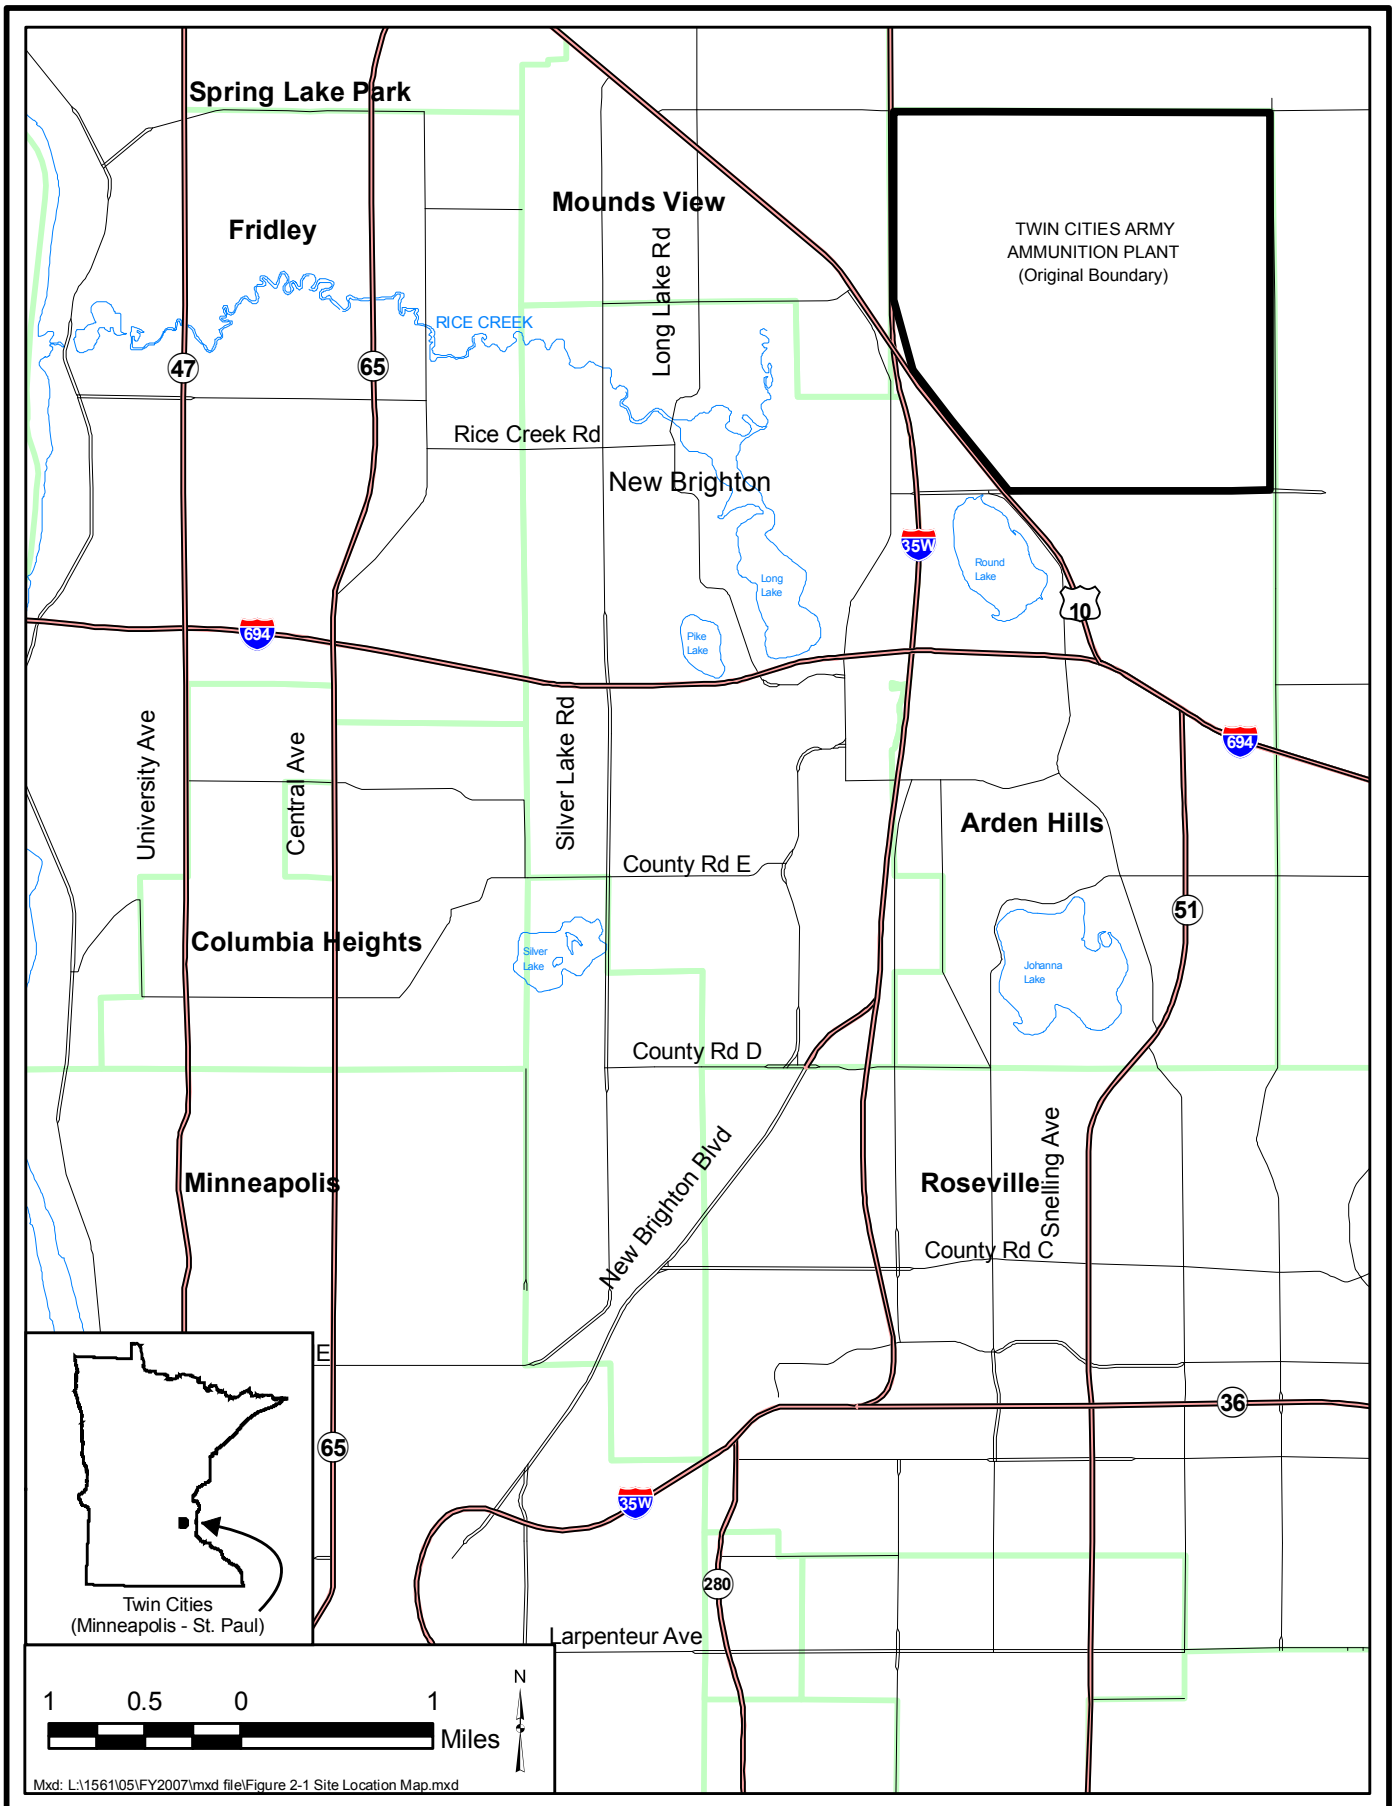

TWIN CITIES ARMY AMMUNITION PLANT

Site Location Map

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 2-1

TWIN CITIES ARMY AMMUNTION PLANT

TCAAP Site Boundaries

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 2-2

3.0 Operable Unit 1: Deep Groundwater

The reference for the OU1 ROD is:

RECORD OF DECISION
Groundwater Remediation
Operable Unit 1
At New Brighton/Arden Hills Superfund Site
1993, Amended 2006

The 2006 ROD amendment formalized the adoption of the statistical analysis of groundwater quality presented in the Annual Performance Reports since FY 2003.

Following are the six primary elements of the amended ROD, with the changed elements shown in italics:

1. Providing alternate water supplies to residents with private wells within the North Plume.

2. Implementing drilling advisories that would regulate the installation of new private wells within the North Plume as a Special Well Construction Area.

3. *Extracting groundwater from the North Plume using the New Brighton Contaminated Groundwater Recovery System (NBCGRS), subject to the following:*

   a. the initial aggregate groundwater extraction rate shall be consistent with the long-term operating history of the NBCGRS;

   b. future decreases in the aggregate extraction rate shall be determined by the Army, USEPA, and MPCA using a transparent public process and rational

engineering, scientific, and economic analyses at least as rigorous as those employed in the feasibility study that was the basis for the original remedy selection;

c. future changes to the aggregate or individual well extraction rates shall be made so as to assure that the rate of restoration of the aquifer will not be slowed or result in a duration of remedy longer than was contemplated by the original ROD;

d. the facilities comprising the NBCGRS may be modified as necessary to assure the restoration of the full areal and vertical extent of the aquifer in a timeframe as contemplated in 3.c, above.

4. Pumping the extracted groundwater to the PGAC Water Treatment Facility in New Brighton for removal of VOCs by a pressurized granular activated carbon (GAC) system.

5. Discharging all of the treated water to the New Brighton municipal distribution system.

6. *Monitoring the groundwater to verify effectiveness of the remedy through measurement of overall plume shrinkage (geographically) and decreasing contaminant concentrations*.

The last requirement (No. 6) will be met by evaluating the groundwater chemical data according to statistical methods contained in the "OU1 Technical Group Technical Memorandum Statistical Evaluation Method For Water Quality Data, Operable Unit 1", dated December 2004 (and any subsequent addendums or revisions approved by the USEPA and MPCA). The statistical analysis will be conducted annually and will be reported in the Annual Performance Reports.

Groundwater containment is provided by three primary municipal wells: New Brighton Municipal (NBM) #4, #14, and #15. NBM #3, which is located next to NBM #4, also contributes to containment, especially when one of the other three wells is off. The extracted water is treated in the Permanent Granular Activated Carbon (PGAC) treatment facility for removal of VOCs, and is then used as part of the municipal water supply. NBM #3 and #4 were pre-existing wells. NBM #14 and NBM #15 began pumping in December 1996 and March 1998, respectively.

The remedy also relies on institutional controls (drilling advisory, alternate water supply, and well abandonment) to manage risks, including downgradient of the containment system.

Section 1.4 of the ROD prescribes six major components of the remedy, which are described and evaluated in the following sections.

3.1 REMEDY COMPONENT #1: ALTERNATE WATER SUPPLY/WELL ABANDONMENT

Description: "Providing an alternative water supply to residents with private wells within the North Plume." (OU1 ROD, page 2)

- Clarified by the OU1 Alternate Water Supply Plan (Montgomery Watson, October 1995) to delete "residents with" since the remedy applies to other wells in addition to residential wells. This plan also identifies the criteria for determining what wells are eligible for an alternate water supply.
- Clarified by the OU1 Alternate Water Supply Plan to also include well abandonment.
- Clarified by the OU1 Alternate Water Supply Plan (page i-2) to also encompass OU3 and the OU2 Site A shallow groundwater plume.

Additional information on the well inventory is presented in Appendix E.

Performance Standard (how do you know when you're done):

- For alternate water supply, when the owners of all wells that meet all of the following criteria have been offered and provided with an alternate water supply (or when the well owners have rejected the offers):

    i. The well is located within the area affected by groundwater plumes that originate at TCAAP, as shown on Figures E-2 and E-3; and
    ii. The well is completed in an affected aquifer; and
    iii. The well contains detectable concentrations of the TCAAP-related chemicals of concern identified on page 18 of the OU1 ROD (or page 26 of the OU3 ROD, or Table 1 of the OU2 ROD, as appropriate for the well location); and
    iv. The well is used in a manner to cause exposure (uses are defined in the Alternate Water Supply Plan); and
    v. The well owner does not already have an alternate water supply.

    If eligible well owners refuse the offer to have an alternate water supply provided, this also satisfies the performance standard.

- For well abandonment, when the owners of all wells that meet all of the following criteria have been offered and provided abandonment (or when the well owners have rejected the offers):

    i. The well is located within the area affected by groundwater plumes that originate at TCAAP; and
    ii. The well is completed in an affected aquifer; and
    iii. The well contains detectable concentrations of the TCAAP-related chemicals of concern identified on page 18 of the OU1 ROD (or page 26

of the OU3 ROD, or Table 1 of the OU2 ROD, as appropriate for the well location); and

iv. The well was constructed prior to the MDH Special Well Construction Area advisory; and

v. The well is being used by the well owner or use was discontinued due to contamination; and

vi. The well is used in a manner to cause exposure (uses are defined in the Alternate Water Supply Plan).

If eligible well owners refuse the offer for abandonment, this also satisfies the performance standard. An exception to abandonment would be if the well is needed for groundwater monitoring.

Is this remedy component being implemented?

Yes. The Alternate Water Supply and Well Abandonment Program has been implemented and is an ongoing program maintained by the Army. The process of identifying wells eligible for alternate water supply and/or abandonment is accomplished by maintaining a "well inventory." The well inventory is a database that was initially developed in 1992, and which has been periodically updated since then. For the purposes of the well inventory, a study area was established which encompasses the groundwater plume (the study area boundary is the same as the MDH Special Well Construction Area). The well inventory is intended to include all wells within the study area. Within the study area, areas of concern are defined by the edge of the groundwater plume, plus additional buffer area. The wells are grouped into categories based on factors such as location relative to the area of concern, type of use, active/non-active status, sealed, etc. Wells in categories with the potential to be impacted are periodically sampled to see if they qualify for alternate water supply and/or abandonment.

Thus, maintenance of the well inventory consists of the following tasks:

1. Check if the area of concern needs to be adjusted based on the extent of contamination,
2. Check if there are any previously unknown wells to be added to the database (in coordination with the MDH as described in Appendix E),
3. Sample wells on a prescribed schedule,
4. Take the appropriate course of action depending on the results,
5. Update the well inventory database with any new information (e.g., water quality results, owner information, construction information, well re-categorizing),
6. Report findings through the Annual Performance Report.

The following questions and answers summarize developments since the last Annual Performance Report with respect to Operable Unit 1.

Did the area of concern within OU1 change during FY 2007, as defined by the 1 µg/l contour line?

No. There was a comprehensive sampling round conducted in FY 2007. The 1 µg/l contour line remained essentially the same as in FY 2005, which was the last comprehensive sampling round (see Figure 3-1).

Were any additional water supply wells discovered within the area of concern for OU1 that are completed within an aquifer of concern?

No (see Appendix E for additional information).

Were any water supply wells within the area of concern for OU1 sampled during FY 2007 (outside of those included in the OU1 performance monitoring plan)? If yes, what were the findings? No

Were any well owners offered an alternate water supply and/or well abandonment during FY 2007? No.

For OU1, are there any well owners that meet the criteria, but have not yet been provided an alternate water supply? No.

For OU1, are there any wells that meet the criteria, but have not yet been abandoned? No.

Is any sampling of water supply wells (excluding those included in the OU1 performance monitoring plan) proposed prior to the next report?
No. FY 2008 is a non-sampling event for well inventory wells as shown in Appendix A.1. The next major event is in FY 2009.

Are there any changes or additional actions required for this remedy component? No.

3.2 REMEDY COMPONENT #2: DRILLING ADVISORIES

Description: "Implementing drilling advisories that would regulate the installation of new private wells within the North Plume as a Special Well Construction Area." (OU1 ROD, page 2)

Performance Standard (how do you know when you're done):
When the MDH has issued a Special Well Construction Area Advisory.

Has the MDH issued a Special Well Construction Area Advisory?
Yes. It was issued in June 1996. In addition to covering OU1, the Special Well Construction Area also encompasses OU3 and the OU2 Site A shallow groundwater plume. In June 1999, the MPCA requested that the MDH extend the boundary of the Special Well Construction Area further to the southwest to the Mississippi River and Marshall Avenue to ensure that the southern

boundary fully encompassed the plume. The MDH revised the Special Well Construction Area in December 1999. The current boundary is shown on Figure E-1 (Appendix E).

Are any changes or additional actions required for this remedy component? No.

3.3 REMEDY COMPONENT #3: GROUNDWATER RECOVERY

Description: "Extracting groundwater at the containment boundary in the North Plume near County Road E." (OU1 ROD, page 2)

- This remedy component consists of recovering deep (Unit 4) groundwater using three City of New Brighton municipal wells: NBM #4, #14, and #15. New Brighton municipal well #4 (NBM #4) was an existing well completed in both the Prairie du Chien and Jordan. NBM #14 and NBM #15 were constructed in the Prairie du Chien as part of the remedy and began pumping in December 1996 and March 1998, respectively. The locations of the three recovery wells are shown on Figure 3-1.
- NBM #3 has been designated as an alternate containment/production well for times when one of the three primary wells is not in operation. NBM #5 and NBM #6 are considered secondary alternates.

The extracted groundwater is used as part of the New Brighton water supply system, and as such, New Brighton took the lead on design and construction of the system, and is responsible for operation of the system. New Brighton contracted Barr Engineering to provide design and construction oversight services. The Army is paying for the OU1 remedy.

Performance Standard (how do you know when you're done):

When the NBCGRS is operating consistent with long term NBCGRS operating rates.

During FY 2007, did the OU1 extraction system operate according to the New Brighton operational plan and consistent with past operations?

Yes. The NBCGRS is operated by the City of New Brighton according to an operational plan designed to meet both municipal water needs and the remediation needs. Following is a discussion of the NBCGRS operation in FY 2007:

Pumping Rates

Table 3-1 presents the monthly pumping volumes for each extraction well and Figure 3-2 illustrates the average monthly pumping rate targets and actual monthly volumes pumped for NBM #3/4, #15, and #14 (west to east order). The pumping targets were derived by Barr Engineering (Barr) based on their Final Conceptual Design Report, Containment/Production Wells (Barr, 1995). The operating system devised by Barr includes different operational conditions (named A thru G), which were designed to respond to maintenance issues by altering the target rates at each extraction well. Condition A is the normal operating condition for when NBM #4, #14, and #15 are all in operation, and has pumping targets (lower limits) of 1.19, 0.99, and 0.99 million gallons per day, respectively. Conditions B through F have different pumping targets for when different wells are out of service (e.g., a pumping target for NBM #3 is added whenever NBM #4, #14, or #15 are out of service, and pumping targets for NBM #5 and #6 are added whenever both NBM #3 and #4 are out of service). Condition G is unique from the other conditions because it does not have a pumping target (i.e., the targets for all wells are zero). Condition G primarily applies during carbon change-outs for the GAC treatment system. Hence, the daily pumping targets can vary depending on what operating condition the system is in. The targets depicted on Figure 3-2 represent a collective or cumulative monthly target based on the daily operating conditions.

For FY 2007, the New Brighton Contaminated Groundwater Recovery System (NBCGRS) was in the normal operating condition (Condition A) approximately 63 percent of the time. The

system was in Condition G (primarily for carbon change-outs) for 14 percent of the time, and Condition B the remaining 23 percent of the time.

Figure 3-2 indicates that the NBCGRS wells, substantially, exceeded the monthly targets in all months during FY 2007. The total NBCGRS pumping volume for FY 2007 of 1.44 billion gallons, the average monthly pumping volume (if pumping was at a uniform rate) would be about 120 million gallons. Compared with the typical monthly pumping target of about 100 million gallons (for the normal operating condition), it is clear that the NBCGRS pumped substantially more than the minimum target rate.

The overall adherence to the pumping targets supports the interpretation that the extraction system is operating in compliance with the amended ROD and is providing substantial containment in the Prairie du Chien by maintaining the historical pumping rates at the NBCGRS.

Extraction Well Water Quality

Trend graphs for trichloroethene in NBM #3, #4, #14, and #15 are shown on Figure 3-4. At both NBM #3 and NBM #4, trichloroethene decreased dramatically between 1991 and 1998, and has been relatively stable since then. The shorter term stability needs to be observed in the context of the overall plume behavior discussed in Section 3.7.

Water Level Contour Analysis

Table 3-2 presents the groundwater elevations measured during FY 2007. Figure 3-3 presents the groundwater elevation contours and an estimate of the capture zone created.

NBCGRS VOC Mass Removal

NBCGRS VOC mass removal is shown on Figure 3-12. The trend in mass removal rate has been downward through approximately 2004 and fairly stable since then.

Monitoring Well Water Quality

As discussed above, the OU1TG developed and reported a method for analyzing groundwater quality trends over time. Section 3.7 below, presents a discussion of the statistical analysis and presents the FY 2007 monitoring well data.

Are any changes or additional actions required for this remedy component?

Potential changes and/or additional actions will be addressed through the ROD modification process discussed previously.

3.4 REMEDY COMPONENT #4: REMOVAL OF VOCS BY GAC

Description: "Pumping the extracted groundwater to the Permanent Granular Activated Carbon (PGAC) Water Treatment Facility in New Brighton for removal of VOCs by a pressurized GAC system." (OU1 ROD, page 2)

- Treatment by the PGAC (along with iron and manganese removal and chlorination) makes the recovered groundwater suitable for municipal drinking water purposes. The PGAC is located approximately one-third mile south of Interstate 694 near Silver Lake Road. The City of New Brighton is responsible for operation and maintenance of the PGAC, with cost reimbursement from the Army for the operations related to the remedy.

Performance Standard (how do you know when you're done):

When the treated water meets the Maximum Contaminant Levels (MCLs) and non-zero Maximum Contaminant Level Goals (MCLGs) established by the Safe Drinking Water Act (SDWA) for the chemicals of concern, as identified on page 18 of the OU1 ROD.

Did the treated water meet the MCLs and non-zero MCLGs established by the SDWA for the OU1 chemicals of concern?

Yes. Table 3-3 shows that the PGAC effluent met the performance standard during FY 2007.

Each of the 8 pairs of GAC Contractors (labeled A and B) is normally run in series (i.e., water passes through A then B, or B then A, depending on whether the most recent carbon change-out was the A or B vessel). The sampling data is not from a combined effluent after the GAC vessels; instead, it is from sampling ports between the lead and lag GAC vessel *and/or* after the lag GAC vessel for each of the 8 GAC vessel pairs in the PGAC. The sampling between the lead and lag vessels is performed every month and determines when breakthrough of the lead GAC vessels has occurred. When there are no contaminant detections between the lead and lag vessels, there is no reason to sample after the lag vessels. When breakthrough of a lead vessel has occurred, a carbon change-out of all 8 lead vessels is scheduled. Until the change-out occurs, monthly samples are collected after each lag vessel (in addition to the monthly between-vessel samples) to ensure that water leaving the PGAC meets the treatment requirements. When the carbon change-out of the lead vessels is completed, the lead vessels are switched to the lag position and vice versa. Monthly sampling then reverts to only between the lead and lag vessels until a contaminant detection occurs, whereupon the process repeats.

Table 3-3 shows that two carbon change-outs occurred in FY 2007: one in October and one in November. Both were triggered by breakthrough detections. The sampling results that represent PGAC effluent water quality are highlighted in Table 3-3 for ease of viewing the compliance portion of the data.

Is any sampling of the treated water proposed prior to the next report?

Yes. Sampling will continue to be performed by the City of New Brighton or their contractor.

Are any changes or additional actions required for this remedy component? No.

3.5 REMEDY COMPONENT #5: DISCHARGE OF TREATED WATER

Description: "Discharging all of the treated water to the New Brighton municipal distribution system." (OU1 ROD, page 2)

Performance Standard (how do you know when you're done):
When the connection to the New Brighton municipal supply system has been completed and water is being discharged.

Is the treated water being discharged to the New Brighton municipal distribution system?
Yes.

Are any changes or additional actions required for this remedy component? No.

3.6 REMEDY COMPONENT #6: GROUNDWATER MONITORING

Description: "Monitoring the groundwater to verify the effectiveness of the remedy." (OU1 ROD, page 2)

Performance Standard (how do you know when you're done):
When a performance groundwater monitoring program has been established and ongoing monitoring is in compliance with the program.

Is this remedy component being implemented?
Yes. Performance monitoring programs have been established to collect the data required to verify the effectiveness of remedy components #1 through #5. Table 3-4 summarizes the performance monitoring requirements, implementing parties, and the specific documents that contain the monitoring plans.

Were the groundwater monitoring requirements for this remedy met?

Yes, with the following exceptions:

- 200804 (St Anthony #3): Not in operation at the time of sampling. The monitoring plan does not require this well to be sampled unless it is in service.
- 234549 (Reiner Well): The pump wasn't working and the well owner didn't know if they would ever fix it.

These wells are not critical to the performance evaluations. Therefore, the groundwater monitoring requirements were met. Well 234549 (Reiner) will be deleted from the sampling plan (see Appendix A.1). Well 234549 has helped to draw the 1 ug/L contour south of the NBCGRS in the past. It has always been non-detect (sampled 1994 through 2003). Monitoring wells 04U880 and 04U881 provide adequate coverage to determine the boundaries of the 1 and 5 ug/L contours, especially given the long term decreasing trends in the aquifer and the nearby operation of the St. Anthony GAC groundwater treatment system.

Is any groundwater sampling proposed prior to the next report? Yes.

- Monitoring of the extraction wells and treatment system effluent will be performed by the City of New Brighton in accordance with the "New Brighton Water System Sampling and Analysis Plan," June 1997.
- Other groundwater monitoring will be in accordance with the Groundwater Monitoring Plan included as Appendix A.1. The next "major" event will be in FY 2009.

Are any changes or additional actions required for this remedy component? No.

3.7 OVERALL REMEDY FOR OU1 DEEP GROUNDWATER

Has the OU1 remedy been completed (i.e., have the cleanup levels on page 18 of the OU1 ROD been attained throughout the areal and vertical extent of the North Plume)? No.

What impact is the groundwater extraction system having on contaminant concentrations? Figure 3-5, Figure 3-6, and Figure 3-7 show the trichloroethene plumes in the Upper Unit 3, Lower Unit 3 and Unit 4 portions of the aquifer for FY 2007. Cross-sections showing the plumes are presented in Figure 3-8, Figure 3-9, and Figure 3-10. These figures show both the OU1 and OU3 plumes, which overlap to some extent and should be viewed together. In general, the plumes are similar to the last comprehensive sampling round in FY 2005. Figure 3-1 and Figure 3-11 shows the 1 µg/l and 100 µg/l trichloroethene contours respectively for the last 5 major sampling rounds to help illustrate how the bulk and edge of the plumes have behaved over this time.

As discussed in Section 3.3 above, the OU1 Technical Memorandum was prepared to develop statistical methods specifically selected to evaluate the long-term progress of remediation and plume evolution in OU1. The OU1 Technical Memorandum states the objective of the statistical evaluation as follows:

> "Verify progress in cleanup of the plume through measurement of overall geographic plume shrinkage and decreasing contaminant concentrations."

The OU1TG identified five issues that need to be statistically addressed, now and over time, to achieve this objective:

1. Measure changing concentrations immediately downgradient of the TGRS, as this area is the first to be affected by any potential escape of contaminants from TCAAP.

2. Measure changes in the geographical size of the plume over time.

3. Measure changes in concentrations immediately downgradient of the NBCGRS, as this is the first area to be affected by any potential escape of contaminants from NBCGRS capture.

4. Measure any unforeseen changes in plume configuration. This addresses the possibility that changing flow patterns may cause a shift in the plume but not necessarily any change in size. A plume shift may require a redistribution of pumping.

5. Measure the long-term trends in overall VOC concentrations (as an indicator of contaminant mass). This provides an overall picture of remedial progress.

The OU1TG developed a series of five well groups designed to address each of the issues listed above. For each group, the appropriate statistical tools were specified and the statistical response threshold was identified that would trigger closer scrutiny by the Army and regulators (USEPA and MPCA). The five groups, corresponding to the five issues discussed above, are:

1. Group 1: Downgradient of the TGRS. This zone is the area downgradient of the TGRS capture zone. This zone should show overall reductions over time in response to TGRS mass removal and containment. However, it is also the stagnation zone of the TGRS so groundwater velocities are reduced and response may be slow. Furthermore, individual wells near the stagnation zone may show increases in contaminant concentrations during some points in time, as the plume shifts in response to changes in pumping.

2. Group 2: Plume Edge Wells. This zone includes wells that define the edges of the plume downgradient of the TGRS. These are wells with low concentrations of

VOCs (<100 µg/l) that will indicate a reduction in overall plume size if VOC concentrations continue to decline.

3. Group 3: Downgradient Sentinel Wells. This is a zone downgradient of the NBCGRS stagnation zone. This group includes three wells but more accurately is defined as a geographic area immediately downgradient of the NBCGRS. This group should help demonstrate improvement due to the VOC mass removal by the NBCGRS over time, analogous to Group 1 and the TGRS.

4. Group 4: Lateral Sentinel Wells. These are "clean" wells downgradient of the TGRS that are beyond the current plume boundaries. These wells should help identify large, unexpected, lateral changes in plume configuration, such as a shifting or expansion of the plume boundary.

5. Group 5: Global Plume Mass Wells. This group includes all the monitoring wells necessary to construct a contour map of the VOC plume. Production wells are not used in Group 5 since the data may not be comparable to monitoring well data. Some wells on TCAAP are included in Group 5 to support the contouring near the TCAAP boundary. This group reflects the overall VOC mass in the aquifer and should show an overall reduction in VOC mass over time.

In October 2005, the Army received a consistency determination on:

Modification #1 to:
OU1 Technical Group Technical Memorandum Statistical Evaluation Method For Water Quality Data, Operable Unit 1" prepared by the Army, Dated December 2004.

This modification created well Group 6 to address the Jordan portion of the Unit 4 aquifer.

6. Group 6: Jordan Wells. The group includes all Jordan monitoring wells, the Prairie du Chien wells nested with them, and New Brighton Municipal Wells 3, 4, 5, and 6. The inclusion of the Prairie du Chien wells is to facilitate comparing the trends between it and the Jordan at these locations. This group will help identify any changes in the plume occurring in the Jordan portion of the aquifer.

Additional detail on the well groups and analysis is presented in the OU1 Technical Memorandum, Modification #1 and Appendix D.2.

FY 2007 was a major sampling year, so new comprehensive plume mapping was completed (Figures 3-5 through 3-10). Table 3-5 presents the FY 2007 groundwater quality data for OU1. These data were collected to support the statistical analysis developed by the OU1TG. Graphs of historical trichloroethene concentrations at any well can be viewed from Figure B-2 (Appendix B). The graphs help illustrate the long-term changes that have occurred throughout OU1 and provide a visual aid for examining the trichloroethene history at any well.

The statistical analysis in Appendix D.2 follows the format described in the OU1 Technical Memorandum and Modification #1.

Upon review of the data for the Unit 3 portion of Group 5, it was determined that the data points lacked consistent sampling histories over time to complete a kriging-based contour map for the Unit 3 similar to the Unit 4 Group 5 wells. In addition, there are not large numbers of data points for each of the sub-levels of the Unit 3 (e.g., upper and lower Unit 3). Instead, the wells that defined the Unit 3 plume were evaluated as individual well trends.

Table 3-6 presents a summary of the statistical results for all groups, from Appendix D.2, reflecting the data collected through FY 2007. Table 3-6 includes an assessment of the statistical thresholds that were triggered in the analysis and brief comments addressing these threshold triggers. Further discussion is presented below.

Group 1:

The Group 1 (downgradient of the TGRS) response threshold was triggered due to a stable outcome of the north plume analysis. In the FY 2003 analysis, these were triggered due to an increasing trend in the north plume and a stable trend in the south plume. The FY 2006 and FY 2007 data improved the trend statistics. North Plume statistics improved from increasing to stable for FY 2006 and 2007 and the South Plume thresholds are no longer triggered based on data through 2007. The continued improvement shown in FY 2007 suggests that ongoing monitoring is a sufficient response to the threshold triggers.

Group 2:

Three wells exhibited increasing trends on data available through FY 2007:

04U861: Showed an upward trend until it was abandoned in 2006. This well is located between the north and south plumes so represents a mingling of the plumes and does not represent a widening or escape of the plume(s). This area is being addressed as part of OU3 (see Section 11.0).

409557: Shows a probable increasing trend. Historically had sporadic detections below 10 µg/l. This well is a Unit 3 well located between the North and South plume in an area where they co-mingle and can be expected to show changes as the plumes shift over time. Since the Unit 3 plume is not expanding it is sufficient to continue the current monitoring plan.

04U846: Has exhibited sporadic results since 1997 (non-detect to 75 µg/l). Current trend driven by 21 µg/l detection in 2003. Currently at 6.7 µg/l and just north of and within hydraulic influence of the NBCGRS. This influence is likely to be the cause of the upward trend since a simple hydraulic relationship to the plume cannot be assumed.

A number of wells showed "No Trend", which constitutes a threshold trigger. These consist of trends with low statistical confidence. Following are the wells with "No-Trend" results and a summary of key observations:

409549: Historically this well was at or above 200 µg/l, and located within the expected area of the North Plume and upgradient of the NBCGRS. Given the concentration drop over the longer term, the current fluctuations are probably normal at this stage of plume development.

03L859: Historically this well had consistent detections below 10 µg/l, and currently appears to be stable. This is a Unit 3 well located between the North and South plume in an area where they co-mingle and can be expected to reflect long-term shifting of plumes.

03U672: Historically this well was non-detect for five of the six rounds in the trend. The statistics are driven by the single detection (3.1 µg/l) in 2001. The well is currently non-detect.

03U805: Historically this well had sporadic detections below 5 µg/l. The trend is driven by the detection (3 µg/l) in 2001. The last three rounds have shown a decrease and the well is currently at 0.94 µg/l. If this continues the trend should change to decreasing in the next sampling round.

04U832: This well appears to be stable when the longer term data are examined. During the 1990's the well was between 29 µg/l and 69 µg/l of trichloroethene. The 2001 and 2003 results below 5 µg/l appear to be the anomalies. Given the distance of this well from the remedial systems, and moderate concentration, a fairly stable history would be expected.

04U841: Historically has had sporadic detections around 20 µg/l. The well is currently at 24 µg/l. The data suggest a stable history since the mid 1990's.

04U843: Historically this well appears to be generally increasing since the early 1990's from 2 to 3 µg/l to 87 µg/l in FY 2007. It is located downgradient of the off-TCAAP hot spot at 04U847. Since the 04U847 area is outside of the TGRS capture zone, this well can be expected to increase as migration of the hot spot continues. This well has not approached the magnitude of 04U847, which has exceeded 1,000 µg/l over most of its history. This suggests that the hot spot is attenuated as it migrates.

206688: This well has been consistently between 9.27 and 11 µg/l. The location of this well downgradient and somewhat lateral to the NBCGRS would suggest it is in a relatively stagnant area of the plume. The stability suggests this area will be slow to fully remediate.

The key factors that apply to Group 2 (from Table D.2.5, Appendix D) are contaminant concentrations, risk to human health and urgency of response needed. Except for 04U843, the data are generally well within historical ranges, and in locations likely within the capture zones of the remedial systems. The trend at 04U843 is consistent with the migration of the hot spot upgradient of that well. There is nothing dramatic enough in these trends to suggests an expansion of the plume, so an immediate response is not needed. Human health is protected by the remedial systems and the special well construction area. In the larger context, the overall trends continue to be downward suggesting that these anomalies, while worth monitoring, are not indicative of a larger issue with long term plume control. The current sampling frequency is adequate to continue to monitor the trends in these wells.

Group 3 and Group 5:

The trends in the Area Weighted Concentration (AWC) for the Group 3 (downgradient sentinel wells) and the Group 5 (global plume mass wells) were both downward, showing improvement in the plume overall and downgradient of the NBCGRS. For further explanation of how the AWC is calculated see Appendix D.2.

The Unit 3 portion of Group 5 is presented in Table 3-6. Wells already in Group 2 were not included.

An increasing trend was identified at 03U831 in data through 2006. This well was abandoned at the request of New Brighton, for development in the area. This area is addressed as part of OU3 in Section 11.0.

Stable or No Trend Results:

The trend at 03U822 and 03L822appears to correlate with the upward trend at the nested Jordan well (04J822). These data suggest a slug of VOCs are moving through the middle section of the Unit 3 plume. The concentrations appear to have peaked and both wells trends have improved since FY 2005 from increasing at 03U822 and No Trend at 03L822 to No Trend and stable, respectively. Continued monitoring of these wells is an appropriate response.

Well 03L809 also showed a No Trend result. This is an improvement from the FY 2005 upward trend. Continued monitoring is appropriate for this well.

Group 4:

In Group 4, one well exceeded the cleanup level. This was 04U848. Monitoring well 04U848 is in OU3, which is addressed in Section 11.0.

Group 6:

With respect to the Jordan, the three new wells installed and sampled since FY 2005 provide additional data points between TCAAP and the NBCGRS to help complete the understanding of the extent and magnitude of VOC concentrations in the Jordan portion of the aquifer.

04J847 remains stable with the data set now consisting of six data points since 2005. This is a shorter time window than other wells but it does suggest the data trend is statistically meaningful over this time frame. The trend is consistent with the nested Unit 4 well (04U847). Continued annual monitoring is appropriate at this well until the longer time frame is established.

04J849 shows No Trend, which triggered the threshold for group six. However, the concentrations are below 0.5 µg/l and are therefore not of concern and it is likely the trend is an artifact of analytical variability at these levels.

Well 04J822 shows an increasing trend. This well is in the central part of the plume and downgradient of the hot spot at well nest 04U847 to the northeast. So the trend does not suggest

a horizontal expansion of the plume. It does appear to suggest the hot spot is migrating to the southwest as expected, as was observed in the Unit 4 trends discussed above. The annual monitoring planned for this well through FY 2007 remains appropriate to further examine this trend.

Jordan wells near the NBCGRS (04J836, 04J838, and 04J839) show No Trend results. This is consistent with their low to moderate concentrations and proximity to the NBCGRS. The Jordan well in this area with the highest concentrations (04J837) shows a clear downward trend from 147 µg/l in 1998 to 15 µg/l in 2007.

The nested Unit 4 wells are also shown on Table 3-6 and generally correlate with their Jordan partners. Well 04U837 shows a stable trend compared to the nested Jordan well (decreasing trend). Looking at the longer history, the Jordan well has decreased until it is similar in concentration to the Unit 4 well. This history suggests the NBCGRS is helping to reduce the Jordan concentrations in this area bringing the two parts of the aquifer to similar concentration.

The New Brighton Municipal well trends were analyzed using a linear regression for data since 1998. Due to the large number of data points, regression was considered superior to the Mann-Kendall analysis. Data from 1998 were used to reflect the approximate time window used throughout the statistical analysis and to avoid skewing the analysis from the earlier high concentrations. All the New Brighton wells showed downward concentration trends except NBM #3, which shows a slight upward trend. This suggests that overall concentrations are decreasing at the New Brighton municipal well field, which agrees with the decreasing mass removal observed over the life of the system.

Overall Statistical Assessment:

Overall, the data meet the statistical criteria developed in this document for assessing the remedial progress in the off-TCAAP aquifers. The data show continuing improvement in the OU1 plume through 2007. Concerns with the OU3 plume are addressed in Section 11.0.

There were individual threshold triggers identified. These triggers highlight specific areas of the plume that are changing over time. This type of behavior is expected in a large complex flow system such as OU1. The thresholds triggered do not suggest any problems with the remedial systems, but suggest movement within the established plumes. The broader analysis for Groups 1, 3, and 5 show continuing improvement. Overall, therefore, the monitoring data indicates that aquifer restoration is occurring in the Prairie du Chien. The Unit 3 plume appears to be in a more stable configuration, but is limited geographically. The threshold triggers are appropriately addressed in the continuing monitoring plan.

How much VOC mass has been removed (at each well and total)?

Table 3-1 shows that the NBCGRS removed 658 pounds of VOCs during FY 2007. The total cumulative VOCs removed by the NBCGRS is 19,567 pounds. The relative contribution from each extraction well is also shown on Table 3-1.

Figure 3-12 shows the annual VOC mass removed (listed at the top of the graph), annual pumping volumes, and the trend in annual mass removal per unit volume pumped since FY 1997 (when NBM #14 was brought online). The mass removal in FY 2007 slightly decreased compared to FY 2006. The trend in annual mass removal per unit volume pumped continued to decrease from FY 2006 to FY 2007 and has been on a decreasing trend since FY 1998, when the last extraction well was brought online (NBM #15). This overall decline in the mass removal trend agrees with the trichloroethene trends in OU1 deep groundwater, which generally show a decreasing trend, and suggests that aquifer restoration is progressing.

Besides the changes already discussed, are any other changes or additional actions required for OU1? No.

TABLE 3-1
OU1 Pumping / VOC Mass Removal Data

FISCAL YEAR 2007

	WELL #3			WELL #4			WELL #5			WELL #6			WELL #14			WELL #15			System Totals		
MONTH	VOC (ug/l)	WATER TREATED (mgallons)	VOC Mass Removed (lbs)	VOC (ug/l)	WATER TREATED (mgallons)	VOC Mass Removed (lbs)	VOC (ug/l)	WATER TREATED (mgallons)	VOC Mass Removed (lbs)	VOC (ug/l)	WATER TREATED (mgallons)	VOC Mass Removed (lbs)	VOC (ug/l)	WATER TREATED (mgallons)	VOC Mass Removed (lbs)	VOC (ug/l)	WATER TREATED (mgallons)	VOC Mass Removed (lbs)	TOTAL VOC EFFLUENT (ug/l)	TOTAL WATER TREATED BY EXTRACTION SYSTEM (Mgallons)	TOTAL VOC'S REMOVED BY EXTRACTION SYSTEM (lbs)
TOTAL GALLONS PUMPED AND VOC'S REMOVED THROUGH SEPTEMBER 30, 2006																				17,245.453	18,909
OCTOBER	40	0.060	0.020	39	35.187	11.453	160	0.170	0.227	98	0.180	0.147	41	18.033	6.171	94	35.944	28.199	1.9	89.574	46.22
NOVEMBER	46	2.300	0.883	45	17.634	6.623	160	2.524	3.370	97	14.568	11.794	22	37.801	6.941	84	43.210	30.293	0	118.037	59.91
DECEMBER	48	2.462	0.986	-	0.000	0.000	170	6.919	9.817	98	5.907	4.831	39	38.117	12.407	89	43.203	32.091	0	96.608	60.14
JANUARY	48	13.277	5.319	-	0.000	0.000	130	4.284	4.648	87	4.992	3.625	39	42.188	13.732	79	44.543	29.369	0	109.284	56.70
FEBRUARY	47	3.942	1.546	45	34.636	13.008	150	6.540	8.187	102	8.168	6.953	24	16.041	3.213	85	22.872	16.226	0	92.199	49.14
MARCH	47	0.173	0.068	46	44.508	17.087	120	0.651	0.652	76	1.888	1.198	20	36.917	6.162	60	27.874	13.958	0	112.011	39.13
APRIL	54	2.642	1.191	51	38.490	16.383	130	0.187	0.203	87	0.255	0.185	22	32.659	5.997	83	33.935	23.507	1.1	108.168	47.47
MAY	49	10.140	4.147	45	41.281	15.504	139	0.159	0.184	93	0.158	0.123	28	40.044	9.358	84	37.011	25.947	0	128.793	55.27
JUNE	41	15.977	5.467	42	42.279	14.820	120	0.188	0.188	87	8.171	5.933	39	41.203	13.411	75	41.056	25.699	0	148.874	65.52
JULY	27	18.469	4.162	35	42.057	12.285	130	0.208	0.226	78	14.711	9.577	43	42.788	15.356	67	43.338	24.234	0	161.571	65.84
AUGUST	29	9.232	2.234	37	43.377	13.395	150	0.127	0.159	89	4.941	3.670	39	39.341	12.805	65	40.582	22.015	0	137.600	54.28
SEPTEMBER	28	11.342	2.650	36	42.192	12.677	130	0.186	0.202	95	0.758	0.601	44	41.130	15.104	79	42.004	27.695	1.6	137.612	58.93
Subtotal			28.674			133.236			28.064			48.637			120.656			299.233			
% of Total Mass			4.4			20.2			4.3			7.4			18.3			45.4			
TOTAL GALLONS TREATED AND VOC'S REMOVED FOR FISCAL YEAR 2007																				1,440.331	658.55
TOTAL GALLONS TREATED AND VOC'S REMOVED SINCE SYSTEM START UP																				18,685.784	19,567

Table 3-2

TCAAP - OU1 Groundwater Elevations
Fiscal Year 2007

WELL NUMBER (IRDMIS)	WELL NUMBER Mn unique	LOCATION	6/1/2007 WL (ft.)	TOC (ft.)	GW Elev (ft.)	Notes
03L811	426809	SE of Belair Excavating Bldg, off of old hwy 8, Just N of RR tracks	65.23	909.8	844.57	TOC from 1992 Kemper Survey
03L822	426813	S of Long Lake Beach pkg lot, in trees between path and RR tracks	42.80	879.08	836.28	
03L841	434037	50' S of hwy 96 along entrance ramp to 35W S, marked with orange flags	68.21	911.91	843.70	
03L846	447899	United Church of Christ NB, entrance to back pkg lot, LL Rd and Pike Lk Cir.	56.70	888.54	831.84	
03M843	426852	Just W of NB Hist. Bldg in LL Park- next to RR Tracks.	50.10	887.16	837.06	
03U811	426808	SE of Belair Excavating Bldg, off of old hwy 8, Just N of RR tracks	65.10	910.57	845.47	TOC from 1992 Kemper Survey
03U821	426810	Asphalt fence- enter through Mid Asph.	43.50	880.20	836.70	TOC from 1992 Kemper Survey
03U822	426812	S of Long Lake Beach pkg lot, in trees between path and RR tracks	43.05	879.30	836.25	
03U831	426863	Across from Beisswenger's Hrdwre, on E side of old hwy 8	Abandoned	891.79		
04J822	706043	On south end of Long Lake Beach parking lot, in NE corner of trees	43.75	880.15	836.40	surveyed 6/24/04
04J834		29th and Rankin St. In the shrubs of the center island median	138.90	948.78	809.88	
04J836	596629	Inside fence for water tower, 7th St NW and Silver Lake Rd.	177.41	1001.49	824.08	
04J837	596631	N side of Belair middle school playground - take rd from 7th St NW	102.85	929.35	826.50	
04J838	596633	S side of 7th St NW, bottom of hill, in field to Hansen Park.	51.42	880.18	828.76	
04J839	596635	S side of 694 going E, between HWY 65 and Silver Lake Rd.	161.48	987.94	826.46	
04J847	706045	Back of Johnson Filters storage lot, NW of main bldg, E of propane tanks	74.51	918.38	843.87	surveyed 6/24/04
04J849	706044	On East side of Long Lake Rd, on south side of creek that goes to Pike Lake	45.30	876.58	831.28	surveyed 6/24/04
04J882	482707	St. Anthony Blvd and Silver Lake Rd., near Mobil Gas Station	112.12	920.60	808.48	
04U821	426811	Asphalt fence- enter through Mid Asph.	43.38	879.81	836.43	TOC from 1992 Kemper Survey
04U834	519836	29th and Rankin St. In the shrubs of the center island median	133.22	947.88	814.66	
04U836	596628	Inside fence for water tower, 7th St NW and Silver Lake Rd. Need NB key	182.16	1000.64	818.48	
04U837	596630	N side of Belair middle school playground - take rd from 7th St NW	100.42	929.15	828.73	
04U838	596632	S side of 7th St NW, bottom of hill, in field to Hansen Park.	49.72	880.49	830.77	
04U839	596634	S side of 694 going E, between HWY 65 and Silver Lake Rd.	158.04	987.73	829.69	
04U841	426851	50' S of hwy 96 along entrance ramp to 35W S, marked with orange flags	68.41	913.77	845.36	
04U843	426853	Long Lake Park, N of NB Hist. Center, N of Rd. just E of RR tracks.	51.70	888.13	836.43	
04U844	426854	SW corner of Midwest Asphalt-in trees, just E of RR track, S of conc. Found	51.51	886.74	835.23	
04U846	426856	United Church of Christ NB, entrance to back pkg lot, LL Rd and Pike Lk Cir.	58.95	889.46	830.51	

Table 3-2

TCAAP - OU1 Groundwater Elevations
Fiscal Year 2007

WELL NUMBER (IRDMIS)	WELL NUMBER Mn unique	LOCATION	6/1/2007 WL (ft.)	TOC (ft.)	GW Elev (ft.)	Notes
04U847	426857	Back of Johnson Filters storage lot, NW of main bldg, E of propane tanks	71.33	916.10	844.77	
04U849	416082	Corner of Long Lake Rd and Rosewood Court. Brown casing	43.75	874.47	830.72	TOC from 1992 Kemper Survey
04U850	416200	Along Pike Lk Dr, N of 694 sound barricade, brown well casing.	88.68	918.99	830.31	
04U855	426860	18th St NW and Long Lake Rd., brown well casing	63.68	898.15	834.47	
04U871	447889	Inside Silver Lake Camp, off of Cty Rd E intersecting Wexford Hts. Dr.	137.55	959.11	821.56	
04U872	447988	Equinox Apt., Silver Lake Rd and Silver Lane	134.93	954.87	819.94	
04U875	447898	Reservoir Blvd, N of nursing home, fenced in MPLS Water Works- call 612-661-4968 to enter gate	194.43	1015.72	821.29	
04U877	447896	Belair Middle School, 5th St NW past Inca Lane	94.48	923.08	828.60	
04U879	447900	29th Ave NW, N of 14th St. Hidden Oaks Park, by concrete block bldg.	118.10	948.12	830.02	
04U880	447895	SE corner of Ostrander Park, 40th and Polk	156.33	975.00	818.67	
04U881	447891	Waite Park, 33rd (34th?) and Garfield, north of hockey rink, next to plygrnd	161.15	978.39	817.24	
04U882	447890	St. Anthony Blvd and Silver Lake Rd., near Mobil Gas Station	106.12	919.96	813.84	
04U883	447892	Cty Rd C and Walnut, by RR tracks, SE corner of Penske Fence	138.67	951.11	812.44	
PJ#318	447894	N end of Central Park, E of Silver Lake Rd, down by Wading Pool.	170.71	985.60	814.89	
	191942	BS118U4- Just E of Midwest Asphalts main scale- flush mount, biggest plate, threaded cap- unscrews CCW	47.87	883.78	835.91	Assumed TOC from adjacent Well No. 409597 (all 3 wells are flush grade and TOC's should be close)
	409547	NW corner of entrance to Long Lake Park, alongside W side of old hwy 8.	59.20	898.60	839.40	
	409548	Boat Launch- S shore of Long Lake- Next to bathrooms, SE corner pkg lot	40.36	872.19	831.83	
	409549	W of Pike Lake School- S side of 14th st., by warming house parking lot.	92.91	923.23	830.32	
	409550	NW corner of Cheetah Precision Bldg fenced- Mounds Ave off old hwy 8.	68.61	914.40	845.79	
	409555	Oakwood, behind Silver Oak Condos @ park, Across from 694	101.83	925.23	823.40	
	409556	Highview Jr. High- on W side of new gymnasium construction	134.00	963.49	829.49	
	409557	NW corner of entrance to Long Lake Park, alongside W side of old hwy 8.	62.00	898.25	836.25	
	409596	scale- flush mount, 3rd plate from scale	40.36	883.62	843.26	TOC from 1992 Kemper Survey
	409597	Just E of Midwest Asphalts main scale- flush mount- 2nd plate closest to scale	47.42	883.78	836.36	
	512761	Gross Golf Course well #2- in well shed N of maint bldg see Head Green Keeper- Rick 612-789-2542 x 9	140.37	951.49	811.12	

Notes:
Water level measured June 1, 2007.
All groundwater elevations are in feet above mean sea level.
All TOC numbers are from a 1999 CRA-maintained file except as noted.

Table 3-3

OU1, PGAC Effluent Water Quality
Fiscal Year 2007

	Influent Well Monitoring						Operational Performance Monitoring													
Sampling	Well	Well	Well	Well	Well	Well	Contactor #1		Contactor #2		Contactor #3		Contactor #4		Contactor #5		Contactor #6		Contactor #7		Contactor #8	
Date	#3	#4	#5	#6	#14	#15	A	B	A	B	A	B	A	B	A	B	A	B	A	B	A	B
"A" Vessels are the Lead Vessels.																						
2-Oct-06	40	39	160	98	41	94	1.4	NS	1.8	NS	2.0	NS	1.8	NS	1.5	NS	1.1	NS	1.7	NS	1.9	NS
GAC replaced in contactors 1A, 2A, 3A, 4A, 5A, 6A, 7A, 8A between October 2, 2006 and October 20, 2006. "B" Vessels become the Lead Vessels.																						
7-Nov-06	46	45	160	97	22	84	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0
4-Dec-06	48	NS	170	98	39	89	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0
8-Jan-07	48	NS	130	87	39	79	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0
5-Feb-07	47	45	150	102	24	85	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0
7-Mar-07	47	46	120	76	20	60	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0
2-Apr-07	54	51	130	87	22	83	NS	0	NS	1.1	NS	0	NS	1.4	NS	1.0	NS	0	NS	0	NS	1.1
GAC replaced in contactors 1B, 2B, 3B, 4B, 5B, 6B, 7B, 8B between April 17,2007and April 27, 2007 "and between May 1 , 2007 and May 11, 2007. A" Vessels become the Lead Vessels.																						
15-May-07	49	45	139	93	28	84	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS
11-Jun-07	41	42	120	87	39	75	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS
25-Jul-07	27	35	130	78	43	67	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS
6-Aug-07	29	37	150	89	39	65	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS	0	NS
18-Sep-07	28	36	130	95	44	79	0	NS	1.5	NS	1.4	NS	1.4	NS	2.1	NS	0	NS	1.4	NS	1.6	NS

Notes:

1) All water quality results shown are for Total VOCs (ug/l).

2) NS = Not Sampled.

3) The highlighted results indicate those results that are representative of effluent water quality for the given pair of contactor vessels (only the A or B vessel result is highlighted since vessels are operating in series).

Table 3-4

Summary of OU1 Monitoring Requirements
Fiscal Year 2007

Remedy Component	Monitoring Requirements	Implementing Party	Documents Containing the Monitoring Plan
#1: Alternate Water Supply/Well Abandonment	a. Water quality data for the perimeter of the plume to define the area of concern	Army	OU1 Groundwater Monitoring Plan in the Annual Report
	b. Water quality data for water supply wells to determine eligibility for alternate supply/abandonment	Army	Well Inventory Report
#2: Drilling Advisories	a. Verification that drilling advisories are in place and functioning as intended	Army/MDH	N/A
#3: Extracting Groundwater with the NBCGRS	a. Pumping volume and rates for each extraction well for comparison to design flowrates	New Brighton	New Brighton Water System Sampling and Analysis Plan
	b. Water levels from monitoring wells to draw contour maps showing the influences of pumping	Army	OU1 Groundwater Monitoring Plan in the Annual Report
	c. Water quality, to assist in evaluation of statistical improvements in groundwater quality.	Army	OU1 Groundwater Monitoring Plan in the Annual Report
#4: Removal of VOCs	a. Effluent water quality to demonstrate compliance with the Safe Drinking Water Act	New Brighton	New Brighton Water System Sampling and Analysis Plan
#5: Discharge of Treated Water	a. Verification of discharge	New Brighton	N/A
#6: Groundwater Monitoring	Outlined above and below		
OR: Overall Remedy (Attainment of cleanup goals)	a. Water quality data throughout the North Plume to evaluate remedial progress	Army	OU1 Groundwater Monitoring Plan in the Annual Report

Table 3-5
OU1 Groundwater Quality Data

Fiscal Year 2007

			Trichloro-ethene (ug/l)	1,1-Dichloro-ethene (ug/l)	cis-1,2-Dichloro-ethene (ug/l)	1,1,1-Trichloro-ethane (ug/l)	1,1,2-Trichloro-ethane (ug/l)	1,1-Dichloro-ethane (ug/l)
OU1 Cleanup Level [1]			5	6	70	200	3	70
03U811		6/4/07	<1	<1	<1	<1	<1	<1
03U821		6/13/07	**19**	1.1	JP 0.20	1.1	<1	JP 0.92
03U822		6/15/07	**140**	**7.1**	2.0	2.7	<1	11
03M843		6/11/07	JP 0.33	<1	<1	<1	<1	<1
03L811		6/4/07	<1	3.0	JP 0.49	<1	<1	2.9
03L822		6/15/07	**280**	**7.4**	2.4	6.0	<1	5.7
03L822	D	6/15/07	**280**	**7.6**	2.4	5.8	<1	5.8
03L832		6/12/07	1.4	JP 0.25	JP 0.18	<1	<1	<1
03L841		6/7/07	<1	<1	<1	<1	<1	<1
03L846		6/12/07	<1	3.9 (UB0.96)	3.6	<1	<1	14
04U821		6/13/07	**29**	2.3	JP 0.26	1.9	<1	1.8
04U834		6/7/07	2.3	<1	<1	<1	<1	<1
04U834	D	6/7/07	2.5	<1	<1	<1	<1	<1
04U836		6/15/07	**32**	2.7	<1	3.2	<1	2.4
04U837		6/12/07	4.8	JP 0.46 (UB0.96)	<1	<1	<1	JP 0.95
04U837	D	6/12/07	5.0	JP 0.46 (UB0.96)	<1	<1	<1	JP 1.0
04U838		6/11/07	**48**	5.0	1.4	2.2	<1	4.4
04U839		6/8/07	JP 0.57 (UB0.2)	<1	<1	<1	<1	<1
04U841		6/7/07	**24**	3.5	JP 0.80	5.1	<1	2.8
04U843		6/14/07	**85**	**12**	1.1	11	<1	9.3
04U843	D	6/14/07	**87**	**12**	JP 1.0	11	<1	9.3
04U844		6/15/07	**290**	**23**	2.3	30	<1	16
04U846		6/12/07	**6.6**	**6.7**	7.0	<1	<1	11
04U846	D	6/12/07	**6.7**	**6.8**	7.2	<1	<1	11
04U847		6/18/07	**880**	**52**	7.4	32	<2	42

Table 3-5
OU1 Groundwater Quality Data

Fiscal Year 2007

			Trichloro-ethene (ug/l)	1,1-Dichloro-ethene (ug/l)	cis-1,2-Dichloro-ethene (ug/l)	1,1,1-Trichloro-ethane (ug/l)	1,1,2-Trichloro-ethane (ug/l)	1,1-Dichloro-ethane (ug/l)
OU1 Cleanup Level [1]			5	6	70	200	3	70
04U849		6/11/07	**52**	5.7	JP 0.70	3.7	<1	4.8
04U850		6/15/07	**80**	**7.5**	JP 0.99	5.5	<1	7.1
04U850	D	6/15/07	**82**	**7.7**	1.0	5.6	<1	7.0
04U855		6/14/07	<1	<1	<1	<1	<1	<1
04U871		6/15/07	**28**	1.7	<1	2.0	<1	2.5
04U872		6/8/07	**9.8**	JP 0.46	<1	JP 0.46	<1	1.1
04U872	D	6/8/07	**9.7**	<1	<1	JP 0.45	<1	1.2
04U875		6/7/07	1.3	<1	<1	<1	<1	<1
04U877		6/6/07	JP 0.68	<1	<1	<1	<1	JP 0.71
04U879		6/11/07	JP 0.44	<1	<1	<1	<1	<1
04U880		6/6/07	<1	<1	<1	<1	<1	<1
04U881		6/12/07	2.3	<1	<1	<1	<1	JP 0.18
04U882		6/12/07	**29**	2.0	JP 0.20	2.1	<1	1.4
04U883		6/5/07	JP 0.19	<1	<1	<1	<1	<1
04J822		12/11/06	JP 0.24	<1	<1	<1	<1	<1
04J822		6/13/07	**83**	**14**	1.8	17	<1	9.5
04J834		6/4/07	JP 0.35	<1	<1	<1	<1	<1
04J836		6/13/07	4.2	JP 0.38	<1	JP 0.52	<1	<1
04J837		6/8/07	**15**	1.1	JP 0.25	JP 0.75	<1	1.5
04J838		6/12/07	**31**	1.9	JP 0.19	1.3	<1	1.5
04J839		6/8/07	1.9	<1	<1	<1	<1	<1
04J847		12/11/06	**740**	**60**	8.0	51	<2	38
04J847		6/18/07	**770**	**52**	7.7	46	<2	39
04J849		12/11/06	**85**	**17**	1.7	20	<1	9.5
04J849	D	12/11/06	**85**	**17**	1.6	20	<1	9.6
04J849		6/12/07	JP 0.21	<1	<1	<1	<1	<1
04J882		6/6/07	<1	<1	<1	<1	<1	<1

Table 3-5
OU1 Groundwater Quality Data

Fiscal Year 2007

		Trichloro-ethene (ug/l)	1,1-Dichloro-ethene (ug/l)	cis-1,2-Dichloro-ethene (ug/l)	1,1,1-Trichloro-ethane (ug/l)	1,1,2-Trichloro-ethane (ug/l)	1,1-Dichloro-ethane (ug/l)
OU1 Cleanup Level [1]		5	6	70	200	3	70
191942	6/18/07	**54**	**6.7**	2.0	3.7	<1	7.7
200154	6/12/07	<1	<1	<1	<1	<1	<1
206688	6/11/07	**11**	JP 0.99 (UB0.96)	<1	JP 0.91	<1	JP 0.90
234546	6/11/07	**14**	JP 0.95 (UB0.96)	<1	JP 0.53	<1	JP 0.81
409547	6/7/07	<1	1.0	JP 0.88	1.3	<1	1.3
409548	6/12/07	1.3	JP 0.34 (UB0.96)	<1	<1	<1	JP 0.46
409549	6/13/07	**18**	1.9	JP 0.17	1.7	<1	1.5
409550	6/15/07	**47**	JP 0.81	<1	2.9	<1	JP 0.65
409555	6/5/07	<1	<1	<1	<1	<1	<1
409556	6/6/07	<1	<1	<1	<1	<1	<1
409557	6/11/07	**40**	**12**	2.7	6.7	<1	10
409596	6/14/07	**5.4**	JP 0.32	<1	<1	<1	JP 0.63
409597	6/15/07	**59**	**8.4**	1.8	4.3	<1	8.6
447894	6/11/07	2.8	<1	<1	<1	<1	<1
512761	6/13/07	**21**	1.5	<1	1.4	<1	1.2

Notes:

(1) Cleanup levels for OU1 deep groundwater are from page 18 of the OU1 ROD. Bolding (in red color) indicates exceedance of the cleanup level.

D Duplicate sample.

JP The value is below the reporting level, but above the method detection limit. Results should be considered estimated.

UB The sample result was less than 5 times the level detected in a blank (the result for the blank is listed after "UB"). The sample result can be considered non detect at an elevated detection limit.

Table 3-6
Group 1,2,3,5 and 6 Mann-Kendall Summary and Maros Conclusion
FY 2007

Group	Kendall S	N	Raw Trend	Confidence	COV	Raw Trend Decision	MAROS Conclusion	Threshold Triggered?	Stable?	Comments
Group 2 Wells:										
409549	7	6	Increasing	86.40%	0.6151	S or NT	**No Trend**	yes	No Trend	
409557	9	6	Increasing	93.20%	0.8894	Probable	**Increasing**	yes	No Trend	
03L673	-3	6	Decreasing	64.00%	0.8170	S or NT	**Stable**	no	Stable	
03L833	-15	6	Decreasing	99.00%	0.6269	Definite	**Decreasing**	no	Stable	
03L848	-5	6	Decreasing	76.50%	0.4384	S or NT	**Stable**	no	Stable	
03L859	7	6	Increasing	86.40%	0.4150	S or NT	**No Trend**	yes	No Trend	
03U672	-1	6	Decreasing	50.00%	2.4495	S or NT	**No Trend**	yes	No Trend	
03U805	1	6	Increasing	50.00%	0.7348	S or NT	**No Trend**	yes	No Trend	
04U673	-1	6	Decreasing	50.00%	0.6647	S or NT	**Stable**	no	Stable	
04U832	5	6	Increasing	73.50%	0.7396	S or NT	**No Trend**	no	No Trend	
04U833	-13	6	Decreasing	99.00%	0.9376	Definite	**Decreasing**	no	Stable	
04U841	4	6	Increasing	70.00%	0.5049	S or NT	**No Trend**	yes	No Trend	
04U843	7	6	Increasing	86.00%	0.7593	S or NT	**No Trend**	yes	No Trend	
04U845	-5	6	Decreasing	76.50%	0.7263	S or NT	**Stable**	no	Stable	
04U846	11	6	Increasing	97.00%	1.4588	Definite	**Increasing**	yes	No Trend	
04U854	-12	6	Decreasing	99.00%	0.3928	Definite	**Decreasing**	no	Stable	
04U859	-1	6	Decreasing	50.00%	0.6991	S or NT	**Stable**	no	Stable	
04U861	11	6	Increasing	97.00%	1.0262	Definite	**Increasing**	yes	No Trend	Abandoned after 2006 sample
04U875	-15	6	Decreasing	99.00%	0.6363	Definite	**Decreasing**	no	Stable	
04U877	-11	6	Decreasing	97.00%	0.4755	Definite	**Decreasing**	no	Stable	
206688	2	6	Increasing	56.00%	0.0835	S or NT	**No Trend**	no	No Trend	
Group 5	-9	6	Decreasing	93.00%	0.1054	Probable	**Decreasing**	no	Stable	
Group 3	-14	6	Decreasing	99.00%	0.5846	Definite	**Decreasing**	no	Stable	
Group 1 NP	-7	6	Decreasing	86.00%	0.3397	S or NT	**Stable**	yes	Stable	
Group 1 SP	-9	6	Decreasing	93.00%	0.1903	Probable	**Decreasing**	no	Stable	

Table 3-6
Group 1,2,3,5 and 6 Mann-Kendall Summary and Maros Conclusion
FY 2007

Group	Kendall S	N	Raw Trend	Confidence	COV	Raw Trend Decision	MAROS Conclusion	Threshold Triggered?	Stable?	Comments
Group 6 OU1 Jordan Wells:										
04J822	9	6	Increasing	93.00%	0.5373	Probable	**Increasing**	Yes	No Trend	
04J834	10	6	Increasing	95.00%	0.7873	Probable	**Increasing**	Yes	No Trend	All detection below 0.5 ug/l
04J836	1	6	Increasing	50.00%	0.6140	S or NT	**No Trend**	Yes	No Trend	All detection below 5 ug/l
04J838	-3	6	Decreasing	64.00%	0.5923	S or NT	**No Trend**	Yes		
04J837	-9	6	Decreasing	93.00%	1.1434	Probable	**Decreasing**	No	No Trend	
04J839	1	6	Increasing	50.00%	0.7400	S or NT	**No Trend**	Yes	No Trend	All detection below 5 ug/l
04J847	-4	5	Decreasing	71.00%	0.1243	S or NT	**Stable**	Yes	Stable	
04J849	7	6	Increasing	86.00%	1.5543	S or NT	**No Trend**	Yes	No Trend	All detection below 0.5 ug/l
04J882	0	6	Zero	43.00%	NA	S or NT	**NA**	No	No Trend	All ND
04J077	-11	6	Decreasing	97.00%	0.7160	Definite	**Decreasing**	No	Stable	
04J702	-12	6	Decreasing	99.00%	0.7096	Definite	**Decreasing**	No	Stable	
04J708	-6	6	Decreasing	73.50%	0.3549	S or NT	**Stable**	Yes	Stable	Last 4 rounds below 5 ug/L
04J713	-6	6	Decreasing	81.00%	1.8489	S or NT	**No Trend**	Yes	No Trend	All below 5 ug/l, currently ND
Group 6 Nested Unit 4 wells:										
04U077	-11	6	Decreasing	97.00%	0.4877	Definite	**Decreasing**	No	Stable	
04U702	-13	6	Decreasing	99.00%	0.9188	Definite	**Decreasing**	No	Stable	
04U708	-6	6	Decreasing	81.00%	0.2497	S or NT	**Stable**	No	Stable	
04U713	-5	6	Decreasing	76.50%	0.8419	S or NT	**Stable**	Yes	Stable	
04U834	-13	6	Decreasing	99.00%	1.0277	Definite	**Decreasing**	No	No Trend	
04U836	4	5	Increasing	70.00%	0.4223	S or NT	**No Trend**	Yes	No Trend	
04U837	0	5	Zero	50.00%	0.8930	S or NT	**Stable**	Yes	Stable	
04U838	0	5	Zero	50.00%	1.0399	S or NT	**No Trend**	Yes	No Trend	
04U839	-4	5	Decreasing	70.00%	0.7745	S or NT	**Stable**	Yes	Stable	
04U847	-4	6	Decreasing	70.00%	0.2213	S or NT	**Stable**	Yes	Stable	
04U849	-5	6	Decreasing	76.50%	0.2488	S or NT	**Stable**	No	Stable	
Group 5 Unit 3 Wells:										
409550	-15	6	Decreasing	0.99	0.87223	Definite	Decreasing	no	Stable	
409597	-11	6	Decreasing	0.99	0.38848	Definite	Decreasing	no	Stable	
409596	-8	6	Decreasing	0.9	0.67143	Probable	Decreasing	no	Stable	
03U831	9	6	Increasing	0.932	1.58854	Probable	Increasing	yes	No Trend	Abandoned in 2006 for construction
03U821	-4	6	Decreasing	0.7	0.60588	S or NT	Stable	no	Stable	
03U822	5	6	Increasing	0.765	0.63024	S or NT	No Trend	yes	No Trend	Appears to have peaked
03L822	-5	6	Decreasing	0.765	0.41394	S or NT	Stable	no	Stable	Appears to have peaked
03L809	5	6	Increasing	0.765	0.59968	S or NT	No Trend	yes	No Trend	Stable since 2001

Table 3-6
Group 1,2,3,5 and 6 Mann-Kendall Summary and Maros Conclusion
FY 2007

Group	Kendall S	N	Raw Trend	Confidence	COV	Raw Trend Decision	MAROS Conclusion	Threshold Triggered?	Stable?	Comments

Notes:
S or NT = Stable or No Trend
N = number of data points
COV = Coefficient of Variance

MAROS Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

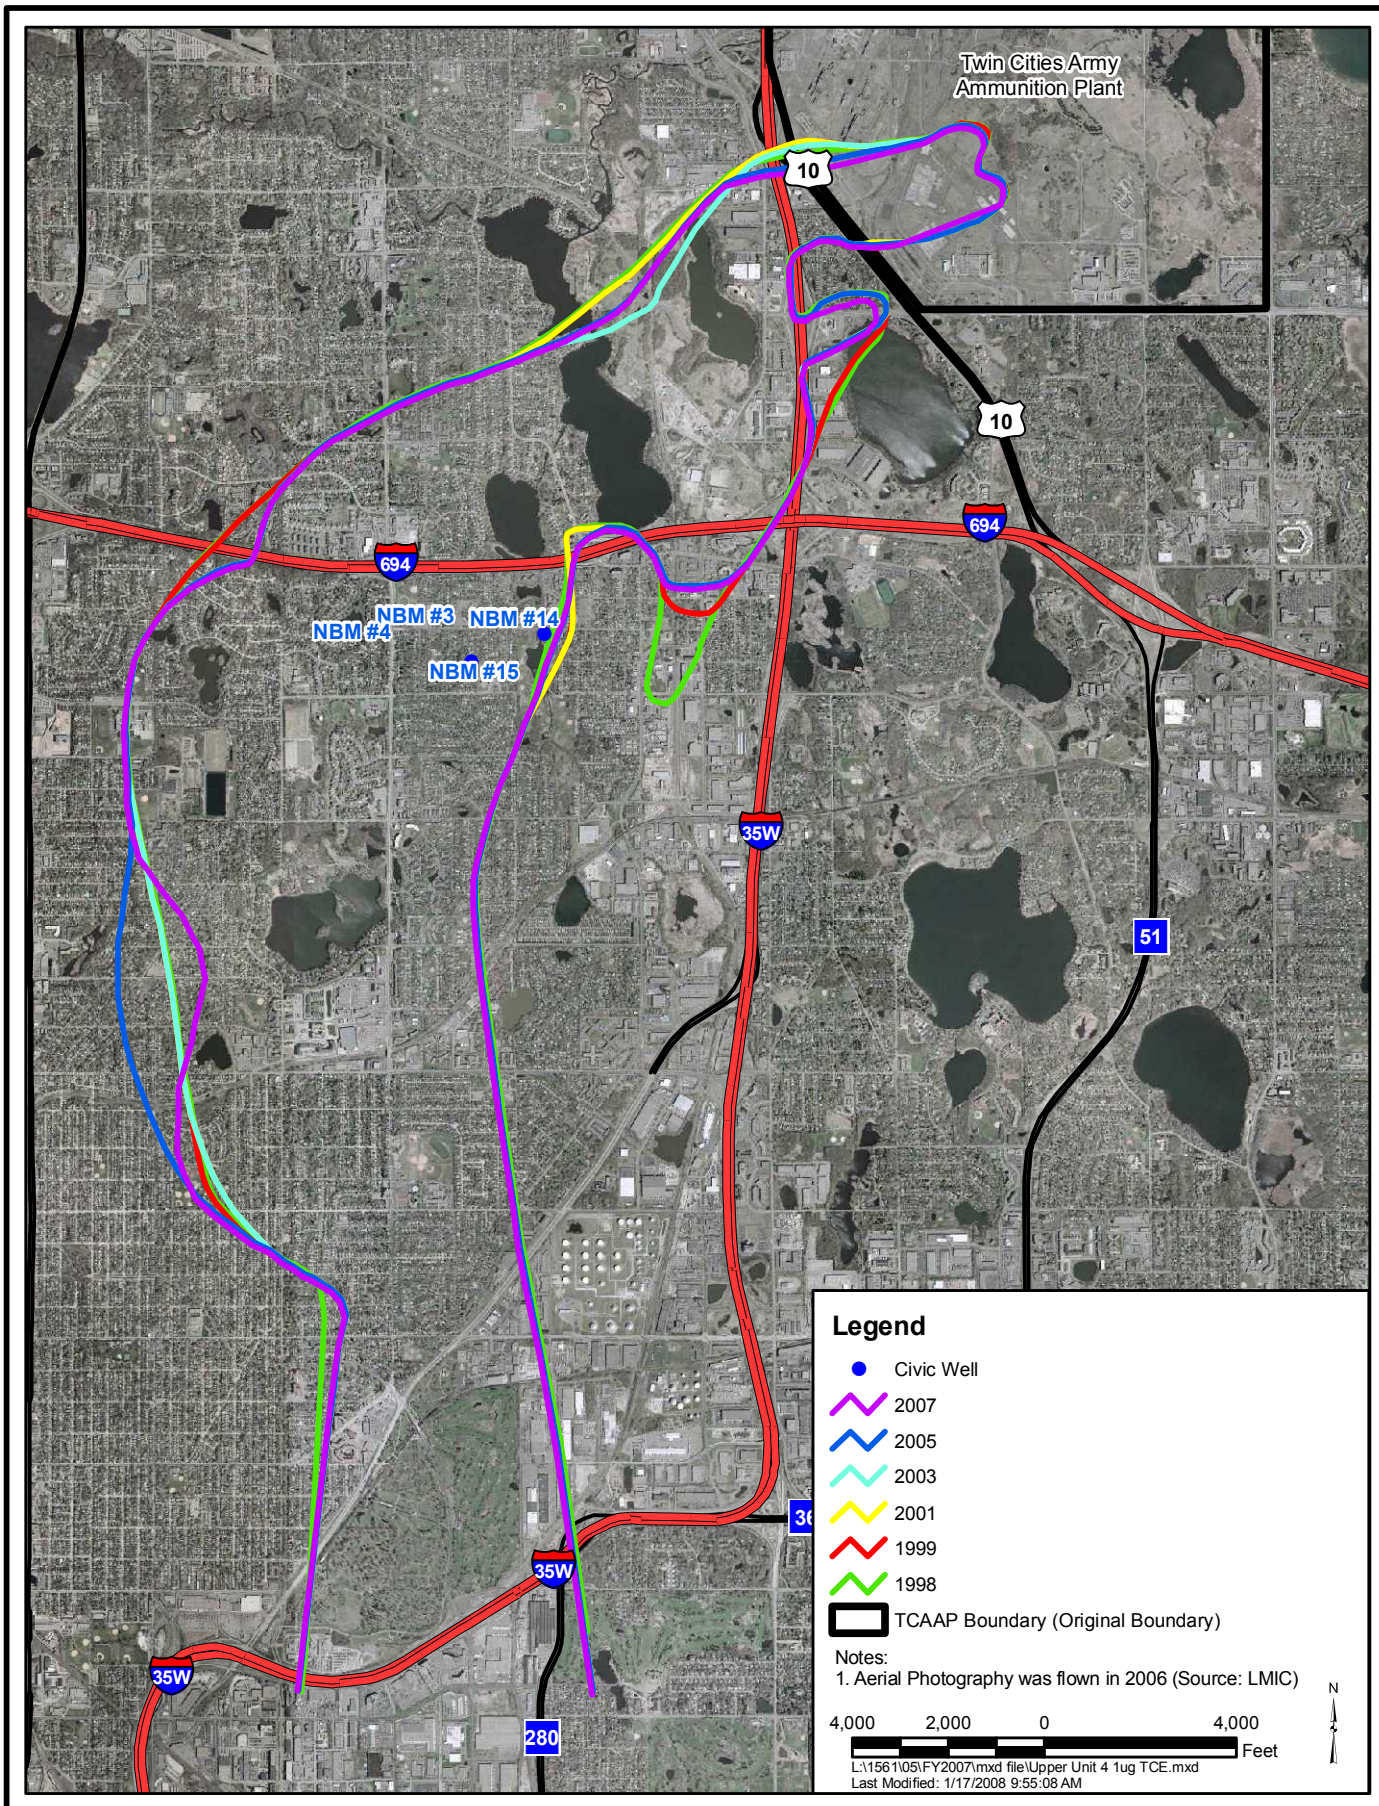

TWIN CITIES ARMY AMMUNTION PLANT

Upper Unit 4,
1 ug/l Trichloroethene Isoconcentration Map

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 3-1

FIGURE 3-2
OU1 WELL PUMPING RATES VS. TARGETS
TWIN CITIES ARMY AMMUNITION PLANT

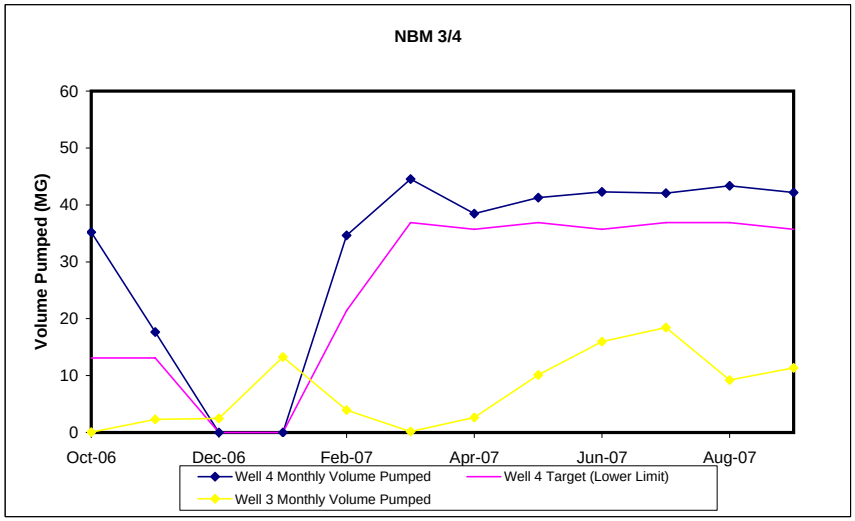

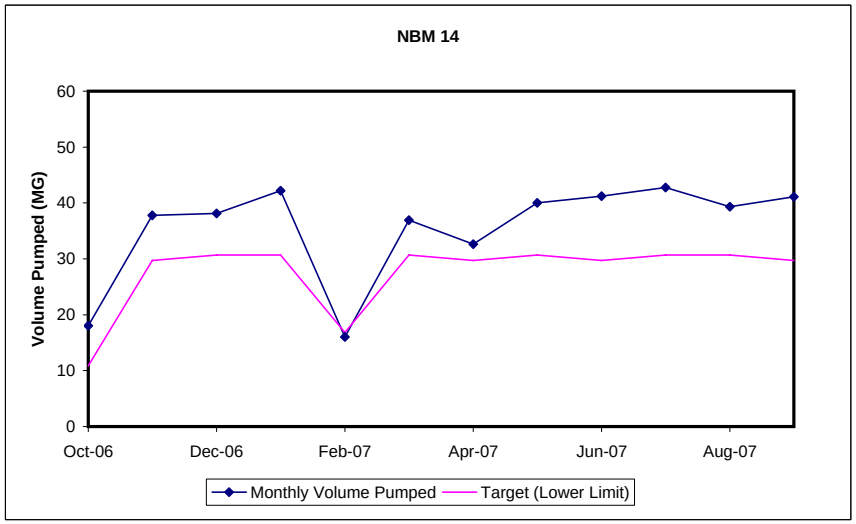

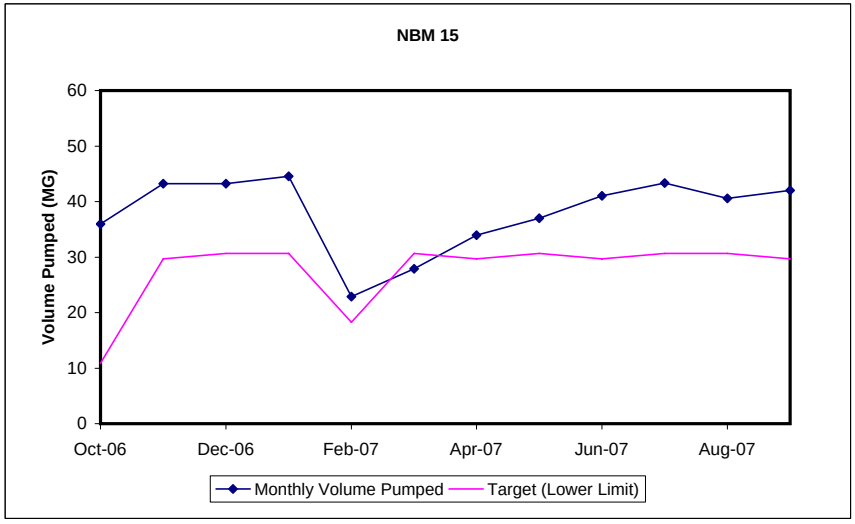

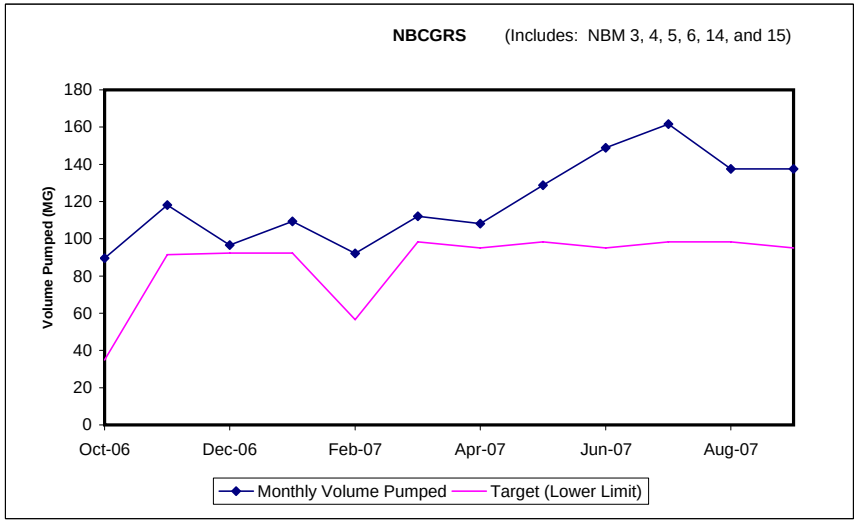

Twin Cities Army Ammunition Plant

(For Detail of On-Post Upper Unit 4 Concentrations and Countours, See Figure 10-7)

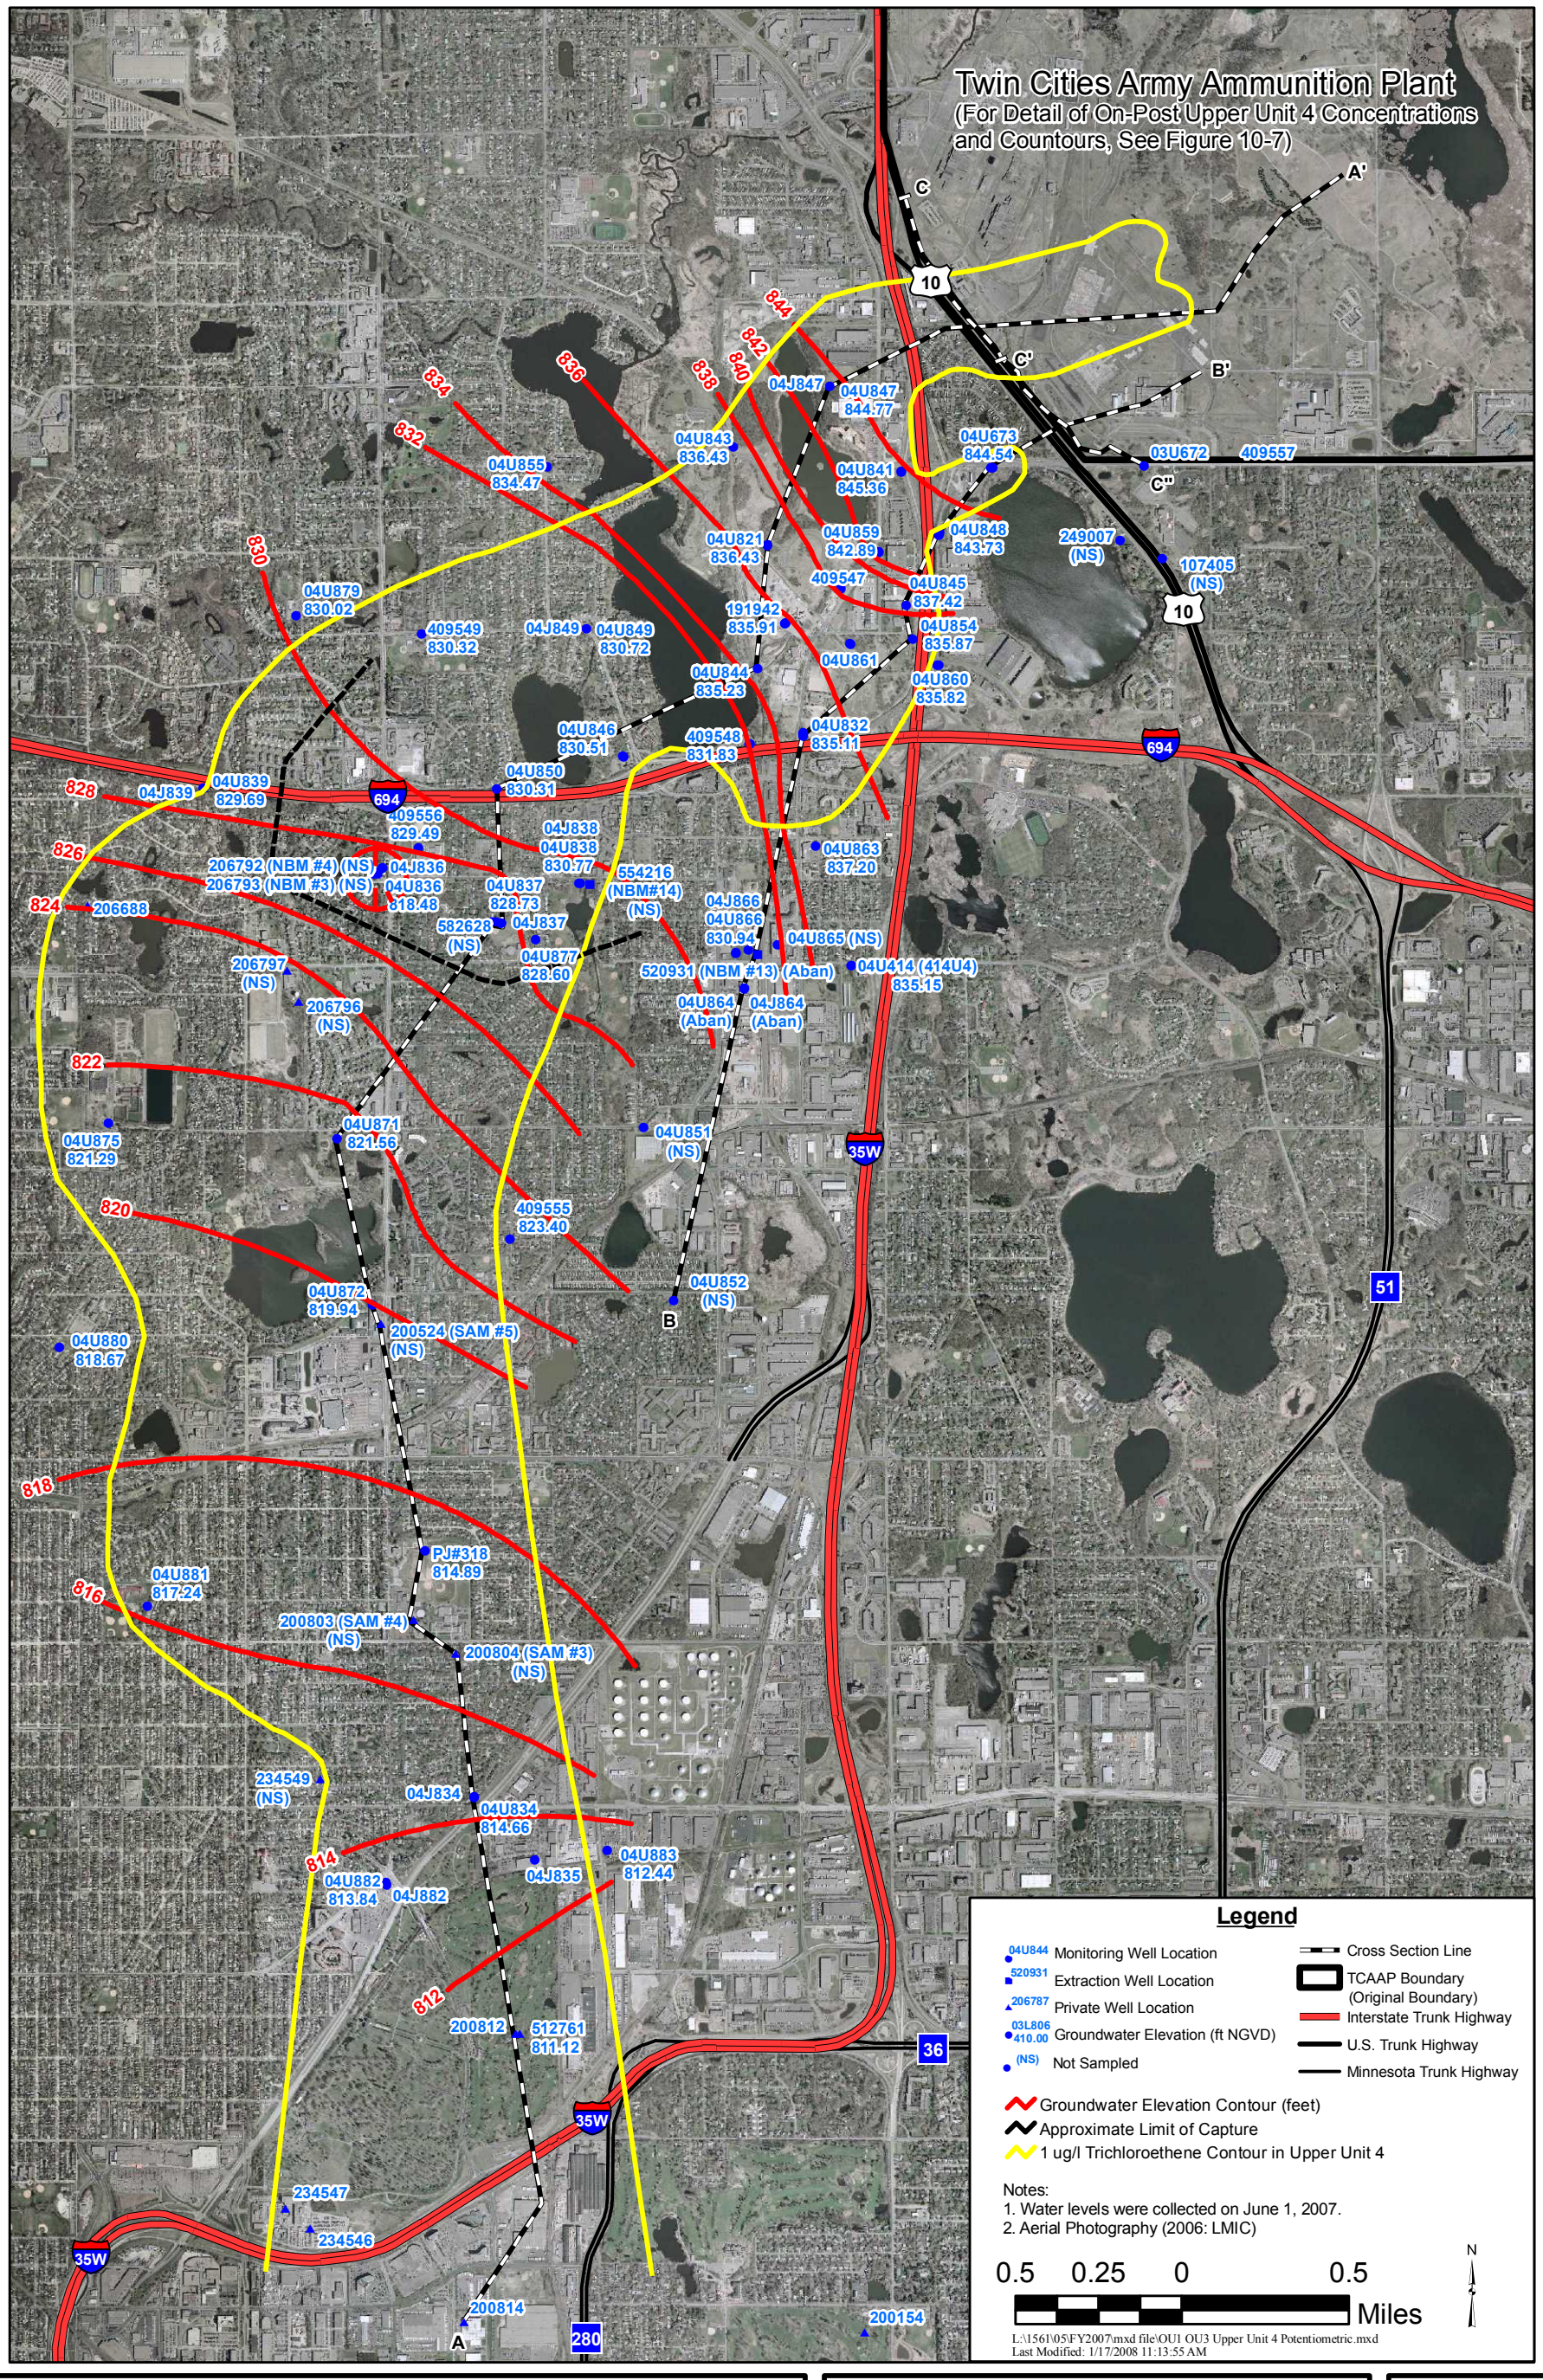

Legend

- 04U844 — Monitoring Well Location
- 520931 — Extraction Well Location
- 206787 — Private Well Location
- 03L806 410.00 — Groundwater Elevation (ft NGVD)
- (NS) — Not Sampled
- Cross Section Line
- TCAAP Boundary (Original Boundary)
- Interstate Trunk Highway
- U.S. Trunk Highway
- Minnesota Trunk Highway
- Groundwater Elevation Contour (feet)
- Approximate Limit of Capture
- 1 ug/l Trichloroethene Contour in Upper Unit 4

Notes:
1. Water levels were collected on June 1, 2007.
2. Aerial Photography (2006: LMIC)

0.5 0.25 0 0.5 Miles

N

L:\1561\05\FY2007\mxd file\OU1 OU3 Upper Unit 4 Potentiometric.mxd
Last Modified: 1/17/2008 11:13:55 AM

TWIN CITIES ARMY AMMUNTION PLANT

OU1 & OU3, Upper Unit 4, Potentiometric, Summer 2007

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 3-3

FIGURE 3-4
NEW BRIGHTON MUNICIPAL WELLS: TRICHLOROETHENE WATER QUALITY TRENDS
TWIN CITIES ARMY AMMUNITION PLANT

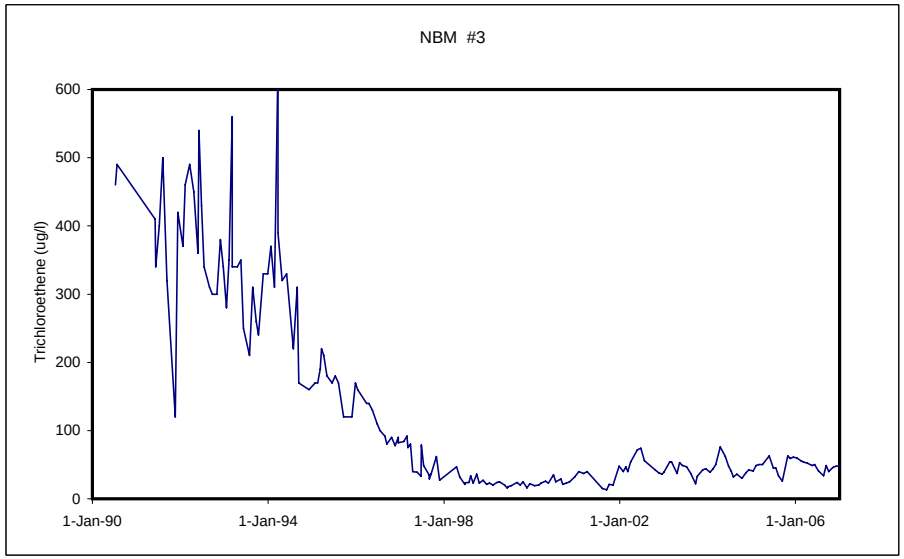

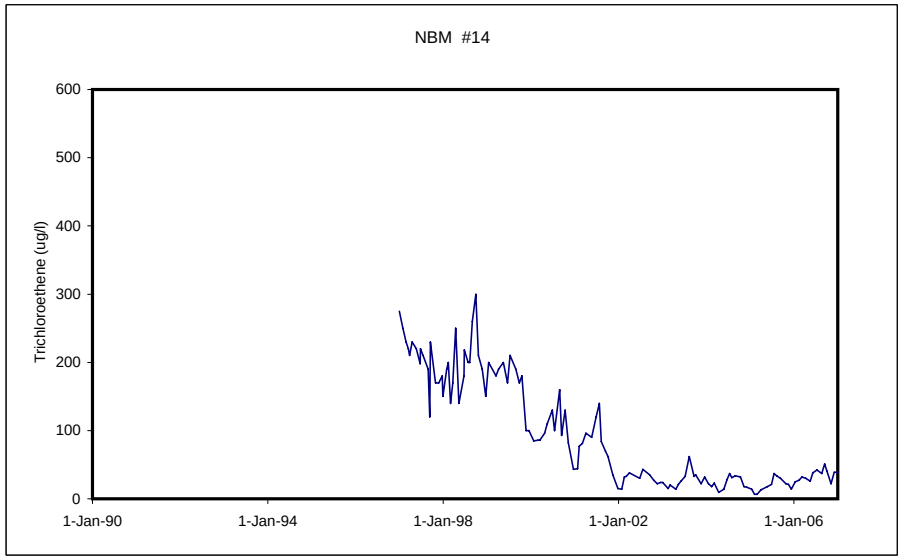

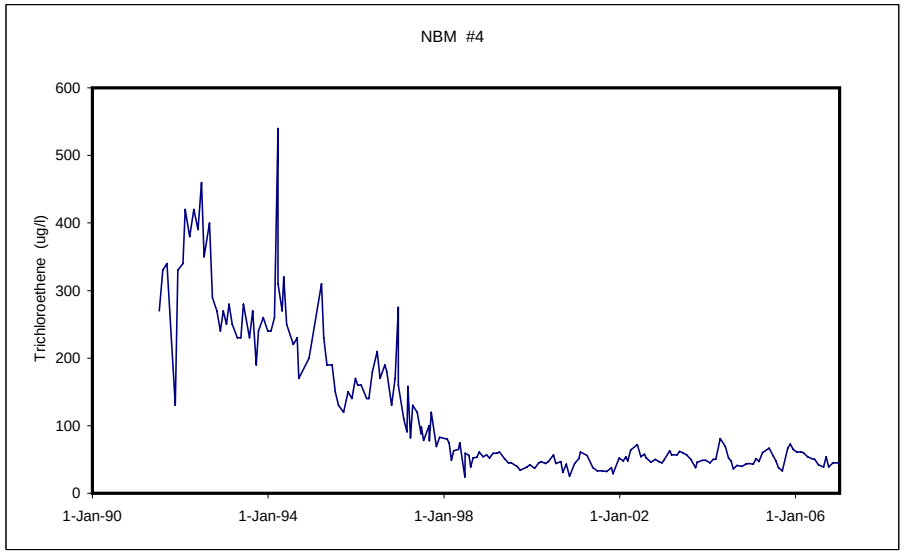

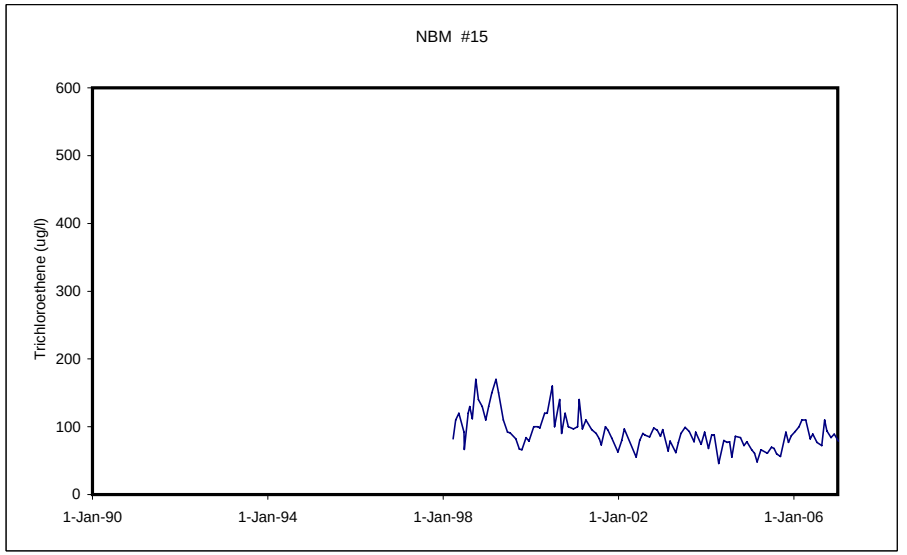

Twin Cities Army Ammunition Plant

(For Detail of On-Post Upper Unit 3 Concentrations and Countours, See Figure 10-5)

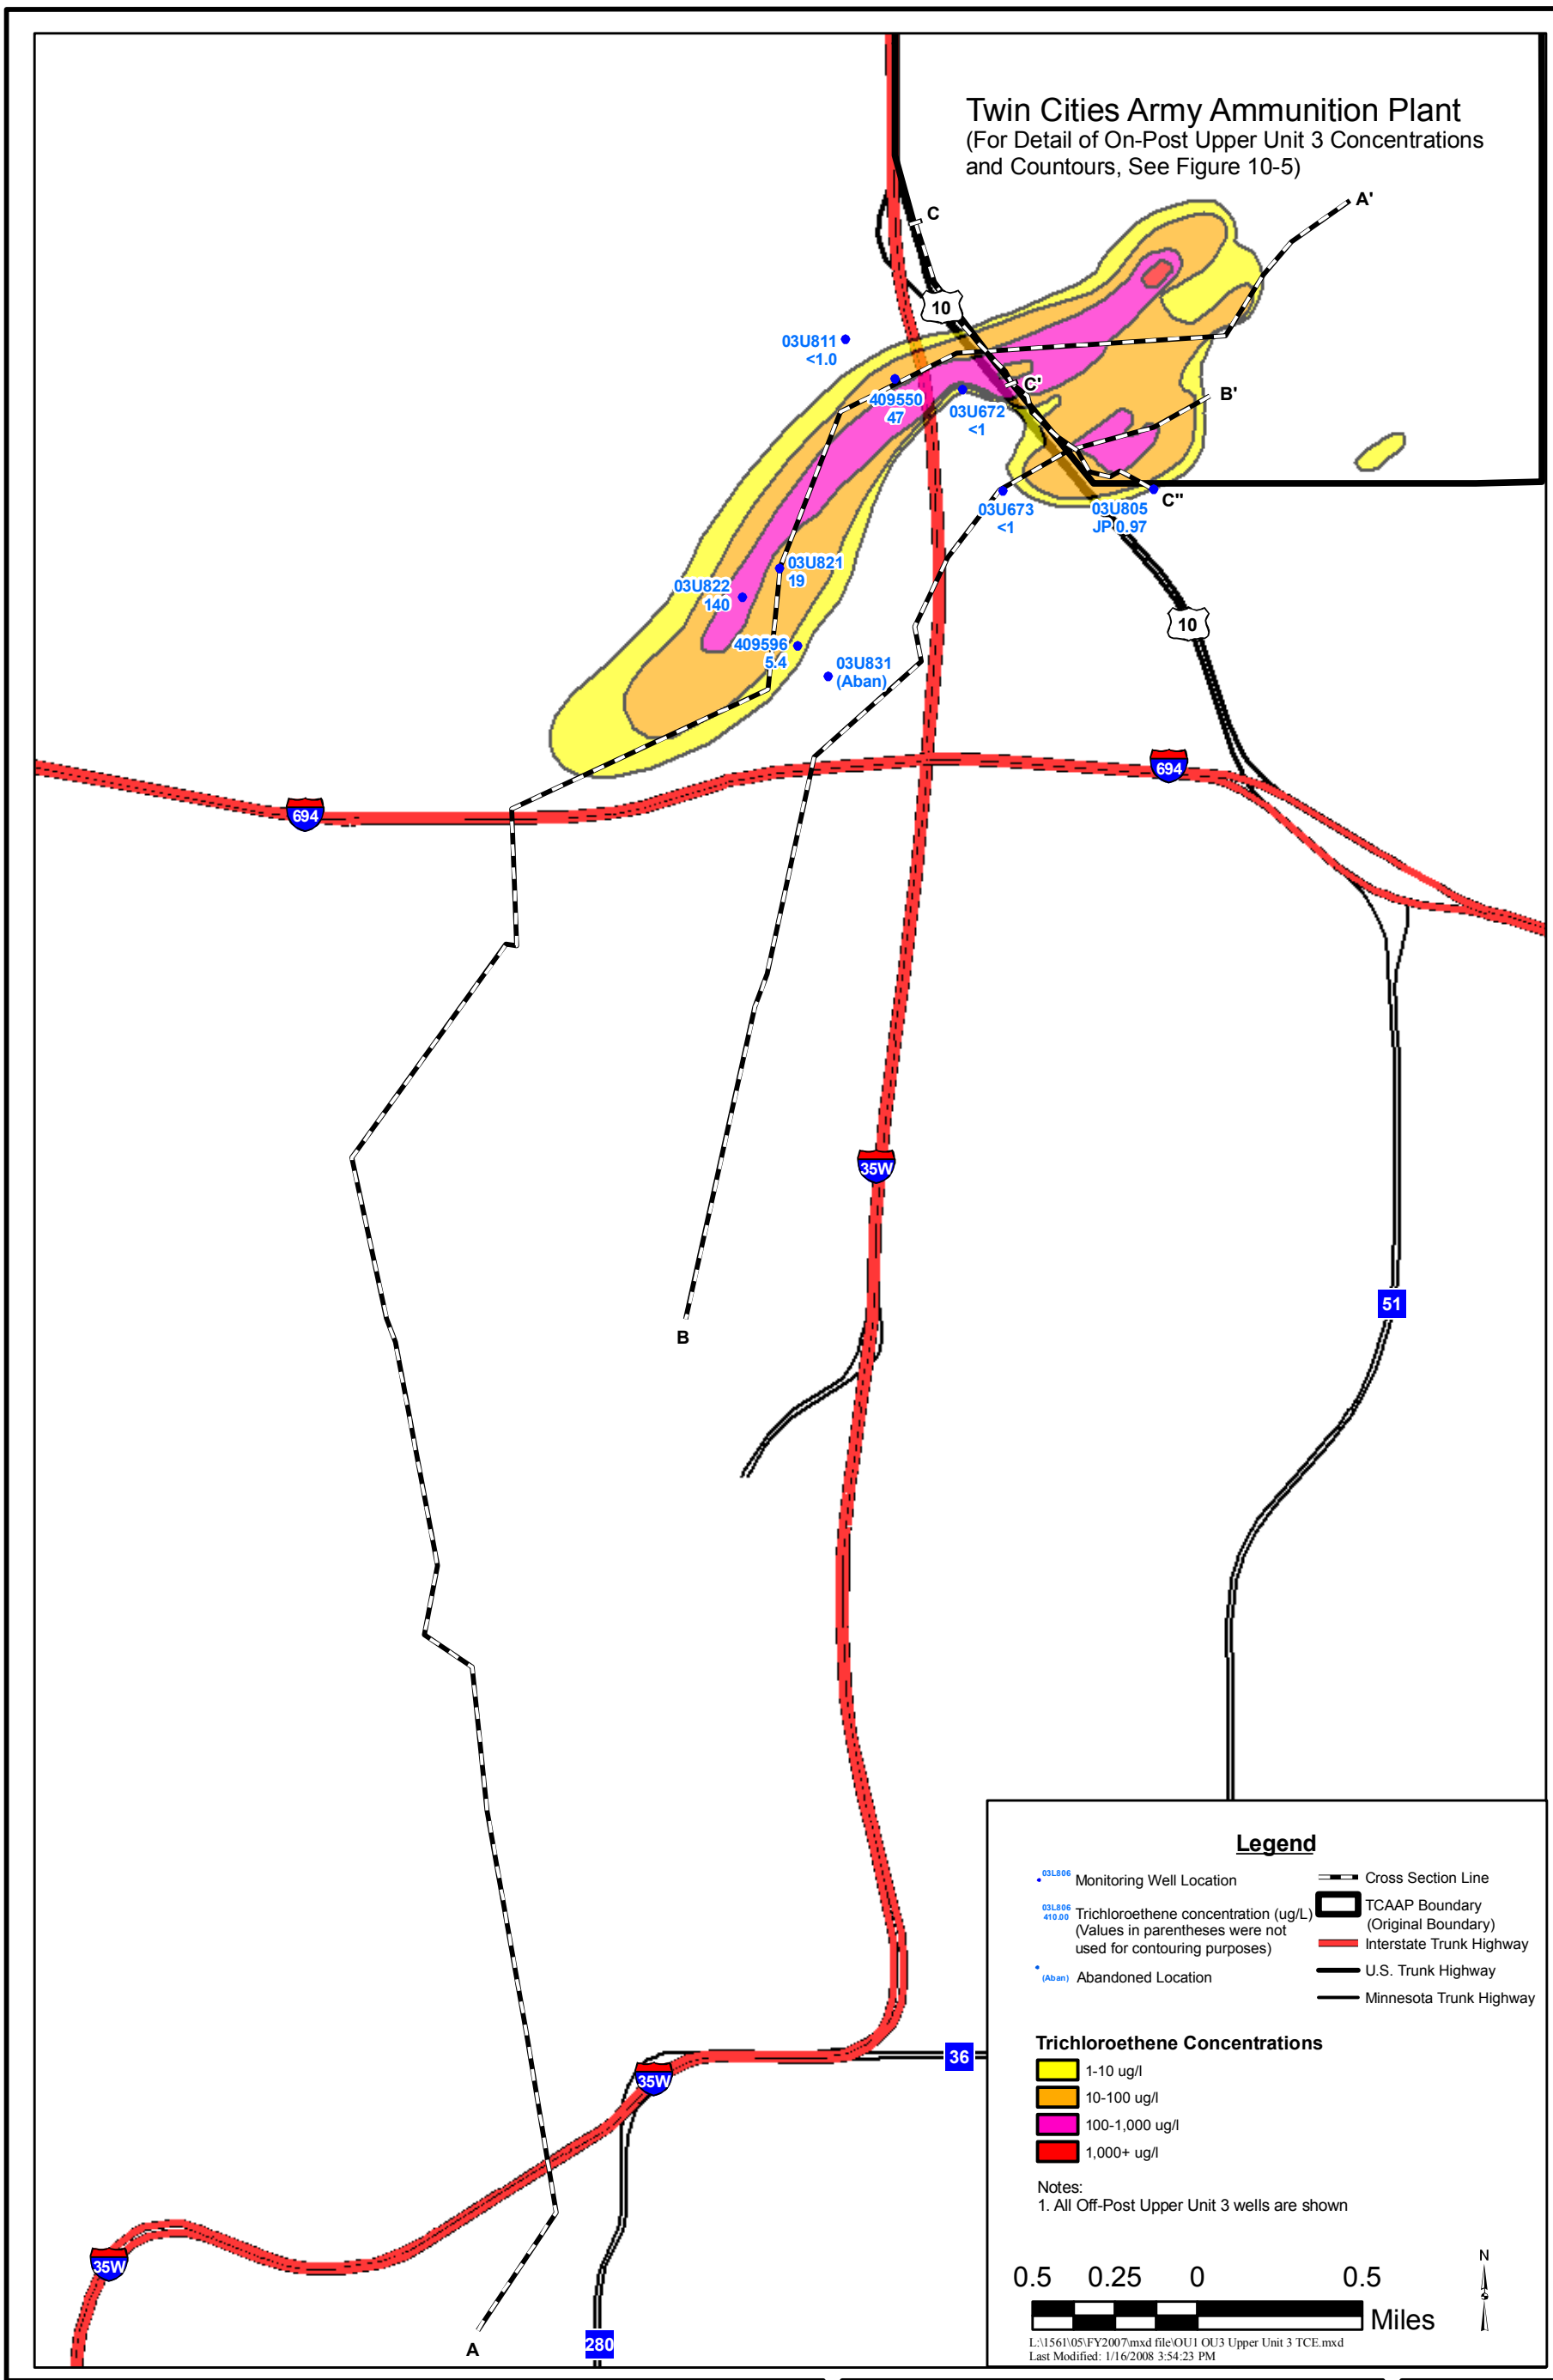

TWIN CITIES ARMY AMMUNTION PLANT

OU1 & OU3, Upper Unit 3, Trichloroethene Isoconcentration Map
Summer 2007

COPYRIGHT

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 3-5

Twin Cities Army Ammunition Plant

(For Detail of On-Post Lower Unit 3 Concentrations and Countours, See Figure 10-6)

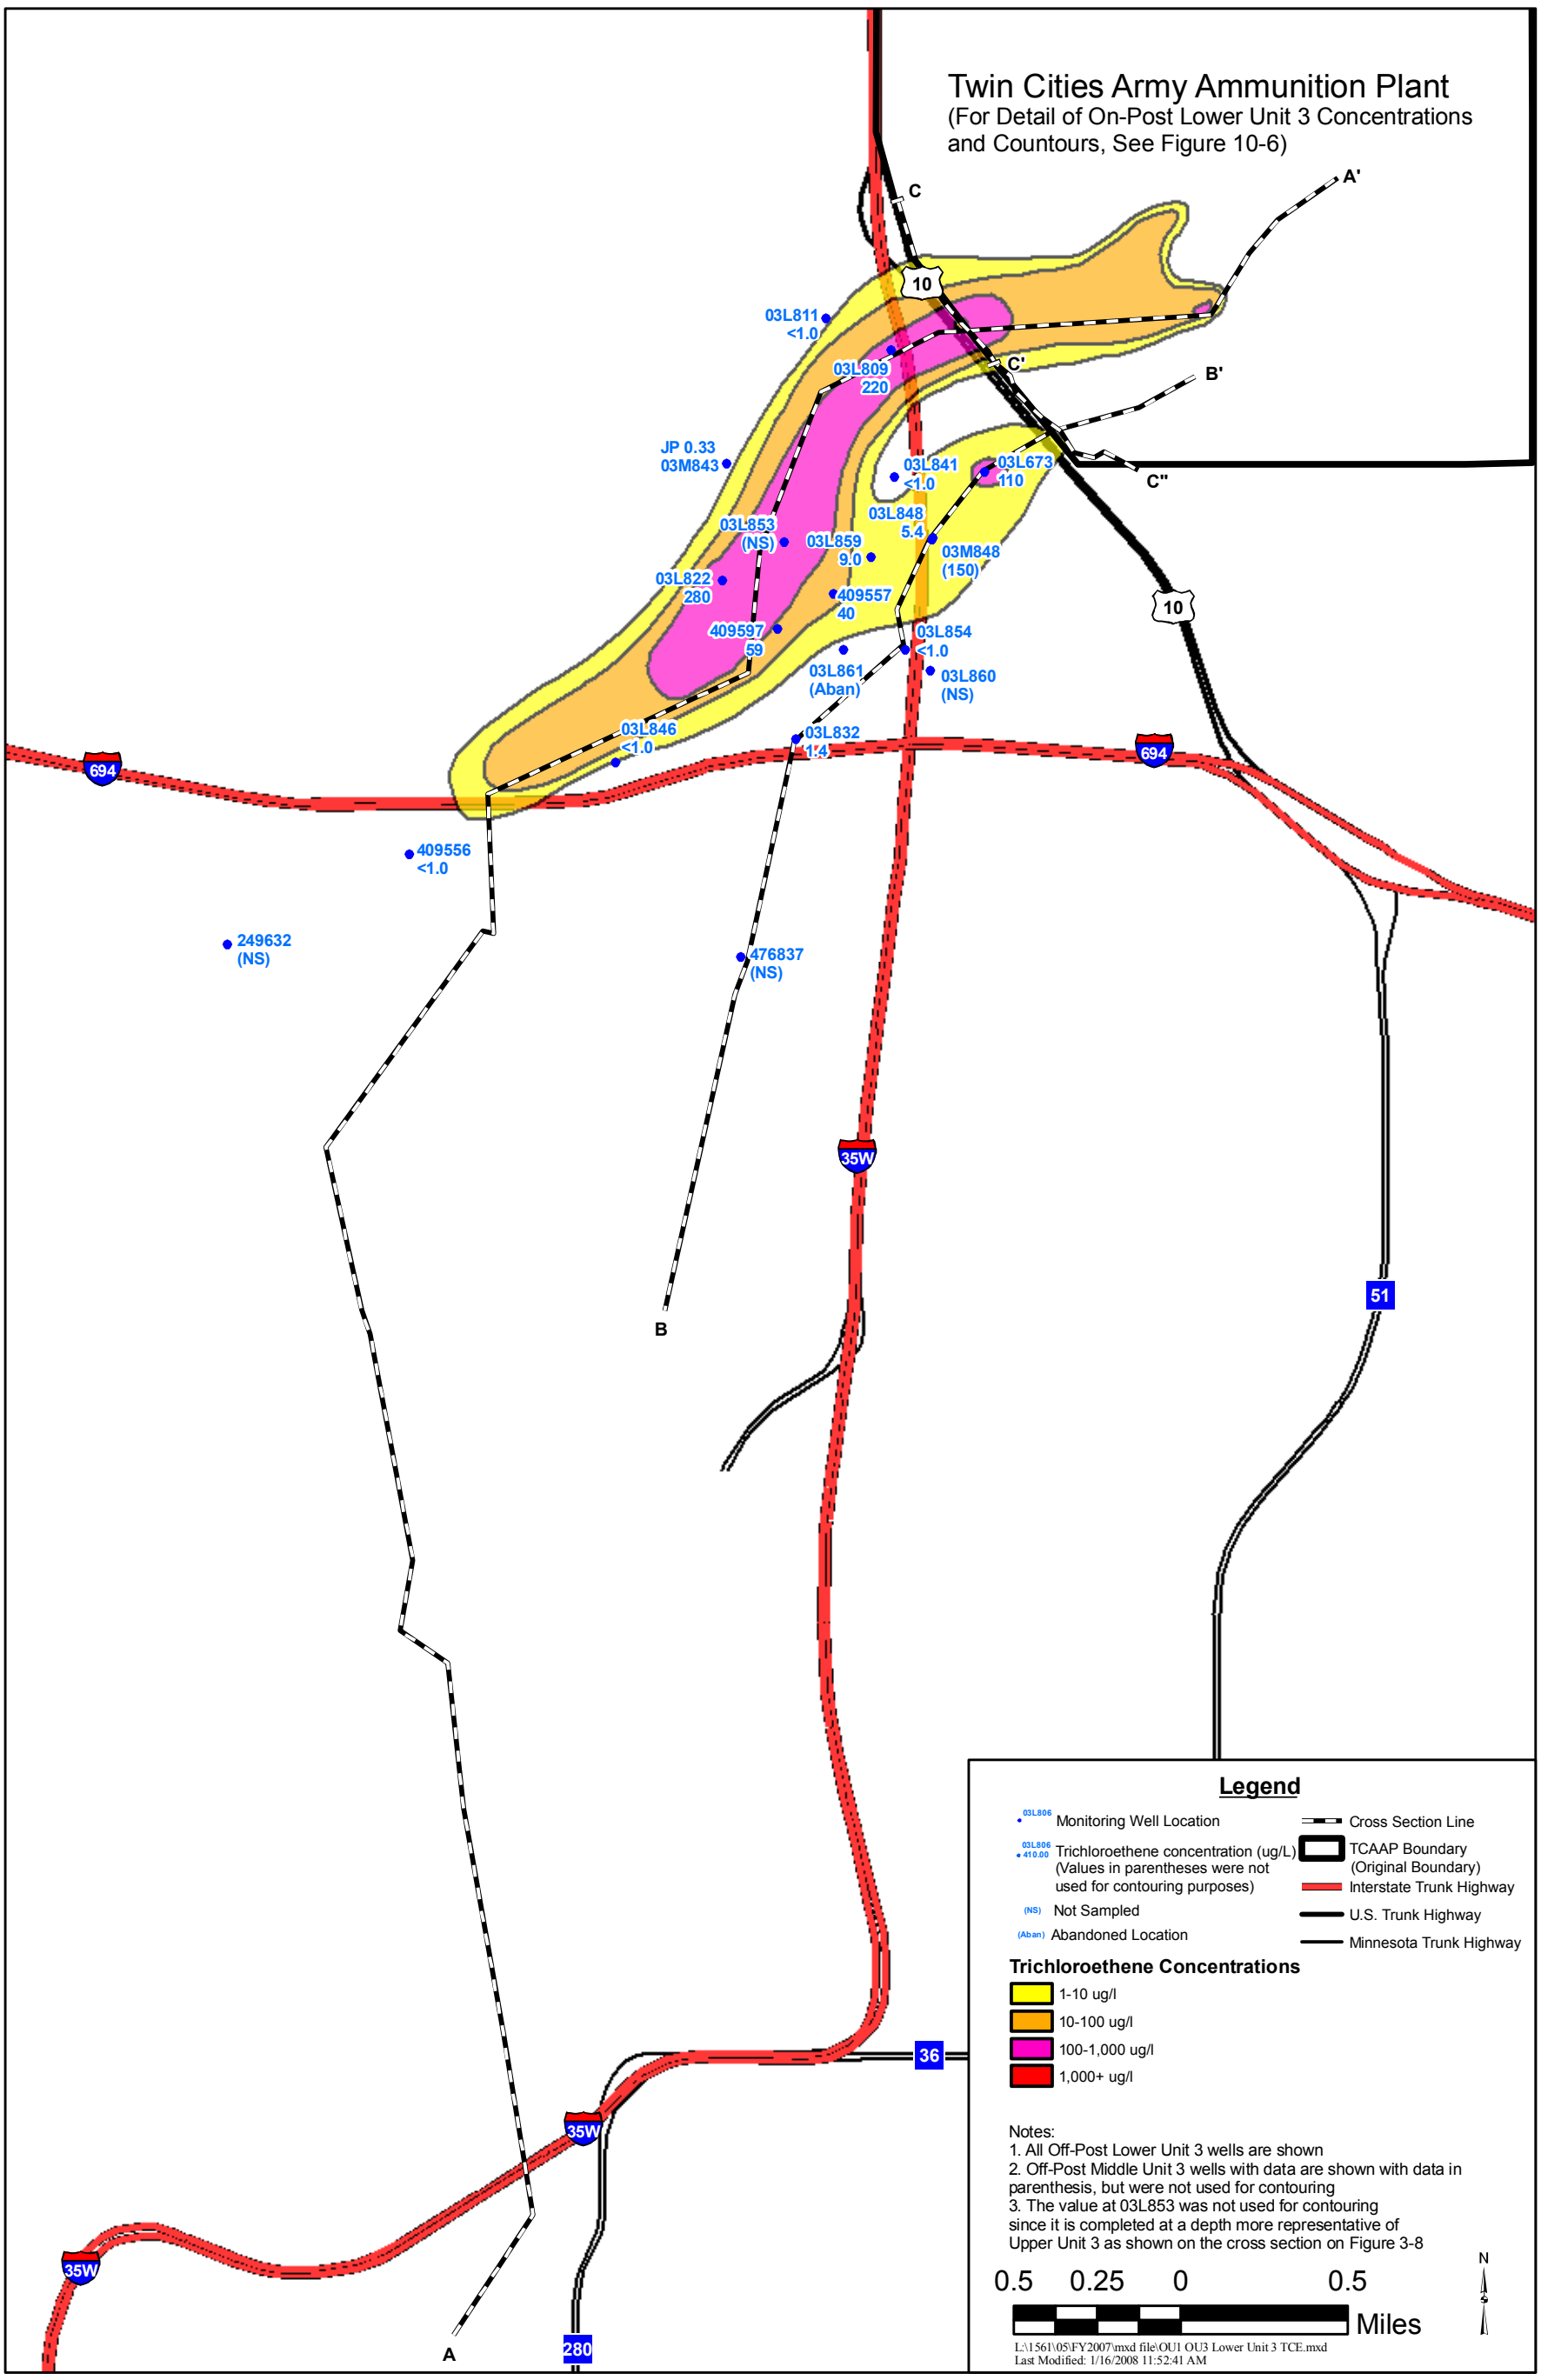

TWIN CITIES ARMY AMMUNTION PLANT

OU1 & OU3, Lower Unit 3, Trichloroethene Isoconcentration Map
Summer 2007

COPYRIGHT

Wenck
Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 3-6

Twin Cities Army Ammunition Plant

(For Detail of On-Post Upper Unit 4 Concentrations and Countours, See Figure 10-7)

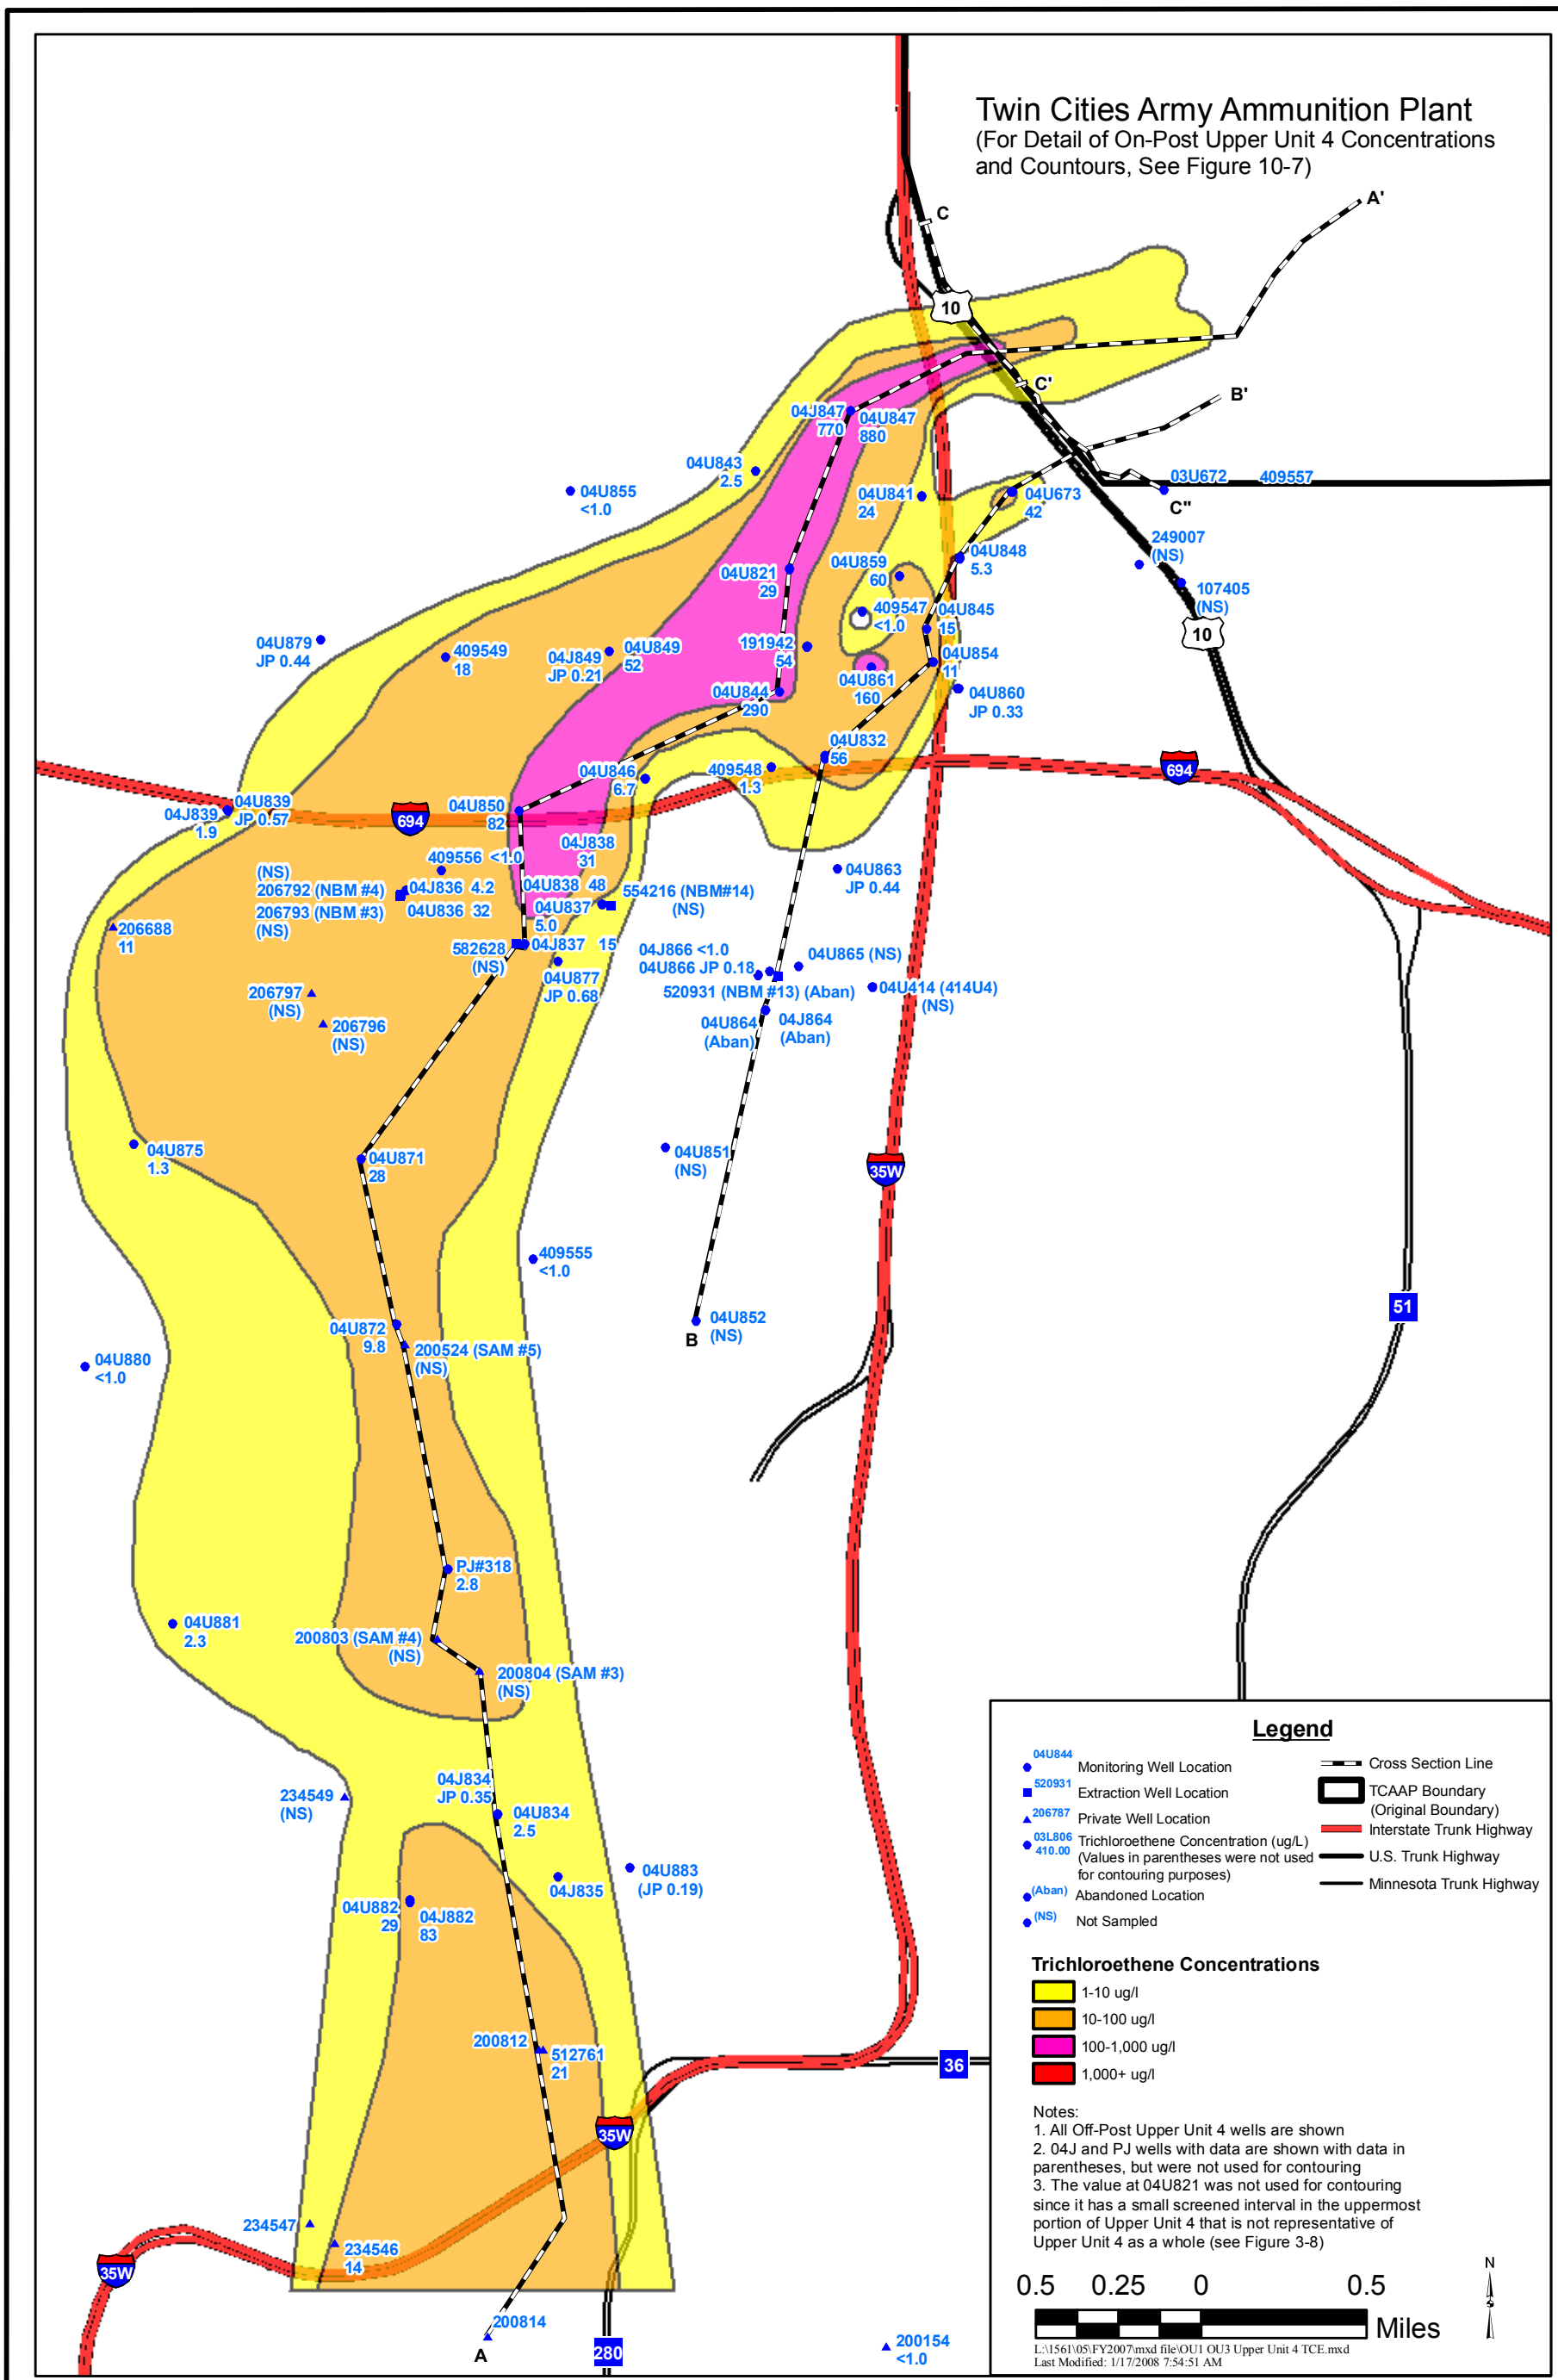

Legend

- 04U844 — Monitoring Well Location
- 520931 — Extraction Well Location
- 206787 — Private Well Location
- 03L806 410.00 — Trichloroethene Concentration (ug/L) (Values in parentheses were not used for contouring purposes)
- (Aban) — Abandoned Location
- (NS) — Not Sampled
- Cross Section Line
- TCAAP Boundary (Original Boundary)
- Interstate Trunk Highway
- U.S. Trunk Highway
- Minnesota Trunk Highway

Trichloroethene Concentrations

- 1-10 ug/l
- 10-100 ug/l
- 100-1,000 ug/l
- 1,000+ ug/l

Notes:
1. All Off-Post Upper Unit 4 wells are shown
2. 04J and PJ wells with data are shown with data in parentheses, but were not used for contouring
3. The value at 04U821 was not used for contouring since it has a small screened interval in the uppermost portion of Upper Unit 4 that is not representative of Upper Unit 4 as a whole (see Figure 3-8)

0.5 0.25 0 0.5 Miles

N

L:\1561\05\FY2007\mxd file\OU1 OU3 Upper Unit 4 TCE.mxd
Last Modified: 1/17/2008 7:54:51 AM

TWIN CITIES ARMY AMMUNTION PLANT

OU1 & OU3, Upper Unit 4, Trichloroethene Isoconcentration Map
Summer 2007

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 3-7

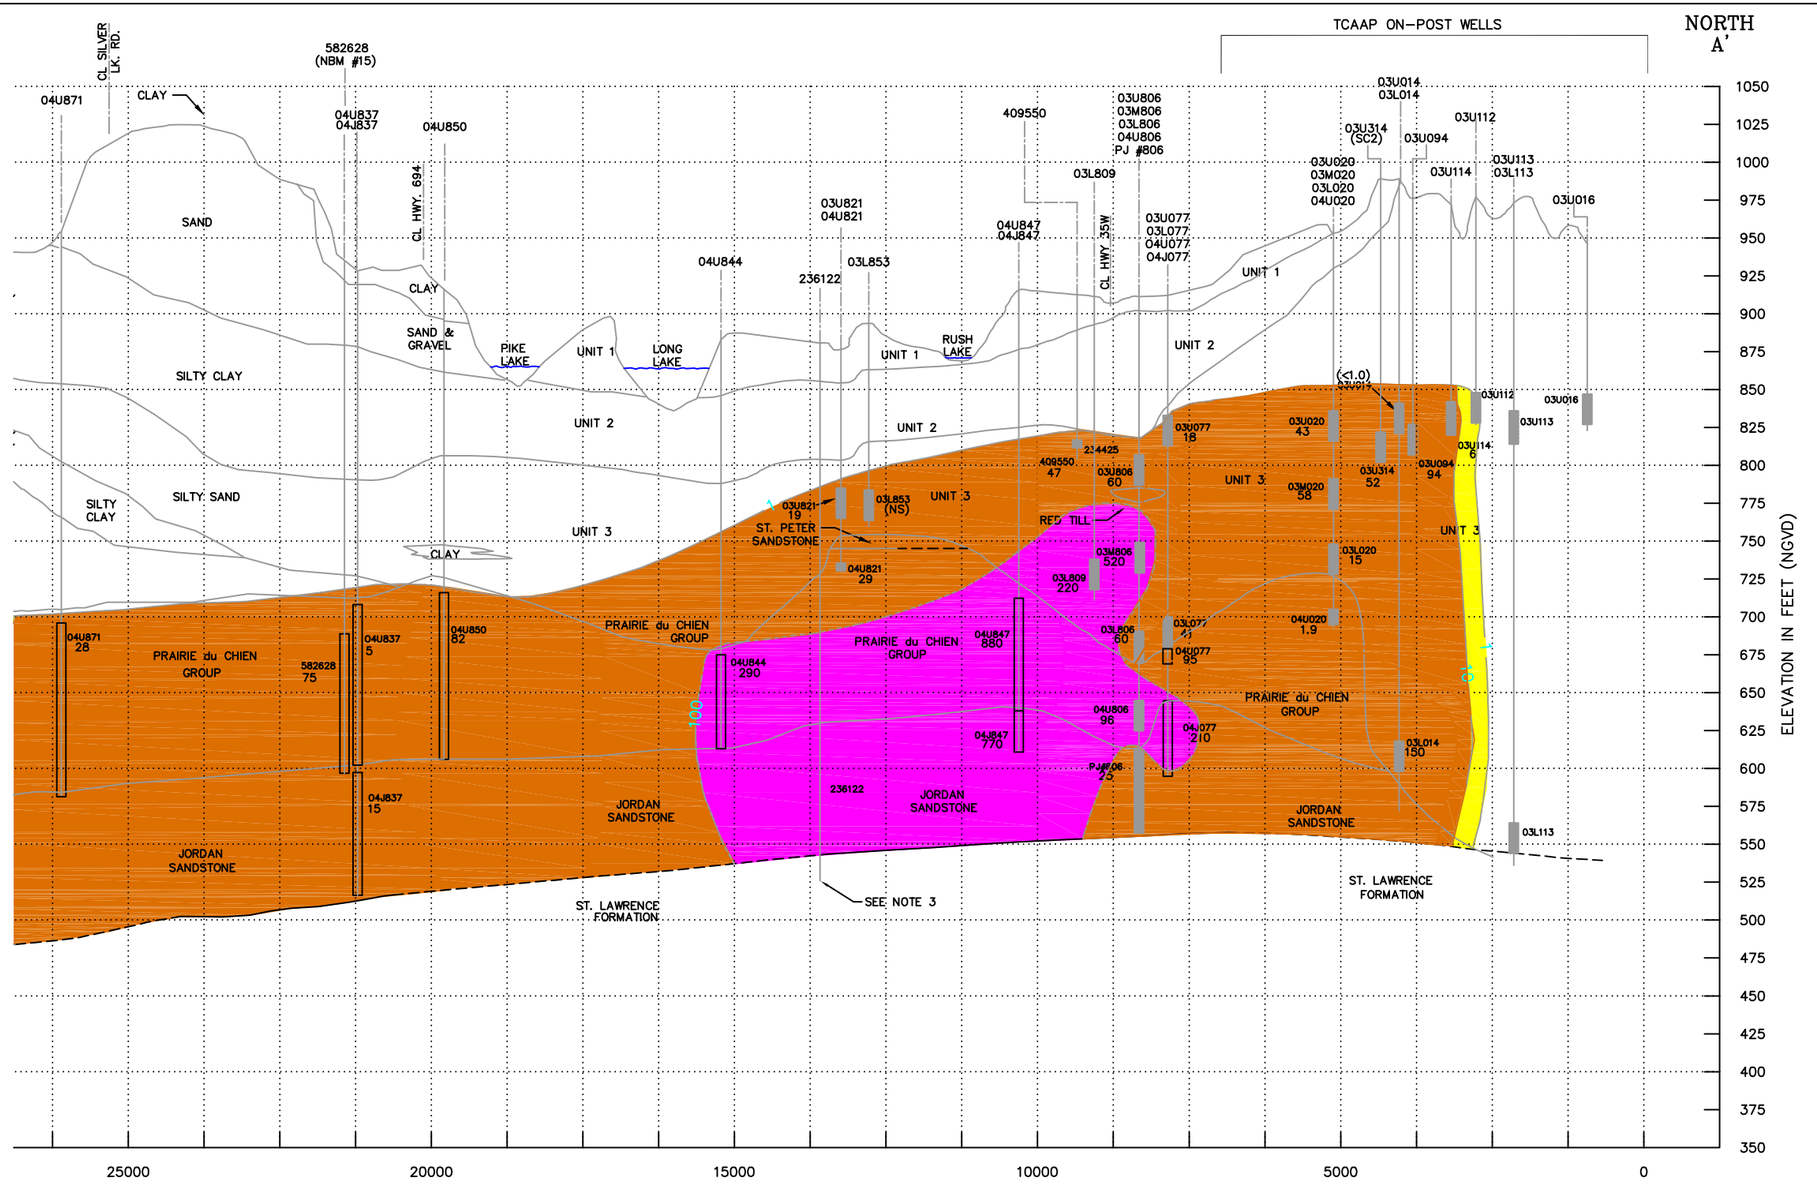

DISTANCE IN FEET

NOTES

(1) CROSS SECTION: TOPOGRAPHY CONSTRUCTED WITH DATA FROM U.S.G.S. NEW BRIGHTON 7.5 MINUTE SERIES QUAD MAP DATED 1967 (PHOTOREVISED 1972, AND 1980); WELL LOCATIONS AND THE "LINE" OF SECTION ARE SHOWN ON FIGURES 3-5 THROUGH 3-7.

(2) WELL NESTS, CONSISTING OF INDIVIDUAL WELLS IN THE SAME PROXIMITY, ARE REPRESENTED ON THE CROSS SECTION BY A SINGLE LINE WITH MULTIPLE WELL SCREENS

(3) WELL 236122 HAS BEEN SEALED, BUT IS SHOWN SINCE IT WAS USED TO PREPARE THE CROSS SECTION

LEGEND

- GEOLOGIC CONTACT
- INFERRED GEOLOGIC CONTACT
- SCREENED INTERVAL OF WELL
- OPEN HOLE INTERVAL OF WELL
- 04U806 2500.00 / 04U847 790.00 — TRICHLOROETHENE CONCENTRATION (ug/l) (VALUES IN PARENTHESES WERE NOT USED FOR CONTOURING PURPOSES)
- 10 — ISOCONCENTRATION CONTOUR (ug/l)
- 10 — ESTIMATED ISOCONCENTRATION CONTOUR (ug/l)
- 04U852 (JP 0.48) — THE VALUE IS ESTIMATED BECAUSE THE VALUE IS BELOW THE REPORTING LIMIT, BUT ABOVE THE METHOD DETECTION LEVEL.
- (NS) — NOT SAMPLED

M: /1561/05/2007/JAN 2007.DWG

TWIN CITIES ARMY AMMUNITION PALN

OU1 TRICHLOROETHENE CROSS-SECTION A-A' (NORTH HALF), SUMMER 2007

COPYRIGHT

Wenck Associates, Inc.
Environmental Engineers
1800 Pioneer Creek Center
Maple Plain, MN 55339

FY 2007

FIGURE 3-8

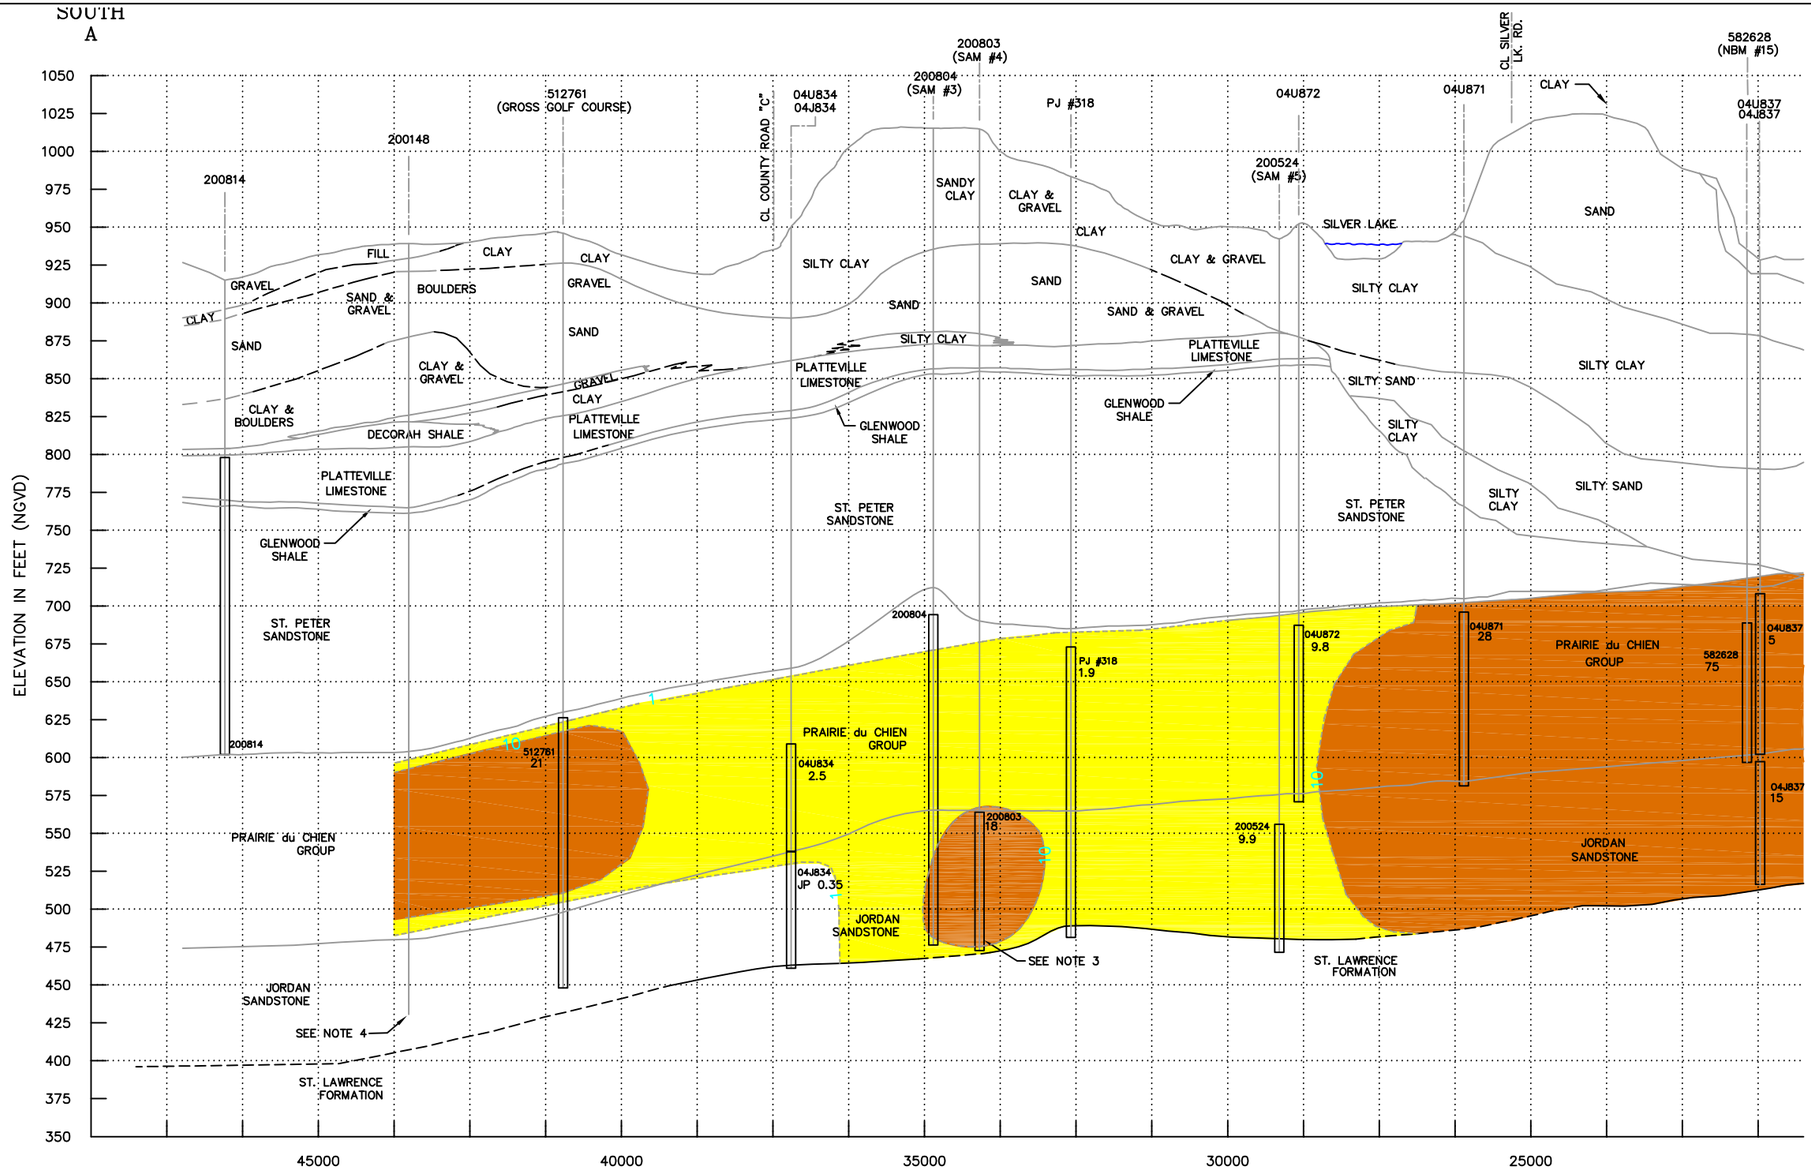

DISTANCE IN FEET

NOTES

(1) CROSS SECTION: TOPOGRAPHY CONSTRUCTED WITH DATA FROM U.S.G.S. NEW BRIGHTON 7.5 MINUTE SERIES QUAD MAP DATED 1967 (PHOTOREVISED 1972, AND 1980); WELL LOCATIONS AND THE "LINE" OF SECTION ARE SHOWN ON FIGURES 3-5 THROUGH 3-7.

(2) WELL NESTS, CONSISTING OF INDIVIDUAL WELLS IN THE SAME PROXIMITY, ARE REPRESENTED ON THE CROSS SECTION BY A SINGLE LINE WITH MULTIPLE WELL SCREENS

(3) NO INFORMATION WAS PROVIDED ON THE WELL LOG FOR 200803 (SAM #4) CONCERNING WELL CONSTRUCTION DETAILS, ESPECIALLY THE OPEN HOLE INTERVAL. AS THIS IS REFERRED TO AS A JORDAN WELL, THE OPEN HOLE WAS ASSUMED TO EXTEND FROM THE TOP OF THE JORDAN TO THE BOTTOM OF THE BOREHOLE.

(4) WELL 200148 HAS BEEN SEALED, BUT IS SHOWN SINCE IT WAS USED TO PREPARE THE CROSS SECTION

LEGEND

GEOLOGIC CONTACT

INFERRED GEOLOGIC CONTACT

SCREENED INTERVAL OF WELL

OPEN HOLE INTERVAL OF WELL

04U808 2500.00
04U847 790.00
TRICHLOROETHENE CONCENTRATION (ug/l) (VALUES IN PARENTHESES WERE NOT USED FOR CONTOURING PURPOSES)

10 ISOCONCENTRATION CONTOUR (ug/l)

10 ESTIMATED ISOCONCENTRATION CONTOUR (ug/l)

04U852 (JP 0.48) THE VALUE IS ESTIMATED BECAUSE THE VALUE IS BELOW THE REPORTING LIMIT, BUT ABOVE THE METHOD DETECTION LEVEL.

M: /1561/05/2007/JAN 2007.DWG

TWIN CITIES ARMY AMMUNITON PLANT

OU1 TRICHLOROETHENE CROSS-SECTION A-A' (SOUTH HALF), SUMMER 2007

COPYRIGHT

Wenck Associates, Inc.
Environmental Engineers
1800 Pioneer Creek Center
Maple Plain, MN 55339

FY 2007

FIGURE 3-9

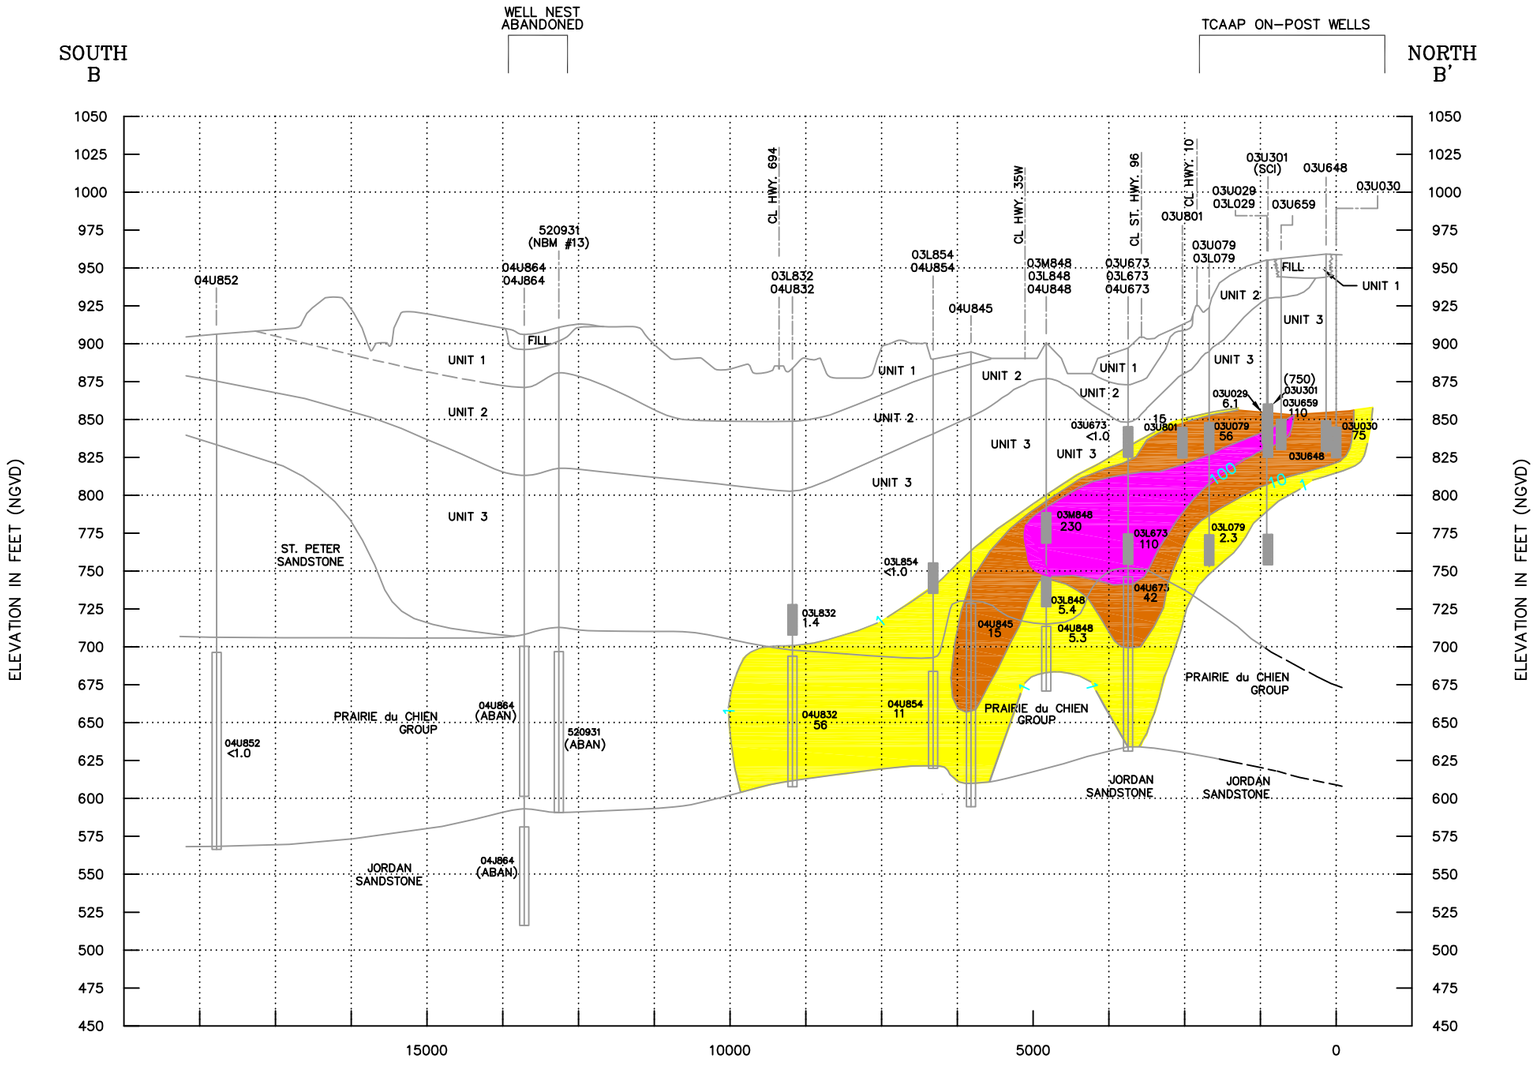

DISTANCE IN FEET

NOTES

(1) CROSS SECTION: TOPOGRAPHY CONSTRUCTED WITH DATA FROM U.S.G.S. NEW BRIGHTON 7.5 MINUTE SERIES QUAD MAP DATED 1967 (PHOTOREVISED 1972, AND 1980); WELL LOCATIONS AND THE "LINE" OF SECTION ARE SHOWN ON FIGURES 3-5 THROUGH 3-7.

(2) WELL NESTS, CONSISTING OF INDIVIDUAL WELLS IN THE SAME PROXIMITY, ARE REPRESENTED ON THE CROSS SECTION BY A SINGLE LINE WITH MULTIPLE WELL SCREENS

(3) NO INFORMATION WAS AVAILABLE ON THE WELL LOG FOR 03U029 AND 03U673 CONCERNING WELL CONSTRUCTION DETAILS, ESPECIALLY THE SCREENED INTERVALS. THE SCREENED INTERVALS FOR THESE WELLS WERE ASSUMED TO BE SIMILAR TO OTHER NEARBY UPPER UNIT 3 WELLS.

LEGEND

- GEOLOGIC CONTACT
- INFERRED GEOLOGIC CONTACT
- SCREENED INTERVAL OF WELL
- OPEN HOLE INTERVAL OF WELL
- 04U806 2500.00 / 04U847 790.00 — TRICHLOROETHENE CONCENTRATION (ug/l) (VALUES IN PARENTHESES WERE NOT USED FOR CONTOURING PURPOSES)
- 10 — ISOCONCENTRATION CONTOUR (ug/l)
- 10 — ESTIMATED ISOCONCENTRATION CONTOUR (ug/l)
- 04U852 (JP 0.48) — THE VALUE IS ESTIMATED BECAUSE THE VALUE IS BELOW THE REPORTING LIMIT, BUT ABOVE THE METHOD DETECTION LEVEL.
- (ABAN) — ABANDONED

M: /1561/05/2007/JAN 2007.DWG

TWIN CITIES ARMY AMMUNITION PLANT

OU1 TRICHLOROETHENE CROSS-SECTION B-B', SUMMER 2007

COPYRIGHT

Wenck Associates, Inc.
Environmental Engineers
1800 Pioneer Creek Center
Maple Plain, MN 55339

FY 2007

FIGURE 3-10

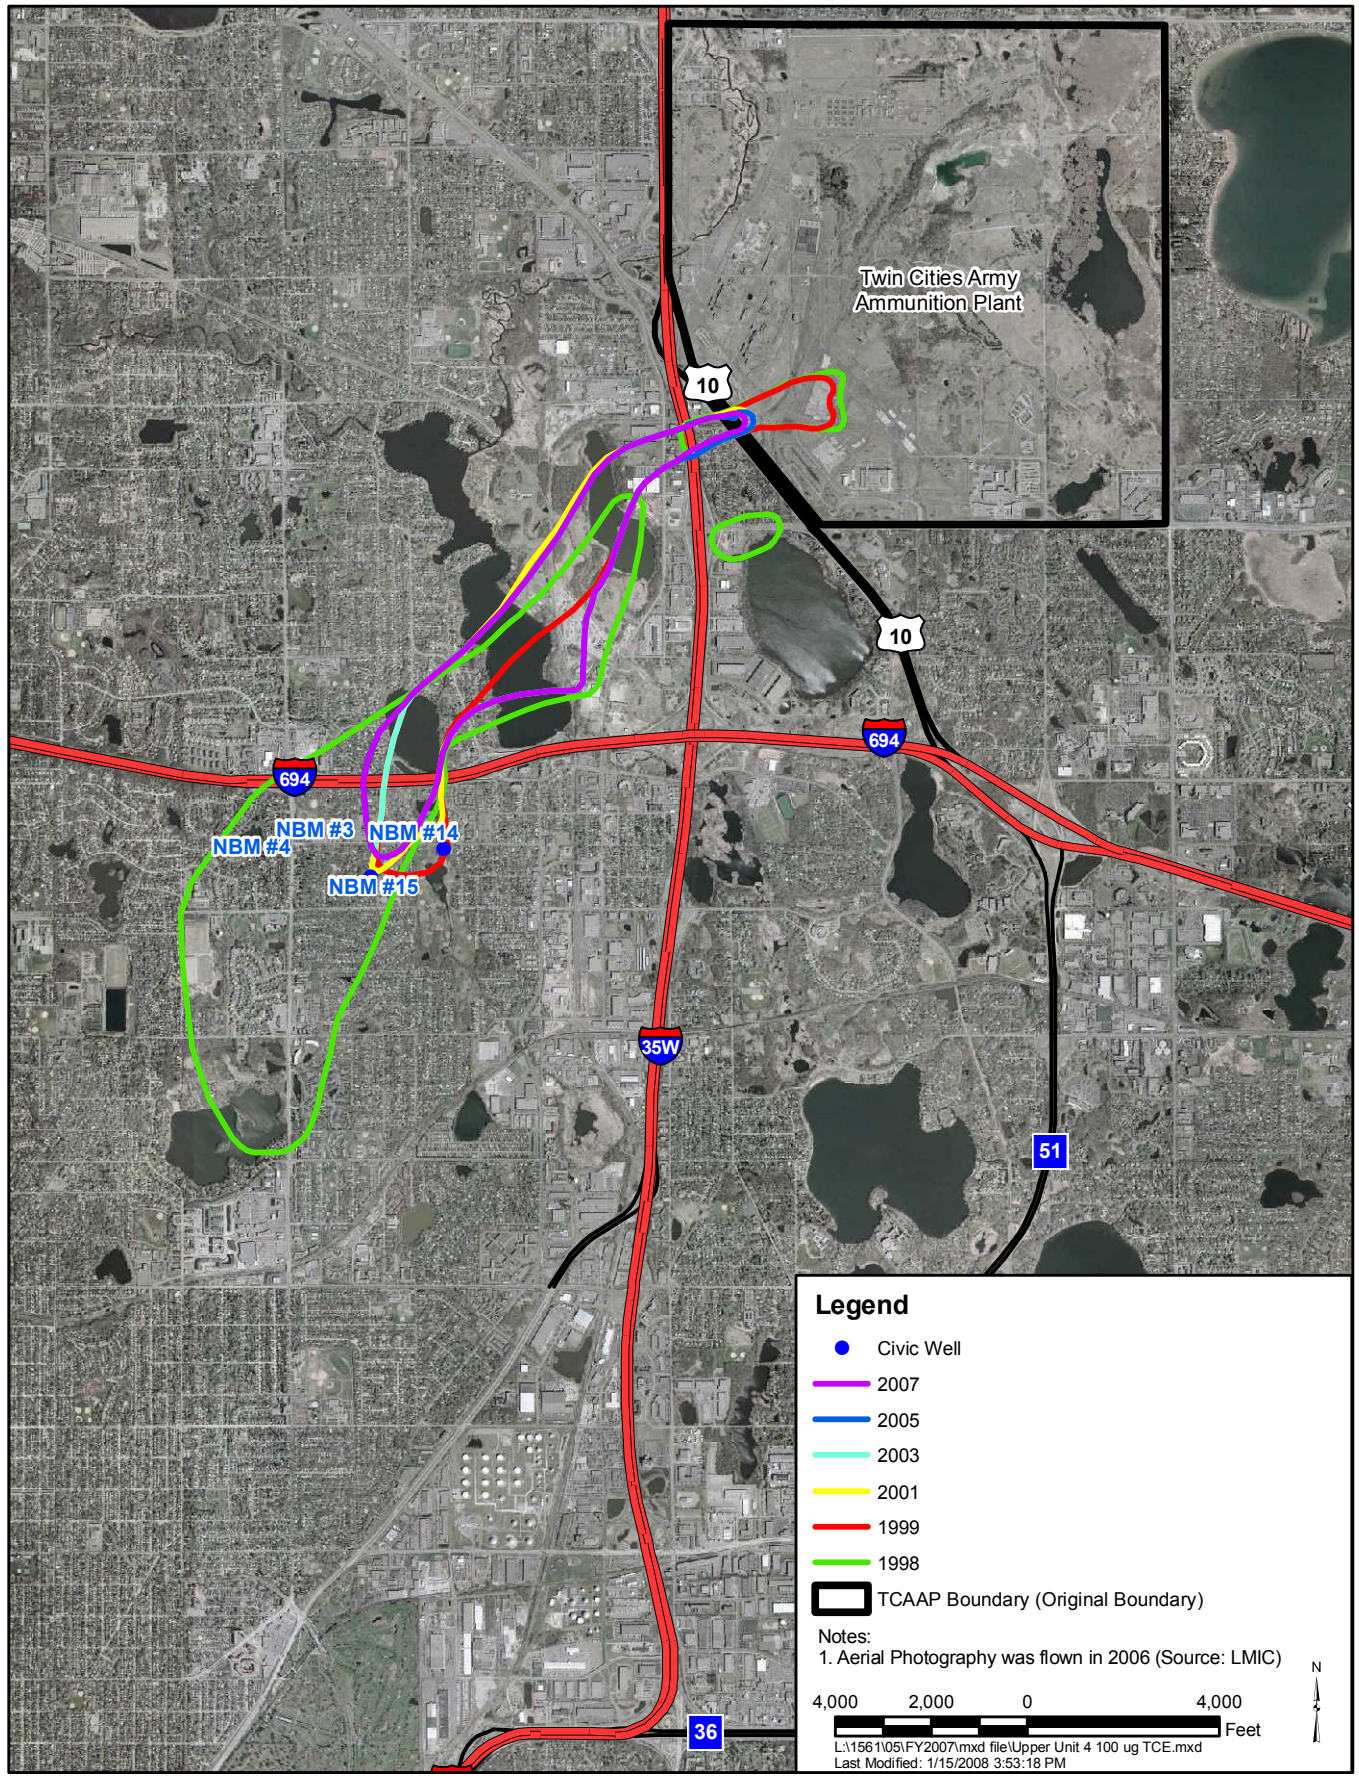

TWIN CITIES ARMY AMMUNTION PLANT

Upper Unit 4,
100 ug/l Trichloroethene Isoconcentration Map

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 3-11

FIGURE 3-12
OU1, NBCGRS MASS REMOVAL HISTORY
Twin Cities Army Ammunition Plant

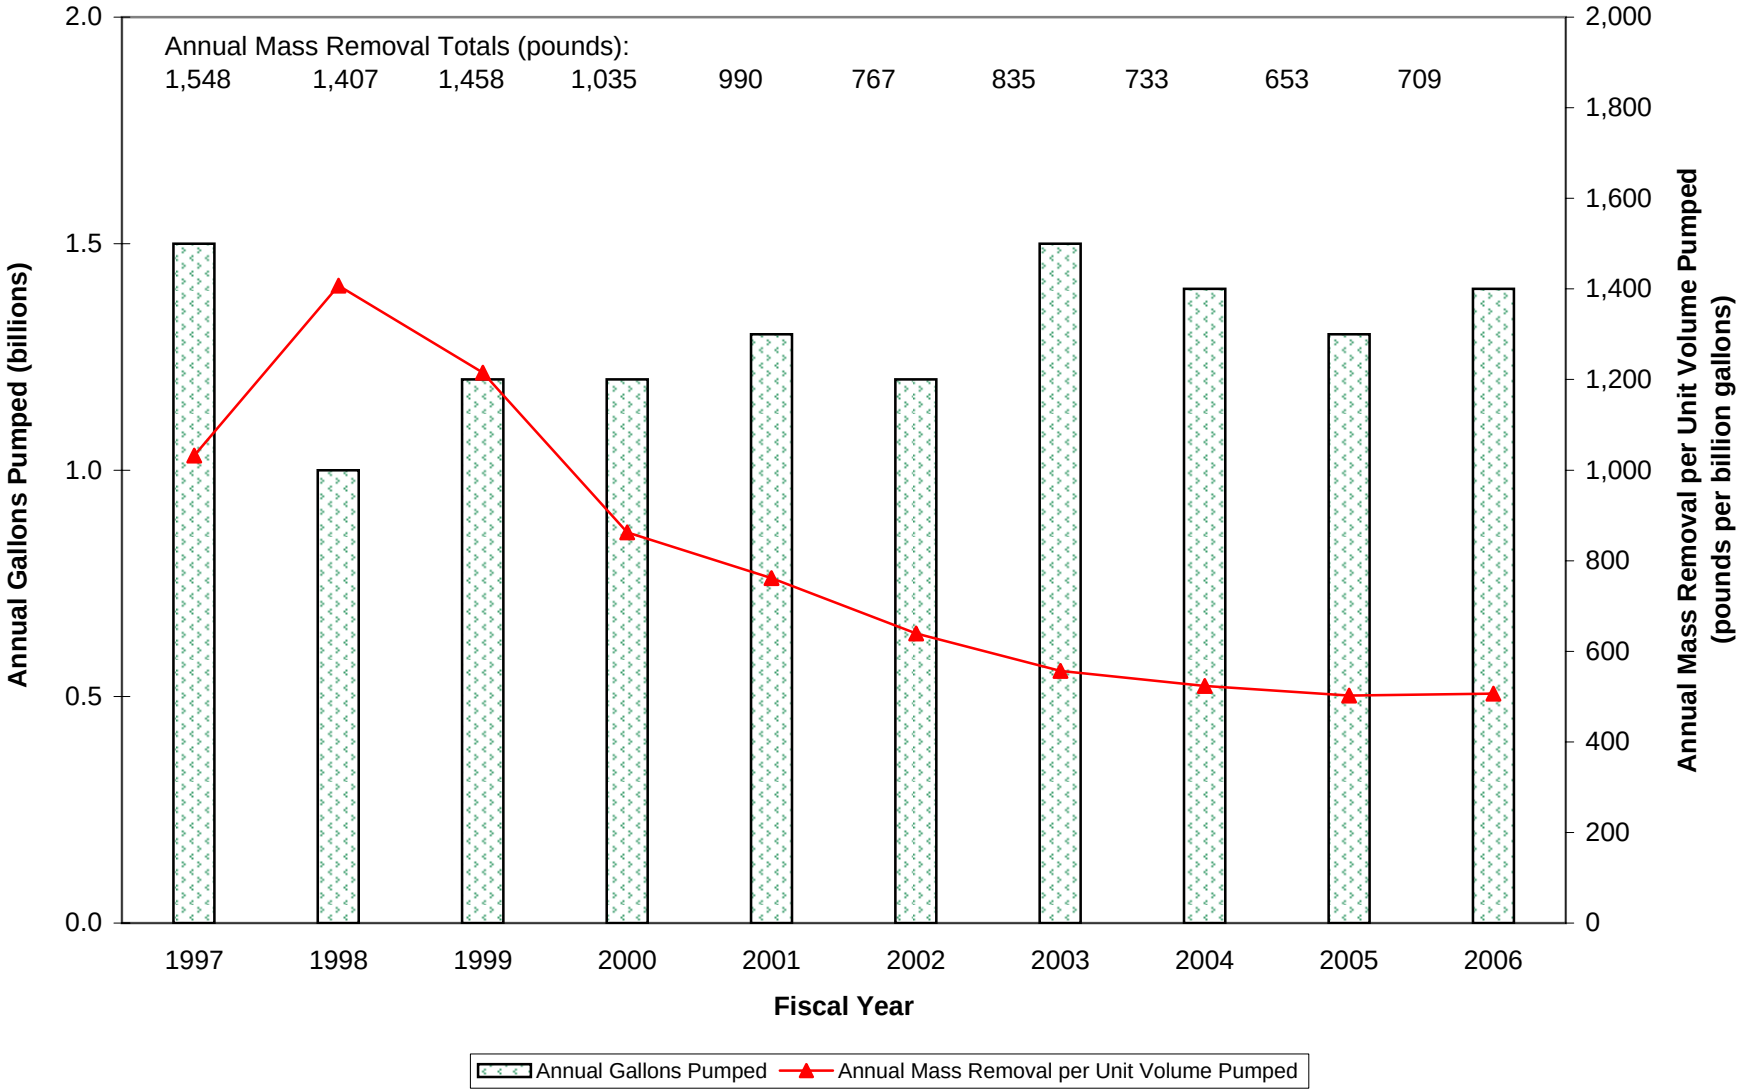

T:\1561\FY 2007 APR\Final\Figures\Figure 3-12

Wenck Associates, Inc.

4.0 Operable Unit 2: Shallow Soil Sites

The reference for the OU2 ROD is:

Twin Cities Army Ammunition Plant
New Brighton/Arden Hills Superfund Site
Operable Unit 2
RECORD OF DECISION
1997, Amended 2007

The 2007 ROD Amendment pertains to Site C, discussed in Section 7.0.

Section 1.4 of the ROD prescribes major remedy components for each of four media as described in Sections 4.0 through 9.0 of this report. Section 4.0 addresses the shallow soil sites.

Through the Remedial Investigation/Feasibility Study (RI/FS) process, Sites A, C, E, H, 129-3, and 129-5 were found to have inorganic and/or organic contaminants above the cleanup goals specified in Table 1 of the OU2 ROD. Unpermitted landfills, or dumps, were identified within Sites A, B, E, H, and 129-15. The OU2 ROD (page 2) describes nine remedy components to address the shallow soil sites. Site C is addressed separately in Section 7.0.

4.1 REMEDY COMPONENTS #1 THROUGH 7: SOIL REMEDIATION

Description: These seven components collectively address the characterization, excavation, sorting, treatment, disposal, site restoration, and site access restrictions for the shallow soils and dumps at Sites A, E, H, 129-3, and 129-5.

Performance Standard (how do you know when you're done):

When the soils at these sites have been remediated such that the contaminant concentrations are below the cleanup levels specified in Table 1 of the OU2 ROD.

Are these remedy components being implemented?

Yes. Soil remediation field work was completed at Sites A, E, H, 129-3, and 129-5 prior to FY 2005. The Closeout Reports for each of these sites (prepared by Shaw Environmental & Infrastructure, Inc. (Shaw)) has received regulatory approval, but final consistency will not be provided until concurrence on the land use control section of each report has been reached between the Army and the regulators (see Section 12.0 for information on land use controls).

Are any changes or additional actions required for this remedy component?

Yes. Land use control issues need to get resolved in order to complete final consistency approval on the various closeout reports.

4.2 REMEDY COMPONENT #8: GROUNDWATER MONITORING

Description: "Five-year period of groundwater monitoring to verify no adverse remedy impacts at Sites A, C, E, H, 129-3, and 129-5." (OU2 ROD, page 2)

Performance Standard (how do you know when you're done):

When five years have elapsed with groundwater monitoring results below the groundwater cleanup levels.

Is this remedy component being implemented?

Yes. The intent of this remedy component is to verify that soil remediation activities did not somehow cause impacts to groundwater. As such, the five-year monitoring period was intended to start after completion of remedy components #1 through #7 described in the previous section. With the exception of Site C, the shallow soil remediation has been completed and this

groundwater monitoring component was started in FY 2003. As discussed in Section 5.7, shallow soil remediation work was also completed at Site D (for non-VOC contaminants) in early FY 2003, and the Closeout Report (prepared by Shaw) indicated that Site D should also be monitored for any impacts to groundwater that could have resulted from soil remediation activities. Site D was, therefore, added to the list of sites to be monitored under this remedy component.

The monitoring plan for each of the sites is presented below (these monitoring activities are included in the monitoring plan for groundwater monitoring wells presented in Appendix A.1). In general, the well most likely to be affected from a hypothetical release from the soil was selected for each Site. Thus, several wells are in the middle of the Site, since this would be the most likely location to see an impact under an assumption that impact would be due to vertical leaching from the soil. A monitoring well in the first encountered aquifer was selected at each Site. For Sites A and H, Unit 1 wells were selected. At Sites on the kame (D, E, 129-3, and 129-5), where Unit 1 is not present, upper Unit 3 wells were selected. The groundwater parameter list for each Site mirrors the chemicals of concern in soil for the respective Site.

There are no groundwater cleanup standards in the ROD for the chemicals of concern in soils at these Sites, with the exception of antimony at Site A, so the data collected under this monitoring program are screened against TCAAP background values that were developed during the OU2 Feasibility Study (as presented in the OU2 ROD). For chemicals not expected to be naturally occurring (VOCs and explosives), the results are screened against the Minnesota Health Risk Limits (HRLs). Since there are not any expected groundwater impacts, the screening will serve to identify possible concerns.

Monitoring Plan:

Site A

Monitoring point: 01U119

Rationale for selected location: Well is located in Unit 1 near to and downgradient of the area of soil excavation at Site A.

Parameters: Antimony, barium, copper, lead

Frequency: Annual

Site C

Shallow groundwater at Site C is known to be impacted and there is an ongoing Corrective Action for Site C groundwater. See Section 7.0 below.

Site D

Monitoring point: 03U093

Rationale for selected location: Well is a shallow Unit 3 well (the first encountered aquifer) located near and downgradient of the soil remediation area.

Parameters: Antimony, lead, nitroglycerine

Frequency: Annual

Site E

Monitoring point: 03U089

Rationale for selected location: Well is a shallow Unit 3 well (the first encountered aquifer) located near and downgradient of the soil remediation area.

Parameters: Antimony, barium, copper, lead, manganese

Frequency: Annual

Site H

Monitoring point: 01U060

Rationale for selected location: Well is on the downgradient edge of Site H and is also the only available Unit 1 monitoring well at the Site.

Parameters: Antimony, arsenic, copper, lead, manganese

Frequency: Annual

129-3

Monitoring point: 03U087

Rationale for selected location: Well is a Unit 3 well (the first encountered aquifer) located in the center of the Site and below the area of soil remediation.

Parameters: Antimony, lead, manganese, nitroglycerine, VOCs

Frequency: Annual

129-5

Monitoring point: 03U097

Rationale for selected location: Well is a Unit 3 well (the first encountered aquifer) located in the center of the Site and below the area of soil remediation.

Parameters: Antimony, barium, lead

Frequency: Annual

Monitoring Results for FY 2007:

Results for the June 2007 sampling event are summarized in Table 4-1 (see Section 7.0 for discussion of Site C). There were no exceedances of screening criteria at Sites A, D, E, 129-3, or 129-5. At Site H, copper exceeded the background value (8.48 µg/l versus background of 4 µg/l). This well showed similar results in the past (e.g., 9.38 µg/l in FY 2006). The HRL for copper is 1,000 µg/l. The surface water chronic standard would fall between 6.3 and 23 µg/l, depending on hardness. Thus, the groundwater results are above the lower end of the surface water standard range (hardness is not available for FY 2007). The Tier II Ecological Risk Assessment Report

(USACHPPM, Final Report, December 2004) evaluated metals, including copper in Sunfish Lake (the surface water body at Site H). Copper was eliminated as a contaminant of concern based on water and sediment sampling in Sunfish Lake. Other metals that were retained were eliminated as concerns later in the Tier II Assessment.

Although the Tier II Risk Assessment did not show evidence of any copper related effects in Sunfish Lake, the surface water chronic standard still applies. Copper in groundwater will continue to be monitored and surface water hardness in Sunfish Lake will be added to the monitoring plan.

Manganese was above the Minnesota HRL at Site H, but well below the background for the Unit 1 aquifer at TCAAP.

Are any changes or additional actions required for this remedy component? Yes. Monitoring at Sites A, D, E, 129-3, or 129-5 will be discontinued and this remedy component is now complete for these sites. The monitoring plan in Appendix A.1 reflects this change. Monitoring at Site H will continue due to the exceedances of surface water criteria for copper. Hardness will be added to the analytical methods to determine if the surface water criterion is actually being exceeded. This was also proposed in the FY 2006 report but it wasn't finalized until after the June 2007 sampling round was complete.

4.3 REMEDY COMPONENT #9: CHARACTERIZATION OF DUMPS

Description: "Characterization of dumps at Sites B and 129-15 to determine their contents. If contents are found to be toxic, hazardous, or contaminated, then a remedy for the landfill will be utilized and documented through a post-ROD amendment. If the contents are not toxic, hazardous or contaminated, a no further action remedy would be employed." (OU2 ROD, page 2)

Performance Standard (how do you know when you're done):

When characterization has been sufficient to determine if the contents are toxic, hazardous, or contaminated, and if they are, when the remedy is in place.

Is this remedy component being implemented?

Yes. Field work was performed at both sites in early FY 1999. At Site B, characterization revealed that a no further action remedy was appropriate. A Closeout Report (prepared by Stone & Webster) received consistency in FY 2001 ("Site B Dump Investigation, Characterization, and Closeout Report"). At Site 129-15, characterization led to construction of a soil cover in FY 2002. The Closeout Report for Site 129-15 (prepared by Shaw) received regulatory approval in FY 2003, but final consistency will not be provided until concurrence on the land use control section of each report has been reached between the Army and the regulators (see Section 12.0 for information on land use controls). A modification to the ROD that will document the remedy selection for Site 129-15 was being prepared at the end of FY 2007.

Are any changes or additional actions required for this remedy component? No.

Table 4-1
Groundwater Quality Data for OU2 Shallow Soil Site
5-Year Groundwater Monitoring

Fiscal Year 2007

	Unit 1 Wells		Unit 3 Wells					TCAAP	TCAAP	
	01U060 (Site H)	01U119 (Site A)	03U087 (Site 129-3)	03U087 D (Site 129-3)	03U089 (Site E)	03U093 (Site D)	03U097 (Site 129-5)	Unit 1 GW Background [1]	Units 3/4 GW Background [1]	MDH HRL
	6/21/07	6/21/07	6/20/07	6/20/07	6/20/07	6/19/07	6/20/07			
VOCs (ug/L)										
1,1,1-Trichloroethane			<1					None	None	200
1,1,2,2-Tetrachloroethane			<1					None	None	2
1,1,2-Trichloroethane			<1					None	None	3
1,1-Dichloroethane			<1					None	None	70
1,1-Dichloroethene			<1					None	None	6
1,2-Dichloroethane			<1					None	None	4
1,2-Dichloropropane			<1					None	None	5
2-Butanone			<5 (RC.025)					None	None	4000
2-Hexanone			<5					None	None	(Note 2)
4-Methyl-2-Pentanone			<5					None	None	300
Acetone			<5					None	None	700
Benzene			<1					None	None	5
Bromodichloromethane			<1					None	None	6
Bromoform			<1					None	None	40
Bromomethane			<1					None	None	10
Carbon Disulfide			<1					None	None	700
Carbon Tetrachloride			<1					None	None	3
Chlorobenzene			<1					None	None	100
Chloroethane			<1					None	None	300*
Chloroform			<1					None	None	60
Chloromethane			<1					None	None	(Note 2)
cis-1,2-Dichloroethene			<1					None	None	70
cis-1,3-Dichloropropene			<1					None	None	2
Dibromochloromethane			<1					None	None	10
Ethylbenzene			<1					None	None	700
m&p-Xylene			<2					None	None	10,000
Methylene Chloride			<1					None	None	5
o-Xylene			<1					None	None	10,000
Styrene			<1					None	None	(Note 2)
Tetrachloroethene			<1					None	None	5
Toluene			<1					None	None	1000
trans-1,2-Dichloroethene			<1					None	None	100
trans-1,3-Dichloropropene			<1					None	None	2
Trichloroethene			<1					None	None	5
Vinyl Chloride			<1					None	None	0.2

Table 4-1
Groundwater Quality Data for OU2 Shallow Soil Site
5-Year Groundwater Monitoring

Fiscal Year 2007

	Unit 1 Wells		Unit 3 Wells					TCAAP	TCAAP	
	01U060 (Site H)	01U119 (Site A)	03U087 (Site 129-3)	03U087 D (Site 129-3)	03U089 (Site E)	03U093 (Site D)	03U097 (Site 129-5)	Unit 1 GW Background [1]	Units 3/4 GW Background [1]	MDH HRL
	6/21/07	6/21/07	6/20/07	6/20/07	6/20/07	6/19/07	6/20/07			
Metals (ug/L)										
Antimony	B 1.16 (UB0.4)	B 0.185 (UB0.4)	B 0.757 (UB0.4)	B 0.329 (UB0.4)	B 0.159 (UB0.4)	B 0.587 (UB0.4)	<2	<10	<10	6 [3]
Arsenic	3.63							6.80	14	(Note 2)
Barium		104			27.1		104	240	206	2000
Copper	**8.48**	B 0.921			B 1.16			4	27	1000*
Lead	B 1.12	B 0.181	B 0.160	B 0.124	B 0.145	B 0.107	B 0.0971	4.2	3.8	15 [4]
Manganese	2160		B 0.142	B 0.130	B 0.342			7,500	760	1000*
Explosives (ug/L)										
Nitroglycerine			<0.970	<0.970		<0.970		None	None	(Note 2)

Notes:

MDH HRL = Minnesota Department of Health, Health Risk Limit (* indicates a Health Based Value, rather than a HRL)

(1) Background values for Unit 1 groundwater from Appendix C, Table 6 in the OU2 ROD.
Background values for Unit 3/4 groundwater from Appendix C, Table 7 in the OU2 ROD.
Bolding (in red color) indicates exceedance of the respective background value.

(2) No HRL has been established for this analyte.

(3) For Site A Shallow Groundwater, this is also the Cleanup level from Table 1 of the OU2 ROD.

(4) No HRL has been established for this analyte. MDH utilizes 15 ug/l as the Action Level "at the tap".

D Duplicate sample.

B The value is below the reporting level, but above the method detection limit. Results should be considered estimated.

RC Rejected due to calibration problem (the response factor is listed after "RC").

UB The sample result was less than 5 times the level detected in a blank (the result for the blank is listed after "UB").
The sample result can be considered non detect at an elevated detection limit.

5.0 Operable Unit 2: Deep Soil Sites

Sites D and G were impacted primarily by VOC contaminants at depths extending to between 50 and 170 feet. Some additional shallow soil contaminants were also present at Site D, and Site G also contains a dump. The OU2 ROD (pages 2-3) describes seven remedy components for these two sites. The final remedy incorporated the use of existing soil vapor extraction (SVE) systems and site caps, which were installed in 1986.

5.1 REMEDY COMPONENT #1: GROUNDWATER MONITORING

Description: "Groundwater Monitoring." (OU2 ROD, page 2)

Performance Standard (how do you know when you're done):
When groundwater monitoring results from wells adjacent to each site are below the cleanup levels for deep groundwater specified in Table 1 of the OU2 ROD, and shown on Table 5-1 in this report.

Is this remedy component being implemented? Yes.

Were the groundwater monitoring requirements of this remedy met?
Yes. Samples were collected and analyzed from the wells that are nearest to Sites D and G in accordance with the FY 2007 Monitoring Plan.

What impact did the SVE systems have on contaminant concentrations in groundwater adjacent to Sites D and G?

Figure 5-1 shows the wells nearest to Sites D and G. Figure 5-2 and Figure 5-3 present trichloroethene trend graphs for these wells. Trichloroethene trends in other nearby wells can also be viewed from Figure B-3 (Appendix B).

Downgradient of Site D, at 03U093 (Figure 5-2), the concentrations over the past five years show a stable trend through FY 2007.

Downgradient of Site G, at 03U094 (Figure 5-3), the concentrations over the past five years show a decreasing trend through 2003 followed by a slight increase, and down again in FY 2006 and 2007.

Table 5-1 presents the FY 2006 data for the deep groundwater chemicals of concern for the two wells nearest to Sites D and G. The table shows that these wells still exceed the cleanup level for trichloroethene. There are no other cleanup level exceedances among these wells.

During the years of SVE operation (1986 to 1998), trichloroethene concentrations in groundwater near Sites D and G decreased from 10,000's of µg/l to less than 100 µg/l. The most dramatic improvement has been at 03U093 (Figure 5-2). Overall, these results indicate that SVE systems at Sites D and G effectively minimized (or eliminated) further contamination of the deep groundwater beneath these sites. However, the contaminant concentrations are still greater than the cleanup levels. Any residual source has not been defined and could be in either the saturated or unsaturated zone. It is possible that natural attenuation will cause reductions in contaminant concentrations in the future, as suggested by the findings of the USEPA's Natural Attenuation Study (U.S. EPA 2001. "Evaluation of the Protocol for Natural Attenuation of Chlorinated Solvents: Case Study at the Twin Cities Army Ammunition Plant. Office of Research and Development, Washington DC EPA/600/R-01/025).

Is any groundwater sampling proposed prior to the next report?

Yes. As shown in Appendix A.1, wells 03U093 (Site D) and 03U094 (Site G) will be sampled in June 2008 for VOC analysis.

Are any changes or additional actions required for this remedy component? No.

5.2 REMEDY COMPONENT #2: RESTRICT SITE ACCESS

Description: "Restrict site access and use during remedy implementation." (OU2 ROD, page 2)

Performance Standard (how do you know when you're done):

When site access is adequately restricted to protect human health.

Is this remedy component being implemented?

Yes (see Section 12.0 for information on land use controls).

Are any changes or additional actions required for this remedy component? No.

5.3 REMEDY COMPONENT #3: SVE SYSTEMS

Description: "Install and operate deep soil vapor extraction (SVE) systems with modified shallow SVE." (OU2 ROD, page 2)

SVE systems were installed at Sites D and G in 1986 as Interim Remedial Actions to address soil contamination, which were then incorporated into the final remedy. The Site D system included 39 shallow vents (depths of 33-54 feet) and one deep vent (depth of 150 feet). The Site G system included 89 shallow vents (depths of 23-55 feet). The systems removed a combined total of over

220,000 pounds of VOCs from both shallow and deep soils between startup in 1986 and shutdown in 1998 (116,199 pounds for Site D and 104,418 pounds for Site G).

Performance Standard (how do you know when you're done):
When the soil concentrations are below the cleanup levels specified in Table 8 of the OU2 ROD.

Is this remedy component being implemented?
This remedy component has been completed. The Site D SVE system was dismantled in FY 2001, and the Site G SVE system was dismantled in FY 2003. The Site D Shallow and Deep Soil VOC Investigation and Closeout Report received regulatory approval in FY 2002. The Site G Closeout Report received regulatory approval in FY 2005.

Are any changes or additional actions required for this remedy component? No.

5.4 REMEDY COMPONENT #4: ENHANCEMENTS TO THE SVE SYSTEMS

Description: "Evaluate and potentially use enhancements to the SVE systems." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When an adequate evaluation has been completed.

Is this remedy component being implemented?
This remedy component has been completed. No enhancements to either SVE system were required, since soil cleanup levels were reached without the need for any such modifications.

Are any changes or additional actions required for this remedy component? No.

5.5 REMEDY COMPONENT #5: MAINTAIN EXISTING SITE CAPS

Description: "Maintain existing site caps." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When the cap is maintained in adequate condition.

Is this remedy component being implemented?
Yes. The caps for Sites D and G were originally intended to minimize infiltration of precipitation and to minimize short-circuiting of air during SVE system operation. With achievement of the soil cleanup goals at Site D, there is no longer a need for a cap relative to VOCs in the soil. At Site G, the revised cleanup goal for trichloroethene was based on maintaining a cap with a specified permeability over the area with trichloroethene contamination (see Section 12.0 for information on land use controls and long-term operation and maintenance (O&M)). An annual inspection of the cap was performed on July 24, 2007 (see Appendix J). There was no erosion or other damage observed that would necessitate any repairs to the cap.

Are any changes or additional actions required for this remedy component? No.

5.6 REMEDY COMPONENT #6: MAINTAIN SURFACE DRAINAGE CONTROLS

Description: "Maintain surface [drainage] controls." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When surface water does not pond on the cap, and surface water flows off at a rate that does not cause erosion problems with the cap.

Is this remedy component being implemented?

Yes. As discussed above, drainage controls are no longer required for Site D relative to VOCs in the soil, but still apply for Site G (see Section 12.0 for information on land use controls and long-term O&M).

Are any changes or additional actions required for this remedy component? No.

5.7 REMEDY COMPONENT #7: CHARACTERIZE SHALLOW SOILS AND DUMP

Description: "Following completion of SVE remediation of deep soils, characterize Site D shallow soils and Site G dump to determine appropriate action." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):

When the characterizations have provided answers necessary to determine if additional remediation is required, and if remediation is required, when it has been completed.

Is this remedy component being implemented?

Yes. For Site D, shallow soil characterization work was completed in FY 2002. In FY 2003, 1,381 cubic yards of soil contaminated with metals and nitroglycerin were excavated by Shaw and transported off-site for disposal at a permitted disposal facility. The Site D Closeout Report received regulatory approval in FY 2004, but final consistency will not be provided until concurrence of the land use control section of the report is reached between the Army and the regulators. A modification to the OU2 ROD documenting the remedy selection for Site D shallow soils was being prepared at the end of FY 2007.

For Site G, a technical memorandum recommending improvements to the Site G cover received regulatory approval in FY 2003. A work plan for the cover design also received regulatory

approval in FY 2003. Cover construction was completed over the Site G dump in early FY 2005. The Site G Closeout Report received regulatory approval, but final consistency will not be provided until concurrence of the land use control section of the report is reached between the Army and the regulators. A modification to the OU2 ROD documenting the remedy selection for Site G was being prepared at the end of FY 2007.

Are any changes or additional actions required for this remedy component? No.

5.8 OVERALL REMEDY FOR DEEP SOIL SITES

Has the SVE remediation been completed (i.e., have the soil cleanup levels in Table 8 of the OU2 ROD been attained throughout the areal and vertical extent of Sites D and G)?
Yes, subject to the revised Site G cleanup levels cited previously.

Has it been determined that remediation of shallow soils at Site D and/or the dump at Site G is not required, or if required, has the remediation been completed?
For Site D, the additional soil removal that was determined to be required has been completed. For Site G, construction of the improvements to the cover were completed in FY 2004.

Table 5-1

Deep Groundwater Data Near Sites D and G
Fiscal Year 2007

		Tetrachloro-ethene (ug/l)	Trichloro-ethene (ug/l)	1,1-Dichloro-ethene (ug/l)	cis-1,2-Dichloro-ethene (ug/l)	1,1-Dichloro-ethane (ug/l)	1,1,1-Trichloro-ethane (ug/l)	1,2-Dichloro-ethane (ug/l)
OU2 Cleanup Level [(1)]		5	5	6	70	70	200	4
Site D								
03U093	6/19/07	<1	**86**	3.5	1.5	0.21JP	51	<1
Site G								
03U094	6/14/06	<1	**94**	3.5	1.3	2.2	28	<1

Notes:

(1) Cleanup levels for Deep Groundwater are from Table 1 of the OU2 ROD. Bolding (in red color) indicates exceedance of the cleanup level.

JP The value is below the reporting level, but above the method detection limit. Results should be considered estimated.

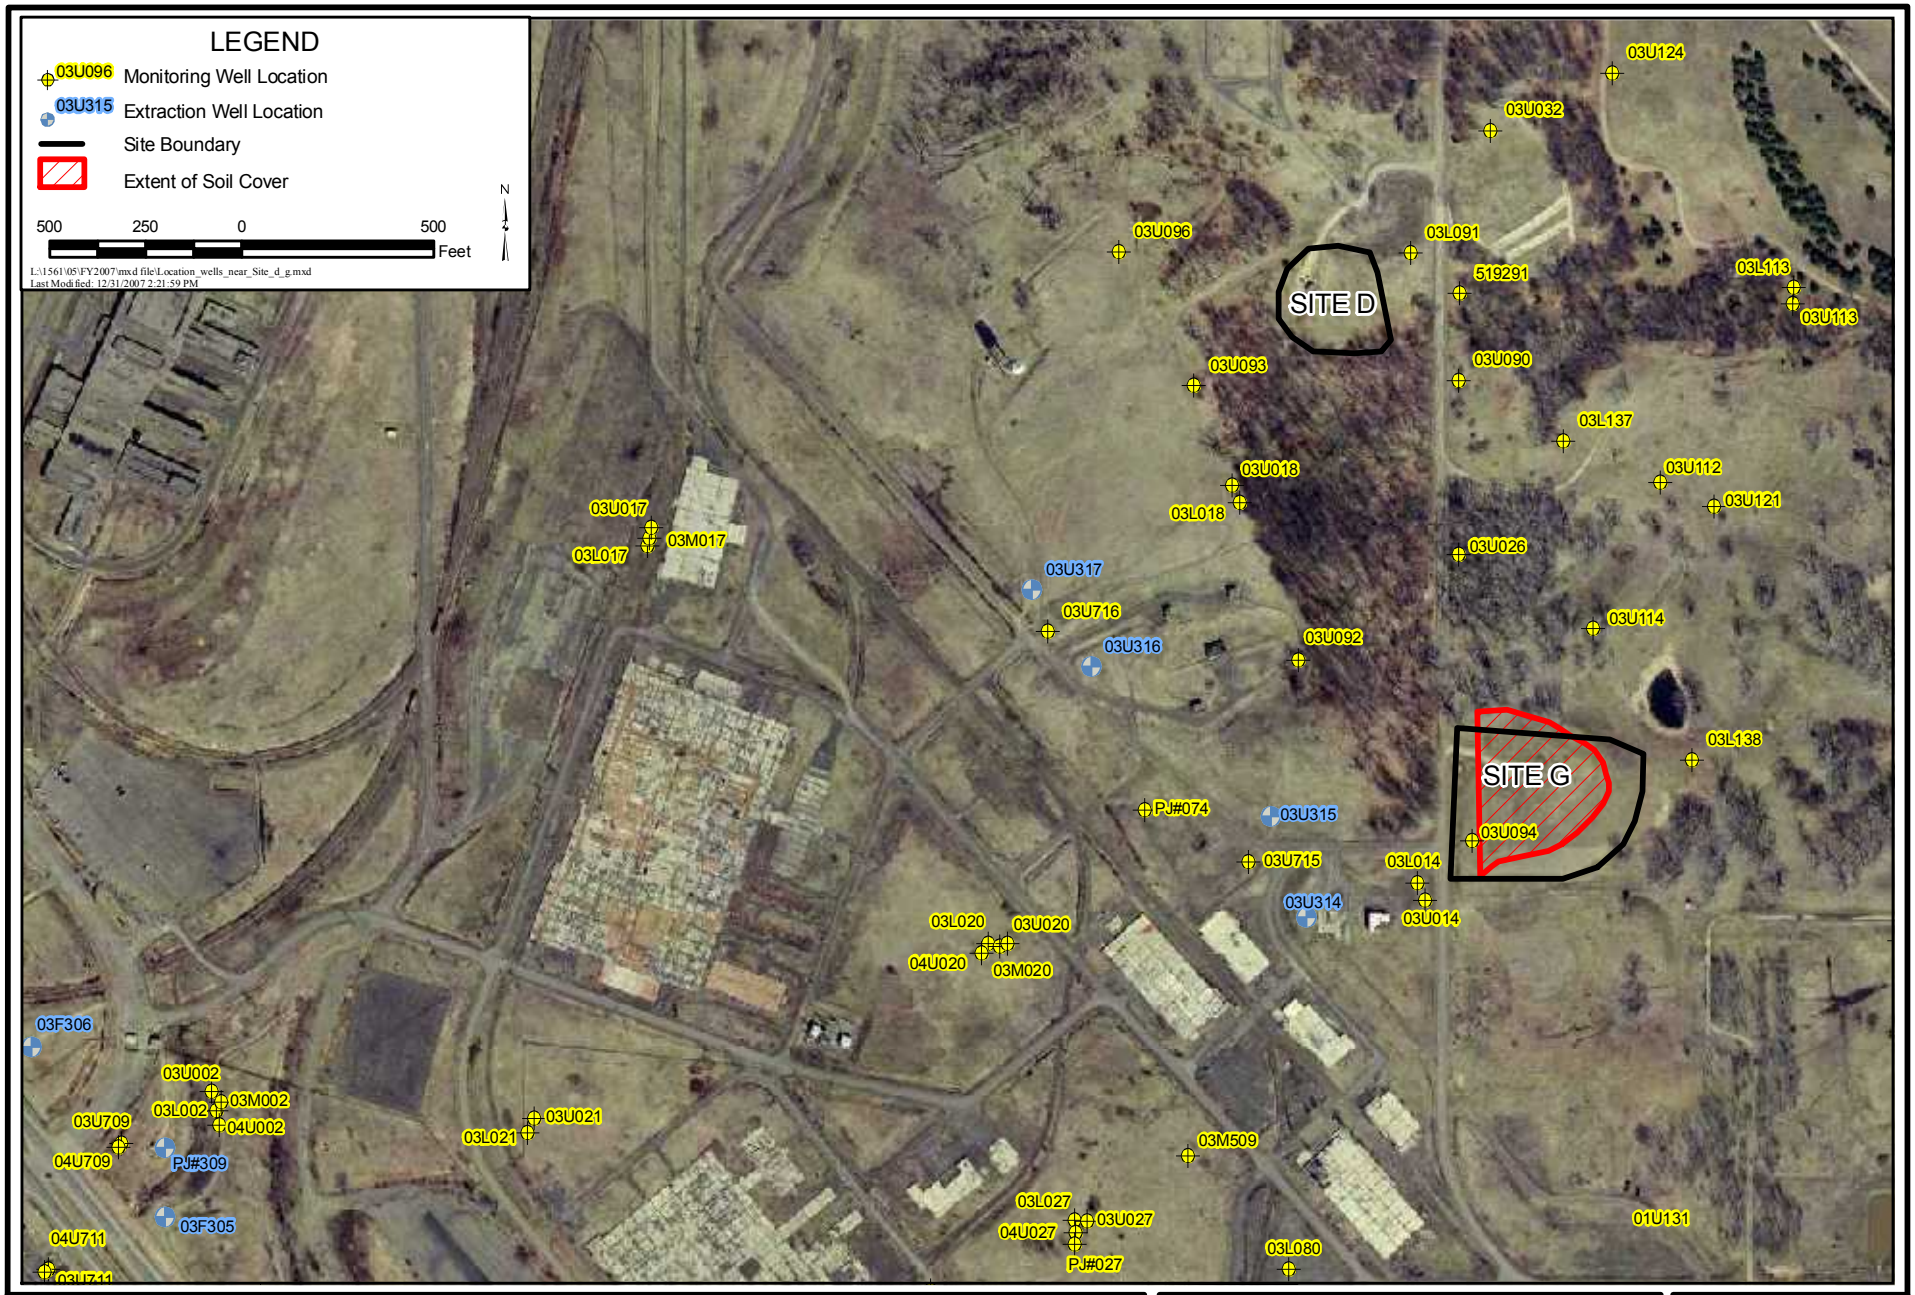

TWIN CITIES ARMY AMMUNITION PLANT

Location of Wells Nearest to Sites D and G

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 5-1

FIGURE 5-2

SITE D, WELL 03U093, TRICHLOROETHENE WATER QUALITY TRENDS

TWIN CITIES ARMY AMMUNITION PLANT

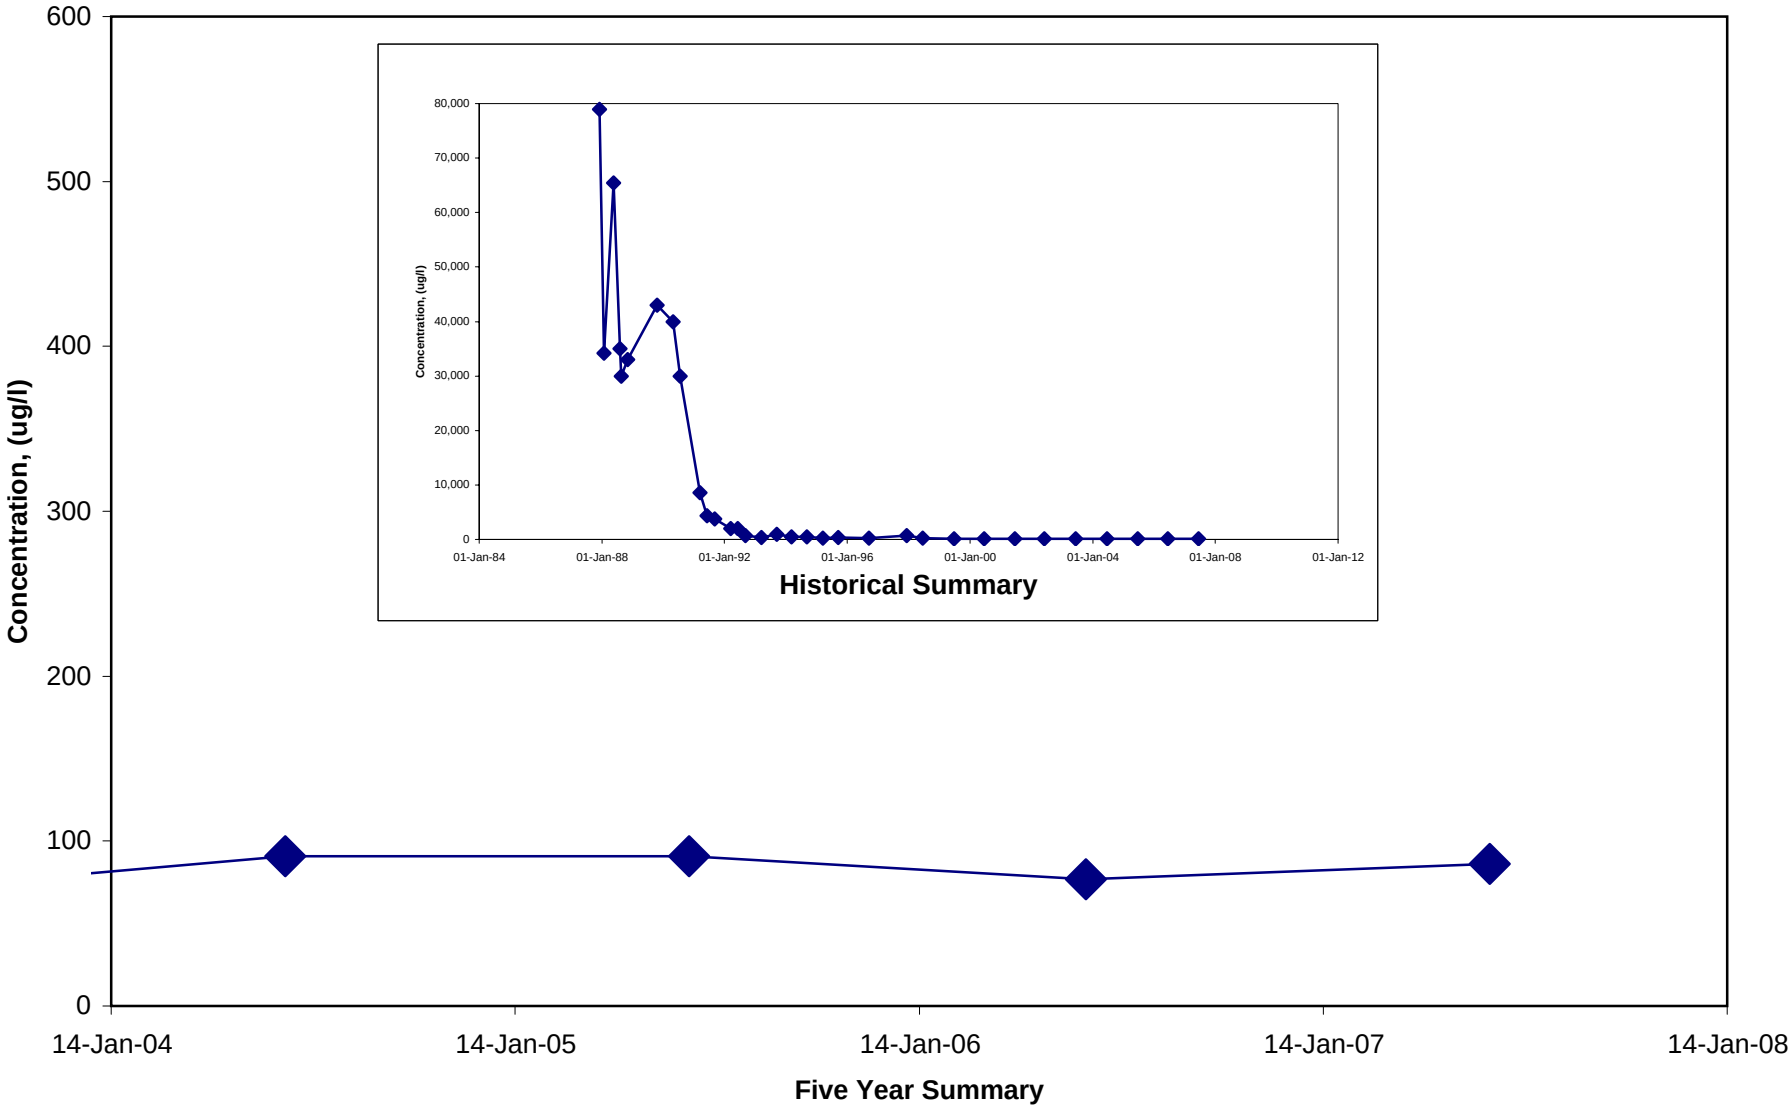

T:\1561\FY 2007 APR\Final\Figures\Figure 5-2

Wenck Associates, Inc.

FIGURE 5-3

SITE G, WELL 03U094, TRICHLOROETHENE WATER QUALITY TRENDS

TWIN CITIES ARMY AMMUNITION PLANT

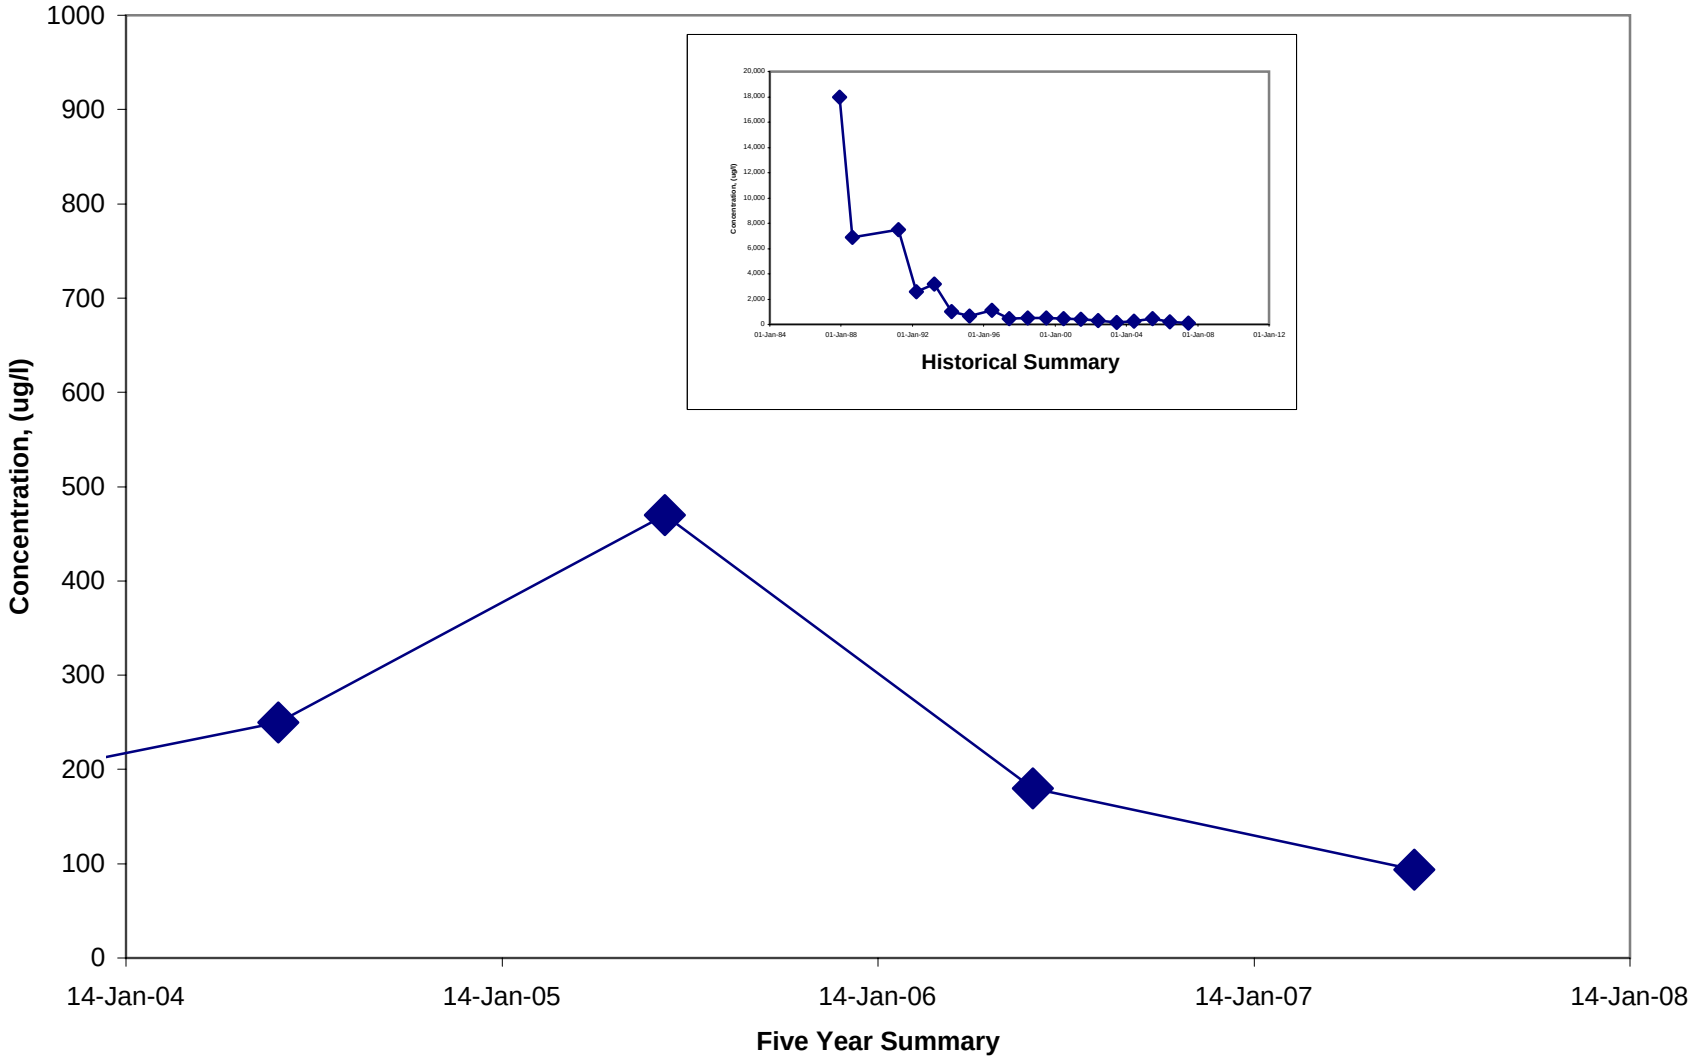

T:\1561\FY 2007 APR\Final\Figures\Figure 5-3

Wenck Associates, Inc.

6.0 Operable Unit 2: Site A Shallow Groundwater

Shallow groundwater at Site A has been impacted by VOCs and antimony. The selected remedy in the OU2 ROD incorporates the use of a groundwater extraction system, which began operation May 31, 1994. The containment system originally consisted of eight extraction wells installed along two lines downgradient of the source area. Only four of the eight extraction wells currently need to be operated to provide the necessary containment. Extracted groundwater is discharged to the sanitary sewer for treatment at a Publicly-Owned Treatment Works (POTW). The ROD prescribes five major components of the remedy that are described and evaluated in the following sections.

6.1 REMEDY COMPONENT #1: GROUNDWATER MONITORING

Description: "Groundwater monitoring to track plume migration and remedy performance." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):

When a performance groundwater monitoring program has been established and ongoing monitoring is in compliance with the program.

Is this remedy component being implemented?

Yes. Performance monitoring programs have been established to collect the data required for remedy components #2 to #4 and evaluation of the overall remedy. Table 6-1 summarizes the performance monitoring requirements, the implementing parties, and the documents that contain the monitoring plans. The FY 2007 Monitoring Plan is included in Appendix A. Figure 6-1 illustrates the wells and piezometers associated with Site A, and highlights the wells that were sampled in FY 2007.

Were the groundwater monitoring requirements for this remedy met? Yes.

Is any groundwater sampling proposed prior to the next report? Yes.

- Groundwater sampling of water supply wells related to alternate water supply and well abandonment will be in accordance with recommendations in Appendix E. No wells are recommended for FY 2007. The next "major" event will be in FY 2009.
- Monitoring of the extraction wells (pumping volumes, water levels, and water quality) and treatment system effluent will be in accordance with Appendix A.2.
- Other groundwater monitoring will be in accordance with the Groundwater Monitoring Plan included as Appendix A.1.

Are any changes or additional actions required for this remedy component? No.

6.2 REMEDY COMPONENT #2: GROUNDWATER CONTAINMENT AND MASS REMOVAL

Description: "Use of existing gradient control wells to contain the contaminant plume and remove mass." (OU2 ROD, page 3)

- Eight extraction wells (EWs), 01U351 – 01U358 (EW-1 – EW-8), were installed in two capture lines as shown on Figure 6-1. Seven of the eight extraction wells fully penetrate the Unit 1 aquifer and range in depth from 31 to 48 feet, as shown in cross-sectional view on Figure 6-2. The one partially penetrating well, 01U353 (EW-3), was completed in silt to sandy clay units that were resistant to drilling and determined to be the top of Unit 2 by the field geologist. The well log does not note the presence of silt (Fuller, 1994). The partially penetrating well is illustrated on cross-section B-B' on Figure 6-2.

- Wells 01U355 – 01U358 (EW-5 – EW-8), the line of extraction wells downgradient of the "first line" of extraction wells, were shut off (with regulatory approval) on July 11, 2000, and have remained off since that time. These wells were shut off because: 1) they were below the cleanup levels, and 2) the known area of groundwater having cleanup goal exceedances was within the capture area of the first line of extraction wells.

Performance Standard (how do you know when you're done):
When the extraction system is providing complete capture of all groundwater exceeding the cleanup levels specified in Table 1 of the OU2 ROD, and shown in Table 6-2 of this report.

Is the Site A groundwater extraction system providing complete capture of all groundwater exceeding the cleanup levels specified in Table 1 of the OU2 ROD?
Yes. Table 6-3 shows the monthly average pumping rate for each extraction well and the combined system total, along with the target pumping rate for containment. The original target pumping rate for wells 01U351 – 01U355 (EW-1 – EW-5) was 15 gpm. The average pumping rate for FY 2007 was 16.9 gpm, above the target.

Water level data collected at Site A in June 2007, is shown in Table 6-4, and a water level contour map prepared from this data is presented on Figure 6-3. This figure shows the influence from pumping the four extraction wells and the interpreted capture boundary, which supports the statement that the system is providing complete capture of all groundwater exceeding the Site A cleanup levels.

Table 6-2 (and also Figure 6-4 and Figure 6-5) show that the locations where groundwater exceeds cleanup levels continue to be at and upgradient of the first line of recovery wells. Two monitoring wells 01U126 and 01U350, exceeded the cleanup level for tetrachloroethene. Monitoring well 01U108 was below the cleanup level for the first time for all constituents. Only 1 extraction well (EW-2) was above the cleanup standards for cis-1,2-dichloroethene and benzene.

Were there any significant operation and maintenance problems (greater than 24-hour shutdown)?

Yes. Table 6-5 summarizes O&M notes for FY 2007.

Are any changes or additional actions required for this remedy component? No.

6.3 REMEDY COMPONENT #3: DRILLING ADVISORY/ALTERNATE WATER SUPPLY/WELL ABANDONMENT

Description: "Institutional controls to restrict new well installations and provide alternate water supplies and well abandonment as necessary." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):

When the MDH has issued a Special Well Construction Area Advisory and when well owners who qualify have been offered and provided with alternate water supply and/or have had their wells abandoned (or the offers have been rejected).

Is the remedy component being implemented?

Yes. The OU1 Alternate Water Supply and Well Abandonment Program is underway and was expanded to cover the area affected by the OU2 Site A shallow groundwater plume. See Section 3.1 of this report for more information on this program.

Has the MDH issued a Special Well Construction Area Advisory for the area impacted by Site A?

Yes, it was issued in June 1996 and revised in December 1999; however, this revision did not affect the boundary for the Site A vicinity.

Did the boundary of the Site A plume get any bigger during FY 2007, as defined by the 1 µg/l contour?

No. Figure 6-4 and Figure 6-5 shows the plumes at Site A. The plume is smaller in FY 2007 compared to FY 2006, especially for tetrachloroethene.

Were any additional water supply wells discovered within the area of concern for the Site A plume that are completed within the aquifer of concern? No.

Were any water supply wells within the Site A plume sampled during FY 2007? If yes, what were the findings? No.

Were any well owners offered an alternate supply and/or well abandonment in FY 2007? No.

Within the Site A plume, are there any well owners that meet the criteria, but have not yet been provided an alternate water supply? No.

Within the Site A plume, are there any wells that meet the criteria, but have not yet been abandoned? No.

Is any sampling of water supply wells proposed prior to the next report? No.

Are any changes or additional actions required for this remedy component? No.

6.4 REMEDY COMPONENT #4: DISCHARGE OF EXTRACTED WATER

Description: "Discharge of extracted groundwater to a publicly-owned treatment works (POTW)." (OU2 ROD, page 3)

- The recovered groundwater is piped to a sewer discharge manhole (Shoreview sanitary sewer discharge manhole #229) located approximately 150 feet north of the TCAAP boundary as shown on Figure 6-1. The recovered groundwater is conveyed via a City of Shoreview sanitary sewer to the Metropolitan Council Environmental Services (MCES) Treatment Plant located at 2400 Childs Road in St. Paul, Minnesota. Discharge is in accordance with Industrial Discharge Permit Number 2194 from the MCES.

Performance Standard (how do you know when you're done):
When the concentrations of contaminants in the extracted groundwater and the flow rate are below the criteria in the Industrial Discharge Permit, as shown in Table 6-6.

During FY 2007, was the discharge water in compliance with the Industrial Discharge Permit requirements?
Yes. Table 6-6 shows that the effluent water quality was below the discharge criteria in every month of FY 2007.

Is any sampling of the discharge water proposed prior to the next report?
Yes. In accordance with the permit requirements, the discharge will be sampled monthly for 1,2-dichloroethene (cis and trans), trichloroethene, 1,1,1-trichloroethane, and mercury (see Appendix A.2).

Are any changes or additional actions required for this remedy component? No.

6.5 REMEDY COMPONENT #5: SOURCE CHARACTERIZATION/ REMEDIATION

Description: "Source characterization/remediation." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
For characterization, when the investigation has answered the questions needed to prepare remedial design documents. For remediation, when the contaminant concentrations in soil are below the cleanup levels specified in Table 1 of the OU2 ROD.

Is this remedy component being implemented?
Yes. Characterization work has been completed. Stone & Webster performed investigation work in 1997 and the final "Site A Investigation Report" was issued December 12, 1997. The report delineated the extent of both VOC-contaminated and metal-contaminated soils requiring remediation.

Remediation has been completed. Shaw completed removal of metal-contaminated soils in FY 1999. Construction of an air sparging/soil vapor extraction (AS/SVE) system to remediate VOC-contaminated soils was completed by Stone & Webster in FY 2000, which began operation in early FY 2001. The AS system was shut off permanently in June 2001 due to a lack of increase in SVE VOC levels and due to concern regarding potential plume spreading. The AS system was being implemented voluntarily and was not a requirement of the OU2 ROD. Soil samples were collected within the source area in July 2002 (and previously in August 2001). In both events, the results showed minimal reduction in soil VOC concentrations. Since it appeared that many years of SVE system operation would be required before cleanup levels would be reached (if ever), the Army ceased SVE system operation on August 21, 2002, and submitted a work plan clarification to the USEPA and MPCA for excavation of the VOC-contaminated soils in the source area. The work plan clarification received regulatory approval in early FY 2003, and 688 cubic yards of contaminated soil were excavated by Shaw and transported off-site to a

permitted disposal facility. The Site A Former 1945 Trench Closeout Report (prepared by Shaw) received regulatory consistency in FY 2004.

Are any changes or additional actions required for this remedy component? No.

6.6 OVERALL REMEDY FOR SITE A SHALLOW GROUNDWATER

Performance Standard (how do you know when you're done):
When the cleanup levels in Table 1 of the OU2 ROD have been attained throughout the areal and vertical extent of the Site A plume within the anticipated ten-year lifespan of the remedy. If the remedy has not been completed within ten years, additional remedial measures will be addressed (OU2 ROD, page 54).

Has the Site A shallow groundwater remedy been completed (i.e., have the cleanup levels in Table 1 of the OU2 ROD been attained throughout the areal and vertical extent of the Site A plume)?
No. Table 6-2 shows the exceedances in wells at Site A during FY 2007. Figure 6-5 shows that the area with tetrachloroethene exceedances (greater than 7 µg/l) extends from the source area (near 01U108) downgradient to near 01U126. The tetrachloroethene exceedances do not extend to the first line of extraction wells. There were no cis-1,2-dichloroethene exceedances (greater than 70 µg/l) at monitoring wells in the Summer 2007 event (Figure 6-4). However, Table 6-2 shows that extraction well EW-2 was above the cleanup standard (160 µg/l) and EW-3 remained below the cleanup standard (51 µg/l). These wells have been fluctuating near the cleanup standard for several years. This suggests that an area with cis-1,2-dichloroethene exceedances (greater than 70 µg/l) persists in the vicinity of EW-2, though it does not extend back to the source area. The presence of cis-1,2-dichloroethene in this area is consistent with the breakdown of trichloroethene and tetrachloroethene with distance from the source area. The benzene concentration in EW-2 was just above the cleanup level of 10 µg/l in the June 2007 event, consistent with FY 2006. The benzene cleanup level was not exceeded in any other wells.

What impact is the groundwater extraction system having on contaminant concentrations?
Groundwater contaminant concentrations at Site A were generally comparable to last year's data, with the cis-1,2-dichloroethene and tetrachloroethene concentrations decreasing slightly at some locations with the plume extent remaining about the same. All wells downgradient of the first line of extraction wells had water quality results that remained below the cleanup levels. Well 01U108, near the source area, dropped below the cleanup level in FY 2007.

The following figures present trend graphs of cis-1,2-dichloroethene, trichloroethene, and tetrachloroethene for representative wells that illustrate these points:

- Figure 6-6 01U902 (downgradient of the extraction system)
- Figure 6-7 Extraction Wells EW-1 to EW-4 (the first line of extraction wells) (cis-1,2-dichloroethene only)
- Figure 6-8 01U108 (near the source area)

Note that some of the data points prior to FY 1999 may be showing total 1,2-dichloroethene (cis and trans isomers combined), since analysis of the cis isomer alone has not always been performed.

What impact is source removal having on contaminant concentrations?
Since the contaminated soils from the Former 1945 Trench were removed from the site in early FY 2003, the source removal appears to be influencing the FY 2006 monitoring data. At 01U108, the closest monitoring well downgradient of the source area, the concentration of tetrachloroethene have decreased to below clean up standards in FY 2007. Well 01U350, which is very near well 01U108 and which had not been sampled since 2002, had 15 µg/l tetrachloroethene, down from 220 µg/l in 2000, just prior to AS/SVE operation and source removal. Overall, monitoring well 01U126 has shown fairly stable tetrachloroethene concentrations in recent years, ranging from 12 to 56 µg/l. Since source removal, the cis-1,2-dichloroethene concentrations have been slightly increasing at extraction well EW-2 and relatively stable at EW-3, which may reflect degradation of the tetrachloroethene observed at

01U108 and 01U126. These data together suggest the plume is "tailing off" as concentrations decrease at Site A and that the source removal was successful.

How much VOC mass has been removed?
Based on the calculated VOC mass removal rates for the total effluent, the groundwater extraction system removed approximately 2.64 pounds of VOCs in FY 2007, with a cumulative VOC mass removal of approximately 51.42 pounds since system startup on May 31, 1994 (Table 6-7).

Has 10 years elapsed since signing of the OU2 ROD? Yes. The June 2007 sampling event was within the ninth year of extraction system operation, and December 2007 will mark ten years since the signing of the OU2 ROD. The ROD states, "should aquifer restoration not be attained within the anticipated ten-year lifespan of the remedy, additional remedial measures will be addressed". Based on the FY 2007 sampling events, cleanup levels have not been completely reached throughout the areal extent of the plume.

Do additional remedial measures need to be addressed? Since the ten-year mark specified in the OU2 ROD has been reached, the Army will submit a 10-year evaluation report to the MPCA and USEPA in FY 2008, which will evaluate the current status of Site A and any potential changes to the remedy that may be appropriate.

6.7 OTHER ACTIVITIES IN FY 2007

There we no other activities conducted at Site A in FY 2007.

Table 6-1

Summary of Site A Shallow Groundwater Monitoring Requirements
Fiscal Year 2007

Remedy Component	Monitoring Requirements	Implementing Party	Documents Containing the Monitoring Plan
#1: Groundwater Monitoring	Outlined below		
#2: Containment and Mass Removal	a. Pumping volumes and rates for each extraction well for comparison to design flowrates for containment	Army	Site A Monitoring Plan in the Annual Report
	b. Water levels from monitoring wells to draw contour maps showing the influences of pumping	Army	Site A Monitoring Plan in the Annual Report
	c. Water quality data for each extraction well to determine VOC mass removal	Army	Site A Monitoring Plan in the Annual Report
#3: Drilling Advisory/Alternate Water Supply/Well Abandonment	See OU1, Remedy Component #1 which also includes the area north of Site A		
#4: Discharge of Extracted Water	a. Water quality data for total system effluent to demonstrate compliance with the Industrial Discharge Permit	Army	Site A Monitoring Plan in the Annual Report
#5: Source Characterization/ Remediation	a. AS/SVE system flowrates and air quality data to evaluate system effectiveness and emissions (this system was permanently shut down on August 21, 2001)	Army	Site A Monitoring Plan in the Annual Report
OR: Overall Remedy (Attainment of cleanup goals)	a. Water quality data throughout the Site A plume to evaluate attainment	Army	Site A Monitoring Plan in the Annual Report

Table 6-2
Site A Groundwater Quality Data

Fiscal Year 2007

			Tetra-chloro-ethene (ug/l)	Tri-chloro-ethene (ug/l)	1,1-Di-chloro-ethene (ug/l)	1,2-Di-chloro-ethane (ug/l)	cis-1,2-Di-chloro-ethene (ug/l)	Chloro-form (ug/l)	Benzene (ug/l)	Antimony (ug/l)
Site A Cleanup Level [1]			7	30	6	4	70	60	10	6
01U039		6/13/07	<1	<1	<1	<1	<1	<1	<1	
01U102		6/14/07	JP 0.41	<1	<1	<1	JP 0.46	<1	<1	
01U103		6/14/07	<1	<1	<1	<1	<1	<1	<1	2.04
01U108		6/15/07	5.9	JP 0.93	<1	<1	JP 0.40	<1	<1	
01U115		6/13/07	<1	<1	<1	<1	JP 0.19	<1	<1	
01U116		6/13/07	<1	<1	<1	<1	JP 0.23	<1	<1	
01U117		6/14/07	3.1	JP 0.81	<1	<1	8.2	<1	<1	
01U126		6/14/07	**20**	<1	<1	<1	<1	<1	<1	
01U127		6/14/07	<1	<1	<1	<1	<1	<1	<1	
01U138		6/13/07	JP 0.22	<1	<1	<1	<1	<1	<1	
01U139		6/14/07	<1	<1	<1	<1	23	<1	1.3	
01U140		6/14/07	<1	<1	<1	<1	1.6	<1	JP 0.47	
01U140	D	6/14/07	<1	<1	<1	<1	1.5	<1	<1	
01U157		6/14/07	<1	JP 0.44	<1	<1	1.2	<1	<1	
01U157	D	6/14/07	<1	JP 0.42	<1	<1	1.2	<1	<1	
01U158		6/14/07	<1	<1	<1	<1	JP 0.44	<1	<1	
01U350		6/15/07	**15**	2.4	<1	<1	3.5	<1	<1	
01U901		6/15/07	<1	<1	<1	<1	JP 0.31	<1	<1	
01U902		6/15/07	<1	<1	<1	<1	5.8	<1	<1	B 0.200 (UB0.4)
01U902	D	6/15/07	---	---	---	---	---	---	---	B 0.129 (UB0.4)
01U903		6/15/07	<1	<1	<1	<1	JP 0.26	<1	<1	
01U904		6/15/07	<1	<1	<1	<1	1.5	<1	<1	B 0.360 (UB0.4)

Table 6-2
Site A Groundwater Quality Data

Fiscal Year 2007

			Tetra-chloro-ethene (ug/l)	Tri-chloro-ethene (ug/l)	1,1-Di-chloro-ethene (ug/l)	1,2-Di-chloro-ethane (ug/l)	cis-1,2-Di-chloro-ethene (ug/l)	Chloro-form (ug/l)	Benzene (ug/l)	Antimony (ug/l)
Site A Cleanup Level [1]			7	30	6	4	70	60	10	6
Extraction Wells:										
01U351 (EW1)		6/14/07	JP 0.50	JP 0.57	<1	<1	1.8	<1	<1	
01U352 (EW2)		6/14/07	JP 0.43	1.5	JP 0.20 (UB0.5)	<1	**160**	<1	**14**	
01U352 (EW2)	D	6/14/07	JP 0.39	1.6	JP 0.21 (UB0.5)	<1	**160**	<1	**13**	
01U353 (EW3)		6/14/07	JP 0.17	1.1	<1	<1	51	<1	4.1	
01U354 (EW4)		6/14/07	<1	JP 0.27	<1	<1	JP 0.77	<1	<1	

Notes:

(1) Cleanup levels for Site A Shallow Groundwater are from Table 1 of the OU2 ROD. Bolding (in red color) indicates exceedance of the cleanup level.

D Duplicate sample.

B The value is below the reporting level, but above the method detection limit. Results should be considered estimated.

JP The value is below the reporting level, but above the method detection limit. Results should be considered estimated.

UB The sample result was less than 5 times the level detected in a blank (the result for the blank is listed after "UB"). The sample result can be considered non detect at an elevated detection limit.

Table 6-3

Site A Removal Action Pumping Data
Fiscal Year 2007

Month	01U351	01U352	01U353	01U354	01U351-354 Subtotal
			Target Flowrate (gpm):		**15.0**
	Average Flowrate (gpm)				
Oct-06	6.0	2.3	3.2	3.2	14.8
Nov-06	7.9	8.4	2.3	5.1	23.7
Dec-06	5.6	7.4	2.1	3.4	18.6
Jan-07	4.8	5.0	1.9	4.7	16.4
Feb-07	5.5	3.4	2.2	4.8	15.9
Mar-07	5.8	1.4	2.0	5.6	14.9
Apr-07	6.3	1.8	1.8	6.4	16.2
May-07	5.7	1.6	1.9	5.3	14.4
Jun-07	7.0	6.2	2.8	2.8	18.9
Jul-07	6.1	7.5	1.6	2.2	17.4
Aug-07	6.0	4.2	1.3	4.0	15.6
Sep-07	4.9	3.8	1.3	6.4	16.4
FY07 Average	**6.0**	**4.4**	**2.0**	**4.5**	**16.9**

Table 6-4

Site A Groundwater Level Data

Fiscal Year 2007

Well ID	TOS (ft)	Stickup (ft)	GW Meas. 2007 (ft)	GW elev. 2007 (ft)
O1U038	900.30	1.69	7.14	894.85
O1U039	897.50	2.23	13.54	886.19
O1U040	892.54	2.43	8.76	886.21
O1U041	898.33	2.25	6.14	894.44
O1U063	892.61	2.40	9.20	885.81
O1U067	897.40	2.76	5.62	894.54
O1U102	905.20	2.28	15.52	891.96
O1U103	904.14	2.48	13.32	893.30
O1U104	899.12	2.41	6.30	895.23
O1U105	901.39	2.40	7.42	896.37
O1U106	896.80	2.88	6.74	892.94
O1U107	899.16	1.69	5.94	894.91
O1U108	904.30	2.14	13.58	892.86
O1U110	897.22	2.63	4.02	895.83
O1U115	900.33	1.67	13.96	888.04
O1U116	902.71	1.85	16.32	888.24
O1U117	902.69	1.81	15.00	889.50
O1U118	901.79	1.94	10.92	892.81
O1U119	898.08	2.00	5.24	894.84
O1U120	902.15	1.81	11.80	892.16
O1U126	903.34	2.33	14.60	891.07
O1U127	902.93	2.35	12.44	892.84
O1U133	900.73	2.46	8.62	894.57
O1U135	899.94	1.94	16.72	885.16
O1U136	898.84	2.42	20.20	881.06
O1U137	900.51	2.12	11.76	890.87
O1U138	904.38	2.14	18.27	888.25
O1U139	901.15	2.10	15.56	887.69
O1U140	898.83	1.82	13.92	886.73
O1U141	897.74	1.91	11.24	888.41
O1U145	902.56	2.57	15.44	889.69
O1U146	902.89	2.53	17.80	887.62
O1U147	902.80	2.44	16.32	888.92
O1U148	902.60	2.65	16.54	888.71
O1U149	901.30	2.71	15.43	888.58
O1U150	901.30	2.27	15.76	887.81
O1U151	904.70	2.49	19.26	887.93
O1U152	901.00	2.80	15.96	887.84

Table 6-4

Site A Groundwater Level Data

Fiscal Year 2007

Well ID	TOS (ft)	Stickup (ft)	GW Meas. 2007 (ft)	GW elev. 2007 (ft)
O1U153	899.90	2.69	15.14	887.45
O1U154	898.90	2.51	14.38	887.03
O1U155	897.90	3.09	14.98	886.01
O1U156	897.80	2.48	14.82	885.46
O1U157	901.90	2.78	16.80	887.88
O1U158	901.10	2.48	16.08	887.50
O1U351	904.00	2.70	20.76	885.94
O1U352	901.00	3.33	17.32	887.01
O1U353	902.00	2.82	22.48	882.34
O1U354	903.80	3.22	20.40	886.62
O1U901	901.48	2.79	19.90	884.37
O1U902	901.29	2.25	16.54	887.00
O1U903	903.70	3.04	18.20	888.54
O1U904	899.40	2.56	16.42	885.54

TOS = Top of Surface which represents the ground surface elevation in feet above mean sea level (MSL). The TOS elevations were retrieved from USAEC IRDMIS.

Groundwater measurements taken on June 13, 2007.

Table 6-5

Site A Removal Action Monthly Operation and Maintenance Notes
Fiscal Year 2007

October
During the month of October, operational parameters were recorded daily on business days.
10/9/06; Cleaned flow meters. System down time: 1 hour.
10/24/06; Cleaned flow meters. System down time: 1 hour.
10/27-29/06; System being acid-washed. System down time: 57 hours.

November
During the month of November, operational parameters were recorded daily on business days.
11/3-5/06; EW-351 and EW-354 were shut down due to leaks inside of control building. EW-351 and EW-354 down time 38 hours.
11/5/06; System down for replacement of piping and valves inside of the control building. System down time: 10 hours.

December
During the month of December, operational parameters were recorded daily on business days.
12/22/06; System down for cleaning of all flow meters. System down time: 1 hour.

January
During the month of January, operational parameters were recorded daily on business days.
1/18/07; System down for cleaning of all flow meters. System down time: 1 hour.
1/23-24/07; System being acid washed; System down time: 28 hours.
1/25/07; EW-353 down for scrubbing of the well screen. EW-353 down time: 17 hours.

February
During the month of February, operational parameters were recorded daily on business days.
2/8/07; System down for cleaning of all flow meters. System down time: 1 hour.

March
During the month of March, operational parameters were recorded daily on business days.
3/20-22/07 System being acid washed. System down time: 40 hours.
3/23-28/07 EW-352 offline. The power cable at the wellhead was shorting out and needed to be respliced. EW-352 down time: 108 hours.

April
During the month of April, operational parameters were recorded daily on business days.
4/20/07 System down for repairs to pipe bank inside control building. System down time: 3 hours.

May
During the month of May, operational parameters were recorded daily on business days.
5/2/07; Cleaned all system flow meters. System down time: 1.5 hours.
5/22/07; Cleaned all system flow meters. Influent to EW-352 flow meter was impeded by sand. System down time: 1.5 hours.

Table 6-5

Site A Removal Action Monthly Operation and Maintenance Notes
Fiscal Year 2007

June

During the month of June, operational parameters were recorded daily on business days.
6/8-10/07 System being acid-washed and the pump intake screens were scrubbed. System down-time: 52 hours.
6/13/07; EW-353 is cycling. Water level draws down to the pump intake level, which causes the pump to cavitate. The well recharges a few feet of head before the pump kicks back on. This cycling is most likely due to the low static groundwater level from the drought. The well was valved back to reduce the frequency of the cycling. Down time : none.

July

During the month of July, operational parameters were recorded daily on business days.
7/5/07; Cleaned all flow meters. System down time: 1 hour.
7/30-31/07; EW-352 not pumping. Troubleshooting problem. May be corrosion of the wires at the well head or possibly an inoperable pump and motor. Well driller notified and on schedule for repair. EW-352 down time: 40 hours.

August

During the month of August, operational parameters were recorded daily on business days.
8/1-8/07; EW-352 not pumping. Troubleshooting problem. Wires at the well head were re-spliced to no effect. Pump and motor are inoperable and were replaced on 8/8/07. EW-352 down time: 175 hours.
8/8-10/07; System being acid-washed and treated with welgicide. System down time: 53 hours.
8/13-31/07; EW-353 is cycling. Well water draws down to the intake screen, until the pump slows, allowing the well to recharge about 1.5' before the pump speeds back up. EW-353 down time: none.

September

During the month of September, operational parameters were recorded daily on business days.

Table 6-6
Site A Effluent Water Quality

Fiscal Year 2007

	cis-1,2-Dichloroethene (ug/l)	trans-1,2-Dichloroethene (ug/l)	Trichloroethene (ug/l)	1,1,1-Trichloroethane (ug/l)	Mercury (ug/l)
Discharge Limits:	3000	3000	3000	3000	2
17-Oct-06	30	JP 0.59	JP 0.77	<1	B 0.0579
15-Nov-06	36	JP 0.68	JP 0.51	<1	<0.100
13-Dec-06	39	JP 0.62	JP 0.60	<1	<0.100
23-Jan-07	25	JP 0.52	JP 0.49	<1	B 0.0191
14-Feb-07	34	JP 0.55	JP 0.66	<1	<0.100
19-Mar-07	10	JP 0.40	JP 0.64	<1	<0.100
19-Apr-07	12	JP 0.39	JP 0.48	<1	<0.100
16-May-07	19	JP 0.43	JP 0.48	<1	<0.100
14-Jun-07	61	JP 0.62	JP 0.67	<1	B 0.0233
19-Jul-07	56	JP 0.81	JP 0.63	<1	<0.100
27-Aug-07	49	JP 0.75	JP 0.68	<1	<0.100
12-Sep-07	34	JP 0.40	JP 0.34	<1	<0.100

Notes:

JP The value is below the reporting limit, but above the method detection limit. Results should be considered estimated.

B The value is below the reporting limit, but above the method detection limit. Results should be considered estimated.

Table 6-7
Site A Removal Action Monthly VOC Removal

FISCAL YEAR 2007

MONTH	1,2-DCE (ug/l)	TRCLE (ug/l)	TOTAL VOC EFFLUENT (ug/l)	CONVERSION FACTOR (l*lb)/(ug*gal)	WATER PUMPED (gallons)	TOTAL VOC'S REMOVED BY EXTRACTION SYSTEM (lbs)
TOTAL GALLONS PUMPED AND VOC'S REMOVED THROUGH SEPTEMBER 30, 2006					154,965,649	48.78
OCTOBER	30.59	0.77	31.36	8.35E-09	684,446	0.18
NOVEMBER	36.68	0.51	37.19	8.35E-09	1,022,777	0.32
DECEMBER	39.62	0.60	40.22	8.35E-09	776,498	0.26
JANUARY	25.52	0.49	26.01	8.35E-09	782,838	0.17
FEBRUARY	34.55	0.66	35.21	8.35E-09	639,452	0.19
MARCH	10.40	0.64	11.04	8.35E-09	642,872	0.06
APRIL	12.39	0.48	12.87	8.35E-09	722,125	0.08
MAY	19.43	0.48	19.91	8.35E-09	646,138	0.11
JUNE	61.62	0.67	62.29	8.35E-09	784,441	0.41
JULY	56.81	0.63	57.44	8.35E-09	796,060	0.38
AUGUST	49.75	0.68	50.43	8.35E-09	695,101	0.29
SEPTEMBER	34.40	0.34	34.74	8.35E-09	668,482	0.19
TOTAL GALLONS PUMPED AND VOC'S REMOVED FOR FISCAL YEAR 2007					8,861,230	2.64
TOTAL GALLONS TREATED AND VOC'S REMOVED SINCE SYSTEM START UP					163,826,879	51.42

Notes:

1) VOC concentrations do not include estimated concentrations for compounds detected below the reporting limit.

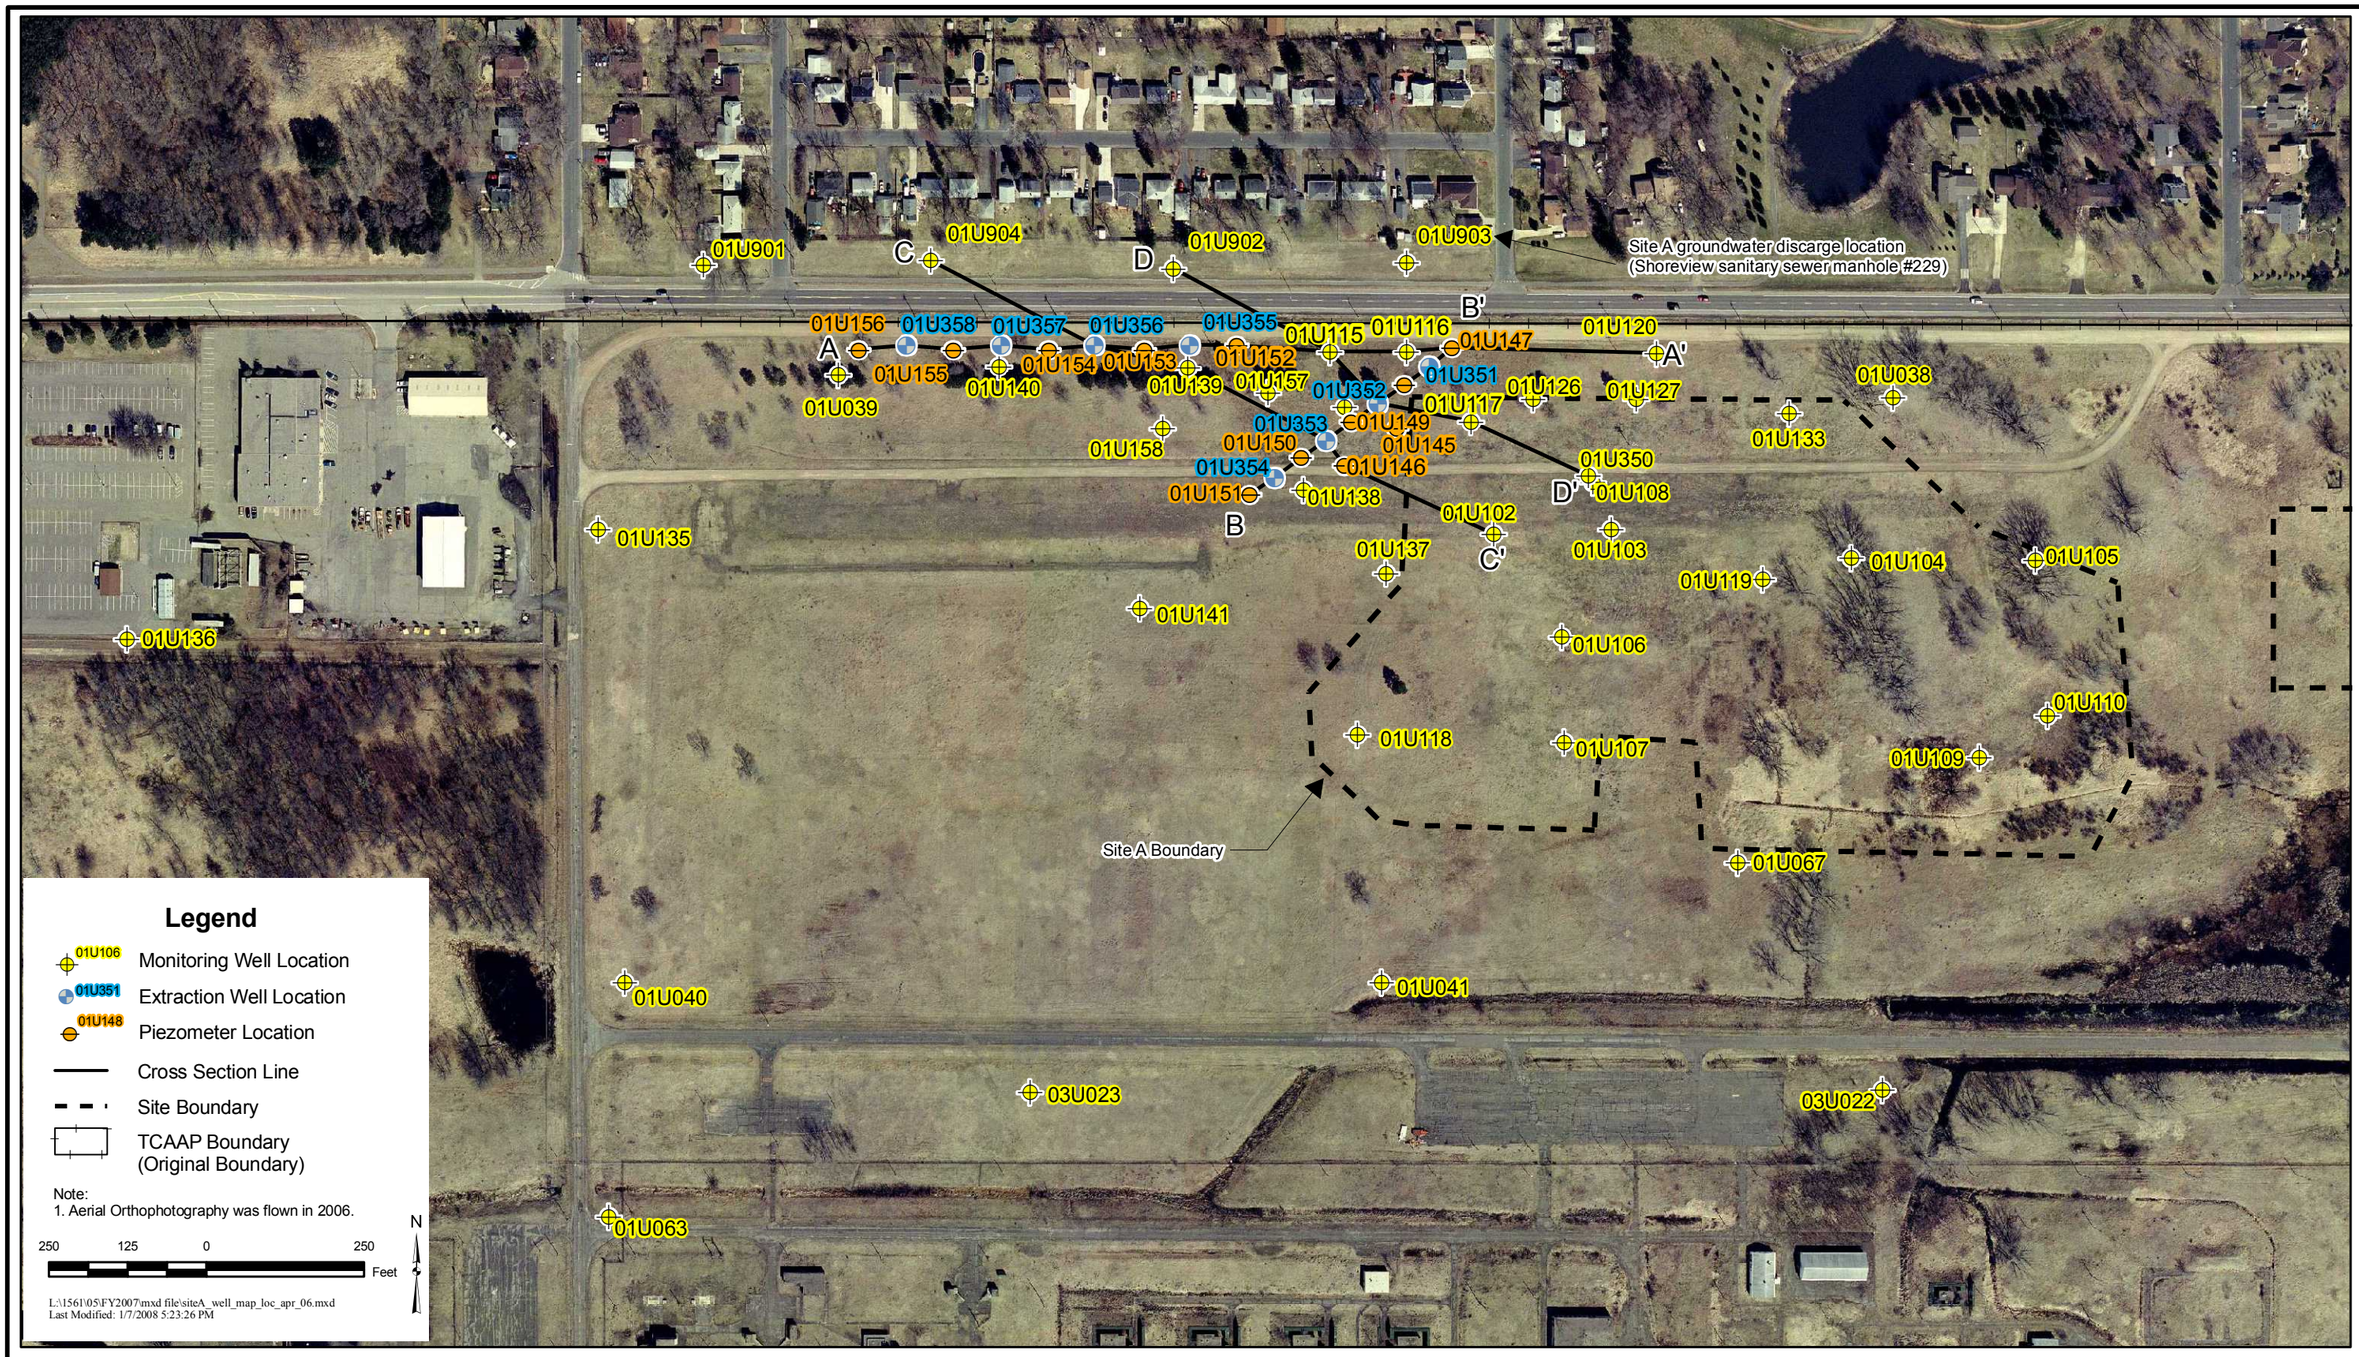

Legend

- 01U106 — Monitoring Well Location
- 01U351 — Extraction Well Location
- 01U148 — Piezometer Location
- Cross Section Line
- Site Boundary
- TCAAP Boundary (Original Boundary)

Note:
1. Aerial Orthophotography was flown in 2006.

250 125 0 250 Feet

N

L:\1561\05\FY2007\mxd file\siteA_well_map_loc_apr_06.mxd
Last Modified: 1/7/2008 5:23:26 PM

TWIN CITIES ARMY AMMUNITION PLANT

Site A, Well Location Map

COPYRIGHT

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 6-1

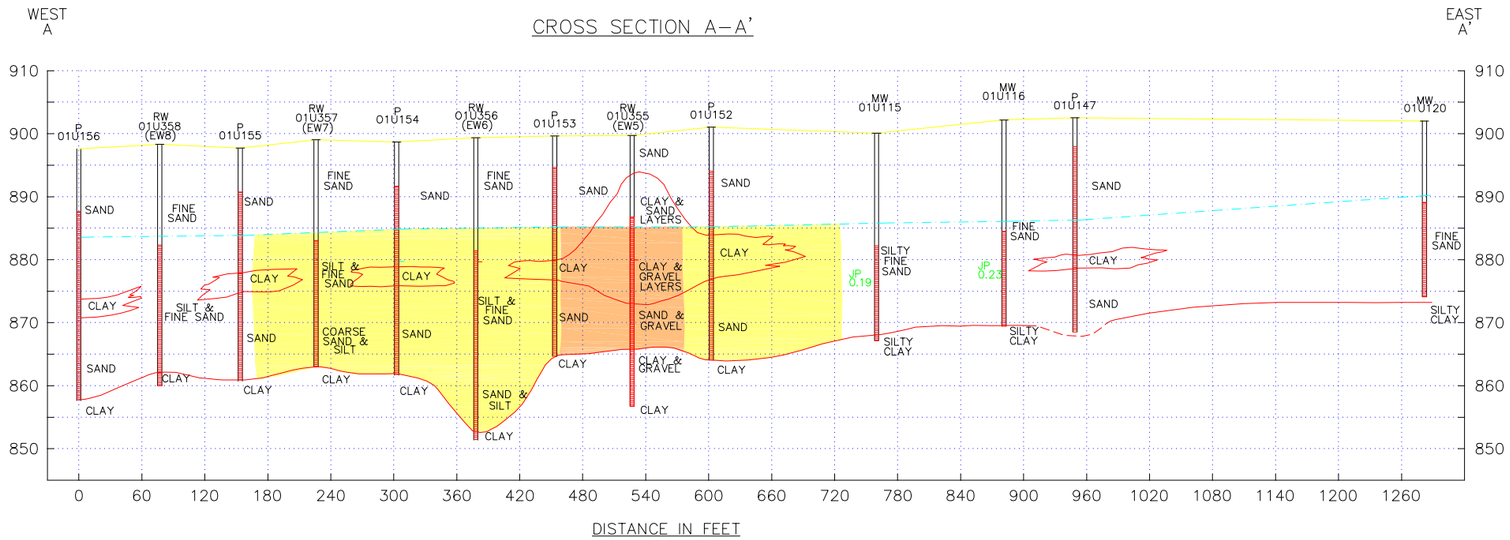

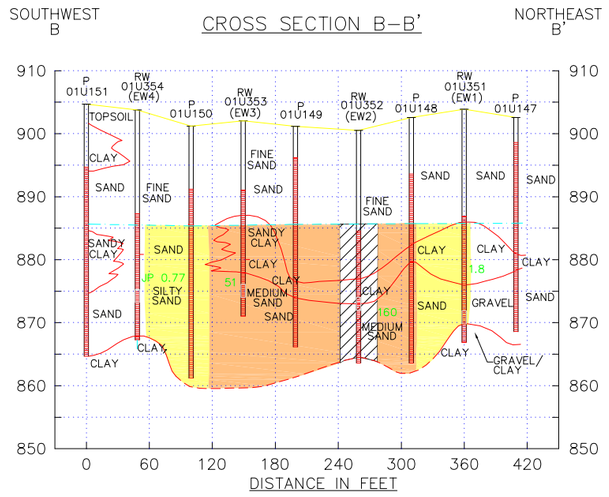

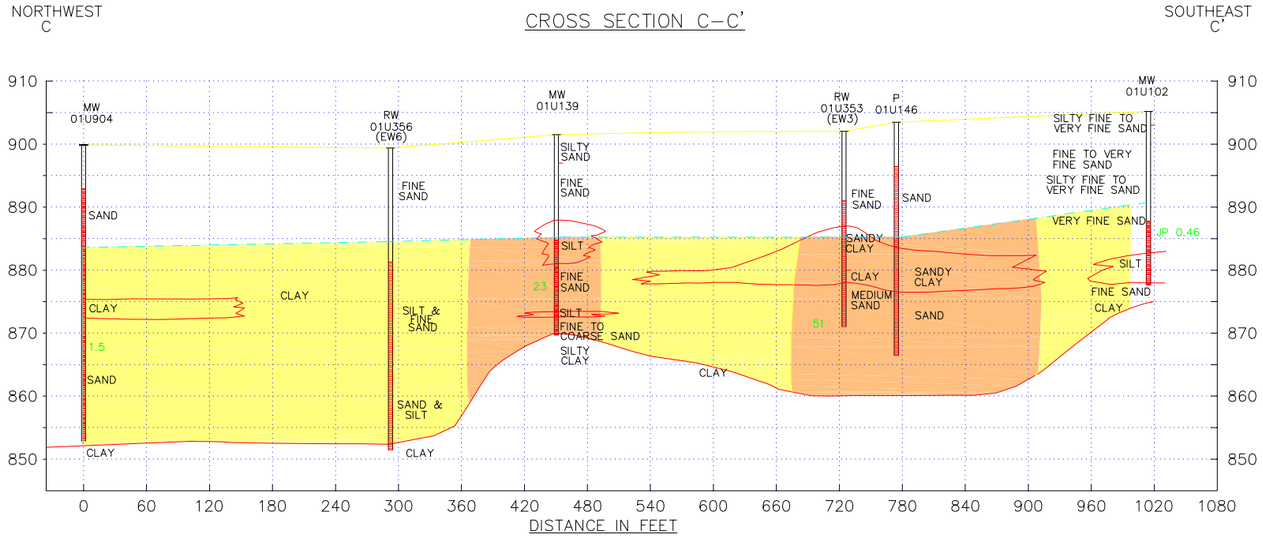

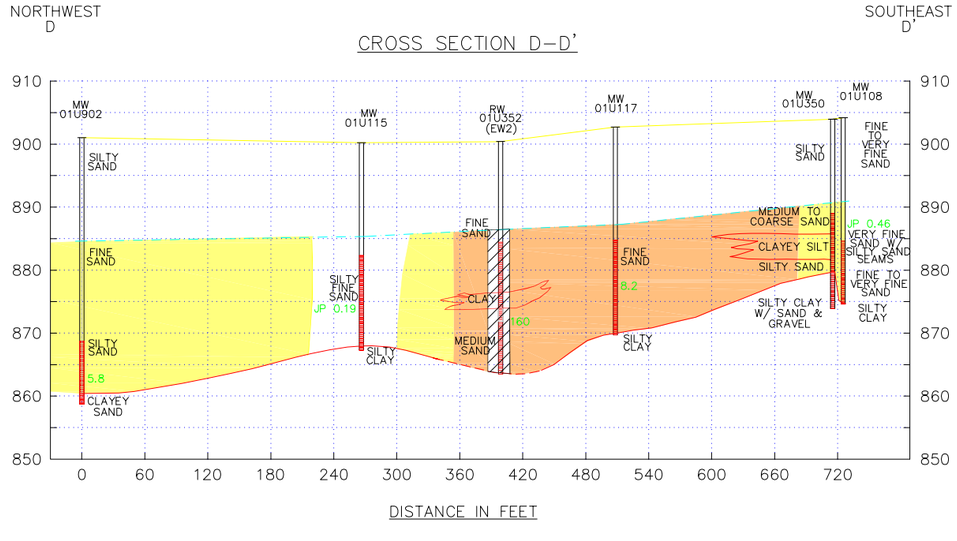

NOTES:

1. RESULTS ARE FROM GROUNDWATER SAMPLES COLLECTED JUNE 13, 14 AND 15, 2007
2. CONSTRUCTION INFORMATION ON RECOVERY WELLS AND PIEZOMETERS WAS GENERATED BY DAHL AND ASSOCIATES, INC. AS PART OF THE SITE A REMOVAL ACTION SYSTEM CONSTRUCTION. CONSTRUCTION INFORMATION ON MONITORING WELLS WAS PROVIDED BY FEDERAL CARTRIDGE COMPANY.

LEGEND

- GEOLOGIC CONTACT
- INFERRED GEOLOGIC CONTACT
- SCREENED INTERVAL OF WELL
- PUMP LOCATION
- 885.0 WATER LEVEL SURFACE
- SLIGHT CHANGE IN GEOLOGIC UNIT (MARK LOCATED ALONG WELL STAFF)
- MW MONITORING WELL
- RW RECOVERY WELL
- P PIEZOMETER

MW 01U117 26 — cis–1,2–DICHLOROETHENE CONCENTRATION (ug/l) (VALUES IN PARENTHESES WERE NOT USED FOR CONTOURING PURPOSES)

cis–1,2–DICHLOROETHENE CONCENTRATIONS

- 1–10 ug/l
- 10–100 ug/l
- >100 ug/l

TWIN CITIES ARMY AMMUNITION PLANT

Site A, cis–1,2–Dichloroethene Cross Sections A–A', B–B', C–C' and D–D' June 2007

COPYRIGHT

Wenck Associates, Inc.
Environmental Engineers
1800 Pioneer Creek Center
Maple Plain, Mn. 55359

FY 2007

Figure 6–2

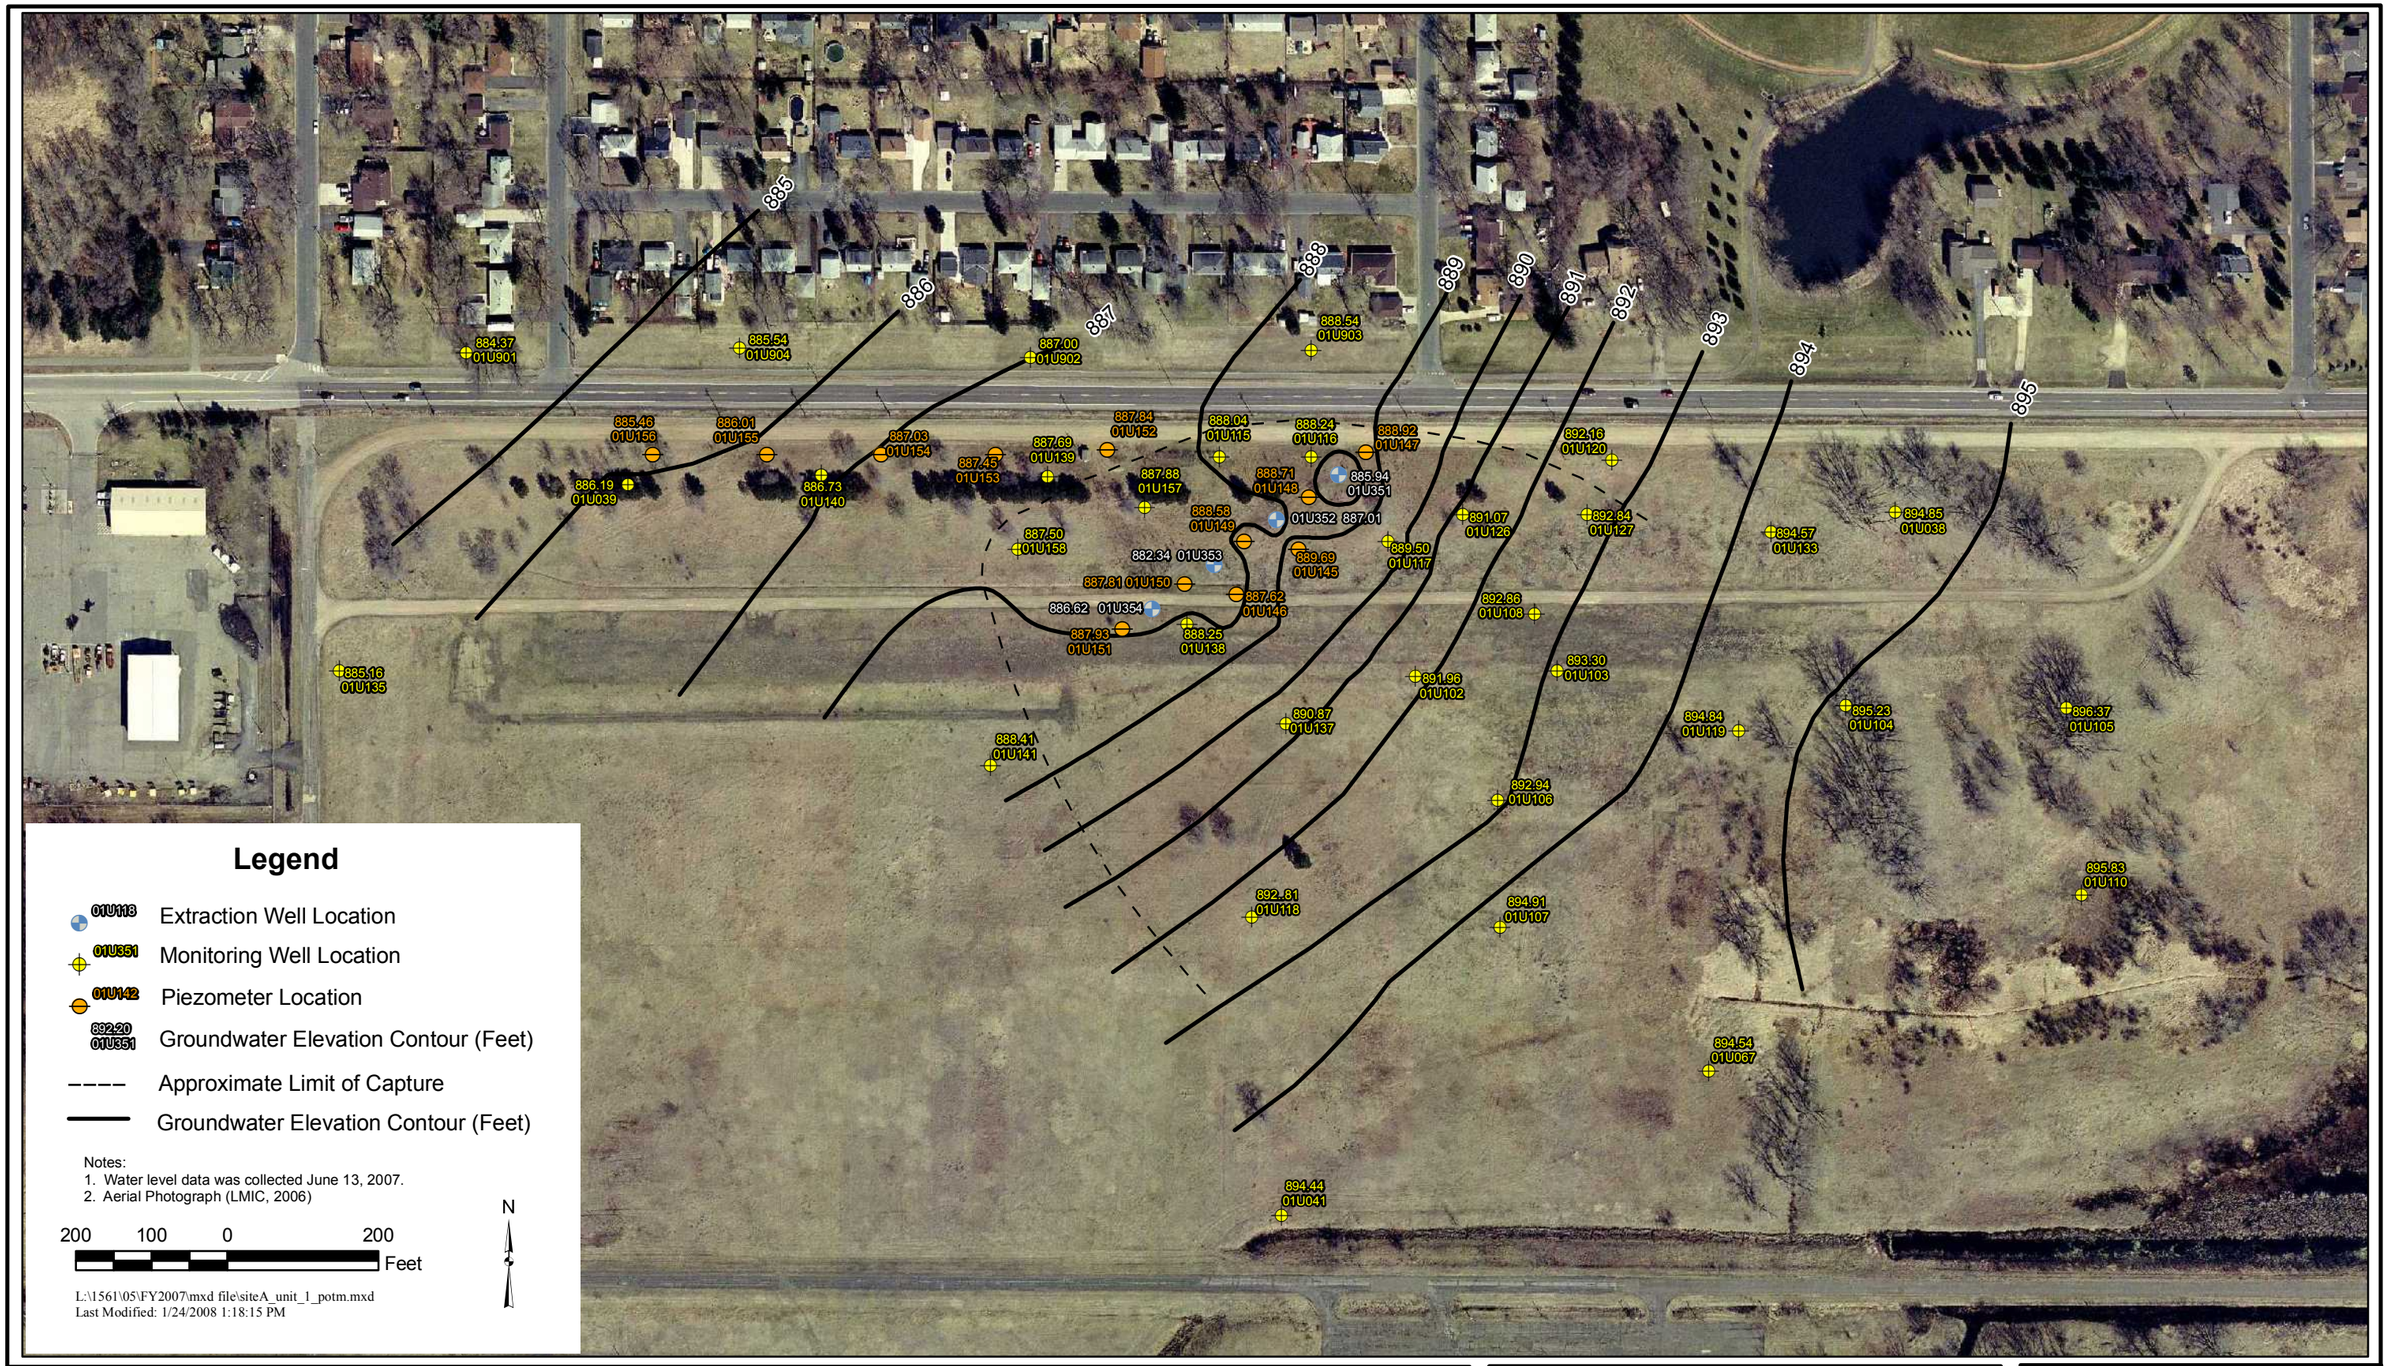

Legend

- 01U118 — Extraction Well Location
- 01U351 — Monitoring Well Location
- 01U142 — Piezometer Location
- 892.20 01U351 — Groundwater Elevation Contour (Feet)
- Approximate Limit of Capture
- Groundwater Elevation Contour (Feet)

Notes:
1. Water level data was collected June 13, 2007.
2. Aerial Photograph (LMIC, 2006)

200 100 0 200 Feet

N

L:\1561\05\FY2007\mxd file\siteA_unit_1_potm.mxd
Last Modified: 1/24/2008 1:18:15 PM

TWIN CITIES ARMY AAMUNITION PLANT

Site A, Unit 1, Potentiometric Map - Summer 2007

COPYRIGHT

Wenck
Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 6-3

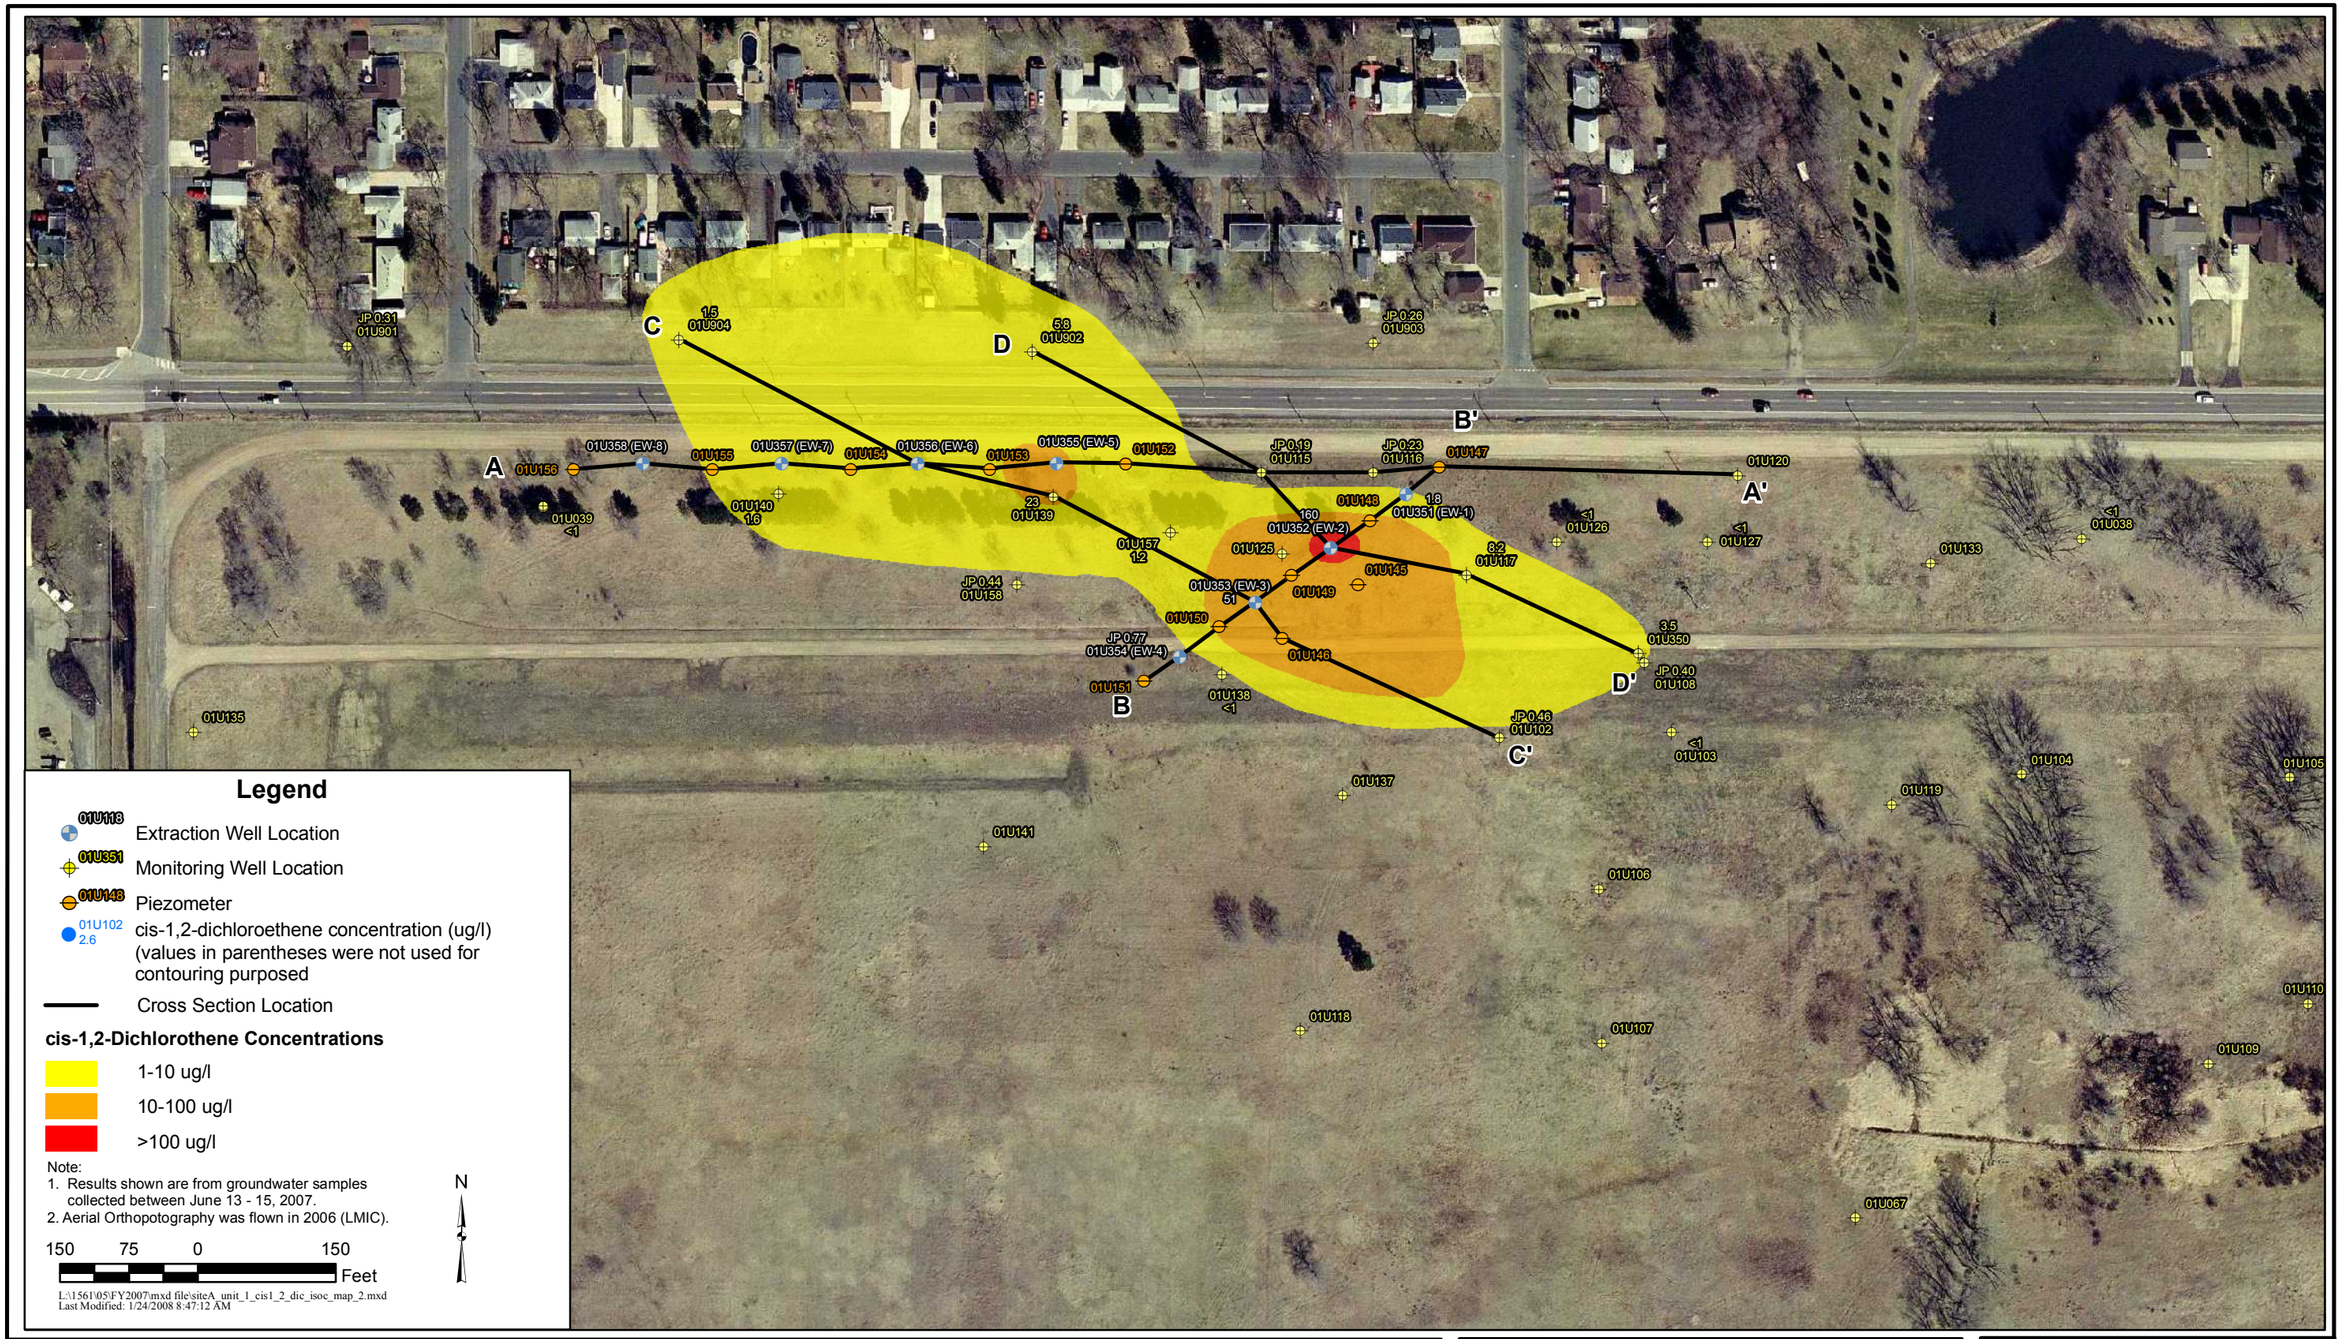

Legend

- 01U118 — Extraction Well Location
- 01U351 — Monitoring Well Location
- 01U148 — Piezometer
- 01U102 2.6 — cis-1,2-dichloroethene concentration (ug/l) (values in parentheses were not used for contouring purposed
- Cross Section Location

cis-1,2-Dichlorothene Concentrations

- 1-10 ug/l
- 10-100 ug/l
- >100 ug/l

Note:
1. Results shown are from groundwater samples collected between June 13 - 15, 2007.
2. Aerial Orthopotography was flown in 2006 (LMIC).

150 75 0 150 Feet

N

L:\1561\05\FY2007\mxd file\siteA_unit_1_cis1_2_dic_isoc_map_2.mxd
Last Modified: 1/24/2008 8:47:12 AM

TWIN CITIES ARMY AMMUNITION PLANT

Site A, Unit 1, cis-1,2-Dichloroethene Isoconcentration Map, Summer 2007

COPYRIGHT

Wenck
Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 6-4

Legend

- 01U118 — Extraction Well Location
- 01U351 — Monitoring Well Location
- 01U148 — Piezometer Location
- 01U102 2.6 — Tetrachloroethene concentration (ug/l) (values in parentheses were not used for contouring purposes)

Tetrachloroethene Concentrations

- 1-10 ug/l
- 10-100 ug/l

Notes:
1. Results shown are from groundwater samples collected between June 13-15, 2007.
2. Aerial Orthophotography was flown in 2006 (LMIC).

N

150 75 0 150 Feet

L:\1561\05\FY2007\mxd file\siteA_unit_1_tetra_isoc_map.mxd
Last Modified: 1/24/2008 9:48:09 AM

TWIN CITIES ARMY AMMUNITION PLANT

Site A, Unit 1 Tetrachloroethene Isocentration Map, Summer 2007

COPYRIGHT

Wenck
Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 6-5

FIGURE 6-6

SITE A, WELL 01U902, TETRACHLOROETHENE, TRICHLOROETHENE, cis-1,2-DICHLOROETHENE WATER QUALITY TRENDS

TWIN CITIES ARMY AMMUNITION PLANT

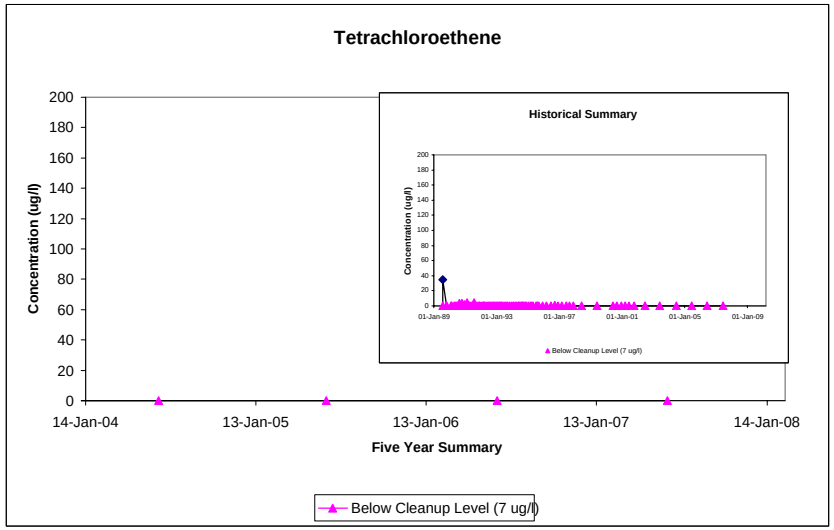

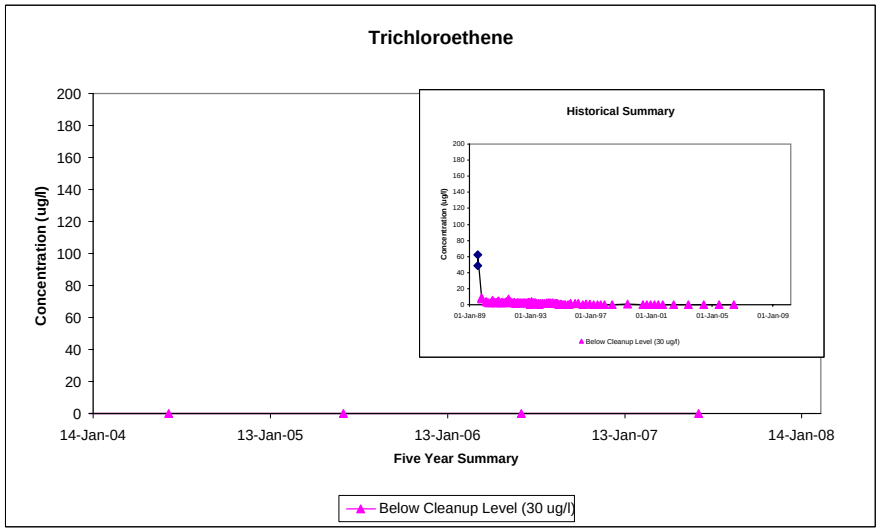

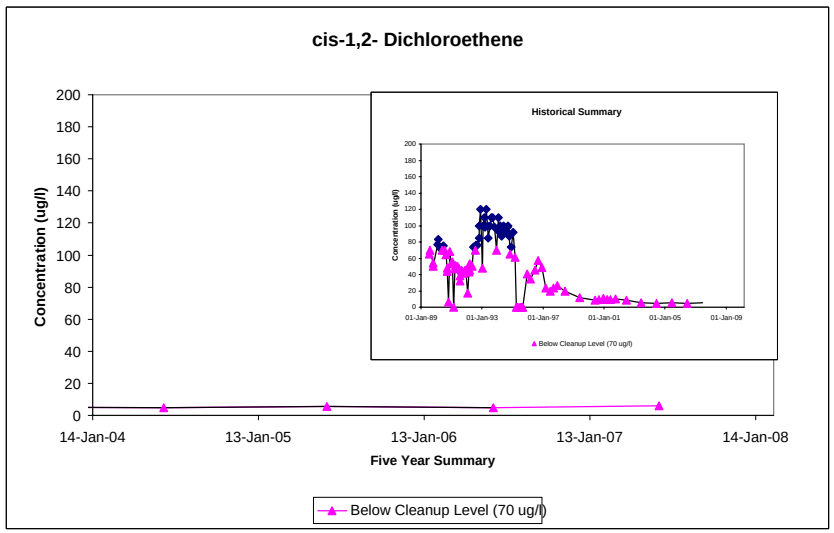

FIGURE 6-7

SITE A, cis-1,2-DICHLOROETHENE WATER QUALITY TRENDS: RECOVERY WELLS

TWIN CITIES ARMY AMMUNITION PLANT

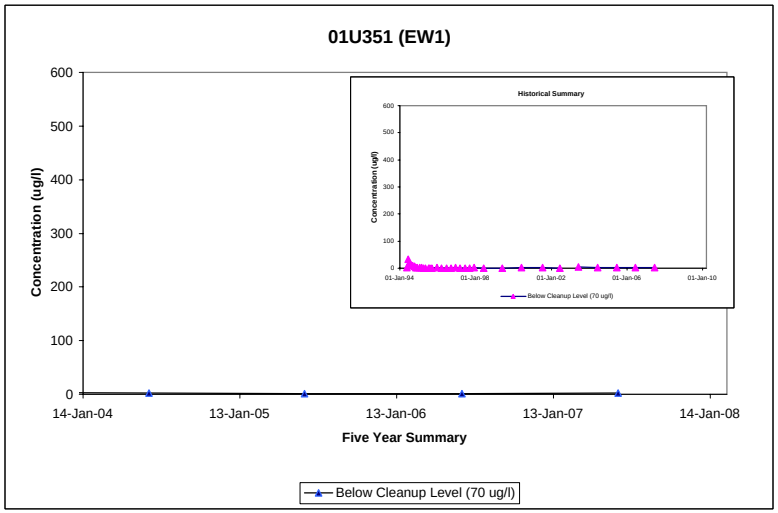

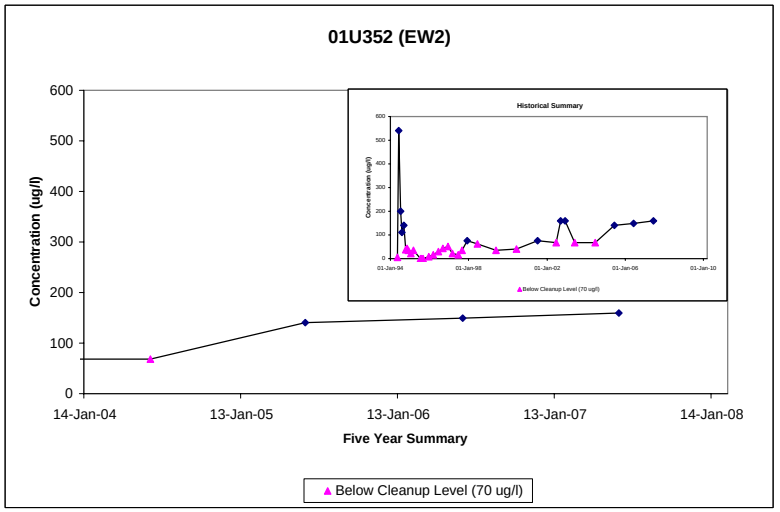

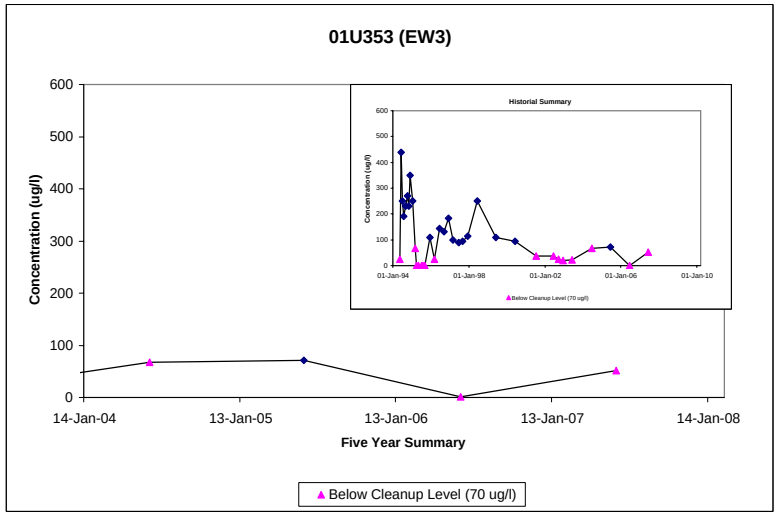

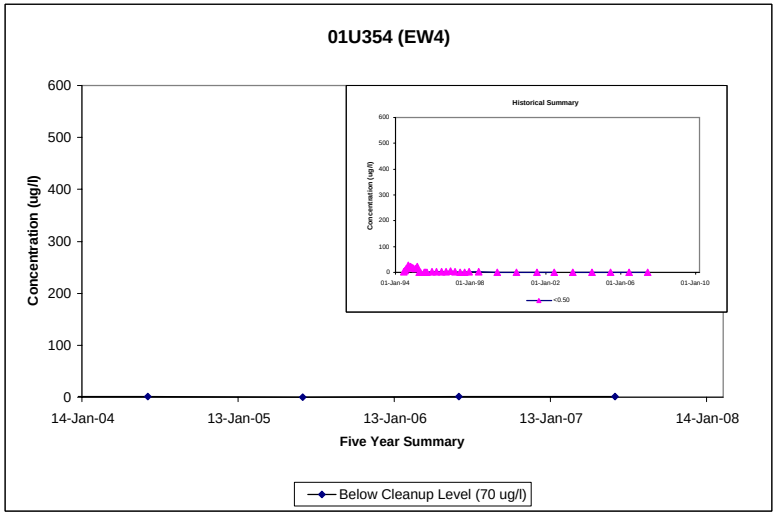

FIGURE 6-8
SITE A, WELL 01U108, TETRACHLOROETHENE, TRICHLOROETHENE, cis-1,2-DICHLOROETHENE WATER QUALITY TRENDS
TWIN CITIES ARMY AMMUNITION PLANT

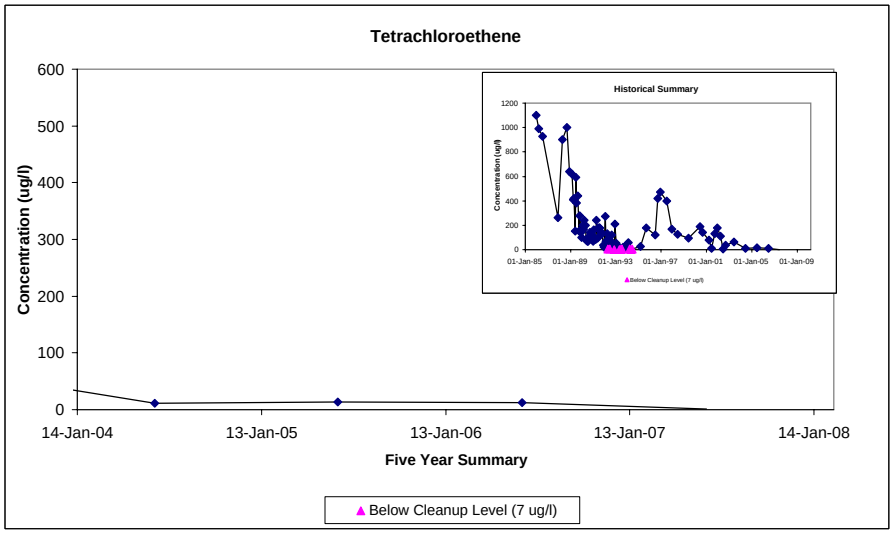

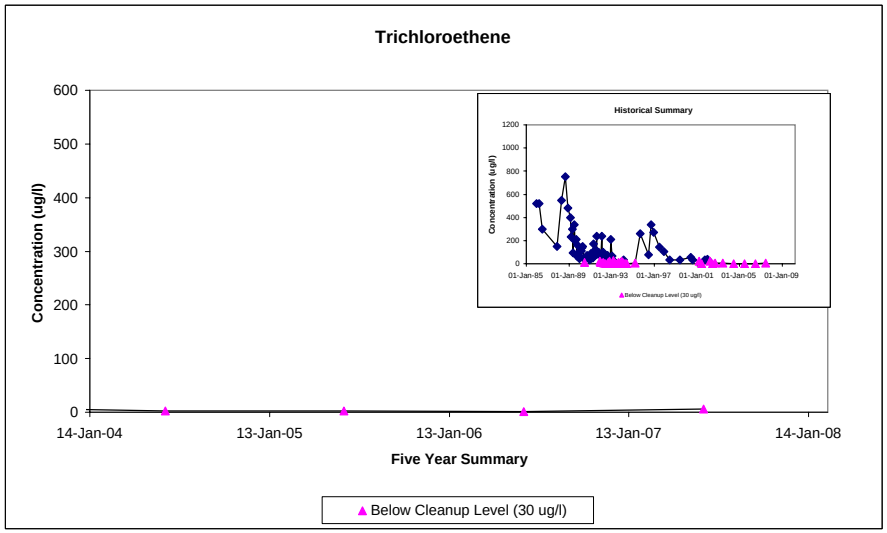

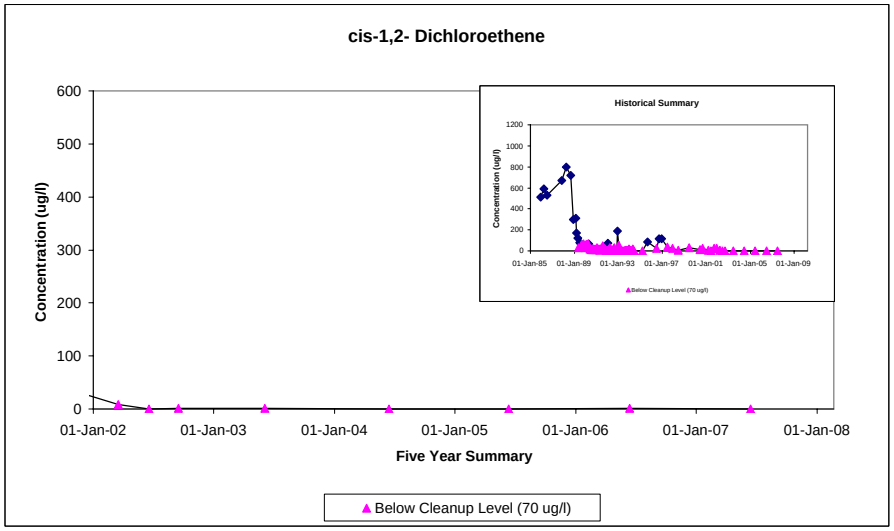

7.0 Site C Groundwater Response Action

The reference for the OU2 ROD is:

Twin Cities Army Ammunition Plant
New Brighton/Arden Hills Superfund Site
Operable Unit 2
RECORD OF DECISION
1997, Amended 2007

The 2007 ROD amendment modified the soil, sediment, surface water, and groundwater remedies for Site C-2 (Site) on TCAAP. The modified remedy included filling in the drainage ditches west and north of the Site to eliminate the surface water exposure points and cover contaminated sediment to prevent direct exposure. Construction was completed near the end of FY 2007. Since the field work was completed near the end of the fiscal year, the amendment did not substantially affect monitoring in FY 2007. Monitoring was completed under the existing contingency plan as discussed below. FY 2008 will be the first year of operation under the modified remedy.

7.1 BACKGROUND

This site had been used for burning of scrap wooden boxes, solvents, oils, and production materials, and also had been used for land disposal and open storage. The remedial investigation/feasibility study process conducted for Site C, as documented in the OU2 ROD, identified six chemicals of concern (COCs) in Site C soils (antimony, arsenic, beryllium, lead, manganese, and thallium, with lead having the highest concentration and most prevalent detection), but did not identify any groundwater COCs.

In FY 1997, the U.S. Army Environmental Center (USAEC) funded a technology demonstration study of phytoremediation of contaminated soil at Site C. Corn and mustard crops were planted and harvested during the two growing seasons in FY 1998 and FY 1999. During the growing seasons, EDTA was applied to the soils to improve the metals uptake by the crops, and had the unintended consequence of causing migration of lead from the soils into the shallow groundwater, which is present within a few feet from the ground surface. On August 10, 2000, the MPCA issued a Notice of Violation to the Army for the impacts to Site C shallow groundwater caused by the phytoremediation demonstration project, requiring that the Army implement corrective actions.

At Site C, Unit 1 contains groundwater, but the aquifer yield is low and the water is not used as a municipal water supply source by any of the surrounding communities. Groundwater in Unit 1 generally flows north beneath Site C and then turns westward, ultimately discharging to Rice Creek. Unit 2 lies beneath Unit 1 and is a glacial till deposit that behaves as an aquitard at TCAAP, preventing downward migration of contaminants. Additional hydrogeologic information is presented in "Hydrogeologic Investigation of Site C", by Shaw Environmental & Infrastructure, March 9, 2001.

The Army installed a groundwater recovery trench to contain the plume, which was operated between November 2000 and July 2001. On July 6, 2001, the Army began operating three extraction wells, located as shown on Figure 7-1, to contain the plume (replacing recovery trench operation). At the start of extraction well operation, extracted groundwater met the MCES requirements for direct discharge to the sanitary sewer (without treatment). On July 15, 2002, due to elevated lead concentrations in EW-3, the Army began pre-treating water from EW-3 using two types of filter media, and has continued to discharge extracted groundwater to the sanitary sewer under an MCES permit.

Man-made ditches are present north and west of the phytoremediation demonstration plot area, and were monitored, as shown on Figure 7-2. Before they were filled in FY 2007, the ditches ultimately discharge into Rice Creek, which is also monitored.

Figures 7-3 and 7-4 present cross-sections showing the geological features of the shallow soil and aquifer (the cross-section alignments are shown on Figure 7-1). The cross-sections show the complex geology of the Site, including significant accumulations of peat, consistent with the nearby wetlands and location in a drainage area.

In February 2002, a contingency plan was prepared to address the operation of the groundwater response action. The monitoring requirements are driven by the contingency plan. The monitoring plan for Site C is presented in Appendix A.5. It includes 16 monitoring wells and three extraction wells, as shown on Figure 7-1, and 8 surface water sampling locations, as shown on Figure 7-2.

The parameters being monitored at this site are copper, lead, total hardness, and EDTA, which were all cited in the Notice of Violation. Lead is the primary chemical of concern (COC) in both the soil and groundwater. Five of the six COCs in Site C soils (antimony, arsenic, beryllium, manganese, and thallium) are not currently being monitored. These analytes were routinely monitored in groundwater and surface water through April 2002; however, since this monitoring data indicated that these analytes were not of concern, the MPCA approved discontinuing monitoring of these five analytes. Copper has continued to be monitored because concentrations have exceeded the respective surface water standard near the phytoremediation demonstration area at Site C. The complete historical water quality database is presented in Appendix D.3 (during FY 2004 and prior thereto, the historical water quality database was included with the Site C monthly data reports that were submitted electronically by the Army to the USEPA and MPCA).

The action levels for lead and copper are the State of Minnesota surface water standards (chronic), as defined in Minnesota Rules Chapter 7050.0222, that are applicable to the ditches and Rice Creek. The action levels are different for the ditches and Rice Creek because the standard is dependent on the ambient hardness of the surface water. These action levels are based on total hardness levels of 257 and 155 milligrams per liter (mg/l) for the ditches and Rice Creek, respectively. Thus, hardness itself does not have an action level, but is monitored

annually in surface water to document these values in relation to the values that were used in calculating the lead and copper standards. EDTA is monitored because its concentrations are known to be elevated in groundwater; however, there are no applicable surface water or groundwater standards, and no decisions are being made based on the data. The EDTA data are thus considered "screening data" that are being collected for informational purposes only.

The elements of the contingency plan, used as guidance through most of FY 2007, are described in the following subsections in a format consistent with the other Sites addressed in this document. Subsequent Annual Performance Reports will address the remedy components, as they will appear in the Amended ROD.

7.2 REMEDY COMPONENT #1: GROUNDWATER MONITORING

Description: Monitor groundwater to track progress of the remedy and identify potential exceedances at compliance points.

Performance Standard (how do you know when you're done):
When a performance groundwater monitoring program has been established and ongoing monitoring is in compliance with the program.

Is this remedy component being implemented?
Yes. The groundwater monitoring program is ongoing. The Monitoring Plan for Site C is included in Appendix A.5. Unit 3 well 03U083 was added, with USEPA and MPCA approval, to the monitoring program for FY 2005 through FY 2007. This well will be sampled and analyzed for lead to verify that migration downward into the Unit 3 aquifer is not occurring.

7.3 REMEDY COMPONENT #2: SURFACE WATER MONITORING

Description: Monitor surface water to identify potential exceedances of the chronic standards.

Performance Standard (how do you know when you're done):
When a performance surface water monitoring program has been established and ongoing monitoring is in compliance with the program.

Is this remedy component being implemented?
Yes. The surface water monitoring program is ongoing. The Monitoring Plan for Site C is included in Appendix A.5.

7.4 REMEDY COMPONENT #3: GROUNDWATER CONTAINMENT

Description: Operate extraction wells to contain the lead plume.

Performance Standard (how do you know when you're done):
When a groundwater containment system is operating consistent with the requirements of the "Groundwater Extraction and Remediation System Design," by Shaw Environment and Infrastructure (Draft), and the concentrations at specified monitoring points are within the requirements of the contingency plan.

Is this remedy component being implemented?
Yes. Three extraction wells (EW-1, EW-2, and EW-3) are currently in operation. After the system was started, Shaw developed an operating criteria that specified that the pumping water levels in the extraction wells be maintained at least 14 feet below the top of casing. This criteria was agreed to with the MPCA. These drawdowns are being achieved.

Figure 7-5 presents the groundwater contours from June 2007. Appendix D.3 includes the historical groundwater level database for Site C. The hydraulic effect of the extraction well operation can be seen in the northern portion of the Site. The groundwater contours for the Site are complex, likely related to the heterogeneous nature of the geology (see cross-sections). In addition, the previously used groundwater extraction trench may be having a local influence on groundwater flow. The trench is aligned roughly parallel to the groundwater flow and upgradient of the extraction wells. Because of this alignment it does not pose a risk to capture and containment but does appear to influence the groundwater contours immediately around it.

Figure 7-6 presents the lead data from June 2007. The areas of exceedances are upgradient of the extraction wells and within the likely area of capture shown on Figure 7-5. The lack of lead exceedances in surface water (see discussions below) indicates that the system is capturing groundwater effectively.

7.5 REMEDY COMPONENT #4: EXTRACTED WATER TREATMENT AND DISCHARGE

Performance Standard (how do you know when you're done):

When the extracted groundwater is treated to meet the requirements of the MCES discharge permit.

Are the permit discharge requirements being met?

Yes. Table 7-1 presents the effluent analytical results for FY 2007 and the MCES discharge limits. The combined effluent is labeled "Effluent-C" on Table 7-1. The MCES requirements, which apply to the combined effluent, for lead, mercury, and pH were met. The other compounds listed are not regulated in the MCES permit.

7.6 REMEDY COMPONENT #5: CONTINGENCY PLAN FOR GROUNDWATER

Description: Contain and treat groundwater if trigger points are exceeded.

Performance Standard (how do you know when you're done):
The triggers for implementing contingency actions with respect to groundwater at Site C are:

- When the groundwater sample results from monitoring wells (MW) MW-6, MW-12, and MW-16 at the north end of the site are above the surface water chronic standard for the ditch during the same sampling event, or
- When the groundwater sample results from monitoring wells MW-4, MW-8, MW-9, MW-10, and MW-11 are above the surface water chronic standard for the ditch during the same sampling event.

If one of the triggers discussed above is met, the extraction system will be modified to increase the total volume of water extracted. The extraction and treatment system will continue to operate in the contingency plan mode (i.e., increased extracted water) until the hydraulic containment is re-evaluated.

Have groundwater concentrations remained below the trigger points?
Yes. Table 7-2 presents the FY 2007 analytical results for groundwater. In FY 2007, the lead chronic standard for the ditch was 6.9 µg/l. There were no exceedances of the triggers in FY 2007. Appendix D.3 presents the historical database for groundwater. In addition, lead trend graphs for the individual monitoring wells are presented in Appendix B (Figure B-3).

Monitoring well MW-11 individually exhibited lead concentrations above the chronic standard in May 2007 with a detection at 13.6 µg/l. The other wells in the contingency group remained below the trigger. These results suggest, especially with the low to non-detectable concentrations at nearby MW-8, that the elevated detections at MW-11 are isolated and do not indicate an overall increase in the lead concentrations. Since MW-11 was the only exceedance and below

the trigger in all the other rounds, these results do not indicate a problem with the containment remedy.

7.7 REMEDY COMPONENT #6: CONTINGENCY PLAN FOR SURFACE WATER

Description: Contain and treat surface water if trigger points are exceeded.

Performance Standard (how do you know when you're done):
When a contingency plan for surface water is in place and monitoring is in compliance with the program.

The triggers for implementation of contingency actions with respect to surface water at Site C are:

- When the average concentration of the 3-day monthly sampling event at sample location SW-6 is above the current surface water chronic standard for the ditch for one quarter (i.e., three consecutive months).
- When the average concentration of the 3-day monthly sampling event is above the surface water chronic standard for Rice Creek at sample location SW-8. The surface water chronic standard for Rice Creek is 4.0 μg/l.

If the trigger at SW-6 or SW-8 is met, then the surface water at SW-6 will be contained and collected. Collected surface water will be treated, if necessary, and discharged to the sanitary sewer. The surface water at SW-6 will continue to be contained and collected until the average concentration of the 3-day monthly sampling event at sample location SW-6 is below the current surface water chronic standard for one quarter (i.e., three consecutive months).

Have surface water concentrations remained below the trigger points?
Yes. Table 7-3 presents the FY 2007 analytical results for surface water. The surface water chronic standard for the ditch (SW-6) is 6.9 µg/l and the chronic standard for Rice Creek is 4 µg/l. No surface water triggers were exceeded in FY 2007. Appendix D.3 presents the historical database for surface water samples.

7.8 OVERALL REMEDY FOR SITE C SHALLOW GROUNDWATER

The groundwater containment remedy for Site C is operating as required by the contingency plan and subsequent agreements, and the data trends indicate that progress towards the remedial objectives is being achieved.

Table 7-4 presents a summary of the lead mass removal and pumped volumes through FY 2007. In FY 2007, the system treated 684,480 gallons of water and removed 0.18 pounds of lead. The lead mass removal decreased significantly from 2.42 pounds of lead in FY 2006. Overall, the system has treated 10.791 million gallons of water and removed 101.8 pounds of lead.

Are any changes proposed for the remedy? Yes. The contingency plan and monitoring plan will be revised in FY 2008 to address the removal of the surface water exposure. This is required in the ROD Amendment.

Table 7-1
Site C Extraction Well/Effluent Data
FY-2007

Sample Location	Collection Date	Collection Time	Lab	Total Lead (MCES Discharge Limit: 1) mg/L	Data Qualifier	Mercury (MCES Discharge Limit: 0.002) mg/L	pH (MCES Discharge Limit: 5-11) pH	COD (MCES Discharge Limit: 250) mg/L	TSS mg/L	Copper	Data Qualifier	EDTA as Na2EDTA mg/L	EDTA as EDTA mg/L	Calcium mg/L	Sulfide mg/L	Iron mg/L
EW1	10/11/2006	3:00	CompuChem	0.00016	B											
EW2	10/11/2006	3:05	CompuChem	0.00014	B											
EW3	10/11/2006	3:10	CompuChem	0.238												
EFFLUENT-C	10/16/2006	10:15	Legend	0.067		<0.00020	6.8									
EFFLUENT-C	11/13/2006	10:30	Legend	0.017		<0.00020	7.1									
EW1	11/21/2006	9:45	CompuChem	0.00010	B											
EW2	11/21/2006	9:48	CompuChem	0.00021	B											
EW3	11/21/2006	9:50	CompuChem	0.137												
EFFLUENT-C	12/11/2006	10:30	Legend	0.047		<0.00020	7.2									
EW1	12/14/2006	11:00	CompuChem	0.00053	B											
EW2	12/14/2006	11:05	CompuChem	0.00021	B											
EW3	12/14/2006	11:10	CompuChem	0.114												
EFFLUENT-C	1/8/2007	10:30	Legend	0.045		<0.00020	6.8									
EW1	1/17/2007	12:05	CompuChem	0.00022	B											
EW2	1/17/2007	12:10	CompuChem	0.00014	B											
EW3	1/17/2007	12:15	CompuChem	0.0786												
EFFLUENT-C	2/12/2007	10:30	Legend	0.019		<0.00020	6.7									
EW1	2/21/2007	2:10	CompuChem	0.00032												
EW2	2/21/2007	2:15	CompuChem	0.00015												
EW3	2/21/2007	2:20	CompuChem	0.0664												
EFFLUENT-C	3/12/2007	10:00	Legend	0.014		<0.00020	6.8									
EW1	3/12/2007	2:10	CompuChem	0.00024	B	UB0.1										
EW2	3/12/2007	2:15	CompuChem	0.00028	B	UB0.1										
EW3	3/12/2007	2:20	CompuChem	0.0454												
EFFLUENT-C	4/9/2007	9:45	Legend	0.025		<0.00020	6.8									
EW1	4/19/2007	11:55	ChemServe										8.52			
EW2	4/19/2007	12:00	ChemServe										224			
EW3	4/19/2007	12:05	ChemServe										187			
EFFLUENT-C	4/19/2007	1:10	ChemServe										200			
EW1	4/19/2007	11:55	CompuChem	0.00015	B					3.1						
EW2	4/19/2007	12:00	CompuChem	0.00014	B					0.73	B					
EW3	4/19/2007	12:05	CompuChem	0.0749						2.8						
EFFLUENT-C	5/14/2007	10:00	Legend	0.096		<0.00020	6.7									
EW1	5/17/2007	1:00	CompuChem	0.00010	B											
EW2	5/17/2007	1:05	CompuChem	0.000061	B											
EW3	5/17/2007	1:10	CompuChem	0.0859												
EFFLUENT-C	6/11/2007	10:30	Legend	0.031		<0.00020	7.0	25.4	30							
EW1	6/21/2007	12:40	CompuChem	0.00032	B											
EW2	6/21/2007	12:45	CompuChem	0.000090	B											
EW3	6/21/2007	12:50	CompuChem	0.123												
EFFLUENT-C	7/9/2007	8:40	Legend	0.030		<0.00020	7.0									
EW1	7/19/2007	3:10	CompuChem	0.00012	B											
EW2	7/19/2007	3:15	CompuChem	0.0045												
EW3	7/19/2007	3:20	CompuChem	0.117												
EFFLUENT-C	8/23/2007	9:45	Legend	0.059		<0.00020	6.8									
EW1	8/29/2007	11:15	CompuChem	0.00036	B											
EW2	8/29/2007	11:20	CompuChem	0.00017	B											
EW3	8/29/2007	11:25	CompuChem	0.0497												
EFFLUENT-C	9/10/2007	10:00	Legend	0.029		<0.00020	6.8									
EW1	9/24/2007	9:30	CompuChem	0.00042	B											
EW2	9/24/2007	9:35	CompuChem	0.00033	B											
EW3	9/24/2007	9:40	CompuChem	0.0417												

Table 7-2
Water Quality Data for Site C Groundwater

Fiscal Year 2007

Sample Location	Date Collected	Lead (Dissolved) (ug/l)	L	D	Copper (Dissolved) (ug/l)	L	D	EDTA as EDTA (mg/l)	L	D
Monitoring Wells:										
MW 1	10/9/06	0.011	B	UB0.04		NS			NS	
MW 1	1/18/07	0.026	U			NS			NS	
MW 1	4/18/07	0.029	U		0.27	B		<1.00		
MW 1	7/18/07	0.019	B	UB0.02		NS			NS	
MW 2	10/10/06	0.024	B	UB0.04		NS			NS	
MW 2	1/18/07	0.026	U			NS			NS	
MW 2	4/18/07	0.029	U		2.5			<1.00		
MW 2	7/18/07	0.084	B	UB0.02		NS			NS	
MW 2D	7/18/07	0.062	B	UB0.02		NS			NS	
MW 3	10/11/06	116				NS			NS	
MW 3	1/18/07	127				NS			NS	
MW 3	4/19/07	309			0.30	B	UB0.4	200		
MW 3	7/19/07	154				NS			NS	
MW 4	10/10/06	0.041	B	UB0.04		NS			NS	
MW 4D	10/10/06	0.057	B	UB0.04		NS			NS	
MW 4	11/21/06	0.060	B	UB0.05		NS			NS	
MW 4	12/14/06	0.035	B	UB0.04		NS			NS	
MW 4	1/17/07	0.026	U	JK-0.05		NS			NS	
MW 4	2/22/07	0.026	U			NS			NS	
MW 4	3/12/07	0.14	B	UB0.1		NS			NS	
MW 4	4/19/07	0.029	U		0.17	B	UB0.4	3.73		
MW 4	5/17/07	0.029	U			NS			NS	
MW 4	6/20/07	0.027	B	UB0.02		NS			NS	
MW 4	7/19/07	0.063	B			NS			NS	
MW 4	8/27/07	0.016	B	UB0.08		NS			NS	
MW 4	9/24/07	0.041	B	UB0.08		NS			NS	
MW 5	10/9/06	0.039	B	UB0.04		NS			NS	
MW 5	1/18/07	0.26	B	UB0.3		NS			NS	
MW 5	4/18/07	0.029	U		0.93	B		<1.00		
MW 5	7/18/07	0.094	B	UB0.02		NS			NS	
MW 6	10/10/06	0.014	B	UB0.04		NS			NS	
MW 6	11/21/06	0.084	B	UB0.05		NS			NS	
MW 6	12/14/06	0.074	B	UB0.04		NS			NS	
MW 6	1/17/07	0.026	U	JK-0.05		NS			NS	
MW 6	2/21/07	0.026	U			NS			NS	

Table 7-2
Water Quality Data for Site C Groundwater

Fiscal Year 2007

Sample Location	Date Collected	Lead (Dissolved) (ug/l)			Copper (Dissolved) (ug/l)			EDTA as EDTA (mg/l)		
			L	D		L	D		L	D
MW 6	3/12/07	0.12	B	UB0.1		NS			NS	
MW 6	4/18/07	0.029	U		0.12	B		11.4		
MW 6D	4/18/07	0.029	U		0.14	B		11.2		
MW 6	5/17/07	0.029	U			NS			NS	
MW 6	6/20/07	0.018	B	UB0.02		NS			NS	
MW 6	7/18/07	0.043	B	UB0.02		NS			NS	
MW 6	8/29/07	0.037	B	UB0.08		NS			NS	
MW 6	9/24/07	0.044	B	UB0.08		NS			NS	
MW 7	10/10/06	0.098	B	UB0.04		NS			NS	
MW 7	1/17/07	0.026	U	JK-0.05		NS			NS	
MW 7	4/19/07	0.054	B	UB0.04	0.22	B	UB0.4	17.6		
MW 7	7/18/07	0.027	B	UB0.02		NS			NS	
MW 8	10/10/06	0.019	B	UB0.04		NS			NS	
MW 8	11/21/06	0.042	B	UB0.05		NS			NS	
MW 8D	11/21/06	0.039	B	UB0.05		NS			NS	
MW 8	12/14/06	0.024	B	UB0.04		NS			NS	
MW 8	1/17/07	0.063	B	UB0.14		NS			NS	
MW 8	2/22/07	0.026	U			NS			NS	
MW 8	3/12/07	0.22	B	UB0.1		NS			NS	
MW 8	4/19/07	0.029	U		0.12	B	UB0.4	6.65		
MW 8D	4/19/07	0.031	B	UB0.04	0.21	B	UB0.4	6.09		
MW 8	5/17/07	0.048	B			NS			NS	
MW 8D	5/17/07	0.029	U			NS			NS	
MW 8	6/20/07	0.015	U			NS			NS	
MW 8	7/18/07	0.015	U			NS			NS	
MW 8	8/28/07	0.042	B	UB0.08		NS			NS	
MW 8D	8/28/07	0.060	B	UB0.08		NS			NS	
MW 8	9/24/07	0.041	B	UB0.08		NS			NS	
MW 9	10/9/06	0.017	B	UB0.04		NS			NS	
MW 9	11/21/06	0.057	B	UB0.05		NS			NS	
MW 9	12/14/06	0.037	B	UB0.04		NS			NS	
MW 9D	12/14/06	0.038	B	UB0.04		NS			NS	
MW 9	1/18/07	0.026	U			NS			NS	
MW 9	2/22/07	0.026	U			NS			NS	
MW 9	3/12/07	0.12	B	UB0.1		NS			NS	
MW 9	4/18/07	0.036	B		0.35	B		<1.00		
MW 9	5/17/07	0.029	U			NS			NS	
MW 9	6/20/07	0.034	B	UB0.02		NS			NS	

Table 7-2
Water Quality Data for Site C Groundwater

Fiscal Year 2007

Sample Location	Date Collected	Lead (Dissolved) (ug/l)	L	D	Copper (Dissolved) (ug/l)	L	D	EDTA as EDTA (mg/l)	L	D
MW 9	7/19/07	0.049	B			NS			NS	
MW 9	8/27/07	0.048	B	UB0.08		NS			NS	
MW 9D	8/27/07	0.23	B	UB0.08		NS			NS	
MW 9	9/24/07	0.45	B			NS			NS	
MW 9D	9/24/07	0.11	B	UB0.08		NS			NS	
MW 10	10/9/06	0.02	B	UB0.04		NS			NS	
MW 10	11/21/06	0.067	B	UB0.05		NS			NS	
MW 10	12/14/06	0.042	B	UB0.04		NS			NS	
MW 10	1/17/07	0.026	U	JK-0.05		NS			NS	
MW 10	4/18/07	0.055	B		0.15	B		<1.00		
MW 10	5/17/07	0.029	U			NS			NS	
MW 10	6/20/07	0.024	B	UB0.02		NS			NS	
MW 10	7/19/07	0.021	B			NS			NS	
MW 10	8/28/07	0.071	B	UB0.08		NS			NS	
MW 10	9/24/07	0.092	B	UB0.08		NS			NS	
MW 10D	9/24/07	0.12	B	UB0.08		NS			NS	
MW 11	10/10/06	0.085	B	UB0.04		NS			NS	
MW 11	11/21/06	0.12	B	UB0.05		NS			NS	
MW 11	12/14/06	0.11	B	UB0.04		NS			NS	
MW 11	1/17/07	0.29	B	UB0.14		NS			NS	
MW 11	2/22/07	0.098	B			NS			NS	
MW 11D	2/22/07	0.056	B			NS			NS	
MW 11	3/12/07	0.17	B	UB0.1		NS			NS	
MW 11	4/18/07	0.66	B		0.43	B		11.7		
MW 11	5/17/07	13.6				NS			NS	
MW 11	6/20/07	0.28	B			NS			NS	
MW 11D	6/20/07	0.35	B			NS			NS	
MW 11	7/18/07	0.064	B	UB0.02		NS			NS	
MW 11	8/28/07	4.8				NS			NS	
MW 11	9/24/07	2.0				NS			NS	
MW 12	10/10/06	0.016	B	UB0.04		NS			NS	
MW 12	11/21/06	0.066	B	UB0.05		NS			NS	
MW 12	12/14/06	0.031	B	UB0.04		NS			NS	
MW 12	1/17/07	0.026	U	JK-0.05		NS			NS	
MW 12	2/21/07	0.026	U			NS			NS	
MW 12D	2/21/07	0.026	U			NS			NS	
MW 12	3/12/07	0.12	B	UB0.1		NS			NS	
MW 12	4/18/07	0.029	U		0.58	B		11.1		

Table 7-2
Water Quality Data for Site C Groundwater

Fiscal Year 2007

Sample Location	Date Collected	Lead (Dissolved) (ug/l)	L	D	Copper (Dissolved) (ug/l)	L	D	EDTA as EDTA (mg/l)	L	D
MW 12	5/17/07	0.029	U			NS			NS	
MW 12	6/20/07	0.015	B	UB0.02		NS			NS	
MW 12	7/18/07	0.015	U			NS			NS	
MW 12	8/28/07	0.036	B	UB0.08		NS			NS	
MW 12	9/24/07	0.028	B	UB0.08		NS			NS	
MW 13	10/11/06	159				NS			NS	
MW 13D	10/11/06	145				NS			NS	
MW 13	1/18/07	1770				NS			NS	
MW 13D	1/18/07	1710				NS			NS	
MW 13	4/19/07	1050			104		JS122	159		
MW 13	7/19/07	505				NS			NS	
MW 14	10/11/06	2.0				NS			NS	
MW 14	1/18/07	11.4				NS			NS	
MW 14	4/19/07	9.7			0.12	B	UB0.4	15.0		
MW 14	7/19/07	26.0				NS			NS	
MW 15	10/11/06	14.8				NS			NS	
MW 15	1/18/07	12.2				NS			NS	
MW 15	4/19/07	5.3			0.15	B	UB0.4	3.31		
MW 15	7/19/07	7.1				NS			NS	
MW 15D	7/19/07	7.5				NS			NS	
MW 16	10/10/06	0.071	B	UB0.04		NS			NS	
MW 16	11/21/06	0.11	B	UB0.05		NS			NS	
MW 16	12/14/06	0.050	B	UB0.04		NS			NS	
MW 16	1/17/07	0.026	U	JK-0.05		NS			NS	
MW 16	2/21/07	0.10	B			NS			NS	
MW 16	3/12/07	0.15	B	UB0.1		NS			NS	
MW 16D	3/12/07	0.23	B	UB0.1		NS			NS	
MW 16	4/19/07	5.6			0.18	B	UB0.4	13.3		
MW 16	5/17/07	0.18	B			NS			NS	
MW 16	6/20/07	0.10	B	UB0.02		NS			NS	
MW 16	7/18/07	0.11	B	UB0.02		NS			NS	
MW 16	8/28/07	0.19	B	UB0.08		NS			NS	
MW 16	9/24/07	0.14	B	UB0.08		NS			NS	
03U083	6/20/07	0.17	B			NS			NS	

Table 7-2
Water Quality Data for Site C Groundwater

Fiscal Year 2007

Sample Location	Date Collected	Lead (Dissolved) (ug/l)	L	D	Copper (Dissolved) (ug/l)	L	D	EDTA as EDTA (mg/l)	L	D
Extraction Wells:										
EW 1	10/11/06	0.16	B	UB0.04		NS			NS	
EW 1	11/21/06	0.10	B	UB0.05		NS			NS	
EW 1	12/14/06	0.53	B			NS			NS	
EW 1D	12/14/06	0.45	B			NS			NS	
EW 1	1/17/07	0.22	B	UB0.14		NS			NS	
EW 1D	1/17/07	0.14	B	UB0.14		NS			NS	
EW 1	2/21/07	0.32	B			NS			NS	
EW 1	3/12/07	0.24	B	UB0.1		NS			NS	
EW 1D	3/12/07	0.22	B	UB0.1		NS			NS	
EW 1	4/19/07	0.15	B	UB0.04	3.1		JS122	8.52		
EW 1	5/17/07	0.10	B			NS			NS	
EW 1	6/21/07	0.32	B			NS			NS	
EW 1	7/19/07	0.12	B			NS			NS	
EW 1	8/29/07	0.36	B	UB0.08		NS			NS	
EW 1	9/24/07	0.42	B			NS			NS	
EW 2	10/11/06	0.14	B	UB0.04		NS			NS	
EW 2	11/21/06	0.21	B	UB0.05		NS			NS	
EW 2	12/14/06	0.21	B			NS			NS	
EW 2	1/17/07	0.048	B	UB0.14		NS			NS	
EW 2	2/21/07	0.15	B			NS			NS	
EW 2	3/12/07	0.28	B	UB0.1		NS			NS	
EW 2	4/19/07	0.14	B	UB0.04	0.73	B	UB0.4	224		
EW 2	5/17/07	0.061	B			NS			NS	
EW 2D	5/17/07	0.099	B			NS			NS	
EW 2	6/21/07	0.090	B	UB0.02		NS			NS	
EW 2	7/19/07	4.5				NS			NS	
EW 2	8/29/07	0.17	B	UB0.08		NS			NS	
EW 2	9/24/07	0.33	B	UB0.08		NS			NS	
EW 3	10/11/06	238				NS			NS	
EW 3	11/21/06	137				NS			NS	
EW 3D	11/21/06	142				NS			NS	
EW 3	12/14/06	114				NS			NS	
EW 3	1/17/07	78.6				NS			NS	
EW 3	2/21/07	66.4				NS			NS	
EW 3	3/12/07	45.4				NS			NS	
EW 3	4/19/07	74.9			2.8		JS122	187		
EW 3	5/17/07	85.9				NS			NS	

Table 7-2
Water Quality Data for Site C Groundwater

Fiscal Year 2007

Sample Location	Date Collected	Lead (Dissolved) (ug/l)	L	D	Copper (Dissolved) (ug/l)	L	D	EDTA as EDTA (mg/l)	L	D
EW 3	6/21/07	123			NS			NS		
EW 3D	6/21/07	119			NS			NS		
EW 3	7/19/07	117			NS			NS		
EW 3	8/29/07	49.7		JS130	NS			NS		
EW 3	9/24/07	41.7			NS			NS		

Notes:

Laboratory Concentration Qualifiers (L):

U	Analyte was not detected above the Instrument Detection Limit (IDL).
B	Reported value is between the Instrument Detection Limit (IDL) and the Contract Required Detection Limit (CRDL).

Data Validation Qualifiers (D):

J	Estimated
JK#	The sample result was less than 5 times the absolute value of a negative detection in a blank (the result for the blank is listed after "JK"). Result should be considered estimated.
JS	The percent recovery for the matrix spike was above the upper QC limit (the percent recovery is listed after "JS"). The sample result could be biased high.
UB#	The sample result was less than 5 times the level detected in a blank (the result for the blank is listed after "UB"). The sample result can be considered non detect at an elevated detection limit.

Other Notes:

D	Duplicate
NS	Not Sampled
EDTA	Ethylenediaminetetraacetic Acid

Table 7-3
Water Quality Data for Site C Surface Water

Fiscal Year 2007

Sample Location	Date Collected	Lead (Dissolved) (ug/l)	L	D	Copper (Dissolved) (ug/l)	L	D	Hardness (mg/l)	L	D	EDTA as EDTA (mg/l)	L	D
SW 1	4/17/07	0.11	B		3.0			341			<1.00		
SW 1	4/18/07	0.096	B		2.6			335		JD		NS	
SW 1D	4/18/07	0.081	B		2.6			68.2				NS	
SW 1	4/19/07	0.073	B		2.3			347				NS	
SW 2	4/17/07	2.0			16.4			363			<1.00		
SW 2D	4/17/07	2.1			17.4			363			<1.00		
SW 2	4/18/07	1.4			12.4			370				NS	
SW 2	4/19/07	1.7			13.1			394				NS	
SW 2	5/15/07	5.1		UB2.1		NS			NS			NS	
SW 2	5/16/07	7.1				NS			NS			NS	
SW 2	5/17/07	7.0				NS			NS			NS	
SW 3	10/9/06	0.17	B	UB0.07		NS			NS			NS	
SW 3	10/10/06	0.14	B	UB0.1		NS			NS			NS	
SW 3	10/11/06	0.10	B	UB0.1		NS			NS			NS	
SW 3	4/17/07	0.14	B		2.3		UB0.5	134			<1.00		
SW 3	4/18/07	0.063	B		1.7	B		97.1				NS	
SW 3	4/19/07	0.069	B		1.6	B	UB0.4	185				NS	
SW 3	5/15/07	0.88	B	UB2.1		NS			NS			NS	
SW 3	5/16/07	0.087	B	UB0.12		NS			NS			NS	
SW 3D	5/16/07	0.31	B	UB0.12		NS			NS			NS	
SW 3	5/17/07	0.19	B	UB0.12		NS			NS			NS	
SW 3	6/19/07	0.80	B	UB1.1		NS			NS			NS	
SW 3	6/20/07	0.42	B	UB0.1		NS			NS			NS	
SW 3	6/21/07	0.12	B	UB0.1		NS			NS			NS	
SW 3D	6/21/07	0.21	B	UB0.1		NS			NS			NS	
SW 4	10/9/06	0.40	B			NS			NS			NS	
SW 4	10/10/06	0.19	B	UB0.1		NS			NS			NS	
SW 4D	10/10/06	0.15	B	UB0.1		NS			NS			NS	
SW 4	10/11/06	1.1				NS			NS			NS	
SW 4	4/17/07	0.31	B		3.7			151			<1.00		
SW 4	4/18/07	0.24	B		3.1			147				NS	
SW 4	4/19/07	0.25	B		3.0			203		JD34		NS	
SW 4D	4/19/07	0.24	B		3.3			146				NS	
SW 4	5/15/07	0.41	B	UB2.1		NS			NS			NS	
SW 4	5/16/07	0.24	B	UB0.12		NS			NS			NS	
SW 4	5/17/07	0.26	B	UB0.12		NS			NS			NS	
SW 4	6/19/07	0.39	B	UB1.1		NS			NS			NS	
SW 4	6/20/07	0.24	B	UB0.1		NS			NS			NS	
SW 4	6/21/07	0.17	B	UB0.1		NS			NS			NS	

Table 7-3
Water Quality Data for Site C Surface Water

Fiscal Year 2007

Sample Location	Date Collected	Lead (Dissolved) (ug/l)				Copper (Dissolved) (ug/l)				Hardness (mg/l)				EDTA as EDTA (mg/l)			
			L		D		L		D		L		D		L		D
SW 5	10/9/06	0.49	B				NS				NS				NS		
SW 5	10/10/06	0.59	B				NS				NS				NS		
SW 5	10/11/06	0.70	B				NS				NS				NS		
SW 5	4/17/07	0.93	B			2.5			UB0.5	192				<1.00			
SW 5	4/18/07	0.38	B			1.6	B			178					NS		
SW 5	4/19/07	0.42	B			1.7	B		UB0.4	186					NS		
SW 5	5/15/07	0.98	B	UB2.1			NS				NS				NS		
SW 5D	5/15/07	1.0		UB2.1			NS				NS				NS		
SW 5	5/16/07	0.22	B	UB0.12			NS				NS				NS		
SW 5	5/17/07	0.18	B	UB0.12			NS				NS				NS		
SW 5	6/19/07	0.42	B	UB1.1			NS				NS				NS		
SW 5	6/20/07	0.70	B				NS				NS				NS		
SW 5	6/21/07	0.48	B	UB0.1			NS				NS				NS		
SW 5	8/27/07	2.5					NS				NS				NS		
SW 5	8/28/07	0.45	B	UB0.18			NS				NS				NS		
SW 5D	8/28/07	0.42	B	UB0.18			NS				NS				NS		
SW 5	8/29/07	0.44	B	UB0.18			NS				NS				NS		
SW 5	9/24/07	0.27	B	UB0.1			NS				NS				NS		
SW 5	9/25/07	0.34	B	UB0.1			NS				NS				NS		
SW 5D	9/25/07	0.32	B	UB0.1			NS				NS				NS		
SW 5	9/26/07	0.27	B	UB0.1			NS				NS				NS		
SW 6	10/9/06	0.18	B	UB0.07			NS				NS				NS		
SW 6	10/10/06	0.14	B	UB0.1			NS				NS				NS		
SW 6	10/11/06	0.15	B	UB0.1			NS				NS				NS		
SW 6D	10/11/06	0.19	B	UB0.1			NS				NS				NS		
SW 6	4/17/07	1.3				2.5			UB0.5	213				<1.00			
SW 6	4/18/07	1.0				2.2				204					NS		
SW 6	4/19/07	1.1				2.0	B			279					NS		
SW 6	5/15/07	0.74	B	UB2.1			NS				NS				NS		
SW 6	5/16/07	0.22	B	UB0.12			NS				NS				NS		
SW 6	5/17/07	0.31	B	UB0.12			NS				NS				NS		
SW 6	6/19/07	0.41	B	UB1.1			NS				NS				NS		
SW 6	6/20/07	0.70	B				NS				NS				NS		
SW 6	6/21/07	0.14	B	UB0.1			NS				NS				NS		
SW 6	8/27/07	0.54	B	UB0.18			NS				NS				NS		
SW 6D	8/27/07	0.39	B	UB0.18			NS				NS				NS		
SW 6	8/28/07	0.51	B	UB0.18			NS				NS				NS		
SW 6	8/29/07	0.17	B	UB0.18			NS				NS				NS		
SW 6	9/24/07	0.27	B	UB0.1			NS				NS				NS		
SW 6D	9/24/07	0.10	B	UB0.1			NS				NS				NS		
SW 6	9/25/07	0.25	B	UB0.1			NS				NS				NS		
SW 6	9/26/07	0.15	B	UB0.1			NS				NS				NS		

Table 7-3
Water Quality Data for Site C Surface Water

Fiscal Year 2007

Sample Location	Date Collected	Lead (Dissolved) (ug/l)			Copper (Dissolved) (ug/l)			Hardness (mg/l)		EDTA as EDTA (mg/l)	
			L	D		L	D		D		L D
SW 7	10/9/06	0.84	B			NS			NS		NS
SW 7D	10/9/06	0.23	B	UB0.07		NS			NS		NS
SW 7	10/10/06	0.12	B	UB0.1		NS			NS		NS
SW 7	10/11/06	0.14	B	UB0.1		NS			NS		NS
SW 7	4/17/07	0.24	B		1.6	B	UB0.5	159		<1.00	
SW 7	4/18/07	0.18	B		1.0	B		152			NS
SW 7	4/19/07	0.17	B		1.1	B	UB0.4	147			NS
SW 7	5/15/07	1.3		UB2.1		NS			NS		NS
SW 7	5/16/07	0.37	B	UB0.12		NS			NS		NS
SW 7	5/17/07	0.26	B	UB0.12		NS			NS		NS
SW 7	6/19/07	0.67	B	UB1.1		NS			NS		NS
SW 7D	6/19/07	0.82	B	UB1.1		NS			NS		NS
SW 7	6/20/07	0.51	B			NS			NS		NS
SW 7	6/21/07	0.69	B			NS			NS		NS
SW 7	7/17/07	0.36	B			NS			NS		NS
SW 7	7/18/07	0.35	B			NS			NS		NS
SW 7	7/19/07	0.35	B			NS			NS		NS
SW 7	8/27/07	1.2				NS			NS		NS
SW 7	8/28/07	0.38	B	UB0.18		NS			NS		NS
SW 7	8/29/07	0.40	B	UB0.18		NS			NS		NS
SW 7	9/24/07	0.29	B	UB0.1		NS			NS		NS
SW 7	9/25/07	0.23	B	UB0.1		NS			NS		NS
SW 7	9/26/07	2.8				NS			NS		NS
SW 8	10/9/06	0.16	B	UB0.07		NS			NS		NS
SW 8	10/10/06	0.17	B	UB0.1		NS			NS		NS
SW 8	10/11/06	0.15	B	UB0.1		NS			NS		NS
SW 8	4/17/07	0.22	B		1.3	B	UB0.5	157		<1.00	
SW 8	4/18/07	0.15	B		0.99	B		164			NS
SW 8	4/19/07	0.30	B		1.2	B	UB0.4	85.9			NS
SW 8	5/15/07	2.7		UB2.1		NS			NS		NS
SW 8	5/16/07	0.31	B	UB0.12		NS			NS		NS
SW 8	5/17/07	0.26	B	UB0.12		NS			NS		NS
SW 8D	5/17/07	0.25	B	UB0.12		NS			NS		NS
SW 8	6/19/07	0.72	B	UB1.1		NS			NS		NS
SW 8	6/20/07	0.34	B	UB0.1		NS			NS		NS
SW 8D	6/20/07	0.57	B			NS			NS		NS
SW 8	6/21/07	0.34	B	UB0.1		NS			NS		NS
SW 8	7/17/07	0.57	B			NS			NS		NS
SW 8D	7/17/07	0.47	B			NS			NS		NS
SW 8	7/18/07	0.80	B			NS			NS		NS
SW 8	7/19/07	0.80	B			NS			NS		NS
SW 8	8/27/07	1.0				NS			NS		NS
SW 8	8/28/07	0.31	B	UB0.18		NS			NS		NS

Table 7-3
Water Quality Data for Site C Surface Water

Fiscal Year 2007

Sample Location	Date Collected	Lead (Dissolved) (ug/l)	L	D	Copper (Dissolved) (ug/l)	L	D	Hardness (mg/l)	L	D	EDTA as EDTA (mg/l)	L	D
SW 8	8/29/07	0.27	B	UB0.18	NS			NS			NS		
SW 8	9/24/07	0.21	B	UB0.1	NS			NS			NS		
SW 8	9/25/07	0.23	B	UB0.1	NS			NS			NS		
SW 8	9/26/07	3.3			NS			NS			NS		

Notes:

Laboratory Concentration Qualifiers (L):

U	Analyte was not detected above the Instrument Detection Limit (IDL).
B	Reported value is between the Instrument Detection Limit (IDL) and the Contract Required Detection Limit (CRDL).

Data Validation Qualifiers (D):

J	Estimated
JD	The field duplicate relative percent difference (rpd) was above the QC limit (the result for the rpd is listed after "JD"). If no number appears after the "JD", then the +/- CRDL criteria was not met. Result should be considered estimated.
UB#	The sample result was less than 5 times the level detected in a blank (the result for the blank is listed after "UB"). The sample result can be considered non detect at an elevated detection limit.

Other Notes:

D	Duplicate
NS	Not Sampled
EDTA	Ethylenediaminetetraacetic Acid

TABLE 7-4
SITE C Removal Action Monthly Lead Removal

FISCAL YEAR 2007

MONTH	EW-3		CONVERSION FACTOR	TOTAL LEAD REMOVED BY EXTRACTION SYSTEM (EW-3)	SYSTEM EFFLUENT
	Average Lead Concentration (mg/L)	Volume (gallons)	(l*lb)/(mg*gal)	(lbs)	Volume (gallons)
WATER AND LEAD REMOVED (TO 9/30/06)		3,374,330		101.61	10,107,207
OCTOBER	0.238	21,521	8.35E-06	0.04	67,715
NOVEMBER	0.137	21,873	8.35E-06	0.03	74,569
DECEMBER	0.114	23,351	8.35E-06	0.02	69,965
JANUARY	0.0786	23,170	8.35E-06	0.02	71,178
FEBRUARY	0.0664	13,775	8.35E-06	0.01	62,807
MARCH	0.0454	11,760	8.35E-06	0.00	56,786
APRIL	0.0749	20,934	8.35E-06	0.01	61,076
MAY	0.0859	21,203	8.35E-06	0.02	62,370
JUNE	0.123	13,820	8.35E-06	0.01	49,770
JULY	0.117	13,835	8.35E-06	0.01	37,662
AUGUST	0.050	5,473	8.35E-06	0.00	37,131
SEPTEMBER	0.042	7,153	8.35E-06	0.00	33,451
WATER AND LEAD REMOVED (FY 2007)		197,868		0.18	684,480
WATER AND LEAD REMOVED (TOTAL)		3,572,198		101.79	10,791,687

Notes:

1) EW-1 and EW-2 remain at or near non-detect lead levels and do not provide a significant source of removed lead.

2) This summary table began in June 2002

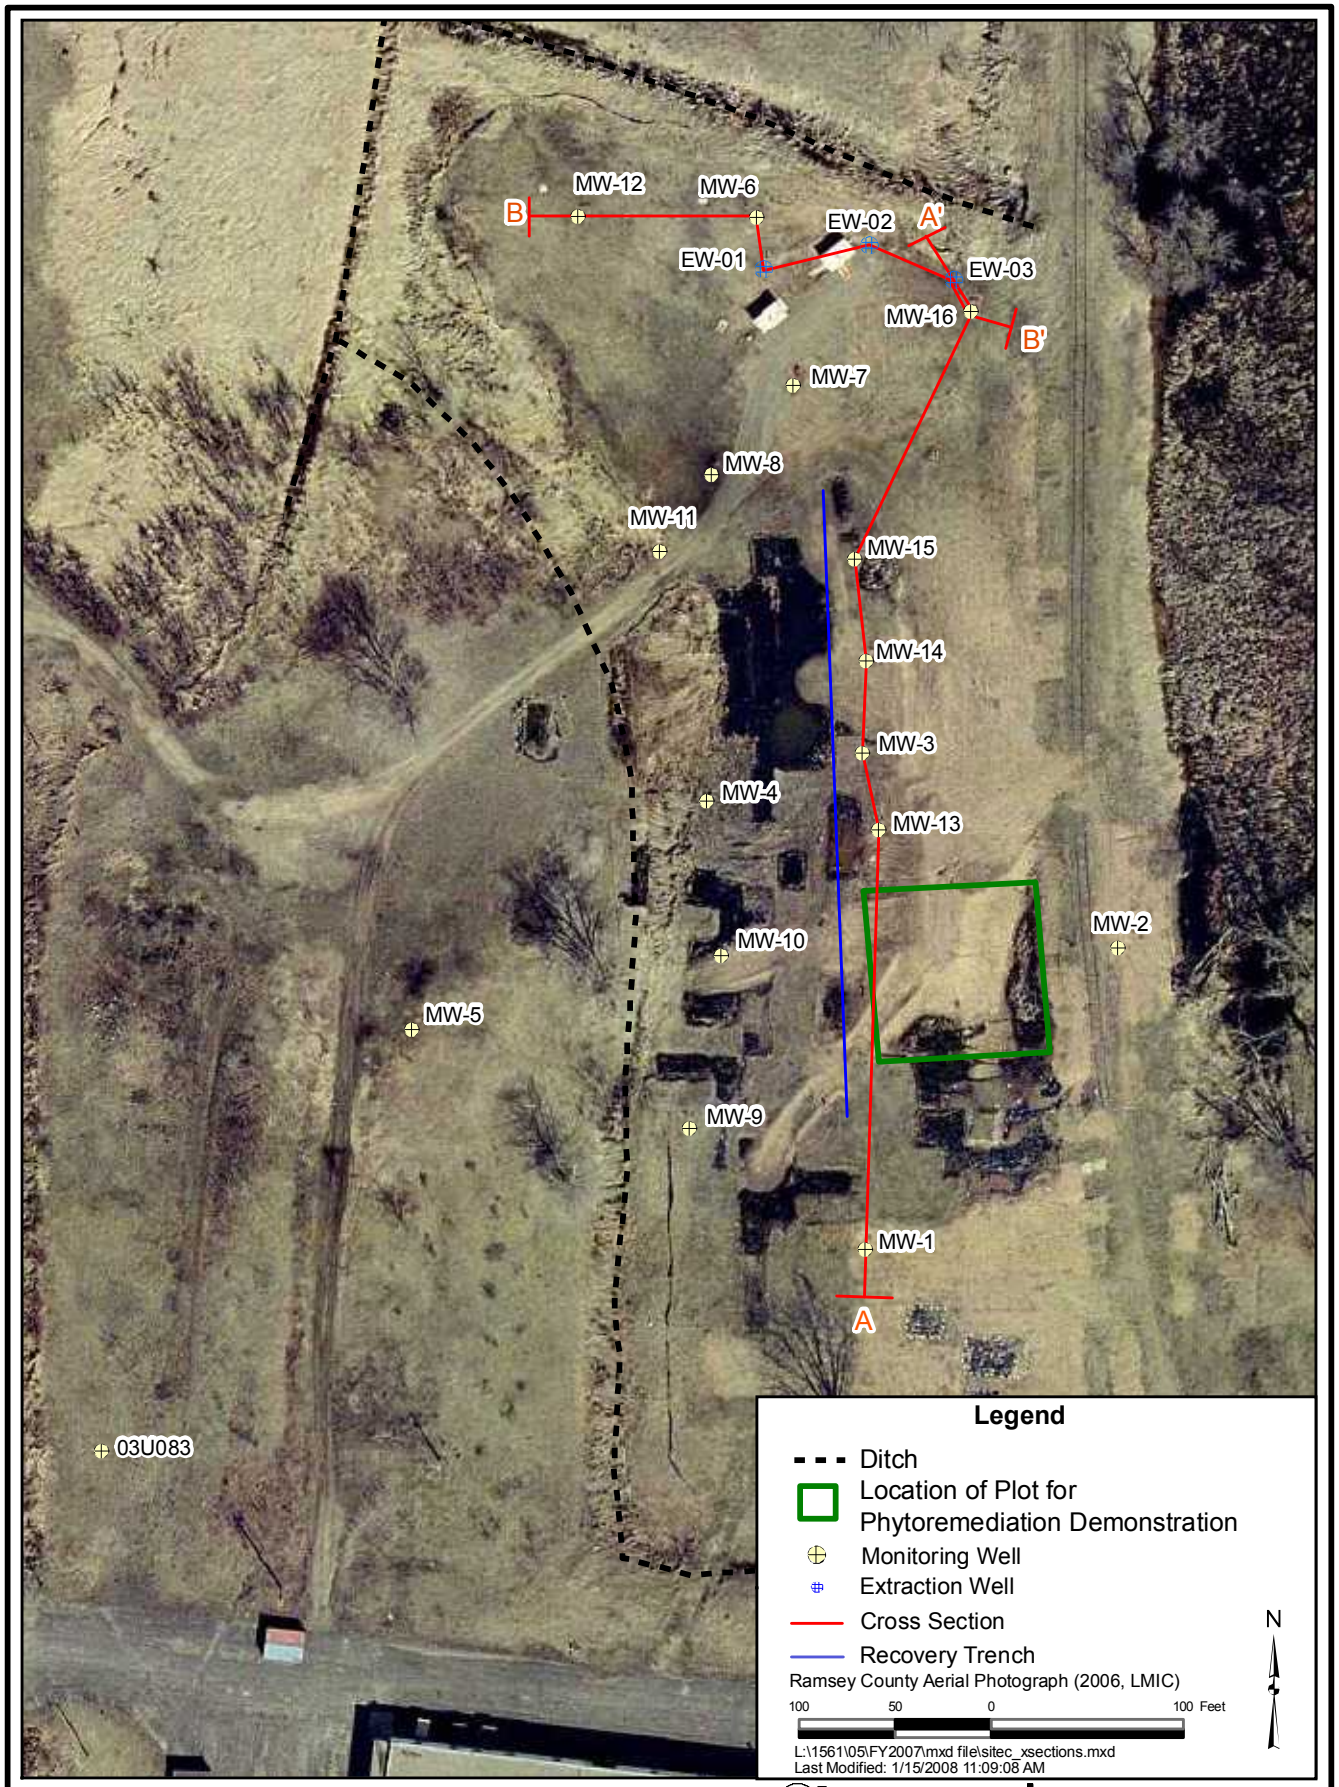

TWIN CITIES ARMY AMMUNITION PLANT

Site C: Site Plan and Cross Section Locations

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 7-1

TWIN CITIES ARMY AMMUNITION PLANT

Surface Water Monitoring Locations Related to Site C

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 7-2

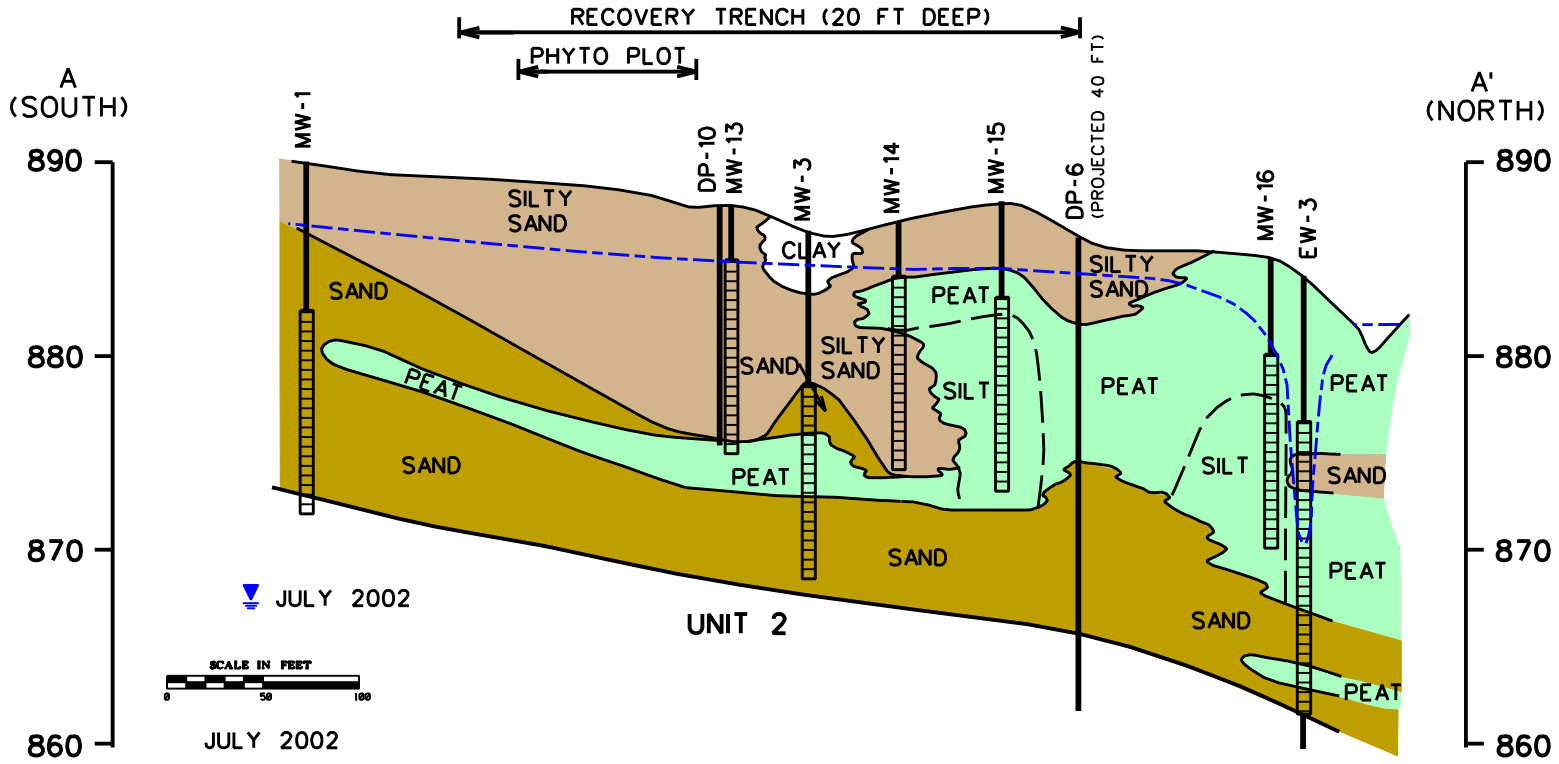

M:/1561/2007/NO-SO-XSEC.DGN

TWIN CITIES ARMY AMMUNITION PLANT

Site C: Cross-Section A-A'

COPYRIGHT

Wenck

Wenck Associates, Inc.
Environmental Engineers

1800 Pioneer Creek Center
Maple Plain, MN 55359

FY 2007

Fig. 7-3

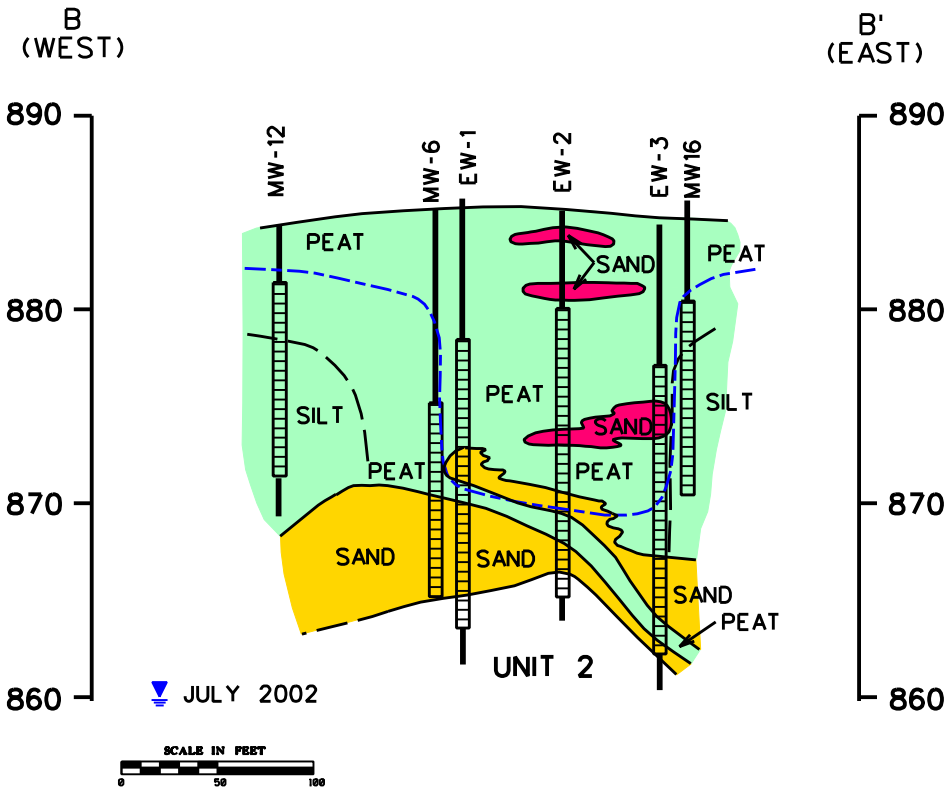

M:/1561/2007/E-W XSEC.DGN

TWIN CITIES ARMY AMMUNITION PLANT

Site C: Cross-Section B-B'

COPYRIGHT

Wenck Associates, Inc.
Environmental Engineers

1800 Pioneer Creek Center
Maple Plain, MN 55359

FY 2007

Fig. 7-4

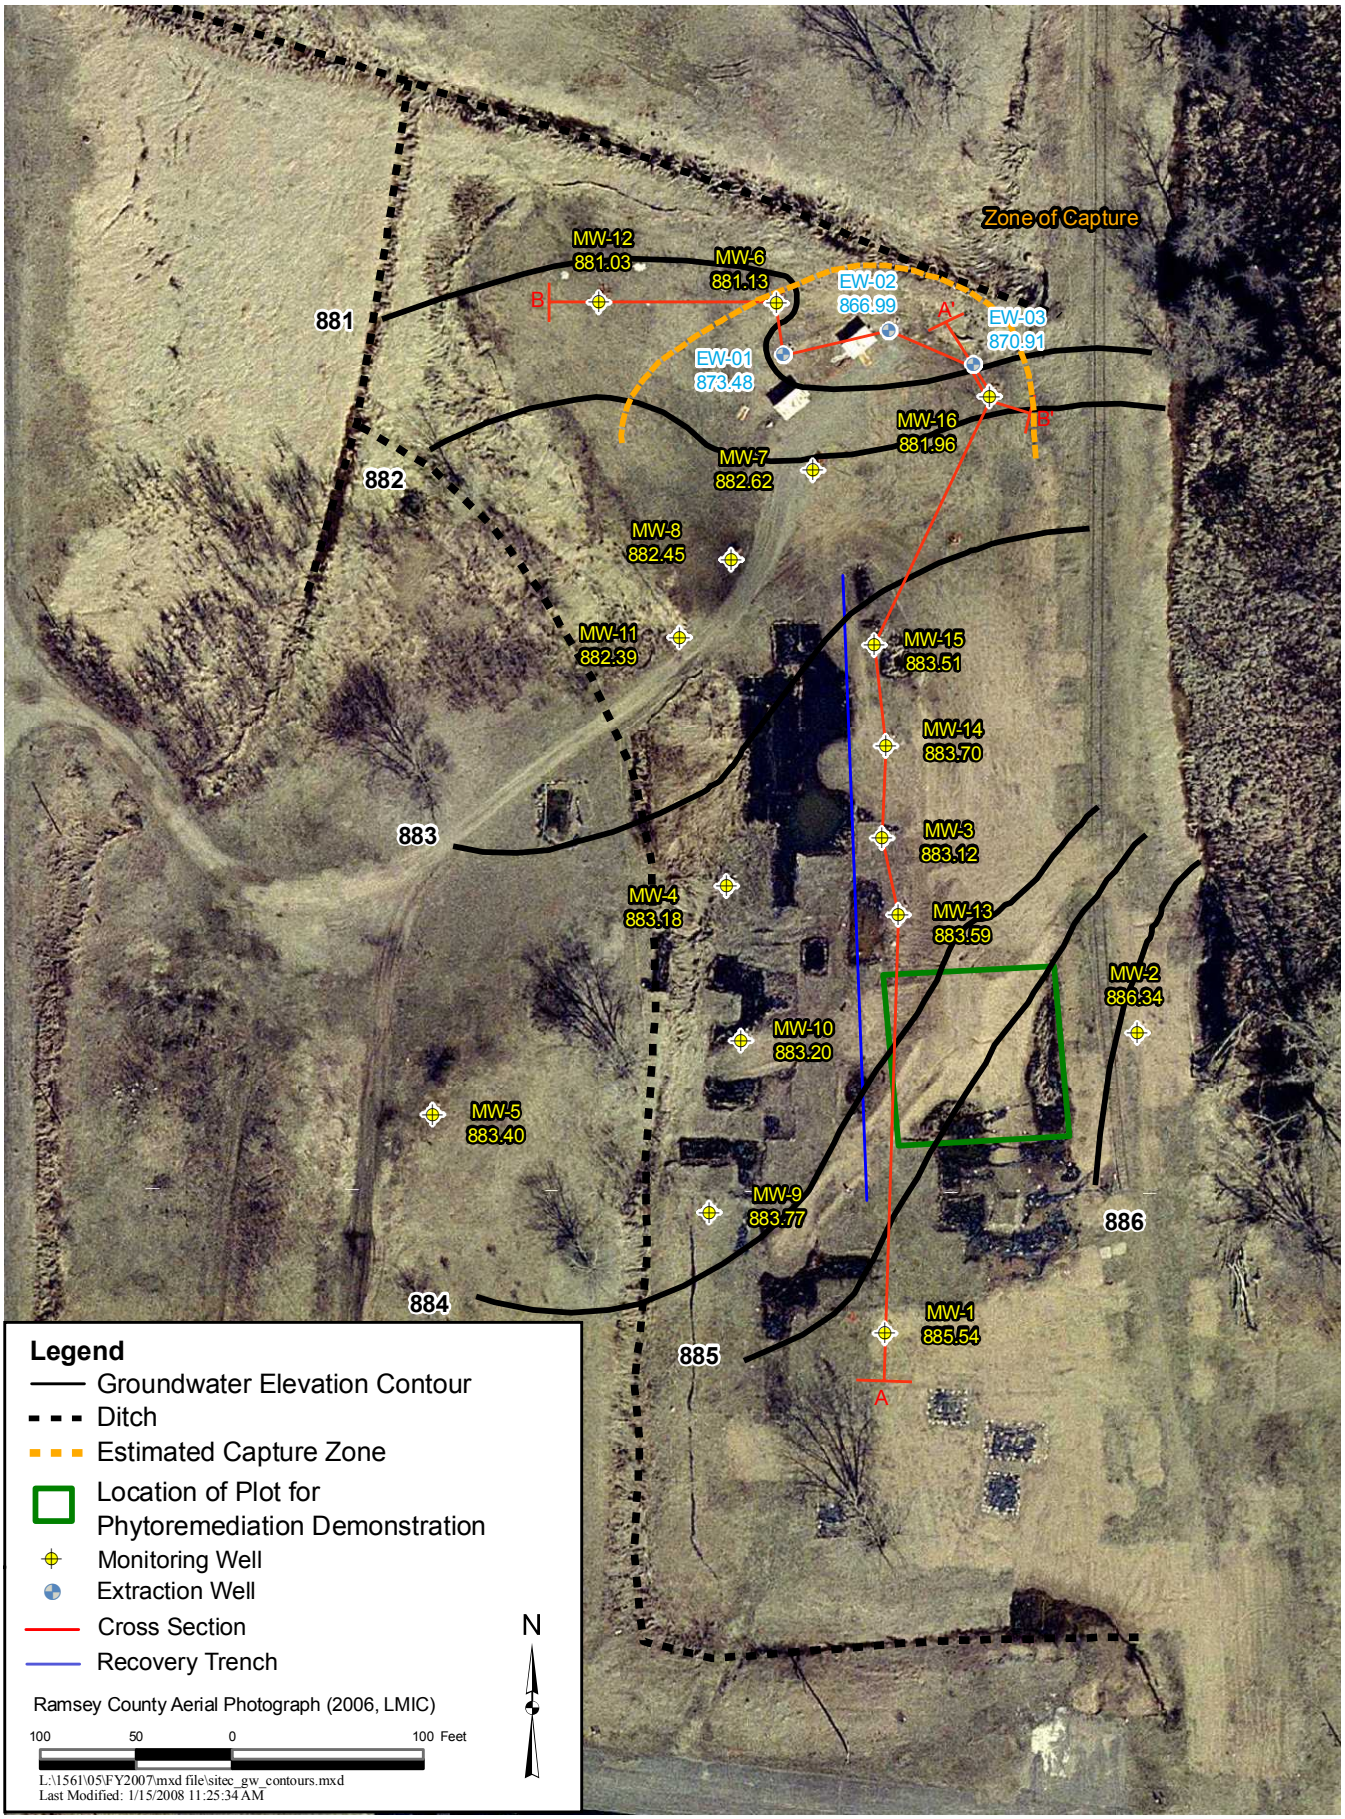

TWIN CITIES ARMY AMMUNITION PLANT

Site C: June 2007
Groundwater Elevation Contours

COPYRIGHT

Wenck
Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 7-5

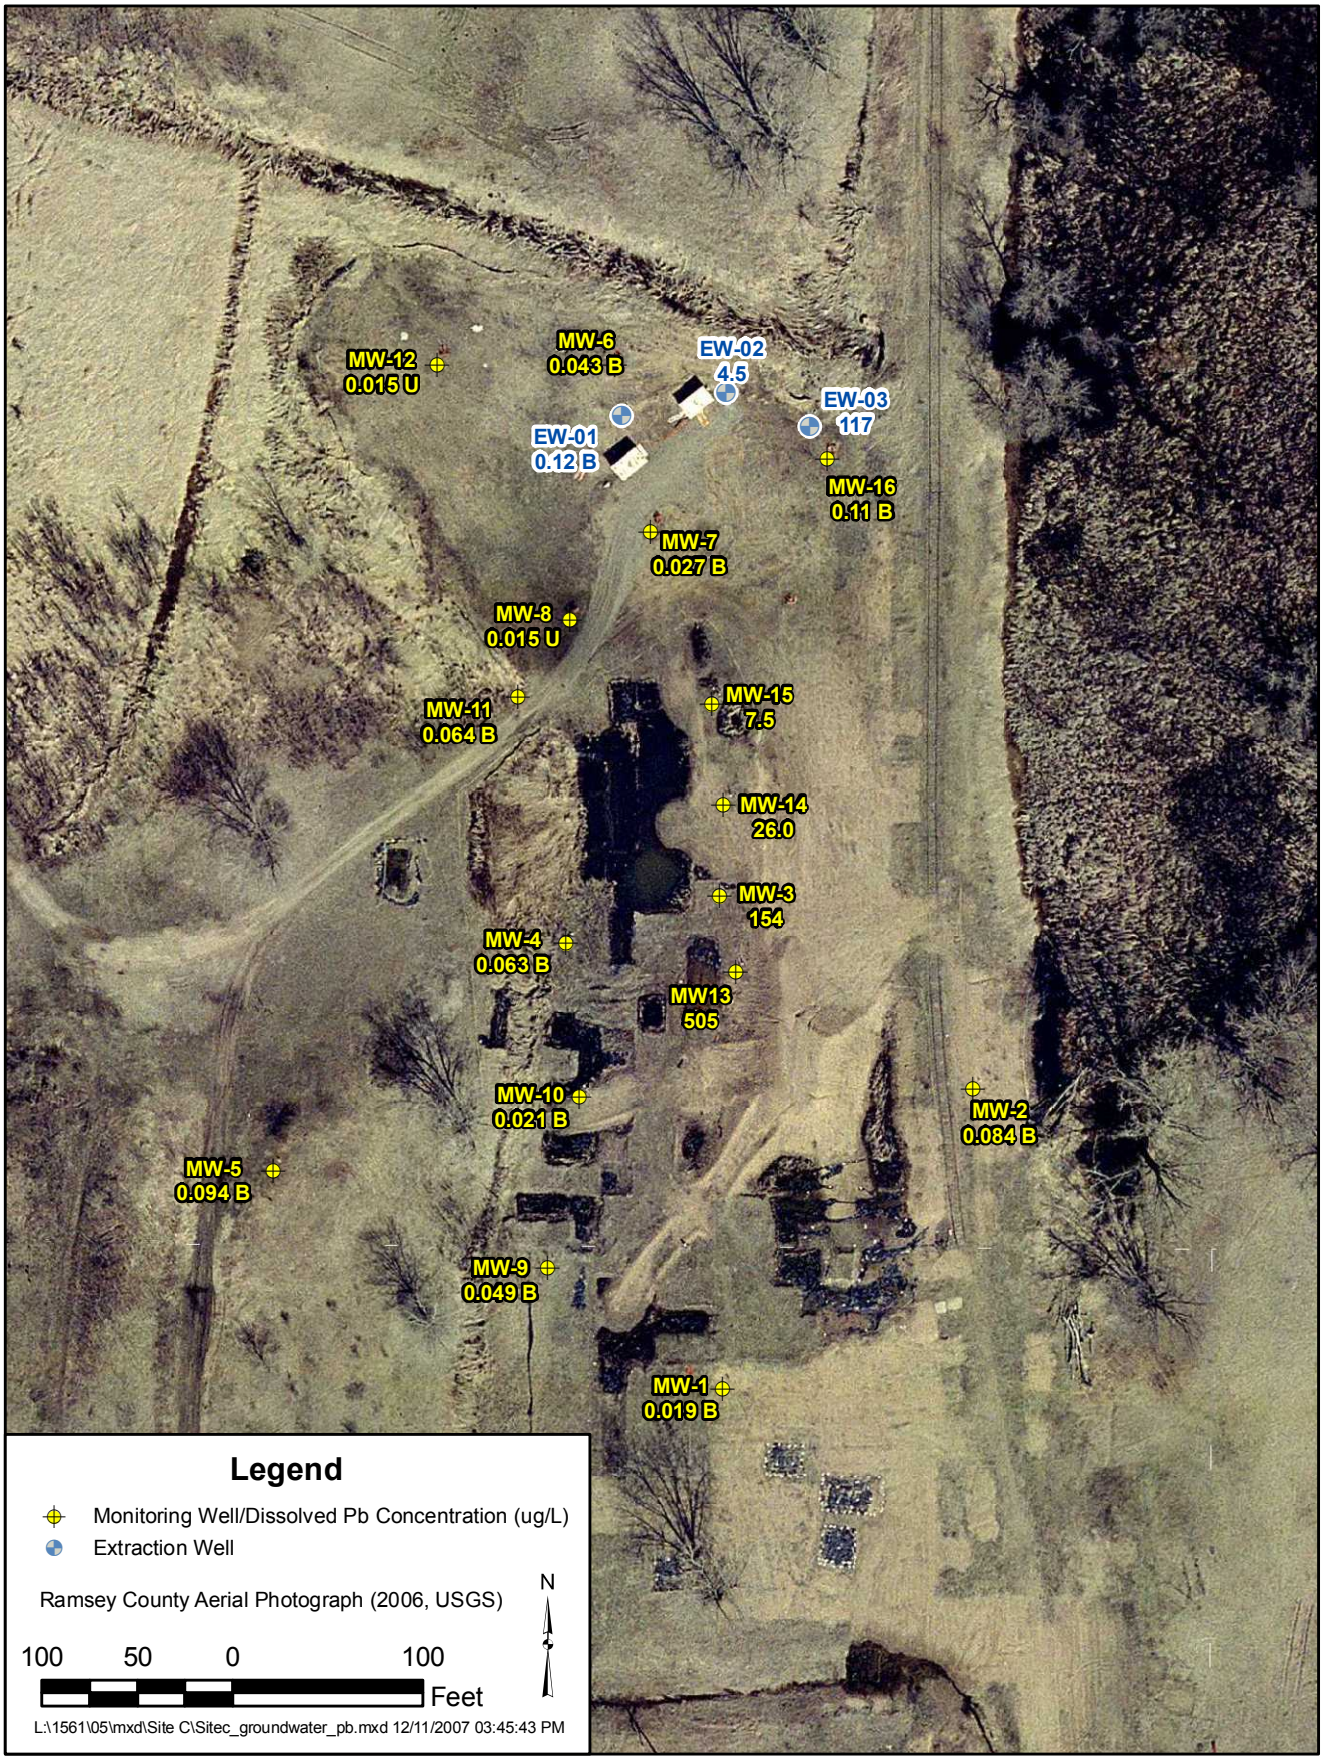

TWIN CITIES ARMY AMMUNITION PLANT

Site C Lead in Groundwater July 2007

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 7-6

8.0 Operable Unit 2: Site I Shallow Groundwater

VOCs have been identified in the Unit 1 groundwater at Site I. Polychlorinated biphenyls (PCBs) have been identified in soils east of Building 502.

PCB-contaminated soils east of Building 502 were excavated in 1986. These soils were stored in a storage building built as part of the PCB Interim Remedial Action (IRA) at Site I. During August and September 1996, these soils were removed and disposed of at a Toxic Substances Control Act (TSCA) landfill with approval of the USEPA and MPCA. Groundwater monitoring was conducted for PCBs through FY 1997. PCBs were not detected in groundwater and the monitoring was discontinued. Information on this work is included in the OU2 Remedial Investigation (Argonne National Laboratory 1991).

Monitoring in FY 2007 addressed the VOCs identified in the Unit 1 groundwater beneath the western portion of Building 502. The selected remedy in the OU2 ROD consists of four components that incorporate the use of an existing well for groundwater extraction as well as additional investigation beneath the building slab. The additional investigation and Predesign Investigation Work Plan (Work Plan) were completed in FY 2000. Based on these documents, the selected remedy was modified to consist of a dual-phase vacuum extraction system, which combines groundwater extraction with soil vapor extraction, to be installed beneath Building 502. A pilot test of dual-phase extraction subsequently determined that the technology was not feasible due to the low permeability of the Unit 1 aquifer beneath the building.

8.1 REMEDY COMPONENT #1: GROUNDWATER MONITORING

Description: "Groundwater monitoring to track remedy performance." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When a monitoring plan has been established and ongoing monitoring is in compliance with the plan.

Is the remedy component being implemented?
Yes. Monitoring at Site I in FY 2007 was conducted according to the monitoring plan for FY 2007. Appendix A summarizes the FY 2007 monitoring plan and any deviations are explained in Appendix C.2.

Monitoring was performed in accordance with the TCAAP Remedial Design/Remedial Action (RD/RA) QAPP (1996) and a new QAPP. The *IRP-QAPP for Performance Monitoring*, TWISS, dated May 19, 2006, was accepted by the USEPA and MPCA as passing the Consistency Test on July 31, 2006. The new QAPP was implemented at the beginning of the 1st quarter FY 2007.

Eleven Unit 1 monitoring wells were planned for sampling at Site I (Building 502) during FY 2007. These wells were 01U064, 01U636, 01U639, 01U640, 01U666, 01U667, 01U668, I01MW, I02MW, I04MW, and I05MW. Figure 8-1 shows these well locations. For FY 2007, both monitoring wells 01U639 and 482089 (I04MW) were included on the list of monitoring locations. Of the two wells, well 01U639 will be the primary sampling location and 482089 (I04MW) will be the alternate sampling location in the event monitoring well 01U639 is dry. If it is not possible to collect a groundwater sample from 01U639, then an attempt will be made to collect a sample from 482089 (I04MW). Well 01U639 is selected as the primary location because there is more analytical data associated with this location. As requested by USEPA, wells 01U632, 01U666, 01U667, and 01U668 were added to the FY 2004 monitoring for a "one-time" groundwater sampling event and for annual groundwater level measurements. In FY 2004 through FY 2007 monitoring wells 01U666 and 01U668 were dry at the time of sampling.

Although monitoring well 01U667 was intended for "one-time" only sampling, results from sampling in 2004 resulted in an agreement to sample the well annually until FY 2007 to establish a four year sampling trend. Monitoring well 01U632 was "one-time" sampled in FY 2006 and added to the annual monitoring plan beginning in FY 2007.

Wells 01U632, 01U639, 01U640, 01U666, 01U668, I01MW, I02MW, and I03MW were dry at the time of sampling and hydraulic monitoring (June, 2007). Wells 01U664 and 01U667 bailed dry after collecting approximately one well volume; however, there was sufficient groundwater to collect samples for analysis. Monitoring well I05MW did not have sufficient groundwater to collect samples for analysis. Groundwater samples were analyzed using EPA Method 8260 for VOCs.

Monitoring well 01U667 was sampled during the June 2007 annual sampling event to complete the four-year trend for MW 01U667. The downgradient and perimeter wells, which have showed decreasing trends in contaminants of concern, will continue to be monitored on an annual basis.

What were the monitoring results for FY 2007?

Table 8-1 presents the results of the FY 2007 analyses. Monitoring well 01U064 continues to show overall declines in concentrations of trichloroethene since the early 1990s. Well I05MW contained insufficient water to sample in 2007. Well 01U064 remains slightly above the Site I cleanup standards for vinyl chloride in FY 2007. The results for well 01U636 are non-detect for site-specific required analytes. Well 482089 (I04MW, which was sampled due to the absence of water in MW 01U639) analytical results for trichloroethene were above the cleanup standards for Site I and, 1,2-dichloroethene was below cleanup standards for Site I; vinyl chloride was non-detect. Well 01U667 had concentrations of 1,2-dichloroethene and vinyl chloride above cleanup standards for Site I; trichloroethene was non-detect at a method detection limit above the cleanup level. Figure 8-2 presents the groundwater elevations.

Monitoring wells 01U632, 01U666, 01U667, and 01U668 were added to the FY 2004 monitoring event for groundwater sampling on a "one-time" basis and annual groundwater level

measurements. Monitoring well 01U632 was one-time sampled in FY 2006 and MW 01U667 was sampled in FY 2007 as the final year of a four-year trend analysis. Analytical results from the four years of sampling indicate consistent results for 1,2-dichloroethene with a concentration range of 19,000 µg/l to 43,000 µg/l, and vinyl chloride with a concentration range of 37,000 µg/l to 57,000 µg/l, with the highest concentrations for each compound exhibited in groundwater collected in 2005. Trichloroethene was detected in groundwater from 01U667 in 2004, at a concentration of 16 µg/l. It was not detected in 2005 through 2007, however due to sample dilution at the laboratory, the detection limits were higher than 16 µg/l in each of the years 2005 through 2007.

8.2 REMEDY COMPONENT #2: GROUNDWATER EXTRACTION

Description: "Use of an existing well to remove impacted groundwater." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When the equipment has been installed and is operating according to the Remedial Design approved by the regulators.

Has the remedy component been implemented?
No. The report on the dual-phase vacuum extraction pilot test was submitted to the Agencies and received a consistency determination on March 16, 2000. The report concluded that neither dual-phase extraction nor groundwater extraction is feasible. The pilot test found that the soil permeability is low. As a result, the test yielded only approximately 1 gallon per hour. The report recommended that no further remedial action is considered until the building is demolished.

8.3 REMEDY COMPONENT #3: POTW DISCHARGE

Description: "POTW discharge of extracted groundwater." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When the discharge component has been implemented.

Has the remedy component been implemented?
No. As discussed above, the report on dual-phase vacuum extraction determined that extraction remedies are not currently feasible.

8.4 REMEDY COMPONENT #4: ADDITIONAL INVESTIGATION

Description: "Additional characterization of the Unit 1 and Unit 2 soil and groundwater." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When the work has been completed according to an Agency approved work plan.

Has the remedy component been implemented?
Yes. The results of the additional investigation were included in the Work Plan. The additional investigation resulted in a pilot study to evaluate the applicability of dual-phase vacuum extraction technology to the site.

Overall Remedy for Site I Shallow Groundwater
The remedy specified in the OU2 ROD was modified in the RD work plan. Based on the results presented in the dual-phase pilot test report, the preferred remedy is in need of further modification so as to only consist of groundwater monitoring. This is acceptable, in large part, due to the fact that groundwater in the Unit 1 aquifer does not flow off-site. Contaminants from

the Unit 1 leak downward into the Unit 3. The deeper Unit 3 aquifer is hydraulically contained by the TGRS.

Monitoring in FY 2007 was consistent with the FY 2007 monitoring plan. The following conclusions are made for FY 2007:

- VOCs continue to be present in the Unit 1 aquifer beneath the western portion of Building 502.
- The additional investigation work identified the sources of VOCs in the Unit 1 aquifer beneath Building 502 and allowed for an evaluation of dual-phase vacuum extraction technology to be completed. The evaluation determined that extraction technologies are not feasible beneath the building.

Is additional monitoring proposed prior to the next report?

Yes. Appendix A presents the FY 2007 – FY 2011 Monitoring Plan. Table 8-2 presents the monitoring requirements for Site I. Unit 3 and Unit 4 groundwater monitoring at Site I is addressed as part of the deep groundwater portion of the monitoring plan. The monitoring plan for Site I will be subject to review based on the anticipated OU2 ROD amendment.

Based on a USEPA request made in FY 2003, water levels will continue to be measured at wells 01U632 and 01U667 on an annual basis. The one-time sampling of 01U632 was completed in 2006 and year four of the four year trend of 01U667 was completed in 2007; both wells will be removed from the water quality sampling requirements of the Monitoring Plan. In addition, based on the absence of water from monitoring wells 01U666 and 01U668 over the last four fiscal years of monitoring, these two wells will be removed from the Monitoring Plan.

8.5 OTHER ACTIVITY

During FY 2004, a Five-Year Review of the remedy was performed. The review concluded that the remedy was functioning as intended, and that the components of the remedy remain protective of human health and the environment. The Review also recommended:

- Monitoring the trichloroethene HRL for any changes due to the USEPA's potential update of the trichloroethene health risk assessment; and
- Preparing a ROD amendment for the change from a pump and treat remedy to a monitoring based remedy.

Eight monitoring wells (01U004, 01U054, 01U634, 01U635, 01U638, 01U642, 01U652, and 01U675) were abandoned in FY 2004. Well abandonment is documented in the *Well Abandonment Report, Sites I and K, TCAAP*, SECOR, dated December 15, 2003.

Table 8-1

Groundwater Quality Data
Fiscal Year 2007
Site I, TCAAP
Arden Hills, Minnesota

Location	Date	*1,1,1-Trichloroethane* 111TCE	*1,1,2-Trichloroethane* 112TCE	*1,1-Dichloroethylene* 11DCE	*1,1-Dichloroethane* 11DCLE	*cis-1,2-Dichloroethylene* C12DCE	*Vinyl chloride* C2H3CL	*Chloroform* CHCL3	*trans-1,2-Dichloroethylene* T12DCE	*Tetrachloroethylene* TCLEE	*Trichloroethylene* TRCLE	*1,2-Dichloroethane* 12DCLE
01U064	6/6/2007	<1	<1	<1	0.36 (J)	49	4.1	<1	2.7	<1	0.59 (J)	<1
01U064 D	6/6/2007	<1	<1	<1	0.43 (J)	50	4.5	<1	3	<1	0.63 (J)	<1
01U636	6/6/2007	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U639	6/4/2007	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry
I04MW	6/6/2007	<1	<1	<1	<1	.99 (J)	<1	<1	<1	<1	45	<1
01U640	6/4/2007	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry
01U666	6/4/2007	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry
01U667(1)	6/6/2007	<50	<50	27 (J)	40 (J)	23000 (2)	37000(2)	<50	58	<50	<50	<50
01U668	6/4/2007	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry
482086 (I01MW)	6/4/2007	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry
482088 (I02MW)	6/4/2007	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry

Table 8-1

Groundwater Quality Data
Fiscal Year 2007
Site I, TCAAP
Arden Hills, Minnesota

Location	Date	*1,1,1-Trichloroethane* 111TCE	*1,1,2-Trichloroethane* 112TCE	*1,1-Dichloroethylene* 11DCE	*1,1-Dichloroethane* 11DCLE	*cis-1,2-Dichloroethylene* C12DCE	*Vinyl chloride* C2H3CL	*Chloroform* CHCL3	*trans-1,2-Dichloroethylene* T12DCE	*Tetrachloroethylene* TCLEE	*Trichloroethylene* TRCLE	*1,2-Dichloroethane* 12DCLE
482087 (I05MW)	6/4/2007	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry	Dry

Notes:
Concentrations in ug/L.
J - Value is estimated.
P - Results less than reporting level but greater than instrumental detection limit.
(1) Sample dilution = 50
(2) Sample dilution = 500

TABLE 8-2

SUMMARY OF GROUNDWATER MONITORING REQUIREMENTS
FISCAL YEAR 2007
SITE I, TCAAP
ARDEN HILLS, MINNESOTA

	Remedy Component		Monitoring Requirements	Responsible Party	Document Containing the Monitoring Plan
#1	Groundwater Monitoring	a.	Groundwater quality and water levels to track remedy progress.	Alliant	Site I Monitoring Plan in Annual Performance Report
#2	Groundwater Extraction (1)	a.	Extracted water volumes and rates.	Alliant	Not applicable (1)
#3	POTW Discharge (1)	a.	Water quality data for system effluent to demonstrate compliance with discharge requirement.	Alliant	Not applicable (1)
#4	Additional Investigation	a.	As per work plan (completed).	Alliant	Not applicable
	Overall Remedy	a.	Water quality data to evaluate attainment.	Alliant	Site I Monitoring Plan in Annual Performance Report

Note:
(1) Currently there is no pumping required based on results of additional investigation and pilot test results.

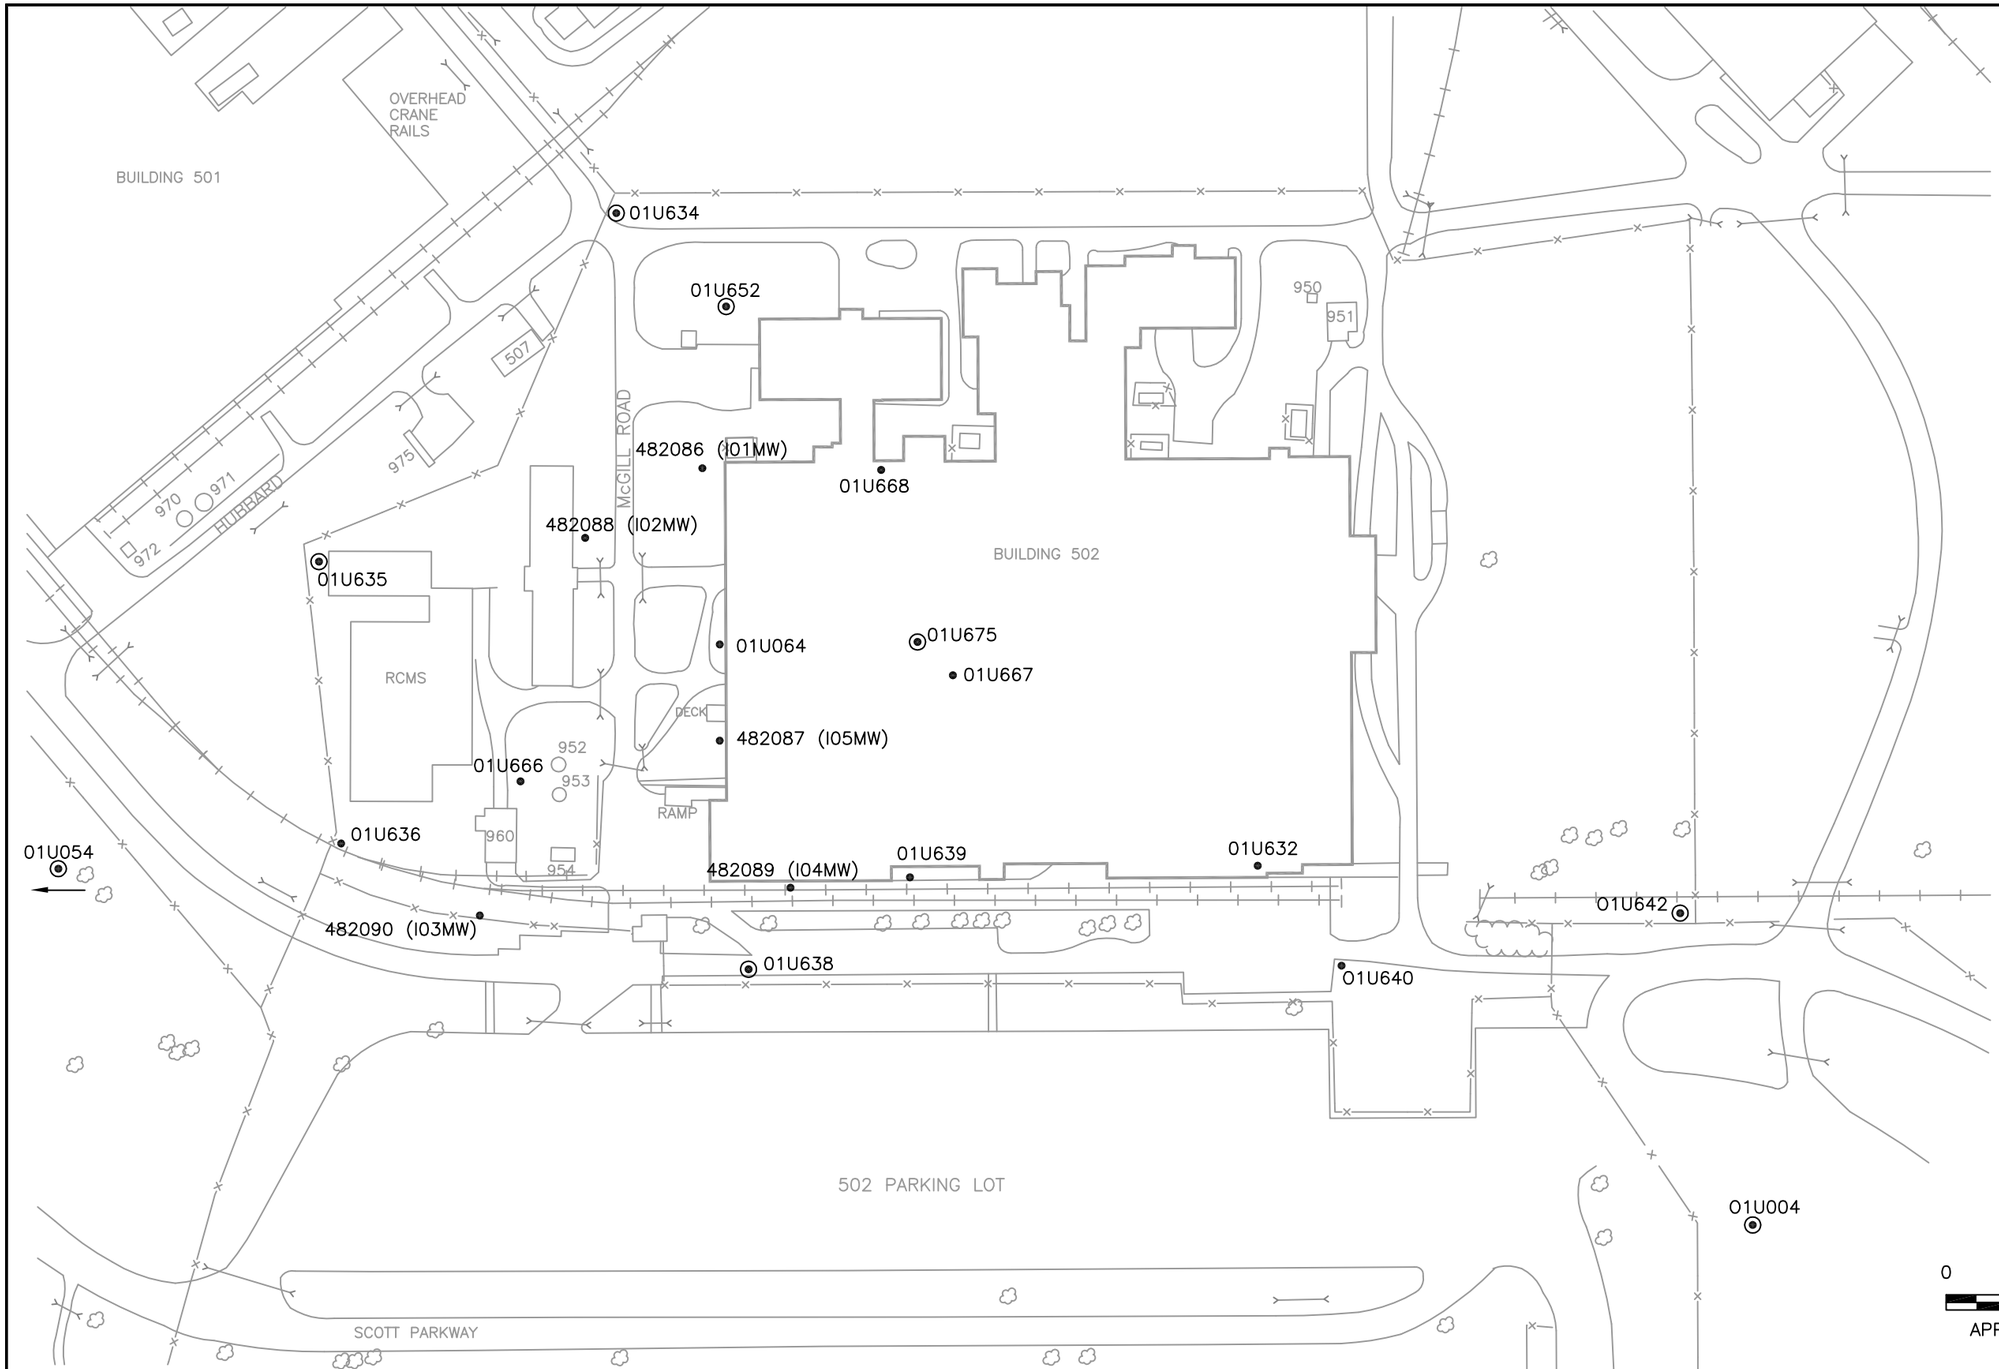

SECOR
4463 WHITE BEAR PARKWAY, SUITE 106
WHITE BEAR LAKE, MINNESOTA 55119
PHONE (651) 653-9112 FAX (651) 653-1751

PREPARED FOR:
TWIN CITY ARMY AMMUNITION PLANT
ARDEN HILLS, MINNESOTA

SITE I, UNIT 1
GROUNDWATER QUALITY
MONITORING LOCATIONS

FIGURE:
8-1

JOB NUMBER:	DRAWN BY:	CHECKED BY:	APPROVED BY:	DATE:
03OT.18508.00.0362	KM	AG	AG	01/08/08

SITE-I-07

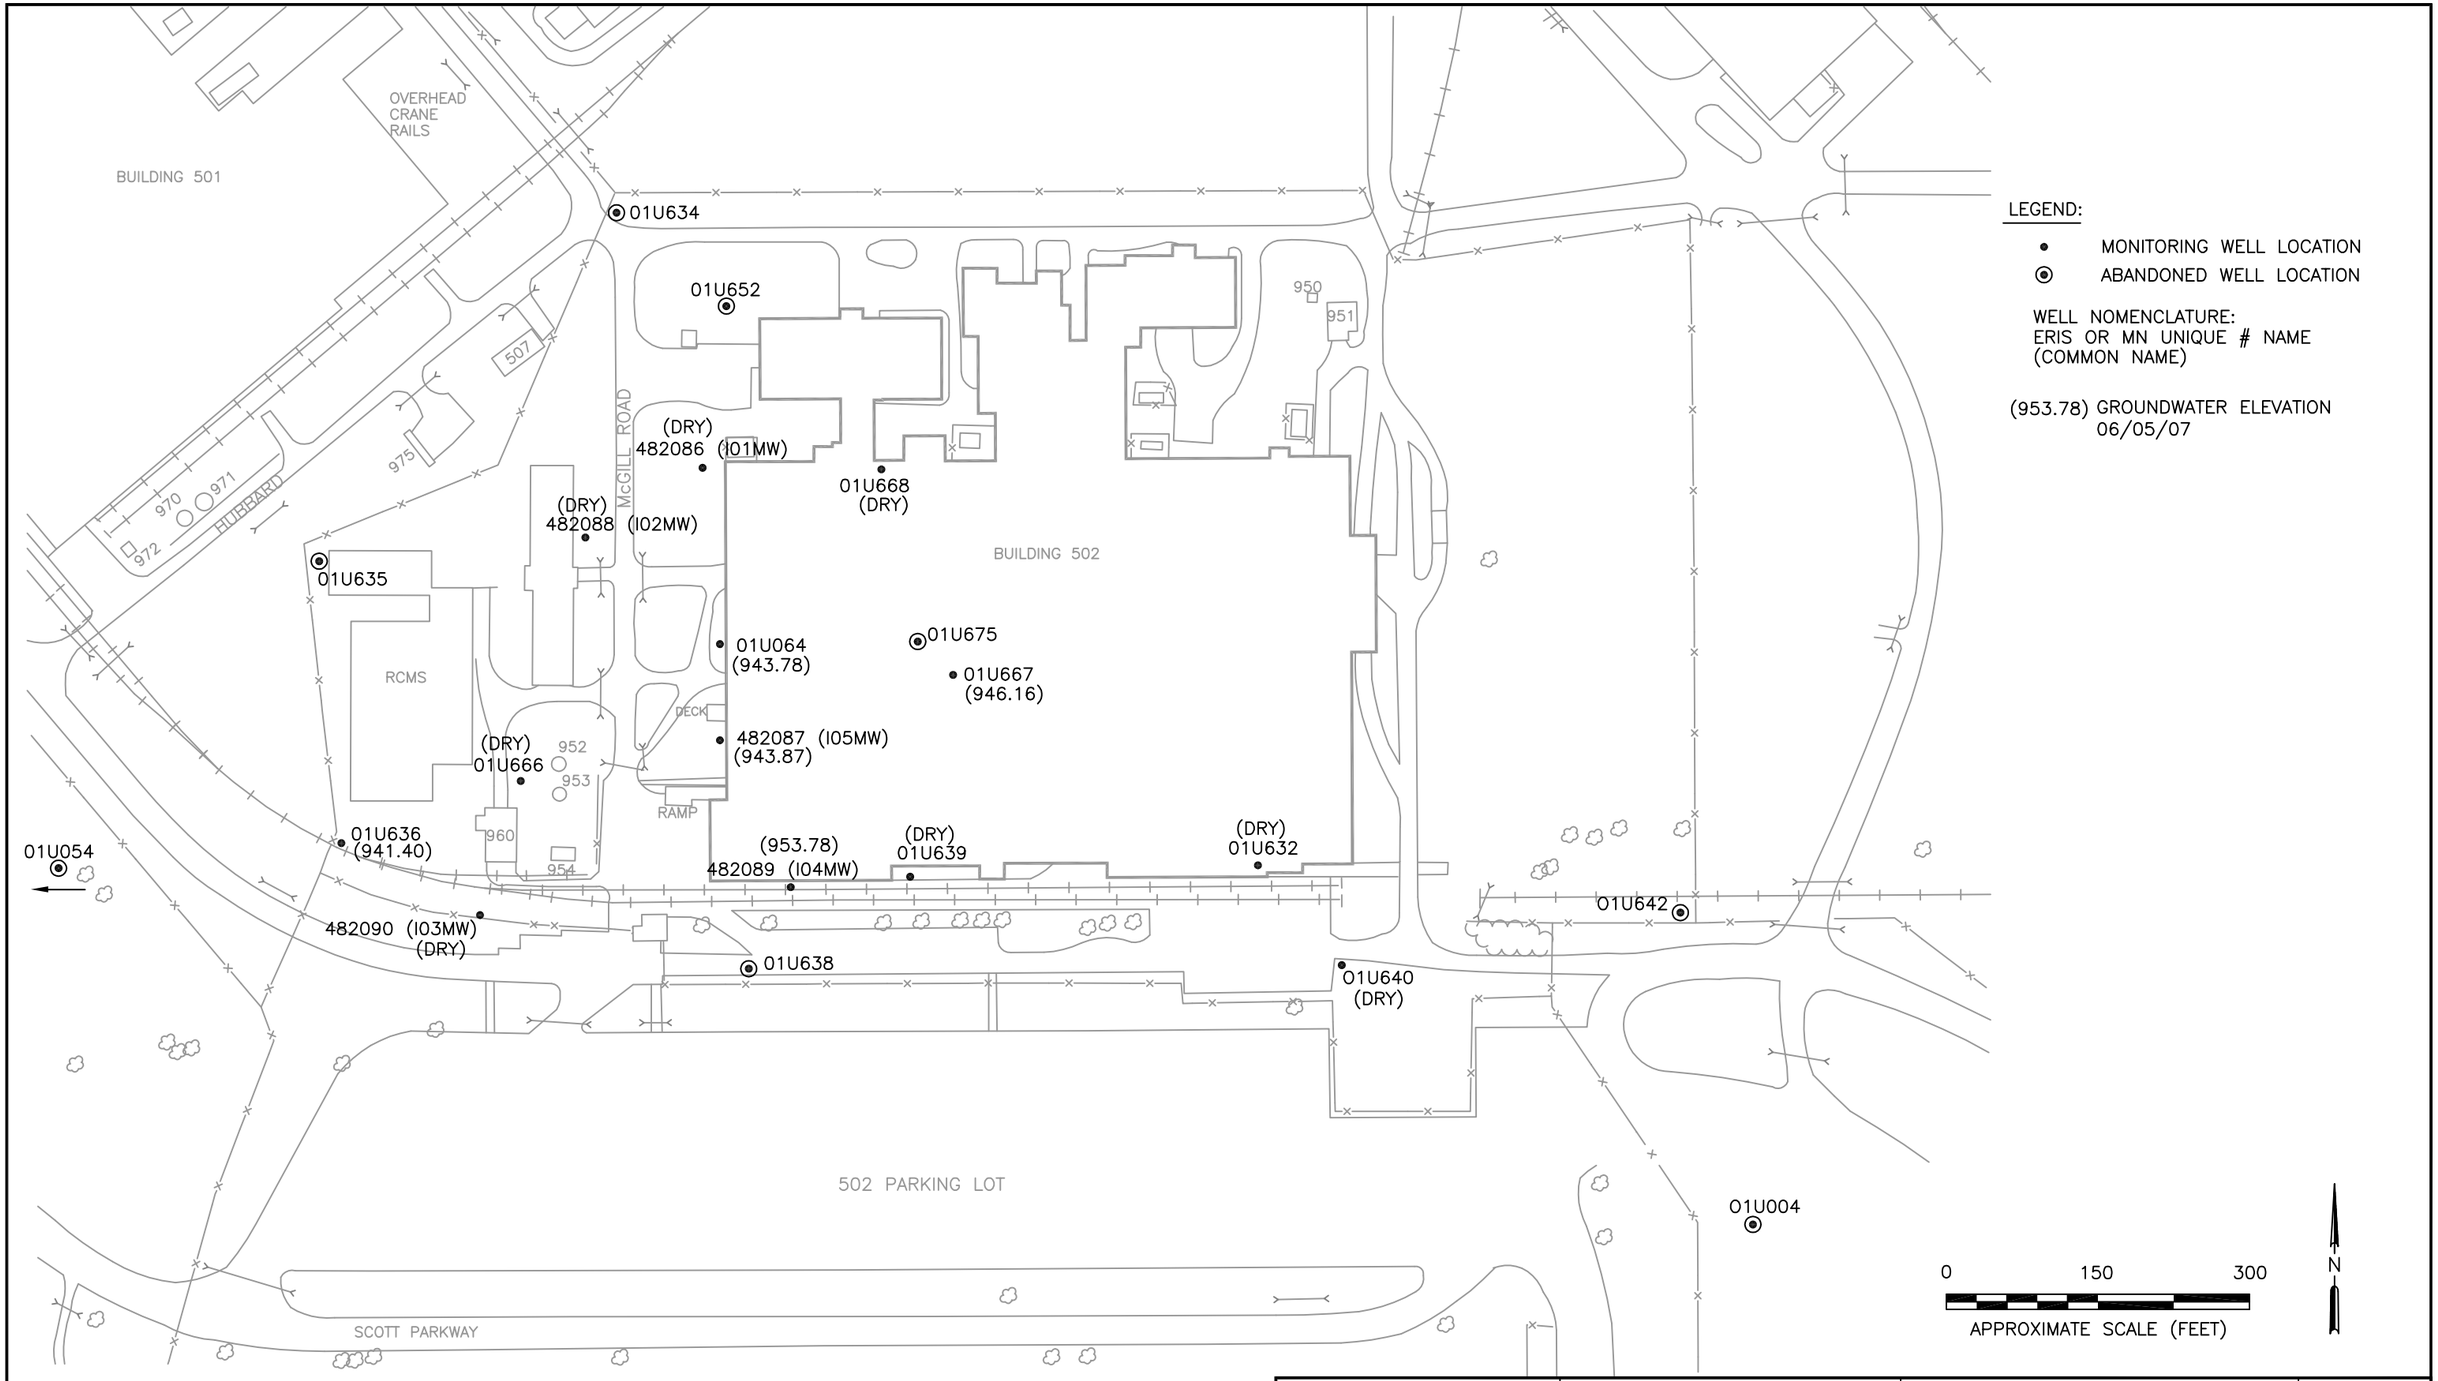

LEGEND:

- • MONITORING WELL LOCATION
- ⊙ ABANDONED WELL LOCATION

WELL NOMENCLATURE:
ERIS OR MN UNIQUE # NAME
(COMMON NAME)

(953.78) GROUNDWATER ELEVATION
06/05/07

0 150 300

APPROXIMATE SCALE (FEET)

N

SECOR
4463 WHITE BEAR PARKWAY, SUITE 106
WHITE BEAR LAKE, MINNESOTA 55119
PHONE (651) 653-9112 FAX (651) 653-1751

PREPARED FOR:
TWIN CITY ARMY AMMUNITION PLANT
ARDEN HILLS, MINNESOTA

SITE I, UNIT 1
GROUNDWATER ELEVATION MAP,
06/05/07

FIGURE: **8-2**

JOB NUMBER:	DRAWN BY:	CHECKED BY:	APPROVED BY:	DATE:
03OT.18508.00.0362	KM	AG	AG	01/08/08

SITE-I-07

9.0 Operable Unit 2: Site K Shallow Groundwater

VOC contamination has been identified in the Unit 1 (perched aquifer) at Building 103. The limits of the VOC plume in the perched groundwater have been defined to be beneath and immediately northwest of Building 103.

The remedy selected in the OU2 ROD consists of seven components that incorporate the existing groundwater extraction trench and air stripper, which began operation in August 1986. The remedy also includes additional investigation of the unsaturated soils beneath the building slab.

9.1 REMEDY COMPONENT #1: GROUNDWATER MONITORING

Description: "Groundwater monitoring to track remedy performance." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When a monitoring plan is established and monitoring is in compliance with the plan.

Is the remedy component being implemented?
Yes. Appendix A summarizes the FY 2007 monitoring plan and any deviations are explained in Appendix C.2.

Monitoring was performed in accordance with the TCAAP RD/RA QAPP (1996) and a new QAPP. The *IRP-QAPP for Performance Monitoring*, TWISS, dated May 19, 2006, was accepted by the USEPA and MPCA as passing the Consistency Test on July 31, 2006. The new QAPP was implemented at the beginning of the 1st quarter FY 2007.

Water levels are collected annually from the monitoring wells and bundle piezometers in the vicinity of the groundwater collection and treatment system. FY 2007 monitoring was performed in accordance with the Monitoring Plan included as Appendix A. The comprehensive monitoring well sampling round was conducted in June 2007. Figure 9-1 presents the sampling and water level monitoring locations. Figure 9-1 also shows the cross-section alignment.

9.2 REMEDY COMPONENT #2: SENTINEL WELLS

Description: "Installation of sentinel wells at the bottom of Unit 1 and top of Unit 3." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When the wells have been installed according to a regulator approved work plan.

Is the remedy component being implemented?
Yes. The OU2 ROD was signed in 1997. The Predesign Investigation Work Plan for Site K was approved in February 1999. The upper Unit 3 sentinel well was installed in February 2000.

Existing piezometers were used to accomplish the deep Unit 1 sentry monitoring. Piezometers 01U625D, 01U626D, 01U627D, and 01U628D were used since they monitor the base of the Unit 1 aquifer near the trench. The issue is the potential for Dense Non-Aqueous Phase Liquids (DNAPLs) to migrate beneath the trench along the Unit 1/Unit 2 interface. These four piezometers are screened at that interface.

Figure 9-1 shows the location of the upper Unit 3 sentinel well (03U621) and the piezometers. The sentinel well was installed to monitor the potential for VOCs to migrate through the Unit 2 till and into the Unit 3 aquifer.

What are the results of the Unit 1 piezometer and Unit 3 sentinel well sampling?

The piezometers (Unit 1 sentinel wells) were sampled in March 2000 and the results were discussed in the FY 2000 Annual Performance Report (APR). The results did not indicate the presence of DNAPLs at the Unit 2/Unit 3 interface. This was a one-time sampling event, as required by the USEPA/MPCA approved Predesign Investigation Work Plan, Site K, TCAAP, CRA, February 1999, and as documented in the Predesign Investigation Report, Site K, TCAAP, CRA, December 2001, for which concurrence was received.

The Unit 3 sentinel well (03U621) was sampled in March, July, and September 2000, of FY 2000, and in January 2001 for the quarterly sampling required by the Work Plan. After that, the well was incorporated into the regular TCAAP monitoring plan. The well was sampled in June 2007 for FY 2007. The results of the sample collected during FY 2007 are presented in Table 9-1. VOCs were not detected in the Unit 3 sentinel well.

9.3 REMEDY COMPONENT #3: HYDRAULIC CONTAINMENT

Description: "Use of existing interceptor/recovery trench to contain the plume and remove impacted groundwater." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):

When the trench is operating as designed and capturing all groundwater exceeding the cleanup levels presented in Table 1 of the OU2 ROD, as described below.

Is the remedy component being implemented?

Yes. The groundwater collection system continues to provide capture (as described later) of the Unit 1 groundwater, upgradient of the trench and beneath Building 103, as designed.

Is the system providing hydraulic capture of the plume?

Yes. Water level data are presented in Table 9-2. Figure 9-2 presents a plan view of the groundwater contours from the June 2007 round of groundwater level measurements. At nested wells, the numerically lowest water elevation was used to create the plan view contours. Monitoring wells downgradient of the extraction trench show consistently higher water levels than those near and upgradient of the trench. This demonstrates that the horizontal hydraulic gradient has been reversed toward the extraction trench due to system operation.

Vertical capture was also effective as illustrated on Figure 9-3. As seen in the figure, groundwater both upgradient and downgradient of the trench is captured and collected. The upward gradient beneath the trench indicates that groundwater does not migrate below the trench. The monitoring coverage provided by the bundle piezometers, demonstrates complete vertical and horizontal hydraulic capture.

Figure 9-4 presents the trichloroethene concentrations from the June 2007 annual sampling event. Trichloroethene concentrations range from non-detect to 6,800 µg/l. The FY 2007 concentrations at wells 01U615 and 01U611, which monitor the core of the plume, showed an increase from 3,400 µg/l to 6,500 µg/l in 01U615 and an increase from 1,200 µg/l to 6,800 µg/l in 01U611 compared to the concentrations measured in FY 2006. The FY 2007 concentration of trichloroethene in 01U615 compares with historical concentrations from the last ten years of sampling, which have ranged from 1,800 µg/l to 7,100 µg/l. Although the FY 2006 and FY 2007 increases in trichloroethene in 01U611 are an order of magnitude greater that FY 2005 sampling, the overall trend continues to shown a gradual decrease in trichloroethene concentrations over the last fifteen years of sampling. Water levels measured during the FY 2007 monitoring were 0.92 feet lower at 01U615 and 0.6 feet higher at 01U611 compared to FY 2006 elevations. These wells have historically exhibited fluctuating groundwater elevations.

Comparison of Figure 9-4 to the groundwater contour maps indicates that the VOC plume is hydraulically contained by the treatment system. Table 9-1 presents the monitoring well sampling data. The plume was originally defined based on data from all of the monitoring wells.

The current monitoring well network is used to confirm the plume contours and measure the progress of remediation. Thus, the contours on Figure 9-4 were drawn with consideration of the extensive historical data.

Three wells (01U128, 01U617, and 01U621) exhibit low concentrations of 1,2-dichloroethene downgradient of the groundwater collection system's capture zone. Two of these wells (01U128 and 01U617) have exhibited reasonably consistent concentrations of 1,2-dichloroethene since 1987. The third well, 01U621, has exhibited 1,2-dichloroethene since September 1993. The concentrations at these wells were consistent with those measured in FY 2006 and previous years.

9.4 REMEDY COMPONENT #4: GROUNDWATER TREATMENT

Description: "Treatment of contaminated groundwater using air stripping."
(OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When the air stripping facility is treating water to the cleanup standards.

Is the remedy component being implemented?
Yes. See discussion below.

Were there any major operational changes during the year?
No. The original air stripping tower and controls were replaced with a new fluidized bed type air stripper system on June 21, 1999. During FY 2007, the treatment system functioned properly. The new air stripper is less prone to fouling and requires less maintenance. The treatment system was operational 93.6% of the time in FY 2007. The operational efficiency in FY 2007 was affected by system down time from October 17, 2006 to November 1, 2006 and from December 1, 2006 to December 7, 2006. During FY 2007, a regular maintenance schedule was

maintained. Appendix F.1 summarizes operational data and events at the groundwater extraction and treatment system.

9.5 REMEDY COMPONENT #5: TREATED WATER DISCHARGE

Description: "Discharge of treated groundwater to Rice Creek." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When the system is operating as designed with treated water discharge to the storm sewer that, in turn, discharges to Rice Creek. The water is required to meet the substantive requirements of Document No. MNU000579 (MPCA), which contains the state-accepted discharge limits for surface water. Sampling and analysis are performed to monitor performance (see below).

Is the remedy component being implemented?
Yes. See discussion in Section 9.6.

9.6 REMEDY COMPONENT #6: DISCHARGE MONITORING

Description: "Monitoring to track compliance with discharge requirements." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When a monitoring plan is established and is being implemented in accordance with the plan.

Is the remedy component being implemented?
Yes. Treatment system monitoring consisted of quarterly influent and effluent sampling. Influent and effluent analytical results are presented in Table 9-3 and Table 9-4. The discharge met all the treatment requirements.

Table 9-5 presents the VOC mass removal and monthly flow rates. A total of 5,484,637 gallons of water and 23.6 pounds of VOCs were removed from the aquifer in FY 2007. The cumulative mass removal is 200.8 pounds of VOCs.

9.7 REMEDY COMPONENT #7: ADDITIONAL INVESTIGATION

Description: "Additional characterization of the unsaturated Unit 1 soil." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When the additional investigation has been completed according to a regulator approved work plan.

Is the remedy component being implemented?
Yes. The Work Plan was approved in FY 1999. Work began in February 2000. A report of the investigation results was submitted in November 2001 and received a consistency determination from the Agencies on December 6, 2001. The report defined the extent of VOC contaminated soils beneath Building 103 and refined the location of the source area. The report and subsequent follow up sampling resolved anomalous dissolved zinc, lead, and nickel data at two monitoring wells. Zinc, lead, and nickel are no longer groundwater concerns.

9.8 OVERALL REMEDY FOR SITE K

Overall, the remedy for Site K continued to operate consistent with past years and in compliance with the required performance criteria.

Is additional monitoring proposed prior to the next report? No.

9.9 OTHER ACTIVITY

Alliant conducted pilot scale tests of two new technologies at Site K. These are Hydrogen Release Compound™ (HRC), and direct hydrogen injection with gas-permeable membranes. Both technologies are intended to enhance natural anaerobic degradation of chlorinated VOCs. These tests were completed in late FY 2000 and a report of the results was issued in FY 2001. The report determined that HRC was not effective under the specific conditions beneath the building slab at Site K. The direct hydrogen injection test yielded promising results but more research is needed for full-scale operation.

In FY 2002, no research field work was conducted; however, Alliant allowed the University of Minnesota to continue its research into direct hydrogen injection by making the test plot available for its use.

In June 2002, a Remedial Action Report for Site K, TCAAP, CRA, was submitted to the USEPA and MPCA. The purpose of the report was to document the remedial action implementation as required by the FFA. The report discussed implementation of the components required by the TCAAP OU2 ROD. A consistency letter for this report was received in FY 2003.

During the June 2004 monitoring, a groundwater sample was collected from well 01U615 and analyzed for 1,4-dioxane using EPA Method 8270c. The laboratory analytical result for 1,4-dioxane was estimated to be 0.64 µg/l, which is below the MDH Health Based Value (HBV) of 30 µg/l. The method detection limit (MDL) was 0.11 µg/l and the contract required detection limit (CRDL) was 1.0 µg/l.

Two monitoring wells (01U622 and 01U623) were abandoned in FY 2004. Well abandonment is documented in the *Well Abandonment Report, Sites I and K, TCAAP,* SECOR, dated December 15, 2003.

During FY 2004, a Five-Year Review of the remedy was performed. The review concluded that the remedy was functioning as intended, and that the components of the remedy remain protective of human health and the environment. The Review also recommended monitoring the trichloroethene HRL for any changes due to the USEPA's potential update of the trichloroethene health risk assessment.

During FY 2005, the groundwater collection system trench was cleaned using a high-pressure water jetting technique. Pre-cleaning and post-cleaning video documentation was used to assess the effectiveness of the high pressure jetting. Pre-cleaning (June 2005) and post-cleaning (November 2005) groundwater contouring and groundwater elevations were used to further assess the trench cleanings effectiveness on hydraulic containment within the VOC plume. Results of both effectiveness assessments indicate that the jet cleaning improved the hydraulic containment compared to pre-cleaned conditions.

During FY 2006, Building 103 was demolished, leaving in place the concrete slab (floor) of the building. The Building 103 concrete slab will remain in place and continue to act as a Site K cap.

TABLE 9-1

GROUNDWATER QUALITY DATA
FISCAL YEAR 2007
SITE K, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date	Trichloroethylene TRCLE	1,1,1-Trichloroethane 111TCE	1,1,2-Trichloroethane 112TCE	1,1-Dichloroethylene 11DCE	1,1-Dichloroethane 11DCLE	cis-1,2-Dichloroethylene C12DCE	Vinyl chloride C2H3CL	Chloroform CHCL3	trans-1,2-Dichloroethylene T12DCE	Tetrachloroethylene TCLEE	1,2-Dichloroethane 12DCLE
01U128	6/5/2007	<1	<1	<1	<1	<1	4.0	<1	<1	0.39 (J)	<1	<1
OW103 (01U603)	6/5/2007	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U604	6/5/2007	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
OW111 (01U611) (1)	6/5/2007	6800 (2)	<20	<20	<20	<20	570	<20	<20	380	<20	<20
OW115 (01U615) (1)	6/5/2007	6500 (2)	<20	<20	<20	<20	1400	<20	<20	170	<20	<20
OW117 (01U617)	6/5/2007	<1	<1	<1	<1	<1	2.7	<1	<1	0.38 (J)	<1	<1
OW118 (01U618)	6/5/2007	0.85 (J)	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
OW119 (01U619)	6/5/2007	0.51 (J)	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
OW121 (01U621)	6/5/2007	<1	<1	<1	<1	<1	1.9	<1	<1	<1	<1	<1
OW121 (01U621) D	6/5/2007	<1	<1	<1	<1	<1	1.8	<1	<1	<1	<1	<1
03U621	6/5/2007	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
482083 (K04MW)	6/5/2007	0.67 (J)	<1	<1	<1	0.86 (J)	<1	<1	<1	<1	<1	<1

Notes:
Concentrations in ug/L.
D - Duplicate analysis.
J - Value is estimated.
P - Results less than reporting level but greater than instrumental detection limit.
Sample dilution = 1, unless noted otherwise.
(1) Sample dilution = 20.
(2) Sample dilution = 100.

Table 9-2

GROUNDWATER ELEVATION MONITORING
SITE K, TCAAP
ARDEN HILLS, MINNESOTA

Well ID	*TOC Elevation*	*Depth to Water (ft BGS)*	*Groundwater Elevation 6/4/2007*
01U047	880.31	6.76	873.55
01U048	885.32	11.46	873.86
01U052	886.51	12.01	874.50
01U065	883.90	10.09	873.81
01U128	883.69	9.64	874.05
01U601	892.68	7.11	885.57
01U602	889.35	4.82	884.53
01U603	887.31	10.21	877.10
01U604	888.98	12.75	876.23
01U605	887.76	9.85	877.91
01U607	891.01	5.79	885.22
01U608	889.30	3.82	885.48
01U609	889.33	3.50	885.83
01U611	889.29	4.22	885.07
01U612	886.91	7.08	879.83
01U613	892.07	6.36	885.71
01U615	888.66	12.92	875.74
01U616	890.37	12.29	878.08
01U617	887.72	11.16	876.56
01U618	891.52	12.36	879.16
01U619	891.75	7.96	883.79
01U620	888.65	10.65	878.00
01U621	886.57	8.96	877.61
01U622	889.43	Monitoring well abandoned	
01U623	889.44	Monitoring well abandoned	
01U624A	889.88	12.22	877.66
01U624B	889.88	12.23	877.65
01U624C	889.91	12.25	877.66
01U624D	889.89	12.23	877.66
01U625A	886.92	10.38	876.54
01U625B	886.91	10.44	876.47
01U625C	886.91	10.43	876.48
01U625D	886.92	10.45	876.47
01U626A	886.87	10.37	876.50
01U626B	886.88	10.83	876.05
01U626C	886.88	10.71	876.17
01U626D	886.88	10.15	876.73
01U627A	886.46	9.03	877.43
01U627B	886.47	10.06	876.41
01U627C	886.47	10.17	876.30
01U627D	886.48	10.15	876.33
01U628A	887.82	10.32	877.50
01U628B	887.83	10.63	877.20
01U628C	887.82	11.10	876.72
01U628D	887.84	11.11	876.73
482085 (K01MW)	891.24	4.37	886.87
482084 (K02MW)	891.35	5.47	885.88
482083 (K04MW)	887.66	9.11	878.55
03U621	887.01	34.69	852.32

Notes:
ft BGS - feeg below ground surface

TABLE 9-3

TREATMENT SYSTEM CONCENTRATIONS (ORGANICS)
FISCAL YEAR 2007
SITE K, TCAAP
ARDEN HILLS, MINNESOTA

Location	Sample Date	1,1-Dichloroethane 11DCLE		1,1-Dichloroethene 11DCE		1,2-Dichloroethane 12DCLE		cis-1,2-Dichloroethene C12DCE		trans-1,2-Dichloroethene T12DCE		Trichloroethene TRCLE		Vinyl chloride C2H3CL	
Effluent	12/12/2006	ND		ND		ND		2.7		ND		1.7		ND	
Effluent	12/12/2006	ND	D	ND	D	ND	D	2.6	D	ND	D	1.8	D	ND	D
Effluent	3/14/2007	ND		ND		ND		0.79	J	ND		1.5	B	ND	
Effluent	3/14/2007	ND	D	ND	D	ND	D	0.63	D,J	ND	D	1.2	D,B	ND	D
Effluent	6/6/2007	ND		ND		ND		2.3		ND		5.3		ND	
Effluent	6/6/2007	ND	D	ND	D	ND	D	2.4	D	ND	D	5.3	D	ND	D
Effluent	9/6/2007	ND		ND		ND		0.59	J	ND		0.69	J	ND	
Effluent	9/6/2007	ND	D	ND	D	ND	D	0.57	D,J	ND	D	0.74	D,J	ND	D
Influent	12/12/2006	ND		0.26	J	ND		190		20		200		2.1	
Influent	3/14/2007	ND		ND		ND		120		13		300	B	0.67	J
Influent	6/6/2007	ND		ND		ND		160		13		450		0.66	J
Influent	9/6/2007	ND		ND		ND		190		13		340		0.76	J
MDL		0.355		0.199		0.297		0.171		0.168		0.195		0.456	
MDL		0.344		0.234		0.308		0.269		0.229		0.247		0.316	
CRDL		1		1		1		1		1		1		1	
REQ.		--		7.0		3.8		70		100		10		0.18	

Notes:
Results are reported in µg/L unless otherwise noted.
MDL - Method Detection Limit
CRDL - Contract Required Detection Limit
ND - Not Detected
D - Duplicate Analysis
P - Results less than reporting level but greater than instrument detection limit.
J - Value Estimated
REQ - Substantive Requirement Document Concentration Limit, Maximum Daily Concentration
B - Value is between the MDL and PQL (Practical Quantitaion Limit

TABLE 9-4

TREATMENT SYSTEM CONCENTRATIONS (INORGANICS)
FISCAL YEAR 2007
SITE K, TCAAP
ARDEN HILLS, MINNESOTA

Location	***Sample Date***	***Phosphorus Total***		***Copper***		***Cyanide***		***Lead***		***Mercury***		***Silver***		***Zinc***
Effluent	12/11/06	320	B	5.63	UB1.63	3.5	B	0.93	B	ND	U	0.110	UB.98	31.1
Effluent	3/14/07	240	B	3.13	B	3.4	B	0.112	B	ND	U	0.120	B	17.4
Effluent	6/6/07	260	B	5.14		ND	U	0.363	B	ND	U	0.721	UB.638 JS53	18.8
Effluent	9/6/07	437		12.50		ND	U	3.51		ND	U	ND	UB.862	158
MDL	12/11/06	170.0		0.484		2.97		0.0158		0.0304		0.083		0.081
MDL	3/14/07	170.0		0.0725		2.81		0.0726		0.0158		0.0453		0.616
MDL	6/6/07	153.0		0.243		1.36		0.0451		0.0158		0.250		0.692
MDL	9/6/07	153.0		0.243		1.36		0.0726		0.0158		0.250		0.692
CRDL		200		5		10		2		0.100		2.0		5
REQ.		1000		21		17		106		0.2		3.4		134

Notes:

Results are reported in ug/L unless otherwise noted.
CRDL - Contract Required Detection Limit
MDL - Method Detection Limit
ND - Not Detected
REQ - Substantive Requirement Document Concentration Limit, Maximum Daily Conc.
U - Not detected at or above the MDL or IDL.
B - Value is between the MDL and PQL
JE#- Serial dilution percent difference out of control limits; # = %difference
UB# - Contamination present in calibration blanks; # = concentration present in Blanks
JS#- Matrix Spike recoveries out of control limit; # = %recovery

TABLE 9-5

SUMMARY OF MONTHLY VOC REMOVAL
FISCAL YEAR 2007
SITE K, TCAAP
ARDEN HILLS, MINNESOTA

Month	Total Monthly Flow (million gallons)	Total VOC Influent Concentration	Total VOC Effluent Concentration	Total VOCs in Treatment Center Discharge (g)	Total VOC Mass Removed (g)	Total VOC Mass Removed (lb)
Cumulative As Of September 2006 (FY06)						177.2
October[(1)]	0.33001	412.36	4.4	5.49	508.90	1.12
November[(1)]	0.45873	412.36	4.4	7.63	707.40	1.56
December	0.34355	412.36	4.4	5.71	529.78	1.17
January[(1)]	0.42838	433.67	2.29	3.71	698.52	1.54
February[(1)]	0.30357	433.67	2.29	2.63	495.01	1.09
March	0.39285	433.67	2.29	3.40	640.59	1.41
April[(1)]	0.56553	623.66	7.6	16.25	1316.95	2.90
May[(1)]	0.58345	623.66	7.6	16.76	1358.68	2.99
June	0.54547	623.66	7.6	15.67	1270.24	2.80
July[(1)]	0.46658	543.76	1.28	2.26	956.76	2.11
August[(1)]	0.47257	543.76	1.28	2.29	969.05	2.13
September	0.60989	543.76	1.28	2.95	1250.63	2.75
Totals - FY07	5.50058			84.7	10702.5	23.6
Cumulative To Date						200.8

Notes:
(1) Influent and Effluent VOC concentrations from 12/11/06, 3/14/07, 6/06/07 and 9/06/07 quarterly samples, respectively. Calculations based on compounds with concentrations above the CRDL only.

TABLE 9-6

SUMMARY OF GROUNDWATER MONITORING REQUIREMENTS
FISCAL YEAR 2007
SITE K, TCAAP
ARDEN HILLS, MINNESOTA

	Remedy Component	Monitoring Requirements	Responsible Party	Documents Containing the Monitoring Plan
#1	Groundwater Monitoring	Outlined below	Alliant	Site K Monitoring Plan in Annual Performance Report
#2	Sentinel Wells	a. Water quality to monitor potential migration.	Alliant	Site K Monitoring Plan in Annual Performance Report
#3	Hydraulic Containment	a. Water levels for use in drawing contour maps showing capture.	Alliant	Site K Monitoring Plan in Annual Performance Report
		b. Pumping volumes and rates for reporting and mass removal calculation.	Alliant	Site K Monitoring Plan in Annual Performance Report
#4	Groundwater Treatment	None	Alliant	Site K Monitoring Plan in Annual Performance Report
#5	Treated Water Discharge	None	Alliant	Site K Monitoring Plan in Annual Performance Report
#6	Discharge Monitoring	a. Treated effluent water quality for comparison to substantive requirements criteria for discharge maximum daily concentration.	Alliant	Site K Monitoring Plan in Annual Performance Report
#7	Additional Investigation	a. As per work plan (completed).	Alliant	Site K Monitoring Plan in Annual Performance Report

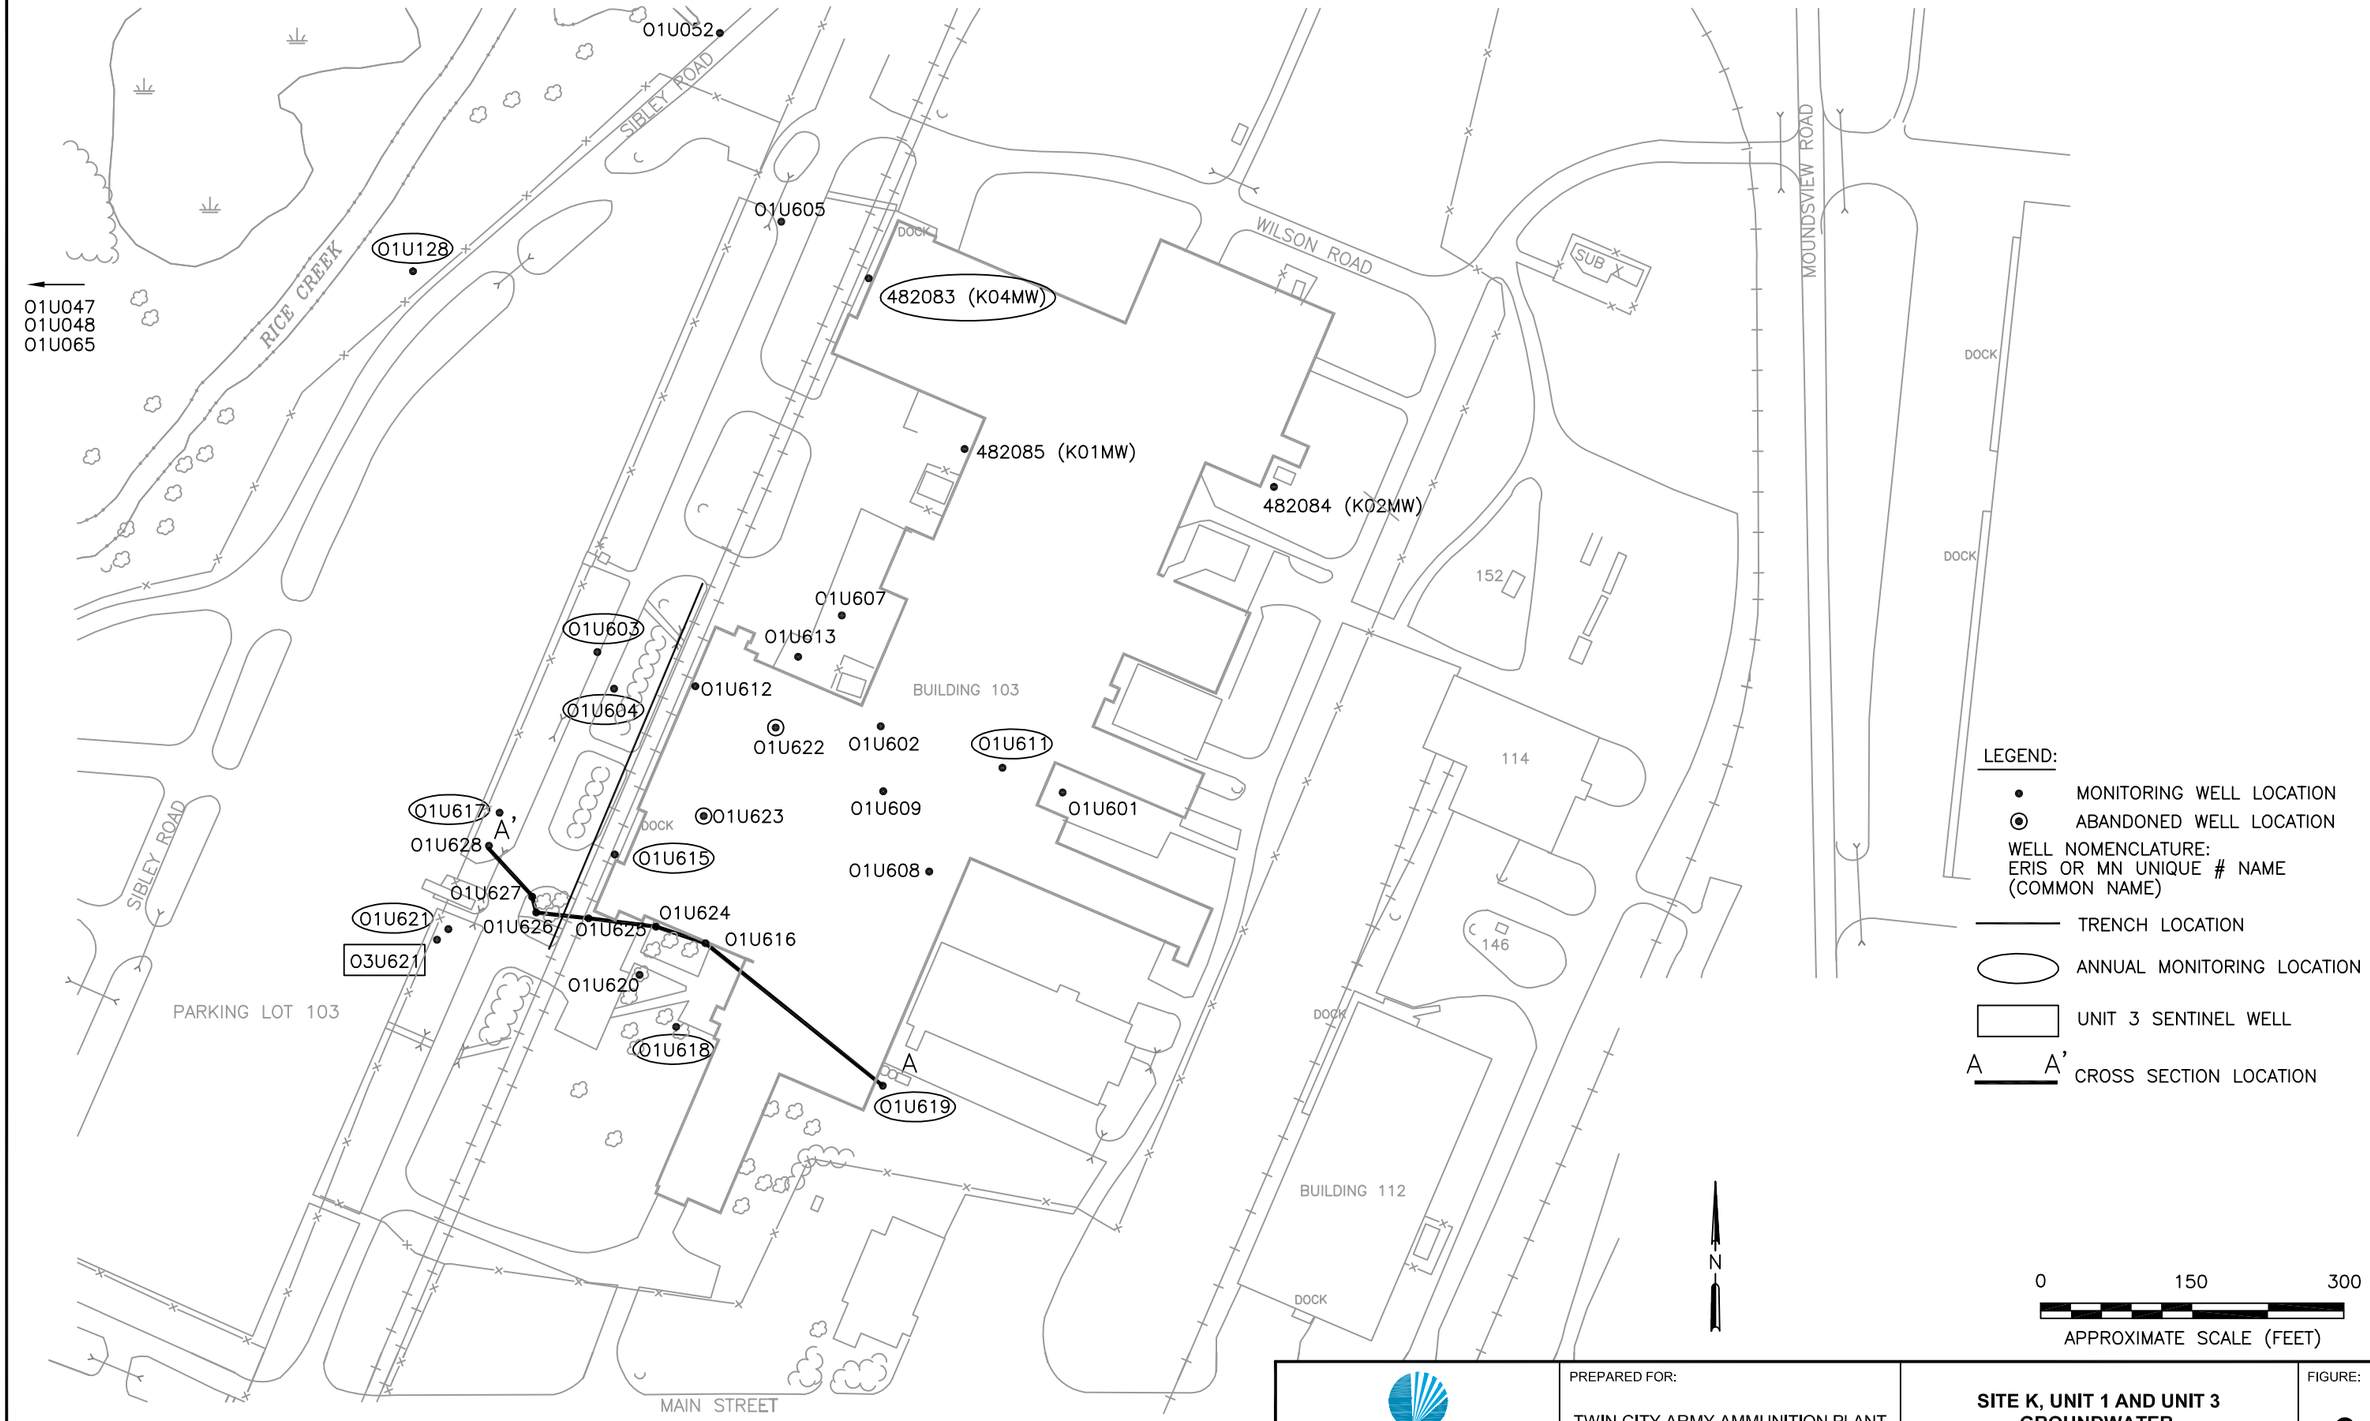

SECOR
4463 WHITE BEAR PARKWAY, SUITE 106
WHITE BEAR LAKE, MINNESOTA 55119
PHONE (651) 653-9112 FAX (651) 653-1751

PREPARED FOR:
TWIN CITY ARMY AMMUNITION PLANT
ARDEN HILLS, MINNESOTA

SITE K, UNIT 1 AND UNIT 3 GROUNDWATER MONITORING LOCATIONS

FIGURE: **9-1**

JOB NUMBER:	DRAWN BY:	CHECKED BY:	APPROVED BY:	DATE:
03OT.18508.0462	KM	AG	AG	01/08/08

SITE-K-07

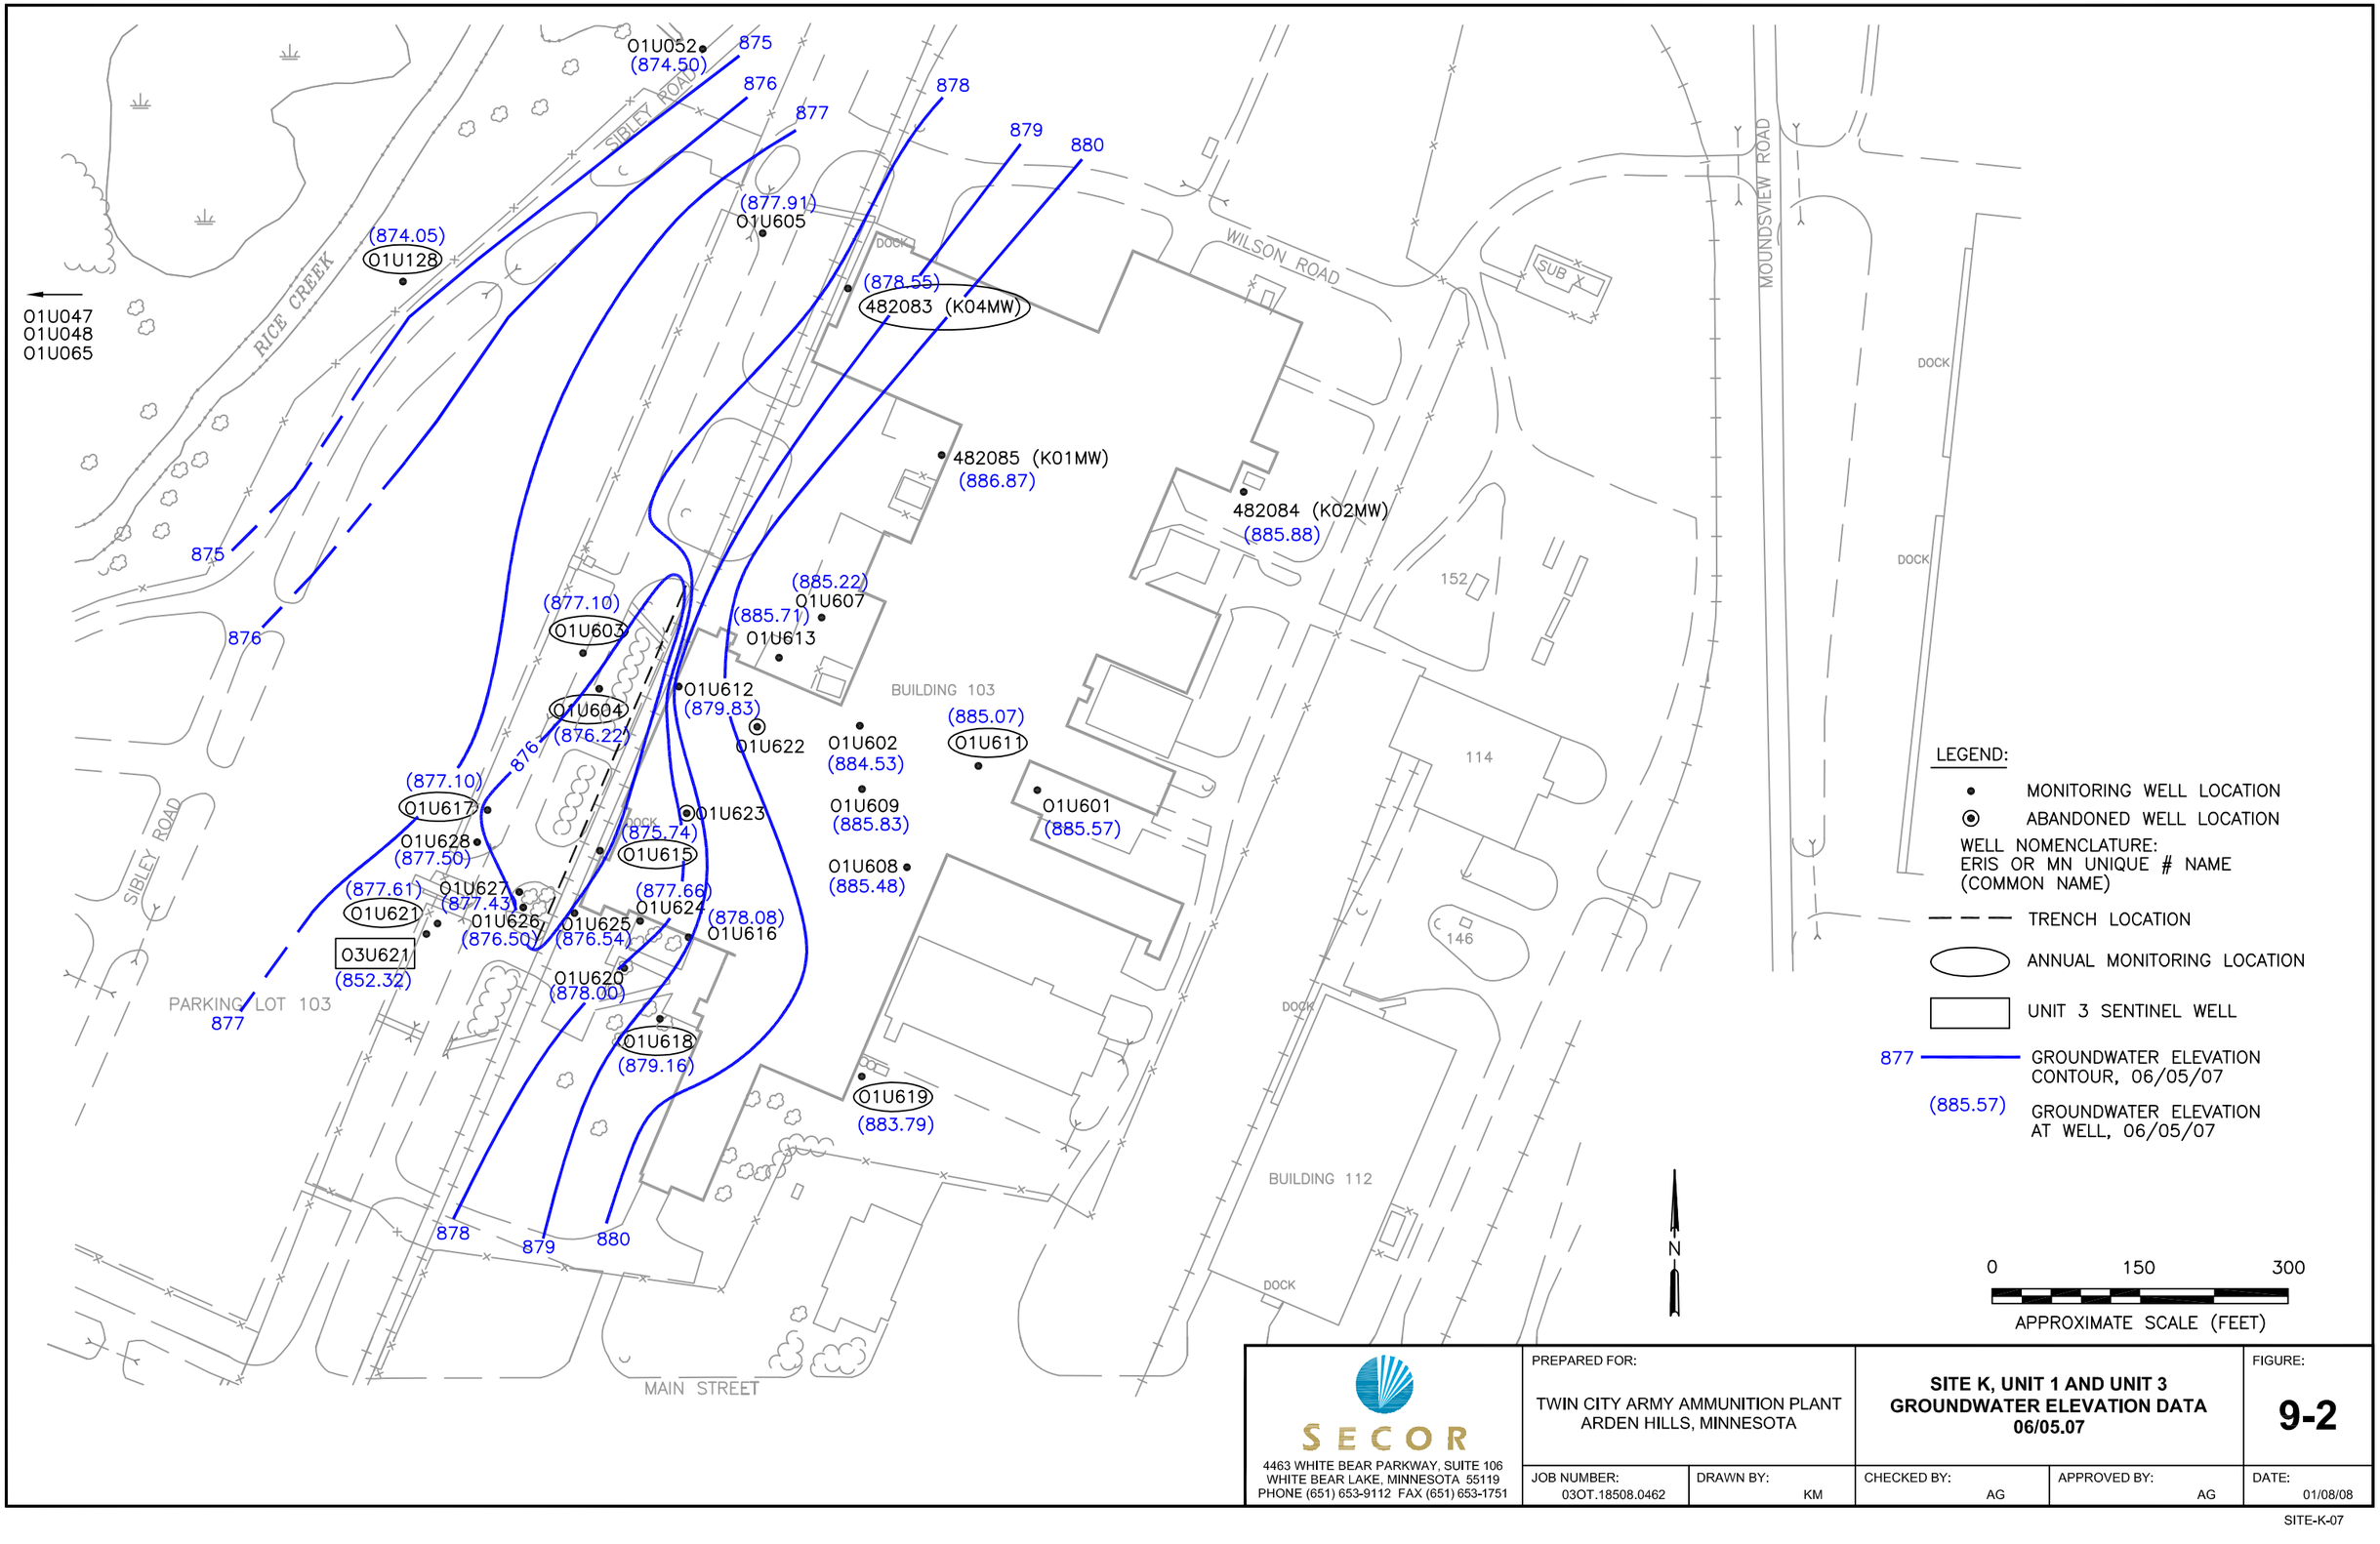

SECOR
4463 WHITE BEAR PARKWAY, SUITE 106
WHITE BEAR LAKE, MINNESOTA 55119
PHONE (651) 653-9112 FAX (651) 653-1751

PREPARED FOR:
TWIN CITY ARMY AMMUNITION PLANT
ARDEN HILLS, MINNESOTA

SITE K, UNIT 1 AND UNIT 3
GROUNDWATER ELEVATION DATA
06/05.07

FIGURE: **9-2**

JOB NUMBER:	DRAWN BY:	CHECKED BY:	APPROVED BY:	DATE:
03OT.18508.0462	KM	AG	AG	01/08/08

SITE-K-07

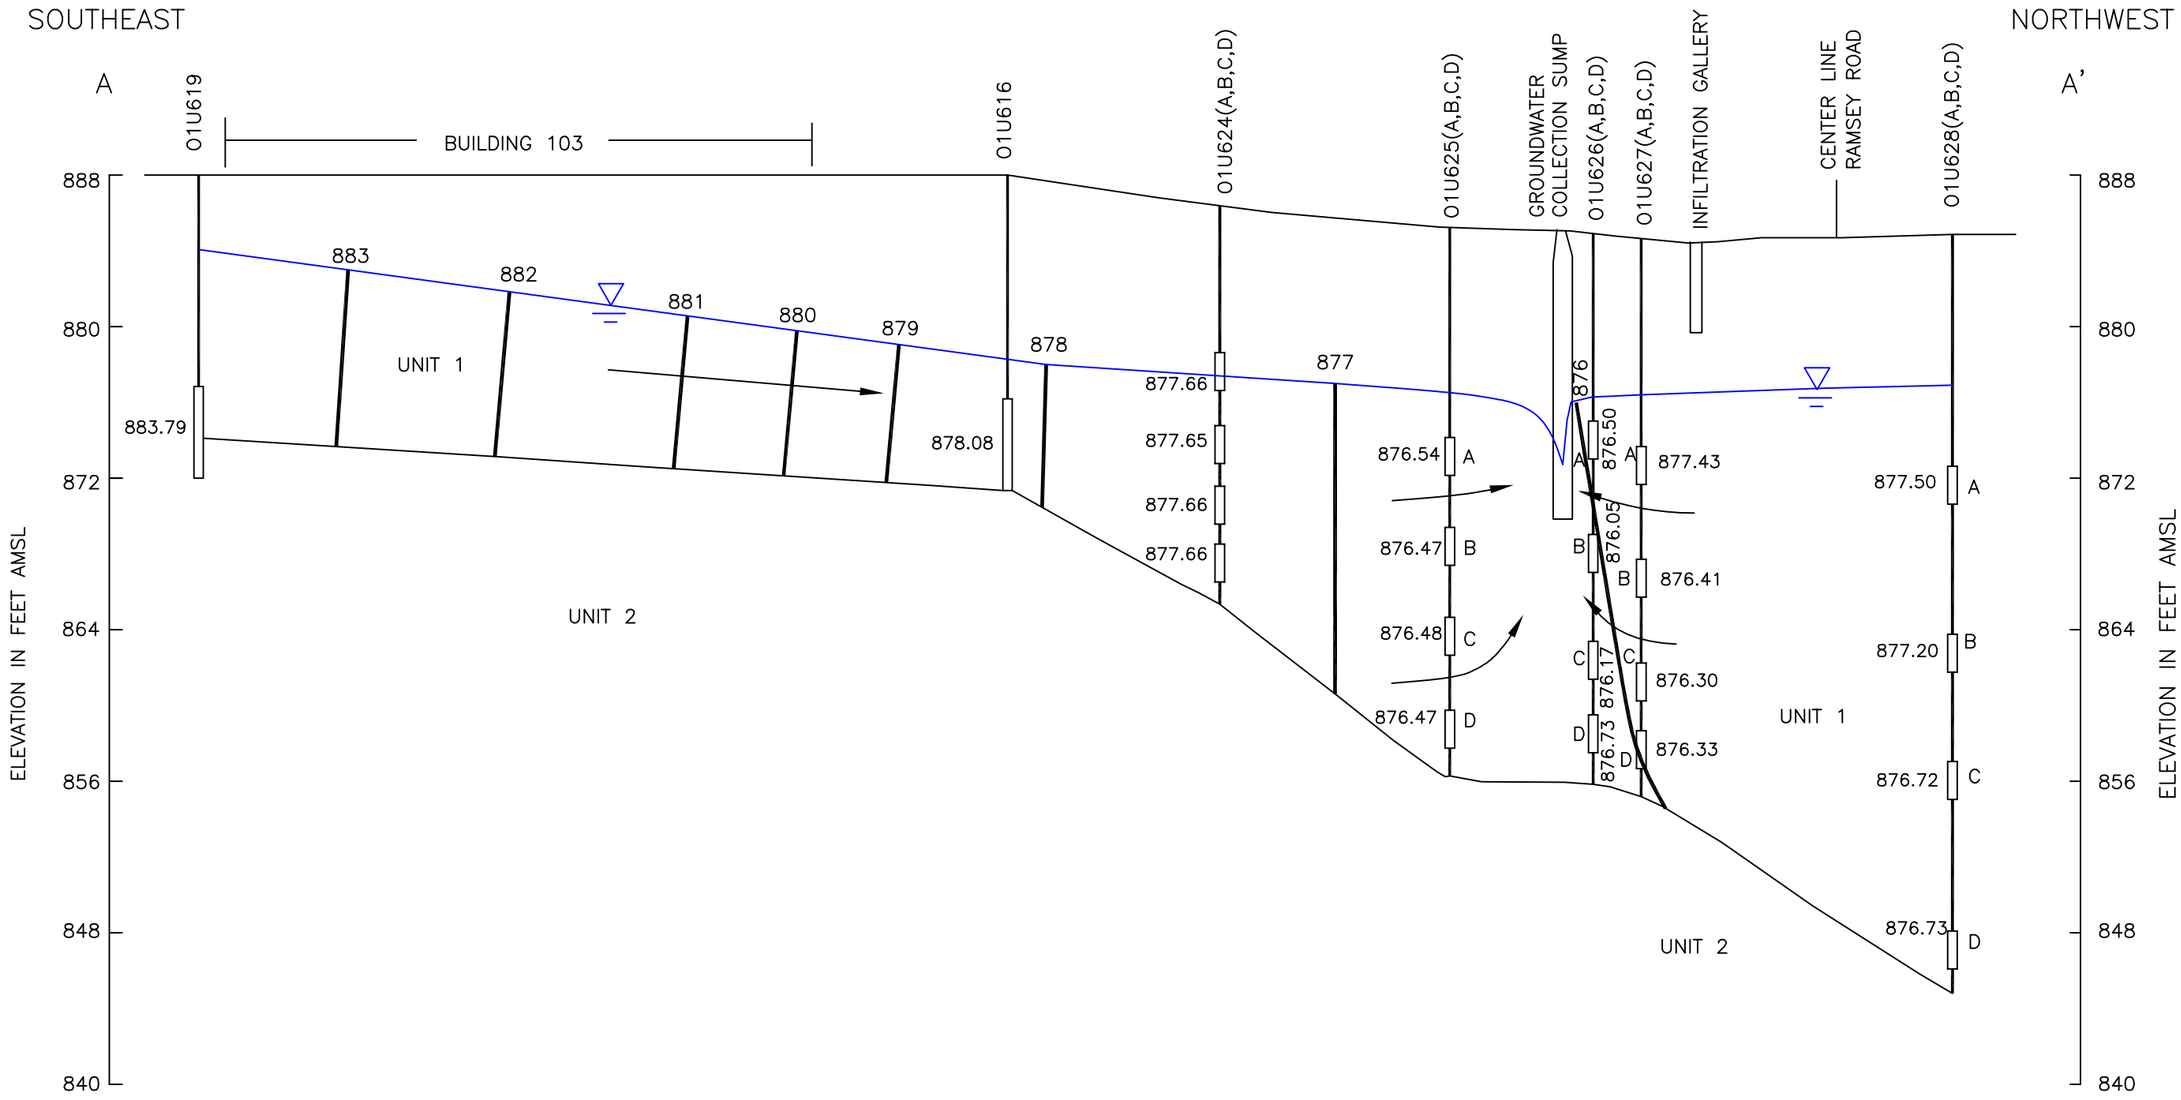

VERTICAL SCALE
1"=8'
0 8

HORIZONTAL SCALE
1"=40'
0 40

SECOR
4463 WHITE BEAR PARKWAY, SUITE 106
WHITE BEAR LAKE, MINNESOTA 55110
PHONE (651) 653-9112 FAX (651) 653-1751

PREPARED FOR:
TWIN CITY ARMY AMMUNTION PLANT
ARDEN HILLS, MINNESOTA

SITE K
HYDROGEOLOGIC CROSS SECTION A-A'
06/05/07 (Q95)

FIGURE: **9-3**

JOB NUMBER:	DRAWN BY:	CHECKED BY:	APPROVED BY:	DATE:
03OT.18508.00.0462	KM	AG	AG	01/08/08

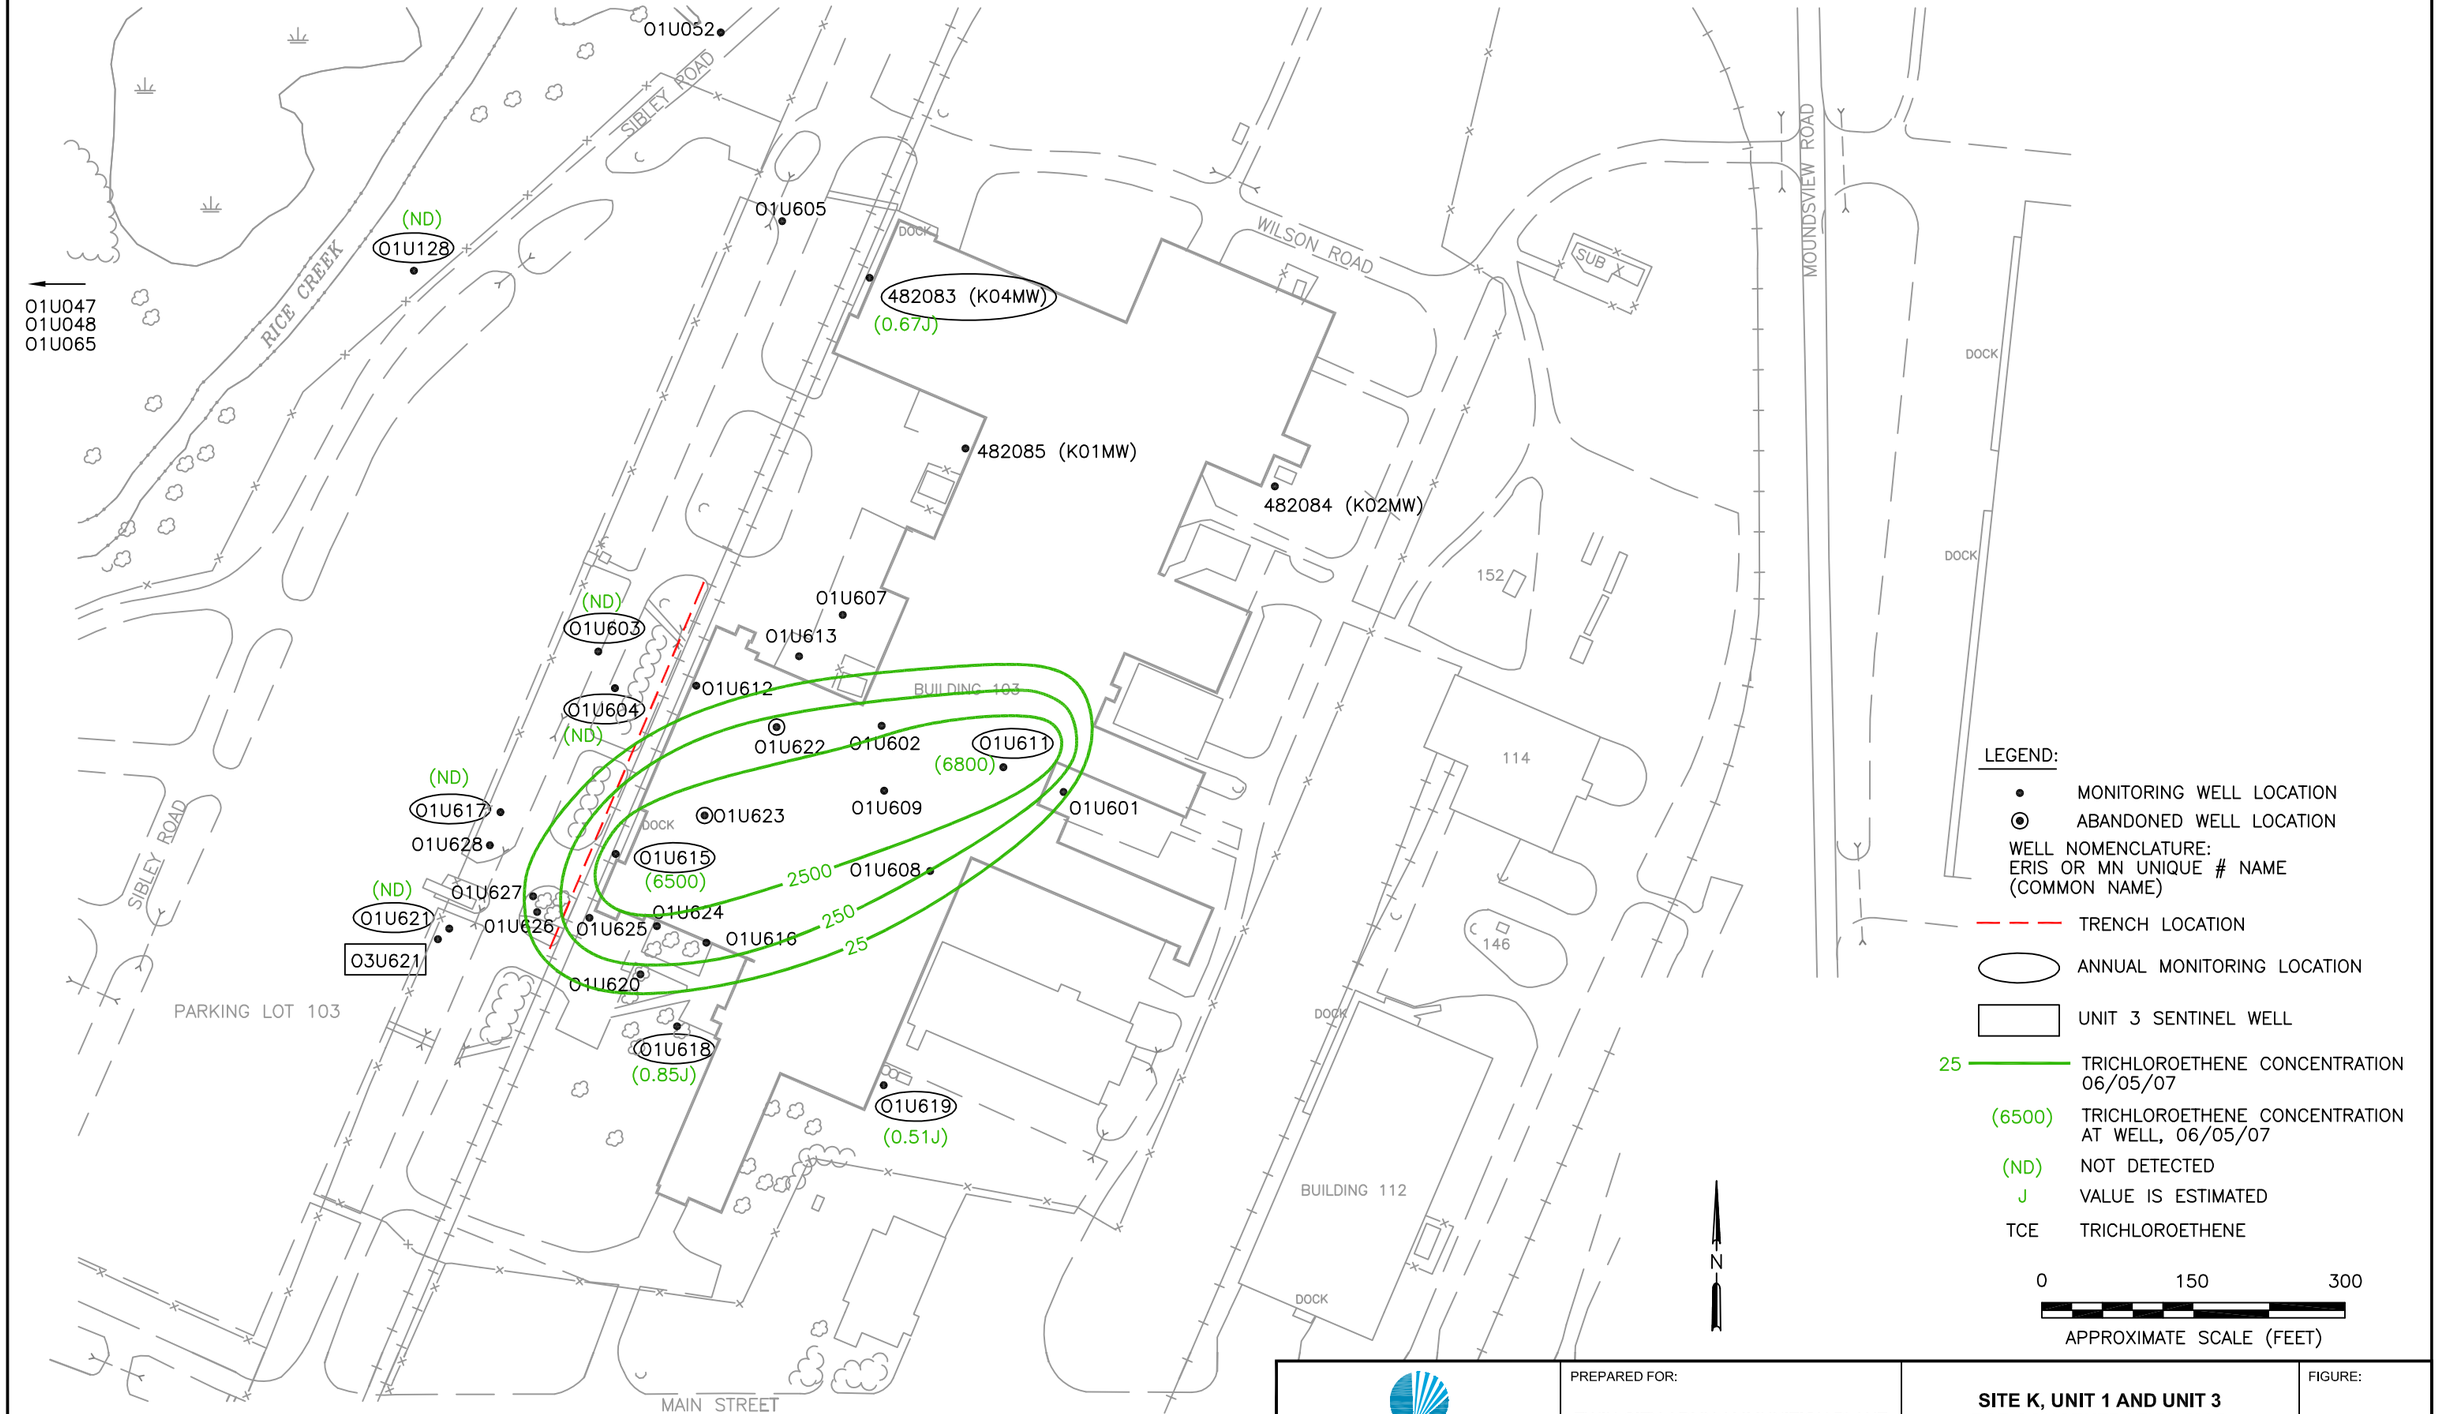

SECOR
4463 WHITE BEAR PARKWAY, SUITE 106
WHITE BEAR LAKE, MINNESOTA 55119
PHONE (651) 653-9112 FAX (651) 653-1751

PREPARED FOR:
TWIN CITY ARMY AMMUNITION PLANT
ARDEN HILLS, MINNESOTA

SITE K, UNIT 1 AND UNIT 3
TCE CONCENTRATION MAP
06/05/07 (Q95)

FIGURE:
9-4

JOB NUMBER:	DRAWN BY:	CHECKED BY:	APPROVED BY:	DATE:
03OT.18508.0462	KM	AG	AG	01/08/08

SITE-K-07

10.0 Operable Unit 2: Deep Groundwater

The selected remedy for the Deep Groundwater in the OU2 ROD consists of five remedial components that include continued use of the TGRS, with modifications to improve VOC contaminant removal from the source area. It also includes an annual review of new and emerging technologies potentially applicable to the Deep Groundwater. This report documents all performance and monitoring data collected from October 2006 through September 2007.

Historical Design and Evaluation of TGRS Remedial Action

In 1987, a Record of Decision (1987 ROD) was prepared by the USEPA in order to implement the Interim Response Action Plan (IRAP) for TCAAP. The 1987 ROD provided specific criteria for the Boundary Groundwater Recovery System (BGRS). Following extensive interagency negotiations on the FFA and the ROD, the BGRS was started on October 19, 1987.

The BGRS consisted of six Unit 3 extraction wells (B1 through B6), that were connected by forcemain to an air stripping treatment facility. The initial six BGRS extraction wells (B1 through B6) were installed and pumping tests were conducted prior to start up of the BGRS. These pumping tests were documented in the BGRS Extraction Well Pumping Test Report.

Following the initial 90-day operation of the BGRS, the IRA-BGRS Performance Assessment Report (PAR) was prepared. The PAR assessed the hydraulic and treatment performance of the BGRS. The PAR presented an extensive database collected during the initial 90-day period of BGRS operation and prior pertinent data. The PAR also included a summary of the geology, hydrogeology, and remediation history for TCAAP. The PAR was subsequently approved by the USEPA and MPCA.

A pumping test on well B9 was conducted in August 1988 and formed the basis of the final design of the TGRS. This test, and the previous pumping tests, were utilized to determine the pumping rate required to achieve the necessary zone of capture for the TGRS; based on the plume size at that time. The PAR stated that the overall pumping rate needed for the 17 extraction wells was 2,450 gpm. During the detailed design of the TGRS, the system was designed with the capacity to operate at a maximum theoretical rate of 2,900 gpm. The additional pumpage was included to provide a safety margin for the calculations and to allow for fluctuations in system operation.

The PAR made recommendations for expansion of the BGRS into the TGRS in order to meet the Phase II remediation criteria established in the 1987 ROD. These modifications were completed and the expanded system began operation on January 31, 1989.

The 1989 Annual Monitoring Report was the first report covering the fully configured TGRS. It concluded that the TGRS developed a continuous zone of capture that was approximately 4,500 feet wide at the TCAAP boundary. The zone of capture widened to approximately 8,300 feet upgradient of the boundary. This zone of capture was demonstrated at average system pumping rates of 2,400 to 2,700 gpm.

The 1989 Annual Monitoring Report was wider in scope than subsequent annual monitoring reports for the TGRS. The 1989 report was both a performance assessment report and a monitoring report. The 1989 report represented the first year of operation of the expanded TGRS. Thus, a more detailed and exhaustive performance assessment was appropriate and possible, as there were data available from non-pumping conditions for detailed comparison with pumping conditions. Between 1990 and 2002, the system continued to operate at an essentially steady state condition, so the TGRS was evaluated by comparing the pumping rates to those achieved for the 1989 evaluation.

In FY 2003, the Army received agency approval on the TGRS Operating Strategy (OS) document. The OS was based in part on findings from the 1989 Annual Monitoring Report and

presented a Global Operation Strategy (GOS) for the entire TGRS extraction system and a Micro Operation Strategy (MOS) for selected well groups. Evaluations now consider and compare actual pumping rates to the GOS and MOS rates presented in the Final TGRS OS.

TGRS Modifications

Since 1990, a number of modifications have been made to the TGRS operation in response to changes in plume configuration or operational issues. A brief summary of the major changes is presented below:

1. Source control well SC4 was shut down in November 1996 in response to insignificant VOC mass removal by this well. SC4 operated at an average extraction rate of 29 gpm in 1989 and 45 gpm prior to shut down.
2. Boundary extraction well B12 was shut down in November 1996. The plume in the B12 area had dropped below cleanup standards for several years. Well B12 operated at an average extraction rate of 139 gpm in 1989 and 190 gpm prior to shut down.
3. As per the OS, boundary extraction well B2 was shutdown and replaced with well B13 that began production in December 2002. The well screen in B2 became fouled and flow rates decreased from an average of nearly 200 gpm in the early 1990s to 52 gpm in 2002. During FY 2003, well B13 operated at maximum pumping capacity of nearly 100 gpm. The original design capacity for B13 was 200 gpm.
4. As per the OS, boundary extraction wells B7 and B10, and source control well SC3 were officially shut down in December 2002 due to the low TRCLE concentrations.
5. As per the OS, a larger capacity pump was installed at well B9 in December 2002 to raise the pumping rate from 150 gpm to approximately 300 gpm.
6. In July 2004, the TGRS was modified (Modification #3) as approved by the Agencies in May 2004. Pumps in Wells B1 and B13 were replaced and the pump in Well B13 was lowered to allow pumping below the well screen.
7. Flow rates at individual wells have been modified from time to time due to plume configuration changes, operational issues, and to maintain the OS.

10.1 REMEDY COMPONENT #1: HYDRAULIC CONTAINMENT AND CONTAMINANT REMOVAL FROM THE SOURCE AREA

Description: "Groundwater extraction to hydraulically contain the contaminated source area to the 5 µg/l TRCLE concentration contour and optimize the removal of contaminants from the source area through pumping of select wells." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):

When the TGRS is containing the contaminated source area to the 5 µg/l TRCLE contour and the system is operated to maximize the contaminant removal from the source area.

Is the remedy component being implemented?

Yes. The TGRS was operated in FY 2007 consistent with the requirements of the OU2 ROD. Table 10-1 presents the cleanup requirements for the TGRS from the OU2 ROD.

During FY 2007, the total extraction well water pumped was approximately 1,799 gpm. The total extraction well water pumping rate was above the GOS Total System Operational Minimum (1,745 gpm) where the Army and the agencies agree that OU2 ROD requirements are met with an adequate safety factor. Additionally, all of the individual well groupings were above their respective MOS minimums for FY 2007.

How is the system operated and what preventative maintenance measures were conducted during the year?

Summary of Operations

Beginning in FY 2003, the system operation changed to conform to the OS. Under the OS, groundwater is extracted from 8 wells along the southwest boundary of TCAAP (B1, B3 through B6, B8, B9, B11, and B13) and three wells downgradient of interior source areas on TCAAP (SC1, SC2, and SC5). Prior to this, wells B2, B7, B10, and SC3 were also operating components

of the system. Submersible pumps in the extraction wells discharge into a common pressurized forcemain that carries the water to the treatment system. The treatment system is located adjacent to Building 116. The TGRS layout is presented on Figure 10-1.

The TGRS was designed and constructed with three options for treated water discharge: recharge at the Arsenal Sand and Gravel Pit, discharge to Rice Creek, and discharge to the TCAAP elevated water tank. Water stored in the elevated tank was "softened" and then "polished" with GAC prior to distribution at TCAAP. Due to the Army discontinuing all non-environmental services at TCAAP in September 2007, the elevated water tank and the water softening and polishing equipment is no longer used. As such, the Arsenal Sand and Gravel Pit option is utilized for all of the extracted and treated water from the TGRS.

System Operation Specifications

In general, the influent and effluent water flow rates at the treatment plant are designed to be equal, thereby providing continuous operation of all processes and equipment. The following is a summary of the system design parameters:

- The groundwater extraction system, including the treatment center and 17 TGRS extraction wells, was originally designed to provide a theoretical hydraulic capacity of 2,900 gpm and a sustained daily average capacity of 2,730 gpm.
- The influent to the treatment plant is divided between Towers 1 and 2, each receiving up to a maximum of 1,450 gpm.
- Wet Well Pumps 1 and 2 (WWP#1 and WWP#2 located in Wet Wells 1 and 2) transfer water to Towers 4 and 3, respectively. Each pump and tower handles up to a maximum of 1,450 gpm.
- Wet Well Pumps 3 and 4 (WWP#3 and WWP#4 located in Wet Well 3) discharge treated water to an end use at a combined rate of up to a maximum of 2,900 gpm.
- Air blowers provide air to the towers. The blowers for Towers 1 and 2 are designed to provide 6,000 – 7,000 standard cubic feet per minute (scfm) each. The blowers for Towers 3 and 4 are designed to provide 9,000 – 14,000 scfm each.

Water level sensors within the wet wells communicate with the programmed logic controller (PLC) according to changing water levels. A complete and balanced operation should provide continuing water levels above the low-level sensors and below the high-level sensors. However, given the probability of unbalanced flows for any number of reasons (e.g., changing hydraulic heads, maintenance, repairs, temporary malfunctions), the PLC has provisions within its program to cycle-off the extraction well(s) or wet well pumps according to high water levels occurring in the wet wells; and in turn, cycle-off the wet well pumps according to low levels occurring within these wet wells.

The system operates such that the wet well pumps cycle rather than the extraction well pumps. The rationale behind this is that there are a relatively small number of motors, starters, and electrically controlled valves associated with the wet wells when compared with the extraction well field. This also provides for more continuous and complete hydraulic capture within the aquifer units. However, the extraction well field will cycle if necessary, starting with the least contaminated extraction well, B7 (if operating), and followed by the other extraction wells in a predetermined sequence.

In summary, the priority of operation is as follows:

- Maintain constant operation of all extraction wells and air stripping towers above the operating minimum;
- Maintain the desired flow rates at individual wells;
- Maintain treatment center WWP#1 and WWP#2 pumping rate equal to or slightly above the combined pumping rate of the extraction well field; and
- Maintain treatment center WWP#3 and WWP#4 pumping rate equal to or slightly above WWP#1 and #2.

FY 2007 Maintenance and Inspection Activity

During FY 2007, the following inspection and maintenance activities occurred:

Preventive Maintenance (PM): The extensive PM program allowed the operations staff to identify and repair or replace equipment to avoid a downtime failure. The program consists of monthly, quarterly, and annual maintenance tasks. When required, further repair work was scheduled rather than waiting for the failure to occur. A broad range of system-specific information was collected during this year's PM. This information is used to direct future repair work.

Electrical Inspection and Temperature Survey: A system-wide electrical inspection and infrared temperature survey was performed to identify loose connections and overheating components. Component overheating often precedes equipment failure. Electrical components that were identified as failing were replaced.

Verification of Flow Meters: As part of the routine PM, flow meters in the pumphouses were compared to a factory-calibrated flow meter. Flow volume measurements before and after conducting maintenance on the meters were compared to verify the consistency of measurements. Meters found to be out of calibration were replaced or recalibrated.

Daily Tracking of Flow Rates: Pumphouse and treatment center meter readings were recorded in the course of the daily inspections. Daily meter readings were tabulated and the flow rates were calculated and reviewed by the operations staff. Early detection of changes in flow rate was critical in early identification of failing equipment. By early detection of flow rate changes, equipment repair was typically scheduled before a failure occurred.

Did the system operate at a rate sufficient for complete capture?

Yes. At 1,799 gpm, the total extraction well water pumped was above the GOS Total System Operational Minimum (1,745 gpm) where the Army and the agencies agree that capture is achieved with an adequate safety factor. Figure 10-2 plots the daily average flow rate since

October 1, 2006, and shows that the TGRS operated above the OM for the majority of the time (318 days or 87.1 percent of the time) in FY 2007. On a monthly basis, total TGRS extraction rates were below 1,745 gpm during the following months:

- October 2006 (1,708 gpm, lower flow due to Tower 3 cleaning and SC5 data cable problem); and
- September 2007 (1,736 gpm, lower flow due to B1 well rehabilitation and modifying the TGRS discharge to prevent water from entering the elevated water tank by sealing off the altitude valve).

Appendix F.2 provides additional information on the various downtimes throughout FY 2007.

The monthly and annual volume of water pumped is presented in Table 10-2 and 10-3. Table10-2 presents the pumphouse metered monthly flow volumes of each extraction well. The individual pumphouse flow meters are used to determine the amount of groundwater extracted from the various MOS well groups, individual extraction wells, and the total amount of groundwater extracted during the fiscal year. Table 10-3 presents the combined pumphouse-metered flow volume (extraction wells) and the flow volumes metered at various stages in the treatment center along with historical data. These flow meters are used to evaluate the flow of water through the treatment process to ensure proper system operation. In addition, treatment center meters #1 and #2, located after the first set of air stripping towers, are used as a check on the total extracted groundwater calculation.

As shown on Table 10-3, the TGRS successfully captured and treated approximately 945,317,300 gallons of contaminated water from October 2006 through September 2007, based on the sum of the individual pumphouse flow meters. This converts to an average flow rate of 1,799 gpm.

The TGRS as a whole was operational 97.4 percent of the time (i.e., 355.6 days out of 365 days in FY 2007).

Monthly Flow Reports

Each month a Monthly Flow Report is prepared. The report includes the month's meter totalizer readings, calculated flow volumes, and operational notes. Flow volumes are presented on a daily basis and are totaled to provide a monthly flow volume. A compilation of FY 2007 operational notes is presented in Appendix F.2. During FY 2007, the sum of the individual pumphouse flow meters was used to measure total flow volumes in monthly reports for comparison with Operating Strategy limits. Daily variation in readings at individual wells is primarily due to differences in the time of day when meter readings were taken.

How much down time occurred during the year?

The down time for each extraction well, over the last five years, is presented in Table 10-4. A summary of average down time for the pumphouses and the treatment center by the category of failure is presented in Table 10-5. A description of each down time event, organized chronologically, is presented in Appendix F.2. The same descriptions organized by affected pumphouse, treatment center, and forcemain is presented in Appendix F.3.

Treatment center and extraction well down times resulted primarily from failure and subsequent repair of components in the pumphouses, treatment center, and electrical service. The treatment center and extraction wells were shut down for repairs much less in FY 2007 than they were in FY 2006.

Description of Down Time Categories

Pumphouse component failures accounted for an average of 5.7 days down time per pumphouse. There was less down time due to pumphouse maintenance in FY 2007 than in FY 2006. The major pumphouse repairs causing down time were:

- Communication failures at Pumphouses SC2 and SC5;
- Pump failure and replacement at Pumphouse B11;
- Well redevelopment at Pumphouses B1 and SC2; and
- Failed I/O adapter cards at Pumphouses B4, B8, B9, and B13.

Treatment center component failures and repairs that caused pumphouse down time consisted of electric check valve maintenance, malfunctions, and repairs, and electrical control equipment failures and subsequent repairs. Treatment center component failures, repairs, and adjustments accounted for an average of 0.3 days down time per pumphouse. The major treatment center repairs causing substantial down time were a failure of a seal inside ECV 4 in November and repairs to the float switch at Wet Well Pump 2 in October. Although not a repair item, some downtime occurred in October due the cleaning of Tower 3.

Electrical service system failures accounted for an average of 1.4 days down time per pumphouse. Electrical storm damage was the primary cause of down time.

Preventative maintenance procedures accounted for an average of 1.0 days of down time per pumphouse. Preventative maintenance procedures are described in the project Operation and Maintenance Manual.

System modifications accounted for an average of 0.2 days down time per pumphouse due to modifying the TGRS discharge to prevent water from entering the elevated water tank by sealing off the altitude valve in September 2007.

Forcemain issues accounted for an average of 0.1 days down time per pumphouse. Down time due to forcemain issues was the same as in FY 2006 and did not account for a significant amount of down time in FY 2007.

Were there any major operational changes during the year?

Yes. In September 2007, discharge of treated groundwater to the elevated water tank was discontinued. As such, the Arsenal Sand and Gravel Pit option is utilized for all of the extracted and treated water from the TGRS.

Did the system achieve hydraulic capture?

Yes. The total extraction well water pumped was above the GOS Operational Minimum (1,745 gpm) where the Army and the agencies agree that capture is achieved with an adequate safety factor. A positive sign with respect to capture is the generally stable or decreasing TRCLE concentrations evident at many wells across the TGRS boundary since FY 2001.

Groundwater elevation measurements were collected in June 2007. Appendix D contains the water level database for the monitoring wells. Figures 10-3 through 10-5 present the groundwater elevations for Upper Unit 3, Lower Unit 3, and Unit 4 during this time period. These figures present the potentiometric contours from three vertical portions of the aquifer. The groundwater elevation contours and limits of capture in the three portions of the aquifer are similar to those observed in FY 2003 after the modification to the OS was implemented. The zone of capture created by the TGRS extends beyond the 5 µg/l TRCLE contour, in both the Unit 3 and the Unit 4 aquifers.

How much VOC mass was removed by the system and how is it changing with time?

As discussed above, the TGRS extracted and treated approximately 945,317,300 gallons of water from October 2006 through September 2007. Based on the monthly influent and effluent VOC concentrations and the monthly flow totals as measured by the extraction well flow meters, the TGRS removed a total of 2,507 pounds of VOCs from October 2006 through September 2007. The VOC mass removal in FY 2006 was 2,552 pounds. The decrease in FY 2007 reflects an overall decrease in plume concentration.

Average VOC influent concentrations decreased from 337 µg/l in FY 2006 to 308 µg/l in FY 2007 (8.6 percent lower). Table 10-6 summarizes the individual VOC mass contribution of each extraction well and the entire system. Overall, the TGRS has removed nearly 100 tons (196,990 lbs.) of VOCs from the aquifers since 1987 and nearly 8.5 tons of VOCs since the end of FY 2001 (the TGRS OS was based on data through 2001). If the annual VOC mass removal from the TGRS is less than 1,709 pounds (50 percent of the FY 2001 mass removal) then the

Army and agencies have agreed that review of the OS operating minimum rates should be conducted and potentially reduced.

The total mass removed is based on the monthly TGRS influent and effluent sampling and flow through the treatment system. The monthly sampling of the treatment system provides the best estimate of overall mass removal, compared to the individual extraction well sampling, due to the larger number of samples and consistency in the month-to-month analytical results. The percent contributions for each well are based on the average flows from each well and the semi-annual VOC results from each well.

VOC samples were collected semi-annually from the operating extraction wells that comprise the TGRS. Wells B2, B7, B10, B12, SC3, and SC4 are shut down, but were temporarily operated for June 2007 sampling. Samples collected in June 2007 at wells B9 and B13 were rejected since it was discovered that the wells were not operating at the time of sampling and hence the stagnate water sampled in the piping was not representative of the groundwater for those wells. Wells B9 and B13 were resampled in July 2007. Table 10-7 presents a summary of the sampling results for the extraction wells.

Variations in detection limits from round to round are the result of varying sample dilution performed by the laboratory. Dilutions are required due to the high concentrations of some analytes. The location of the extraction wells is presented on Figure 10-1.

Appendix G.1 presents TRCLE versus time graphs for each extraction well. As shown, TRCLE concentrations have declined in each well and now many wells appear to be stable or still declining. Since June 2001, the following wells have shown the most improvement (greater than 50 percent reduction) in TRCLE concentrations:

- B10 (5.1 µg/l in 2001 to less than 1.0 µg/l in 2007);
- B6 (200 µg/l in 2001 to 96 µg/l in 2007);
- B5 (400 µg/l in 2001 to 170 µg/l in 2007); and
- B4 (490 µg/l in 2001 to 170 µg/l in 2007).

These trends reflect the overall decline in OU2 deep groundwater contaminant concentrations. In addition, as discussed below, there has been a reduction in overall TGRS influent concentrations over the previous several years.

As Table 10-6 illustrates, eight wells, B1, B4, B5, B6, B9, B13, SC1, and SC5, that are located in the centers of the plume, achieve the largest rates of VOC removal. These eight wells together accounted for nearly 99 percent of the VOC mass removed.

The source control wells, SC1 through SC5, together accounted for over 65 percent of the VOC mass removed while accounting for only 8.7 percent of the water pumped by the system. SC5, in particular, removed almost 61 percent of the total VOC mass at a rate of only approximately 102 gpm (5.7 percent of the total water pumped by the system). This illustrates the efficiency of extracting groundwater from near the source areas.

What do the long-term trends in the monitoring wells show?

Appendix B presents the TRCLE graphs over time for monitoring wells on- and off-TCAAP. Although a formal statistical analysis has not been conducted, the large majority of these graphs reflect downward trends in TRCLE concentration, indicating an overall improvement in water quality both upgradient and downgradient of the TGRS. Due to the complexity of the flow system, changes in flow direction over time, and the variation in chemical transport properties across the study area, the graphs may not reflect a uniform or easily predictable pattern. Several wells were identified in previous APRs or when reviewing the FY 2007 database that have inconsistent or upward trends in TRCLE concentrations that warrant further observation and discussion:

Well	Trend Observation
03U003	Trend identified during FY 2004 data review. Dropped from 1,000's of ppb in early 1990s to recently stable in 100's of ppb. Maintain annual sampling frequency. Recommend removal from expanded TRCLE trend review.
03U030	Trend identified during FY 2003 data review. Highest concentration in 1999, but appears to be stable since 2003. Maintain biennial sampling frequency (next event 2009). Recommend removal from expanded TRCLE trend review.
03U806, 03L806, and 04U806	Trend identified in FY 2001 APR. Dropped from 1000's of ppb in mid 1990s. Decreasing TRCLE of at least 45 percent since 2001. Maintain annual sampling frequency. Recommend removal of Wells 03U806 and 04U806 from expanded TRCLE trend review.
03U094	Trend identified during FY 2004 data review. Increased from 170 ppb in 2003 to 470 ppb in 2005, and back down to 180 ppb in 2006 and 94 ppb in 2007. Maintain annual sampling frequency.
03M806	Trend identified during FY 2003 data review. Dropped from near 900 ppb in 1987, to below 100 ppb from 1993 through 1996. Increased to 1,300 ppb, a historical high concentration, in 2003. Decreased to 910 ppb in 2006 and 520 ppb in 2007. Maintain annual sampling frequency.

Well	Trend Observation
03U708	TRCLE concentrations have decreased since 2002 from 270 ppb to 79 ppb in 2007. Recommend removal from expanded TRCLE trend review.
03U711	Trend identified in FY 2001 APR. Dropped from near 1,000 ppb in 1994, to 75 ppb in 1999, increased to 250 ppb in 2004, and has decreased to 120 ppb in 2007. Maintain annual sampling frequency.
03U710	Trend identified during FY 2004 data review. Dropped from over 3,000 ppb in late 1980s, to 100's during the 1990s, recently decreased to 61 ppb in 2006, a historical low concentration. Slight increase to 94 ppb in 2007. Maintain biennial sampling frequency (next event 2009). Recommend removal from expanded TRCLE trend review.
03L014	Trend identified during FY 2003 data review. Increased from near non-detect in late 1980s to over 800 ppb in 1999, at 150 ppb in 2007. Maintain biennial sampling frequency (next event 2009). Recommend removal from expanded TRCLE trend review.
03L809	Trend identified in FY 2001 APR. Dropped from over 3,000 ppb to 67 ppb through 1998, at 220 ppb in 2007. Maintain biennial sampling frequency (next event 2009).

Well	Trend Observation
04U861	Trend identified in FY 2001 APR. Below 10 ppb during late 1980s through 1993, increased to 200 ppb in 2005 and decreased to 150 ppb in 2006. Abandoned in 2006 (See Section 11.4). Recommend removal from expanded TRCLE review.
04U843	Trend identified in FY 2001 APR. Below 15 ppb from late 1980s through 1997, increased to between 22 ppb and 38 ppb from 1998 through 2001, dropped to below 1 ppb in 2003, and recently peaked at 60 ppb in 2005. Maintain biennial sampling frequency (next event 2009).
04U841	Trend identified in FY 2001 APR. Below 10 ppb through 1995, increased to 25 ppb in 2001, decreased to 5 ppb in 2003, and increased to 19 ppb in 2005. Maintain biennial sampling frequency (next event 2009).
03U822	Trend identified during FY 2003 data review. Below 25 ppb through 1998, peaked at 375 ppb in 1999, decreased to 160 ppb in 2005. Maintain biennial sampling frequency (next event 2009).
03L822	Trend identified in FY 2001 APR. Increased from below 5 ppb during early 1990s to over 600 ppb from 1999 through 2003. Decreased to 400 ppb in 2005. Approximately 1 mile from TGRS. Well historically showed 1,1,1-trichloroethane as major contaminant. Maintain biennial sampling frequency (next event 2009).

10.2 REMEDY COMPONENT # 2: GROUNDWATER TREATMENT

Description: "Groundwater treatment using air stripping." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):
When the air stripping treatment facility is treating water and meeting the clean up requirements in Table 1 of the OU2 ROD.

Is the remedy component being implemented?
Yes. The air stripping treatment facility has been operating since 1986.

Did the treatment system meet the treatment requirements in the OU2 ROD?
Yes. Influent and effluent water was sampled on a monthly basis during FY 2007. The influent/effluent database for FY 2007 is contained in Appendix G.2. Figure 10-6 presents a graph of influent TRCLE versus time. This graph is cumulative and includes data from before 1989, when the system consisted of only six extraction wells. The average FY 2007 influent TRCLE concentration was 239 µg/l, down from 259 µg/l in FY 2006. FY 2007 represents the fifth year since the TGRS was reconfigured to achieve greater pumping in the centers of the VOC plumes and less pumping on the edges of the plumes where VOC concentrations are much lower. The decreasing TRCLE concentration could be due in part to the system stabilizing to the new configuration and to an overall decrease in plume concentration.

Figure 10-6 also presents a graph of the effluent TRCLE concentration versus time. As indicated, the effluent was below 5 µg/l TRCLE for all sampling events in FY 2007. A review of the FY 2007 database indicates that the effluent has also remained below the treatment requirements for all other VOC compounds specified in the OU2 ROD. Comparison of influent and effluent TRCLE concentrations indicates average removal efficiency over 99.9 percent.

What was the mass of VOCs emitted into the air?

The air stripping towers remove VOCs with an efficiency of approximately 99.9 percent. Thus, the air emissions are essentially equal to the VOC mass removal rates presented in Table 10-6. Air emissions therefore averaged 6.9 pounds/day based on the VOC mass removal rates. The total VOC emissions from October 2006 through September 2007 were 2,507 pounds.

10.3 REMEDY COMPONENT #3: TREATED WATER DISCHARGE

Description: "Discharge of treated water to the on-site gravel pit." (OU2 ROD, page 3)

Performance Standard (how do you know when you're done):

When the gravel pit is accommodating the discharge from the treatment system and allowing it to recharge to the aquifer.

Is the remedy component being implemented?

Yes. Based on visual observation during FY 2007, there were no noticeable changes in Gravel Pit performance. The Gravel Pit is accommodating the TGRS discharge as designed.

10.4 REMEDY COMPONENT #4: INSTITUTIONAL CONTROLS

Description: "Institutional controls to restrict access to contaminated aquifers and prevent exposure to contaminated groundwater." (OU2 ROD, page 4)

Performance Standard (how do you know when you're done):

When a special well construction area and alternate water supply have been established and private wells in impacted areas have been sealed.

Is the remedy component being implemented?

Yes, although, the institutional controls have not been formally adopted for OU2. There are no private users of groundwater on TCAAP and the TCAAP potable water supply is treated by the TGRS prior to distribution. TCAAP is a government reservation, is fenced, and access is restricted to authorized personnel. Furthermore, although the Special Well Construction Area does not apply to the U.S. government-owned property, the Special Well Construction Area will directly apply to any TCAAP property that is transferred out of U.S. government control.

10.5 REMEDY COMPONENT #5: REVIEW OF NEW TECHNOLOGIES

Description: "Reviews of new and emerging technologies that have the potential to cost-effectively accelerate the timeframe for aquifer restoration. Reviews shall be performed by the Army and reported annually in accordance with the consistency provisions of the TCAAP FFA." (OU2 ROD, page 4)

- The intent is to consider new technologies of merit, which is not on any set schedule. To have merit, a new technology must have promise in reducing cost and the time for cleanup. There may be years where no technologies are considered. It is envisioned that at any time, any interested party (Army, USEPA, and MPCA) can suggest new technologies for consideration. At a minimum, the Technical Review Committee meetings can serve as a forum for discussion of possible technologies. If a technology is agreed to have merit by the Army, USEPA, and MPCA, then the Army will evaluate the technology. The level of effort for evaluations can range from simple literature searches to extensive treatability studies. On an annual basis, the Army will report on:

  - Whether or not any new technologies were identified and considered to have merit that year,

- The progress or results of any evaluations during that year, and
- Any planned evaluations for the following year.

Performance Standard (how do you know when you're done):

When the Army reports on the status of any reviews of emerging technologies in the annual monitoring report.

Is the remedy component being implemented?

Yes. Beginning with the FY 1997 Annual Performance Report, the Army reports annually on the status of any reviews of emerging technologies.

- In September 2002, the USEPA and MPCA announced they would be conducting a natural attenuation microcosm study using carbon dating. In October 2002, Army drilled a boring at Site G to collect soil for the study. The study results were published in 2004.
- "New technologies" is an ongoing agenda item for the monthly Technical Review Committee meetings between the Army, USEPA, and MPCA. No emerging technologies were identified through the process during FY 2007.
- The MPCA identified a study involving the addition of vegetable oil to groundwater that is being monitored at the Navy site in Fridley, Minnesota, as a potential technology of interest.

Were any new technologies identified and considered to have merit during FY 2007?

No. The Army's review did not identify any new or emerging technologies that have the potential to cost-effectively accelerate the timeframe for aquifer restoration.

What is the status and/or findings of any previously initiated reviews of emerging technologies?

MPCA continued its research into natural attenuation processes at TCAAP. The USEPA and MPCA published the results of the microcosm study for deep groundwater sediments in 2004

showing that abiotic degradation of cis-DCE is an important factor contributing to the natural attenuation of this compound at the site. (*Non-biological Removal of cis-dichloroethylene and 1,1-dichloroethylene in aquifer sediment containing magnetite.* Environmental Science and Technology, 38: 1746-1752.)

Are any new reviews planned at this time for the coming year?

No. The Army will continue to have new technologies on the agenda for the quarterly Technical Review Committee meeting, and attend conferences that highlight emerging and new technologies. However, reviews of specific technologies are not planned in FY 2008.

10.6 REMEDY COMPONENT #6: GROUNDWATER MONITORING

Description: "Groundwater monitoring to track remedy performance." (OU2 ROD, page 4)

Performance Standard (how do you know when you're done):

When a regulator approved monitoring plan is in place and monitoring is conducted according to the plan.

Is the remedy component being implemented?

Yes. Monitoring in FY 2007 was consistent with the OU2 ROD. Water level measurements and water quality samples were collected as stated in Appendix A.1. Appendix A summarizes the FY 2007 monitoring plan and any deviations are explained in Appendix C.2. Samples collected in June 2007 at wells B9 and B13 were rejected since it was discovered that the wells were not operating at the time of sampling and hence, the stagnate water sampled in the piping was not representative of the groundwater for those wells. Wells B9 and B13 were resampled in July 2007. Monitoring was as follows:

Groundwater

TGRS groundwater level measurements were collected during December 2006 and June 2007 according to the monitoring plan. Appendix D contains the comprehensive groundwater quality and water level database for the TGRS monitoring wells. Water quality samples were collected from TGRS wells according to the monitoring plan. Groundwater samples were collected at wells stated in Appendix A.1. All wells were sampled for volatile organic compound (VOC) (8260B) analysis. FY 2007 was a "big round" year in the biennial sample program, so samples were collected for the full list of wells. Table 10-8 presents the groundwater quality data for FY 2007. Figures 10-7 through 10-9 present plan views of the TRCLE plumes and Figures 10-10 and 10-11 present a cross sectional view of the plume along the TCAAP boundary.

Results from the 2007 groundwater sampling showed similar or decreasing TRCLE concentrations at most wells sampled. The decreases were most notable at 03U094 (steady decrease from 470 µg/l in 2005 to 180 µg/l in 2006 to 94 µg/l in 2007), 03M806 (decrease from 910 µg/l in 2006 to 520 µg/l in 2007), and 03U021 (500 µg/l in 2005 to 240 µg/l in 2007). Increases in TRCLE concentrations from the last sampling event were observed at wells 04J077, 03U659, 03U003, and 03L806. However, the general trend at these wells since 1999 appear to be in decline or stable.

The TGRS OS estimated the width of the 5 µg/l TRCLE plume at the source area to be 3,600 feet based on FY 2001 analytical data. Since that time, nearly 8.5 tons of VOCs have been removed from the groundwater. TRCLE concentrations are decreasing across the site, especially those at the following wells that are now below 5 µg/l since 2001: B10, 03L833, 04U833, 04U702, 04J702, 03U701, and 04U701. Monitoring well 03U672 along the southern end outside 5 µg/l TRCLE plume has decreased from 3.1 µg/l to not detectable (below 1 µg/l) in 2007.

As a result, the width of TRCLE plume is narrowing. Figure 10-12 shows FY 2007 TRCLE data with the 5 µg/l TRCLE contours for FY 2001 and FY 2007. Based on these contours, the estimated width of the source area TRCLE plume has decreased approximately 12 percent from 3,600 feet to 3,150 feet or approximately 88 percent of the FY 2001 width (2700 feet).

According to the TGRS OS, overall TGRS operating goals will be reviewed if the source area plume width shrinks to 75 percent of the FY 2001 width. At the boundary, the TRCLE plume narrowing is more pronounced having decreased approximately 20 percent from 4,600 feet to 3,600 feet. According to the TGRS OS, overall TGRS operating goals will be reviewed if the source area plume width shrinks to 75 percent of the FY 2001 width (2,700 feet).

Treatment System

The TGRS treatment system influent and effluent was sampled monthly during FY 2007 in accordance with the FY 2007 monitoring plan. Groundwater samples from the extraction wells were collected in December 2006 and June 2007 in accordance with the FY 2007 monitoring plan.

Is additional monitoring proposed prior to the next report?

No additional monitoring for FY 2008 is proposed beyond that presented in the Monitoring Plan (Appendix A) of the FY 2006 APR. Table 10-9 and Appendix A of this report provide FY 2008 monitoring requirements.

10.7 OVERALL REMEDY FOR DEEP GROUNDWATER

Did the TGRS meet the requirements of the OU2 ROD? Yes.

- Hydraulic capture in Unit 3 extends beyond the 5 µg/l TRCLE contour. This meets the VOC capture criterion in the OU2 ROD. Hydraulic capture in Unit 4 extends beyond the 5 µg/l TRCLE contour. This meets the VOC capture criterion in the OU2 ROD.
- The total extraction well water pumped was above the Total System Operational Minimum (1,745 gpm). The FY 2007 extraction well water pumped was approximately 1,799 gpm.
- The TGRS extracted and treated 945,317,300 gallons of water and removed 2,507 pounds of VOCs from October 2006 to September 2007. Average VOC influent concentrations decreased by 8.6% from FY 2006.

- Groundwater analytical data of the source area shows a general decrease in TRCLE concentration. This demonstrates that the TGRS is effectively removing VOC mass from the aquifer.
- Effluent VOC concentrations were below contaminant-specific requirements for all sampling events.

Do any additional measures need to be addressed?

Not at this time.

TABLE 10-1

GROUNDWATER CLEANUP LEVELS
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Substance	*Expected Level in Discharge (ppb)*	*Operable Unit 2 Rod Requirements (ppb)*
Volatile Organic Compounds (VOCs)		
cis-1,2-Dichloroethene plus trans-1,2-Dichloroethene	<1	70
1,1-Dichloroethene	<1	6
1,1,1-Trichloroethane	<1	200
1,2-Dichloroethane	<1	4
Trichloroethene	<5	5
1,1-Dichloroethane	<1	70
Tetrachloroethene	<1	5

TABLE 10-2

EXTRACTION WELL WATER PUMPED
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Volume of Water Pumped (gallons)													
	B1	***B3***	***B4***	***B5***	***B6***	***B8***	***B9***	***B11***	***B13***	***SC1***	***SC2***	***SC5***	***TOTAL***
October 2006	11,008,900	6,083,900	7,513,000	10,386,800	10,157,800	5,895,500	12,270,500	4,724,100	3,968,700	1,264,700	318,700	2,638,900	76,231,500
(gpm)	247	136	168	233	228	132	275	106	89	28	7	59	1,708
November 2006	10,501,000	8,124,400	6,956,200	9,644,100	9,784,600	6,048,500	12,401,100	3,216,500	3,955,000	1,234,300	582,000	5,077,400	77,525,100
(gpm)	243	188	161	223	226	140	287	74	92	29	13	118	1,795
December 2006	11,094,800	8,114,000	7,282,800	10,303,100	10,410,100	6,454,700	12,372,100	4,705,300	4,283,800	1,303,200	1,488,600	5,051,200	82,863,700
(gpm)	249	182	163	231	233	145	277	105	96	29	33	113	1,856
January 2007	10,555,500	8,123,700	6,751,100	10,163,900	9,948,100	6,124,300	13,062,000	4,775,200	3,986,900	1,279,100	1,609,900	4,422,560	80,802,260
(gpm)	236	182	151	228	223	137	293	107	89	29	36	99	1,810
February 2007	8,566,400	7,283,600	7,501,800	8,382,400	8,990,500	5,605,700	11,536,200	4,475,700	3,667,300	1,189,800	1,394,300	4,380,880	72,974,580
(gpm)	212	181	186	208	223	139	286	111	91	30	35	109	1,810
March 2007	9,058,700	7,571,100	9,415,700	9,426,700	10,120,800	6,254,100	12,983,700	4,891,300	4,081,500	1,292,600	1,649,600	4,733,890	81,479,690
(gpm)	203	170	211	211	227	140	291	110	91	29	37	106	1,825
April 2007	9,173,000	7,617,700	8,867,800	9,052,600	9,755,800	5,994,300	12,473,800	5,099,800	4,765,000	859,700	1,440,900	4,137,600	79,238,000
(gpm)	212	176	205	210	226	139	289	118	110	20	33	96	1,834
May 2007	9,688,200	7,746,900	8,890,800	9,221,000	9,915,600	5,968,300	12,160,900	5,474,800	4,822,700	1,285,000	1,616,300	4,549,450	81,339,950
(gpm)	217	174	199	207	222	134	272	123	108	29	36	102	1,822
June 2007	9,185,100	7,523,000	8,191,300	9,159,300	9,870,800	5,289,800	11,587,100	5,278,100	4,133,000	1,214,000	1,188,700	4,423,400	77,043,600
(gpm)	213	174	190	212	228	122	268	122	96	28	28	102	1,783
July 2007	9,113,400	7,970,000	8,903,100	9,293,100	9,802,500	5,901,200	12,637,800	5,248,700	4,673,200	1,219,200	1,048,600	4,593,120	80,403,920
(gpm)	204	179	199	208	220	132	283	118	105	27	23	103	1,801
August 2007	9,268,200	7,680,600	9,049,200	9,434,800	10,000,200	5,601,800	12,098,100	5,235,400	4,948,000	1,226,100	1,044,100	4,854,200	80,440,700
(gpm)	208	172	203	211	224	125	271	117	111	27	23	109	1,802
September 2007	6,510,700	7,681,600	9,251,200	8,873,100	8,689,200	5,264,200	12,070,400	4,726,100	4,959,000	1,142,200	989,500	4,817,100	74,974,300
(gpm)	151	178	214	205	201	122	279	109	115	26	23	112	1,736
TOTAL FY 2007	**113,723,900**	**91,520,500**	**98,574,000**	**113,340,900**	**117,446,000**	**70,402,400**	**147,653,700**	**57,851,000**	**52,244,100**	**14,509,900**	**14,371,200**	**53,679,700**	**945,317,300**
Operational Minimum	225	170	195	195	210	135	275	80	110	20	30	100	1,745

	B11, B1, B13	B4, B5, B6	B4, B5, B6, B8, B9	Total System
FY07 Average Flow Rate (gpm)	426	627	1042	1,799
MOS Operational Minimum (gpm)	415	600	1,010	1,745

TABLE 10-3

TREATMENT CENTER WATER METER TOTALS
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Volume of Water Pumped (gallons)										
	Extraction Wells	*Meter 1*	*Meter 2*	*Total Meters 1 & 2*	*Meter 3*	*Meter 4*	*Total Meters 3 & 4*	*Meter 5*	*Meter 6*	*Total Meters 5 & 6*
October 2006	76,231,500	41,032,000	34,191,000	75,223,000	20,804,000	58,025,000	78,829,000	0	0	0
November 2006	77,525,100	38,850,000	37,985,000	76,835,000	23,166,000	60,595,000	83,761,000	0	0	0
December 2006	82,863,700	39,565,000	41,822,000	81,387,000	24,031,000	64,398,000	88,429,000	0	0	0
January 2007	80,802,260	39,299,000	40,380,000	79,679,000	27,237,000	59,116,000	86,353,000	0	0	0
February 2007	72,974,580	36,311,000	36,863,000	73,174,000	21,549,000	58,914,000	80,463,000	0	0	0
March 2007	81,479,690	40,086,000	41,082,000	81,168,000	23,021,000	66,297,000	89,318,000	0	0	0
April 2007	79,238,000	39,235,000	39,539,000	78,774,000	20,371,000	61,621,000	81,992,000	0	0	0
May 2007	81,339,950	40,599,000	39,714,000	80,313,000	23,380,000	60,343,000	83,723,000	0	0	0
June 2007	77,043,600	35,395,000	40,509,000	75,904,000	22,614,000	175,563,000	198,177,000	0	0	0
July 2007	80,403,920	30,437,000	48,353,000	78,790,000	24,043,000	58,088,000	82,131,000	0	0	0
August 2007	80,440,700	34,573,000	44,522,000	79,095,000	27,486,000	55,452,000	82,938,000	0	0	0
September 2007	74,974,300	32,519,000	42,741,000	75,260,000	23,359,000	54,749,000	78,108,000	0	0	0
TOTAL FY 2007	945,317,300	447,901,000	487,701,000	935,602,000	281,061,000	833,161,000	1,114,222,000	0	0	0
FY89	1,033,353,676	501,826,000	560,836,000	1,062,662,000	383,736,000	587,596,000	971,332,000	493,681,000	582,955,000	1,076,636,000
FY90	1,008,415,750	493,915,000	526,417,000	1,020,332,000	371,391,000	588,642,000	960,033,000	487,946,000	543,726,000	1,031,672,000
FY91	1,382,327,590	666,166,000	708,313,000	1,374,479,000	523,702,000	789,947,000	1,313,649,000	601,307,000	649,621,000	1,250,928,000
FY92	1,401,346,600	68,289,000	724,328,000	1,407,227,000	557,169,000	772,509,000	1,329,678,000	767,707,000	677,735,000	1,445,442,000
FY93	1,388,206,172	666,814,000	725,341,000	1,392,155,000	504,027,000	651,149,000	1,155,176,000	729,078,000	762,791,000	1,491,869,000
FY94	1,245,663,275	660,700,000	659,953,000	1,320,653,000	457,210,000	715,668,000	1,172,878,000	653,913,000	550,131,000	1,204,044,000
FY95	1,369,361,500	706,114,000	683,982,000	1,390,096,000	500,275,000	739,744,000	1,240,019,000	495,616,000	274,507,000	770,123,000
FY96	1,341,763,220	734,443,000	629,327,000	1,363,770,000	503,518,000	754,399,000	1,257,917,000	4,000	600,035,000	600,039,000
FY97	1,213,035,110	688,312,000	568,804,600	1,257,116,600	538,625,000	586,515,000	1,125,140,000	13,000	578,900,000	578,913,000
FY98	1,196,007,900	624,784,000	540,353,000	1,220,604,000	511,065,000	603,871,000	1,114,936,000	58,000	178,076,000	178,134,000
FY99	1,158,224,870	623,500,000	496,773,200	1,177,206,200	398,620,000	718,384,000	1,117,004,000	26,000	17,000	43,000
FY 2000	1,148,448,350	635,724,000	489,669,000	1,183,258,000	389,709,000	663,807,000	1,053,516,000	0	0	0
FY 2001	1,113,163,360	614,341,000	443,167,000	1,113,164,000	318,517,000	718,661,000	1,037,178,000	0	0	0
FY 2002	917,318,879	491,082,800	434,959,700	926,042,500	225,460,000	650,839,000	876,299,000	0	0	0
FY 2003	904,295,450	545,281,000	345,993,000	891,274,000	125,965,000	750,518,000	876,483,000	0	0	0
FY 2004	908,718,760	518,391,900	376,889,660	895,281,560	216,177,000	680,633,000	896,810,000	0	0	0
FY 2005	895,339,710	520,073,000	363,275,000	883,348,000	224,823,000	658,405,000	883,228,000	0	0	0
FY 2006	929,715,590	534,305,000	377,499,000	911,804,000	266,299,000	669,900,000	936,199,000	0	0	0
FY 2007	945,317,300	447,901,000	487,701,000	935,602,000	281,061,000	833,161,000	1,114,222,000	0	0	0

TABLE 10-4

PUMPHOUSE DOWN TIME (DAYS)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Well Name	*FY07 Down Time (Days)*	*FY06 Down Time (Days)*	*FY05 Down Time (Days)*	*FY04 Down Time (Days)*	*FY03 Down Time (Days)*	*FY02 Down Time (Days)*
B1	10.6	6.9	11.5	7.1	46	22.4
B2	(1)	(1)	(1)	(1)	1	63.2
B3	6.4	23.5	34.0	11.3	26	117.9
B4	6.0	10.4	26.2	7.6	21	11.8
B5	1.3	27.1	13.9	7.6	29	9.4
B6	2.2	11.9	15.6	15.4	19	10.8
B7	(1)	(1)	(1)	(1)	(1)	109.4
B8	8.6	34.6	18.5	10.0	18	107.6
B9	10.2	20.8	23.1	8.4	15	51.3
B10	(1)	(1)	(1)	(1)	(1)	109.9
B11	12.4	24.9	22.7	15.5	23	90.8
B12	(1)	(1)	(1)	(1)	(1)	(1)
B13	6.2	14.1	13.7	12.8	19	(1)
SC1	8.9	13.4	21.8	17.8	29	35.9
SC2	21.8	17.5	13.9	11.4	27	107.7
SC3	(1)	(1)	(1)	(1)	(1)	108.1
SC4	(1)	(1)	(1)	(1)	(1)	(1)
SC5	18.5	37.1	11.9	24.8	18	5.9

Note:
(1) The extraction well was not in operation during the fiscal year.

TABLE 10-5

DOWN TIME (DAYS) BY CATEGORY
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Category	*Down Time (Days)*
Pumphouse Component	5.7
Treatment Center Component	0.3
Electrical Service	1.4
Miscellaneous	0.7
Preventive Maintenance	1.0
System Modification	0.2
Forcemain	0.1
Total System Equivalent	9.4

Anticipated Down Time for Fiscal Year 2008

Pumphouse Component	3.5
Treatment Center Component	3.0
Electrical Service	1.0
Miscellaneous	0.1
Preventive Maintenance	3.5
System Modification	1.0
Forcemain	2.0

TABLE 10-6

VOC MASS LOADING SUMMARY
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Well	*Percent Contribution to VOC Mass Removal*	*FY 2007 Total Pounds VOCs Mass Removed*
B1	4.7%	117.4
B2	0.0%	0.0
B3	0.3%	8.0
B4	7.5%	188.2
B5	7.8%	195.8
B6	4.2%	105.7
B7	0.0%	0.0
B8	0.6%	15.8
B9	7.0%	175.2
B10	0.0%	0.0
B11	0.0%	1.1
B12	0.0%	0.0
B13	2.7%	67.2
SC1	4.0%	99.2
SC2	0.3%	7.8
SC3	0.0%	0.0
SC4	0.0%	0.0
SC5	60.9%	1,526
Fiscal Year 2007 Total (lbs)		***2,507***
Daily Average (lbs/day)		***6.9***

HISTORICAL TOTAL

Fiscal Year		*Pounds VOC Mass Removed*
2007		2,507
2006		2,552
2005		2,663
2004		3,291
2003		3,041
2002		2,852
2001		3,418
2000		4,499
1999		4,878
1998		6,132
1997		6,210
1996		10,655
1995		13,355
1994		15,070
1993		20,165
1992		24,527
1991		26,760
1990		18,005
1989	(First year of full scale system)	19,510
1988		4,800
1987		2,100
Total		***196,990***

TABLE 10-7

VOC CONCENTRATIONS IN TGRS EXTRACTION WELLS (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Alias	Date	Dup	1,1,1-Trichloroethane µg/L	1,1,2-Trichloroethane µg/L	1,1-Dichloroethane µg/L	1,1-Dichloroethene µg/L	1,2-Dichloroethane µg/L	Carbon Tetrachloride µg/L	Chloroform µg/L
03F302	B1	12/4/06		7	0.37 JP	1.3	2	< 1	< 1	< 1
03F302	B1	6/4/07		7.7	0.35 JP	1.3	1.6	< 1	< 1	< 1
03F303	B2	6/5/07		< 1	2.2	0.71 JP	1.4	< 1	< 1	< 1
03F304	B3	12/4/06		1.2	< 1	1.1	1.6	< 1	< 1	< 1
03F304	B3	6/4/07		1.1	< 1	1	1	< 1	< 1	< 1
03F305	B4	12/4/06		21	< 1	12	13 E	< 1	< 1	< 1
03F305	B4	12/4/06	D	21	< 1	12	13 E	< 1	< 1	< 1
03F305	B4	6/4/07		22	< 1	13	12 E	< 1	< 1	< 1
03F306	B5	12/4/06		10	< 1	6	6.8 E	< 1	< 1	< 1
03F306	B5	6/4/07		9.1	< 1	5.7	5.4	< 1	< 1	< 1
03F307	B6	12/4/06		2.4	< 1	3	3.7	< 1	< 1	< 1
03F307	B6	6/4/07		2.2	< 1	2.5	2.8	< 1	< 1	< 1
03F308	B7	6/4/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1
03F312	B11	12/4/06		< 1	< 1	< 1	< 1	< 1	< 1	< 1
03F312	B11	6/4/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1
03F319	B13	12/4/06		4.5	< 1	1.3	1.4	< 1	< 1	< 1
03F319	B13	7/3/07		3.7	< 1	1.3	1.2	< 1	< 1	< 1
03U301	SC1	12/4/06		14	< 2	1.3 JP	2.8	< 2	< 2	0.43 JP
03U301	SC1	6/4/07		10	< 2	0.94 JP	1.4 JP	< 2	< 2	< 2

TABLE 10-7

VOC CONCENTRATIONS IN TGRS EXTRACTION WELLS (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	*Alias*	*Date*	*Dup*	*1,1,1-Trichloroethane µg/L*	*1,1,2-Trichloroethane µg/L*	*1,1-Dichloroethane µg/L*	*1,1-Dichloroethene µg/L*	*1,2-Dichloroethane µg/L*	*Carbon Tetrachloride µg/L*	*Chloroform µg/L*
03U314	SC2	12/4/06		8.3	< 1	1.4	1.7	< 1	< 1	< 1
03U314	SC2	6/4/07		12	< 1	1.2	1.5	< 1	< 1	< 1
03U315	SC3	6/4/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1
03U316	SC4	6/4/07		0.41 JP	< 1	< 1	< 1	< 1	< 1	0.58 JP
03U317	SC5	12/4/06		870 E	< 10	19	34 E	< 10	< 10	< 10
03U317	SC5	6/4/07		870 E	< 10	17	28 E	< 10	< 10	< 10
03U317	SC5	6/4/07	D	840 E	< 10	17	28 E	< 10	< 10	< 10
PJ#309	B8	12/4/06		2.2	< 1	1.1	1.6	< 1	< 1	< 1
PJ#309	B8	6/4/07		2.3	< 1	1.1	1.3	< 1	< 1	< 1
PJ#310	B9	12/4/06		17	< 1	7.8	10 E	< 1	< 1	< 1
PJ#310	B9	7/3/07		11	< 1	6.9	7.2 E	< 1	< 1	< 1
PJ#310	B9	7/3/07	D	11	< 1	7	7.3 E	< 1	< 1	< 1
PJ#311	B10	6/4/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1
PJ#313	B12	6/4/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1

TABLE 10-7

VOC CONCENTRATIONS IN TGRS EXTRACTION WELLS (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Alias	Date	Dup	*cis-1,2-Dichloroethene µg/L*		*Freon 113 µg/L*		*Methylene Chloride µg/L*		*Tetrachloroethene µg/L*		*trans-1,2-Dichloroethene µg/L*		*Trichloroethene µg/L*		*Vinyl Chloride µg/L*	
03F302	B1	12/4/06		5.7		< 1		< 1		2.6		< 1		98	E	< 1	
03F302	B1	6/4/07		5.7		< 1		< 1		2.5		< 1		110	E	< 1	
03F303	B2	6/5/07		1.6		< 1		< 1		0.88	JP	< 1		25	E	< 1	
03F304	B3	12/4/06		0.34	JP	< 1		< 1		< 1		< 1		6.8	E	< 1	
03F304	B3	6/4/07		0.26	JP	< 1		< 1		< 1		< 1		6.5	E	< 1	
03F305	B4	12/4/06		5.6		< 1		< 1		< 1		< 1		180	E	< 1	
03F305	B4	12/4/06	D	5.5		< 1		< 1		< 1		< 1		180	E	< 1	
03F305	B4	6/4/07		5.8		< 1		< 1		< 1		< 1		170	E	< 1	
03F306	B5	12/4/06		1.1		< 1		< 1		8	E	< 1		180	E	< 1	
03F306	B5	6/4/07		1		< 1		< 1		7	E	< 1		170	E	< 1	
03F307	B6	12/4/06		0.68	JP	< 1		< 1		< 1		< 1		100	E	< 1	
03F307	B6	6/4/07		0.55	JP	< 1		< 1		< 1		< 1		96	E	< 1	
03F308	B7	6/4/07		< 1		< 1		< 1		< 1		< 1		2.3		< 1	
03F312	B11	12/4/06		< 1		< 1		< 1		< 1		< 1		2.1		< 1	
03F312	B11	6/4/07		< 1		< 1		< 1		< 1		< 1		2.4		< 1	
03F319	B13	12/4/06		6.6		< 1		< 1		0.88	JP	< 1		150	E	< 1	
03F319	B13	7/3/07		6		< 1		< 1		0.84	JP	< 1		130	E	< 1	
03U301	SC1	12/4/06		64		< 2		< 2		0.45	JP	< 2		720	E	< 2	
03U301	SC1	6/4/07		61		< 2		< 2		< 2		< 2		750	E	< 2	

TABLE 10-7

VOC CONCENTRATIONS IN TGRS EXTRACTION WELLS (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Alias	Date	Dup	*cis-1,2-Dichloroethene µg/L*		*Freon 113 µg/L*		*Methylene Chloride µg/L*		*Tetrachloroethene µg/L*		*trans-1,2-Dichloroethene µg/L*		*Trichloroethene µg/L*		*Vinyl Chloride µg/L*	
03U314	SC2	12/4/06		0.55	JP	< 1		< 1		< 1		< 1		50	E	< 1	
03U314	SC2	6/4/07		0.45	JP	< 1		< 1		< 1		< 1		52	E	< 1	
03U315	SC3	6/4/07		< 1		< 1		< 1		< 1		< 1		0.81	JP	< 1	
03U316	SC4	6/4/07		< 1		< 1		< 1		< 1		< 1		5.5	E	< 1	
03U317	SC5	12/4/06		< 10		12		< 10		7	JPE	< 10		2500	E	< 10	
03U317	SC5	6/4/07		< 10		10		< 10		5	JPE	< 10		2400	E	< 10	
03U317	SC5	6/4/07	D	< 10		9.6	JP	< 10		5.5	JPE	< 10		2400	E	< 10	
PJ#309	B8	12/4/06		0.42	JP	< 1		< 1		< 1		< 1		21	E	< 1	
PJ#309	B8	6/4/07		0.38	JP	< 1		< 1		< 1		< 1		22	E	< 1	
PJ#310	B9	12/4/06		2.6		< 1		< 1		< 1		< 1		120	E	< 1	
PJ#310	B9	7/3/07		2.5		< 1		< 1		< 1		< 1		97	E	< 1	
PJ#310	B9	7/3/07	D	2.5		< 1		< 1		< 1		< 1		96	E	< 1	
PJ#311	B10	6/4/07		< 1		< 1		< 1		< 1		< 1		0.52	JP	< 1	
PJ#313	B12	6/4/07		< 1		< 1		< 1		< 1		< 1		< 1		< 1	

Notes:
D - Duplicate analysis
JP - Results less than reporting level but greater than instrument detection limit.
E - Exceedence of the cleanup level

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

			1,1,1-Trichloroethane		*1,1,2-Trichloroethane*		*1,1-Dichloroethane*		*1,1-Dichloroethene*	
TGRS Cleanup Level [1]			*200*				*70*		*6*	
			µg/L		*µg/L*		*µg/L*		*µg/L*	
Location	*Date*	*Dup*								
03L002	6/13/07		2.5		< 1		0.68	JP	1.3	
03L007	6/18/07		< 1		< 1		< 1		< 1	
03L014	6/18/07		52		< 1		3.8		2.5	
03L017	6/15/07		< 1		< 1		< 1		< 1	
03L018	6/19/07		< 1		< 1		< 1		< 1	
03L020	6/7/07		0.98	JPJL126	< 1		< 1		0.26	JP
03L021	6/13/07		< 1		< 1		< 1		< 1	
03L077	6/12/07		3.5		< 1		< 1		1	
03L078	6/13/07		0.5	JP	< 1		< 1		< 1	
03L079	6/13/07		< 1		< 1		< 1		< 1	
03L084	6/15/07		< 1		< 1		< 1		< 1	
03L802	6/14/07		< 1		< 1		< 1		< 1	
03L806	6/12/07		3.6		0.71	JP	41		31	
03L809	6/20/07		4.4		< 1		24		15	
03L833	6/14/07		< 1		< 1		< 1		< 1	

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

			1,1,1-Trichloroethane		1,1,2-Trichloroethane		1,1-Dichloroethane		1,1-Dichloroethene	
TGRS Cleanup Level [1]			*200 µg/L*		*µg/L*		*70 µg/L*		*6 µg/L*	
Location	*Date*	*Dup*								
03M002	6/13/07		1.5		< 1		7.3		4.2	
03M020	6/8/07		4.7	JL126	< 1		1.2		0.85	JP
03M802	6/14/07		< 1		< 1		< 1		< 1	
03M806	6/12/07		< 2		< 2		92		42	
03M806	6/12/07	D	< 2		< 2		93		38	
03U002	6/14/07		3.8		< 1		1.9		1.9	
03U003	6/15/07		22		< 1		3.5		5.5	
03U004	6/14/07		< 1		< 1		< 1		< 1	
03U005	6/18/07		< 1		< 1		0.37	JP	< 1	
03U005	6/18/07	D	< 1		< 1		0.36	JP	< 1	
03U007	6/18/07		< 1		< 1		< 1		< 1	
03U009	6/20/07		< 1		< 1		< 1		< 1	
03U014	6/19/07		< 1		< 1		< 1		< 1	
03U017	6/15/07		0.45	JP	< 1		< 1		< 1	
03U018	6/19/07		7.9		< 1		0.43	JP	0.96	JP
03U020	6/7/07		29	JL126	< 1		1.1		3.8	

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

			1,1,1-Trichloroethane		1,1,2-Trichloroethane		1,1-Dichloroethane		1,1-Dichloroethene	
TGRS Cleanup Level [1]			*200 µg/L*		*µg/L*		*70 µg/L*		*6 µg/L*	
Location	*Date*	*Dup*								
03U021	6/13/07		47		< 1		5.4		7.9	
03U027	6/13/07		1.4		1.7		< 1		< 1	
03U027	6/13/07	D	1.3		1.6		< 1		0.23	JP
03U028	6/8/07		3.1	JL126	< 1		< 1		0.65	JP
03U029	6/8/07		0.77	JPJL126	< 1		< 1		< 1	
03U030	6/8/07		0.31	JPJL126	< 1		< 1		< 1	
03U032	6/19/07		< 1		< 1		< 1		< 1	
03U075	6/15/07		< 1		< 1		< 1		< 1	
03U075	6/15/07	D	< 1		< 1		< 1		< 1	
03U077	6/12/07		1.2		< 1		< 1		< 1	
03U078	6/13/07		2.4		1.3		< 1		0.79	JP
03U079	6/13/07		14		< 1		0.57	JP	1.5	
03U092	6/14/07		0.93	JP	< 1		< 1		< 1	
03U093	6/19/07		51		< 1		0.21	JP	3.5	
03U094	6/19/07		28		< 1		2.2		3.5	
03U096	6/19/07		3.1		< 1		1.7		1.1	

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

TGRS Cleanup Level [1]			*1,1,1-Trichloroethane* 200 µg/L		*1,1,2-Trichloroethane* µg/L		*1,1-Dichloroethane* 70 µg/L		*1,1-Dichloroethene* 6 µg/L	
Location	*Date*	*Dup*								
03U099	6/20/07		2.2		< 1		< 1		0.18	JP
03U114	6/14/07		0.69	JP	< 1		< 1		< 1	
03U659	6/15/07		9.1		< 1		1.7		2.1	
03U671	6/8/07		8.7	JL126	< 1		1.3		2.2	
03U672	6/18/07		< 1		< 1		< 1		< 1	
03U701	6/11/07		< 1		< 1		< 1		< 1	
03U702	6/11/07		< 1		< 1		< 1		< 1	
03U703	6/8/07		3.2	JL126	< 1		< 1		0.48	JP
03U708	6/6/07		17	JL126	< 1		2.9		4.9	
03U709	6/8/07		8.4	JL126	< 1		2.3		2.4	
03U710	6/14/07		12		< 1		0.86	JP	2	
03U711	6/14/07		19		< 1		5.5		6.5	
03U715	6/19/07		16		< 1		1		2.2	
03U801	6/11/07		< 1		< 1		< 1		< 1	
03U803	6/14/07		< 1		< 1		< 1		< 1	

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

TGRS Cleanup Level [1]			*1,1,1-Trichloroethane* 200 µg/L		*1,1,2-Trichloroethane* µg/L		*1,1-Dichloroethane* 70 µg/L		*1,1-Dichloroethene* 6 µg/L	
Location	***Date***	***Dup***								
03U804	6/11/07		< 1		< 1		< 1		< 1	
03U805	6/20/07		< 1		< 1		4.6		0.49	JP
03U805	6/20/07	D	< 1		< 1		4.7		0.5	JP
03U806	6/12/07		< 1		< 1		2.1		1.2	
04J077	6/12/07		21		< 1		25		20	
04J702	6/11/07		< 1		< 1		< 1		< 1	
04J708	6/6/07		0.61	JPJL126	< 1		0.51	JP	0.22	JP
04J713	6/11/07		< 1		< 1		< 1		< 1	
04J713	6/11/07	D	< 1		< 1		< 1		< 1	
04U002	6/13/07		< 1		< 1		< 1		< 1	
04U007	6/18/07		< 1		< 1		< 1		< 1	
04U020	6/7/07		< 1		< 1		< 1		< 1	
04U027	6/13/07		< 1		< 1		< 1		< 1	
04U077	6/12/07		8.7		< 1		2		2.6	
04U510	6/20/07		< 1		< 1		< 1		< 1	
04U510	6/20/07	D	< 1		< 1		< 1		< 1	
04U701	6/11/07		< 1		< 1		< 1		< 1	

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

	TGRS Cleanup Level [1]			*1,1,1-Trichloroethane*			*1,1,2-Trichloroethane*			*1,1-Dichloroethane*			*1,1-Dichloroethene*		
				200						*70*			*6*		
				µg/L			*µg/L*			*µg/L*			*µg/L*		
Location	*Date*	*Dup*													
04U702	6/11/07		<	1			<	1		<	1		<	1	
04U708	6/6/07		<	1			<	1		<	1		<	1	
04U709	6/8/07			0.65	JPJL126JS153/139		<	1			0.35	JP		0.27	JP
04U711	6/14/07		<	1			<	1		<	1		<	1	
04U713	6/11/07		<	1			<	1		<	1		<	1	
04U802	6/14/07		<	1			<	1		<	1		<	1	
04U806	6/12/07			3.5			<	1			23			14	
04U833	6/14/07		<	1			<	1		<	1		<	1	
04U833	6/14/07	D	<	1			<	1		<	1		<	1	
PJ#806	6/12/07			0.6	JP		<	1			1.9			1.2	

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date	Dup	TGRS Cleanup Level [1]	1,2-Dichloroethane	Carbon Tetrachloride	Chloroform	cis-1,2-Dichloroethene	Freon 113	Methylene Chloride
				4			70		
				µg/L	µg/L	µg/L	µg/L	µg/L	µg/L
03L002	6/13/07			< 1	< 1	< 1	< 1	< 1	< 1
03L007	6/18/07			< 1	< 1	< 1	< 1	< 1	< 1
03L014	6/18/07			< 1	< 1	< 1	1.1	< 1	< 1
03L017	6/15/07			< 1	< 1	< 1	< 1	< 1	< 1
03L018	6/19/07			< 1	< 1	< 1	< 1	< 1	< 1
03L020	6/7/07			< 1	< 1	< 1	< 1	< 1	< 1
03L021	6/13/07			< 1	< 1	< 1	< 1	< 1	< 1
03L077	6/12/07			< 1	< 1	< 1	< 1	< 1	< 1
03L078	6/13/07			< 1	< 1	< 1	< 1	< 1	< 1
03L079	6/13/07			< 1	< 1	< 1	< 1	< 1	< 1
03L084	6/15/07			< 1	< 1	< 1	< 1	< 1	< 1
03L802	6/14/07			< 1	< 1	< 1	< 1	< 1	< 1
03L806	6/12/07			< 1	< 1	< 1	3.6	< 1	< 1
03L809	6/20/07			< 1	< 1	< 1	1.8	< 1	< 1
03L833	6/14/07			< 1	< 1	< 1	< 1	< 1	< 1

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date	Dup	1,2-Dichloroethane	Carbon Tetrachloride	Chloroform	cis-1,2-Dichloroethene	Freon 113	Methylene Chloride
TGRS Cleanup Level [1]			*4*			*70*		
			µg/L	*µg/L*	*µg/L*	*µg/L*	*µg/L*	*µg/L*
03M002	6/13/07		< 1	< 1	< 1	0.89 JP	< 1	< 1
03M020	6/8/07		< 1	< 1	< 1	0.34 JP	< 1	< 1
03M802	6/14/07		< 1	< 1	< 1	< 1	< 1	< 1
03M806	6/12/07		< 2	< 2	< 2	5.3	< 2	< 2
03M806	6/12/07	D	< 2	< 2	< 2	5.2	< 2	< 2
03U002	6/14/07		< 1	< 1	0.43 JP	0.35 JP	< 1	< 1
03U003	6/15/07		< 1	< 1	0.39 JP	10	< 1	< 1
03U004	6/14/07		< 1	< 1	< 1	< 1	< 1	< 1
03U005	6/18/07		< 1	< 1	< 1	0.51 JP	< 1	< 1
03U005	6/18/07	D	< 1	< 1	< 1	0.59 JP	< 1	< 1
03U007	6/18/07		< 1	< 1	< 1	< 1	< 1	< 1
03U009	6/20/07		< 1	< 1	< 1	< 1	< 1	< 1
03U014	6/19/07		< 1	< 1	< 1	< 1	< 1	< 1
03U017	6/15/07		< 1	< 1	< 1	< 1	< 1	< 1
03U018	6/19/07		< 1	< 1	0.79 JP	9.4	< 1	< 1
03U020	6/7/07		< 1	< 1	1.8	0.64 JP	< 1	< 1

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date	Dup		*1,2-Dichloroethane*	*Carbon Tetrachloride*	*Chloroform*	*cis-1,2-Dichloroethene*	*Freon 113*	*Methylene Chloride*
TGRS Cleanup Level [1]				*4*			*70*		
				µg/L	*µg/L*	*µg/L*	*µg/L*	*µg/L*	*µg/L*
03U021	6/13/07			< 1	< 1	0.33 JP	3.5	< 1	< 1
03U027	6/13/07			< 1	< 1	< 1	1.4	< 1	< 1
03U027	6/13/07	D		< 1	< 1	< 1	1.3	< 1	< 1
03U028	6/8/07			< 1	< 1	< 1	4.2	< 1	< 1
03U029	6/8/07			< 1	< 1	< 1	< 1	< 1	< 1
03U030	6/8/07			< 1	< 1	0.81 JP	3.8	< 1	< 1
03U032	6/19/07			< 1	< 1	< 1	< 1	< 1	< 1
03U075	6/15/07			< 1	< 1	< 1	< 1	< 1	< 1
03U075	6/15/07	D		< 1	< 1	< 1	< 1	< 1	< 1
03U077	6/12/07			< 1	< 1	< 1	< 1	< 1	< 1
03U078	6/13/07			< 1	< 1	0.3 JP	0.93 JP	< 1	< 1
03U079	6/13/07			< 1	< 1	< 1	2.1	< 1	< 1
03U092	6/14/07			< 1	< 1	8.9	4.5	< 1	< 1
03U093	6/19/07			< 1	< 1	< 1	1.5	< 1	< 1
03U094	6/19/07			< 1	< 1	0.22 JP	1.3	< 1	< 1
03U096	6/19/07			< 1	< 1	< 1	< 1	< 1	< 1

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date	Dup	TGRS Cleanup Level [1]	1,2-Dichloroethane	Carbon Tetrachloride	Chloroform	cis-1,2-Dichloroethene	Freon 113	Methylene Chloride
				4			70		
				µg/L	µg/L	µg/L	µg/L	µg/L	µg/L
03U099	6/20/07			< 1	< 1	< 1	< 1	< 1	< 1
03U114	6/14/07			< 1	< 1	0.55 JP	< 1	< 1	< 1
03U659	6/15/07			< 1	< 1	< 1	42	< 1	< 1
03U671	6/8/07			< 1	< 1	0.28 JP	0.59 JP	< 1	< 1
03U672	6/18/07			< 1	< 1	< 1	< 1	< 1	< 1
03U701	6/11/07			< 1	< 1	< 1	< 1	< 1	< 1
03U702	6/11/07			< 1	< 1	< 1	< 1	< 1	< 1
03U703	6/8/07			< 1	< 1	0.99 JP	3.5	< 1	< 1
03U708	6/6/07			< 1	< 1	1.4	1.3	< 1	< 1
03U709	6/8/07			< 1	< 1	1.2	0.56 JP	< 1	< 1
03U710	6/14/07			< 1	< 1	0.19 JP	3	< 1	< 1
03U711	6/14/07			< 1	< 1	0.28 JP	1.9	< 1	< 1
03U715	6/19/07			< 1	< 1	2.5	< 1	< 1	< 1
03U801	6/11/07			< 1	< 1	< 1	< 1	< 1	< 1
03U803	6/14/07			< 1	< 1	< 1	< 1	< 1	< 1

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date	Dup	1,2-Dichloroethane	Carbon Tetrachloride	Chloroform	cis-1,2-Dichloroethene	Freon 113	Methylene Chloride
TGRS Cleanup Level [1]			*4*			*70*		
			µg/L	*µg/L*	*µg/L*	*µg/L*	*µg/L*	*µg/L*
03U804	6/11/07		< 1	< 1	< 1	< 1	< 1	< 1
03U805	6/20/07		< 1	< 1	< 1	< 1	< 1	< 1
03U805	6/20/07	D	< 1	< 1	< 1	< 1	< 1	< 1
03U806	6/12/07		< 1	< 1	< 1	< 1	< 1	< 1
04J077	6/12/07		< 1	< 1	< 1	8.8	< 1	< 1
04J702	6/11/07		< 1	< 1	< 1	< 1	< 1	< 1
04J708	6/6/07		< 1	< 1	< 1	< 1	< 1	< 1
04J713	6/11/07		< 1	< 1	1.2	< 1	< 1	< 1
04J713	6/11/07	D	< 1	< 1	1.1	< 1	< 1	< 1
04U002	6/13/07		< 1	< 1	< 1	< 1	< 1	< 1
04U007	6/18/07		< 1	< 1	< 1	< 1	< 1	< 1
04U020	6/7/07		< 1	< 1	< 1	< 1	< 1	< 1
04U027	6/13/07		< 1	< 1	< 1	< 1	< 1	< 1
04U077	6/12/07		< 1	< 1	< 1	0.39 JP	< 1	< 1
04U510	6/20/07		< 1	< 1	< 1	< 1	< 1	< 1
04U510	6/20/07	D	< 1	< 1	< 1	< 1	< 1	< 1
04U701	6/11/07		< 1	< 1	< 1	< 1	< 1	< 1

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date	Dup	1,2-Dichloroethane	Carbon Tetrachloride	Chloroform	cis-1,2-Dichloroethene	Freon 113	Methylene Chloride
TGRS Cleanup Level [1]			*4*			*70*		
			µg/L	*µg/L*	*µg/L*	*µg/L*	*µg/L*	*µg/L*
04U702	6/11/07		< 1	< 1	< 1	< 1	< 1	< 1
04U708	6/6/07		< 1	< 1	< 1	< 1	< 1	< 1
04U709	6/8/07		< 1	< 1	< 1	< 1	< 1	< 1
04U711	6/14/07		< 1	< 1	< 1	< 1	< 1	< 1
04U713	6/11/07		< 1	< 1	< 1	< 1	< 1	< 1
04U802	6/14/07		< 1	< 1	< 1	< 1	< 1	< 1
04U806	6/12/07		< 1	< 1	< 1	1.4	< 1	< 1
04U833	6/14/07		< 1	< 1	< 1	< 1	< 1	< 1
04U833	6/14/07	D	< 1	< 1	< 1	< 1	< 1	< 1
PJ#806	6/12/07		< 1	< 1	< 1	< 1	< 1	< 1

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

			Tetrachloroethene		trans-1,2-Dichloroethene		Trichloroethene		Vinyl Chloride	
TGRS Cleanup Level [1]			5 µg/L		µg/L		5 µg/L		µg/L	
Location	*Date*	*Dup*								
03L002	6/13/07		< 1		< 1		26		< 1	
03L007	6/18/07		< 1		< 1		< 1		< 1	
03L014	6/18/07		0.2	JP	< 1		150		< 1	
03L017	6/15/07		< 1		< 1		0.31	JP	< 1	
03L018	6/19/07		< 1		< 1		0.57	JP	< 1	
03L020	6/7/07		< 1		< 1		15		< 1	
03L021	6/13/07		< 1		< 1		3.1		< 1	
03L077	6/12/07		< 1		< 1		41		< 1	
03L078	6/13/07		< 1		< 1		3.9		< 1	
03L079	6/13/07		< 1		< 1		2.3		< 1	
03L084	6/15/07		< 1		< 1		0.46	JP	< 1	
03L802	6/14/07		< 1		< 1		3.3		< 1	
03L806	6/12/07		0.42	JP	< 1		220		< 1	
03L809	6/20/07		0.39	JP	< 1		220		< 1	
03L833	6/14/07		< 1		< 1		3.1		< 1	

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

			Tetrachloroethene		*trans-1,2-Dichloroethene*		*Trichloroethene*		*Vinyl Chloride*	
TGRS Cleanup Level [1]			*5*				*5*			
			µg/L		*µg/L*		*µg/L*		*µg/L*	
Location	*Date*	*Dup*								
03M002	6/13/07		<	1	<	1	50		<	1
03M020	6/8/07		<	1	<	1	58		<	1
03M802	6/14/07		<	1	<	1	9.7		<	1
03M806	6/12/07		<	2	<	2	520		<	2
03M806	6/12/07	D	<	2	<	2	500		<	2
03U002	6/14/07		<	1	<	1	28		<	1
03U003	6/15/07		<	1	<	1	160		<	1
03U004	6/14/07		<	1	<	1	0.47	JP	<	1
03U005	6/18/07		<	1	<	1	0.2	JP	<	1
03U005	6/18/07	D	<	1	<	1	0.19	JP	<	1
03U007	6/18/07		<	1	<	1	< 1		<	1
03U009	6/20/07		<	1	<	1	0.27	JP	<	1
03U014	6/19/07		<	1	<	1	0.35	JP	<	1
03U017	6/15/07		<	1	<	1	2.1		<	1
03U018	6/19/07		<	1	<	1	41		<	1
03U020	6/7/07		<	1	<	1	75		<	1

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date	Dup	Tetrachloroethene	trans-1,2-Dichloroethene	Trichloroethene	Vinyl Chloride
TGRS Cleanup Level [1]			*5 µg/L*	*µg/L*	*5 µg/L*	*µg/L*
03U021	6/13/07		< 1	< 1	240	< 1
03U027	6/13/07		< 1	< 1	16	< 1
03U027	6/13/07	D	< 1	< 1	16	< 1
03U028	6/8/07		< 1	< 1	38	< 1
03U029	6/8/07		< 1	< 1	6.1	< 1
03U030	6/8/07		< 1	< 1	43	< 1
03U032	6/19/07		< 1	< 1	< 1	< 1
03U075	6/15/07		< 1	< 1	0.17 JP	< 1
03U075	6/15/07	D	< 1	< 1	< 1	< 1
03U077	6/12/07		< 1	< 1	18	< 1
03U078	6/13/07		8.6	< 1	60	< 1
03U079	6/13/07		< 1	< 1	56	< 1
03U092	6/14/07		< 1	< 1	18	< 1
03U093	6/19/07		< 1	< 1	86	< 1
03U094	6/19/07		< 1	< 1	94	< 1
03U096	6/19/07		< 1	< 1	15	< 1

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

			Tetrachloroethene		*trans-1,2-Dichloroethene*		*Trichloroethene*		*Vinyl Chloride*	
TGRS Cleanup Level [1]			*5*				*5*			
			µg/L		*µg/L*		*µg/L*		*µg/L*	
Location	*Date*	*Dup*								
03U099	6/20/07		< 1		< 1		5.5		< 1	
03U114	6/14/07		< 1		< 1		6		< 1	
03U659	6/15/07		< 1		0.35	JP	200		< 1	
03U671	6/8/07		3.6		< 1		34		< 1	
03U672	6/18/07		< 1		< 1		< 1		< 1	
03U701	6/11/07		< 1		< 1		2		< 1	
03U702	6/11/07		< 1		< 1		0.62	JP	< 1	
03U703	6/8/07		11		< 1		45		< 1	
03U708	6/6/07		2.4		< 1		79		< 1	
03U709	6/8/07		< 1		< 1		51		< 1	
03U710	6/14/07		< 1		< 1		94		< 1	
03U711	6/14/07		1.5		< 1		120		< 1	
03U715	6/19/07		< 1		< 1		43		< 1	
03U801	6/11/07		< 1		< 1		15		< 1	
03U803	6/14/07		< 1		< 1		0.33	JP	< 1	

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date	Dup	Tetrachloroethene		trans-1,2-Dichloroethene		Trichloroethene		Vinyl Chloride	
TGRS Cleanup Level [1]			*5 µg/L*		*µg/L*		*5 µg/L*		*µg/L*	
03U804	6/11/07		< 1		< 1		< 1		< 1	
03U805	6/20/07		< 1		< 1		0.97	JP	< 1	
03U805	6/20/07	D	0.21	JP	< 1		0.94	JP	< 1	
03U806	6/12/07		0.99	JP	< 1		60		< 1	
04J077	6/12/07		< 1		< 1		210		< 1	
04J702	6/11/07		< 1		< 1		2.7		< 1	
04J708	6/6/07		< 1		< 1		4.6		< 1	
04J713	6/11/07		< 1		< 1		< 1		< 1	
04J713	6/11/07	D	< 1		< 1		< 1		< 1	
04U002	6/13/07		< 1		< 1		3.5		< 1	
04U007	6/18/07		< 1		< 1		< 1		< 1	
04U020	6/7/07		< 1		< 1		1.9		< 1	
04U027	6/13/07		< 1		< 1		< 1		< 1	
04U077	6/12/07		< 1		< 1		95		< 1	
04U510	6/20/07		< 1		< 1		< 1		< 1	
04U510	6/20/07	D	< 1		< 1		< 1		< 1	
04U701	6/11/07		< 1		< 1		4.2		< 1	

TABLE 10-8

GROUNDWATER QUALITY DATA (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

			Tetrachloroethene		trans-1,2-Dichloroethene		Trichloroethene		Vinyl Chloride	
TGRS Cleanup Level [(1)]			*5*				*5*			
			µg/L		*µg/L*		*µg/L*		*µg/L*	
Location	*Date*	*Dup*								
04U702	6/11/07		<	1	<	1	1.2		<	1
04U708	6/6/07		<	1	<	1	1.1		<	1
04U709	6/8/07		<	1	<	1	7.8		<	1
04U711	6/14/07		<	1	<	1	1.7		<	1
04U713	6/11/07		<	1	<	1	0.19	JP	<	1
04U802	6/14/07		<	1	<	1	0.38	JP	<	1
04U806	6/12/07		<	1	<	1	96		<	1
04U833	6/14/07		<	1	<	1	1.5		<	1
04U833	6/14/07	D	<	1	<	1	1.6		<	1
PJ#806	6/12/07		<	1	<	1	25		<	1

Notes:
(1) Cleanup levels for TGRS are from the OU2 ROD. Shading indicates exceedence of the cleanup level.
D - Duplicate Analysis
J - Value is estimated
JP - Results less than reporting level but greater than instrument detection limit.
UB# - Blank Contamination, # = highest concentration of blank affecting data.

TABLE 10-9

SUMMARY OF OU2 DEEP GROUNDWATER MONITORING REQUIREMENTS
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Remedy Component	*Monitoring Requirements*	*Implementing Party*	*Documents Containing the Monitoring Plan*
#1 Hydraulic Containment and Mass Removal	a. Water levels to draw contour maps showing hydraulic zone of capture	Alliant/Army	Deep groundwater monitoring plan in Annual Report
	b. Pumping volumes and rates for comparison to design rates	Alliant/Army	Deep groundwater monitoring plan in Annual Report
	c. Influent and extraction well water quality for overall mass removal calculations	Alliant/Army	Deep groundwater monitoring plan in Annual Report
#2 Groundwater Treatment	• Outlined below	Alliant/Army	Deep groundwater monitoring plan in Annual Report
#3 Treated Water Discharge	• Effluent monitoring to verify attainment of treatment requirements	Alliant/Army	Deep groundwater monitoring plan in Annual Report
#4 Institutional Controls	• None	Alliant/Army	Deep groundwater monitoring plan in Annual Report
#5 Review of New Technologies	• None	Alliant/Army	Deep groundwater monitoring plan in Annual Report
#6 Groundwater Monitoring	• As above	Alliant/Army	Deep groundwater monitoring plan in Annual Report
Overall Remedy	a. Groundwater quality to verify attainment of clean up goals	Alliant/Army	Deep groundwater monitoring plan in Annual Report

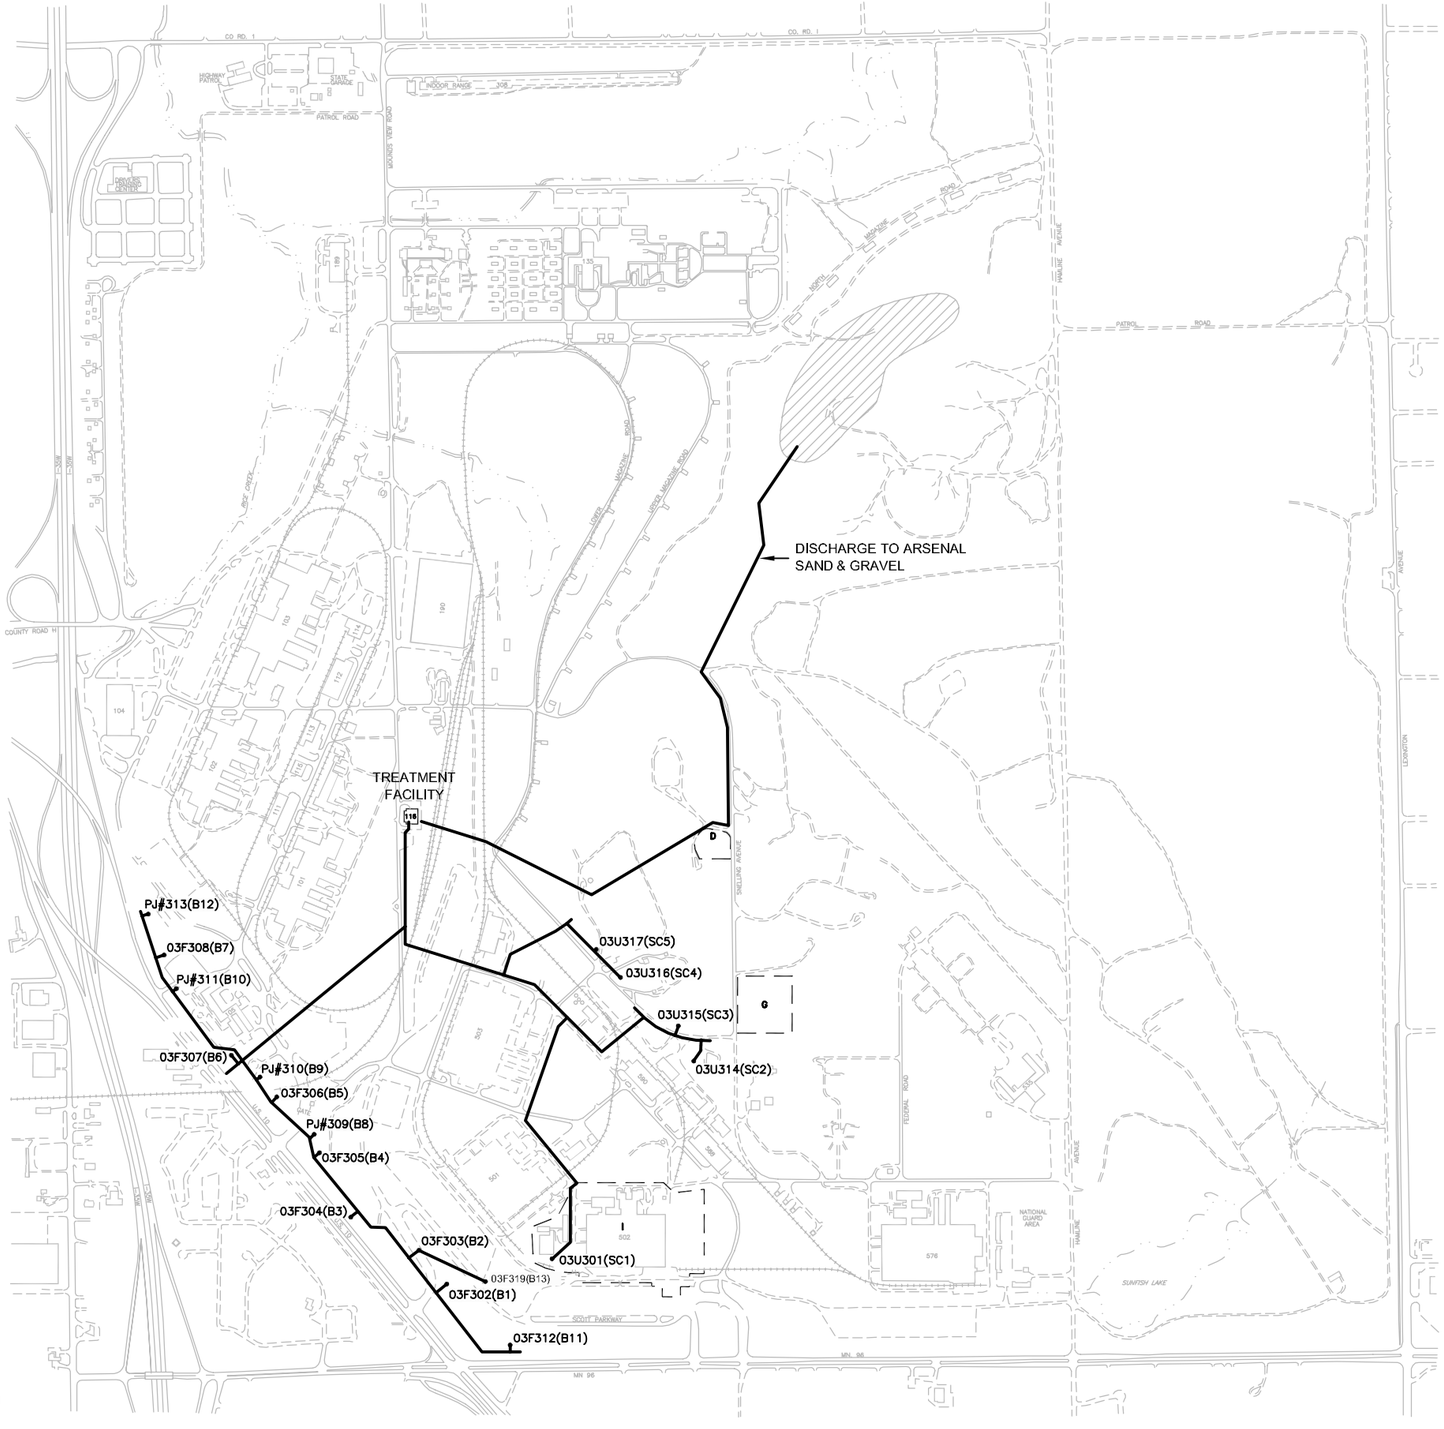

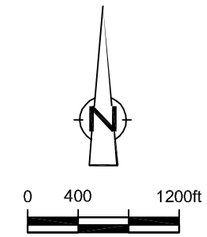

LEGEND

- PRIMARY ROAD
- SECONDARY ROAD
- RAILROAD
- DRAINAGE
- BUILDING
- BUILDING REMOVED
- SOURCE AREA
- WELL LOCATION

EXTRACTION WELL NAME CROSS REFERENCE

B1	03F302
B2	03F303
B3	03F304
B4	03F305
B5	03F306
B6	03F307
B7	03F308
B8	PJ#309
B9	PJ#310
B10	PJ#311
B11	03F312
B12	PJ#313
B13	03F319
SC1	03U301
SC2	03U314
SC3	03U315
SC4	03U316
SC5	03U317

figure 10-1

TGRS LAYOUT
TWIN CITIES ARMY AMMUNITION PLANT
Arden Hills, Minnesota

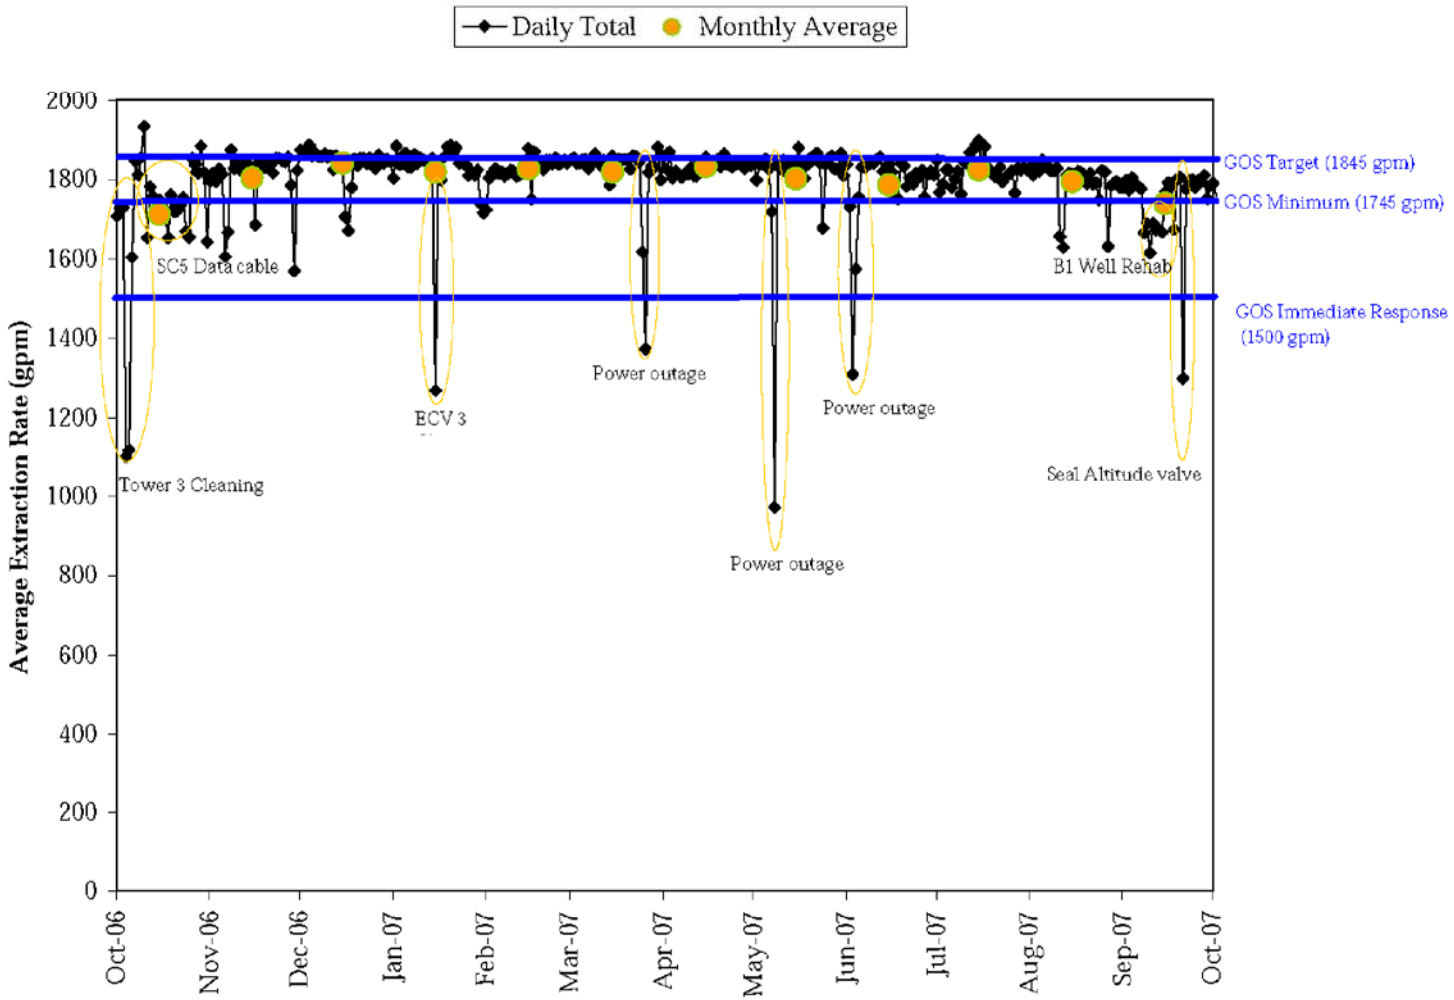

figure 10-2

TGRS FY2007 TOTAL DAILY FLOW RATES
TWIN CITIES ARMY AMMUNITION PLANT
Arden Hills, Minnesota

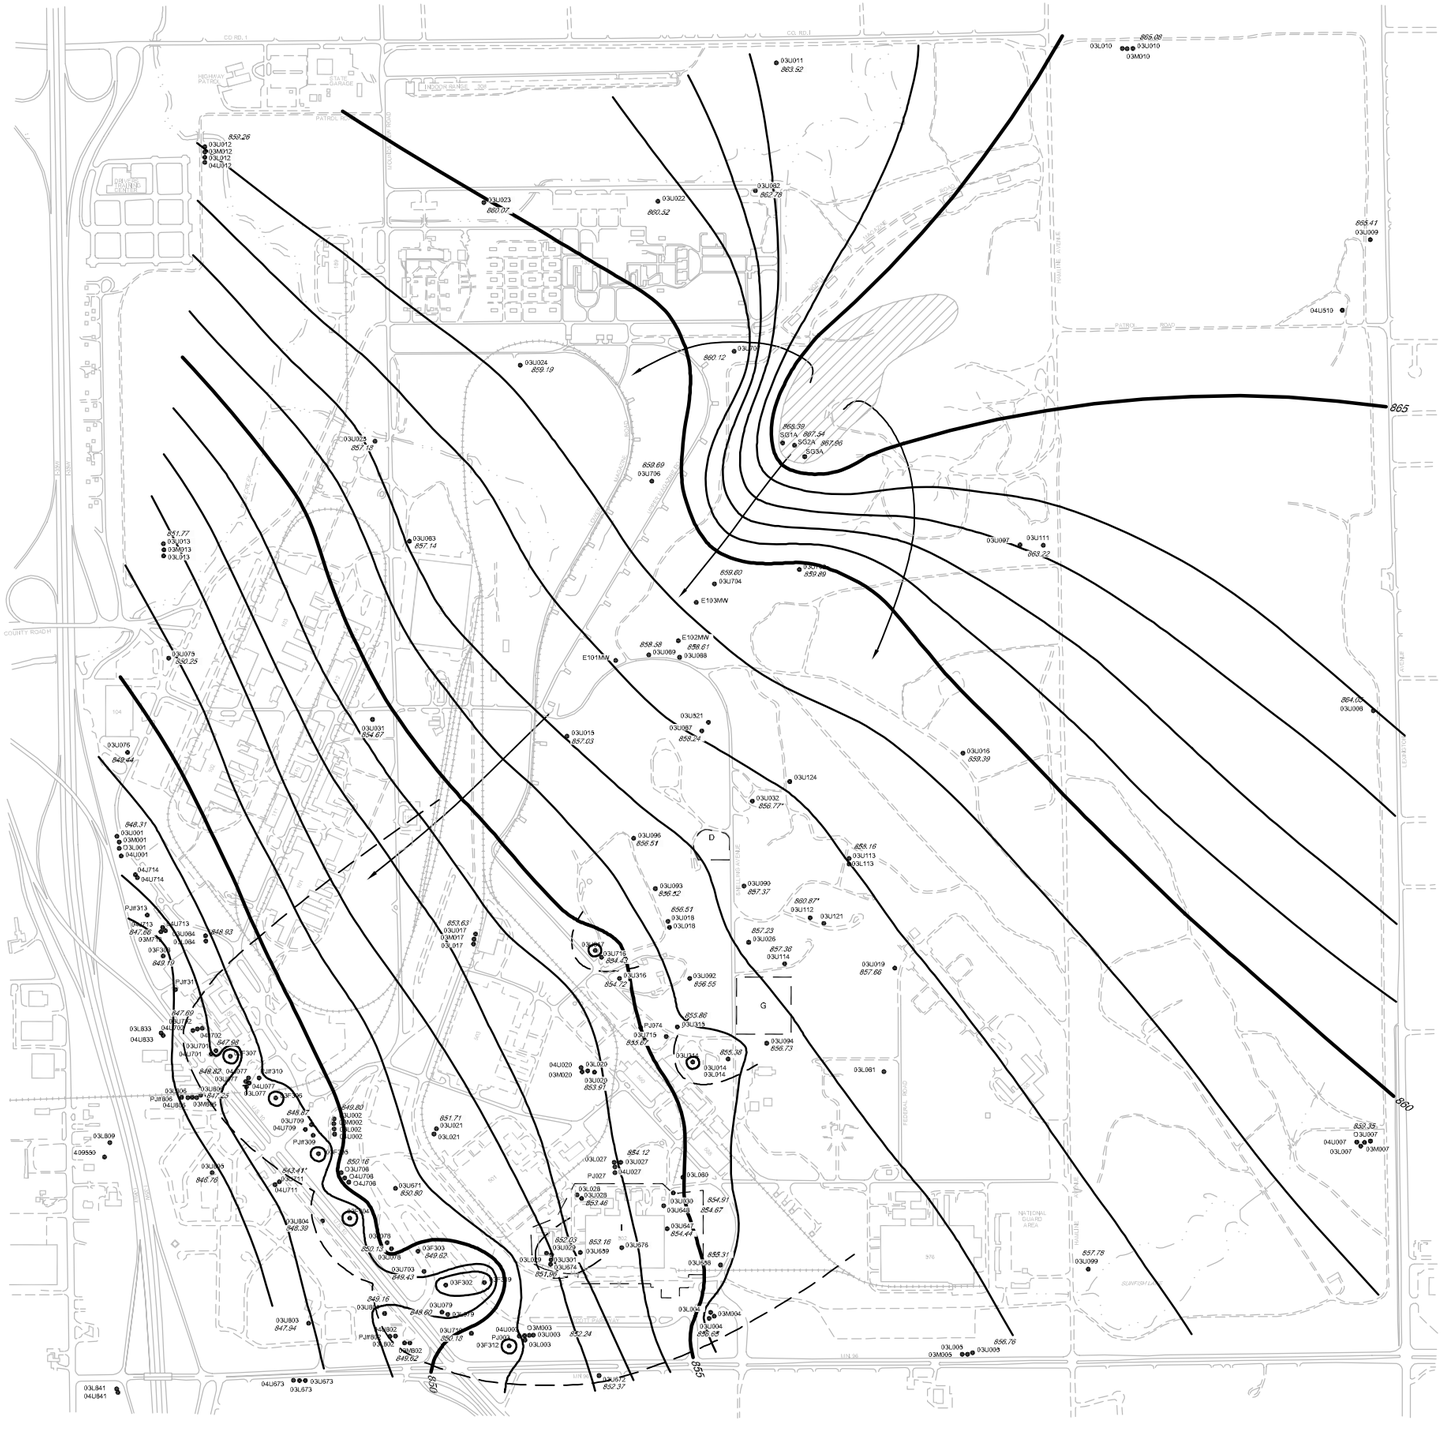
CO. RD. I
HIGHWAY 10
STATE GARAGE
PATROL ROAD
ROADWAY
RAILROAD
COUNTY ROAD
FEDERAL ROAD
NATIONAL GUARD AREA
03JP13
03M012
03JP12
04UP11
03JP23
03JP22
03JP24
03JP25
03JP83
03JP79
03JP76
03JP31
03JP33
03JP06
03JP09
03JP10
03JP11
03JP92
03JP94
03JP95
03JP96
03JP97
03JP99
03JP00
03JP01
03JP02
03JP03
03JP04
03JP05
03JP07
03JP08
03JP21
03JP26
03JP27
03JP28
03JP29
03JP30
03JP32
03JP34
03JP35
03JP36
03JP37
03JP38
03JP39
03JP40
03JP41
03JP42
03JP43
03JP44
03JP45
03JP46
03JP47
03JP48
03JP49
03JP50
03JP51
03JP52
03JP53
03JP54
03JP55
03JP56
03JP57
03JP58
03JP59
03JP60
03JP61
03JP62
03JP63
03JP64
03JP65
03JP66
03JP67
03JP68
03JP69
03JP70
03JP71
03JP72
03JP73
03JP74
03JP75
03JP77
03JP78
03JP80
03JP81
03JP82
03JP84
03JP85
03JP86
03JP87
03JP88
03JP89
03JP90
03JP91
03JP98
03JP100
03JP101
03JP102
03JP103
03JP104
03JP105
03JP106
03JP107
03JP108
03JP109
03JP110
03JP111
03JP112
03JP113
03JP114
03JP115
03JP116
03JP117
03JP118
03JP119
03JP120
03JP121
03JP122
03JP123
03JP124
03JP125
03JP126
03JP127
03JP128
03JP129
03JP130
03JP131
03JP132
03JP133
03JP134
03JP135
03JP136
03JP137
03JP138
03JP139

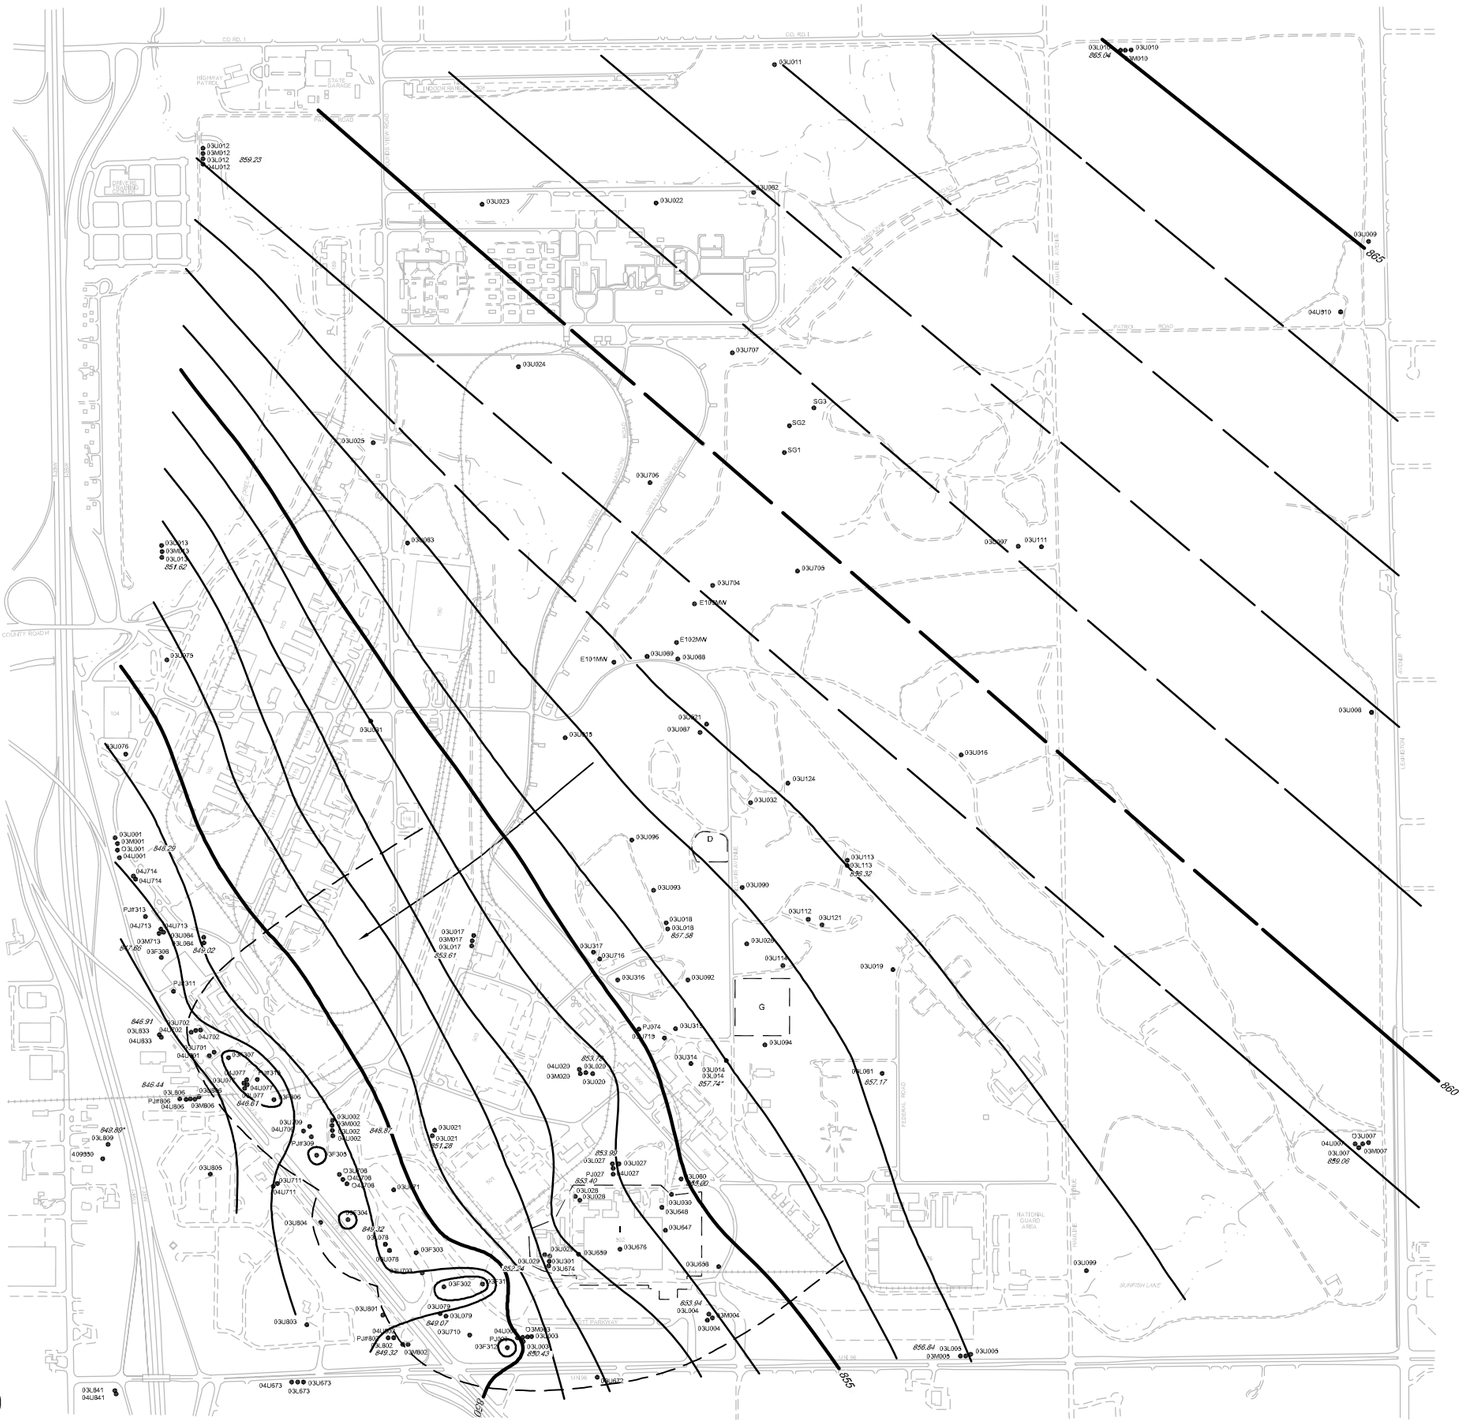

figure 10-4

OU2, LOWER MAP 3, POTENTIOMETRIC MAP, 6/1/07 (Q95)
TWIN CITIES ARMY AMMUNITION PLANT
Arden Hills, Minnesota

47533-43(002)GN-SP007 Jan 15/2008

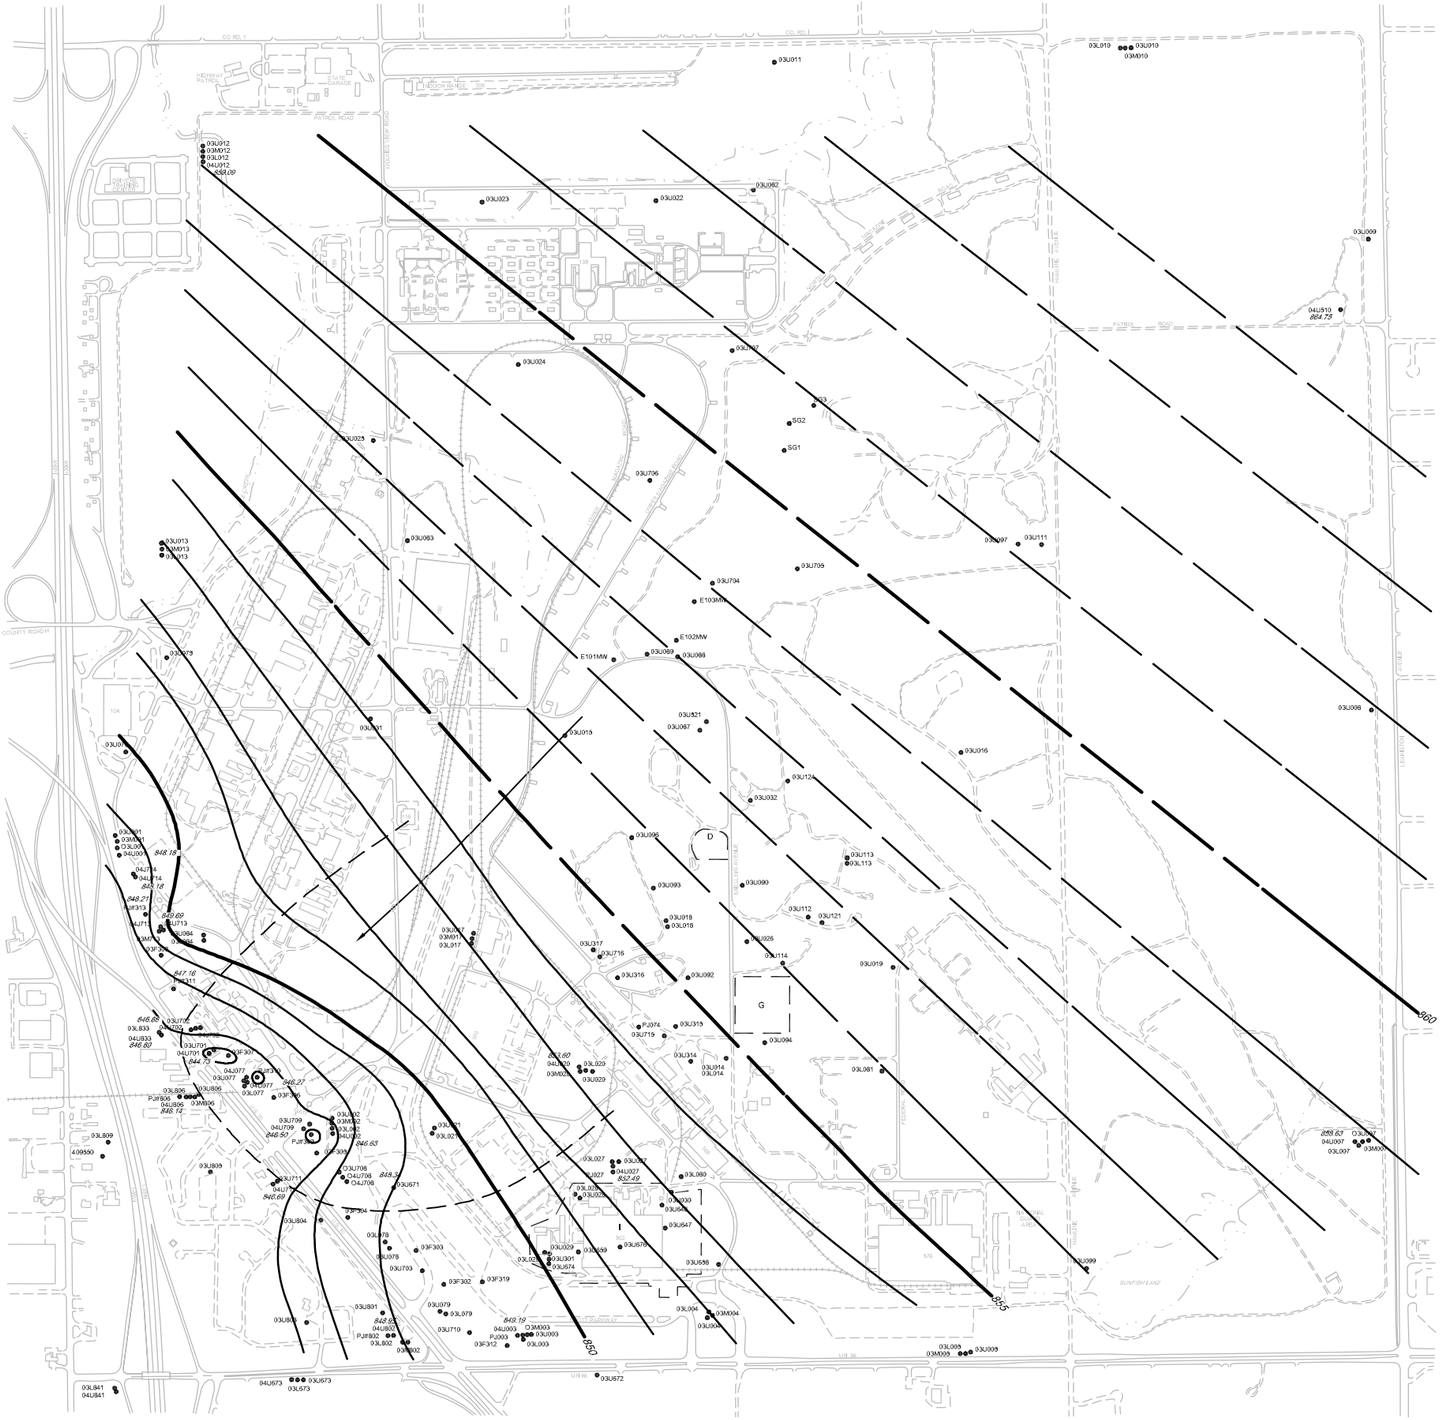
03U011
03U023
03U022
03U082
03U009
03U024
03U025
03U706
03U063
03U704
E103MW
E102MW
E101MW
03U069
03U068
03U079
03U011
03U015
03U821
03U087
03U016
03U124
03U032
03U096
03U093
03U090
03U112
03U121
03U113
03U018
03U026
03U114
03U317
03U716
03U316
03U092
03U019
03U315
03U094
03U314
03U029
03U081
03U027
03U030
03U647
03U576
03U301
03U974
03U558
03U004
03U099
03U098
03U111
03U097
03U709
03U801
03U710
03U672
03U673
03U841
03U809
03U806
03U805
03U804
03U671
03U707
03U708
03U703
03U802
03U803
03U005
03U003
03U007
03U009
03U010
03U910
03U912
03U013
03U012
03U912
03U912
03U913
03U913
03U913
03U912
03U912
03U912

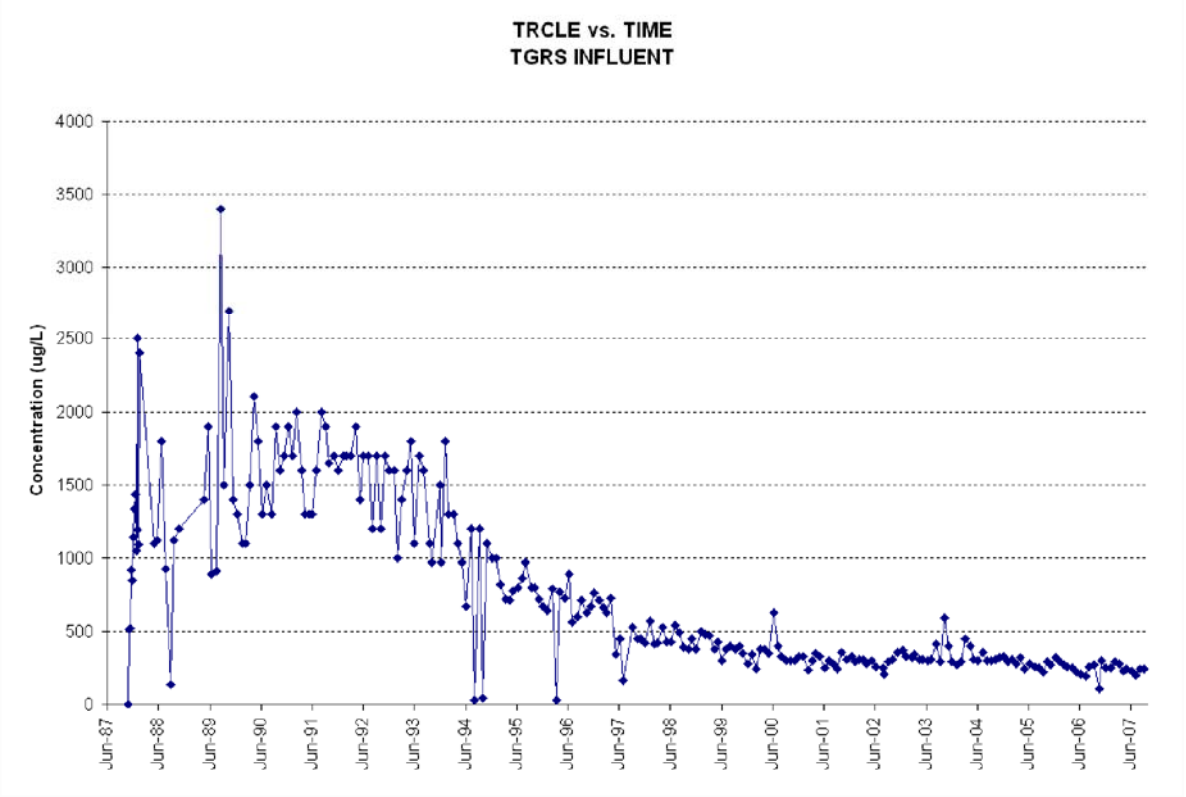

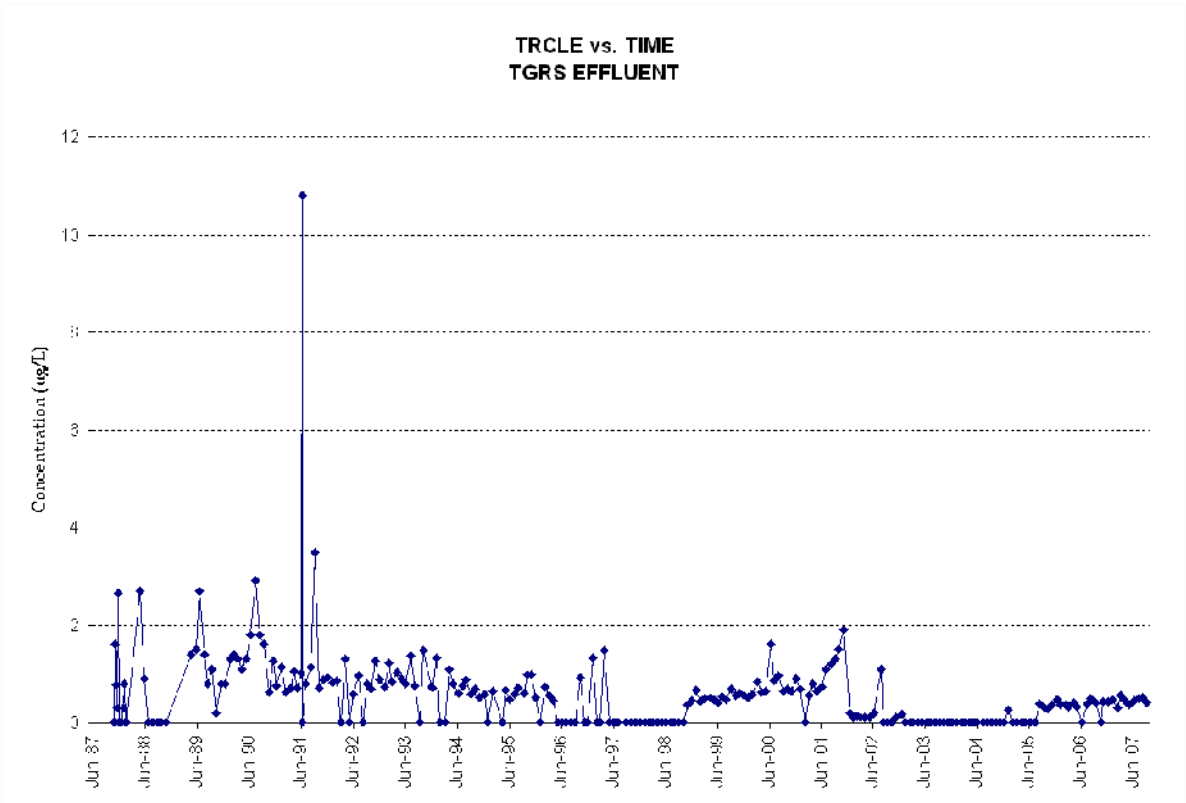

figure 10-6

NOTE: SAMPLES REPORTING CONCENTRATIONS OF NON-DETECT WERE PLOTTED AS ZERO. WHEN DUPLICATE SAMPLES WERE COLLECTED, THE HIGHER CONCENTRATION WAS PLOTTED.

TGRS TREATMENT SYSTEM PERFORMANCE
TWIN CITIES ARMY AMMUNITION PLANT
Arden Hills, Minnesota

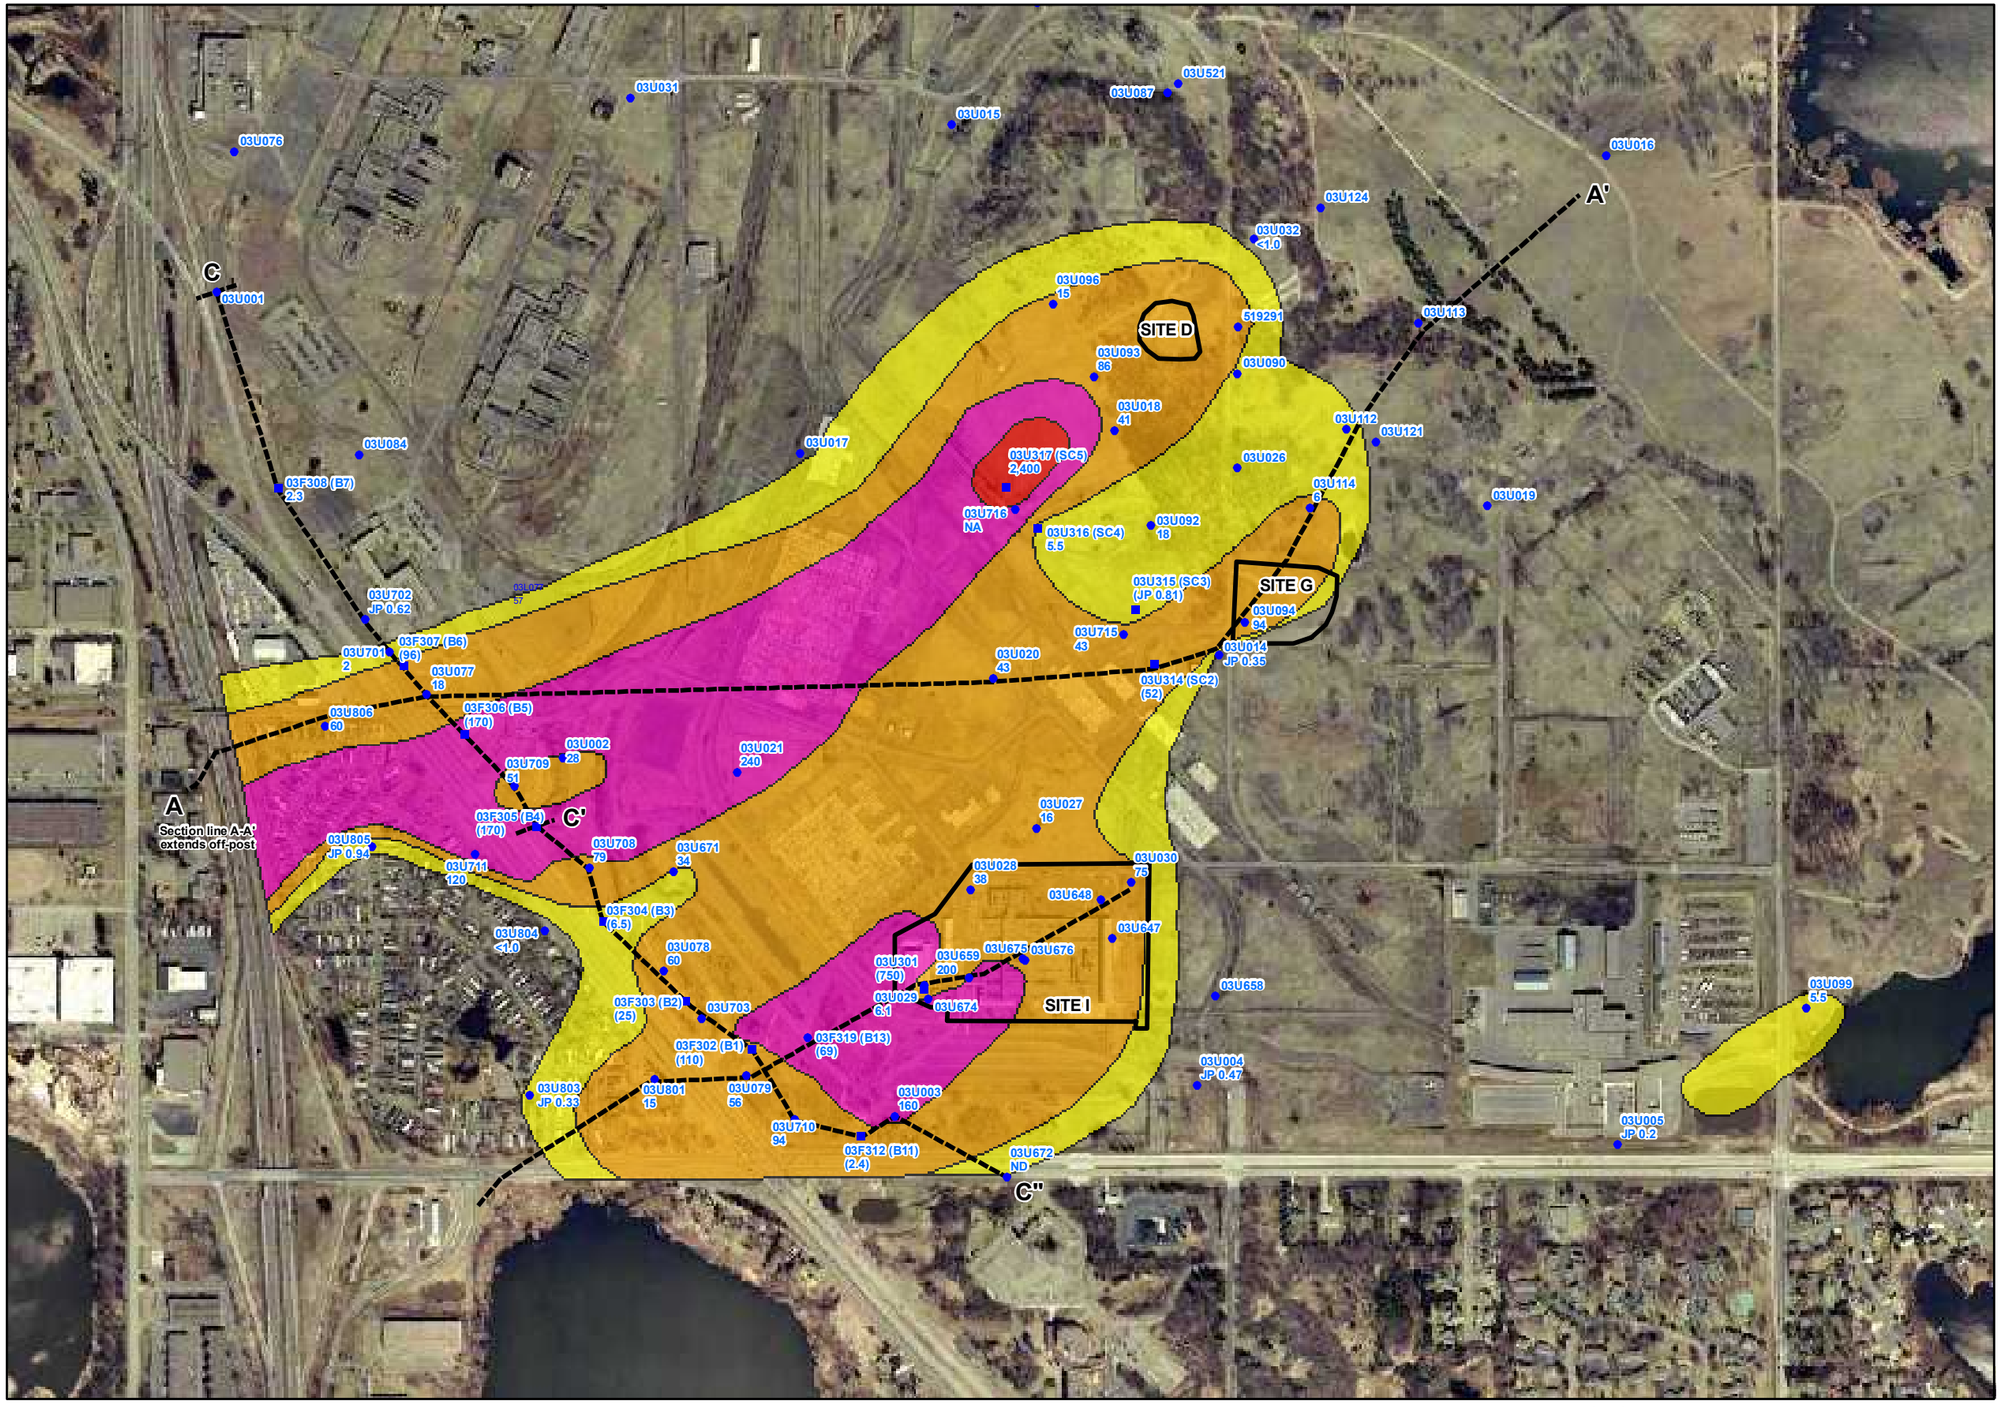

Legend

- 03L077 — Monitoring Well Location
- 03F307 — Extraction Well Location
- 03L077 62 — Trichloroethene concentrations (ug/L) (values in parentheses were not used for contouring purposes)
- ND — Non-Detect
- NA — Not Available
- Site Boundary
- Cross-Section Line

Trichloroethene Concentrations

- 1-10 ug/l
- 10-100 ug/l
- 100-1,000 ug/l
- 1,000 -10,000 ug/l

Notes:
1. 03F and 03U extraction wells are shown with data in parentheses, but concentrations were not used for contouring (except for SC-3 and SC-4, which were used for contouring since they are being sampled as monitoring wells and since they are screened only within Upper Unit 3.
2. Results are from groundwater samples collected in June 2007.
3. Aerial Orthophotography flown in 2006 (LMIC)

N
W E
S

700 350 0 700
Feet

L:\1561\05\FY2007\mxd file\OU2 Upper Unit 3 TCE_Iso_map.mxd
Last Modified: 1/17/2008 8:33:16 AM

TWIN CITIES ARMY AMMUNITION PLANT

OU2, Upper Unit 3, Trichloroethene Isoconcentration Map, Summer 2007

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 10-7

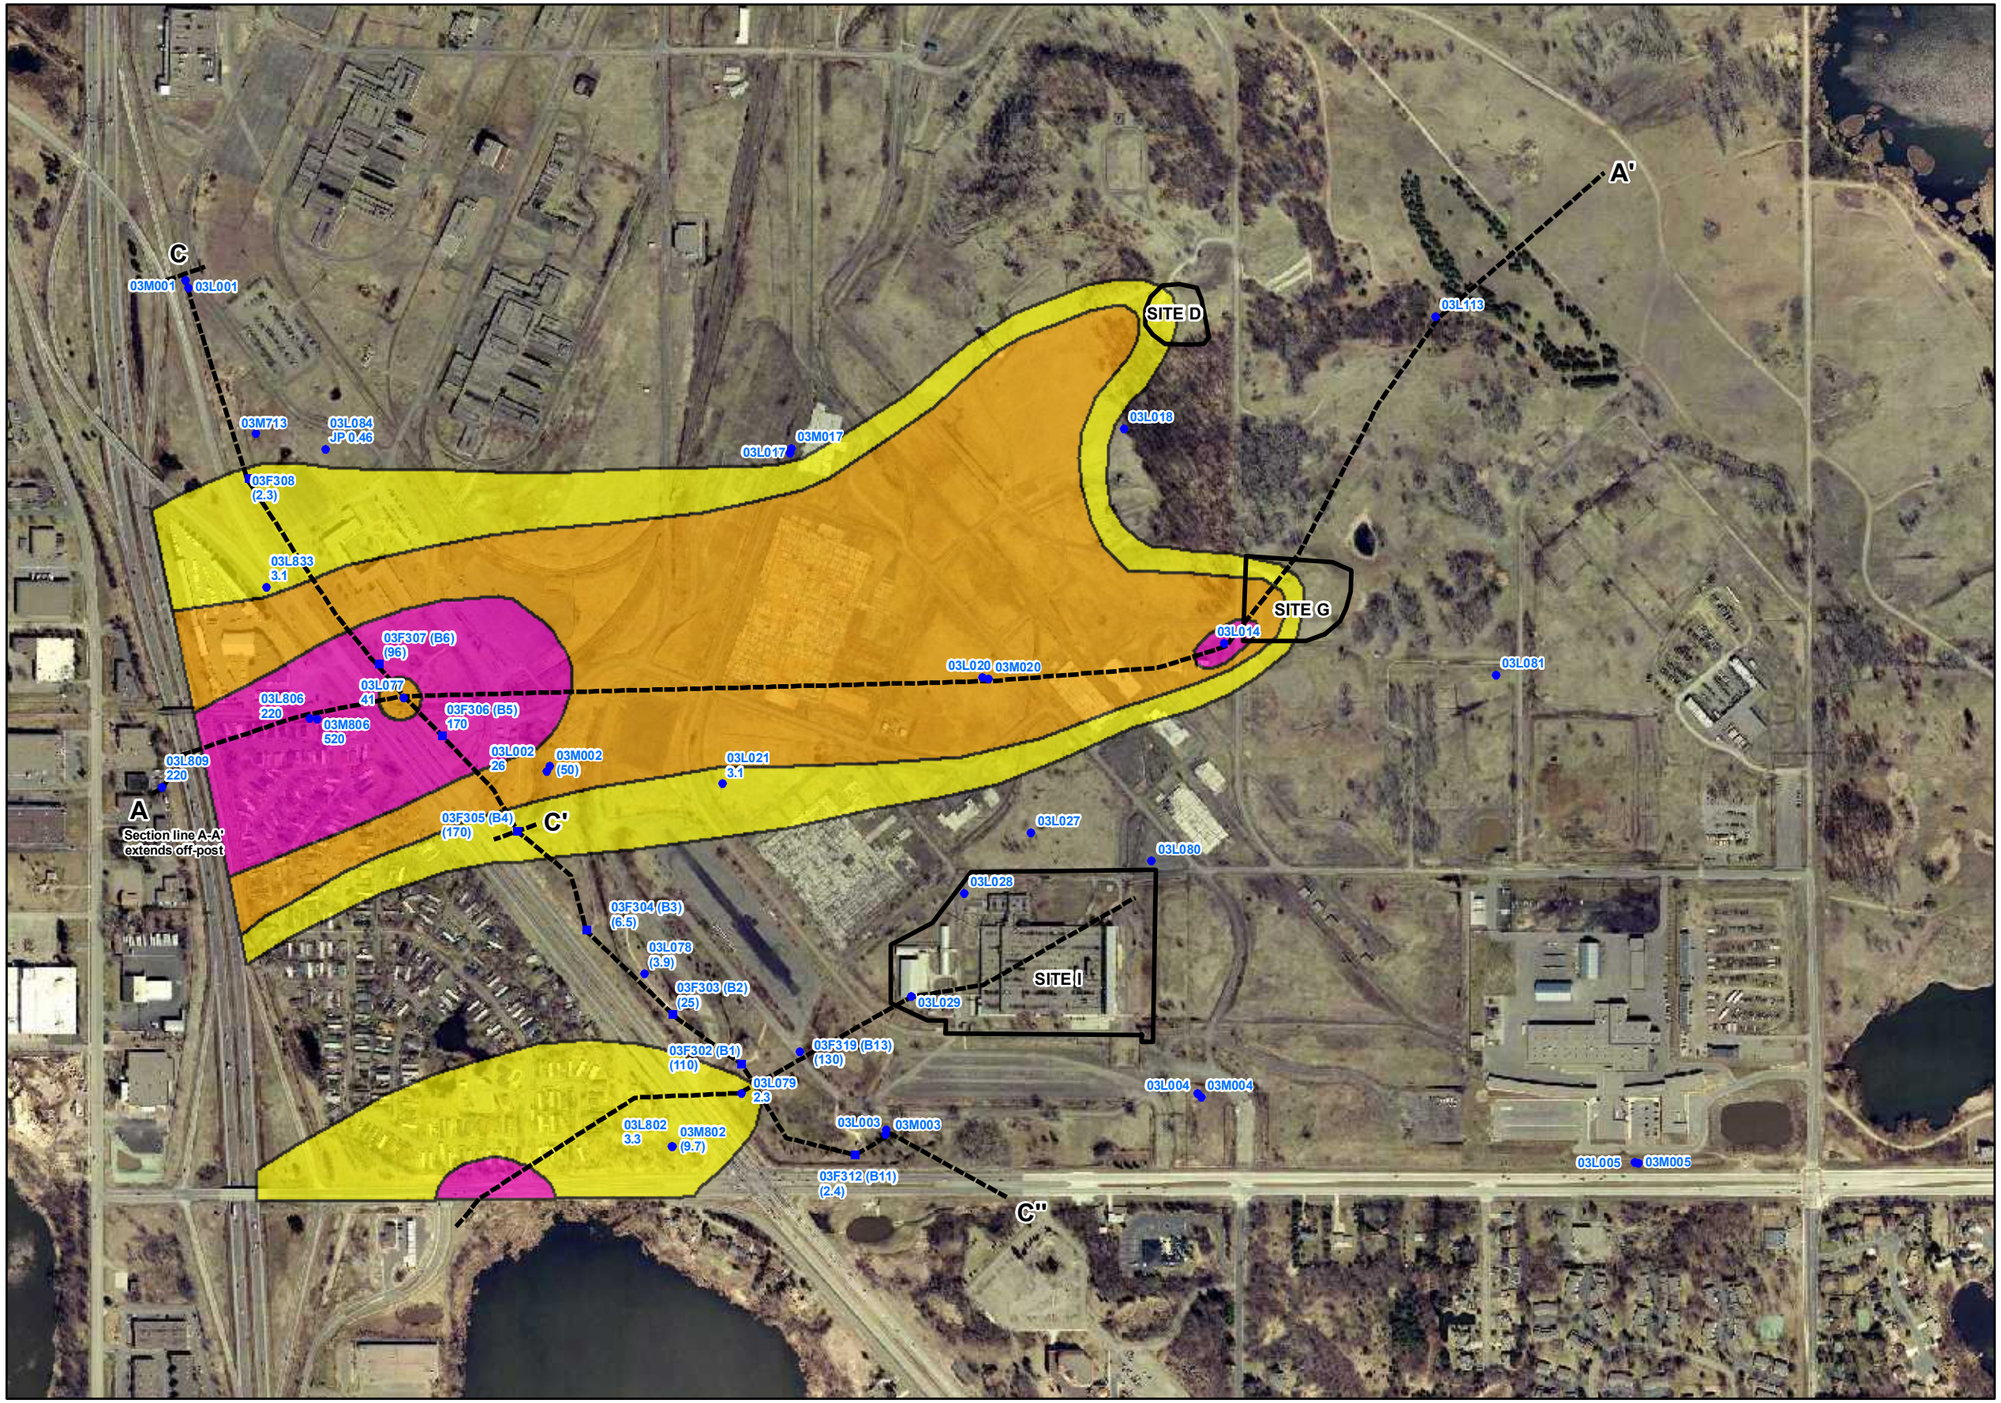

Legend

- 03L077 — Monitoring Well Location
- 03F307 — Extraction Well Location
- 03L077 62 — Trichloroethene concentrations (ug/L) (values in parentheses were not used for contouring purposes)
- Site Boundary
- Cross-Section Line

Trichloroethene Concentrations

- 1-10 ug/l
- 10-100 ug/l
- 100-1,000 ug/l

Notes:
1. Middle Unit 3 wells with data are shown with data in parentheses, but were not used for contouring.
2. 03F extraction wells are shown with data in parentheses, but were not used for contouring.
3. Results are from groundwater samples collected in June 2007.
4. Aerial Orthophotography flown in 2006.

N
W E
S

700 350 0 700
Feet

L:\1561\05\FY2007\mxd file\OU2 Lower Unit 3 TCE_Iso_map.mxd
Last Modified: 1/16/2008 9:40:55 AM

TWIN CITIES ARMY AMMUNITION PLANT

OU2, Lower Unit 3, Trichloroethene Isoconcentration Map, Summer 2007

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 10-8

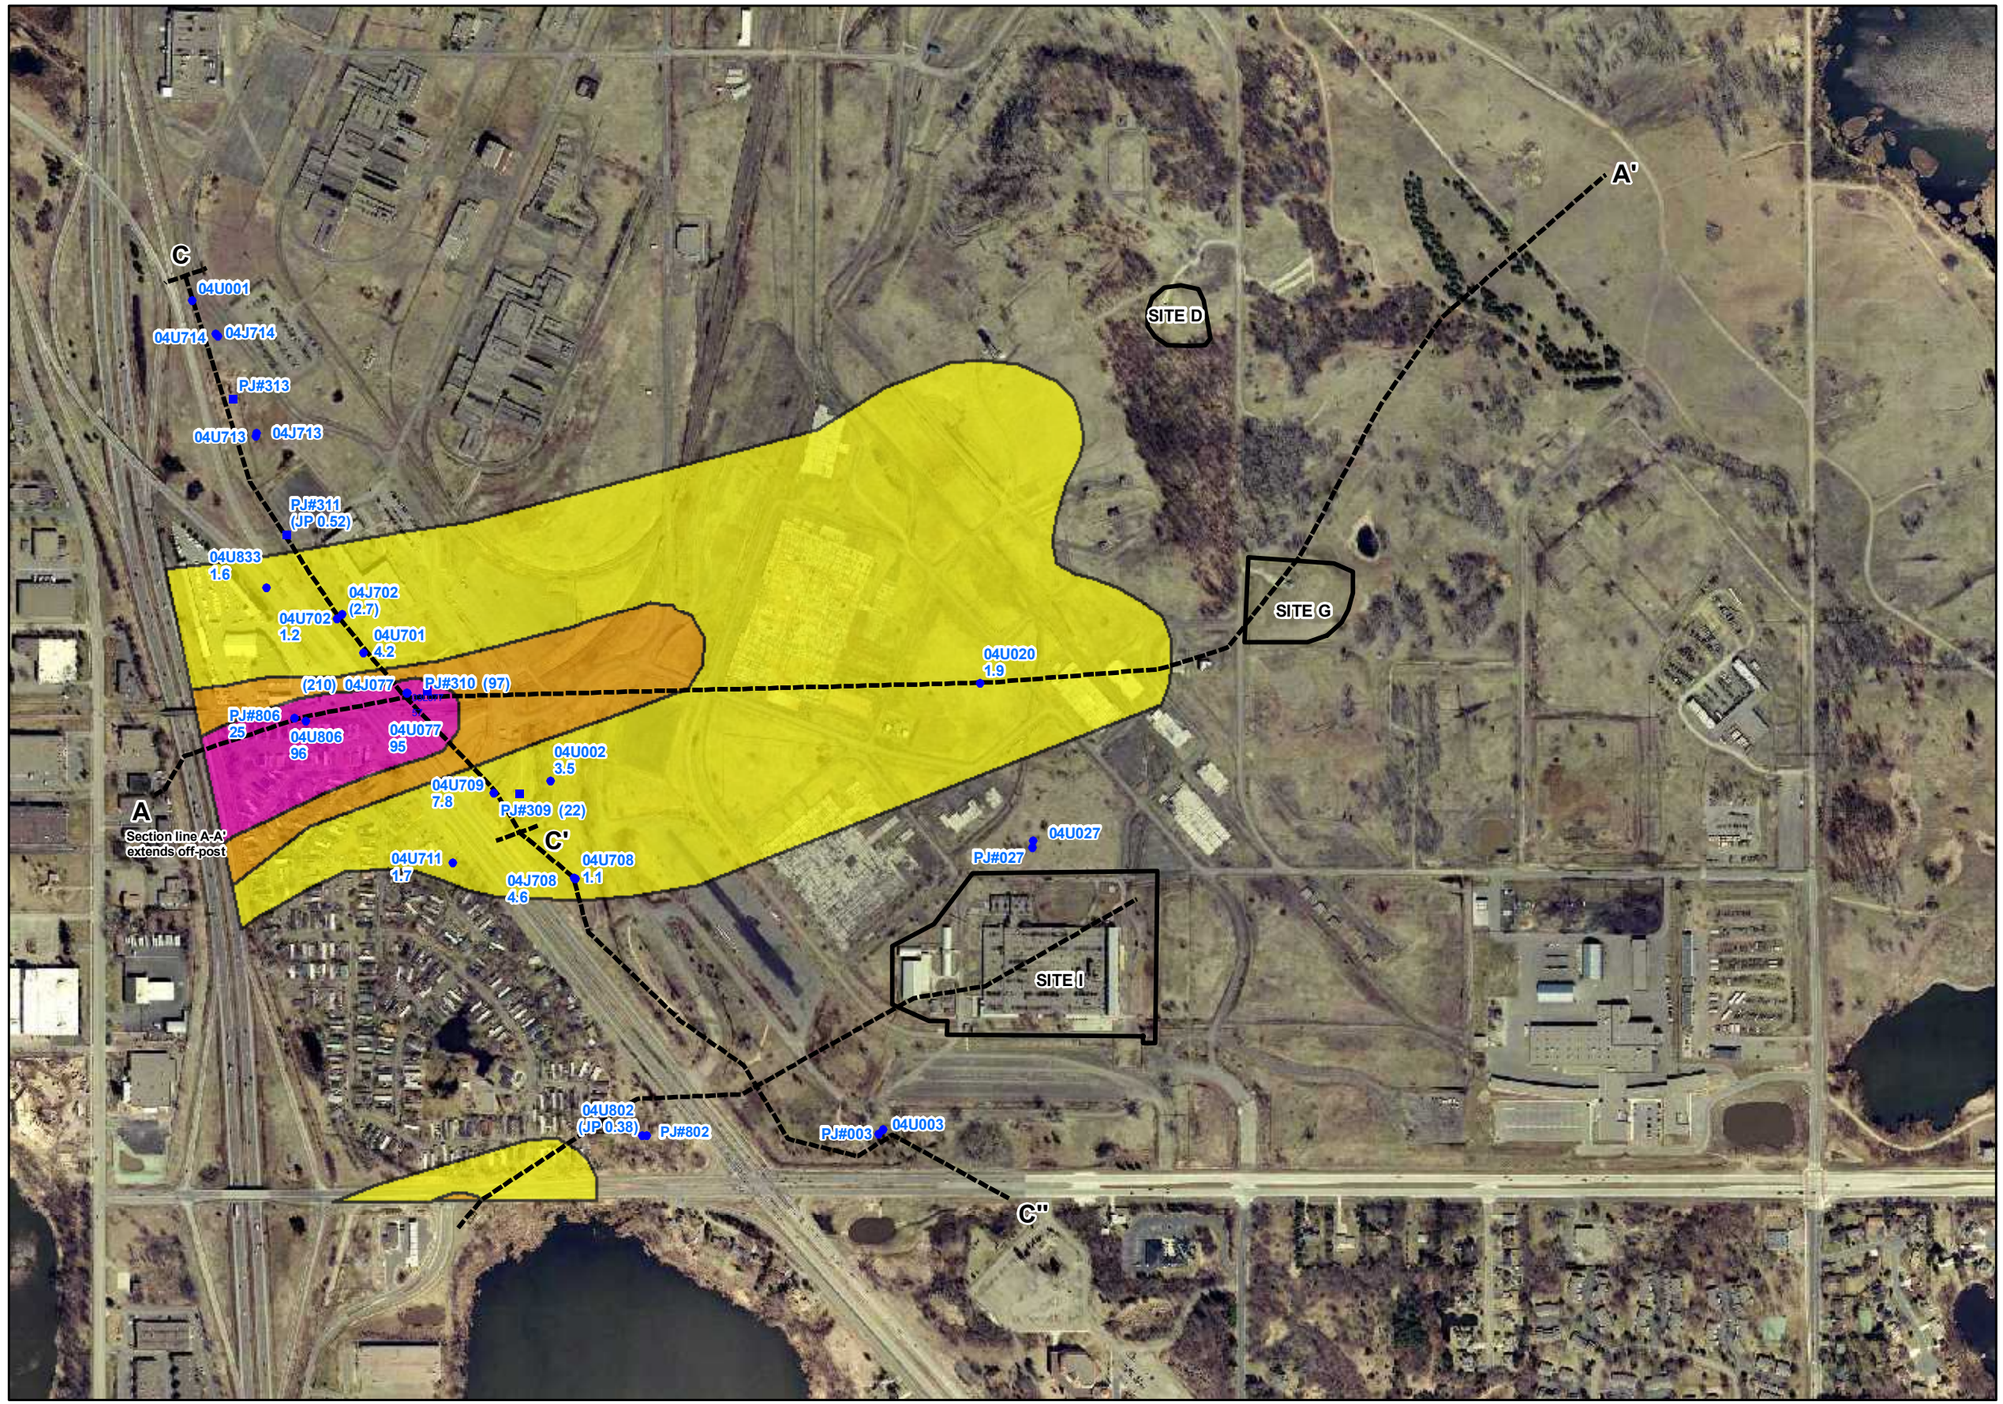

Legend

- 03L077 — Monitoring Well Location
- 03F307 — Extraction Well Location
- 03L077 62 — Trichloroethene concentrations (ug/L) (values in parentheses were not used for contouring purposes)
- Site Boundary
- Cross-Section Line

Trichloroethene Concentrations

- 1-10 ug/l
- 10-100 ug/l
- 100-1,000 ug/l

Notes:
1. All 04J wells (Jordan Wells) with data are shown wth data in parentheses, but were not for countouring.
2. All PJ# Extraction wells are shown with data in parentheses, but were not used for countouring.
3. PJ# monitoring wells are shown with data in parenthesses, but were not used for countouring.
4. Aerial Orthophotograph was flown 2006 (LMIC)
5. Results are from groundwater samples collected in June 2007.

N W E S

700 350 0 700 Feet

L:\1561\05\FY2007\mxd file\OU2 Upper Unit 4 TCE_Iso_map.mxd
Last Modified: 1/16/2008 10:02:33 AM

TWIN CITIES ARMY AMMUNITION PLANT

OU2, Upper Unit 4, Trichloroethene Isoconcentration Map, Summer 2007

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 10-9

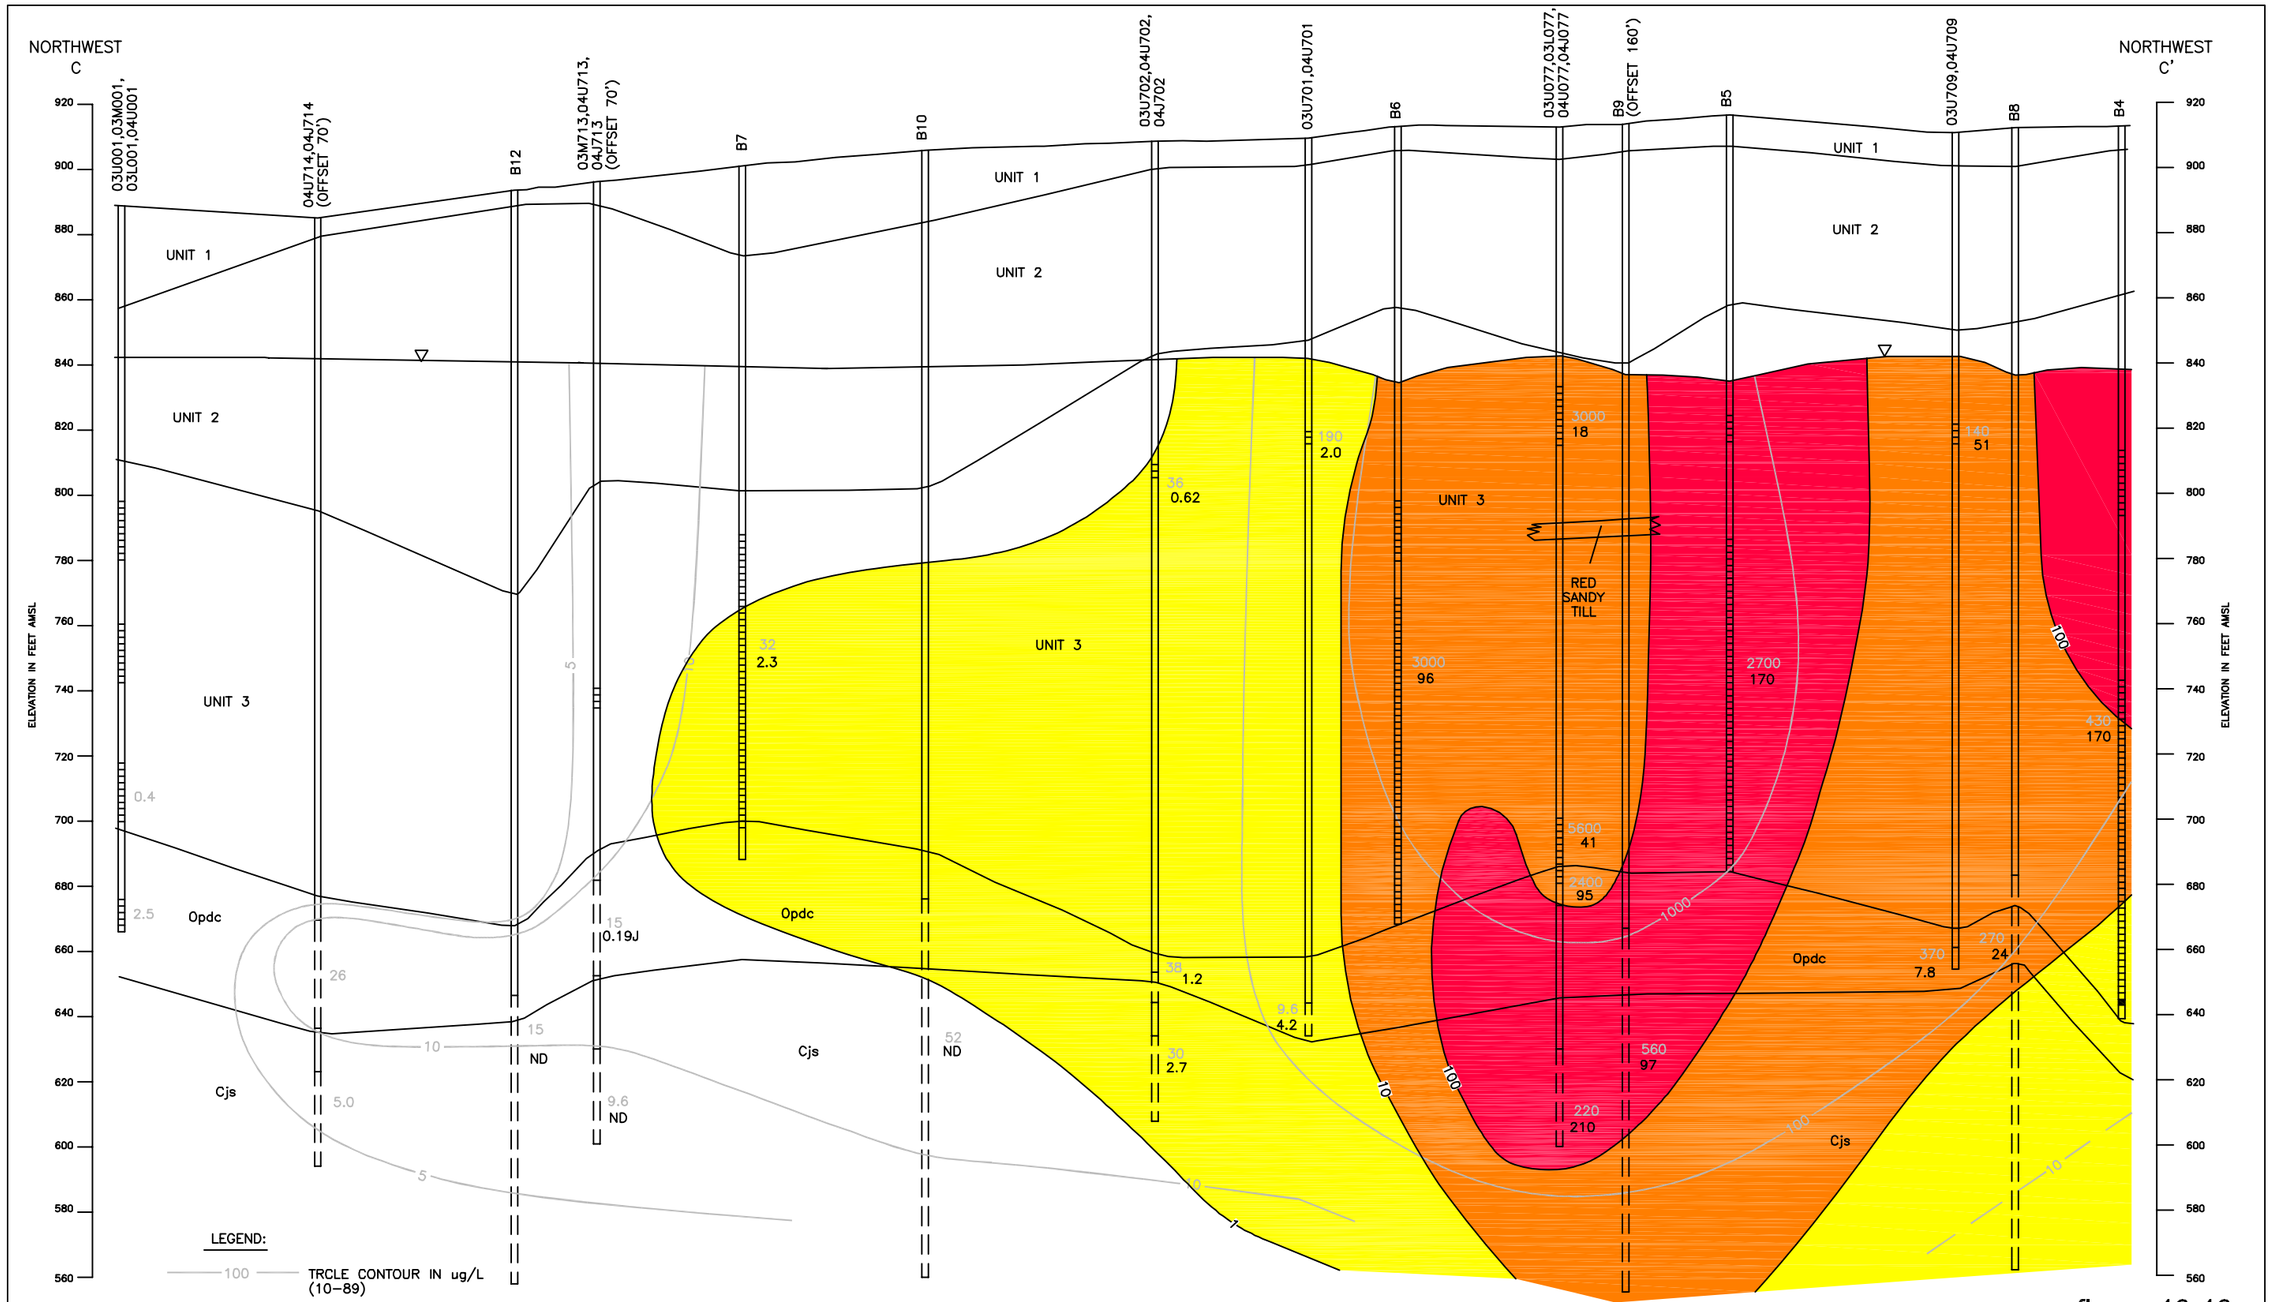

figure 10-10

JUNE 2007 GROUNDWATER TRCLE DATA
CROSS SECTION C-C'
TWIN CITIES ARMY AMMUNITION PLANT
Arden Hills, Minnesota

NORTHWEST
C'

SOUTHEAST
C"

ELEVATION IN FEET AMSL

960 940 920 900 880 860 840 820 800 780 760 740 720 700 680 660 640 620 600 580

B4 | 03U708,04U708, 04J708 | B3 | 03U078, 03L078 | B2 | 03U703 (OFFSET 65') | B1 | B13 (OFFSET 350') | 03U079,03L079 (OFFSET 110') | 03U710 | B11 | 03U003,03M003, 03L003,04U003, PJ003 | 03U672(PD2U3)

UNIT 1
UNIT 2
UNIT 3

430
170
57
120
170
79
300
45
2300
110
130
2300
56
1100
94
880
25
160
1.8
31
3.2
0.5
2.3
1.5
3.9
5.4
6.5
0.7
1.1
4.6
0.3
0.77J

100
10
1
5
1000

Opdc
Cjs
Csl

ELEV. 538.90

LEGEND:

100 — TRCLE CONTOUR IN ug/L (10–89)

100 — TRCLE CONTOUR IN ug/L (06–07)

VERTICAL SCALE
0 20
SCALE IN FEET

HORIZONTAL SCALE
0 100
SCALE IN FEET

figure 10-11

JUNE 2007 GROUNDWATER TRCLE DATA
CROSS SECTION C'-C"
TWIN CITIES ARMY AMMUNITION PLANT
Arden Hills, Minnesota

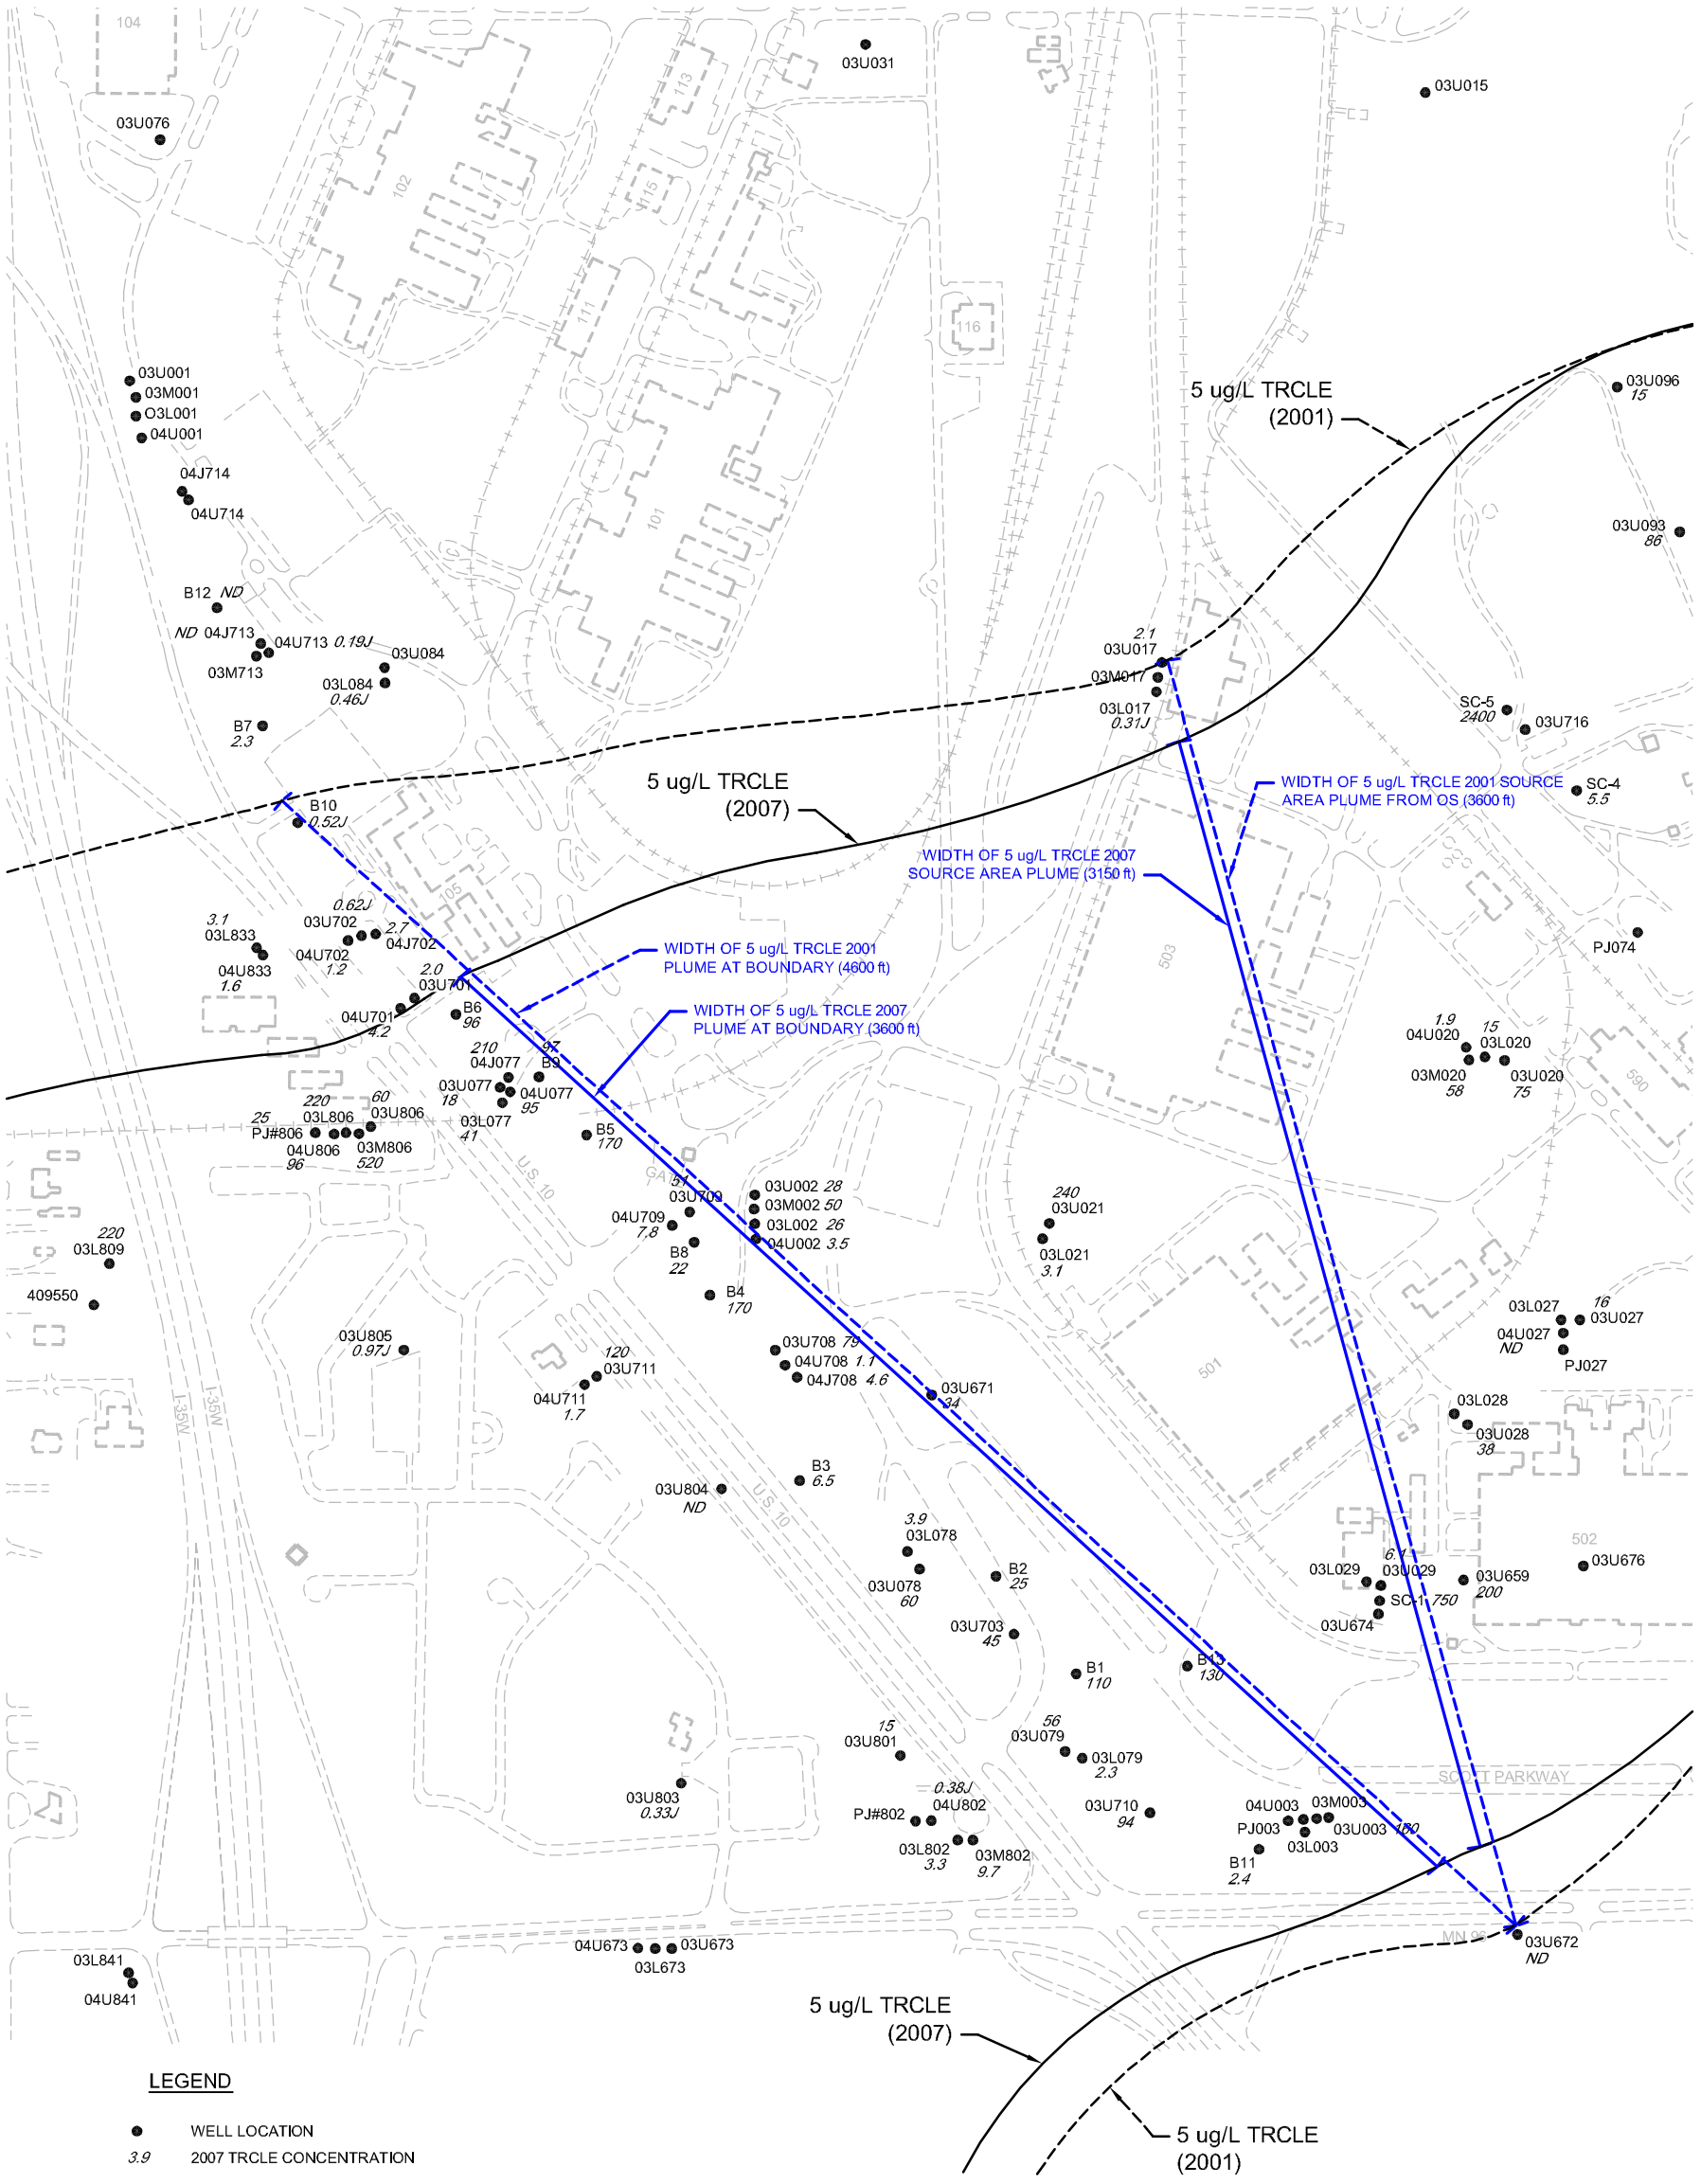

figure 10-12

TGRS ANNUAL MONITORING DATA - WEST PORTION
TRCLE CONCENTRATIONS (ug/L) JUNE 2007
TWIN CITIES ARMY AMMUNITION PLANT
Arden Hills, Minnesota

47533-43(002)GN-SP011 Jan 14/08

11.0 Operable Unit 3: Deep Groundwater

RECORD OF DECISION
Groundwater Remediation
Operable Unit 3
at New Brighton/Arden Hills Superfund Site
1992

RECORD OF DECISION AMENDMENT
For Operable Unit 3
New Brighton/Arden Hills Superfund Site
2006

A ROD Amendment was finalized in 2006 that significantly changed the remedy for OU3. The basis for the OU3 ROD Amendment was the "Groundwater Statistical Evaluation, OU3" technical memorandum, which received consistency on May 2, 2005. This document presented a statistical evaluation showing that the South Plume has been receding since at least 1996, including the period after the Plume Groundwater Recovery System (PGRS) was shut off in 2001. The South Plume had receded well upstream of the PGRS and the PGRS was basically pumping clean water. The ROD Amendment removed the need for a pump and treat remedy, eliminating the PGRS extraction well and treatment train.

The PGRS was an off-post groundwater extraction and treatment system and municipal potable water supply. The PGRS consisted of New Brighton Municipal Well #13 (NBM #13) and a GAC treatment plant. New Brighton used the water for municipal supply. The PGRS was designed to contain the South Plume of VOC contamination emanating from TCAAP and to prevent further downgradient migration. Recovered groundwater was treated and used by the City of New Brighton to fulfill its municipal water supply demand. Figure 11-1 presents an OU3 site plan.

The PGRS began operating on May 3, 1994. In 1997, the PGRS influent dropped to below the ROD required limits for all VOCs. In December 1999, under an agreement with the Agencies, the PGRS pumping rate was reduced from a nominal rate of 1,000 gpm to 400 gpm to help determine if the reductions in concentration were the result of actual plume decreases or the result of dilution from over pumping. In conjunction with the flow rate decrease, a quarterly monitoring program was undertaken to monitor for potential "rebound" in VOC concentrations. As of the end of FY 2000, no rebound was observed and a review of the historical database for all of OU3 and the associated source area in OU2 revealed that the entire South Plume had dramatically decreased in size and concentration since the early 1990s. The concentration decreases were such that the leading edge of the South Plume, at the PGRS, dropped below the ROD requirements.

The results of this evaluation were presented to the Agencies on September 6, 2000, and a report titled "Plume History Evaluation, Operable Unit 3", CRA, was submitted to the Agencies on October 10, 2000. The report documents the history of plume size and concentration reductions throughout OU3. Based on the dramatic reductions in plume size and concentration, the report recommended shutting down the PGRS. The Agencies subsequently accepted the recommendation. The City of New Brighton stopped significant pumping in August 2001 and the PGRS was maintained in standby status. During the period May 2003 through September 2003, the PGRS was operated solely to satisfy peak water supply demands and then was placed back into standby status. The PGRS remained in standby status throughout FY 2004, FY 2005, and FY 2006. The City conducted an evaluation of its municipal system to, in part, determine the future use of the PGRS extraction well and treatment system. The City decided the PGRS treatment system and well NBM #13 were not part of the City's long-term water supply plan. During FY 2007 the PGRS treatment system was dismantled and NBM #13 was abandoned.

11.1 REMEDY COMPONENT #1: MONITORED NATURAL ATTENUATION

Description: "Monitored natural attenuation." (OU3 ROD Amendment, page 17)

Performance Standard (how do you know when you're done):
When a monitoring program is established and monitoring is in compliance with the regulator approved Annual Monitoring Plan.

Is the remedy component being implemented?
Yes. Appendix A summarizes the FY 2007 monitoring plan and any deviations are explained in Appendix C.2. Details of the groundwater monitoring program are discussed in Section 11.2.

11.2 REMEDY COMPONENT #2: GROUNDWATER MONITORING

Description: "Monitoring of the groundwater for VOCs to verify the effectiveness of the selected remedy and the natural attenuation of the South Plume." (OU3 ROD Amendment, page 17)

Performance Standard (how do you know when you're done):
When a monitoring program is established and monitoring is in compliance with the regulator approved Annual Monitoring Plan.

Is the remedy component being implemented?
Yes. Appendix A summarizes the FY 2007 monitoring plan and any deviations are explained in Appendix C.2.

Groundwater samples were collected from sixteen OU3 wells in 2007 as part of the OU1, OU2, and OU3 comprehensive biennial sampling round. Samples were collected as specified in the monitoring plan and analyzed for VOCs by method SW846 8260. Well locations are shown on

Figure 11-1. The specific purpose of monitoring each well is provided in Appendix A. Water elevations were measured during monitoring events and are presented in Appendix D.1.

Table 11-1 presents a summary of the analytical results. Trichloroethylene concentrations in the downgradient sentry well, 04U863, remained less than 1.0 µg/l, as it has been since December 1999. TRCLE concentrations were also less than 1.0 µg/l in wells 03U673, 03L854, 04U860, 04U866, and 04J866. The other ten wells had TRCLE concentrations above the cleanup standard of 5 µg/l, ranging from 5.3 µg/l to 150 µg/l.

1,1,1-Trichloroethane and its degradation product 1,1-dichloroethane and 1,1-dichloroethene were present in three wells at the boundary between OU1 and OU3 (03L859, 04U859, and 04U832), indicating a commingling of the North Plume and the South Plume at these locations.

What were the results of the Statistical Analyses?

The Mann-Kendall statistical analysis was updated for nine edge-of-plume and center-of-plume wells sampled in 2007. Two wells that had been previously analyzed statistically were not statistically analyzed in 2007. Well 04U863, which is a sentry well downgradient of the south edge of the plume, was reclassified as outside of the plume in 2006 because of consistent TRCLE concentrations less than 1.0 µg/l since 1999. In addition, well 04U861 was abandoned in 2006. A summary of the statistical analysis for all nine wells is presented in Table 11-2. Individual spreadsheets and graphs presenting the Mann-Kendall test results for each well are provided in Appendix H.

The trend for 03M848, which has historically been the center of the South Plume, continued to be definitely decreasing. The TRCLE concentration has decreased from 700 µg/l in 1999 to 150 µg/l in 2007. Well 03M848 had the highest TRCLE concentration in the South Plume in 2007, at a concentration much lower than historic concentrations. The strong decrease in concentration at the core of the South Plume seems to indicate that the south plume is dissipating.

The statistical analysis for well 04U859, which is classified as a center-of-plume well and is at the boundary with OU1, indicates a stable trichloroethylene concentration since 1998; although, the trichloroethylene concentration decreased from 71 µg/l in 2005 to 60 µg/l in 2007. The presence of 1,1,1-trichloroethane, and its degradation products, which have historically been present in 04U859, indicates that the North Plume is present at this location and may be a factor in the stable trend.

The trend for five of seven edge-of-plume wells remained the same since the last statistical analysis. A stable trend continued for wells 03L673, 03L848, 04U673, and 4U845; while a decreasing trend was again noted at well 409548. Review of the graphs (and data) for wells 03L673, 03L848, 04U673, and 4U845 in Appendix H, if you exclude the 2001 and 2003 data for each of these four wells, the TRCLE concentrations have been steadily decreasing since 1999. The statistical conclusion for a sixth edge-of-plume well (04U848) changed from stable to no trend with all TRCLE concentrations below 6 µg/l since 1997.

The statistical conclusion for 04U832 changed from no trend to increasing as the concentration of trichloroethylene remained relatively stable at 56 µg/l in 2007 compared to 54 µg/l in 2006. The long-term trend (beyond the six sample events included in the statistical evaluation) of 04U832 is very consistent, with results between 29 µg/l and 56 µg/l since 1991, except for results in 2001 and 2003 of approximately 4 µg/l that cause the increasing statistical evaluation. In addition, 1,1,1-trichloroethane and its degradation products were present in 04U832, which they historically have been, indicating that the North Plume is commingling with the South Plume at this well also and may be a factor in the statistical trends. It should be noted that in contrast to well 04U832, the trend at well 409548, which is near 04U832 at the downgradient edge of the South Plume has a decreasing statistical trend with all concentrations below 3 µg/l since 1995.

In summary, based on the data collected in 2007, the center of the South Plume, represented by 03M848, exhibits a strong trend of decreasing concentrations, while the edge of the South Plume appears stable. A stable trend at the edge of the plume indicates that the South Plume is not

expanding. In addition, the presence of 1,1,1-trichloroethane, and its degradation products at wells near the OU1-OU3 boundary indicates that the North Plume is commingling with the South Plume and may be a factor in the trends noted at the wells near the boundary.

Are contingency actions warranted?

The OU3 ROD Amendment requires contingency actions to be considered when the Mann-Kendall statistical analysis shows that a well at the edge of the South Plume has an increasing trend. The edge-of-plume and center-of-plume wells analyzed in 2007 are identified on Table 11-2.

The 2008 groundwater monitoring event will be an annual event. Only two wells are scheduled for sampling in 2008 (03M848 at the center of the plume and 04U863 as a sentinel well downgradient of the plume). Because of the increasing trend observed at 04U832 and the overall stable trend of the wells at the edge of the plume, two wells will be added to the 2008 sampling event as a contingency action. Wells 04U832 and 04U845 will again be sampled in 2008 as a contingency action, as they were in 2006 (these wells were also sampled as part of the larger biannual sampling event in 2007). This will result in five consecutive years of sampling these two wells after the 2009 biennial sampling event is complete, providing enough data to determine if the low concentrations observed in 2001 and 2003 were an aberration.

What groundwater monitoring is proposed before the next report?

The OU3 monitoring requirements presented in Table 11-3 are proposed. Appendix A presents the FY 2007 – FY 2011 monitoring plan.

11.3 REMEDY COMPONENT #3: DRILLING ADVISORIES

Description: "Continued implementation of the drilling advisories that regulates the installation of new private wells within OU3 as a Special Well Construction Area." (OU3 ROD Amendment, page 17)

Performance Standard (how do you know when you're done):
When the MDH has issued a Special Well Construction Area Advisory.

Has the MDH issued a Special Well Construction Area Advisory?
Yes. It was issued in June 1996. The Special Well Construction Area encompasses OU1, OU3, and the OU2 Site A shallow groundwater plume. In June 1999, the MPCA requested that the MDH extend the boundary of the Special Well Construction Area further to the southwest to the Mississippi River and Marshall Avenue to ensure that the southern boundary fully encompassed the plume. The MDH revised the Special Well Construction Area in December 1999. The current boundary is shown on Figure E-1 (Appendix E).

Are any changes or additional actions required for this remedy component?
No.

11.4 OVERALL REMEDY FOR OU3

Is the Remedy for OU3 Operating in Compliance with the OU3 ROD and OU3 ROD Amendment?
Yes. In FY 2007, groundwater monitoring took place as prescribed in the Annual Monitoring Plan. The comprehensive biennial sampling round of FY 2007 indicates that the South Plume footprint remains stable, with decreasing concentrations at the center of the plume.

Are any changes or additional actions required for OU3?

Yes. Two wells (04U832 and 04U845) are proposed for monitoring in 2008 as a contingency action because of statistical trends noted at the edge of the plume.

Four OU3 wells that were recommended for abandonment in FY 2007 have not yet been abandoned. These four wells (04U852, 04U864, 04U865, and 04J864) will be abandoned in FY 2008.

Monitoring well 04U861 was abandoned in February 2006 at the request of the City of New Brighton to allow for property redevelopment. The Army has committed to replacing 04U861 when the City completes property redevelopment. The schedule for redevelopment is uncertain; however, redevelopment is not expected to progress enough to allow for a replacement well to be installed in FY 2008.

TABLE 11-1

GROUNDWATER QUALITY DATA (µg/L)
OPERABLE UNIT 3, TCAAP
FISCAL YAR 2007

Well	Date		Trichloroethene	1,1,1-Trichloroethane	1,1,2-Trichloroethane	1,1-Dichloroethane	1,1-Dichloroethene	cis-1,2-Dichloroethene	Vinyl Chloride	Carbon Tetrachloride	Chloroform	Freon 113	Methylene Chloride	Tetrachloroethene	trans-1,2-Dichloroethene	1,2-Dichloroethane
OU3 Cleanup Level [(1)]			*5*	*200*	*3*	*70*	*6*	*70*								
03L673	6/21/07		110	< 1	< 1	0.45 JP	0.49 JP	5.3	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
03L848	6/21/07		5.4	< 1	< 1	< 1	< 1	0.58 JP	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
03L848	6/21/07	D	5.3	< 1	< 1	< 1	< 1	0.56 JP	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
03L854	6/21/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
03L859	6/21/07		9	4.2	< 1	4.3	1.6	0.87 JP	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
03M848	6/21/07		150	< 1	< 1	0.61 JP	0.73 JP	8.2	< 1	< 1	< 1	< 1	< 1	0.36 JP	< 1	< 1
03U673	6/21/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
04J866	6/22/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
04U673	6/21/07		42	< 1	< 1	< 1	0.16 JP	1.5	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
04U832	6/22/07		56	3.6	< 1	4.1	5	3.9	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
04U845	6/22/07		15	< 1	< 1	< 1	< 1	0.77 JP	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
04U848	6/21/07		5.3	< 1	< 1	< 1	< 1	0.2 JP	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
04U854	6/21/07		11	< 1	< 1	< 1	< 1	0.5 JP	< 1	< 1	0.77 JP	< 1	< 1	< 1	< 1	< 1
04U859	6/21/07		60	16	< 1	7.8	11	2.7	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
04U860	6/21/07		0.37 JP	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
04U860	6/22/07	D	0.33 JP	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
04U863	6/22/07		0.44 JP	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
04U866	6/22/07		0.18 JP	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1

Notes:

(1) Cleanup levels for OU3 are from the OU3 ROD. Shading indicates exceedance of the cleanup level.

D - Duplicate analysis.

JP - Results are less than the reporting limit, but greater than the instrument detection limit. Value is estimated.

TABLE 11-2

MANN-KENDALL STATISTICAL SUMMARY
OPERABLE UNIT 3, TCAAP
FISCAL YEAR 2007

Well	*Kendall S*	*Number of Data Points*	*Raw Trend*	*Confidence*	*Coefficient of Varience*	*Raw Trend Decision*	*MAROS Conclusion*	*June 2007 TRCLE Conc.*
Edge of Plume Wells								
03L673	-3	6	Decreasing	64.00%	0.8170	Stable or No Trend	Stable	110
03L848	-5	6	Decreasing	76.50%	0.4363	Stable or No Trend	Stable	5.4
409548	-13	6	Decreasing	99.17%	0.4384	Definite	Decreasing	1.3
04U673	-1	6	Decreasing	50.00%	0.6647	Stable or No Trend	Stable	42
04U832	11	6	Increasing	97.20%	0.7484	Definite	Increasing	56
04U845	-1	6	Decreasing	50.00%	0.7472	Stable or No Trend	Stable	15
04U848	1	6	Increasing	50.00%	0.6984	Stable or No Trend	No Trend	5.3
Center of Plume Wells								
03M848	-13	6	Decreasing	99.17%	0.5924	Definite	Decreasing	150
04U859	-1	6	Decreasing	50.00%	0.6991	Stable or No Trend	Stable	60

TABLE 11-3

SUMMARY OF GROUNDWATER MONITORING REQUIREMENTS
OPERABLE UNIT 3, TCAAP

FISCAL YEAR 2007

	Remedy Component	*Monitoring Requirements*	*Implementing Party*	*Documents Containing the Monitoring Plan*
#1	Monitored Natural Attenuation	Outlined below.		
#2	Groundwater Monitoring	a. Water levels for use in drawing contour maps.	Alliant	OU3 Monitoring Plan in Annual Report
		b. Groundwater sampling to track progress of clean-up and attenuation of plume.	Alliant	OU3 Monitoring Plan in Annual Report
#3	Drilling Advisories	a. Verification that drilling advisories are in place and functioning as intended.	Army/MDH	NA
OR:	Overall Remedy	a. Water quality monitoring to verify attainment of clean-up goals.	Alliant	OU3 Monitoring Plan in Annual Report

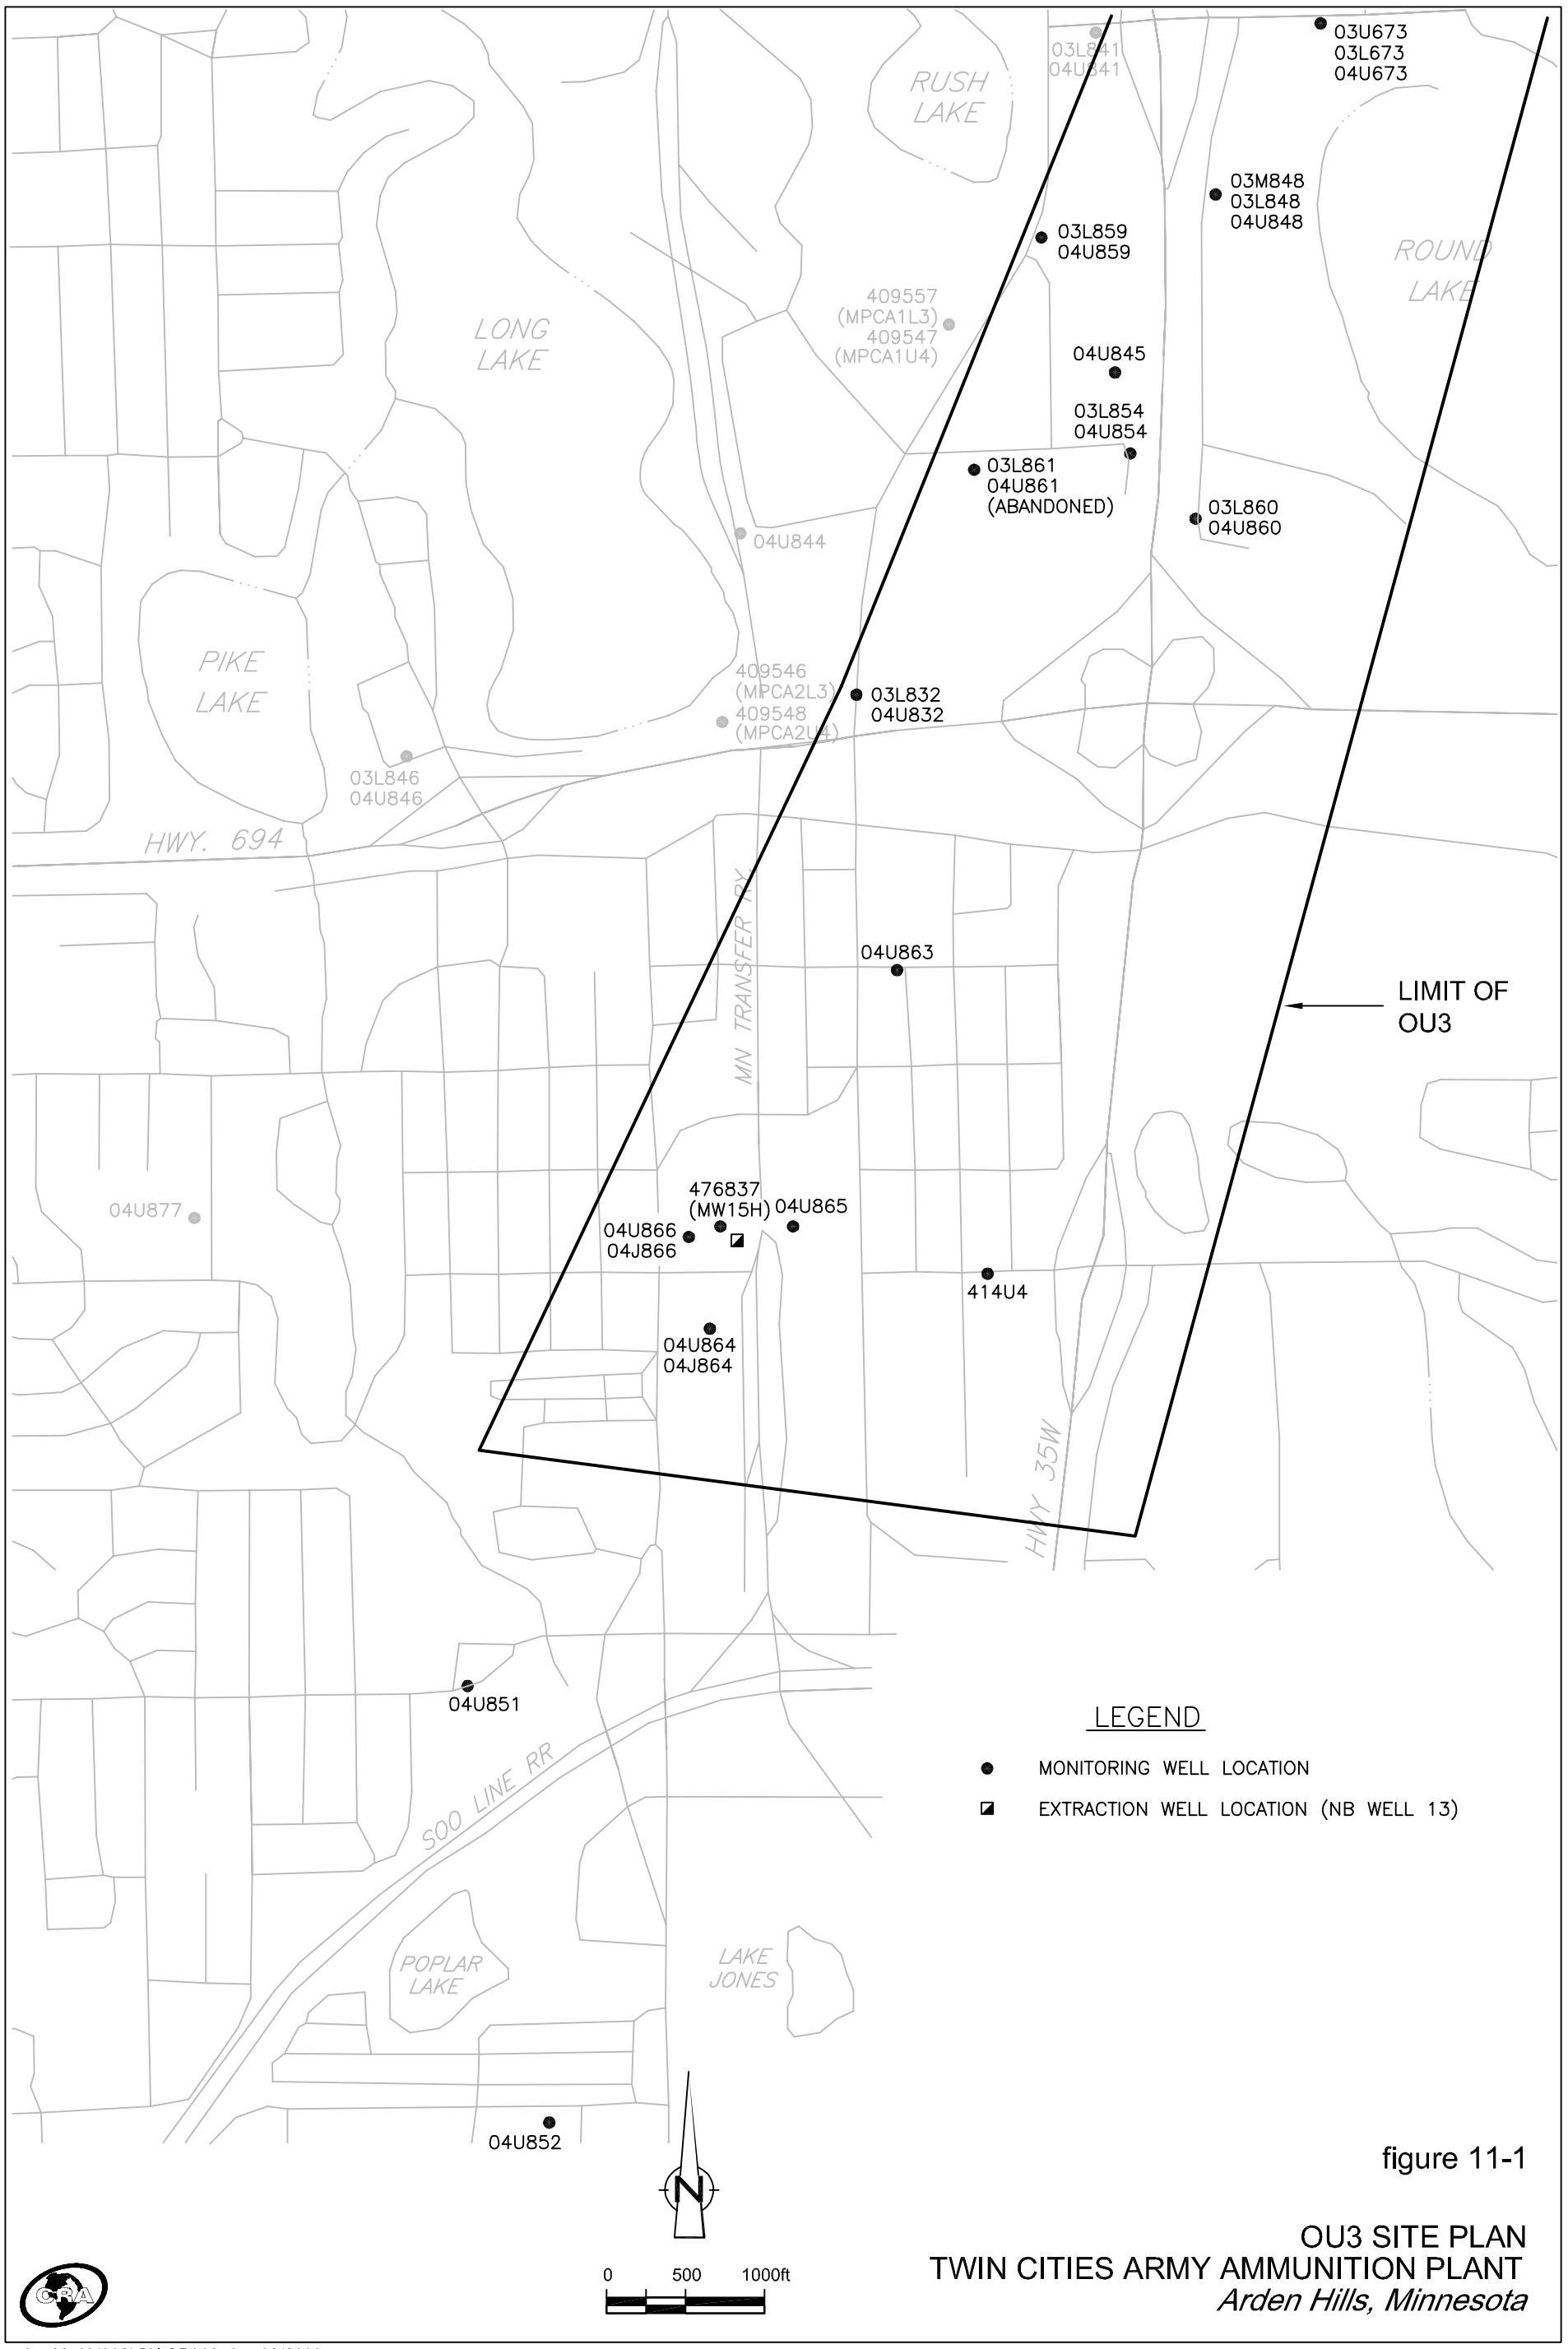

figure 11-1

OU3 SITE PLAN
TWIN CITIES ARMY AMMUNITION PLANT
Arden Hills, Minnesota

47533-43(002)GN-SP003 Jan 09/2008

12.0 Land Use Controls

Has a Land Use Control Implementation Plan (LUCIP) been prepared to address land use control (LUC) issues and is it being implemented?

The Army prepared a LUCIP for TCAAP, dated February 2003. During FY 2007, the Army and National Guard continued to implemented the LUCIP. Although the LUCIP is already being implemented, it has not been approved by the USEPA and MPCA. In light of apparent resolution in 2005 of a national-level debate between the USEPA and Department of Defense (DOD) regarding LUC enforcement, TCAAP needs to resolve installation LUC issues with the USEPA (Region V) and MPCA.

Was the annual site inspection for land use controls conducted in FY 2007, as specified in the LUCIP?

On July 24 2007, the Army, National Guard, and Wenck conducted the annual inspection of TCAAP sites. The checklist that was completed during the inspection is included as Appendix J.

Were any items requiring additional actions identified in the annual site inspection?

It was noted that after the Site C soil remedy is completed in late 2007 the checklist will need to be revised to address the new soil cover.

13.0 Other Installation Restoration Activities During FY 2007

Appendix I briefly summarizes the status of other activities at TCAAP that are related to the Installation Restoration Program, but are not required in the RODs for OU1 through OU3.

13.1 BUILDING 102

In FY 2005, a report was prepared documenting the existence of a VOC plume in the Unit 1 aquifer at Building 102. The findings are documented in a report titled:

> *"Groundwater Investigation Report for Building102, Twin Cities Army Ammunition Plant, Prepared by Wenck Associates Inc. and Keres Consulting Inc., January 2006"*

It was agreed to by the Army, USEPA, and MPCA that quarterly groundwater monitoring would be conducted beginning in June 2006. It was also agreed that the FY 2006 report would begin to document the results at Building 102. There is currently not a remedy in place for Building 102 and it is not addressed as part of the OU2 ROD or the OU2 QAPP. An Engineering Evaluation/Cost Analysis (EE/CA) is currently in preparation at the end of FY 2007. Specifically the QAPP portion of the EE/CA has been completed for Building 102. The complete EE/CA will formalize the monitoring requirements and remedy selection for Building 102. For FY 2007, this section is intended only to document the sampling results.

Four rounds of samples were collected in FY 2007. In June 2007 three new monitoring wells were installed at Building 102. These were all deep nested Unit 1 wells at the locations of existing shallow Unit 1 wells. The new wells were sampled in the June and September sampling rounds. This work will be documented and evaluated fully in the EE/CA.

Figure 13-1 shows the location of Building 102 at TCAAP. Table 13-1 presents the groundwater monitoring data for FY 2007 and Figure 13-2 shows the VOC plume, represented by trichloroethene. Figure 13-3 shows the groundwater elevation contours. The plume exists within the Unit 1 aquifer at Building 102. The investigation report evaluated natural attenuation factors for the plume and found contradictory evidence. As such, the recommendation was made, and agreed upon, to conduct an EE/CA for the Building 102 site (including a site-specific QAPP).

Table 13-1
Building 102 Groundwater Quality Data

Fiscal Year 2007

			Tetrachloroethene (ug/l)	Trichloroethene (ug/l)	cis-1,2-Dichloroethene (ug/l)	trans-1,2-Dichloroethene (ug/l)	1,1-Dichloroethene (ug/l)	Vinyl Chloride (ug/l)	1,1,1,2-Tetrachloroethane (ug/l)	1,1,1-Trichloroethane (ug/l)	1,1,2,2-Tetrachloroethane (ug/l)	1,1,2-Trichloroethane (ug/l)	1,1-Dichloroethane (ug/l)	1,2,3-Trichloropropane (ug/l)
01U578		12/12/06	<1	<1	<1	<1	<1	<1	---	<1	<1	<1	<1	---
01U578		3/13/07	<1	JP 0.37 (UB0.3)	<1	<1	<1	<1	---	<1	<1	<1	<1	---
01U578		6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U578		9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U579		12/12/06	<1	22	5.9	<1	<1	<1	---	<1	<1	<1	<1	---
01U579		3/13/07	<1	38	22	<1	<1	1.6	---	<1	<1	<1	<1	---
01U579		6/20/07	<1	64	27	<1	<1	JP 0.44	<1	<1	<1	<1	<1	<1
01U579		9/11/07	<1	42	18	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U579	D	9/11/07	<1	41	19	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U580		12/12/06	<20	6800	3400	JP 15	JP 8.6	<20	---	<20	<20	<20	<20	---
01U580		3/13/07	<20	16,000	4100	39	JP 11	JP 19	---	<20	<20	<20	<20	---
01U580	D	3/13/07	<20	17,000	4400	39	JP 9.3	JP 16	---	<20	<20	<20	<20	---
01U580		6/20/07	<40	11,000	3100	JP 33	<40	JP 13 (JQ)	<40	<40	<40	<40	<40	<40
01U580	D	6/20/07	<40	12,000	3100	JP 33	<40	<40	<40	<40	<40	<40	<40	<40
01U580		9/11/07	<20	900	220	20	JP 4.6	<20	<20	<20	<20	<20	<20	<20
01U581		12/12/06	<1	<1	JP 0.94	<1	<1	<1	---	<1	<1	<1	<1	---
01U581		3/13/07	JP 0.15	JP 0.46 (UB0.3)	6.6	<1	<1	<1	---	<1	<1	<1	<1	---
01U581		6/20/07	<1	<1	JP 0.41	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U581		9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01L581		12/12/06	<1	8.9	6.2	9.4	<1	<1	---	<1	<1	<1	<1	---
01L581	D	12/12/06	<1	9.4	6.1	9.3	<1	<1	---	<1	<1	<1	<1	---
01L581		3/13/07	<1	9.7	6.8	8.9	<1	JP 0.19	---	<1	<1	<1	<1	---
01L581		6/20/07	<1	8.1	7.0	9.0	<1	JP 0.24	<1	<1	<1	<1	<1	<1
01L581		9/11/07	<1	8.1	7.4	8.3	<1	<1	<1	<1	<1	<1	<1	<1
01L581	D	9/11/07	<1	8.2	7.6	8.4	<1	<1	<1	<1	<1	<1	<1	<1
01U582		12/12/06	<1	<1	<1	<1	<1	<1	---	<1	<1	<1	<1	---
01U582		3/13/07	<1	<1	<1	<1	<1	<1	---	<1	<1	<1	<1	---
01U582		6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U582		9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01L582		6/20/07	<1	JP 0.21 (UB0.41)	25	JP 0.99	<1	JP 0.32	<1	<1	<1	<1	<1	<1
01L582	D	6/20/07	<1	<1	26	1.1	<1	JP 0.37	<1	<1	<1	<1	<1	<1
01L582		9/11/07	<1	<1	27	1.2	<1	<1	<1	<1	<1	<1	<1	<1
01U583		12/12/06	JP 0.70	JP 0.19	<1	<1	<1	<1	---	<1	<1	<1	<1	---
01U583		3/13/07	JP 0.57	JP 0.19 (UB0.3)	<1	<1	<1	<1	---	<1	<1	<1	<1	---
01U583		6/20/07	JP 1.0	JP 0.29 (UB0.41)	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U583		9/11/07	1.2	JP 0.47	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1

Table 13-1
Building 102 Groundwater Quality Data

Fiscal Year 2007

		Tetrachloroethene (ug/l)	Trichloroethene (ug/l)	cis-1,2-Dichloroethene (ug/l)	trans-1,2-Dichloroethene (ug/l)	1,1-Dichloroethene (ug/l)	Vinyl Chloride (ug/l)	1,1,1,2-Tetrachloroethane (ug/l)	1,1,1-Trichloroethane (ug/l)	1,1,2,2-Tetrachloroethane (ug/l)	1,1,2-Trichloroethane (ug/l)	1,1-Dichloroethane (ug/l)	1,2,3-Trichloropropane (ug/l)
01L583	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01L583	9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U584	12/12/06	<1	<1	<1	<1	<1	<1	---	<1	<1	<1	<1	---
01U584	3/13/07	<1	<1	<1	<1	<1	<1	---	<1	<1	<1	<1	---
01U584	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01U584	9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01L584	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
01L584	9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
03U001	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1
03U076	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1	<1

Notes:

Bolding (in red color) indicates detection of the compound.

--- Not sampled.

D Duplicate sample.

JP The value is below the reporting level, but above the method detection limit. Results should be considered estimated.

JQ The value is considered estimated due to poor spectral confirmation on the presence of this analyte.

JS The percent recovery for the matrix spike was outside QC limits (the percent recovery is listed after "JS"). The sample result could be biased high if the recovery is above 100%, or biased low if the recovery is below 100%.

RC Data is rejected due to low response in a calibration standard (the response is listed after "RC").

UB The sample result was less than 5 times the level detected in a blank (the result for the blank is listed after "UB"). The sample result can be considered non detect at an elevated detection limit.

Table 13-1
Building 102 Groundwater Quality Data

Fiscal Year 2007

			1,2-Dibromo -3-Chloro propane (ug/l)	1,2-Dibromo ethane (ug/l)	1,2-Dichloro ethane (ug/l)	1,2-Dichloro propane (ug/l)	1,3-Dichloro propane (ug/l)	2-Butanone (ug/l)	2-Hexanone (ug/l)	4-Methyl-2-Pentanone (ug/l)	Acetone (ug/l)	Benzene (ug/l)	Bromo dichloro methane (ug/l)	Bromoform (ug/l)	Bromo methane (ug/l)	Carbon Disulfide (ug/l)	Carbon Tetra chloride (ug/l)	Chloro benzene (ug/l)
01U578		12/12/06	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U578		3/13/07	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U578		6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U578		9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U579		12/12/06	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U579		3/13/07	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U579		6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U579		9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U579	D	9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U580		12/12/06	---	---	<20	<20	---	<100	<100	<100	<100	<20	<20	<20	<20	<20	<20	<20
01U580		3/13/07	---	---	<20	<20	---	<100	<100	<100	<100	<20	<20	<20	<20	<20	<20	<20
01U580	D	3/13/07	---	---	<20	<20	---	<100	<100	<100	<100	<20	<20	<20	<20	<20	<20	<20
01U580		6/20/07	<40	<40	<40	<40	<40	<200 (RC.043)	<200	<200	<200	<40	<40	<40	<40	<40	<40	<40
01U580	D	6/20/07	<40	<40	<40	<40	<40	<200 (RC.043)	<200	<200	<200	<40	<40	<40	<40	<40	<40	<40
01U580		9/11/07	<20	<20	<20	<20	<20	<100 (RC.026)	<100	<100	<100	<20	<20	<20	<20	<20	<20	<20
01U581		12/12/06	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U581		3/13/07	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U581		6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U581		9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L581		12/12/06	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L581	D	12/12/06	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L581		3/13/07	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L581		6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L581		9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L581	D	9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U582		12/12/06	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U582		3/13/07	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U582		6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U582		9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L582		6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5 (JS74)	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L582	D	6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L582		9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U583		12/12/06	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U583		3/13/07	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U583		6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U583		9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1

Table 13-1
Building 102 Groundwater Quality Data

Fiscal Year 2007

		1,2-Dibromo -3-Chloro propane (ug/l)	1,2-Dibromo ethane (ug/l)	1,2-Dichloro ethane (ug/l)	1,2-Dichloro propane (ug/l)	1,3-Dichloro propane (ug/l)	2-Butanone (ug/l)	2-Hexanone (ug/l)	4-Methyl-2-Pentanone (ug/l)	Acetone (ug/l)	Benzene (ug/l)	Bromo dichloro methane (ug/l)	Bromoform (ug/l)	Bromo methane (ug/l)	Carbon Disulfide (ug/l)	Carbon Tetra chloride (ug/l)	Chloro benzene (ug/l)
01L583	6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L583	9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U584	12/12/06	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U584	3/13/07	---	---	<1	<1	---	<5	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U584	6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01U584	9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L584	6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
01L584	9/11/07	<1	<1	<1	<1	<1	<5 (RC.026)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
03U001	6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1
03U076	6/20/07	<1	<1	<1	<1	<1	<5 (RC.043)	<5	<5	<5	<1	<1	<1	<1	<1	<1	<1

Table 13-1
Building 102 Groundwater Quality Data

Fiscal Year 2007

			Chloro ethane (ug/l)	Chloroform (ug/l)	Chloro methane (ug/l)	cis-1,3-Dichloro propene (ug/l)	Dibromo chloro methane (ug/l)	Dibromo methane (ug/l)	Dichloro difluoro methane (ug/l)	Ethyl benzene (ug/l)	m&p-Xylene (ug/l)	Methylene Chloride (ug/l)	Methyl -t-butyl Ether (ug/l)	o-Xylene (ug/l)	Styrene (ug/l)	Toluene (ug/l)	trans-1,3-Dichloro propene (ug/l)	Trichloro fluoro methane (ug/l)
01U578		12/12/06	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U578		3/13/07	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U578		6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U578		9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U579		12/12/06	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U579		3/13/07	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U579		6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U579		9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U579	D	9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U580		12/12/06	<20	<20	<20	<20	<20	---	---	<20	<40	<20	---	<20	<20	<20	<20	---
01U580		3/13/07	<20	<20	<20	<20	<20	---	---	<20	<40	<20	---	<20	<20	<20	<20	---
01U580	D	3/13/07	<20	<20	<20	<20	<20	---	---	<20	<40	<20	---	<20	<20	<20	<20	---
01U580		6/20/07	<40	<40	<40	<40	<40	<40	<40	<40	<80	<40	<40	<40	<40	<40	<40	<40
01U580	D	6/20/07	<40	<40	<40	<40	<40	<40	<40	<40	<80	<40	<40	<40	<40	<40	<40	<40
01U580		9/11/07	<20	<20	<20	<20	<20	<20	<20	<20	<40	<20	<20	<20	<20	<20	<20	<20
01U581		12/12/06	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U581		3/13/07	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U581		6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U581		9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01L581		12/12/06	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01L581	D	12/12/06	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01L581		3/13/07	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01L581		6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01L581		9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01L581	D	9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U582		12/12/06	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U582		3/13/07	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U582		6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U582		9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01L582		6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01L582	D	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01L582		9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U583		12/12/06	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U583		3/13/07	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U583		6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U583		9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1

Table 13-1
Building 102 Groundwater Quality Data

Fiscal Year 2007

		Chloro ethane (ug/l)	Chloroform (ug/l)	Chloro methane (ug/l)	cis-1,3-Dichloro propene (ug/l)	Dibromo chloro methane (ug/l)	Dibromo methane (ug/l)	Dichloro difluoro methane (ug/l)	Ethyl benzene (ug/l)	m&p-Xylene (ug/l)	Methylene Chloride (ug/l)	Methyl -t-butyl Ether (ug/l)	o-Xylene (ug/l)	Styrene (ug/l)	Toluene (ug/l)	trans-1,3-Dichloro propene (ug/l)	Trichloro fluoro methane (ug/l)
01L583	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01L583	9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U584	12/12/06	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U584	3/13/07	<1	<1	<1	<1	<1	---	---	<1	<2	<1	---	<1	<1	<1	<1	---
01U584	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01U584	9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01L584	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
01L584	9/11/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
03U001	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1
03U076	6/20/07	<1	<1	<1	<1	<1	<1	<1	<1	<2	<1	<1	<1	<1	<1	<1	<1

TWIN CITIES ARMY AMMUNITION PLANT

Location of Building 102

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 13-1

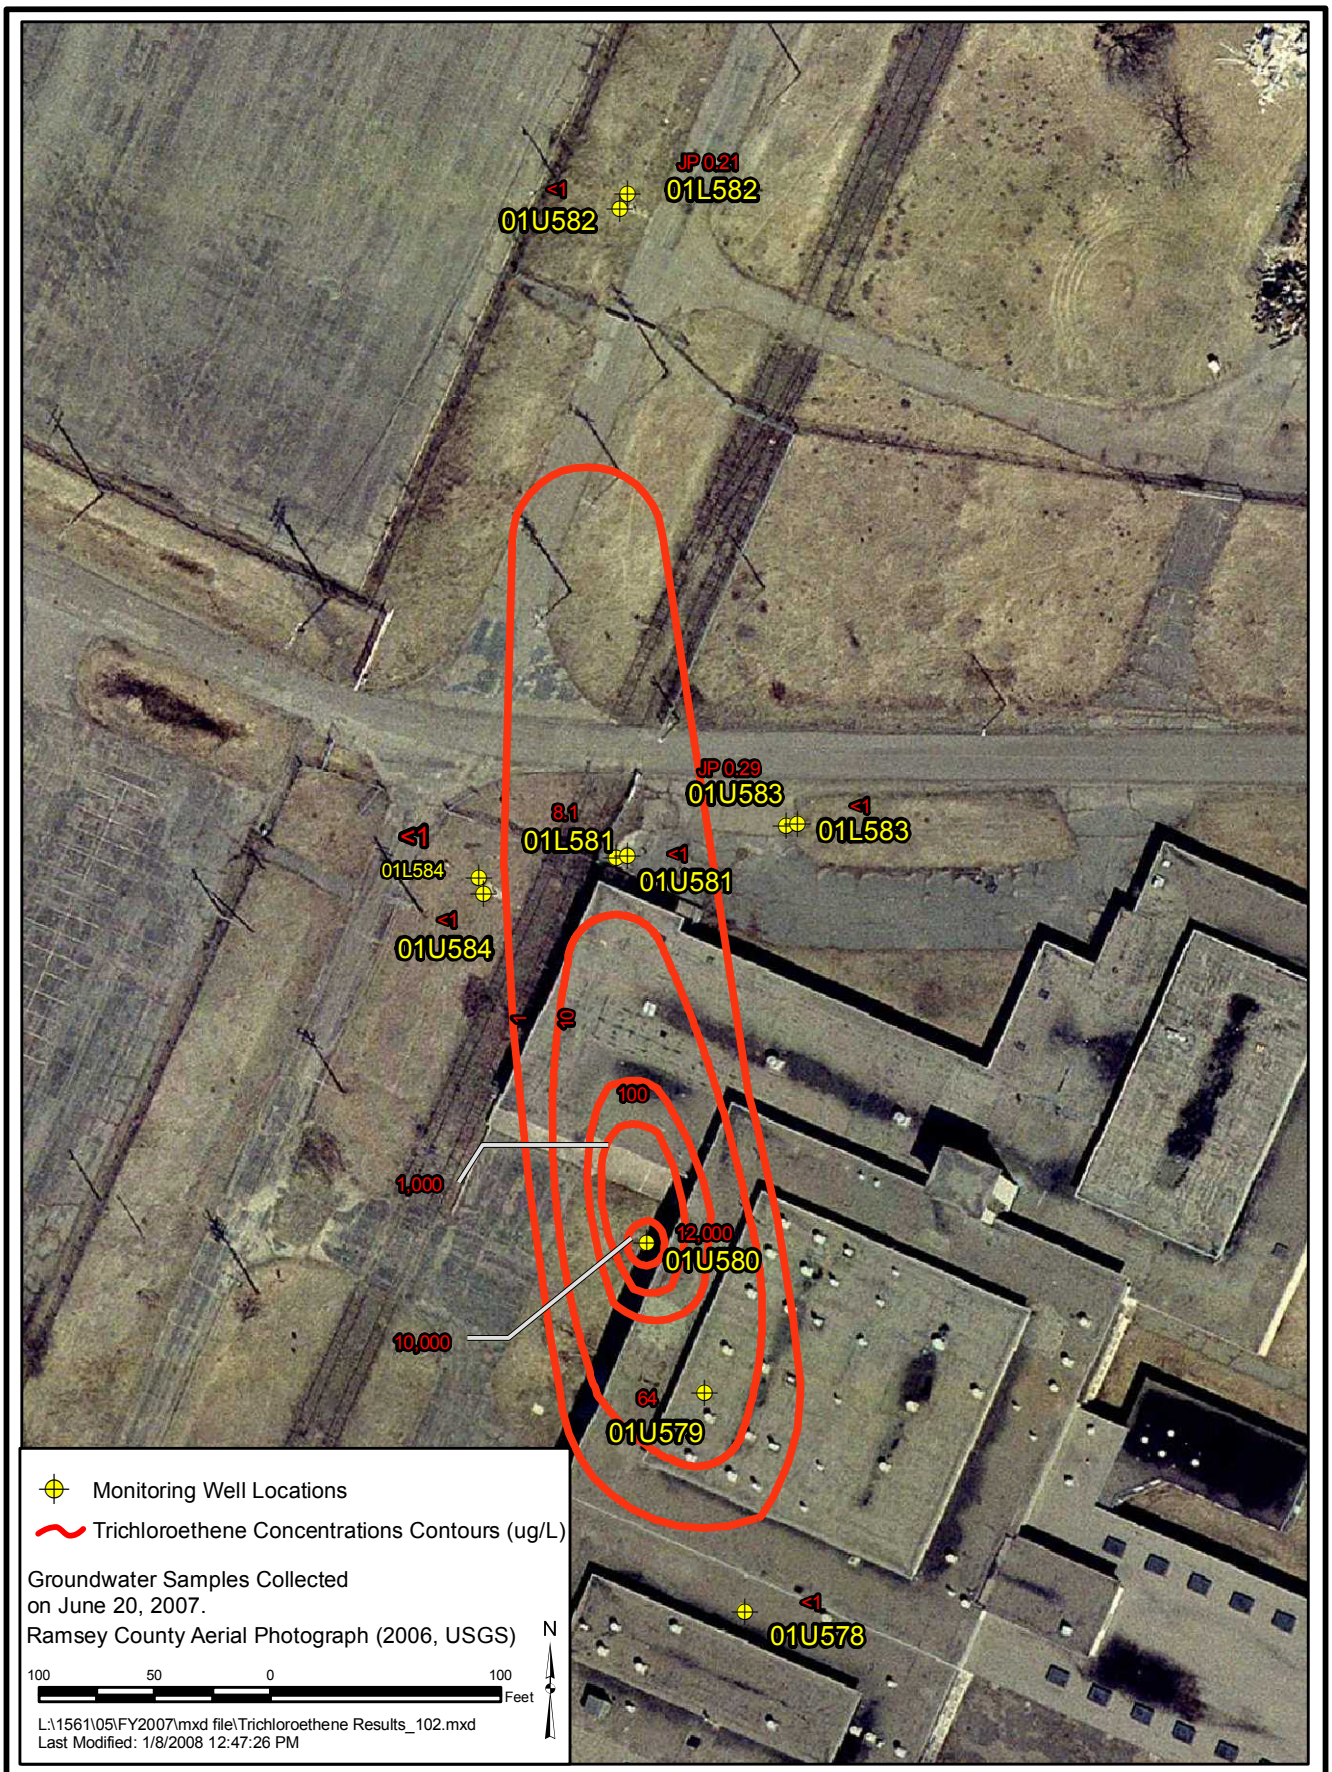

TWIN CITIES ARMY AMMUNITION PLANT

Trichloroethene Results

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 13-2

Legend

- Groundwater Elevation Contour (Feet) (Add 800 to obtain NGVD Elevation)
- Monitoring Well Locations

03U013
03M013
03L013
01U052 74.50
74
75
76
77
78
01U128 74.05
01U605 77.91
482083 78.55
79
80
81
82
83
482085 86.87
482084 85.88
03U083
01U047 73.55
PJ#504
01U048 73.86
01U607 85.22
01U603 77.10
01U613 85.71
01U604 76.23
01U612 79.83
01U602 84.53
01U611 85.07
01U617 76.56
01U627 76.33
01U609 85.83
01U601 85.57
01U628 76.73
01U615 75.74
01U625 76.47
01U608 85.48
01U621 77.61
01U624 77.66
03U621 (52.32)
01U620 78.00
01U616 78.08
03U075
01U626 76.73
01U618 79.16
01U065 73.81
01U619 83.79
01L582 79.22
01U582
01L581 82.80
01U581
01U583
01L584 82.33
01L583 82.73
01U584
03U031
01U580 83.47
01U579 83.70
03U076
01U578 83.99

2006 Aerial Photograph (Source: LMIC)
Notes:
1. Lowest well in well nests used for contouring.
2. Water levels in parenthesis (52.32) were not used for contouring.
3. Groundwater elevations measured 6/20/07 for Building 102 and 6/04/07 for Site K

N

200 100 0 200
Feet

Mxd: L:\1561\05\FY2007\mxd file\Water Level Contour Map_102.mxd
Last Modified: 5/7/2008 8:20:07 AM

TWIN CITIES ARMY AMMUNITION PLANT

Water Level Contour Map - Unit 1 (June - 2007)

COPYRIGHT

Wenck
Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure 13-3

14.0 References

Argonne National Laboratory, 1991. "Installation Restoration Program: Remedial Investigation Report for the Twin Cities Army Ammunition Plant." Final Report, April 1991.

Barr Engineering Company, 1995. "Final Conceptual Design Report, Containment/Production Wells." February 1995.

Conestoga-Rovers & Associates, 1986. "Groundwater Remediation Program Plan (GRPP)." June 1986.

Conestoga-Rovers & Associates, 1987. "BGRS Extraction Well Pumping Test." April 1987.

Conestoga-Rovers & Associates, 1988. "IRA-BGRS Performance Assessment Report." August 1988.

Conestoga-Rovers & Associates, 1991. "IRA-TGRS: 1989 Annual Monitoring Report and Monitoring Plan." June 1991.

Conestoga-Rovers & Associates, 1999. "Predesign Investigation Work Plan, Site K." February 1999.

Conestoga-Rovers & Associates, 2001. "Predesign Investigation Report, Site K." December 2001.

"Federal Facility Agreement." August 12, 1997.

Fuller, D.B., 1994. Personal Communication from David Fuller, Federal Cartridge Company to William P. Johnsen, Wenck Associates, Inc. December 13, 1994.

Montgomery Watson, 1995. "Operable Unit 1 Alternate Water Supply Plan." Final Report, October 1995.

Montgomery Watson, 1996. "Remedial Design/Remedial Action, Quality Assurance Project Plan." September 1996.

Montgomery Watson, 1997. "Operable Unit 2 Feasibility Study." Final Report, March 1997.

Montgomery Watson, 1999. "Final Alternate Water Supply Construction Report for Period 1997 through 1998". March 1999 (updated April 17, 2000 and August 2, 2000).

OU1 Technical Group, 2005. "Technical Memorandum, Statistical Evaluation Method for Operable Unit 1 Water Quality Data." Final Report, December 2005.

"Record of Decision (ROD) for Gradient Control System for TCAAP." 1987.

"Record of Decision, Groundwater Remediation Operable Unit 3 at New Brighton/Arden Hills Superfund Site." 1992, Amended 2006.

"Record of Decision, Groundwater Remediation Operable Unit 1 at New Brighton/Arden Hills Superfund Site." 1993, Amended 2006.

Tecumseh/Wenck Installation Support Services, 2003. "Land Use Control Implementation Plan." February 2003.

Tecumseh/Wenck Installation Support Services, 2003. "Quality Assurance Project Plan for Performance Monitoring." Revision 3, December 10, 2003.

"Twin Cities Army Ammunition Plant, New Brighton/Arden Hills Superfund Site, Operable Unit 2, Record of Decision." 1997.

Appendix A

FY 2007 – FY 2011 Monitoring Plans

A.1 Groundwater Monitoring Wells

APPENDIX A.1
FY 2007 – FY 2011 MONITORING PLAN
FOR GROUNDWATER MONITORING WELLS

Unit Designations:

01U - Upper Fridley Formation	03L - Lower Hillside Formation	SL - St. Lawrence
01L - Lower Fridley Formation	SP - St. Peter	UNK - Unknown
03U - Upper Hillside Formation	PC - Prairie du Chien	
03M - Middle Hillside Formation	J - Jordan	

Notes:

(A) Indicates that the monitoring is the responsibility of Alliant.

(B) Indicates that the monitoring is the responsibility of the Army.

(1) "L (A or B)" denotes a water level measurement by the appropriate party.

(2) "Q (A or B)" denotes a water quality sampling by the appropriate party. The required analyte list for each specific site is shown in Appendix A.4.

(3) The designations refer to the following purposes:

- ❖ Operable Unit 1 Water Quality
  - – 1.a = To contour the perimeter of the plume which defines the area of concern for alternate water supply/well abandonment
  - – OR = Overall remedy. To evaluate attainment of the cleanup levels throughout the plume
- ❖ Operable Unit 1 Water Levels
  - – 3.b = To contour water levels for evaluation of containment
- ❖ Site A Water Quality
  - – OR = Overall remedy. To evaluate attainment of the cleanup levels throughout the plume
- ❖ Site A Water Levels
  - – 2.b = To contour water levels for evaluation of containment
- ❖ Site I Water Quality
  - – 1.a = To track remedy progress
  - – OR = Overall remedy. To evaluate attainment of the cleanup levels throughout the plume
- ❖ Site I Water Levels
  - – 1.a = To track remedy progress
- ❖ Site K Water Quality
  - – OR = Overall remedy. To evaluate attainment of the cleanup levels throughout the plume
- ❖ Site K Water Levels
  - – 3.a = To contour water levels for evaluation of containment
- ❖ TGRS Water Quality
  - – OR = Overall remedy. To evaluate attainment of the cleanup levels throughout the plume
- ❖ TGRS Water Levels
  - – 1.a = To contour water levels for evaluation of containment
- ❖ Operable Unit 3 Water Quality
  - – OR = Overall remedy. To evaluate attainment of the cleanup levels throughout the plume
- ❖ Operable Unit 3 Water Levels
  - – 2.a = To contour water levels for evaluation of containment

(4) Sample if in production at time of sample collection.

(5) Sample extraction well annually or biennially, as shown, since it is no longer being pumped.

(6) Wells 04U414 and 04U851 monitored every 5 years during event preceding 5-year review

(7) Sample annually for five years (FY 2003 through FY 2007) to verify that there have been no adverse impacts to groundwater due to shallow soil remediation work.

(8) Of the two wells, well 01U639 will be the primary sampling location and 482089 (I04MW) will be the alternate sampling location. If it is not possible to collect a groundwater sample from 01U639, then an attempt will be made to collect a sample from 482089 (I04MW).

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
Operable Unit 1			Note: Changes from the monitoring plan presented in the previous Annual Performance Report are highlighted in this appendix.								
03U	03U811			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
03U	03U821			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
03U	03U822			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	None	
03U	03U831			---	---	---	---	---		None	abandoned 2006
03U	409550	PCA 6U3		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	None	
03U	409596	BS118U3		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	None	
03M	03M843			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	None	
03L	03L811			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
03L	03L822			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	None	
03L	03L832			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	None	
03L	03L841			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	None	
03L	03L846			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	None	
03L	03L853			---	---	---	---	---	OR	None	
03L	409556	PCA4L3		Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	None	
03L	409557	PCA1L3		Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	None	
03L	409597	BS118L3		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	None	
PC	04U821			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	04U834			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	None	
PC	04U836	MW-1		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	04U837	MW-3		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	04U838	MW-5		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	04U839	MW-7		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	04U841			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	04U843			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	3.b	
PC	04U844			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	04U846			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	04U847			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	04U849			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	04U850			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
PC	04U855			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	3.b	
PC	04U871			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	3.b	
PC	04U872			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	3.b	
PC	04U875			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	3.b	
PC	04U877			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	3.b	
PC	04U879			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	3.b	
PC	04U880			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	3.b	
PC	04U881			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	None	
PC	04U882			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	None	
PC	04U883			Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	None	
PC	191942	BS118U4		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	200154	UM Golf Course		Q(B)	---	Q(B)	---	Q(B)	1.a, OR	---	
PC	200814	American Linen		---	---	---	---	---	---	---	
PC	206688	Cloverpond		Q(B)	---	Q(B)	---	Q(B)	1.a, OR	---	
PC	234547	Honywell Ridgway		---	---	---	---	---	---	---	
PC	409547	PCA1U4		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	409548	PCA2U4		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	409549	PCA3U4		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	409555	PCA5U4		Q,L(B)	---	Q,L(B)	---	Q,L(B)	1.a, OR	3.b	
PC	512761	Gross Golf Course #2		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
PC	554216	New Brighton #14									See Appendix A.2
PC	582628	New Brighton #15									See Appendix A.2
J	04J822			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	3.b	
J	04J834			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	None	
J	04J835			---	---	---	---	---	---	---	
J	04J836	MW-2		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
J	04J837	MW-4		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
J	04J838	MW-6		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
J	04J839	MW-8		Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	3.b	
J	04J847			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	3.b	
J	04J849			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	3.b	
J	04J882			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	None	
J	200524	St. Anthony #5	(4)	Q(B)	---	Q(B)	---	Q(B)	OR	---	Army gets St. Anthony Data
J	200803	St. Anthony #4	(4)	Q(B)	---	Q(B)	---	Q(B)	OR	---	Army gets St. Anthony Data

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
J	206796	New Brighton #5									See Appendix A.2
J	206797	New Brighton #6									See Appendix A.2
PC/J	200804	St. Anthony #3	(4)	Q(B)	---	Q(B)	---	Q(B)	OR	---	Army gets St. Anthony Data
PC/J	200812	Gross Golf #1		---	---	---	---	---	---	---	
PC/J	206792	New Brighton #4									See Appendix A.2
PC/J	206793	New Brighton #3									See Appendix A.2
PC/J	233221	R&D Systems, N. Well		---	---	---	---	---	---	---	
PC/J	234549	Reiner		Q(B)	---	---	---	---	1.a, OR	---	Well out of service
PC/J	PJ#318			Q,L(B)	---	Q,L(B)	---	Q,L(B)	OR	None	
UNK	234546	Honywell Ridgway		Q(B)	---	Q(B)	---	Q(B)	OR	---	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
Operable Unit 2											
Site A Removal Action											
01U	01U038			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U039			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U040			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U041			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U063			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U067			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U102			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U103			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U104			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U105			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U106			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U107			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U108			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U110			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U115			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U116			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U117			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U118			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U119		(7)	Q,L(B)	L(B)	L(B)	L(B)	L(B)	(Note 7)	2.b	See Page 2 of Appendix A.4
01U	01U120			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U125			---	---	---	---	---	OR	2.b	
01U	01U126			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U127			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U133			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U135			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U136			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U137			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
01U	01U138			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U139			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U140			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U141			L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U145	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U146	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U147	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U148	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U149	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U150	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U151	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U152	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U153	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U154	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U155	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U156	Piezometer		L(B)	L(B)	L(B)	L(B)	L(B)	---	2.b	
01U	01U157			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U158			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U350			---	---	---	---	---	---	---	
01U	01U351	EW-1									See Appendix A.2
01U	01U352	EW-2									See Appendix A.2
01U	01U353	EW-3									See Appendix A.2
01U	01U354	EW-4									See Appendix A.2
01U	01U355	EW-5		---	---	---	---	---	---	---	
01U	01U356	EW-6		---	---	---	---	---	---	---	
01U	01U357	EW-7		---	---	---	---	---	---	---	
01U	01U358	EW-8		---	---	---	---	---	---	---	
01U	01U901			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U902			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U903			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	
01U	01U904			Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	Q,L(B)	OR	2.b	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
Site I Remedial Action											
01U	01U064			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	1a, OR	1a, OR	
01U	01U632			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	1a, OR	1a, OR	
01U	01U636			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	1a, OR	1a, OR	
01U	01U639		(8)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	1a, OR	1a, OR	
01U	01U640			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	1a, OR	1a, OR	
01U	01U666			L(A)	L(A)	L(A)	L(A)	L(A)	---	1a, OR	
01U	01U667			Q,L(A)	L(A)	L(A)	L(A)	L(A)	---	1a, OR	
01U	01U668			L(A)	L(A)	L(A)	L(A)	L(A)	---	1a, OR	
01U	482086	I01MW		Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	1a, OR	1a, OR	
01U	482087	I05MW		Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	1a, OR	1a, OR	
01U	482088	I02MW		Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	1a, OR	1a, OR	
01U	482089	I04MW	(8)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	1a, OR	1a, OR	
01U	482090	I03MW		L(A)	L(A)	L(A)	L(A)	L(A)	---	1a, OR	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
Site K Remedial Action											
01U	01U047			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U048			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U052			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U065			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U128			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	
01U	01U601			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U602			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U603			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	
01U	01U604			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	
01U	01U605			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U607			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U608			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U609			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U611			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	
01U	01U612			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U613			L(A)	L(A)	L(A)	L(A)	L(A)	OR	3.a	
01U	01U615			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	
01U	01U616			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U617			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	
01U	01U618			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	
01U	01U619			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	
01U	01U620			L(A)	L(A)	L(A)	L(A)	L(A)	OR	3.a	
01U	01U621			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	
01U	01U624			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U625			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U626			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U627			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	01U628			L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
01U	482083	K04-MW		Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	
01U	482084	K02-MW		L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
01U	482085	K01-MW		L(A)	L(A)	L(A)	L(A)	L(A)	---	3.a	
03U	03U621			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	3.a	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
TCAAP Groundwater Recovery System											
03F	03F302	B1									See Appendix A.2
03F	03F303	B2	(5)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
03F	03F304	B3									See Appendix A.2
03F	03F305	B4									See Appendix A.2
03F	03F306	B5									See Appendix A.2
03F	03F307	B6									See Appendix A.2
03F	03F308	B7	(5)	Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03F	03F312	B11									See Appendix A.2
03F	03F319	B13									See Appendix A.2
03U	03U001			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U002			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U003			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U004			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U005			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U007			Q,L(A)	---	Q,L(A)	---	Q,L(A)	Background	1.a	
03U	03U008			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U009			Q,L(A)	---	Q,L(A)	---	Q,L(A)	Background	1.a	
03U	03U010			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U011			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U012			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U013			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U014			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U015			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U016			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U017			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U018			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U019			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U020			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
03U	03U021			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U022			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U023			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U024			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U025			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U026			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U027			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U028			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U029			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U030			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U031			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U032			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U075			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U076			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U077			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U078			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U079			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U082			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U083			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U084			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U087		(7)	Q(B),L(A)	---	L(A)	---	L(A)	(Note 7)	1.a	See Page 2 of Appendix A.4
03U	03U088			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U089		(7)	Q(B),L(A)	---	L(A)	---	L(A)	(Note 7)	1.a	See Page 2 of Appendix A.4
03U	03U090			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U092			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U093		(7)	Q,L(A),Q(B)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR, (Note 7)	1.a	See Page 2 of Appendix A.4
03U	03U094			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
03U	03U096			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U097		(7)	Q(B)	---	---	---	---	(Note 7)	---	See Page 2 of Appendix A.4
03U	03U099			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
03U	03U111			L(A)	---	L(A)	---	L(A)	---	1.a	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
03U	03U112			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U113			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U114			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U121			---	---	---	---	---	---	---	
03U	03U129			---	---	---	---	---	---	---	
03U	03U301	SC1									See Appendix A.2
03U	03U314	SC2									See Appendix A.2
03U	03U315	SC3	(5)	Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U316	SC4	(5)	Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U317	SC5									See Appendix A.2
03U	03U521			---	---	---	---	---	---	---	
03U	03U647			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U648			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U658			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U659			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U671			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U672			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U674			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U675			---	---	---	---	---	---	---	
03U	03U676			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U701			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U702			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U703			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U704			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U705			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U706			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U707			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U708			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
03U	03U709			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U710			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U711			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
03U	03U715			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U716			L(A)	---	L(A)	---	L(A)	---	1.a	
03U	03U801			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
03U	03U803			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U804			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U805			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03U	03U806			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
03U	519288	E101-MW		---	---	---	---	---	---	---	
03U	519289	E102-MW		---	---	---	---	---	---	---	
03U	519290	E103-MW		---	---	---	---	---	---	---	
03M	03M001			L(A)	---	L(A)	---	L(A)	---	1.a	
03M	03M002			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03M	03M003			L(A)	---	L(A)	---	L(A)	---	1.a	
03M	03M004			L(A)	---	L(A)	---	L(A)	---	1.a	
03M	03M005			L(A)	---	L(A)	---	L(A)	---	1.a	
03M	03M007			L(A)	---	L(A)	---	L(A)	---	1.a	
03M	03M010			L(A)	---	L(A)	---	L(A)	---	1.a	
03M	03M012			L(A)	---	L(A)	---	L(A)	---	1.a	
03M	03M013			L(A)	---	L(A)	---	L(A)	---	1.a	
03M	03M017			L(A)	---	L(A)	---	L(A)	---	1.a	
03M	03M020			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03M	03M713			L(A)	---	L(A)	---	L(A)	---	1.a	
03M	03M802			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
03M	03M806			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
03L	03L001			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L002			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L003			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L004			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L005			L(A)	---	L(A)	---	L(A)	---	1.a	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
03L	03L007			Q,L(A)	---	Q,L(A)	---	Q,L(A)	Background	1.a	
03L	03L010			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L012			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L013			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L014			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L017			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L018			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L020			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L021			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L027			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L028			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L029			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L077			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L078			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L079			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L080			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L081			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L084			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L113			L(A)	---	L(A)	---	L(A)	---	1.a	
03L	03L802			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
03L	03L806			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
03L	03L809			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
03L	03L833			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC	04U001			L(A)	---	L(A)	---	L(A)	---	1.a	
PC	04U002			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC	04U003			L(A)	---	L(A)	---	L(A)	---	1.a	
PC	04U007			Q,L(A)	---	Q,L(A)	---	Q,L(A)	Background	1.a	
PC	04U012			L(A)	---	L(A)	---	L(A)	---	1.a	
PC	04U020			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC	04U027			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
PC	04U077			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC	04U510			Q,L(A)	---	Q,L(A)	---	Q,L(A)	Background	1.a	
PC	04U701			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC	04U702			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC	04U708			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC	04U709			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC	04U711			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
PC	04U713			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC	04U714			L(A)	---	L(A)	---	L(A)	---	1.a	
PC	04U802			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
PC	04U806			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
PC	04U833			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
J	04J077			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
J	04J702			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
J	04J708			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
J	04J713			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
J	04J714			L(A)	---	L(A)	---	L(A)	---	1.a	
PC/J	PJ#003			L(A)	---	L(A)	---	L(A)	---	1.a	
PC/J	PJ#027			L(A)	---	L(A)	---	L(A)	---	1.a	
PC/J	PJ#309	B8									See Appendix A.2
PC/J	PJ#310	B9									See Appendix A.2
PC/J	PJ#311	B10	(5)	Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC/J	PJ#313	B12	(5)	Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	1.a	
PC/J	PJ#802			L(A)	---	L(A)	---	L(A)	---	1.a	
PC/J	PJ#806			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	1.a	
---	Staff Gauges			L(A)	---	L(A)	---	L(A)	---	---	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
Unit 1 Wells											
01U	01U035			---	---	---	---	---	---	---	
01U	01U043			---	---	---	---	---	---	---	
01U	01U044			---	---	---	---	---	---	---	
01U	01U045			---	---	---	---	---	---	---	
01U	01U046			---	---	---	---	---	---	---	
01U	01U060		(7)	Q(B)	Q(B)	Q(B)	Q(B)	Q(B)	(Note 7)	---	Monitoring continued after 2007
01U	01U072			---	---	---	---	---	---	---	
01U	01U085			---	---	---	---	---	---	---	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
Operable Unit 3											
03U	03U673			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	2.a	
03M	03M848			Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	2.a	
03L	03L673			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	2.a	
03L	03L832			L(A)	---	L(A)	---	L(A)	---	2.a	
03L	03L848			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	2.a	
03L	03L854			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	2.a	
03L	03L859			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	2.a	
03L	03L860			L(A)	---	L(A)	---	L(A)	---	2.a	
03L	03L861			---	---	---	---	---	---	---	Abandoned FY06
03L	476837	MW15H		---	---	---	---	---	---	---	
PC	04U414	414U4	(6)	---	---	Q,L(A)	---	---	OR	2.a	
PC	04U673			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	2.a	
PC	04U832			Q,L(A)	Q,L(A)	Q,L(A)	---	Q,L(A)	OR	2.a	Contingency Action for FY08
PC	04U845			Q,L(A)	Q,L(A)	Q,L(A)	---	Q,L(A)	OR	2.a	Contingency Action for FY08
PC	04U848			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	2.a	
PC	04U851		(6)	---	---	Q,L(A)	---	---	OR	2.a	
PC	04U852			---	---	---	---	---	---	---	Proposed for Abandonment
PC	04U854			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	2.a	
PC	04U859			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	2.a	
PC	04U860			Q,L(A)	---	Q,L(A)	---	Q,L(A)	OR	2.a	
PC	04U861			---	---	---	---	---	---	---	Abandoned FY06
PC	04U863	323U4		Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	Q,L(A)	OR	2.a	
PC	04U864	324U4		--	--	--	--	--	--	--	Proposed for Abandonment
PC	04U865	325U4		---	--	---	--	---	---	---	Proposed for Abandonment
PC	04U866	326U4		Q,L(A)	--	Q,L(A)	--	Q,L(A)	OR	2.a	
PC	520931	NBM #13		--	--	--	--	--	--	--	Abandoned FY07

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
J	04J864	324 J		--	--	--	--	--	--	--	Proposed for Abandonment
J	04J866	326 J		Q,L(A)	--	Q,L(A)	--	Q,L(A)	OR	2.a	

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
Other Installation Restoration Activities											
TCAAP Well Inventory											
(Entries under "Notes" refer to the well inventory category)											
---	234356	Nordquist, Bob	1a	---	---	Q(B)	---	---	Well Inventory	---	1873 Old Hwy 8
---	249608	Rapit Printing, Inc	1a	---	---	Q(B)	---	---	Well Inventory	---	2520 Larpenteur Ave
---	433298	Town & Cntry Golf Crse	1a	---	---	Q(B)	---	---	Well Inventory	---	2279 Marshall Ave
---	509052	Shriners Hospital	1a	---	---	Q(B)	---	---	Well Inventory	---	2025 E River Rd
---	S00311	Inglebrech, Brenda	1a	---	---	Q(B)	---	---	Well Inventory	---	1390 Silver Lake Rd
---	S00444	Mnpls Parks & Rec Dept	1a	---	---	Q(B)	---	---	Well Inventory	---	Ontario & E River Rd
---	200173	KSTP Radio TV	1b	---	---	Q(B)	---	---	Well Inventory	---	3415 University Ave
---	234355	Kingdom Hall	1b	---	---	Q(B)	---	---	Well Inventory	---	1987 Mound St
---	234421	BioChem	1b	---	---	Q(B)	---	---	Well Inventory	---	2151 Mustang Dr
---	234469	Palwski, T.	1b	---	---	Q(B)	---	---	Well Inventory	---	2816 Hwy 88
---	234544	R&D Systems	1b	---	---	Q(B)	---	---	Well Inventory	---	2201 Kennedy St NE
---	249632	Montzka, Harold	1b	---	---	Q(B)	---	---	Well Inventory	---	2301 N Upland Crest NE
---	537801	Midwest Industrial	1b	---	---	Q(B)	---	---	Well Inventory	---	4759 Old Hwy 8
---	200180	Town & Cntry Golf Crse	1c	---	---	Q(B)	---	---	Well Inventory	---	2279 Marshal Ave
---	200522	Pemtom	1c	---	---	Q(B)	---	---	Well Inventory	---	Silver Lake Rd
---	200523	Pemtom	1c	---	---	Q(B)	---	---	Well Inventory	---	Silver Lake Rd & Co Rd E
---	756236	Pechiney Plastic Pckging	1c	---	---	Q(B)	---	---	Well Inventory	---	150 26th Ave SE
---	S00437	Northern Star Co.	1c	---	---	Q(B)	---	---	Well Inventory	---	3171 5th St SE
---	107405	Anderson, Paul	2a	---	---	Q(B)	---	---	Well Inventory	---	4355 Hwy 10
---	249007	Walton, Reggie	2a	---	---	Q(B)	---	---	Well Inventory	---	4453 Hwy 10
---	249113	Wyttenbach, Daniel	2a	---	---	Q(B)	---	---	Well Inventory	---	990 11th Ave NW
---	127537	Midwest Asphalt	2b	---	---	Q(B)	---	---	Well Inventory	---	1400 Old Hwy 8
---	200176	Waldorf Paper Products	2b	---	---	Q(B)	---	---	Well Inventory	---	2236 Myrtle Ave
---	234571	Leiser, Mark	2b	---	---	Q(B)	---	---	Well Inventory	---	1901 17th St NW
---	S00002	Midland Hills Cntry Club	2b	---	---	Q(B)	---	---	Well Inventory	---	2001 N Fulham St
---	200076	Old Dutch Foods, Inc.	2c	---	---	Q(B)	---	---	Well Inventory	---	2375 Terminal Rd

APPENDIX A.1

FY 2007 - FY 2011 MONITORING PLAN FOR GROUNDWATER MONITORING WELLS

Well Information									Purpose For Monitoring (3)		
Unit	Well I.D.	Common Name	Notes	June 07	June 08	June 09	June 10	June 11	Water Quality	Water Level	Comments
---	236029	R&D Systems, S. Well	2c	---	---	Q(B)	---	---	Well Inventory	---	2201 Kennedy St NE
---	236439	Waldorf Paper Products	2c	---	---	Q(B)	---	---	Well Inventory	---	2250 Wabash Ave
---	249150	Coldor, Lisa	4a	---	---	Q(B)	---	---	Well Inventory	---	3511 Stinson Blvd NE
---	249185	Novotny, Mark	4a	---	---	Q(B)	---	---	Well Inventory	---	1706 Malvern St
---	249191	Wells, Henry	4a	---	---	Q(B)	---	---	Well Inventory	---	1651 Millwood Ave
---	S00294	Western Remodelers	4a	---	---	Q(B)	---	---	Well Inventory	---	2520 W Larpenteur Ave
---	S00295	Alfson, Loren	4a	---	---	Q(B)	---	---	Well Inventory	---	2351 Summer St
---	S00409	Ohara, Rose	4a	---	---	Q(B)	---	---	Well Inventory	---	3553 Stinson Blvd NE
---	S00608	Grundtner, James	4a	---	---	Q(B)	---	---	Well Inventory	---	136 Oakwood Dr
---	---	Beach, Larry	4a	---	---	Q(B)	---	---	Well Inventory	---	1615 Silver Lake Rd
---	---	City of New Brighton	4a	---	---	Q(B)	---	---	Well Inventory	---	19 14th St NW
---	---	Burton, Jason	4a	---	---	Q(B)	---	---	Well Inventory	---	2073 Tenth St NW
---	---	Tabaika, Dorothy	4a	---	---	Q(B)	---	---	Well Inventory	---	2512 27th Ave NE
---	---	Willig, Allan	4a	---	---	Q(B)	---	---	Well Inventory	---	2600 Pahl Ave
---	---	Weisenberger, Heidi	4a	---	---	Q(B)	---	---	Well Inventory	---	2816 Silver Lake Rd
---	---	Hinton/Hermes	4a	---	---	Q(B)	---	---	Well Inventory	---	2935 Old Hwy 8
Grenade Range											
---	653903	GR1-1		---	---	---	---	---	OR	---	
---	653904	GR1-2		---	---	---	---	---	OR	---	
---	653905	GR2-1		---	---	---	---	---	OR	---	
---	675976	GR-DF1		---	---	---	---	---	OR	---	

A.2 Remedial Treatment Systems

APPENDIX A.2
FY 2007 - FY 2011 MONITORING PLAN
FOR REMEDIAL TREATMENT SYSTEMS

OU1: DEEP GROUNDWATER (1)

Location	Sampling Frequency	Parameters
• Extraction Wells NBM#4, #14, and #15	- Monthly	- Pumping Volumes
(and also NBM#3, #5, and #6)	- Monthly	- Water Quality (2)
• PGAC Effluent	- Monthly	- Water Quality (2)

OU2: SITE A SHALLOW GROUNDWATER

Location	Sampling Frequency	Parameters
• Extraction Wells (EW1 through EW4)	- Monthly	- Pumping Volumes
	- Annual	- Water Levels
	- Annual	- Water Quality (2)
• Extraction/Discharge System Effluent	- Monthly	- Trichloroethene; 1,1,1-Trichloroethane; 1,2-Dichloroethene (cis and trans); and Mercury (3)

OU2: SITE K REMEDIAL ACTION

Location	Sampling Frequency	Parameters
• Extracted Groundwater	- Monthly	- Pumping Volume
• Treatment System Effluent [Outfall 391 (010)]	- See Appendix A.3	- See Appendix A.3

OU2: TCAAP GROUNDWATER RECOVERY SYSTEM (TGRS)

Location	Sampling Frequency	Parameters
• Extraction Wells	- Monthly	- Pumping Volumes
	- Semi-Annually	- Water Levels
	- Semi-Annually	- Water Quality (2)
• Treatment System Influent	- Monthly	- Pumping Volumes
	- Monthly	- Water Quality (2)
• Treatment System Effluent	- Monthly	- Water Quality (2)

Notes:

(1) Performed by the City of New Brighton using their Sampling and Analysis Plan.

(2) The required analyte list for each specific site is presented in Appendix A.4.

(3) Site A effluent sampling frequency and parameters are as required by the MCES Special Discharge Permit (#2194).

A.3 Surface Water

APPENDIX A.3
FY 2007 - FY 2011 MONITORING PLAN
FOR SURFACE WATER

Analysis	Analytical Method	Units	Site K Effluent (Outfall 010)
Flow Rate	- -	M gal/day	Continuous
Total Flow	- -	M gal	M
pH	(field)	(pH)	Q
Cyanide	9012A	µg/l	Q
Copper	6020	µg/l	Q
Lead	6020	µg/l	Q
Mercury	7470A	µg/l	Q
Phosphorus (Total)	365.4	µg/l	Q
Silver	6020	µg/l	Q
Silver	7761	µg/l	- -
Zinc	6020	µg/l	Q
Trichloroethene	8260B	µg/l	Q
1,1-Dichloroethene	8260B	µg/l	Q
1,1-Dichloroethane	8260B	µg/l	Q
Cis-1,2-Dichloroethene	8260B	µg/l	Q
Trans-1,2-Dichloroethene	8260B	µg/l	Q
Vinyl Chloride	8260B	µg/l	Q
1,2-Dichloroethane	8260B	µg/l	Q

Notes:

M = Measurement required once per month

Q = Analysis required once per quarter

A.4 Site Specific Lists of Required Analytes

APPENDIX A.4
SITE SPECIFIC LISTS OF REQUIRED ANALYTES

Note: Cleanup levels (in ug/l) from each Record of Decision are shown below for use in determining the required method detection limits. Also note that these lists represent the minimum list of analytes. A larger analyte list may be utilized by the monitoring organization, if so desired.

OU1 (DEEP GROUNDWATER) (1)

1,1-Dichloroethane	70
1,1-Dichloroethene	6
cis-1,2-Dichloroethene	70
1,1,1-Trichloroethane	200
1,1,2-Trichloroethane	3
Trichloroethene	5

SITE A (SHALLOW GROUNDWATER) (2)

Antimony*	6
1,1-Dichloroethene	6
1,2-Dichloroethane	4
Benzene	10
Chloroform	60
cis-1,2-Dichloroethene	70
Tetrachloroethene	7
Trichloroethene	30

*Antimony is only monitored at these wells: 01U103, 01U902 and 01U904.

SITE I (SHALLOW GROUNDWATER) (2)

1,2-Dichloroethene (cis and trans)	70
Trichloroethene	30
Vinyl Chloride	0.2

SITE K (SHALLOW GROUNDWATER) (2)

1,2-Dichloroethene (cis and trans)	70
Trichloroethene	30

OU2 (DEEP GROUNDWATER) (2)

1,1,1-Trichloroethane	200
1,1-Dichloroethane	70
1,1-Dichloroethene	6
1,2-Dichloroethane	4
cis-1,2-Dichloroethene	70
Tetrachloroethene	5
Trichloroethene	5

OU3 (DEEP GROUNDWATER) (3)

1,1-Dichloroethane	70
1,1-Dichloroethene	6
cis-1,2-Dichloroethene	70
1,1,1-Trichloroethane	200
1,1,2-Trichloroethane	3
Trichloroethene	5

Notes:

(1) From page 18 of the OU1 Record of Decision.

(2) From Table 1 of the OU2 Record of Decision.

(3) From Page 26 of the OU3 Record of Decision.

Analytical Methods:

VOCs: SW-846 Method 8260B

Antimony: SW-846 Method 6020

APPENDIX A.4 (cont'd)
SITE SPECIFIC LISTS OF REQUIRED ANALYTES

OTHER INSTALLATION RESTORATION ACTIVITIES

WELL INVENTORY SAMPLING

VOCs (report full VOC list)

OU2 SHALLOW SOIL SITE 5-YEAR GROUNDWATER MONITORING

01U119 (Site A)	complete
03U093 (Site D)	complete
03U089 (Site E)	complete
01U060 (Site H)	Metals (antimony, arsenic, copper, lead, manganese), hardness
03U087 (Site 129-3)	complete
03U097 (Site 129-5)	complete

Analytical Methods:

VOCs: SW-846 Method 8260B
Metals: SW-846 Method 6020
Explosives (nitroglycerine): SW-846 Method 8332
SVOCs (bis (2-ethylhexyl) phthalate): SW-846 Method 8270C
PCBs: SW-846 Method 8082
Radionuclides (gross alpha/gross beta): EPA Method 900.0
Radionuclides (radium 226/radium 228): EPA Method 9315/9320

A.5 Site C Monitoring Plan

Appendix A.5
Site C Monitoring Plan
Twin Cities Army Ammunition Plant

	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec
Surface Water Sampling	*(Total numbers of samples are shown, excluding field duplicates.)*											
SW-1 through 8 (three consecutive days):												
Lead (dissolved) [2]				24	24	24	24	24	24	24		
Copper (dissolved) [2]				24								
Total Hardness				24								
EDTA				8[1]								
Groundwater Sampling												
MW-4, 6, 8, 9, 10, 11, 12, & 16:												
Lead (dissolved) [2]	8	8	8	8	8	8	8	8	8	8	8	8
Copper (dissolved) [2]				8								
EDTA				8								
EW-1, 2, 3:												
Lead (dissolved) (2)	3	3	3	3	3	3	3	3	3	3	3	3
Copper (dissolved) (2)				3								
EDTA				3								
MW-1, 2, 3, 5, 7, 13, 14 & 15:												
Lead (dissolved) [2]	8			8			8			8		
Copper (dissolved) [2]				8								
EDTA				8								
03U083												

Notes:

1) A sample for EDTA analysis is collected at each of the 8 surface water locations on only 1 day of the 3-day surface water sampling event.
2) Analytical method 6020 for lead and copper
3) Well 03U083 was sampled and analyzed for lead from FY2005 through FY2007.

Appendix B

Description of Hydrogeologic Units/Well Nomenclature and Trichloroethene Trends

(Trichloroethene Trend Graphs are located at the end of this Appendix)

APPENDIX B
DESCRIPTION OF HYDROGEOLOGIC UNITS/WELL NOMENCLATURE AND TRICHLOROETHENE TRENDS

On- and off-TCAAP wells have been installed in four hydrogeologic units beneath the site. These hydrogeologic units, as referred to in this report, are conceptually illustrated on Figure B-1 and are described below:

Unit 1: This unit, referred to as the Fridley Formation, consists of alluvium and lacustrine deposits above the Twin Cities Formation (Unit 2). The formation is made up of fine- to medium-grained sand and clayey silt, which acts as an unconfined aquifer with an estimated hydraulic conductivity of 8.3×10^{-3} cm/sec (International Technology Corp. 1992). The Unit 1 deposits are discontinuous at TCAAP and ranges in thickness from zero to 50 feet. They are predominantly limited to the north, east, and southwest portions of the site. Groundwater in Unit 1 is also discontinuous.

Unit 2: Known as the Twin Cities Formation, Unit 2 consists of Quaternary aged glacial till and, similar to Unit 1, is discontinuous at TCAAP. Unit 2 is generally regarded as an aquitard to vertical migration of groundwater; however, sand and gravel lenses may contain water.

Unit 3: This unit consists primarily of the Quaternary aged Hillside Sand Formation, which is continuous beneath TCAAP. Near the center of TCAAP, the Hillside Sand Formation is overlain by the Arsenal Sand, which forms a kame. There is no distinct lithologic contact between the Hillside Sand and the Arsenal Sand, and both are considered included in Unit 3. Unit 3 ranges in thickness from 25 to 450 feet. For monitoring purposes, the Unit 3 aquifer thickness has been arbitrarily subdivided into thirds designated as upper, middle, and lower.

Unit 4: This unit consists collectively of bedrock from the Prairie du Chien Group and Jordan Formation (Ordovician and Cambrian periods, respectively). For monitoring purposes, the Prairie du Chien Group is referred to as Upper Unit 4, while the Jordan Formation is Lower Unit 4. The Jordan Formation varies from fine- to coarse-grained quartz sandstone. The Prairie du Chien Group in the TCAAP area consists of a finely crystalline dolomite of the Oneota Formation, as well as quartz sandstone and dolomite members of the Shakopee Formation. A more detailed description of the bedrock geology can be found in the Remedial Investigation Report (Argonne National Laboratory, 1991).

In order to identify the hydrogeologic unit in which each well is completed, the United States Army Environmental Center (USAEC), formerly the United States Army Toxic and Hazardous Materials Agency (USATHAMA), developed a standardized identification system for wells at TCAAP (referred to as the IRDMIS number). Well designations consist of six characters, such as 03U093. The first two characters represent the hydrogeologic unit in which the well is completed, as follows:

01	-	Unit 1
03	-	Unit 3
04	-	Unit 4: Prairie du Chien Group or Jordan Formation
PJ	-	Unit 4: Prairie du Chien Group and Jordan Formation

The third character represents the relative position of the well screen or open hole within the specified hydrogeologic unit, as follows:

U	-	upper portion
M	-	middle portion
L	-	lower portion
J	-	Jordan Sandstone
F	-	fully penetrating Unit 3
#	-	open hole (total or partial thickness)

The remaining three characters represent the well number, as follows:

001 thru 500	USAEC wells and additional wells installed by others adjacent to an existing well with the 001-500 designation.
501 thru 600	TCAAP wells.
601 thru 800	On-post Alliant wells.
801 thru 999	Off-post Alliant wells.

Off-TCAAP wells installed by parties other than USAEC, TCAAP, or Alliant are designated by their Minnesota unique number. For reference, a well-designation cross-reference guide is included as Tables B-1 and B-2, which lists all wells of concern, the Minnesota unique number, the IRDMIS number, and any other name(s) the wells may have. Table B-1 is sorted by unique number and Table B-2 is sorted by IRDMIS number. The well type in these two tables is abbreviated as follows:

UN	-	Unknown
MUNI	-	Municipal
MON	-	Monitoring
DOM	-	Domestic
IND	-	Industrial
P.S.	-	Public Supply
COM	-	Commercial
IRR	-	Irrigation
ABAND	-	Abandoned
PIEZ.	-	Piezometer
REM	-	Remedial

Tables B-3 and B-4, which contain the same list of wells as Table B-2 (i.e., a listing that is sorted by IRDMIS number), can be used to view the boring log for a given well, if available. To view the well log, click on the desired well name in the table with the mouse. Table B-3 provides the boring logs for on-TCAAP wells and Table B-4 provides the boring logs for off-TCAAP wells.

Figures B-2 and B-3 show locations for off- and on-TCAAP wells, respectively. With a known well name, the location of that well can be determined using the "Edit, Find" or "Edit, Search" function and then typing in the desired well name, which will highlight this well name on the figure. Using either of the figures, the trichloroethene trend graph for a specific well can be viewed by clicking on the desired well name with the mouse. Some of the wells do not have trend graphs available (primarily sealed wells). Refer to the historical water quality database in Appendix D for this information.

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
107405		ROEBKE	OFF	UN		
110485		NEW BRIGHTON #12	OFF	MUNI		
114410	03U521		OFF	MON		
122210		ST. PAUL PORT AUTH. #3	OFF	IND		
127537		MIDWEST ASPHALT	OFF	DOM		
134318		LORENZ W SEUTTER	OFF	DOM		
139035		WATERGATE MARINA	OFF	P.S.		
151568		ARDEN MANOR MOBILE HOME	OFF	P.S.		
161432		NEW BRIGHTON #10	OFF	MUN		
191942		118PDC/MODEL STONE	OFF	MON		
194701	01U620	OW120U1	ON	MON		
194702	01U621	PW121U1	ON	MON		
194703	01U622	OW122U1	ON	MON	✓	
194704	01U623	OW123U1	ON	MON	✓	
194716	01U634	OW504U1	ON	MON	✓	
194717	01U638	OW508U1		MON	✓	
194718	01U639	OW509U1	ON	MON		
194719	01U640	OW510U1	ON	MON		
194720	01U631	OW501U1	ON	MON		
194721	01U632	OW502U1		MON		
194722	01U635	OW505U1	ON	MON	✓	
194723	01U636	OW506U1	ON	MON.		
194724	01U642	OW512U1	ON	MON	✓	
194725	01U612	OW112U1	ON	MON		194758
194726	01U613		ON	MON		194759
194727	01U615	OW115U1	ON	MON		194760
194728	01U616	OW116U1	ON	MON		194761
194729	01U617	OW117U1	ON	MON		194770
194730	01U618	OW118U1	ON	MON		194771
194772	01U619	PW119U1	ON	MON		
200070		RUAN TRANSPORT	OFF	COM	✓	
200071		PRESTRESSED CONCRETE	OFF	IND	✓	
200072		WITTE TRANSPORTATION	OFF	IND	✓	
200073		WILSON TRANSFER & STORAGE	OFF	IND		
200074		ASBESTOS PROD	OFF	IND	✓	
200075		PHILLIPS PETROLEUM	OFF	IND	✓	
200076		OLD DUTCH FOODS INC	OFF	IND		
200077		JOHN CONLIN	OFF	DOM	✓	
200078		WILLIAM CLASS	OFF	DOM		
200079		LAWRENCE SCHOENING	OFF	DOM		
200080		CARL A OSTROM & SON	OFF	DOM		
200081		A. O. LIEBIG	OFF	DOM		
200082		2196 MARION ROAD	OFF	DOM		
200148		PAPER CALMERSON	OFF	IND	✓	
200154		U OF M GOLF COURSE	OFF	IRR		
200167		KOPPERS COKE #1	OFF	IND		
200171		PLATING INC	OFF	IND		
200197		SNOW FLAKE DAIRY	OFF	COM		
200264		1620 CENTRAL	OFF	IND		

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
200384		METALLURGICAL INC. WELL #1	OFF	IND		
200524		ST. ANTHONY #5	OFF	MUNI		
200525		PLETSCHER	OFF	UN		
200531		NAZARETH	OFF	UN		
200599		CEDAR AVE. TRIANGLE	OFF	P.S.		
200602		ATKINSON MILL CO.	OFF	IND		
200629		GENERAL MILLS	OFF	IND		
200803		ST. ANTHONY #4	OFF	P.S.		
200804		ST. ANTHONY #3	OFF	MUNI		
200812		GROSS GOLF COURSE #1	OFF	COM		
200814		AMERICAN LINEN	OFF	IND		
201074		GLEASSON MORTUARY	OFF	COM		
201082		NORTHWESTERN HOSPITAL	OFF	P.S.		
206669		FRIDLEY #8	OFF	MUNI		
206672		FRIDLEY #9	OFF	MUNI		
206673		FRIDLEY #6	OFF	MUNI		
206688		CLOVERPOND WELL	OFF	DOM		
206689		JAMES K. O'NEIL	OFF	UN		
206693		FERNELIUS	OFF	UN		
206702		MINN E.S.	OFF	UN		
206720		MOUNDSVIEW	OFF	MUNI		
206722		M0UNDSVIEW #5	OFF	MUNI		
206724	PJ#504	TWIN CITIES ARSENAL	OFF	ABAND	✓	
206725	03L523	ARSENAL GRAVEL PIT	ON	ABAND	✓	
206750		SHORE #4	OFF	MUNI		
206753	PJ#506	TWIN CITIES ARSENAL NO. 6	ON		✓	
206754	PJ#501	TWIN CITIES ARSENAL NO. 1	ON	P.S.	✓	
206755	PJ#507	TWIN CITIES ARSENAL NO. 7	ON	ABAND	✓	
206756	PJ#502	TWIN CITIES ARSENAL NO. 2	ON	IND	✓	
206758	PJ#503	TWIN CITIES ARSENAL NO. 3	ON	IND	✓	
206759	PJ#508	TWIN CITIES ARSENAL NO. 8	ON	ABAND	✓	
206760	03M509		ON		✓	
206760	PJ#509	TWIN CITIES ARSENAL NO.9	ON	DOM	✓	
206787		MOUNDSVIEW H.S.	OFF	P.S.		
206789		NEW BRIGHTON #1	OFF	MUNI	✓	
206791		NEW BRIGHTON #7	OFF	MUNI		
206792		NEW BRIGHTON #4				
206793		NEW BRIGHTON #3	OFF	MUNI		
206794		NEW BRIGHTON #9	OFF	MUNI		
206795		NEW BRIGHTON #8	OFF	MUNI		
206796		NEW BRIGHTON #5	OFF	MUNI		
206797		NEW BRIGHTON #6	OFF	MUNI		
206798		NEW BRIGHTON #2	OFF	MUNI	✓	
223844		KURTH MALTING CO EAST WL	OFF	IND		
223992		BOOM ISLAND	OFF	IND		
225886		FRANKLIN STEEL SQUARE	OFF	P.S.		
225905		ST PAUL TERM. WAREHOUSE	OFF	IND		
225906		ST PAUL TERM. WAREHOUSE	OFF	IND		
231741		LABELLE	OFF	UN		

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
231742	04U510	GRENADE PLANT PROOF RANGES	ON	IND		
231845		MNDOT CIVIL DEFENSE TRAIN.	ON/OFF	P.S.		
231854	03L522	ARSENAL GRAVEL PIT	ON	ABAND 8/9	✓	
231857	03M505			ABAND	✓	
231878		MENGELKOCH #2	OFF	UN		
232067		NBR 135	OFF	UN		
232069		UHIL	OFF	UN		
233221		REUBEN MEAT	OFF	DOM		
233222		LOWRY GROVE TRAILER	OFF	ABAND	✓	
233241		KOZAH'S MARKET	OFF	UN	✓	
233520		MCGILLIS	OFF	UN		
233533		ROSELAWN CEMETARY	OFF	IRR		
233763		P. L. MORGAN	OFF	DOM		
233806		2581 NORTH CLEVELAND	OFF	DOM		
234135	03U001	S1U3	ON	MON		
234136	03M001	S1M3	ON	MON		
234137	03L001	S1L3	ON	MON		
234138	04U001	S1U4	ON	MON		
234139	03U002	S2U3	ON	MON		
234140	03M002	S2M3	ON	MON		
234141	03L002	S2L3	ON	MON		
234142	03U003	S3U3	ON	MON		
234143	03M003	S3M3	ON	MON		
234144	03L003	S3L3	ON	MON		
234145	03U004	S4U3	ON	MON		
234146	03M004	S4M3	ON	MON		
234147	03L004	S4L3	ON	MON		
234148	03U005	S5U3	ON	MON		
234149	03U006	S6U3	ON	MON	✓	
234150	03U007	S7U3	ON	MON		
234151	03M007	S7M3	ON	MON		
234152	03L007	S7L3	ON	MON		
234153	03U008	S8U3	ON	MON		
234154	03U009	S9U3	ON	MON		
234155	03U010	S10U3	ON	MON		
234156	03M010	S10M3	ON	MON		
234157	03L010	S10L3	ON	MON		
234158	03U011	S11U3	ON	MON		
234159	03U012	S12U3	ON	MON		
234160	03M012	S12M3	ON	MON		
234161	03L012	S12L3	ON	MON		
234162	03U013	S13U3	ON	MON		
234163	03M013	S13M3	ON	MON		
234164	03L013	S13L3	ON	MON		
234165	03U014	S14U3	ON	MON		
234166	03U015	S15U3	ON	MON		
234167	03U016	S16U3	ON	MON		
234168	03U017	S17U3	ON	MON		
234169	03M017	S17M3	ON	MON		

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
234170	03L017	S17L3	ON	MON		
234171	03U018	S18U3	ON	MON		
234172	03U019	S19U3	ON	MON		
234173	03U020	S20U3	ON	MON		
234174	03M020	S20M3	ON	MON		
234175	03L020	S20L3	ON	MON		
234176	03U021	S21U3	ON	MON		
234193	04U003	S3U4	ON	MON		
234194	04U002	S2U4	ON	MON		
234195	04U007	S7U4	ON	MON		
234196	04U012	S12U4	ON	MON		
234197	04U020	S20U4	ON	MON		
234198	01U004	S4U1	ON	MON	✓	
234199	01U011	S11U1	ON	MON	✓	
234200	01U012	S12U1	ON	MON	✓	
234201	01U022	S22U1	ON	MON	✓	
234202	01U033	S33U1	ON	MON	✓	
234204	01U034	S34U1	ON	MON	✓	
234205	01U035	S35U1	ON	TEST		
234206	01U036	S36U1	ON	MON	✓	
234207	01U037	S37U1		MON	✓	
234208	01U038	S38U1		MON		
234209	01U039	S39U1	ON	MON		
234210	01U040	S40U1	ON	MON		
234211	01U041	S41U1	ON	MON		
234212	01U044	S44U1	ON	MON		
234215	01U045	S45U1	ON	MON		
234216	01U046	S46U1	ON	MON		
234217	01U047	S47U1	ON	MON		
234218	01U048	S48U1		MON		
234221	01U050	S50AU1		MON	✓	
234222	01U051	S51U1	ON	MON	✓	
234223	01U052	S52U1	ON	MON		
234225	01U053	S53AU1	ON	MON	✓	
234227	01U054	S54AU1		MON	✓	
234235	01U060	S60U1	ON	MON		
234237	01U062	S62U1	ON	MON	✓	
234239	01U063	S63U1	ON	MON		
234240	01U064	S64U1	ON	MON		
234241	01U065	S65U1	ON	MON		
234243	01U067	S67U1	ON	MON		
234250	01U072	S72AU1	ON	MON		
234301		DEWITT	OFF	UN	✓	
234305		GLENN BEGGIN	OFF	UN		
234319		HIDE & TALLOW #1	OFF	UN		
234327		BRESKE	OFF	UN		
234335		MENGELKOCH #1	OFF	UN		
234337		MENGELKOCH #3	OFF	UN	✓	
234350		GORDON	OFF	UN		

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
234351		YEMPA	OFF	UN		
234352		1206 12TH AV NW	OFF	UN	✓	
234353		LENTSCH'S ICE WK.	OFF	UN		
234355		KINGDOM HALL	OFF	UN		
234356		NORDQUIST P43	OFF	UN		
234357		PHILLIPS PET P46	OFF	UN		
234386		ZELL OLS.	OFF	UN		
234391		SHERER L.	OFF	UN		
234396		DEWITT	OFF	UN	✓	
234406		KLAPP	OFF	UN	✓	
234409		HIDE & TALLOW	OFF	UN		
234425		KEN GEREBI	OFF	UN	✓	
234430		CMIEL	OFF	UN	✓	
234431		HARSTAD	OFF	UN		
234463		KEN SOLIE	OFF	UN		
234546		HONEYWELL RIDGEWAY	OFF	UN		
234547		HONEYWELL RIDGEWAY	OFF	UN		
234549		REINER	OFF	IRR		
235539		OLD HOTEL	OFF	UN		
235557		HIDDEN FALLS PARK W.WELL	OFF	P.S.		
235565	PJ#074	S74PJ		MON	✓	
235619		SHRINERS HOSPITAL	OFF	P.S.		
235735		FLOUR CITY ARCHITECTURAL	OFF	COM		
235748	03L014	S14L3	ON	MON		
235749	03L018	S18L3	ON	MON		
235750	03L021	S21L3	ON	MON		
235751	03L027	S27L3	ON	MON		
235752	03L028	S28L3		MON		
235753	03L029	S29L3		MON		236066
236066	03U094	S94U3	ON	MON		
236067	03L091	S91L3	ON	MON	✓	
236068	03L086	S86L3	ON	MON	✓	
236069	03U084	S84U3	ON	MON		
236070	03L081	S81L3	ON	MON		
236071	03L080	S80L3	ON	MON		
236072	03U079	S79U3	ON	MON		
236073	03U078	S78U3	ON	MON		
236074	03L078	S78L3	ON	MON		
236075	03U077	S77U3	ON	MON		
236076	03L077	S77L3	ON	MON		
236077	03U076	S76U3	ON	MON		
236078	03U075	S75U3	ON	MON		
236079	03L005	S5L3	ON	MON		
236080	03L113	WF1L3	ON	MON		
236122		NWR	OFF	ABAND		
236176	01U003	S3U1	ON	MON	✓	
236177	01U043	S43AU1		MON		
236178	03U022	S22U3		MON		
236179	03U023	S23U3		MON		

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
236180	03U024	S24U3		MON		
236181	03U025	S25U3		MON		
236182	03U026	S26U3	ON	MON		
236183	03U027	S27U3		MON		
236184	03U028	S28U3		MON		
236185	03U029	S29U3		MON		
236186	03U030	S30U3		MON		
236187	03U031	S31U3		MON		
236188	03U032	S32U3		MON		
236189	01U601	OW101U1	ON	MON		
236190	01U602	OW102U1	ON	MON		
236191	01U603	OW103U1	ON	MON		
236192	01U604	OW104U1	ON	MON		
236193	01U605	OW10571	ON	MON		
236194	01U524	FA4U1	ON	PIEZ.	✓	
236195	01U527	FV8U1	ON	PIEZ.	✓	
236196	01U525	FW5U1	ON	PIEZ.	✓	
236197	01U526	FV12U1	ON	PIEZ.	✓	
236437	PJ#802	T2PJ	OFF	MON		421437
236449	03U801	T1U3	OFF	MON		
236450	04U802	T2U4	OFF	MON		
236452	01U803	T3U1	OFF	TEST	✓	424053
236453	03U803	T3U3	OFF	MON		421434
236455	03U804	T4U3	OFF	MON		421433
236457	01U805	T5U1	OFF	MON	✓	424060
236458	03U805	T5U3	OFF	MON		421432
236460	01U806	T6U1	OFF	MON	✓	424058
236461	03U806	T6U3	OFF	MON		421431
236462	03M806	T6M3	OFF	MON		421430
236463	03L806	T6L3	OFF	MON		421429
236464	04U806	T6U4	OFF	MON		421428
236465	PJ#806	T6PJ	OFF	MON		421427
236468	PJ#003	S3PJ	ON	MON		
236469	PJ#027	S27PJ	ON	MON		
236471	01U807	T7U1	OFF	TEST	✓	424059
236476	03U082	S82U3	ON	MON		
236478	03U083	S83U3	ON	MON		
236479	01U085	S85U1	ON	MON		
236480	03U087	S87U3	ON	MON		
236482	03U088	S88U3	ON	MON		
236483	03U089	S89U3	ON	MON		
236485	03U090	S90U3	ON	MON		
236487	03U092	S92U3	ON	MON		
236489	03U093	S93U3	ON	MON		
236491	03U096	S96U3	ON	MON		
236493	03U097	S97U3	ON	MON		
236494	01U098	S98U1	ON	MON	✓	
236495	03U099	S99U3	ON	MON		
236497	01U100	S100U1	ON	MON	✓	

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
236498	01U101	S101U1	ON	MON	✓	
236499	01U102	S102U1	ON	MON		
236500	01U103	S103U1	ON	MON		
236501	01U104	S104U1	ON	MON		
236502	01U105	S105U1	ON	MON		
236503	01U106	S106U1	ON	MON		
236504	01U107	S107U1	ON	MON		
236505	01U108	S108U1	ON	MON		
236506	01U109	S109U1	ON	MON	✓	
236507	01U110	S11OU1	ON	MON		
236508	03U111	S111U3	ON	MON		
236510	03U112	S112U3	ON	MON		
242124	03U113	WF1U3	ON	MON		
242125	03U114	WF2U3	ON	MON		
242127	01U607	OW107U1	ON	MON		
242128	01U608	OW108U1	ON	MON		
242129	01U609	OW109U1	ON	MON		
242130	01U610	OW110U1	ON	MON		
242131	01U611	OW111U1	ON	MON		
242132	03U647	OW517U3	ON	MON		
242133	03U648	OW518U3	ON	MON		
242134	01U652	OW522U1	ON	MON	✓	
242135	01U666	OW536U1	ON	MON		
242136	01U667	OW537U1	ON	MON		
242137	01U668	OW538U1	ON	MON		
242138	04U027	S27U4		MON		
242153	01U813	H3U1	OFF	MON	✓	
242160	03L079	S79L3	ON	MON		
242162		301PB	OFF	UN		
242182	01U624A	BP185A	ON	PIEZ		
242183	01U624B	BP185B	ON	PIEZ		
242184	01U624C	BP185C	ON	PIEZ		
242185	01U624D	BP185D	ON	PIEZ		
242186	01U625A	BP285A	ON	PIEZ		
242187	01U625B	BP285B	ON	PIEZ		
242188	01U625C	BP285C	ON	PIEZ		
242189	01U625D	BP285D	ON	PIEZ		
242190	01U626A	BP385A	ON	PIEZ		
242191	01U626B	BP385B	ON	PIEZ		
242192	01U626C	BP385C	ON	PIEZ		
242193	01U626D	BP385D	ON	PIEZ		
242194	01U627A	BP485A	ON	PIEZ		
242195	01U627B	BP485B	ON	PIEZ		
242196	01U627C	BP485C	ON	PIEZ		
242197	01U627D	BP485D	ON	PIEZ		
242198	01U628A	BP585A	ON	PIEZ		
242199	01U628B	BP585B	ON	PIEZ		
242200	01U628C	BP585C	ON	PIEZ		
242201	01U628D	BP585D	ON	PIEZ		

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
242207		SUNSET MEMORIAL CEMETARY	OFF	UN		
249152		BOYLE	OFF	DOM		
265735		FLOUR CITY ARCH	OFF	UN		
322664		ABBOTT NW HOSP	OFF	UN		
405651		METAL-MATIC INC.	OFF	IND		
406198	04U851	311U4	OFF	MON		
409546		PCA2L3	OFF	TEST	✓	
409547		PCA1U4	OFF	TEST		
409548		PCA2U4	OFF	TEST		
409549		PCA3U4	OFF	TEST		
409550		PCA6U3	OFF	TEST		
409555		PCA5U4	OFF	TEST		
409556		PCA4L3	OFF	TEST		
409557		PCA1L3	OFF	TEST		
409595		B109U3	OFF	ABAND		
409596		B118U3	OFF	MON		
409597		B118L3	OFF	IND		
409598		B117U3	OFF	ABAND		
416051	03M848	308M3	OFF	MON		
416078	04U848	308U4	OFF	TEST		
416080	04U852	312U4	OFF	MON		
416081	03L858	318L3	OFF	MON	✓	
416082	04U849	309U4	OFF	MON		
416143			OFF	ABAND		
416198		311U4	OFF	MON		
416199	03L848	308L3	OFF	MON		
416200	04U850	310U4	OFF	MON		
420713		HERBST LANDFILL	OFF	MON		
421425	03U659	OW529U3	ON	MON		
421426	03U658	OW528U3	ON	MON		
421438	03U671	PO-1	ON	MON		
421440	03U672	PD2U3	OFF	MON		
421441	03U673	PD3U3	OFF	MON		
424052	01L822	NW2L1	OFF	TEST	✓	
424054	01L821	NW1L1	OFF	TEST	✓	
424055	01L811	H1L1; MDNR Well	OFF	TEST		
424056	01L816	H6L1	OFF	ABAND	✓	
424057	01U808	T8U1	ON	MON	✓	
424061	01L823	NW3L1	OFF	TEST	✓	
424062	01L813	H3L1	OFF	TEST	✓	
426808	03U811	H1U3	OFF	TEST		
426809	03L811	H1L3	OFF	TEST		
426810	03U821	NW1U3	OFF	TEST		
426811	04U821	NW1U4	OFF	TEST		
426812	03U822	NW2U3	OFF	TEST		
426813	03L822	NW2L3	OFF	TEST		
426814	03U824	NW4U3	OFF	TEST	✓	
426815	03L673	PD3L3	OFF	TEST		
426816	03L813	H3L3	OFF	TEST	✓	

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
426817	03L802	T2L3	OFF	TEST		
426818	03M802	T2M3	OFF	TEST		
426842	03F302	B1	ON	REM		
426843	03F303	B2	ON	REM		
426844	03F304	B3	ON	REM		
426845	03F305	B4	ON	REM		
426846	03F306	B5	ON	REM		
426847	03F307	B6	ON	REM		
426848	03U701	701U3	ON	MON		
426849	04U701	701U4	ON	MON		
426850	03U702	702U3	ON	MON		
426851	04U841	301U4	OFF	TEST		
426852	03M843	303M3	OFF	TEST		
426853	04U843	303U4	OFF	TEST		
426854	04U844	304U4	OFF	TEST		
426855	04U845	305U4	OFF	MON		
426856	04U846	306U4	OFF	MON		
426857	04U847	307U4	OFF	MON		
426858	03L853	313L3	OFF	MON		
426859	03L854	314L3	OFF	MON		
426860	04U855	315U4	OFF	MON		
426861	03L856	316L3	OFF	MON	✓	
426862	03U815	H5U3	OFF	TEST	✓	
426863	03U831	OM1U3	OFF	TEST		
426864	03U832	OM2U3	OFF	TEST	✓	
426865	03L832	OM2L3	OFF	TEST		
426866	04U832	OM2U4	OFF	TEST		
426867	04U673	PD3U4	OFF	TEST		
426868	03L809	T9L3	OFF	MON		
426876	04U702	702U4	ON	MON		
426877	04U077	ST77U4	ON	MON		
426878	03U703	703U3		MON		
426879	03U708	708U3	ON	MON		
426880	04U708	708U4	ON	MON		
426881	03U709	709U3	ON	MON		
426882	04U709	709U4	ON	MON		
426883	03U704	704U3	ON	MON		
426884	03U705	705U3	ON	MON		
426885	03U706	706U3	ON	MON		
426886	03U707	707U3	ON	MON		
427410	01U120		ON	MON		
427411	01U115		ON	MON		
427412	01U116		ON	MON		
427413	01U117		ON	MON		
427414	01U118		ON	MON		
427415	01U119		ON	MON		
434031	04U711	711U4	OFF	MON		
434032	03U710	71OU3	ON	MON		
434033	03U711	711U3	OFF	MON		

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
434034	04U861	321U4	OFF	MON		
434035	04U860	320U4	OFF	MON		
434036	04U859	319U4	OFF	MON		
434037	03L841	301L3	OFF	MON		
434038	03L860	320L3	OFF	MON		
434039	03L861	321L3	OFF	MON		
434040	03L859	319L3	OFF	MON		
439701	04U854	314U4	OFF	MON		
440884	03U121		ON	MON		
440885	03M005	ST-5-M3	ON	MON		
440886	03U129		ON	MON		
440887	03L084	ST84L3	ON	MON		
440888	01U122		ON	MON	✓	
440889	01U125		ON	MON		
440890	01U126		ON	MON		
440891	01U127		ON	MON		
440892	01U128		ON	MON		
440893	01U133		ON	MON		
440894	01U134		OFF	MON		
440895	01U130		ON	MON	✓	
440896	03U124		ON	MON	✓	
447889	04U871	401U4	OFF	MON		
447890	04U882	412U4	OFF	MON		
447891	04U881	411U4	OFF	MON		
447892	04U883	413U4	OFF	MON		
447893	01U350		ON	MON		
447894	PJ#318	318U4	OFF	MON		
447895	04U880	410U4	OFF	MON		
447896	04U877	407U4	OFF	MON		
447898	04U875	405U4	OFF	MON		
447899	03L846	306L3	OFF	MON		
447900	04U879	409U4	OFF	MON		
447988	04U872	402U4	OFF	MON		
447998	01U135		ON	MON		
447999	01U136		ON	MON		
453821	03U317	SC-5	ON	REM		
453822	03U316	SC-4	ON	REM		
453823	03F308	B7	ON	REM		
453824	03F312	B11	ON	REM		
453825	PJ#309	B8	ON	REM		
453826	PJ#310	B9	ON	REM		
453827	PJ#311	B10	ON	REM		
453828	PJ#313	B12	ON	REM		
453829	04J708		ON	MON		
453830	04J713		ON	MON		
453831	03M713		ON	MON		
453832	04U714		ON	MON		
453833	03U715	SM1	ON	MON		
453834	03U716	SM2	ON	MON		

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
471394	04U863	323U4	OFF	MON		
476387		MW15H	OFF	MON		
482083		K04-MW	ON	MON		
482084		K02-MW	ON	MON		
482085		K01-MW	ON	MON		
482086		I01-MW	ON	MON		
482087		I05-MW	ON	MON		
482088		I02-MW	ON	MON		
482089		I04-MW	ON	MON		
482090		I03-MW	ON	MON		
482707	04J882		OFF	MON		
482708	04J835		OFF	MON		
482709	04J834		OFF	MON		
500691	04U414	414U4/EZ SELF SERVICE	OFF	MON		
500694	03L137		ON	MON	✓	
505189	01U137		ON	MON		
505190	01U138		ON	MON		
505191	01U139		ON	MON		
505192	01U140		ON	MON		
505193	01U141		ON	MON		
505209	01U902		OFF	MON		
505210	01U901	H3U1	OFF	MON		
505618	03L138		ON	MON	✓	
508115	04U322	322U4	OFF	MON		
508117	04J702		ON	MON		
508118	04J077		ON	MON		
508119	04U713		ON	MON		
508120	04J714		ON	MON		
508122	03U314	SC-2	ON	REM		
509083		NEW BRIGHTON #11	OFF	MUNI		
512761		GROSS GOLF #2	OFF	IRR		
519288		E101-MW	ON	MON		
519289		E102-MW	ON	MON		
519290		E103-MW	ON	MON		
519291		129-1501-MW	ON	MON	✓	
519836	04U834		OFF	MON		
519956	03L833		OFF	MON		
519957	04U833		OFF	MON		
520931		NEW BRIGHTON #13	OFF	MUNI		
524047	04U865	325U4	OFF	MON		
524048	04J866	326J	OFF	MON		
524049	04U866	326U4	OFF	MON		
524050	04U864	324U4	OFF	MON		
524051	04J864	324J	OFF	MON		
538039	01U145		ON	PIEZ.		
538040	01U146		ON	PIEZ.		
538041	01U147		ON	PIEZ.		
538042	01U148		ON	PIEZ.		
538043	01U149		ON	PIEZ.		

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
538044	01U150		ON	PIEZ.		
538045	01U151		ON	PIEZ.		
538046	01U152		ON	PIEZ.		
538047	01U153		ON	PIEZ.		
538048	01U154		ON	PIEZ.		
538049	01U155		ON	PIEZ.		
538050	01U156		ON	PIEZ.		
538051	01U351	EW1	ON	REM		
538052	01U352	EW2	ON	REM		
538053	01U353	EW3	ON	REM		
538054	01U354	EW4	ON	REM		
538055	01U355	EW5	ON	REM		
538056	01U356	EW6	ON	REM		
538057	01U357	EW7	ON	REM		
538058	01U358	EW8	ON	REM		
538059	01U904		OFF	MON		
538060	01U903		OFF	MON		
538062	01U157		ON	MON		
538063	01U158		ON	MON		
554216		NEW BRIGHTON #14	OFF	MUNI		
582628		NEW BRIGHTON #15	OFF	MUNI		
589650		CM1MW	ON	MON		
596628	04U836	MW-1	OFF	MON		
596629	04J836	MW-2	OFF	MON		
596630	04U837	MW-3	OFF	MON		
596631	04J837	MW-4	OFF	MON		
596632	04U838	MW-5	OFF	MON		
596633	04J838	MW-6	OFF	MON		
596634	04U839	MW-7	OFF	MON		
596635	04J839	MW-8	OFF	MON		
616601		CM2MW	ON	MON		
616602		CM3MW	ON	MON		
624019		CM5MW	ON	MON		
643379			ON	PIEZ.	✓	
643380			ON	PIEZ.	✓	
643381			ON	PIEZ.	✓	
643382			ON	PIEZ.	✓	
653903		GR1-1	ON	MON		
653904		GR1-2	ON	MON		
653905		GR2-1	ON	MON		
675976		GR-DF1	ON	MON		
687112	03F319	B13	ON	REM		
706043	04J822		OFF	MON		
706044	04J849		OFF	MON		
706045	04J947		OFF	MON		
	01U131				✓	
	01U132					
	01U142				✓	
	01U143				✓	

TABLE B-1
TCAAP WELL INDEX
SORTED BY UNIQUE NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
	01U144				✓	
	01U653			MON		
	01U675				✓	
	03L306		ON	MON		
	03L843	303L3	OFF	MON		
	03U301	SC-1	ON	REM		
	03U315	SC-3		REM		
	03U674	OW541U3	ON	MON		
	03U675					
	03U676	OW543U3	ON	MON		
	04U842			MON		
	PJ#006		ON	MON		
		MW15D	OFF	MON		
		MW15S	OFF	MON		

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
424055	01L811	H1L1; MDNR Well	OFF	TEST		
424062	01L813	H3L1	OFF	TEST	✓	
424056	01L816	H6L1	OFF	ABAND	✓	
424054	01L821	NW1L1	OFF	TEST	✓	
424052	01L822	NW2L1	OFF	TEST	✓	
424061	01L823	NW3L1	OFF	TEST	✓	
236176	01U003	S3U1	ON	MON	✓	
234198	01U004	S4U1	ON	MON	✓	
234199	01U011	S11U1	ON	MON	✓	
234200	01U012	S12U1	ON	MON	✓	
234201	01U022	S22U1	ON	MON	✓	
234202	01U033	S33U1	ON	MON	✓	
234204	01U034	S34U1	ON	MON	✓	
234205	01U035	S35U1	ON	TEST		
234206	01U036	S36U1	ON	MON	✓	
234207	01U037	S37U1		MON	✓	
234208	01U038	S38U1		MON		
234209	01U039	S39U1	ON	MON		
234210	01U040	S40U1	ON	MON		
234211	01U041	S41U1	ON	MON		
236177	01U043	S43AU1		MON		
234212	01U044	S44U1	ON	MON		
234215	01U045	S45U1	ON	MON		
234216	01U046	S46U1	ON	MON		
234217	01U047	S47U1	ON	MON		
234218	01U048	S48U1		MON		
234221	01U050	S50AU1		MON	✓	
234222	01U051	S51U1	ON	MON	✓	
234223	01U052	S52U1	ON	MON		
234225	01U053	S53AU1	ON	MON	✓	
234227	01U054	S54AU1		MON	✓	
234235	01U060	S60U1	ON	MON		
234237	01U062	S62U1	ON	MON	✓	
234239	01U063	S63U1	ON	MON		
234240	01U064	S64U1	ON	MON		
234241	01U065	S65U1	ON	MON		
234243	01U067	S67U1	ON	MON		
234250	01U072	S72AU1	ON	MON		
236479	01U085	S85U1	ON	MON		
236494	01U098	S98U1	ON	MON	✓	
236497	01U100	S100U1	ON	MON	✓	
236498	01U101	S101U1	ON	MON	✓	
236499	01U102	S102U1	ON	MON		
236500	01U103	S103U1	ON	MON		
236501	01U104	S104U1	ON	MON		
236502	01U105	S105U1	ON	MON		
236503	01U106	S106U1	ON	MON		
236504	01U107	S107U1	ON	MON		
236505	01U108	S108U1	ON	MON		

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
236506	01U109	S109U1	ON	MON	✓	
236507	01U110	S11OU1	ON	MON		
427411	01U115		ON	MON		
427412	01U116		ON	MON		
427413	01U117		ON	MON		
427414	01U118		ON	MON		
427415	01U119		ON	MON		
427410	01U120		ON	MON		
440888	01U122		ON	MON	✓	
440889	01U125		ON	MON		
440890	01U126		ON	MON		
440891	01U127		ON	MON		
440892	01U128		ON	MON		
440895	01U130		ON	MON	✓	
	01U131				✓	
	01U132					
440893	01U133		ON	MON		
440894	01U134		OFF	MON		
447998	01U135		ON	MON		
447999	01U136		ON	MON		
505189	01U137		ON	MON		
505190	01U138		ON	MON		
505191	01U139		ON	MON		
505192	01U140		ON	MON		
505193	01U141		ON	MON		
	01U142				✓	
	01U143				✓	
	01U144				✓	
538039	01U145		ON	PIEZ.		
538040	01U146		ON	PIEZ.		
538041	01U147		ON	PIEZ.		
538042	01U148		ON	PIEZ.		
538043	01U149		ON	PIEZ.		
538044	01U150		ON	PIEZ.		
538045	01U151		ON	PIEZ.		
538046	01U152		ON	PIEZ.		
538047	01U153		ON	PIEZ.		
538048	01U154		ON	PIEZ.		
538049	01U155		ON	PIEZ.		
538050	01U156		ON	PIEZ.		
538062	01U157		ON	MON		
538063	01U158		ON	MON		
447893	01U350		ON	MON		
538051	01U351	EW1	ON	REM		
538052	01U352	EW2	ON	REM		
538053	01U353	EW3	ON	REM		
538054	01U354	EW4	ON	REM		
538055	01U355	EW5	ON	REM		
538056	01U356	EW6	ON	REM		

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
538057	01U357	EW7	ON	REM		
538058	01U358	EW8	ON	REM		
236194	01U524	FA4U1	ON	PIEZ.	✓	
236196	01U525	FW5U1	ON	PIEZ.	✓	
236197	01U526	FV12U1	ON	PIEZ.	✓	
236195	01U527	FV8U1	ON	PIEZ.	✓	
236189	01U601	OW101U1	ON	MON		
236190	01U602	OW102U1	ON	MON		
236191	01U603	OW103U1	ON	MON		
236192	01U604	OW104U1	ON	MON		
236193	01U605	OW10571	ON	MON		
242127	01U607	OW107U1	ON	MON		
242128	01U608	OW108U1	ON	MON		
242129	01U609	OW109U1	ON	MON		
242130	01U610	OW110U1	ON	MON		
242131	01U611	OW111U1	ON	MON		
194725	01U612	OW112U1	ON	MON		194758
194726	01U613		ON	MON		194759
194727	01U615	OW115U1	ON	MON		194760
194728	01U616	OW116U1	ON	MON		194761
194729	01U617	OW117U1	ON	MON		194770
194730	01U618	OW118U1	ON	MON		194771
194772	01U619	PW119U1	ON	MON		
194701	01U620	OW120U1	ON	MON		
194702	01U621	PW121U1	ON	MON		
194703	01U622	OW122U1	ON	MON	✓	
194704	01U623	OW123U1	ON	MON	✓	
242182	01U624A	BP185A	ON	PIEZ		
242183	01U624B	BP185B	ON	PIEZ		
242184	01U624C	BP185C	ON	PIEZ		
242185	01U624D	BP185D	ON	PIEZ		
242186	01U625A	BP285A	ON	PIEZ		
242187	01U625B	BP285B	ON	PIEZ		
242188	01U625C	BP285C	ON	PIEZ		
242189	01U625D	BP285D	ON	PIEZ		
242190	01U626A	BP385A	ON	PIEZ		
242191	01U626B	BP385B	ON	PIEZ		
242192	01U626C	BP385C	ON	PIEZ		
242193	01U626D	BP385D	ON	PIEZ		
242194	01U627A	BP485A	ON	PIEZ		
242195	01U627B	BP485B	ON	PIEZ		
242196	01U627C	BP485C	ON	PIEZ		
242197	01U627D	BP485D	ON	PIEZ		
242198	01U628A	BP585A	ON	PIEZ		
242199	01U628B	BP585B	ON	PIEZ		
242200	01U628C	BP585C	ON	PIEZ		
242201	01U628D	BP585D	ON	PIEZ		
194720	01U631	OW501U1	ON	MON		
194721	01U632	OW502U1		MON		

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
194716	01U634	OW504U1	ON	MON	✓	
194722	01U635	OW505U1	ON	MON	✓	
194723	01U636	OW506U1	ON	MON.		
194717	01U638	OW508U1		MON	✓	
194718	01U639	OW509U1	ON	MON		
194719	01U640	OW510U1	ON	MON		
194724	01U642	OW512U1	ON	MON	✓	
242134	01U652	OW522U1	ON	MON	✓	
	01U653			MON		
242135	01U666	OW536U1	ON	MON		
242136	01U667	OW537U1	ON	MON		
242137	01U668	OW538U1	ON	MON		
	01U675				✓	
236452	01U803	T3U1	OFF	TEST	✓	424053
236457	01U805	T5U1	OFF	MON	✓	424060
236460	01U806	T6U1	OFF	MON	✓	424058
236471	01U807	T7U1	OFF	TEST	✓	424059
424057	01U808	T8U1	ON	MON	✓	
242153	01U813	H3U1	OFF	MON	✓	
505210	01U901	H3U1	OFF	MON		
505209	01U902		OFF	MON		
538060	01U903		OFF	MON		
538059	01U904		OFF	MON		
426842	03F302	B1	ON	REM		
426843	03F303	B2	ON	REM		
426844	03F304	B3	ON	REM		
426845	03F305	B4	ON	REM		
426846	03F306	B5	ON	REM		
426847	03F307	B6	ON	REM		
453823	03F308	B7	ON	REM		
453824	03F312	B11	ON	REM		
687112	03F319	B13	ON	REM		
234137	03L001	S1L3	ON	MON		
234141	03L002	S2L3	ON	MON		
234144	03L003	S3L3	ON	MON		
234147	03L004	S4L3	ON	MON		
236079	03L005	S5L3	ON	MON		
234152	03L007	S7L3	ON	MON		
234157	03L010	S10L3	ON	MON		
234161	03L012	S12L3	ON	MON		
234164	03L013	S13L3	ON	MON		
235748	03L014	S14L3	ON	MON		
234170	03L017	S17L3	ON	MON		
235749	03L018	S18L3	ON	MON		
234175	03L020	S20L3	ON	MON		
235750	03L021	S21L3	ON	MON		
235751	03L027	S27L3	ON	MON		
235752	03L028	S28L3		MON		
235753	03L029	S29L3		MON		236066

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
236076	03L077	S77L3	ON	MON		
236074	03L078	S78L3	ON	MON		
242160	03L079	S79L3	ON	MON		
236071	03L080	S80L3	ON	MON		
236070	03L081	S81L3	ON	MON		
440887	03L084	ST84L3	ON	MON		
236068	03L086	S86L3	ON	MON	✓	
236067	03L091	S91L3	ON	MON	✓	
236080	03L113	WF1L3	ON	MON		
500694	03L137		ON	MON	✓	
505618	03L138		ON	MON	✓	
	03L306		ON	MON		
231854	03L522	ARSENAL GRAVEL PIT	ON	ABAND	✓	
206725	03L523	ARSENAL GRAVEL PIT	ON	ABAND	✓	
426815	03L673	PD3L3	OFF	TEST		
426817	03L802	T2L3	OFF	TEST		
236463	03L806	T6L3	OFF	MON		421429
426868	03L809	T9L3	OFF	MON		
426809	03L811	H1L3	OFF	TEST		
426816	03L813	H3L3	OFF	TEST	✓	
426813	03L822	NW2L3	OFF	TEST		
426865	03L832	OM2L3	OFF	TEST		
519956	03L833		OFF	MON		
434037	03L841	301L3	OFF	MON		
	03L843	303L3	OFF	MON		
447899	03L846	306L3	OFF	MON		
416199	03L848	308L3	OFF	MON		
426858	03L853	313L3	OFF	MON		
426859	03L854	314L3	OFF	MON		
426861	03L856	316L3	OFF	MON	✓	
416081	03L858	318L3	OFF	MON	✓	
434040	03L859	319L3	OFF	MON		
434038	03L860	320L3	OFF	MON		
434039	03L861	321L3	OFF	MON		
234136	03M001	S1M3	ON	MON		
234140	03M002	S2M3	ON	MON		
234143	03M003	S3M3	ON	MON		
234146	03M004	S4M3	ON	MON		
440885	03M005	ST-5-M3	ON	MON		
234151	03M007	S7M3	ON	MON		
234156	03M010	S10M3	ON	MON		
234160	03M012	S12M3	ON	MON		
234163	03M013	S13M3	ON	MON		
234169	03M017	S17M3	ON	MON		
234174	03M020	S20M3	ON	MON		
231857	03M505			ABAND	✓	
206760	03M509		ON		✓	
453831	03M713		ON	MON		
426818	03M802	T2M3	OFF	TEST		

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
236462	03M806	T6M3	OFF	MON		421430
426852	03M843	303M3	OFF	TEST		
416051	03M848	308M3	OFF	MON		
234135	03U001	S1U3	ON	MON		
234139	03U002	S2U3	ON	MON		
234142	03U003	S3U3	ON	MON		
234145	03U004	S4U3	ON	MON		
234148	03U005	S5U3	ON	MON		
234149	03U006	S6U3	ON	MON	✓	
234150	03U007	S7U3	ON	MON		
234153	03U008	S8U3	ON	MON		
234154	03U009	S9U3	ON	MON		
234155	03U010	S10U3	ON	MON		
234158	03U011	S11U3	ON	MON		
234159	03U012	S12U3	ON	MON		
234162	03U013	S13U3	ON	MON		
234165	03U014	S14U3	ON	MON		
234166	03U015	S15U3	ON	MON		
234167	03U016	S16U3	ON	MON		
234168	03U017	S17U3	ON	MON		
234171	03U018	S18U3	ON	MON		
234172	03U019	S19U3	ON	MON		
234173	03U020	S20U3	ON	MON		
234176	03U021	S21U3	ON	MON		
236178	03U022	S22U3		MON		
236179	03U023	S23U3		MON		
236180	03U024	S24U3		MON		
236181	03U025	S25U3		MON		
236182	03U026	S26U3	ON	MON		
236183	03U027	S27U3		MON		
236184	03U028	S28U3		MON		
236185	03U029	S29U3		MON		
236186	03U030	S30U3		MON		
236187	03U031	S31U3		MON		
236188	03U032	S32U3		MON		
236078	03U075	S75U3	ON	MON		
236077	03U076	S76U3	ON	MON		
236075	03U077	S77U3	ON	MON		
236073	03U078	S78U3	ON	MON		
236072	03U079	S79U3	ON	MON		
236476	03U082	S82U3	ON	MON		
236478	03U083	S83U3	ON	MON		
236069	03U084	S84U3	ON	MON		
236480	03U087	S87U3	ON	MON		
236482	03U088	S88U3	ON	MON		
236483	03U089	S89U3	ON	MON		
236485	03U090	S90U3	ON	MON		
236487	03U092	S92U3	ON	MON		
236489	03U093	S93U3	ON	MON		

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
236066	03U094	S94U3	ON	MON		
236491	03U096	S96U3	ON	MON		
236493	03U097	S97U3	ON	MON		
236495	03U099	S99U3	ON	MON		
236508	03U111	S111U3	ON	MON		
236510	03U112	S112U3	ON	MON		
242124	03U113	WF1U3	ON	MON		
242125	03U114	WF2U3	ON	MON		
440884	03U121		ON	MON		
440896	03U124		ON	MON	✓	
440886	03U129		ON	MON		
	03U301	SC-1	ON	REM		
508122	03U314	SC-2	ON	REM		
	03U315	SC-3		REM		
453822	03U316	SC-4	ON	REM		
453821	03U317	SC-5	ON	REM		
114410	03U521		OFF	MON		
242132	03U647	OW517U3	ON	MON		
242133	03U648	OW518U3	ON	MON		
421426	03U658	OW528U3	ON	MON		
421425	03U659	OW529U3	ON	MON		
421438	03U671	PO-1	ON	MON		
421440	03U672	PD2U3	OFF	MON		
421441	03U673	PD3U3	OFF	MON		
	03U674	OW541U3	ON	MON		
	03U675					
	03U676	OW543U3	ON	MON		
426848	03U701	701U3	ON	MON		
426850	03U702	702U3	ON	MON		
426878	03U703	703U3		MON		
426883	03U704	704U3	ON	MON		
426884	03U705	705U3	ON	MON		
426885	03U706	706U3	ON	MON		
426886	03U707	707U3	ON	MON		
426879	03U708	708U3	ON	MON		
426881	03U709	709U3	ON	MON		
434032	03U710	71OU3	ON	MON		
434033	03U711	711U3	OFF	MON		
453833	03U715	SM1	ON	MON		
453834	03U716	SM2	ON	MON		
236449	03U801	T1U3	OFF	MON		
236453	03U803	T3U3	OFF	MON		421434
236455	03U804	T4U3	OFF	MON		421433
236458	03U805	T5U3	OFF	MON		421432
236461	03U806	T6U3	OFF	MON		421431
426808	03U811	H1U3	OFF	TEST		
426862	03U815	H5U3	OFF	TEST	✓	
426810	03U821	NW1U3	OFF	TEST		
426812	03U822	NW2U3	OFF	TEST		

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
426814	03U824	NW4U3	OFF	TEST	✓	
426863	03U831	OM1U3	OFF	TEST		
426864	03U832	OM2U3	OFF	TEST	✓	
508118	04J077		ON	MON		
508117	04J702		ON	MON		
453829	04J708		ON	MON		
453830	04J713		ON	MON		
706043	04J822		OFF	MON		
508120	04J714		ON	MON		
482709	04J834		OFF	MON		
482708	04J835		OFF	MON		
596629	04J836	MW-2	OFF	MON		
596631	04J837	MW-4	OFF	MON		
596633	04J838	MW-6	OFF	MON		
596635	04J839	MW-8	OFF	MON		
706045	04J847		OFF	MON		
706044	04J840		OFF	MON		
524051	04J864	324J	OFF	MON		
524048	04J866	326J	OFF	MON		
482707	04J882		OFF	MON		
234138	04U001	S1U4	ON	MON		
234194	04U002	S2U4	ON	MON		
234193	04U003	S3U4	ON	MON		
234195	04U007	S7U4	ON	MON		
234196	04U012	S12U4	ON	MON		
234197	04U020	S20U4	ON	MON		
242138	04U027	S27U4		MON		
426877	04U077	ST77U4	ON	MON		
508115	04U322	322U4	OFF	MON		
500691	04U414	414U4/EZ SELF SERVICE	OFF	MON		
231742	04U510	GRENADE PLANT PROOF RANGES	ON	IND		
426867	04U673	PD3U4	OFF	TEST		
426849	04U701	701U4	ON	MON		
426876	04U702	702U4	ON	MON		
426880	04U708	708U4	ON	MON		
426882	04U709	709U4	ON	MON		
434031	04U711	711U4	OFF	MON		
508119	04U713		ON	MON		
453832	04U714		ON	MON		
236450	04U802	T2U4	OFF	MON		
236464	04U806	T6U4	OFF	MON		421428
426811	04U821	NW1U4	OFF	TEST		
426866	04U832	OM2U4	OFF	TEST		
519957	04U833		OFF	MON		
519836	04U834		OFF	MON		
596628	04U836	MW-1	OFF	MON		
596630	04U837	MW-3	OFF	MON		
596632	04U838	MW-5	OFF	MON		
596634	04U839	MW-7	OFF	MON		

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
426851	04U841	301U4	OFF	TEST		
	04U842			MON		
426853	04U843	303U4	OFF	TEST		
426854	04U844	304U4	OFF	TEST		
426855	04U845	305U4	OFF	MON		
426856	04U846	306U4	OFF	MON		
426857	04U847	307U4	OFF	MON		
416078	04U848	308U4	OFF	TEST		
416082	04U849	309U4	OFF	MON		
416200	04U850	310U4	OFF	MON		
406198	04U851	311U4	OFF	MON		
416080	04U852	312U4	OFF	MON		
439701	04U854	314U4	OFF	MON		
426860	04U855	315U4	OFF	MON		
434036	04U859	319U4	OFF	MON		
434035	04U860	320U4	OFF	MON		
434034	04U861	321U4	OFF	MON		
471394	04U863	323U4	OFF	MON		
524050	04U864	324U4	OFF	MON		
524047	04U865	325U4	OFF	MON		
524049	04U866	326U4	OFF	MON		
447889	04U871	401U4	OFF	MON		
447988	04U872	402U4	OFF	MON		
447898	04U875	405U4	OFF	MON		
447896	04U877	407U4	OFF	MON		
447900	04U879	409U4	OFF	MON		
447895	04U880	410U4	OFF	MON		
447891	04U881	411U4	OFF	MON		
447890	04U882	412U4	OFF	MON		
447892	04U883	413U4	OFF	MON		
236468	PJ#003	S3PJ	ON	MON		
	PJ#006		ON	MON		
236469	PJ#027	S27PJ	ON	MON		
235565	PJ#074	S74PJ		MON	✓	
453825	PJ#309	B8	ON	REM		
453826	PJ#310	B9	ON	REM		
453827	PJ#311	B10	ON	REM		
453828	PJ#313	B12	ON	REM		
447894	PJ#318	318U4	OFF	MON		
206754	PJ#501	TWIN CITIES ARSENAL NO. 1	ON	P.S.	✓	
206756	PJ#502	TWIN CITIES ARSENAL NO. 2	ON	IND	✓	
206758	PJ#503	TWIN CITIES ARSENAL NO. 3	ON	IND	✓	
206724	PJ#504	TWIN CITIES ARSENAL	OFF	ABAND	✓	
206753	PJ#506	TWIN CITIES ARSENAL NO. 6	ON		✓	
206755	PJ#507	TWIN CITIES ARSENAL NO. 7	ON	ABAND	✓	
206759	PJ#508	TWIN CITIES ARSENAL NO. 8	ON	ABAND	✓	
206760	PJ#509	TWIN CITIES ARSENAL NO.9	ON	DOM	✓	
236437	PJ#802	T2PJ	OFF	MON		421437
236465	PJ#806	T6PJ	OFF	MON		421427

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
107405		ROEBKE	OFF	UN		
110485		NEW BRIGHTON #12	OFF	MUNI		
122210		ST. PAUL PORT AUTH. #3	OFF	IND		
127537		MIDWEST ASPHALT	OFF	DOM		
134318		LORENZ W SEUTTER	OFF	DOM		
139035		WATERGATE MARINA	OFF	P.S.		
151568		ARDEN MANOR MOBILE HOME	OFF	P.S.		
161432		NEW BRIGHTON #10	OFF	MUNI		
191942		118PDC/MODEL STONE	OFF	MON		
200070		RUAN TRANSPORT	OFF	COM	✓	
200071		PRESTRESSED CONCRETE	OFF	IND	✓	
200072		WITTE TRANSPORTATION	OFF	IND	✓	
200073		WILSON TRANSFER & STORAGE	OFF	IND		
200074		ASBESTOS PROD	OFF	IND	✓	
200075		PHILLIPS PETROLEUM	OFF	IND	✓	
200076		OLD DUTCH FOODS INC	OFF	IND		
200077		JOHN CONLIN	OFF	DOM	✓	
200078		WILLIAM CLASS	OFF	DOM		
200079		LAWRENCE SCHOENING	OFF	DOM		
200080		CARL A OSTROM & SON	OFF	DOM		
200081		A. O. LIEBIG	OFF	DOM		
200082		2196 MARION ROAD	OFF	DOM		
200148		PAPER CALMERSON	OFF	IND	✓	
200154		U OF M GOLF COURSE	OFF	IRR		
200167		KOPPERS COKE #1	OFF	IND		
200171		PLATING INC	OFF	IND		
200197		SNOW FLAKE DAIRY	OFF	COM		
200264		1620 CENTRAL	OFF	IND		
200384		METALLURGICAL INC. WELL #1	OFF	IND		
200524		ST. ANTHONY #5	OFF	MUNI		
200525		PLETSCHER	OFF	UN		
200531		NAZARETH	OFF	UN		
200599		CEDAR AVE. TRIANGLE	OFF	P.S.		
200602		ATKINSON MILL CO.	OFF	IND		
200629		GENERAL MILLS	OFF	IND		
200803		ST. ANTHONY #4	OFF	P.S.		
200804		ST. ANTHONY #3	OFF	MUNI		
200812		GROSS GOLF COURSE #1	OFF	COM		
200814		AMERICAN LINEN	OFF	IND		
201074		GLEASSON MORTUARY	OFF	COM		
201082		NORTHWESTERN HOSPITAL	OFF	P.S.		
206669		FRIDLEY #8	OFF	MUNI		
206672		FRIDLEY #9	OFF	MUNI		
206673		FRIDLEY #6	OFF	MUNI		
206688		CLOVERPOND WELL	OFF	DOM		
206689		JAMES K. O'NEIL	OFF	UN		
206693		FERNELIUS	OFF	UN		
206702		MINN E.S.	OFF	UN		
206720		MOUNDSVIEW	OFF	MUNI		

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
206722		M0UNDSVIEW #5	OFF	MUNI		
206750		SHORE #4	OFF	MUNI		
206787		MOUNDSVIEW H.S.	OFF	P.S.		
206789		NEW BRIGHTON #1	OFF	MUNI	✓	
206791		NEW BRIGHTON #7	OFF	MUNI		
206792		NEW BRIGHTON #4				
206793		NEW BRIGHTON #3	OFF	MUNI		
206794		NEW BRIGHTON #9	OFF	MUNI		
206795		NEW BRIGHTON #8	OFF	MUNI		
206796		NEW BRIGHTON #5	OFF	MUNI		
206797		NEW BRIGHTON #6	OFF	MUNI		
206798		NEW BRIGHTON #2	OFF	MUNI	✓	
223844		KURTH MALTING CO EAST WL	OFF	IND		
223992		BOOM ISLAND	OFF	IND		
225886		FRANKLIN STEEL SQUARE	OFF	P.S.		
225905		ST PAUL TERM. WAREHOUSE	OFF	IND		
225906		ST PAUL TERM. WAREHOUSE	OFF	IND		
231741		LABELLE	OFF	UN		
231845		MNDOT CIVIL DEFENSE TRAIN.	ON/OFF	P.S.		
231878		MENGELKOCH #2	OFF	UN		
232067		NBR 135	OFF	UN		
232069		UHIL	OFF	UN		
233221		REUBEN MEAT	OFF	DOM		
233222		LOWRY GROVE TRAILER	OFF	ABAND	✓	
233241		KOZAH'S MARKET	OFF	UN	✓	
233520		MCGILLIS	OFF	UN		
233533		ROSELAWN CEMETARY	OFF	IRR		
233763		P. L. MORGAN	OFF	DOM		
233806		2581 NORTH CLEVELAND	OFF	DOM		
234301		DEWITT	OFF	UN	✓	
234305		GLENN BEGGIN	OFF	UN		
234319		HIDE & TALLOW #1	OFF	UN		
234327		BRESKE	OFF	UN		
234335		MENGELKOCH #1	OFF	UN		
234337		MENGELKOCH #3	OFF	UN	✓	
234350		GORDON	OFF	UN		
234351		YEMPA	OFF	UN		
234352		1206 12TH AV NW	OFF	UN	✓	
234353		LENTSCH'S ICE WK.	OFF	UN		
234355		KINGDOM HALL	OFF	UN		
234356		NORDQUIST P43	OFF	UN		
234357		PHILLIPS PET P46	OFF	UN		
234386		ZELL OLS.	OFF	UN		
234391		SHERER L.	OFF	UN		
234396		DEWITT	OFF	UN	✓	
234406		KLAPP	OFF	UN	✓	
234409		HIDE & TALLOW	OFF	UN		
234425		KEN GEREBI	OFF	UN	✓	
234430		CMIEL	OFF	UN	✓	

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
234431		HARSTAD	OFF	UN		
234463		KEN SOLIE	OFF	UN		
234546		HONEYWELL RIDGEWAY	OFF	UN		
234547		HONEYWELL RIDGEWAY	OFF	UN		
234549		REINER	OFF	IRR		
235539		OLD HOTEL	OFF	UN		
235557		HIDDEN FALLS PARK W.WELL	OFF	P.S.		
235619		SHRINERS HOSPITAL	OFF	P.S.		
235735		FLOUR CITY ARCHITECTURAL	OFF	COM		
236122		NWR	OFF	ABAND		
242162		301PB	OFF	UN		
242207		SUNSET MEMORIAL CEMETARY	OFF	UN		
249152		BOYLE	OFF	DOM		
265735		FLOUR CITY ARCH	OFF	UN		
322664		ABBOTT NW HOSP	OFF	UN		
405651		METAL-MATIC INC.	OFF	IND		
409546		PCA2L3	OFF	TEST	✓	
409547		PCA1U4	OFF	TEST		
409548		PCA2U4	OFF	TEST		
409549		PCA3U4	OFF	TEST		
409550		PCA6U3	OFF	TEST		
409555		PCA5U4	OFF	TEST		
409556		PCA4L3	OFF	TEST		
409557		PCA1L3	OFF	TEST		
409595		B109U3	OFF	ABAND		
409596		B118U3	OFF	MON		
409597		B118L3	OFF	IND		
409598		B117U3	OFF	ABAND		
416143			OFF	ABAND		
416198		311U4	OFF	MON		
420713		HERBST LANDFILL	OFF	MON		
476387		MW15H	OFF	MON		
482083		K04-MW	ON	MON		
482084		K02-MW	ON	MON		
482085		K01-MW	ON	MON		
482086		I01-MW	ON	MON		
482087		I05-MW	ON	MON		
482088		I02-MW	ON	MON		
482089		I04-MW	ON	MON		
482090		I03-MW	ON	MON		
509083		NEW BRIGHTON #11	OFF	MUNI		
512761		GROSS GOLF #2	OFF	IRR		
519288		E101-MW	ON	MON		
519289		E102-MW	ON	MON		
519290		E103-MW	ON	MON		
519291		129-1501-MW	ON	MON	✓	
520931		NEW BRIGHTON #13	OFF	MUNI		
554216		NEW BRIGHTON #14	OFF	MUNI		
582628		NEW BRIGHTON #15	OFF	MUNI		

TABLE B-2
TCAAP WELL INDEX
SORTED BY IRDMIS NUMBER

Minnesota Unique #	IRDMIS #	Common Name	Well Location	Well Type	Well Sealed	Second Unique #
589650		CM1MW	ON	MON		
616601		CM2MW	ON	MON		
616602		CM3MW	ON	MON		
624019		CM5MW	ON	MON		
643379			ON	PIEZ.	✓	
643380			ON	PIEZ.	✓	
643381			ON	PIEZ.	✓	
643382			ON	PIEZ.	✓	
653903		GR1-1	ON	MON		
653904		GR1-2	ON	MON		
653905		GR2-1	ON	MON		
675976		GR-DF1	ON	MON		
		MW15D	OFF	MON		
		MW15S	OFF	MON		

Appendix B: Table B-3

Boring Logs On-TCAAP Wells
Sorted by IRDMIS Number

TCAAP Well Boring Logs are included on this CDROM as Table B-3 and Table B-4

Appendix B: Table B-4

Boring Logs Off-TCAAP Wells
Sorted by IRDMIS Number

TCAAP Well Boring Logs are included on this CDROM as Table B-3 and Table B-4

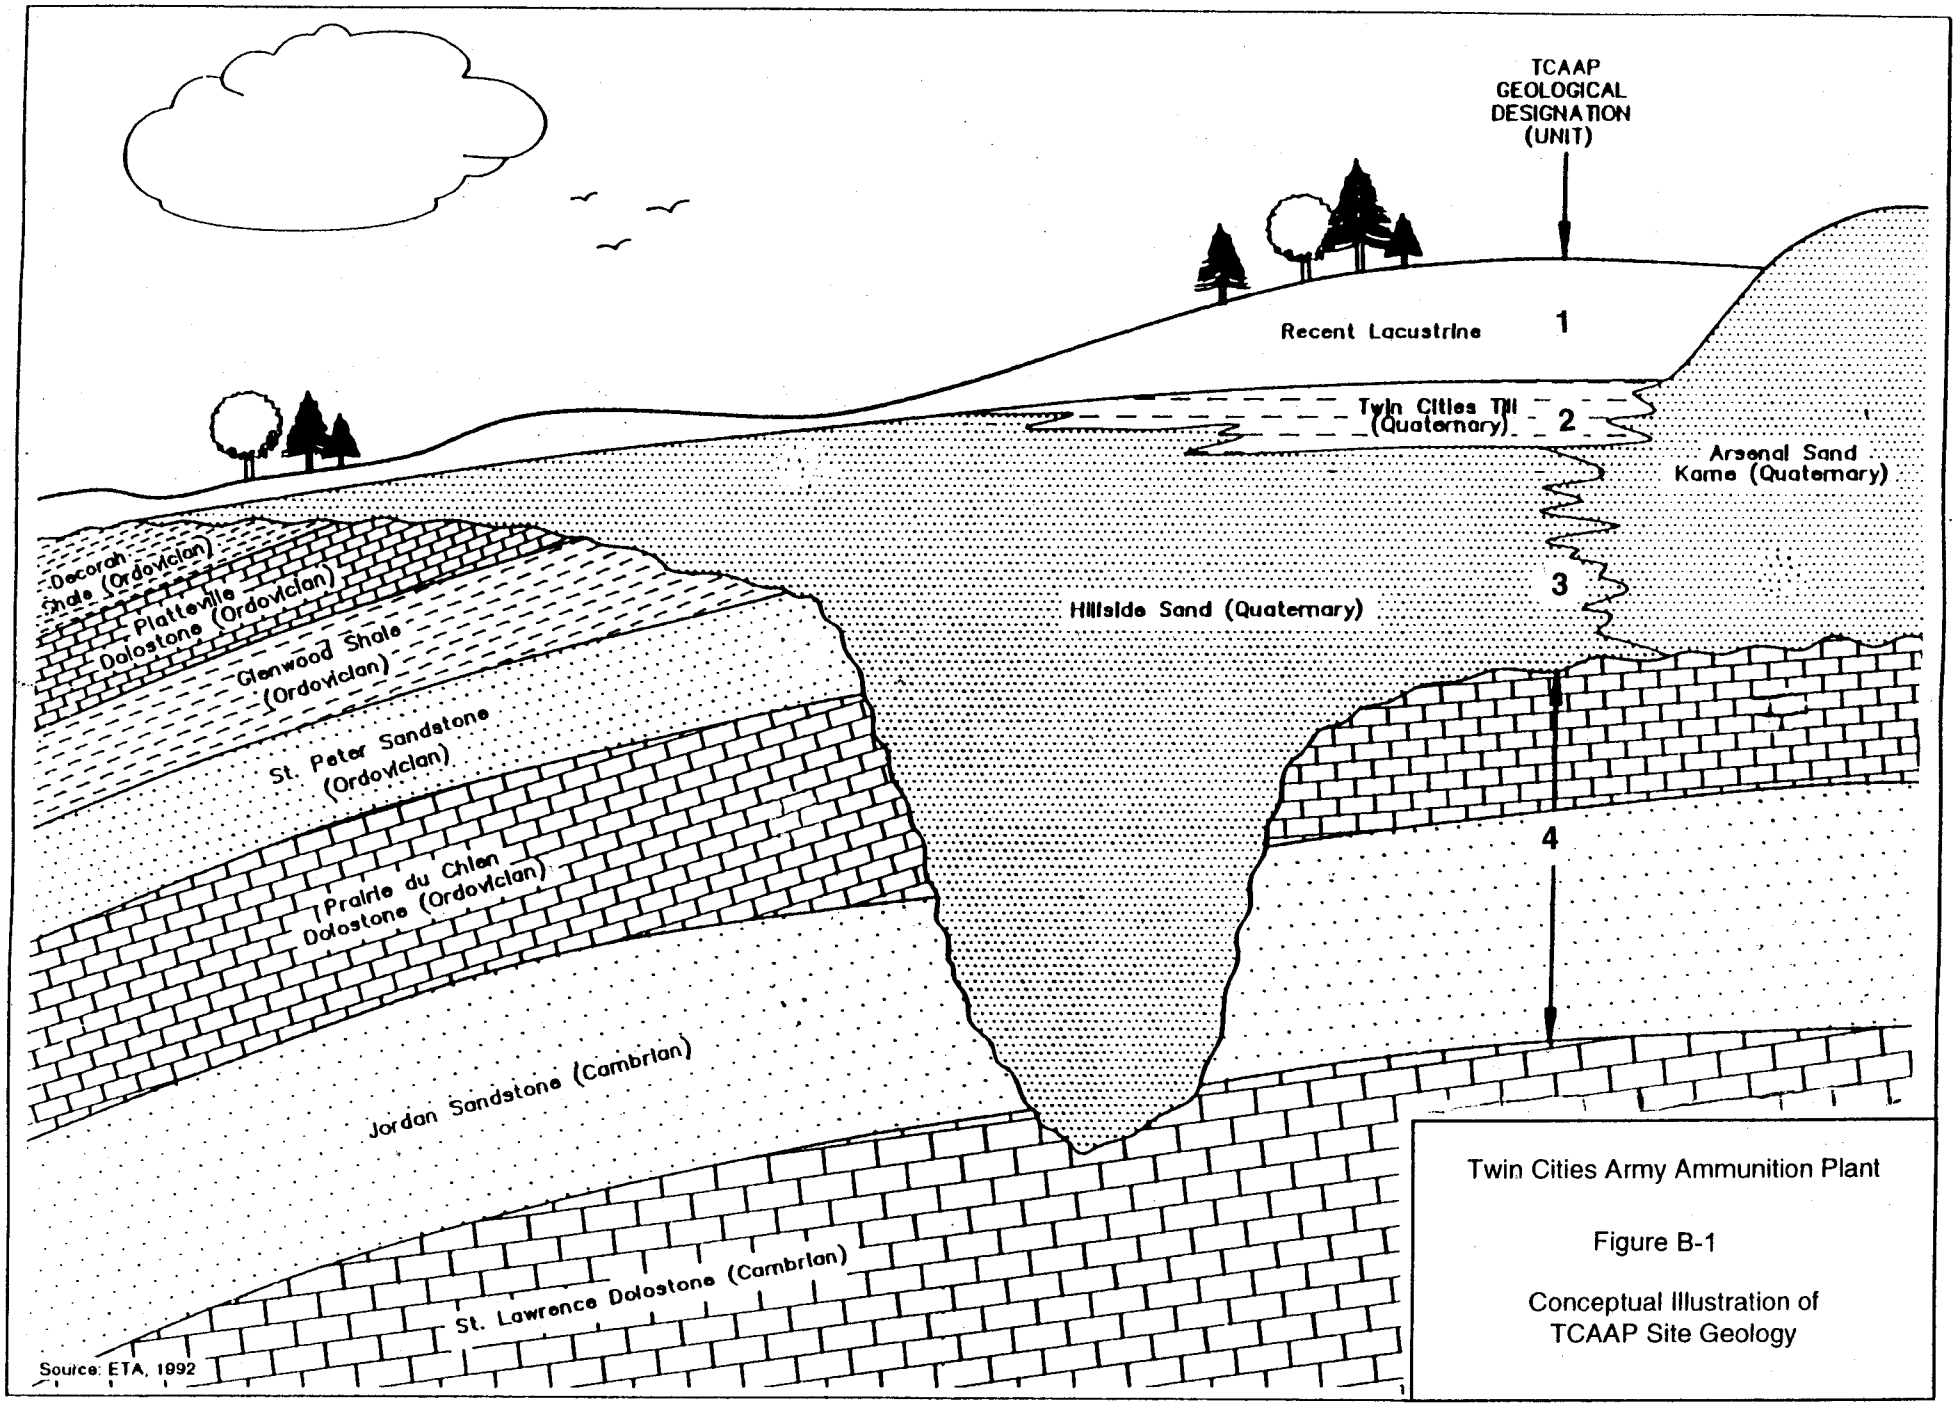

Twin Cities Army Ammunition Plant

Figure B-1

Conceptual Illustration of
TCAAP Site Geology

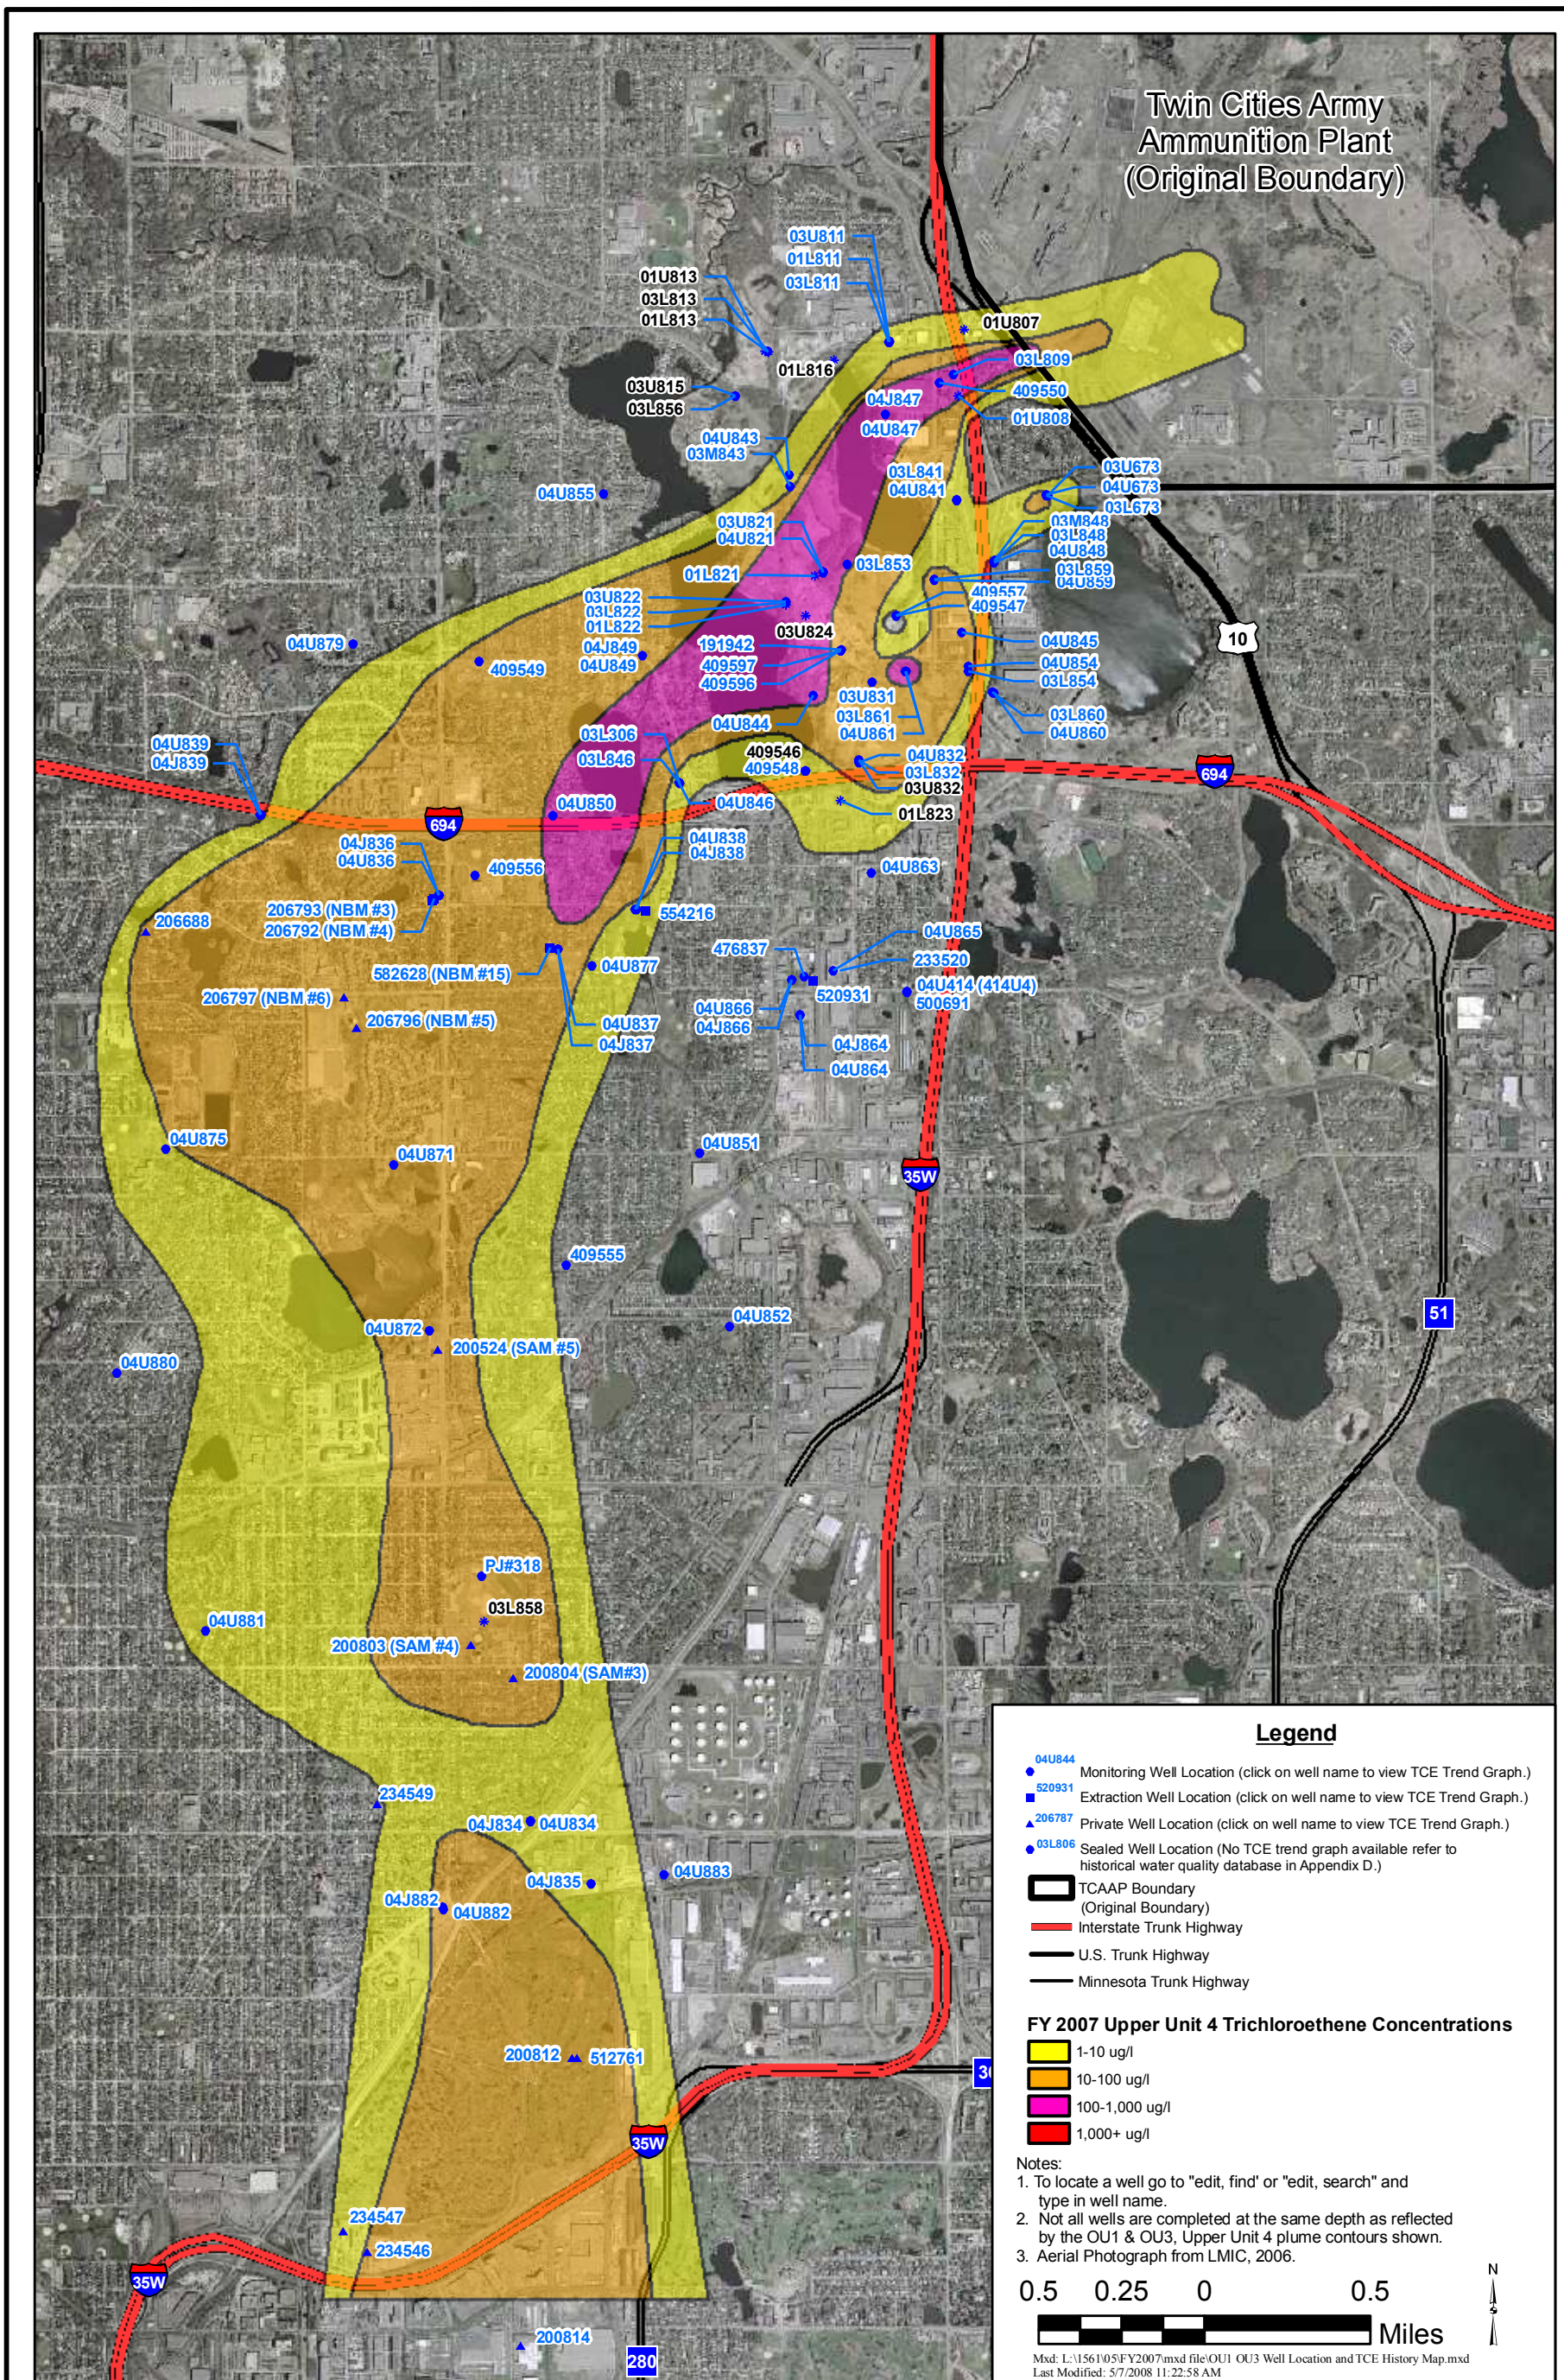

TWIN CITIES ARMY AMMUNTION PLANT

OU1 & OU3 Well Location and TCE History Map

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure B-2

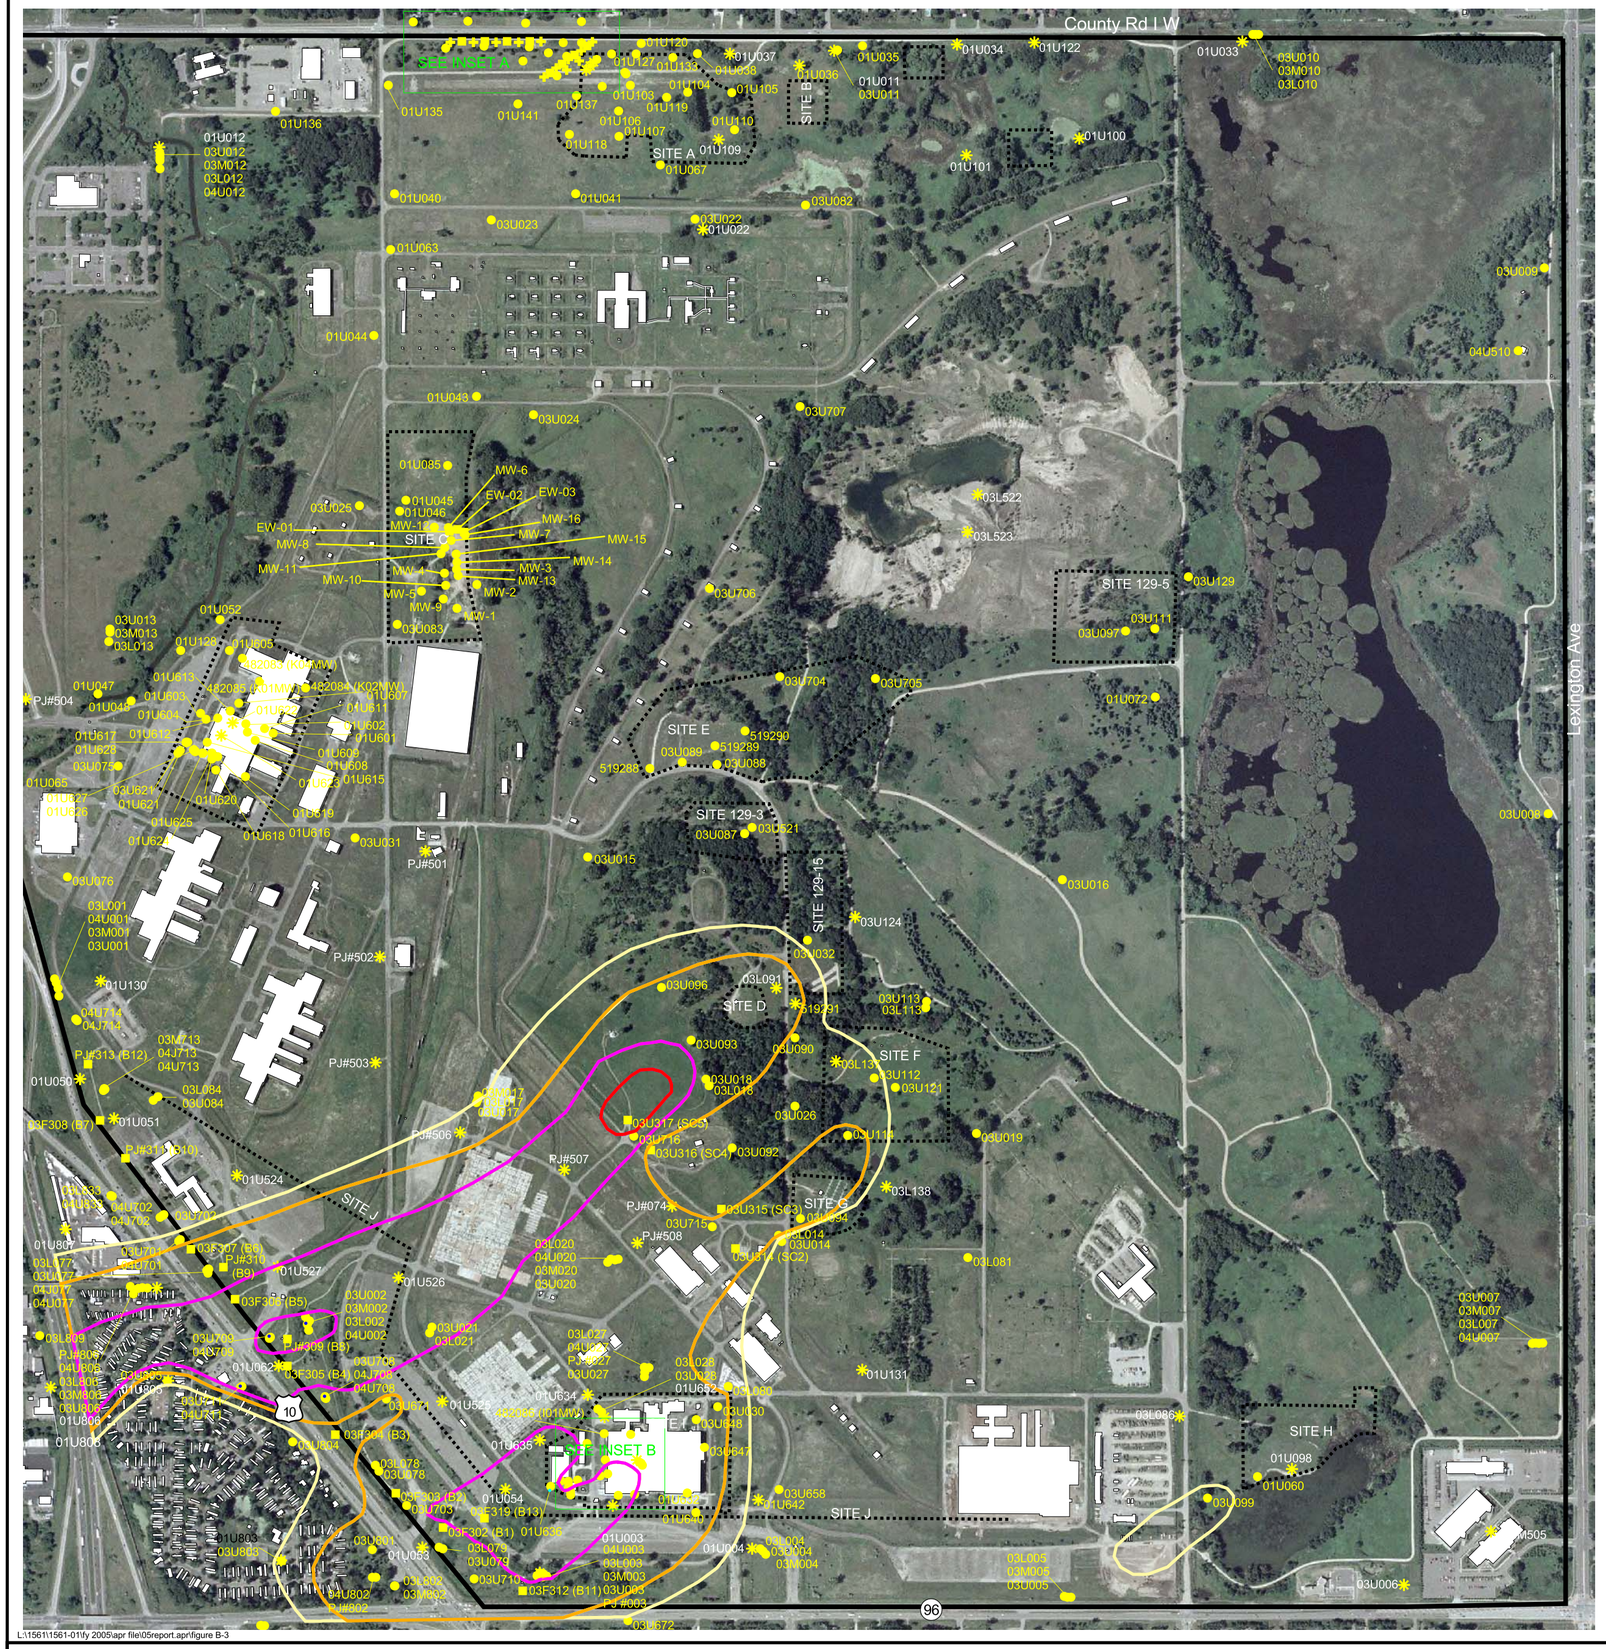
County Rd I W
SEE INSET A
SITE A
SITE B
SITE C
SITE D
SITE E
SITE F
SITE G
SITE H
SITE I
SITE J
SITE 129-5
SITE 129-3
SITE 129-15
SEE INSET B
Lexington Ave
MW-1
MW-2
MW-3
MW-4
MW-5
MW-6
MW-7
MW-8
MW-9
MW-10
MW-11
MW-13
MW-14
MW-15
MW-16
EW-01
EW-02
EW-03
PJ#501
PJ#502
PJ#503
PJ#504
PJ#505
PJ#506
PJ#507
PJ#508
PJ#074
PJ#309 (B8)
PJ#310 (B9)
PJ#311 (B10)
PJ#313 (B12)
03F305 (B4)
03F306 (B5)
03F307 (B6)
03F308 (B7)
03F309 (B8)
03F310 (B9)
03F311 (B10)
03F312 (B11)
03F313 (B12)
03F314 (B13)
03F315 (B14)
03F316 (B15)
03F317 (B16)
03F318 (B17)
03F319 (B18)
03F320 (B19)
03F321 (B20)
03F322 (B21)
03F323 (B22)
03F324 (B23)
03F325 (B24)
03F326 (B25)
03F327 (B26)
03F328 (B27)
03F329 (B28)
03F330 (B29)
03F331 (B30)
03F332 (B31)
03F333 (B32)
03F334 (B33)
03F335 (B34)
03F336 (B35)
03F337 (B36)
03F338 (B37)
03F339 (B38)
03F340 (B39)
03F341 (B40)
03F342 (B41)
03F343 (B42)
03F344 (B43)
03F345 (B44)
03F346 (B45)
03F347 (B46)
03F348 (B47)
03F349 (B48)
03F350 (B49)
03U317 (SC5)
03U316 (SC4)
03U315 (SC3)
03U314 (SC2)
03U313 (SC1)
482085 (K01MW)
482084 (K02MW)
482088 (I02MW)
482087 (I03MW)
482086 (I01MW)
519290
519289
519288
519291
01U904
01U902
01U903
01U156
01U155
01U154
01U153
01U152
01U140
01U139
01U039
01U157
01U125
01U149
01U158
01U353 (EW-3)
01U150
01U354 (EW-4)
01U151
01U138
01U146
01U144
01U143
01U142
01U145
01U147
01U351 (EW-1
01U352 (EW-2)
01U148
01U102
01U137
01U635
01U668
01U064
01U675
01U676
01U677
01U666
01U636
01U674
01U639
01U098
01U060
01U099
01U505
01U006
01U672
03U009
04U510
03L522
03L523
03U129
03U111
03U097
03U072
03U008
03U707
03U704
03U705
03U706
03U083
03U082
03U023
03U022
03U024
03U025
03U031
03U015
03U016
03U124
03U032
03U096
03U093
03U090
03U018
03U026
03U019
03U092
03U113
03L113
03U112
03U121
03L137
03L138
03L081
03L086
03L091
03U007
03M007
03L007
04U007
03U658
03U004
03M004
03L004
03U005
03M005
03L005
03U006
03U099
03U639
03U629
03U630
03U675
03U676
03U677
03U666
03U636
03U674
03U639
01U135
01U136
01U141
01U137
01U103
01U104
01U105
01U119
01U106
01U107
01U118
01U110
01U109
01U067
01U037
01U038
01U035
01U036
01U011
03U011
01U034
01U122
01U033
03U010
03M010
03L010
01U100
01U101
01U012
03U012
03M012
03L012
04U012
01U040
01U041
01U063
01U044
01U049
01U085
01U045
01U046
03U025
01U052
03U013
03M013
03L013
01U128
01U605
01U047
01U603
01U604
01U613
01U617
01U628
01U612
01U602
01U601
01U607
01U611
01U609
01U608
01U615
01U065
01U627
01U626
03U621
01U621
01U620
01U619
01U625
01U624
01U618
01U616
03U076
03L001
04U001
03M001
03U001
01U130
04U714
04J714
03M713
04J713
04U713
01U050
03L084
03U084
01U051
01U524
01U807
03U707
03L077
03M077
04J077
03L078
03M078
04J078
03L079
03M079
04J079
03L080
03M080
04J080
01U808
01U809
01U810
01U811
01U812
01U813
01U814
01U815
01U816
01U817
01U818
01U819
01U820
01U821
01U822
01U823
01U824
01U825
01U826
01U827
01U828
01U829
01U830
01U831
01U832
01U833
01U834
01U835
01U836
01U837
01U838
01U839
01U840
01U841
01U842
01U843
01U844
01U845
01U846
01U847

Trend Graph Not Available,
Well No Longer Routinely Sampled

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

Monitoring Well Has Been Sealed

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U038

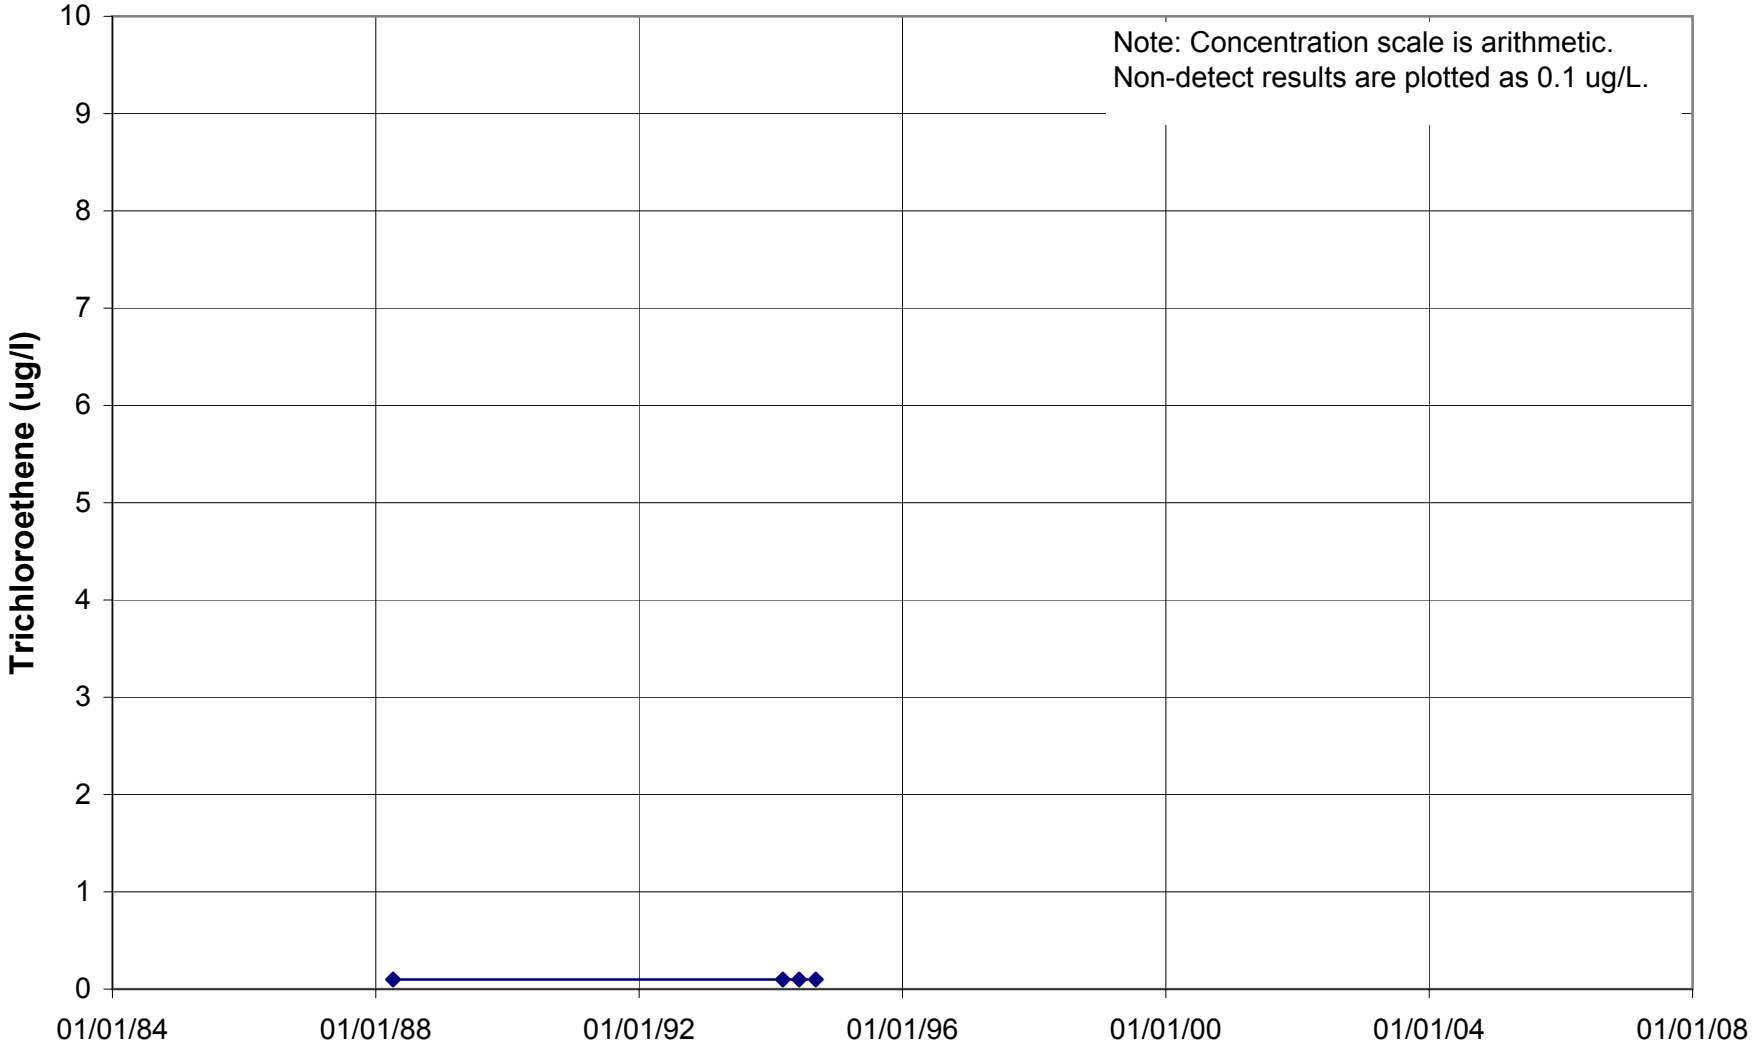

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U039

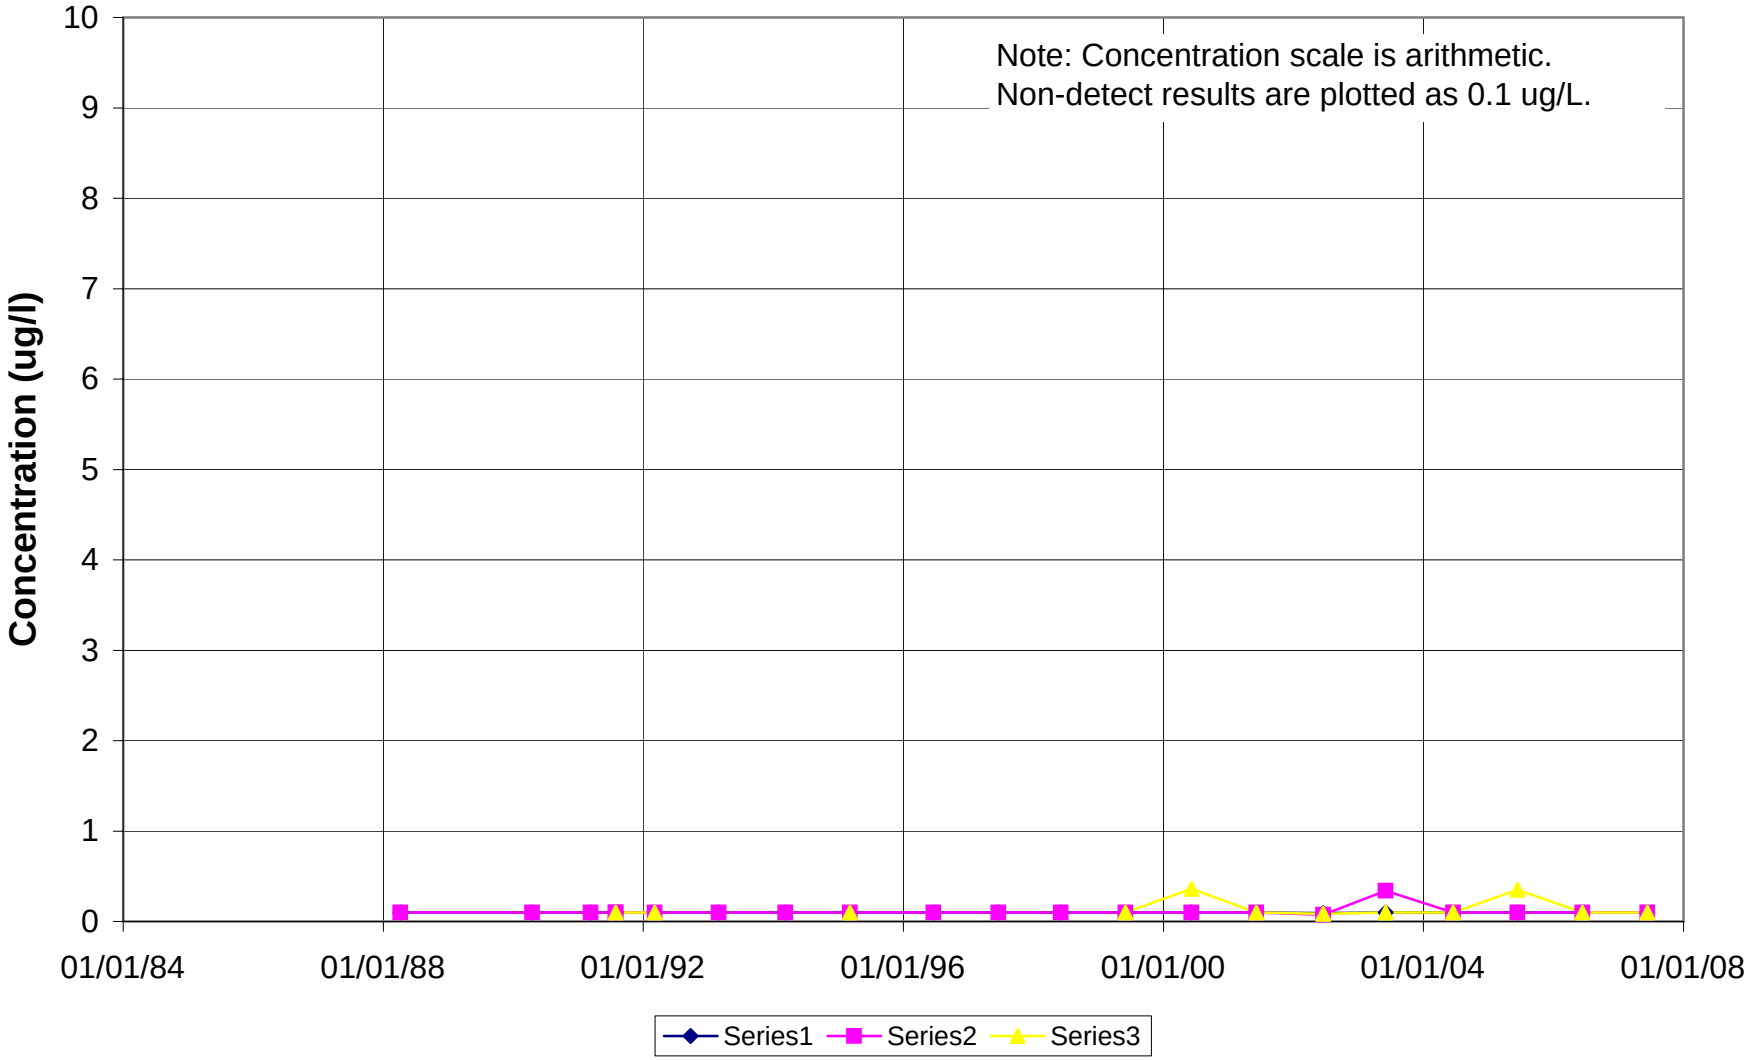

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U040

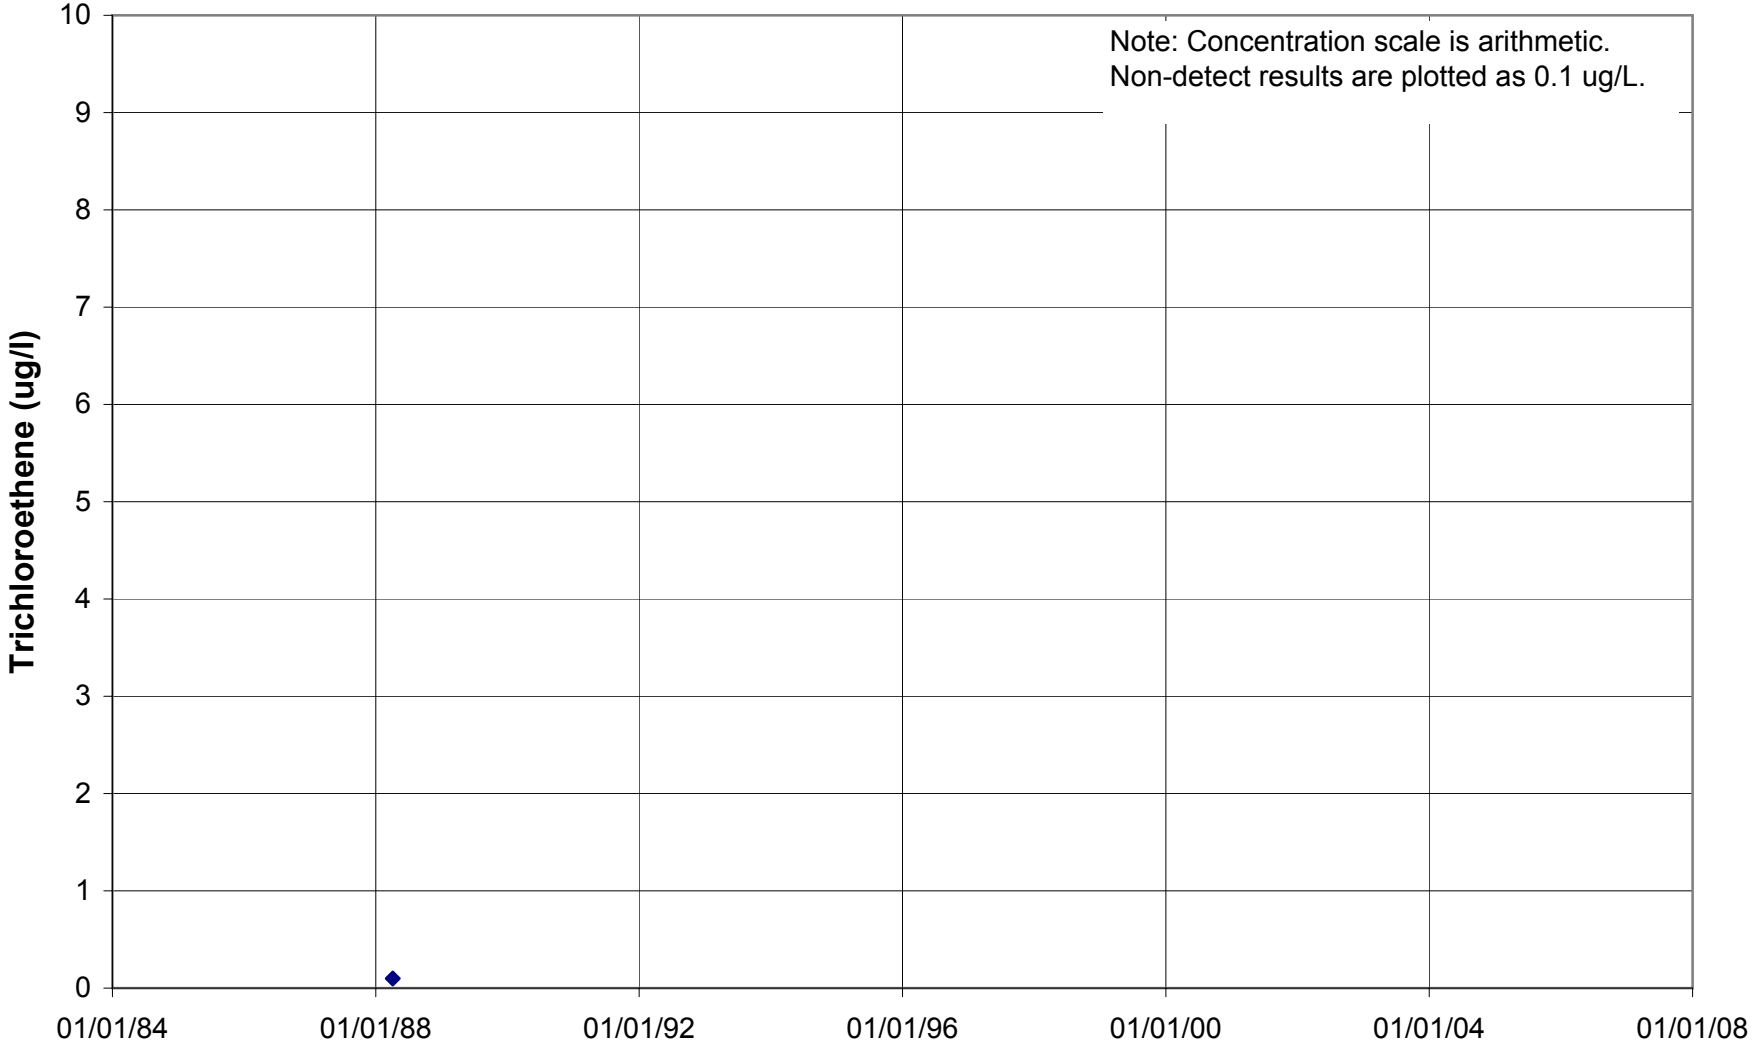

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U041

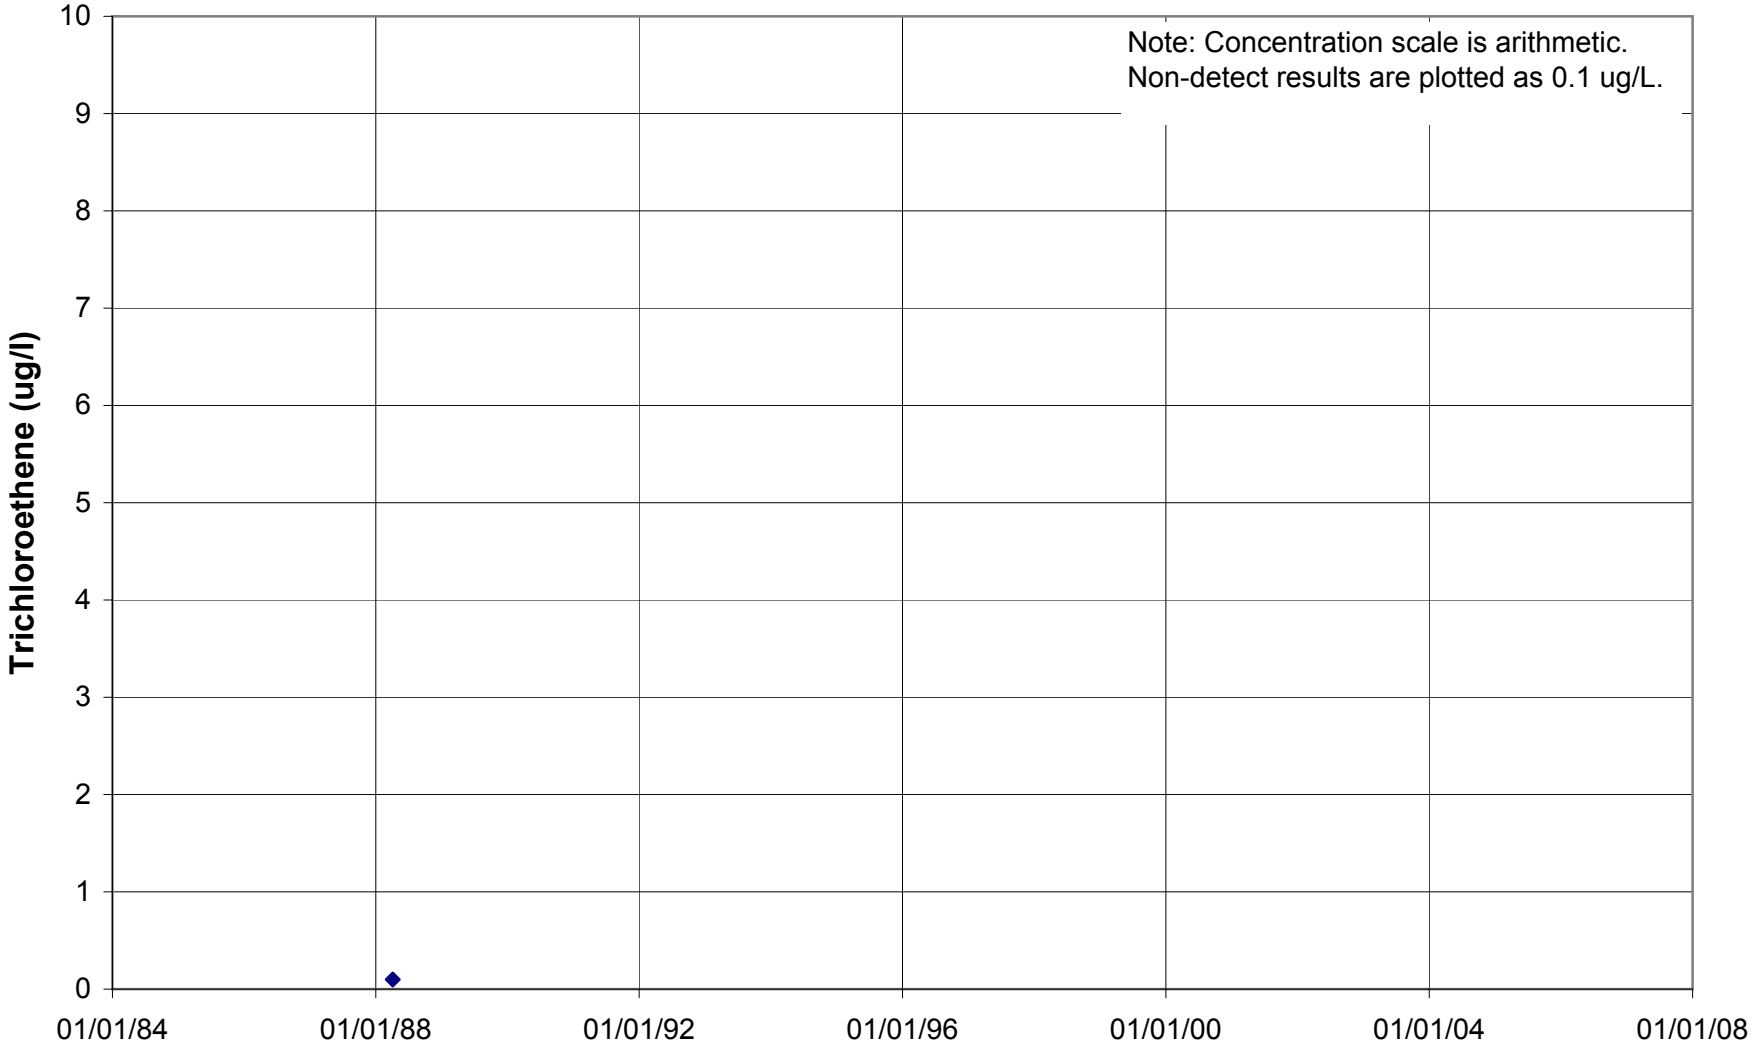

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U045

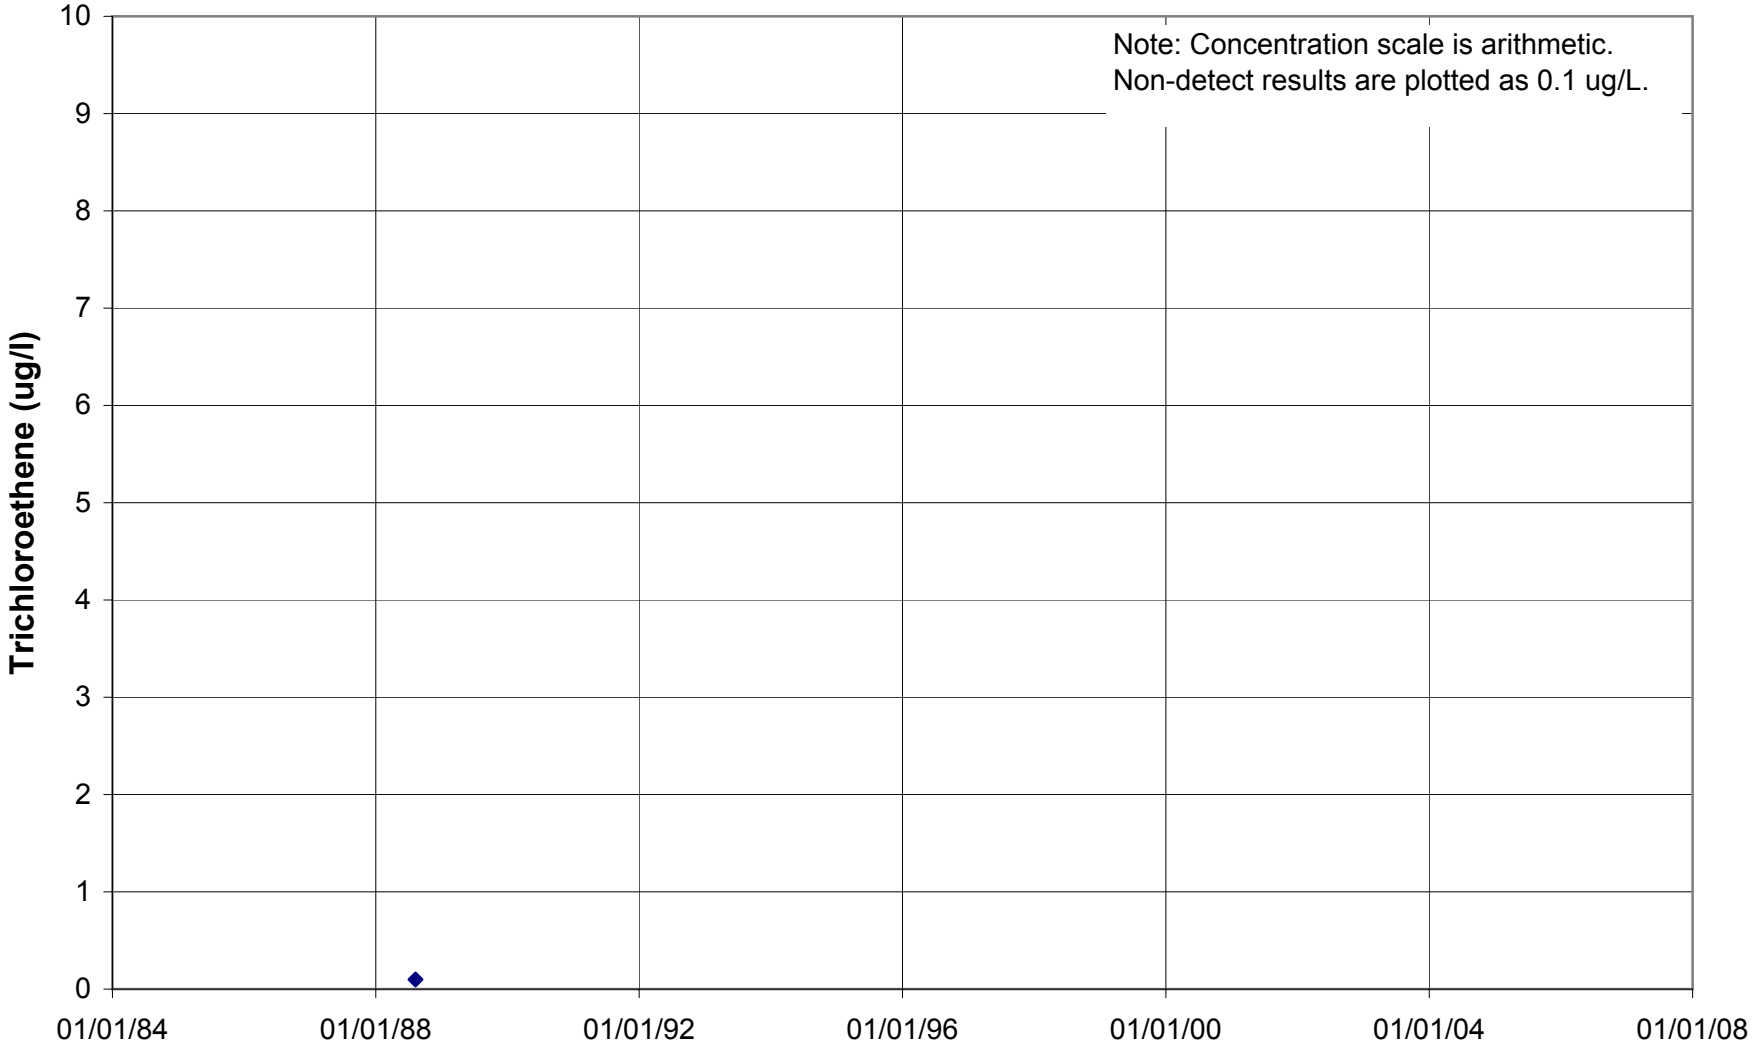

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U047

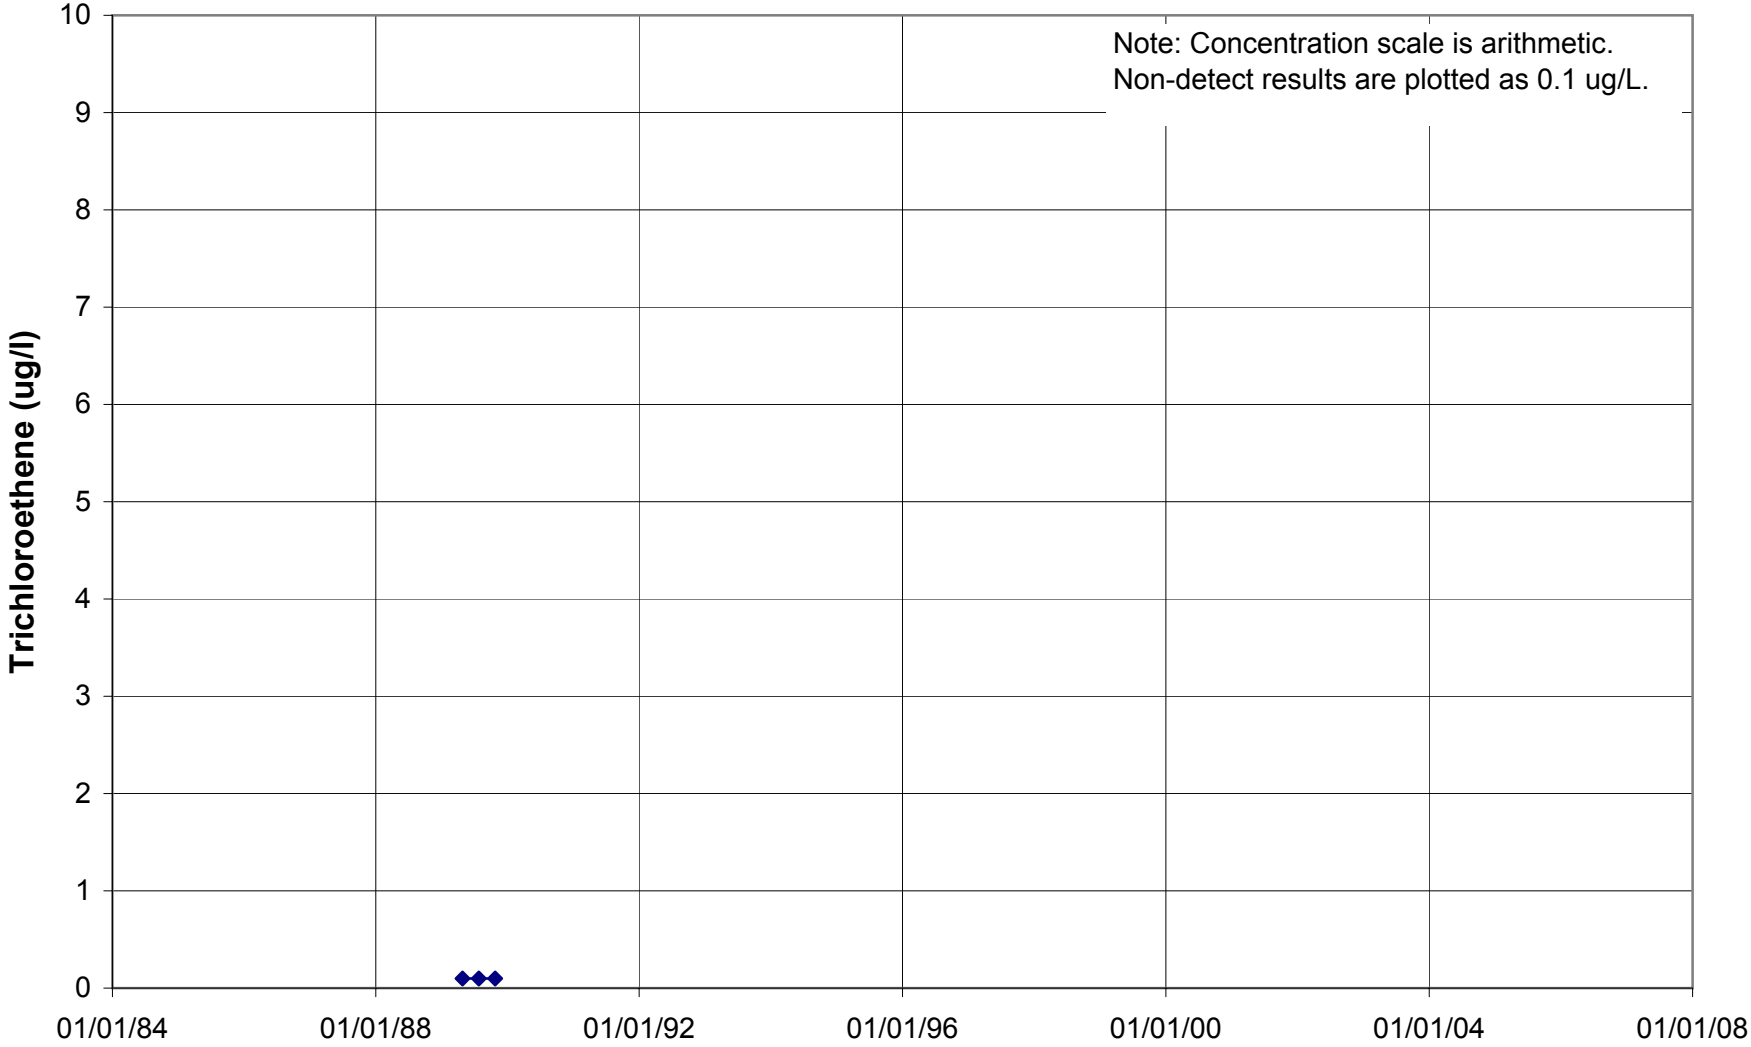

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U052

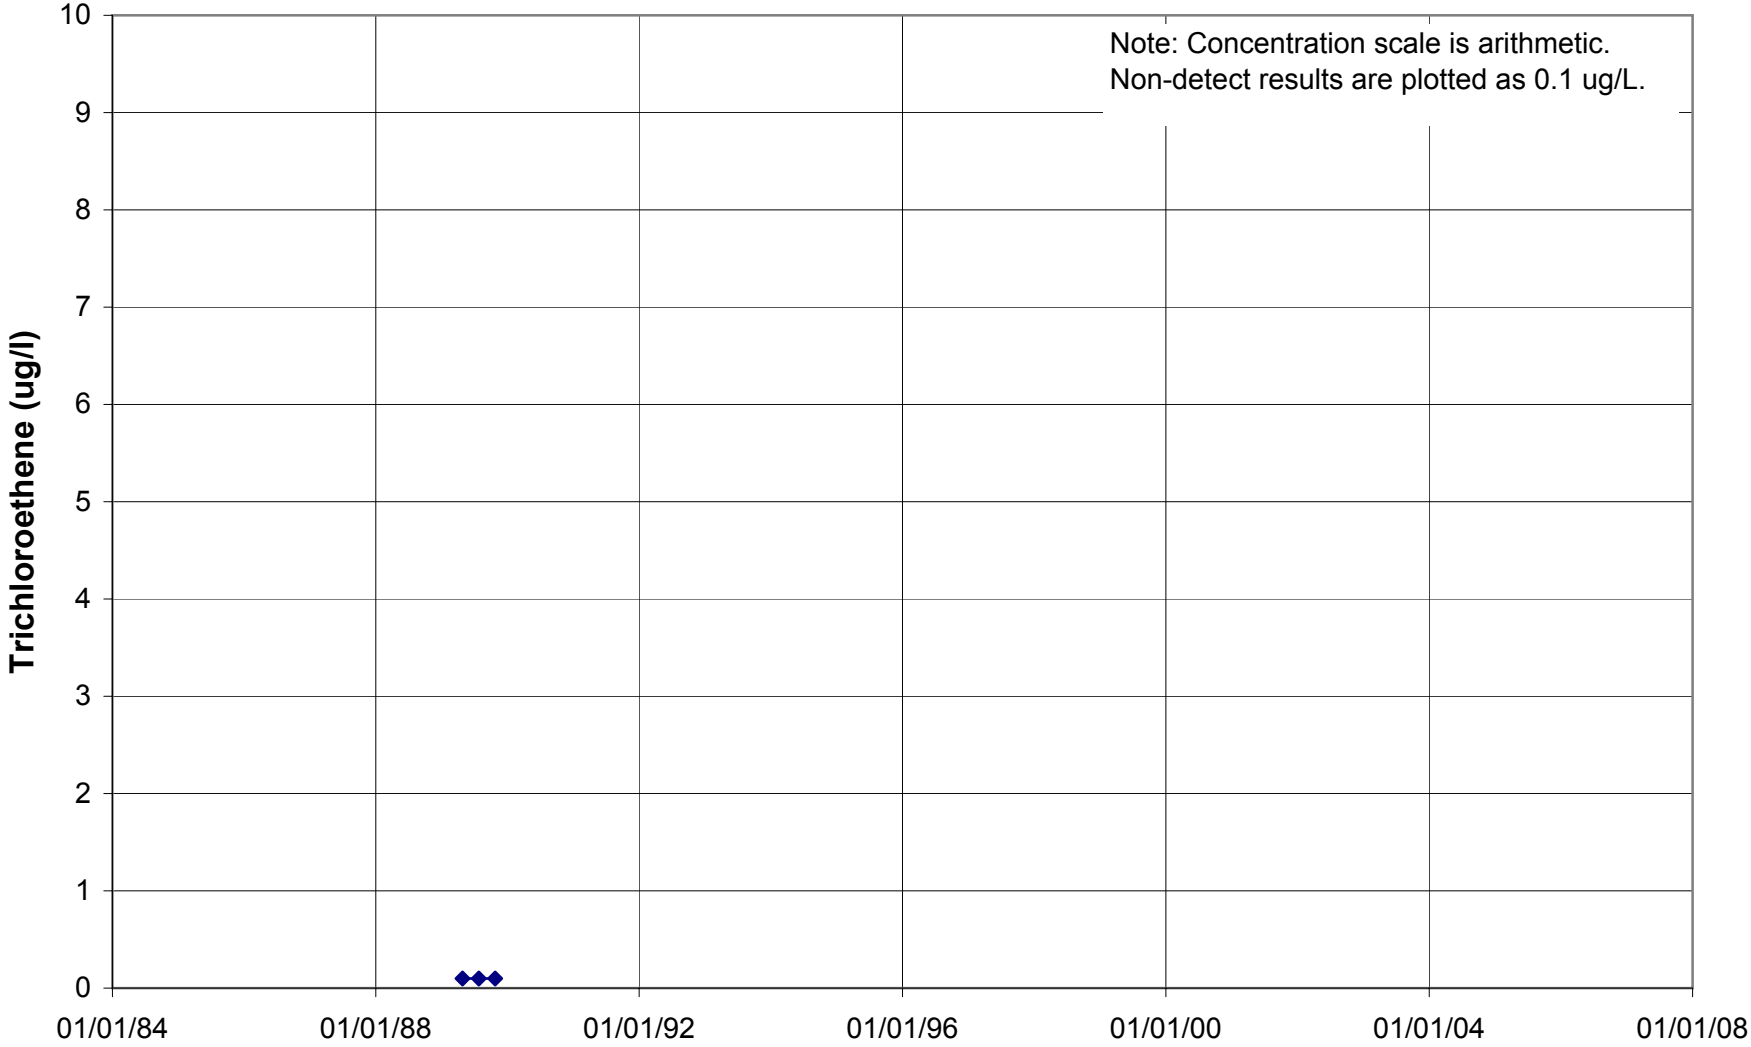

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U060

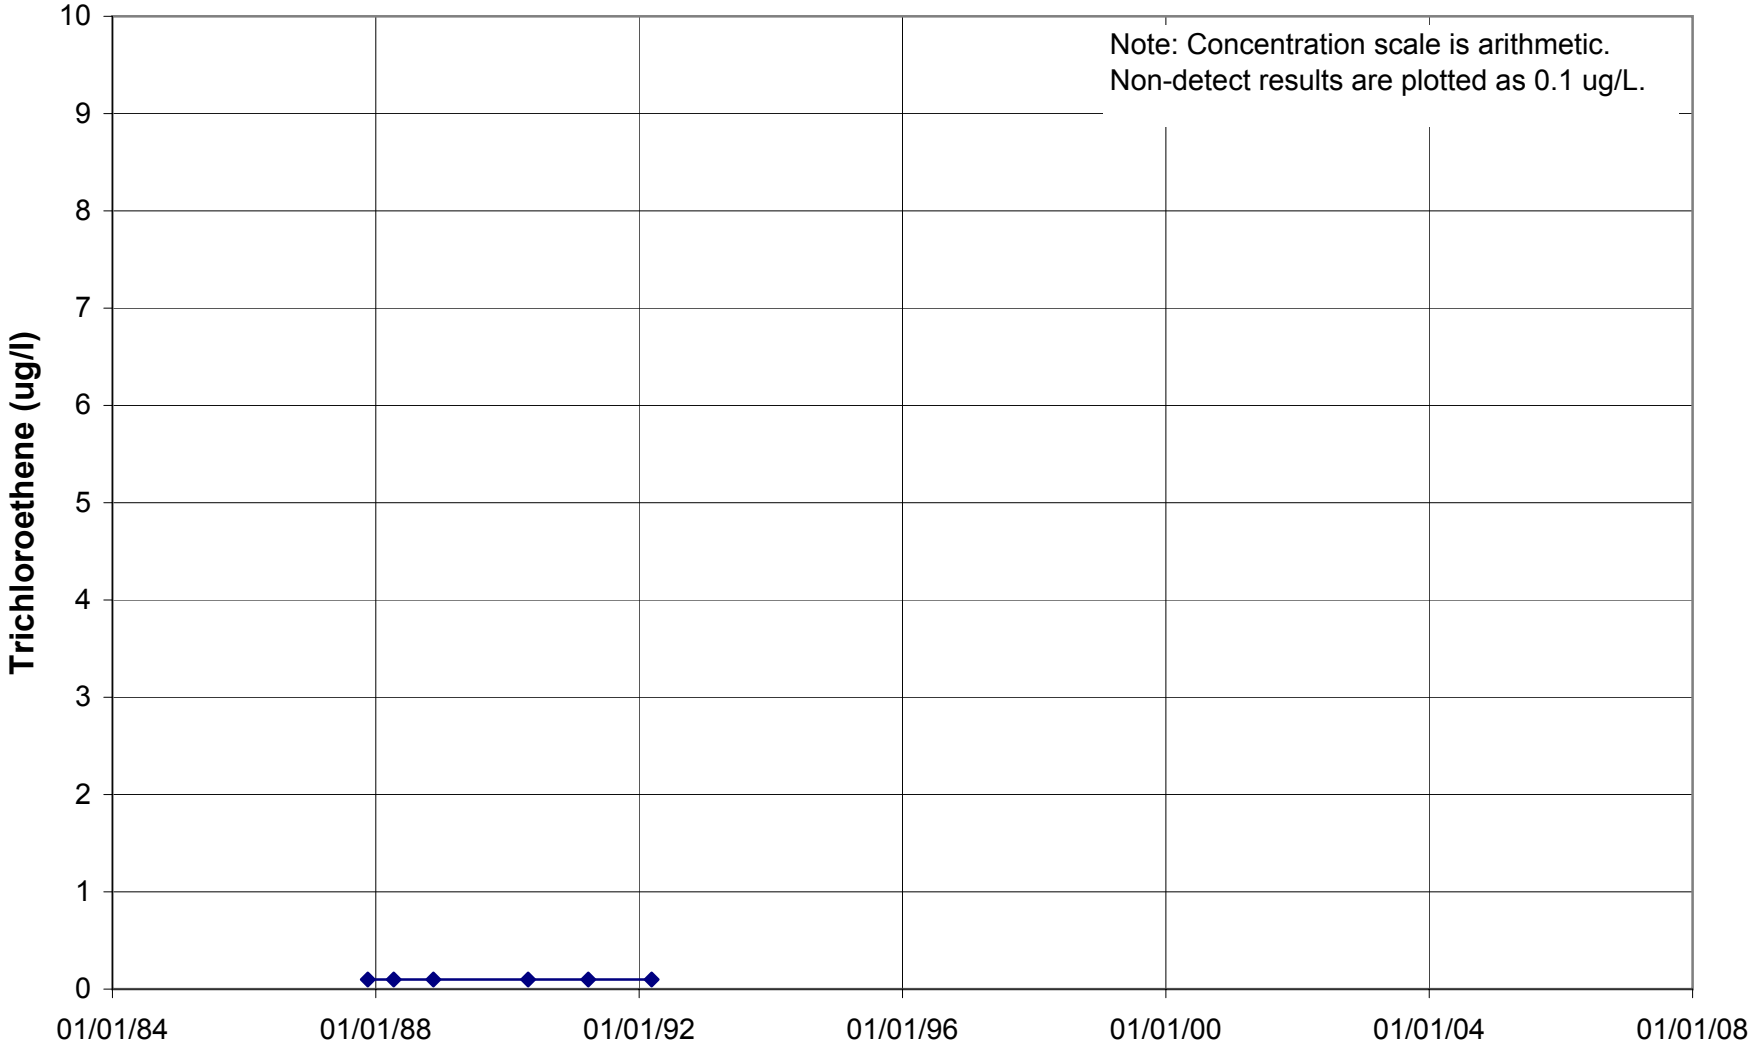

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U063

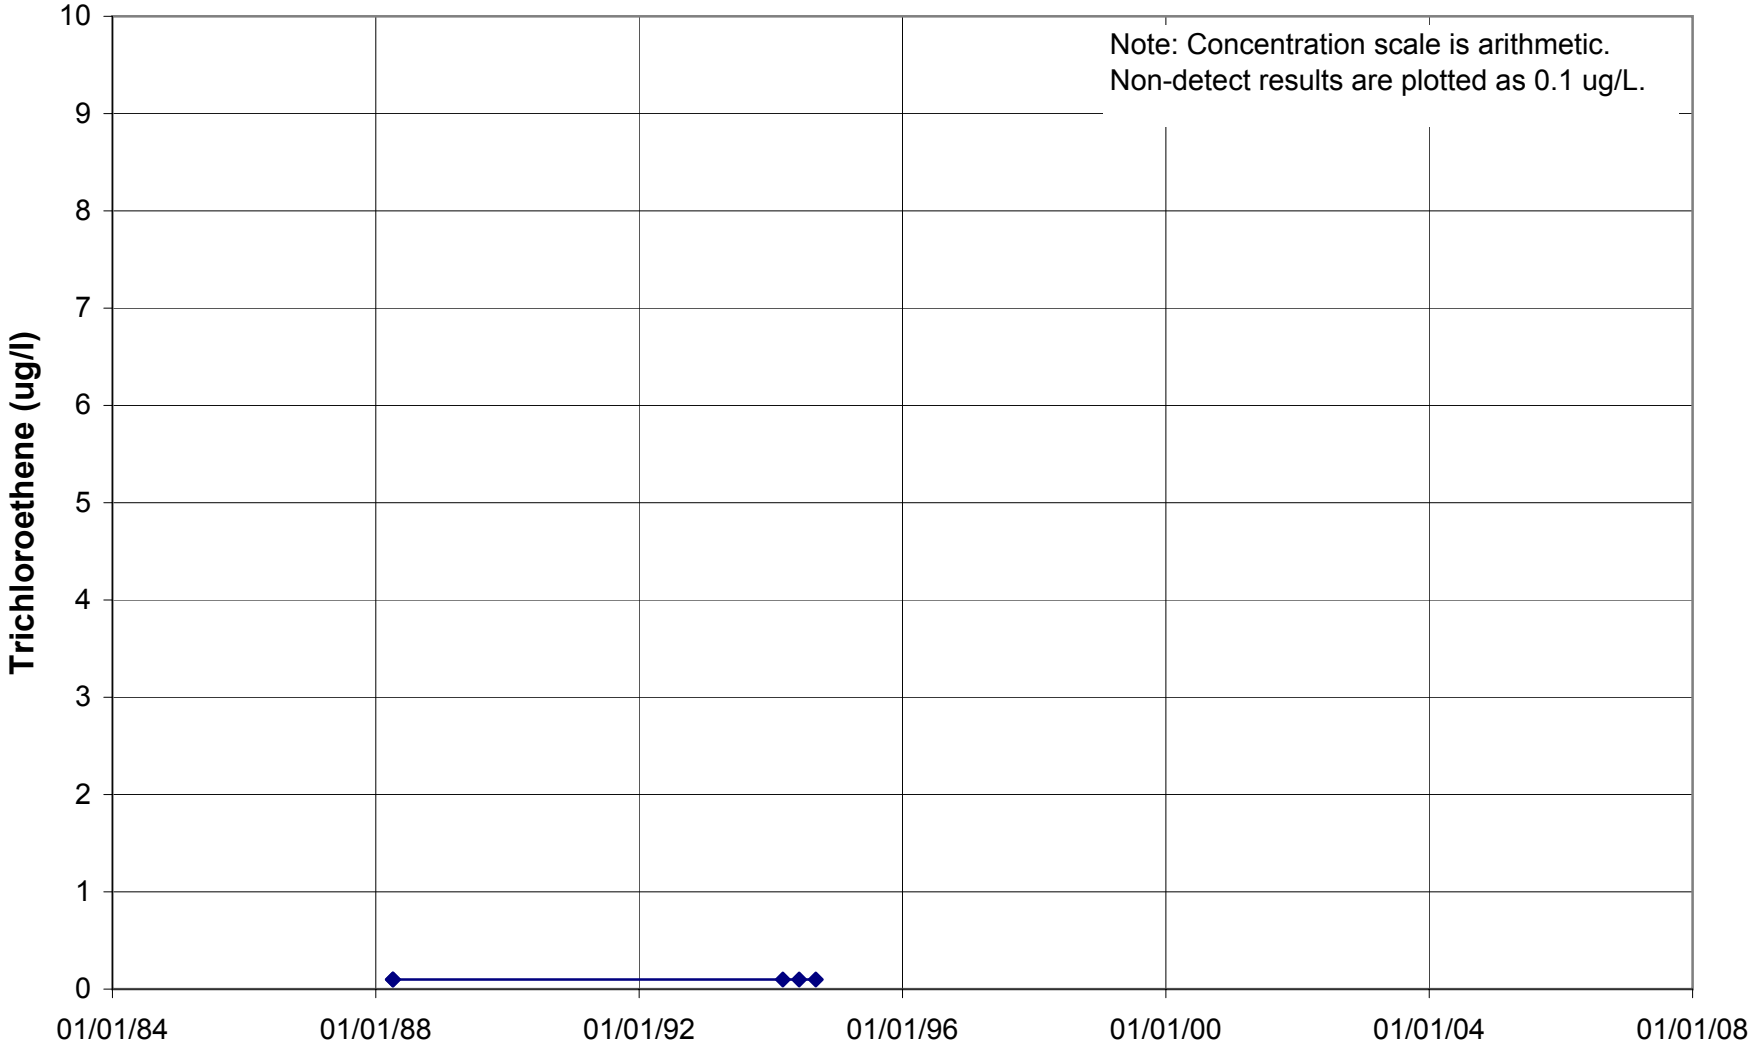

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U064

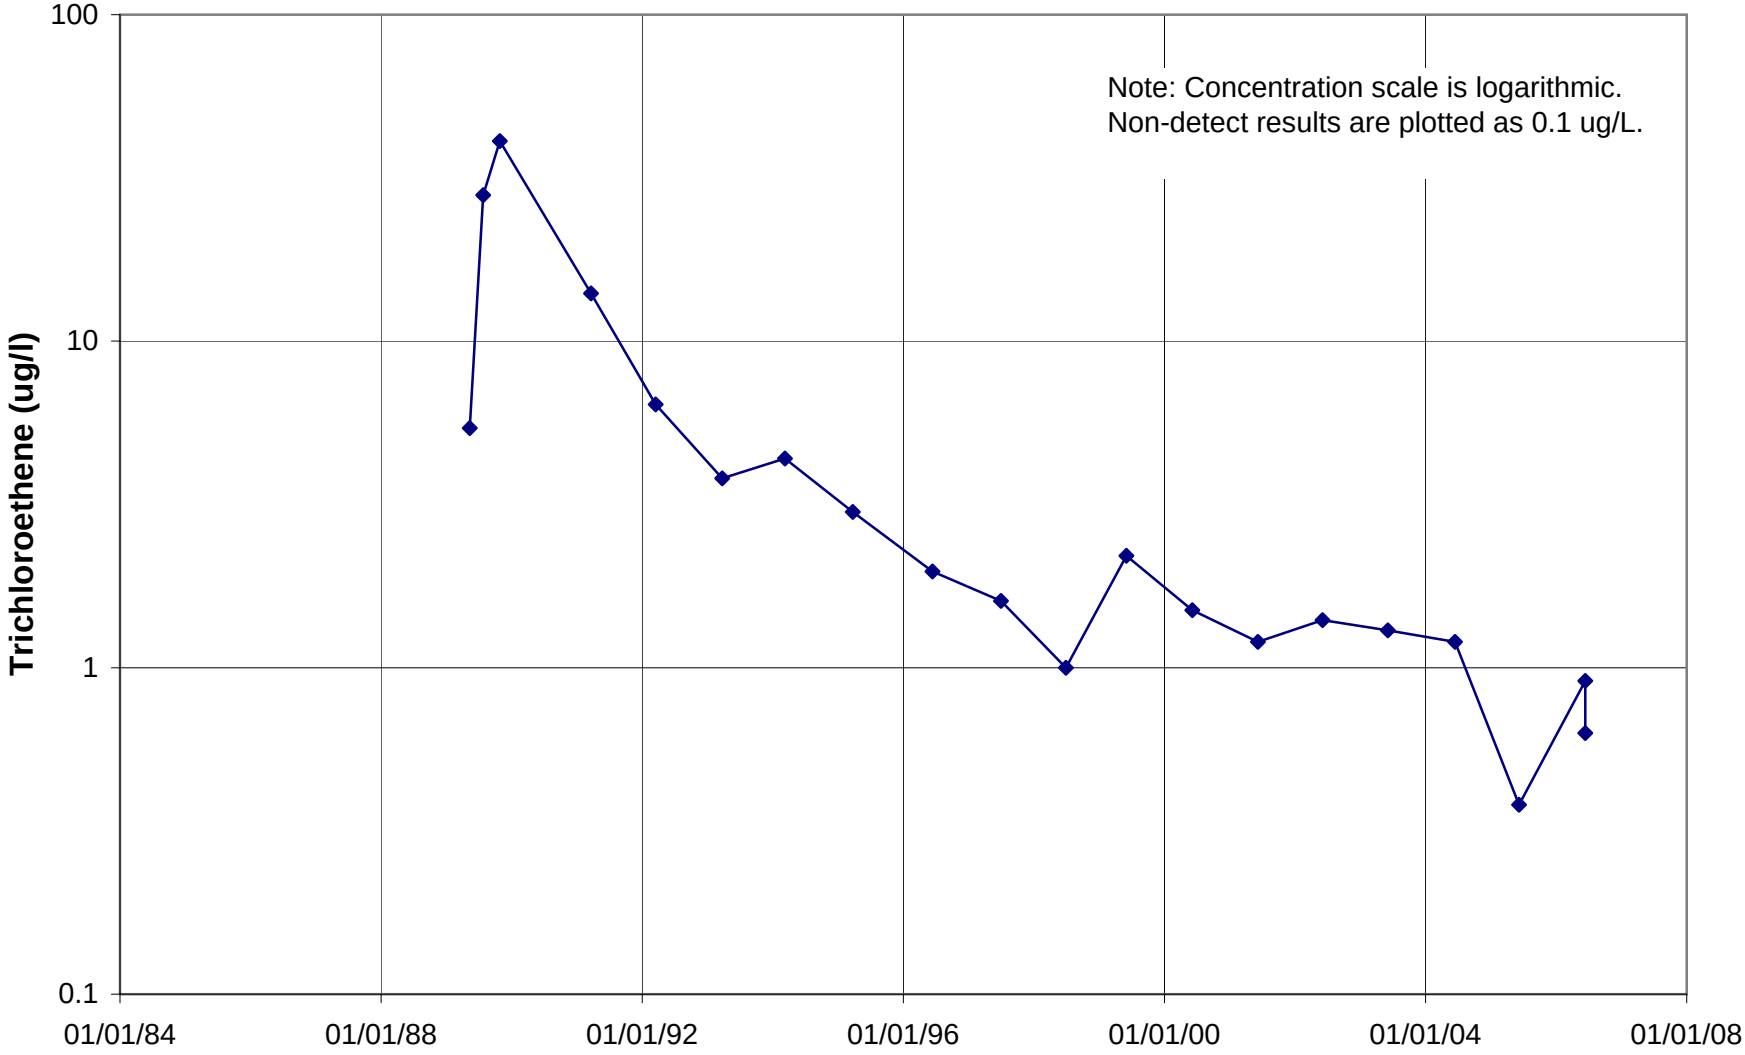

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U067

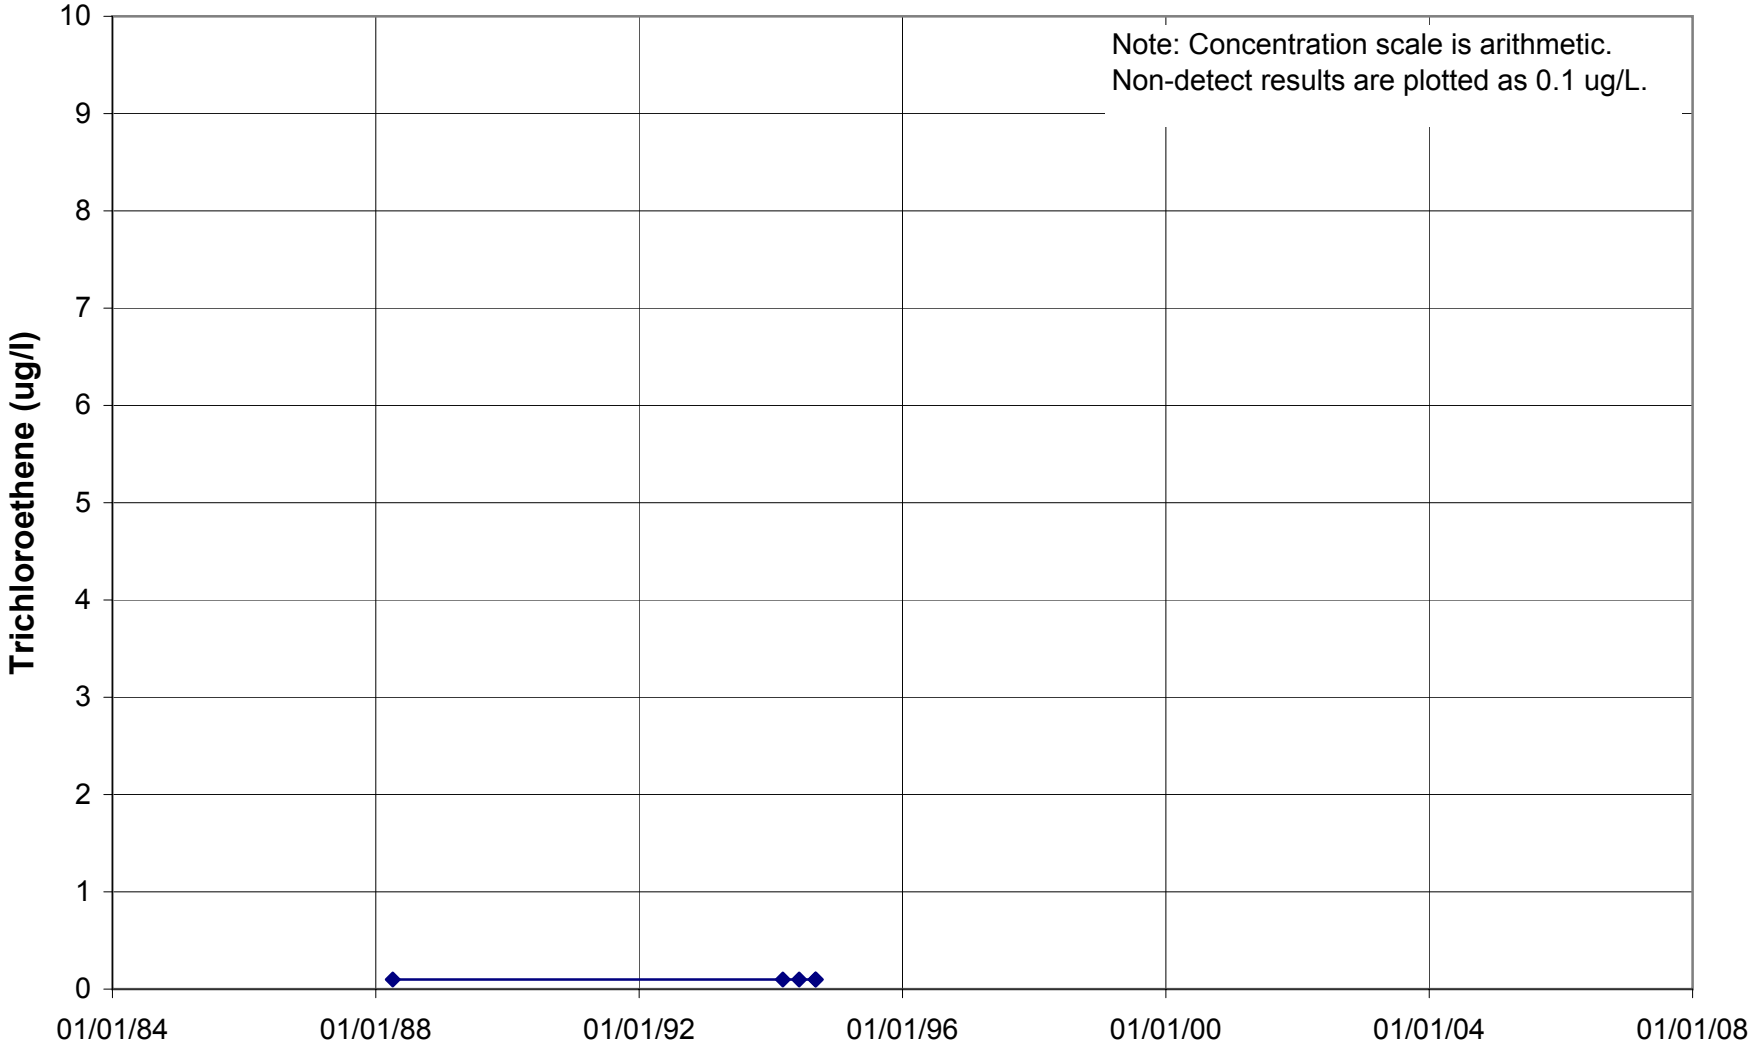

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U072

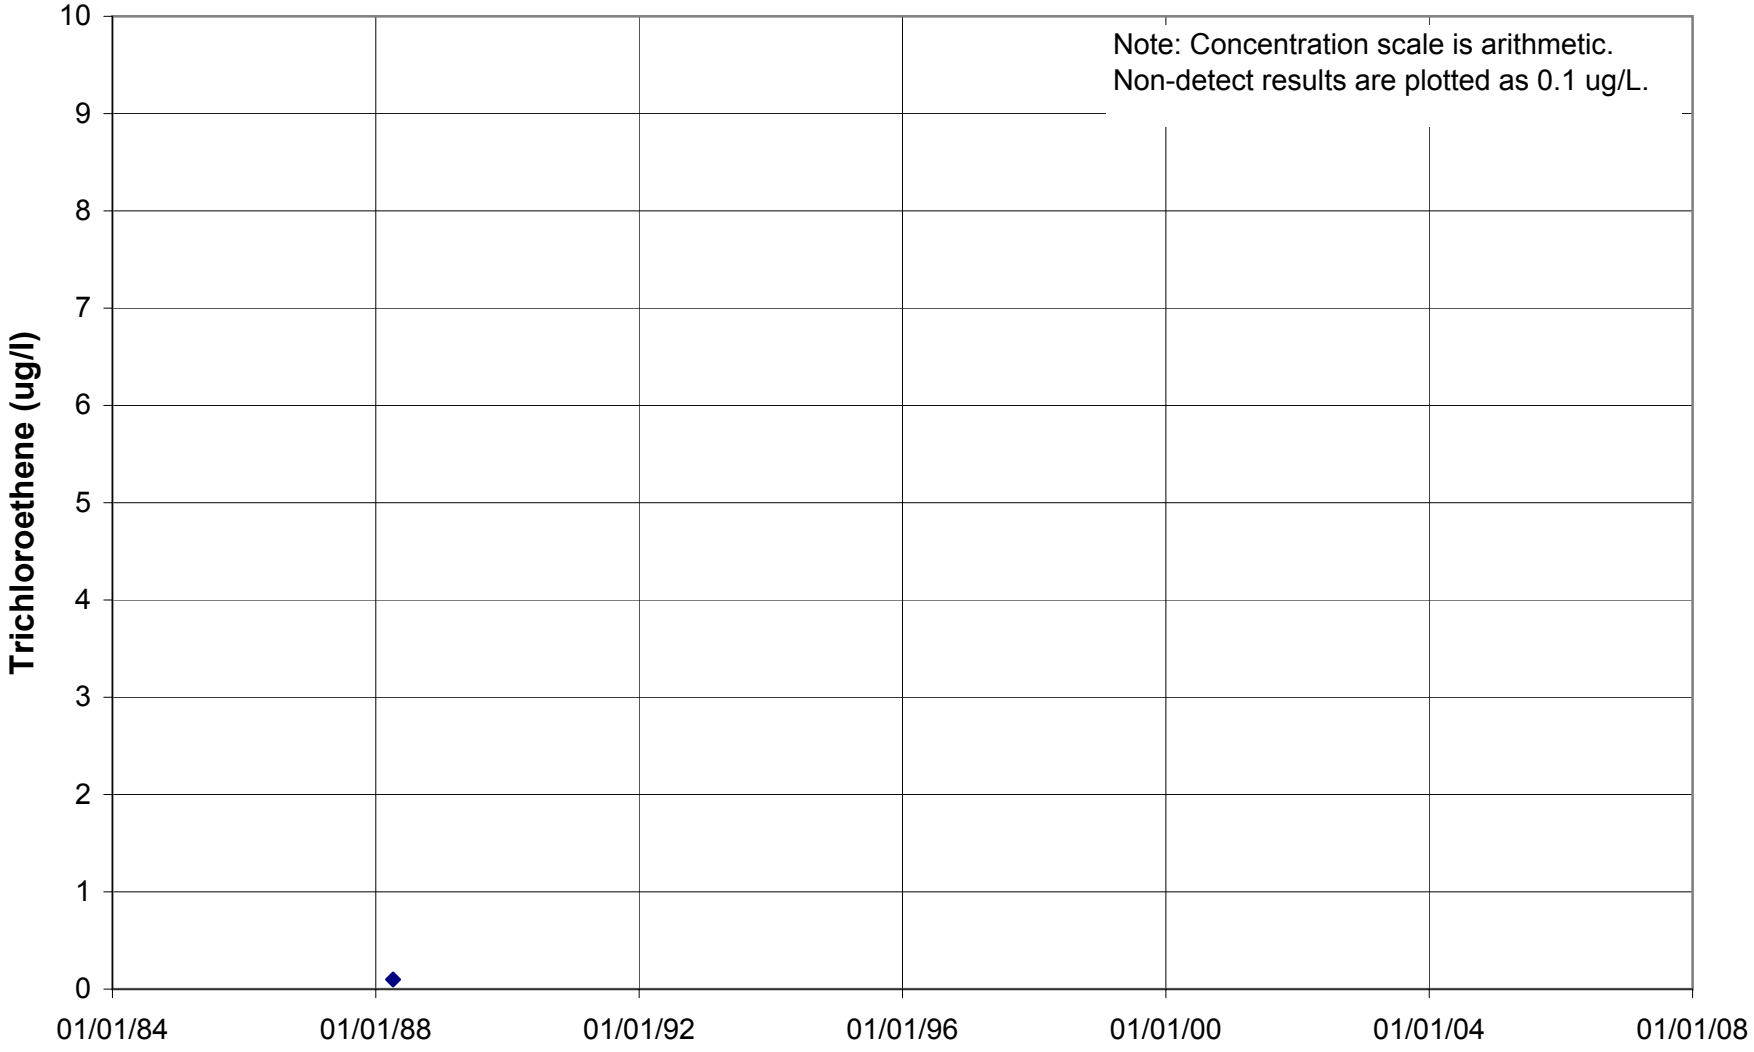

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U085

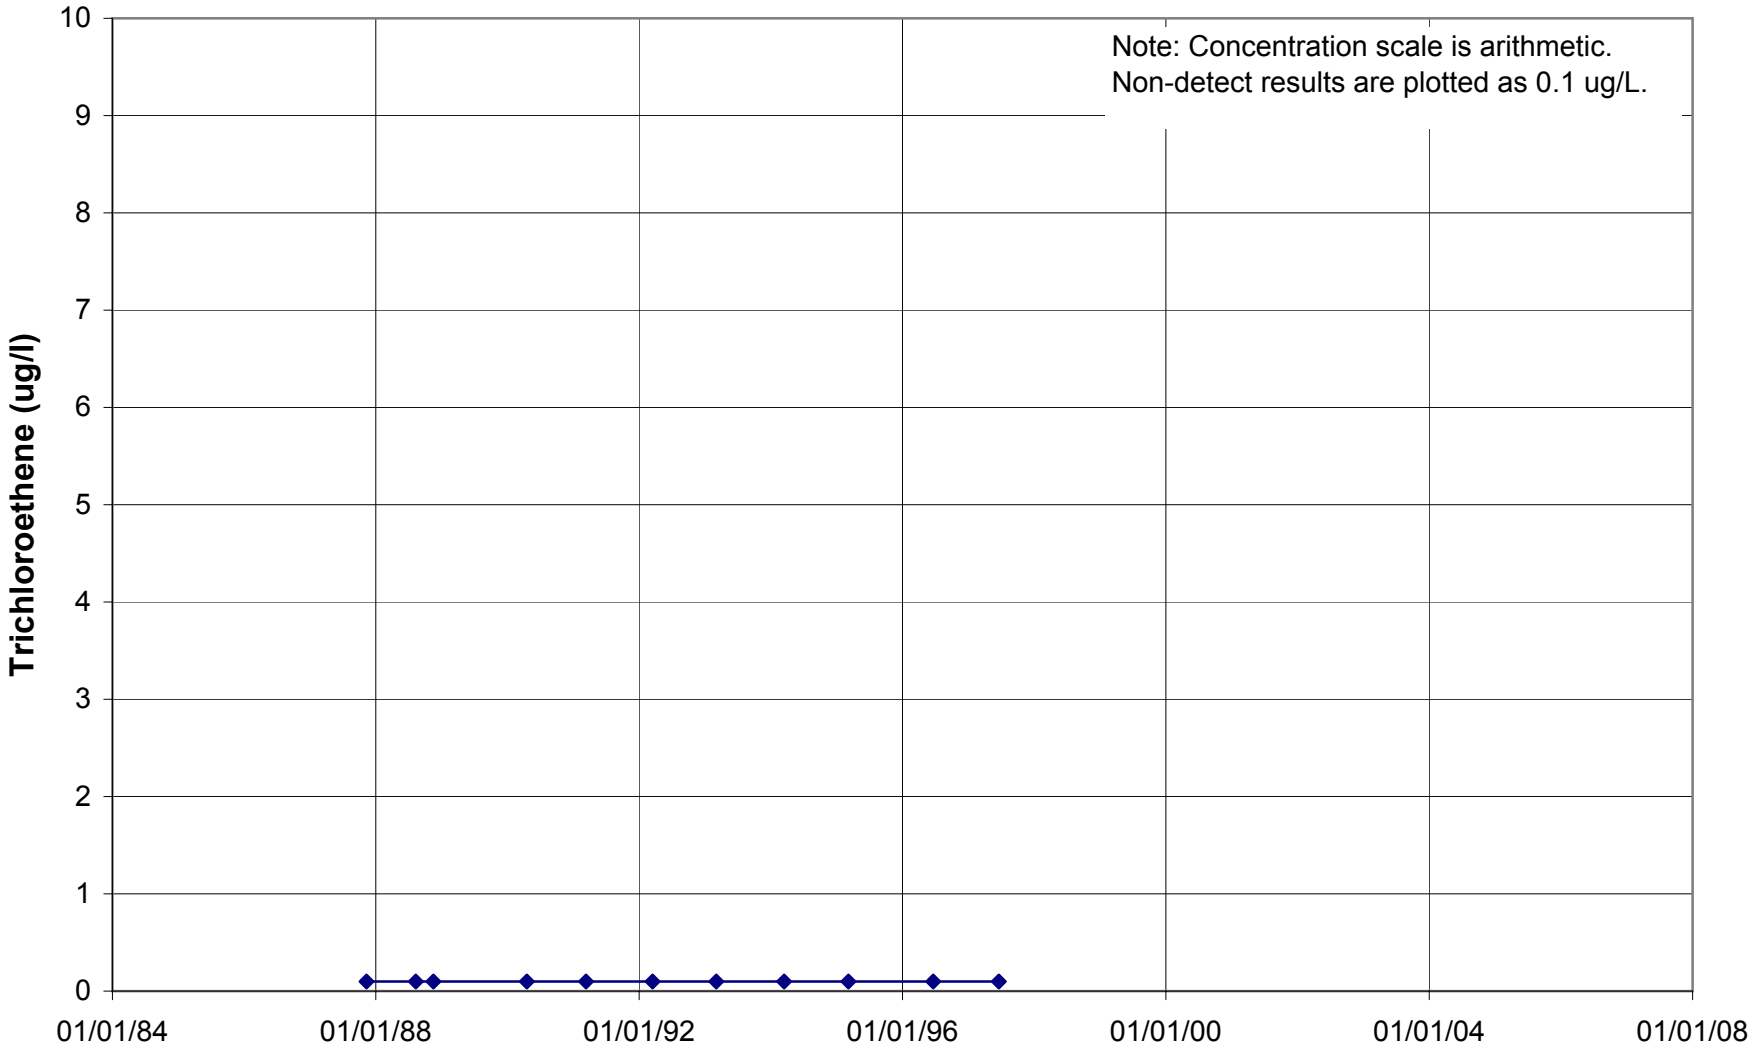

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U102

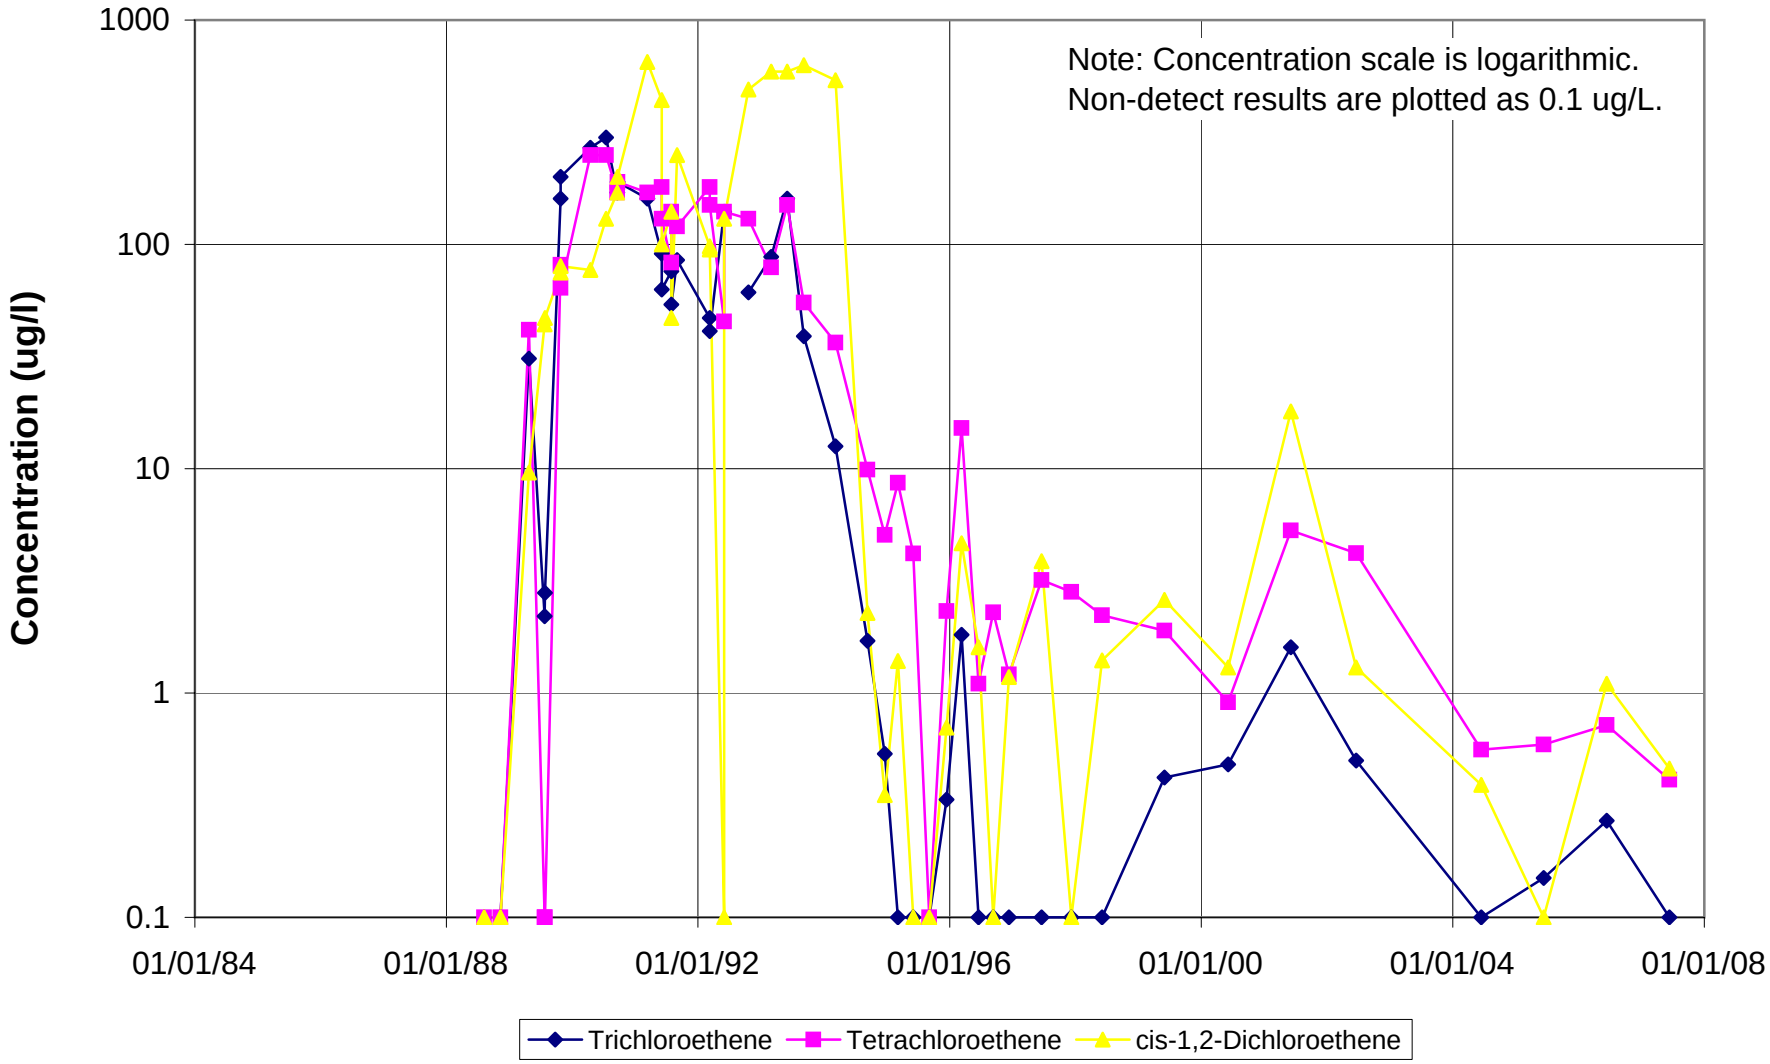

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U103

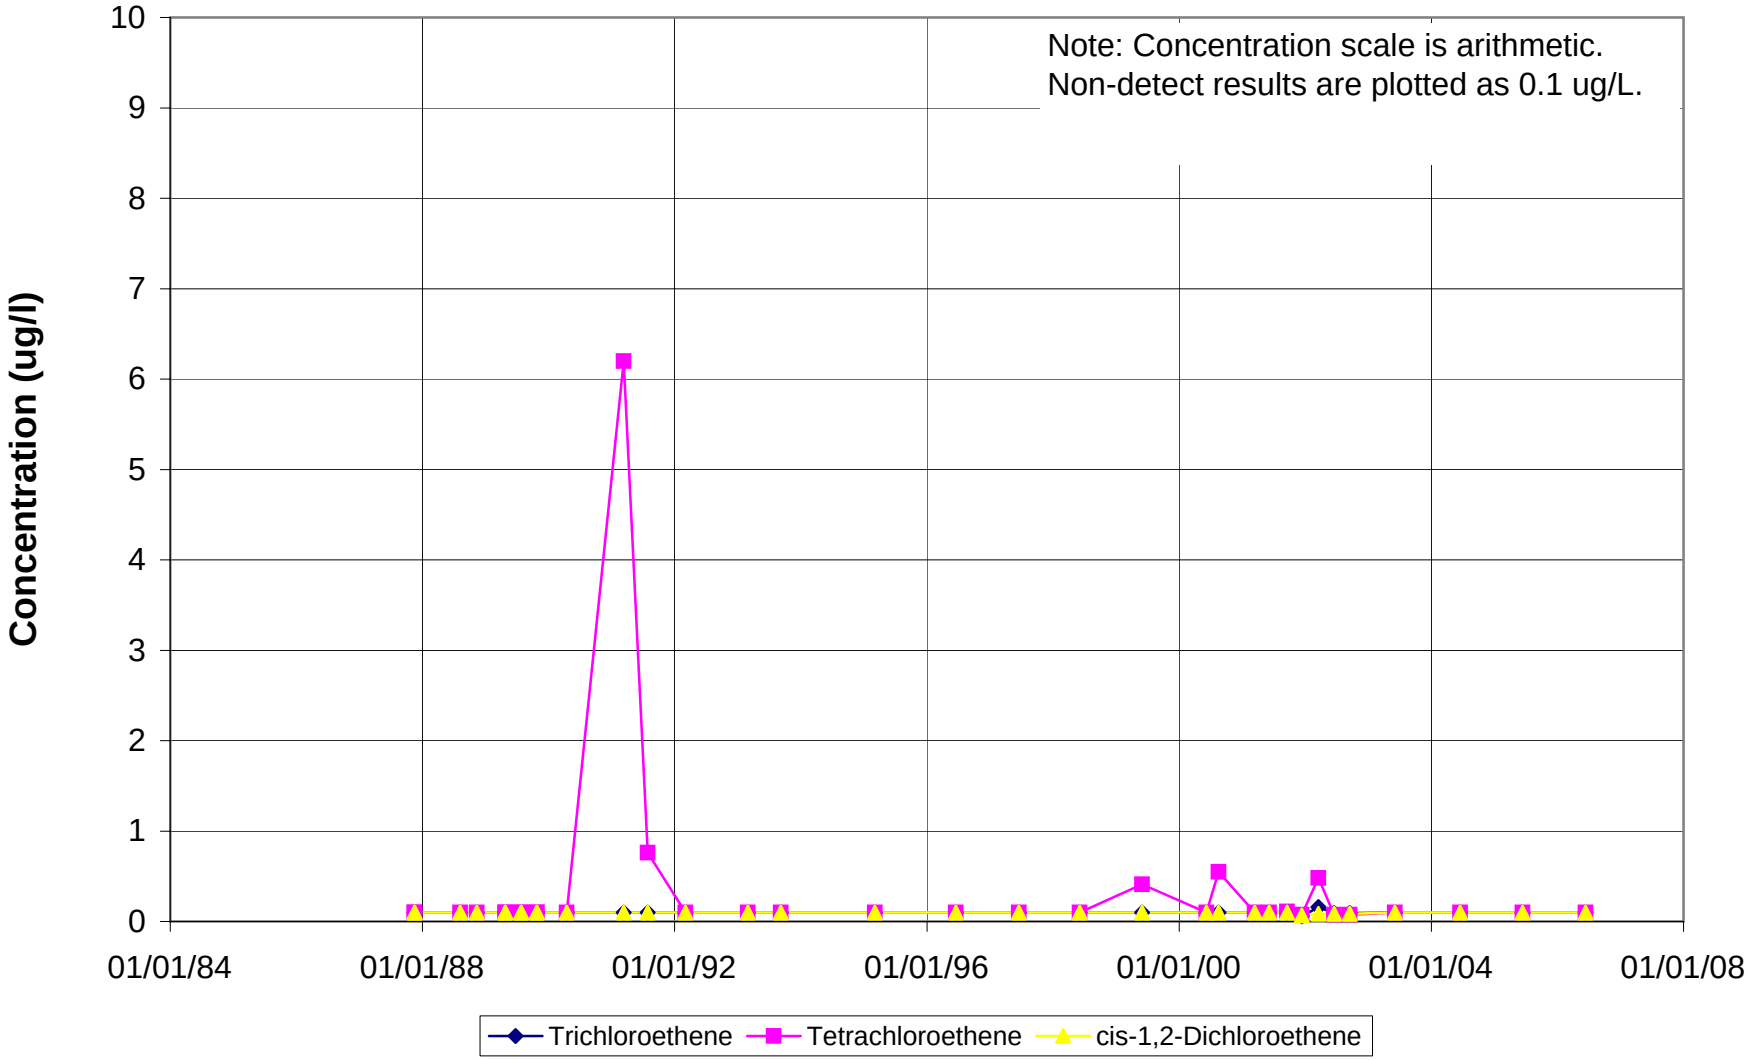

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U104

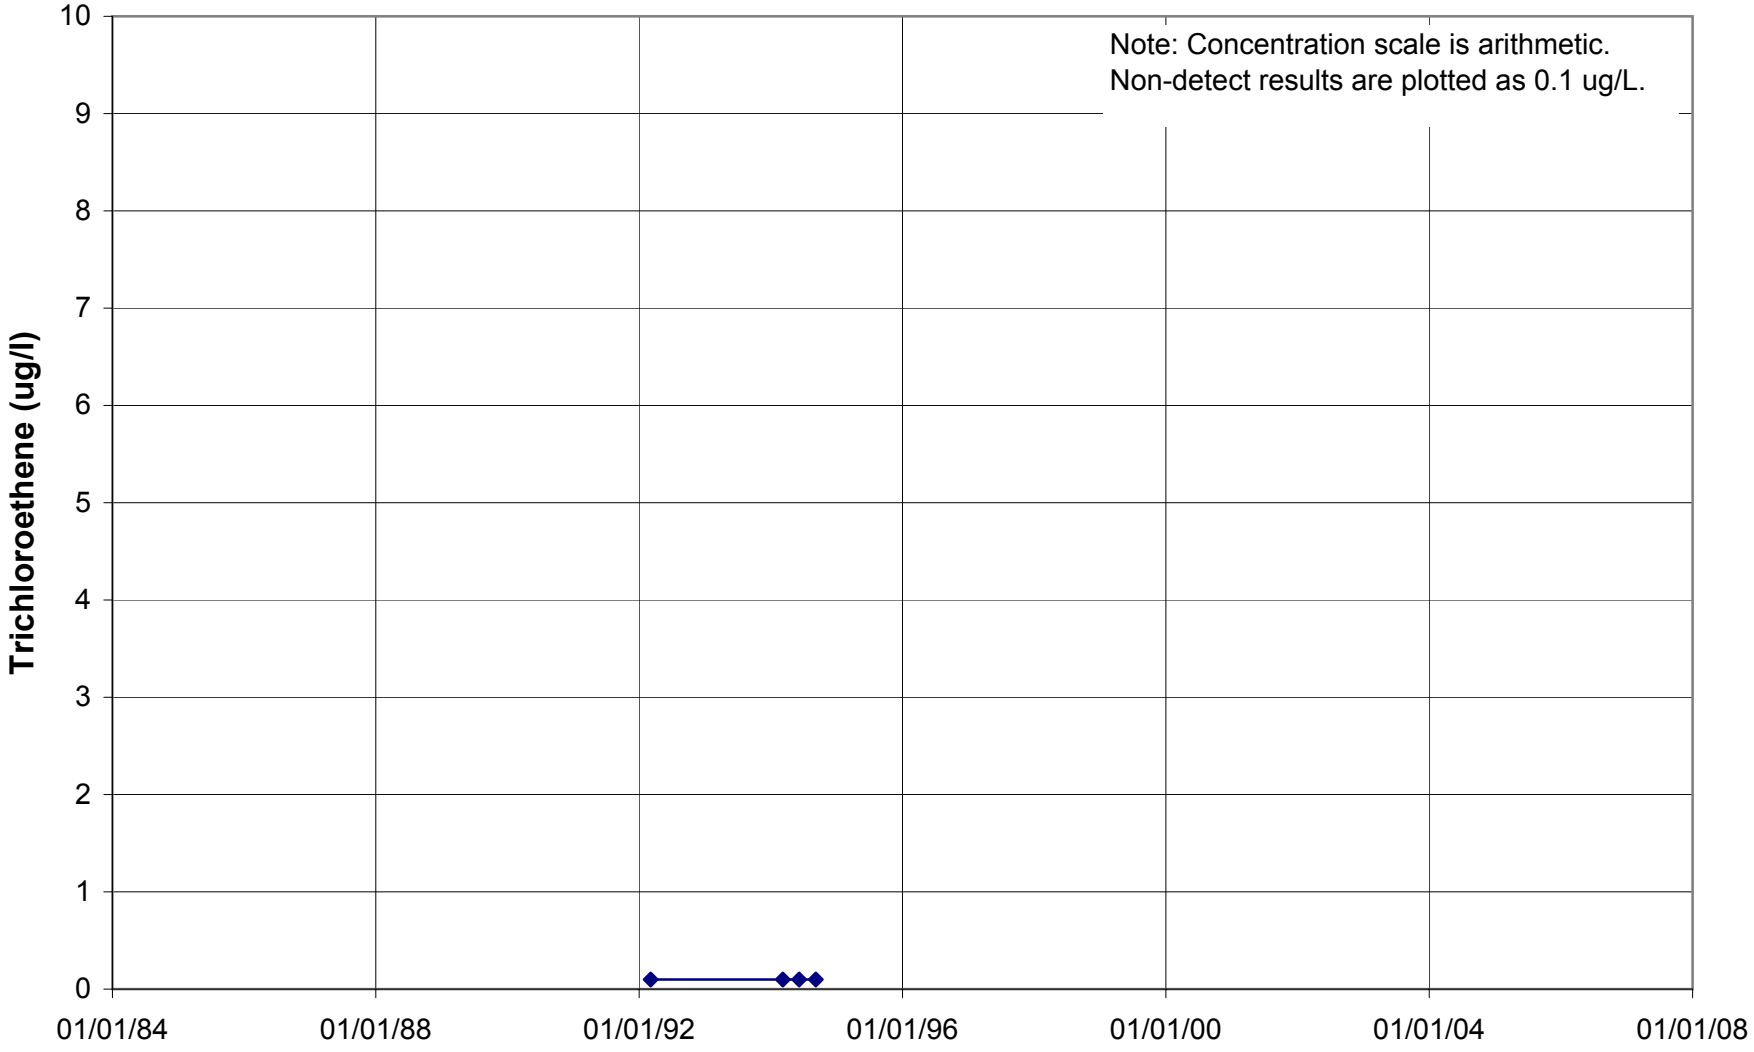

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U105

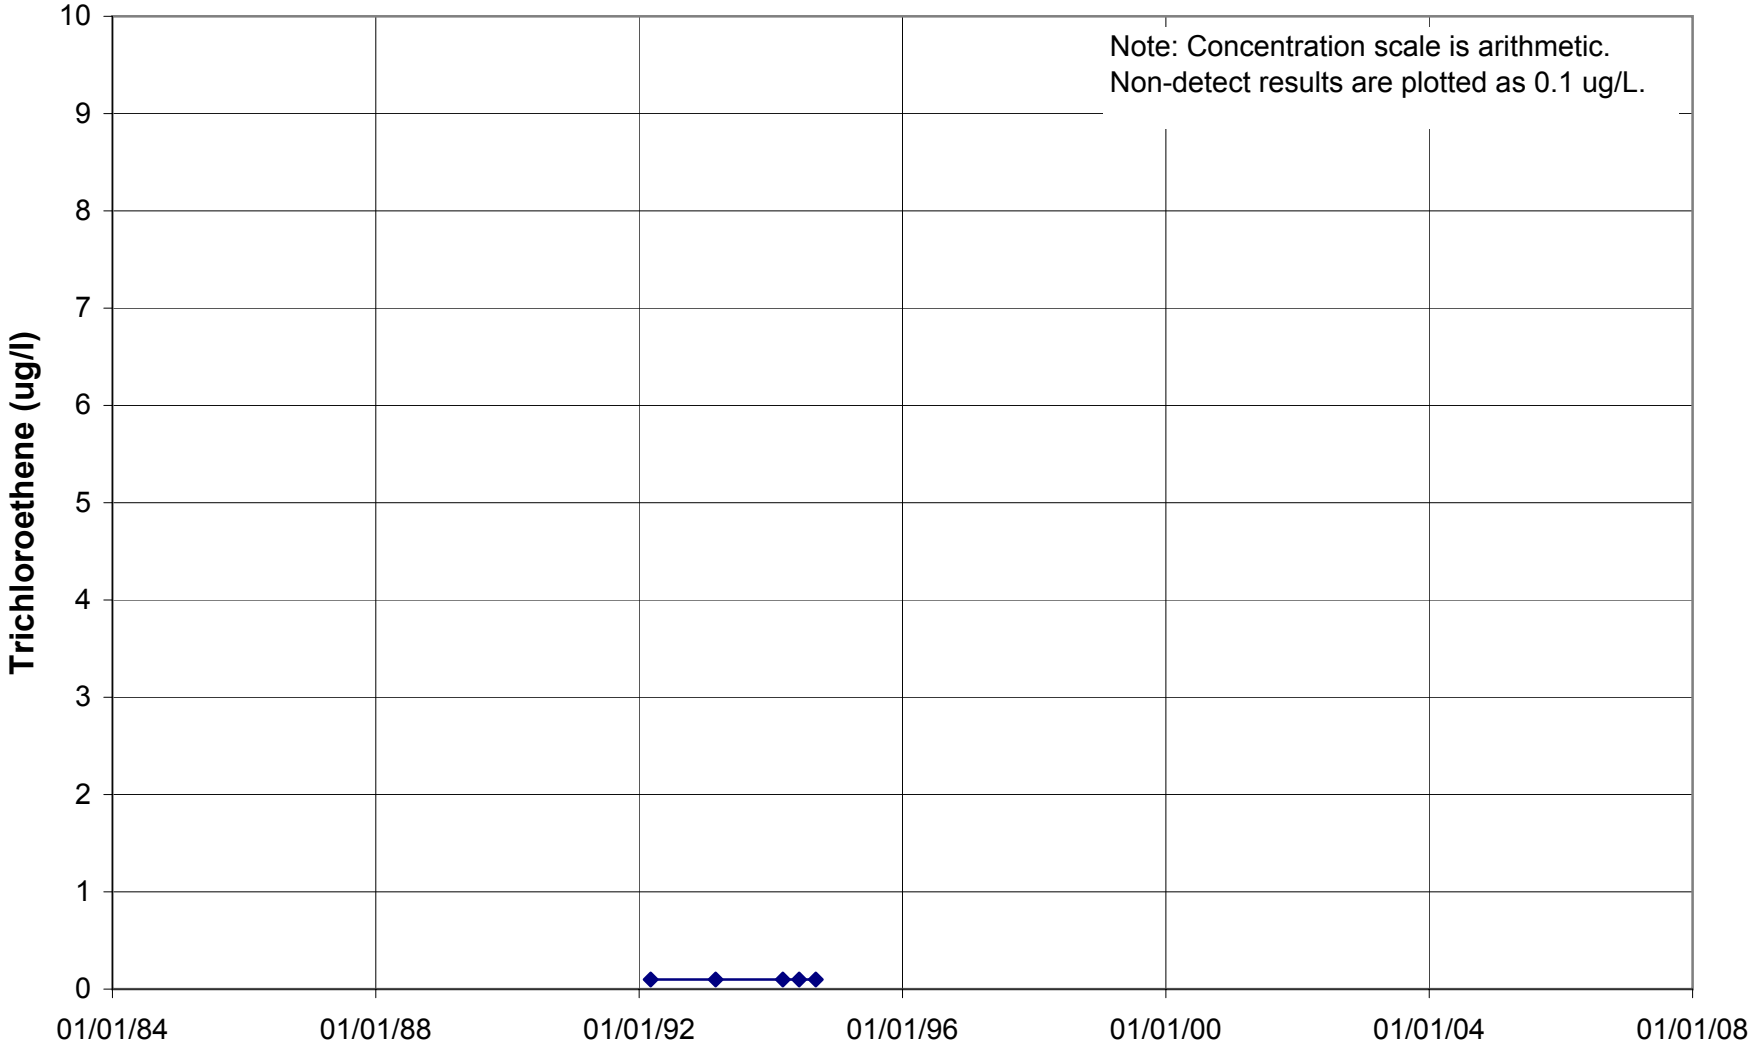

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U106

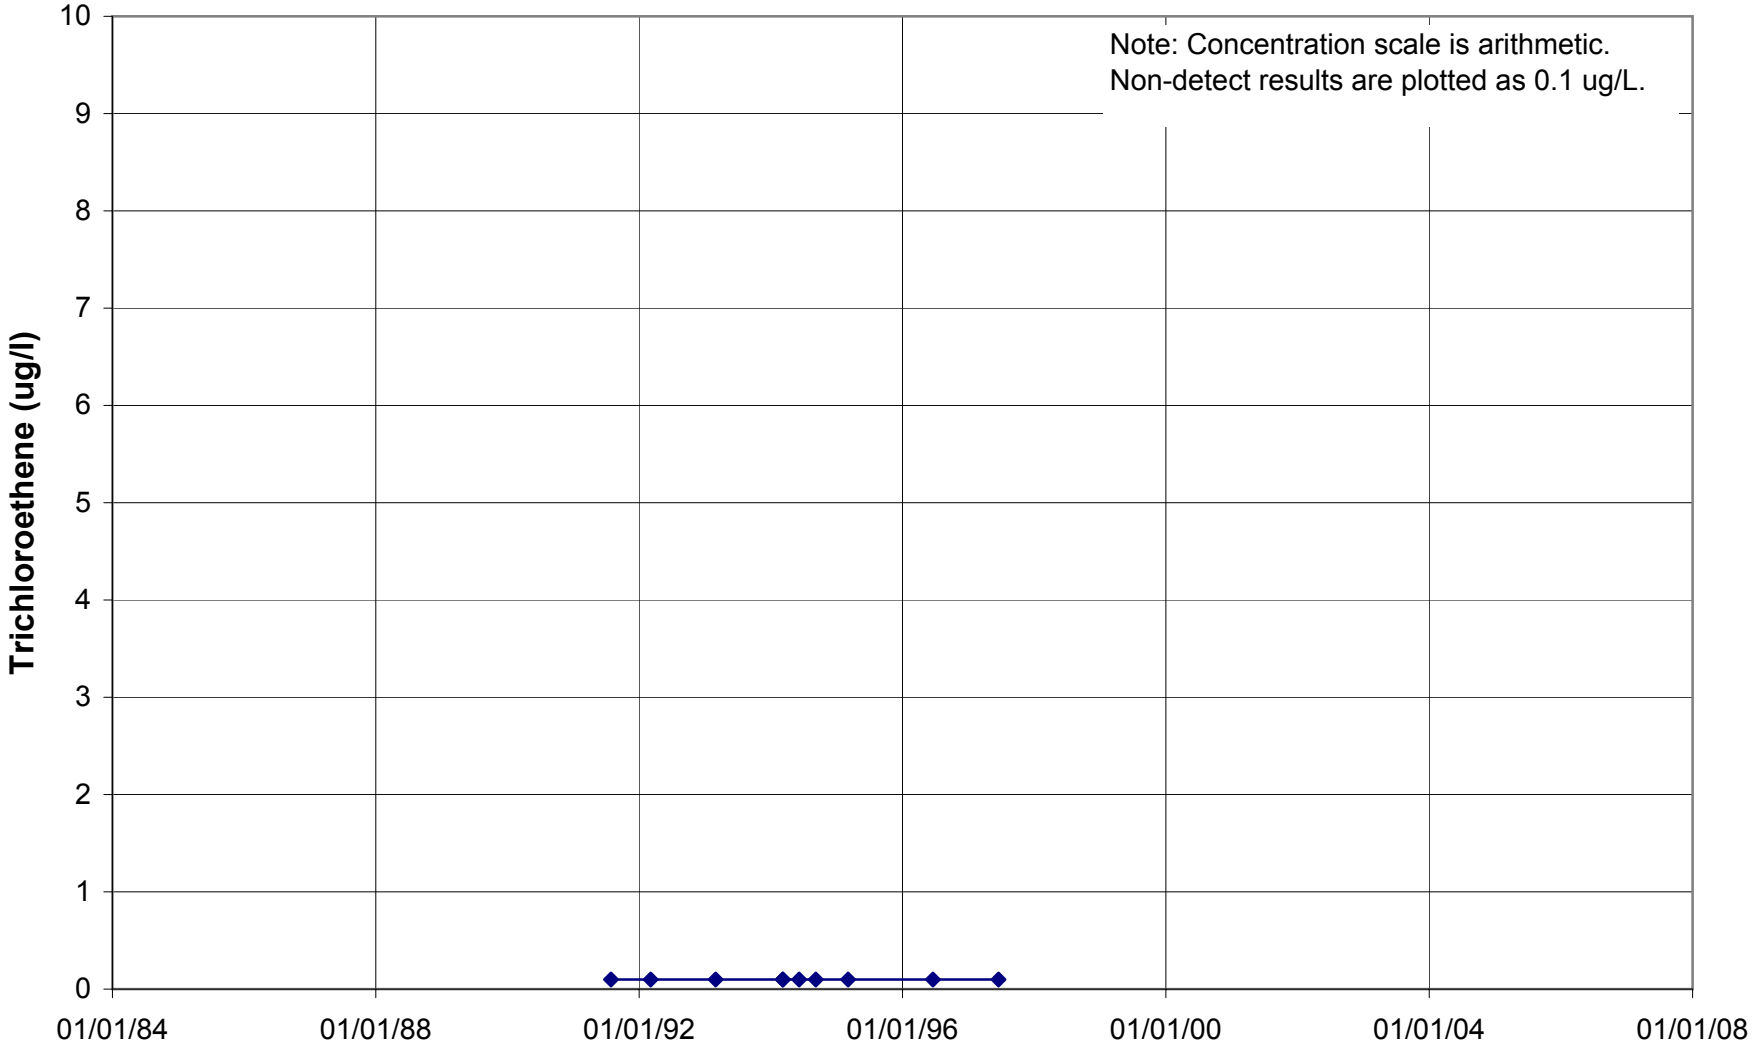

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U107

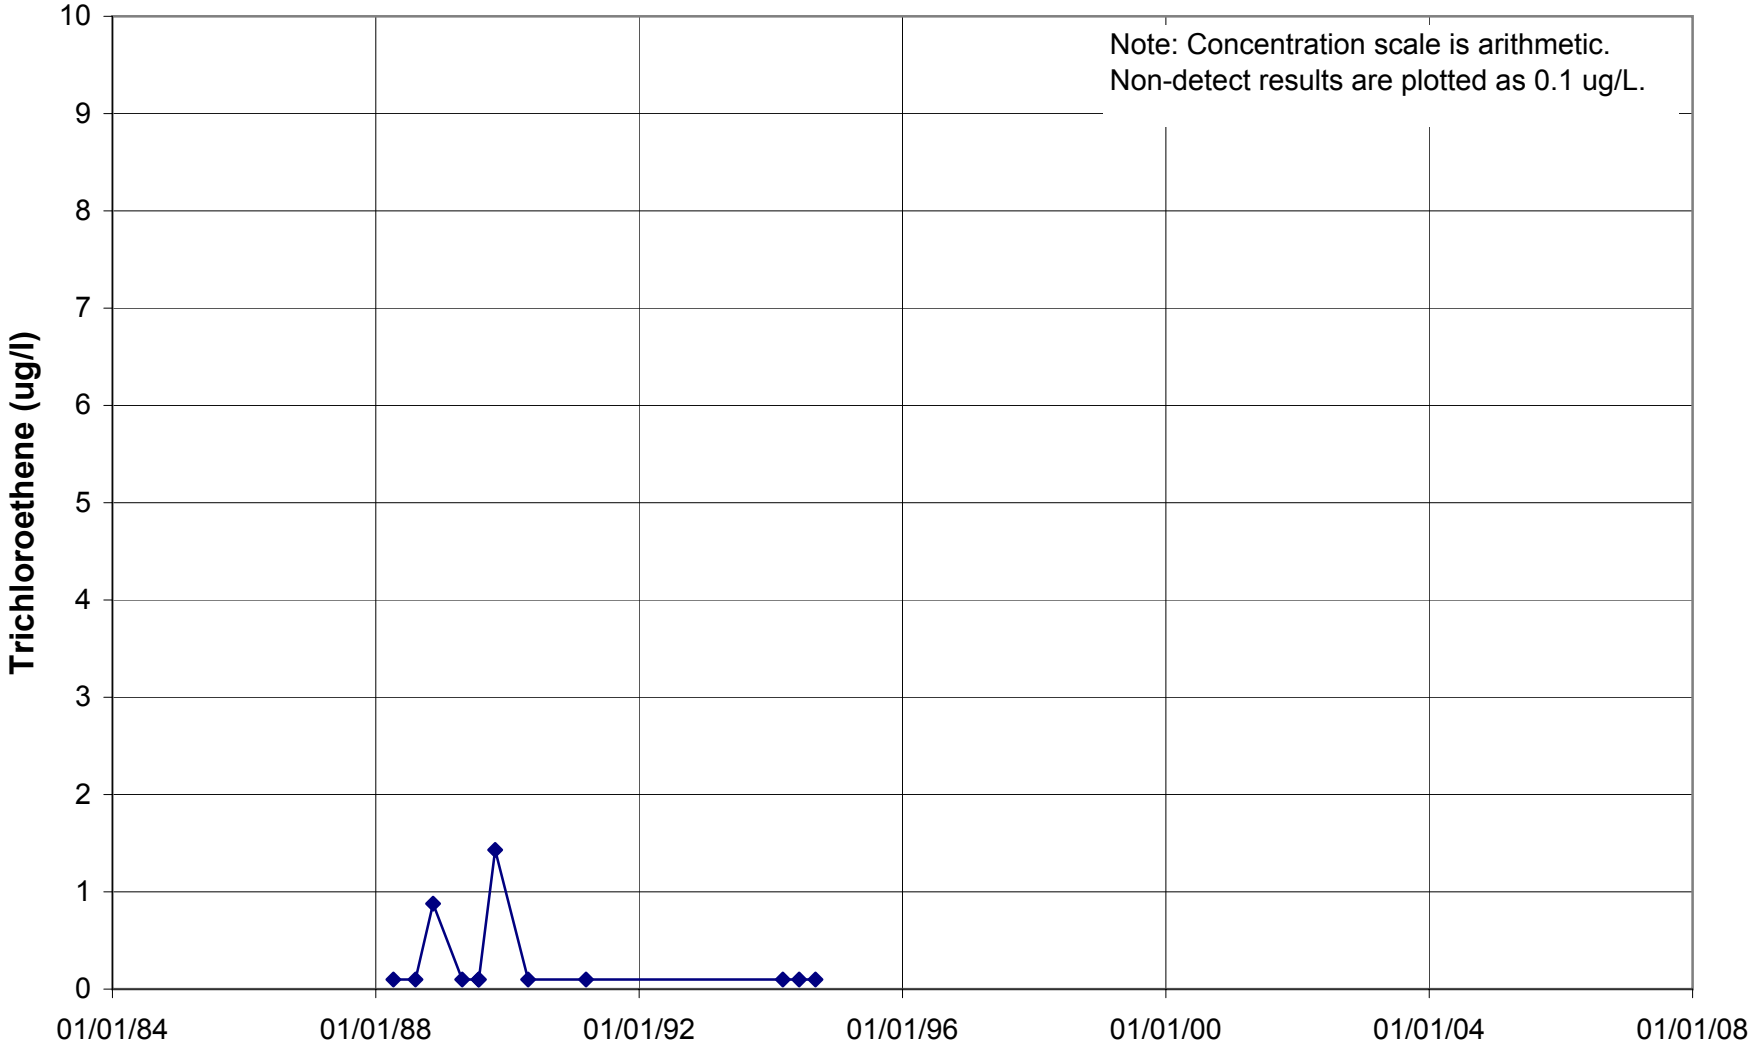

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U108

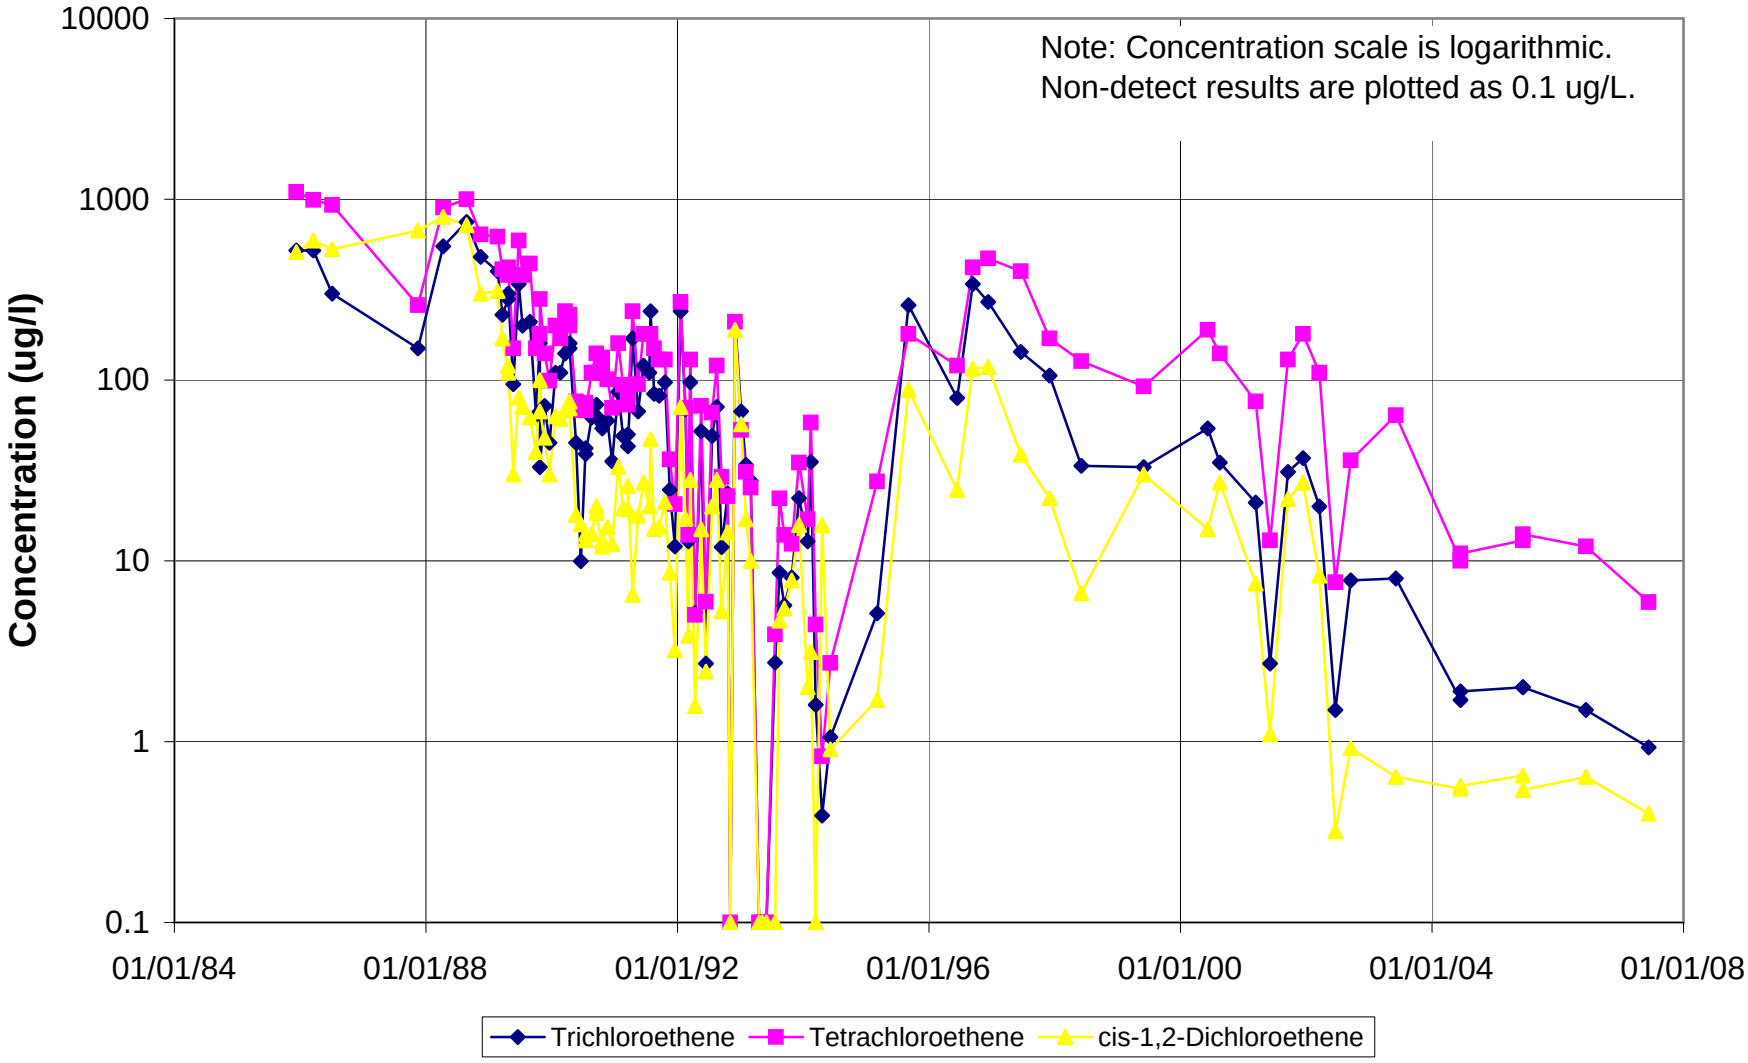

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U110

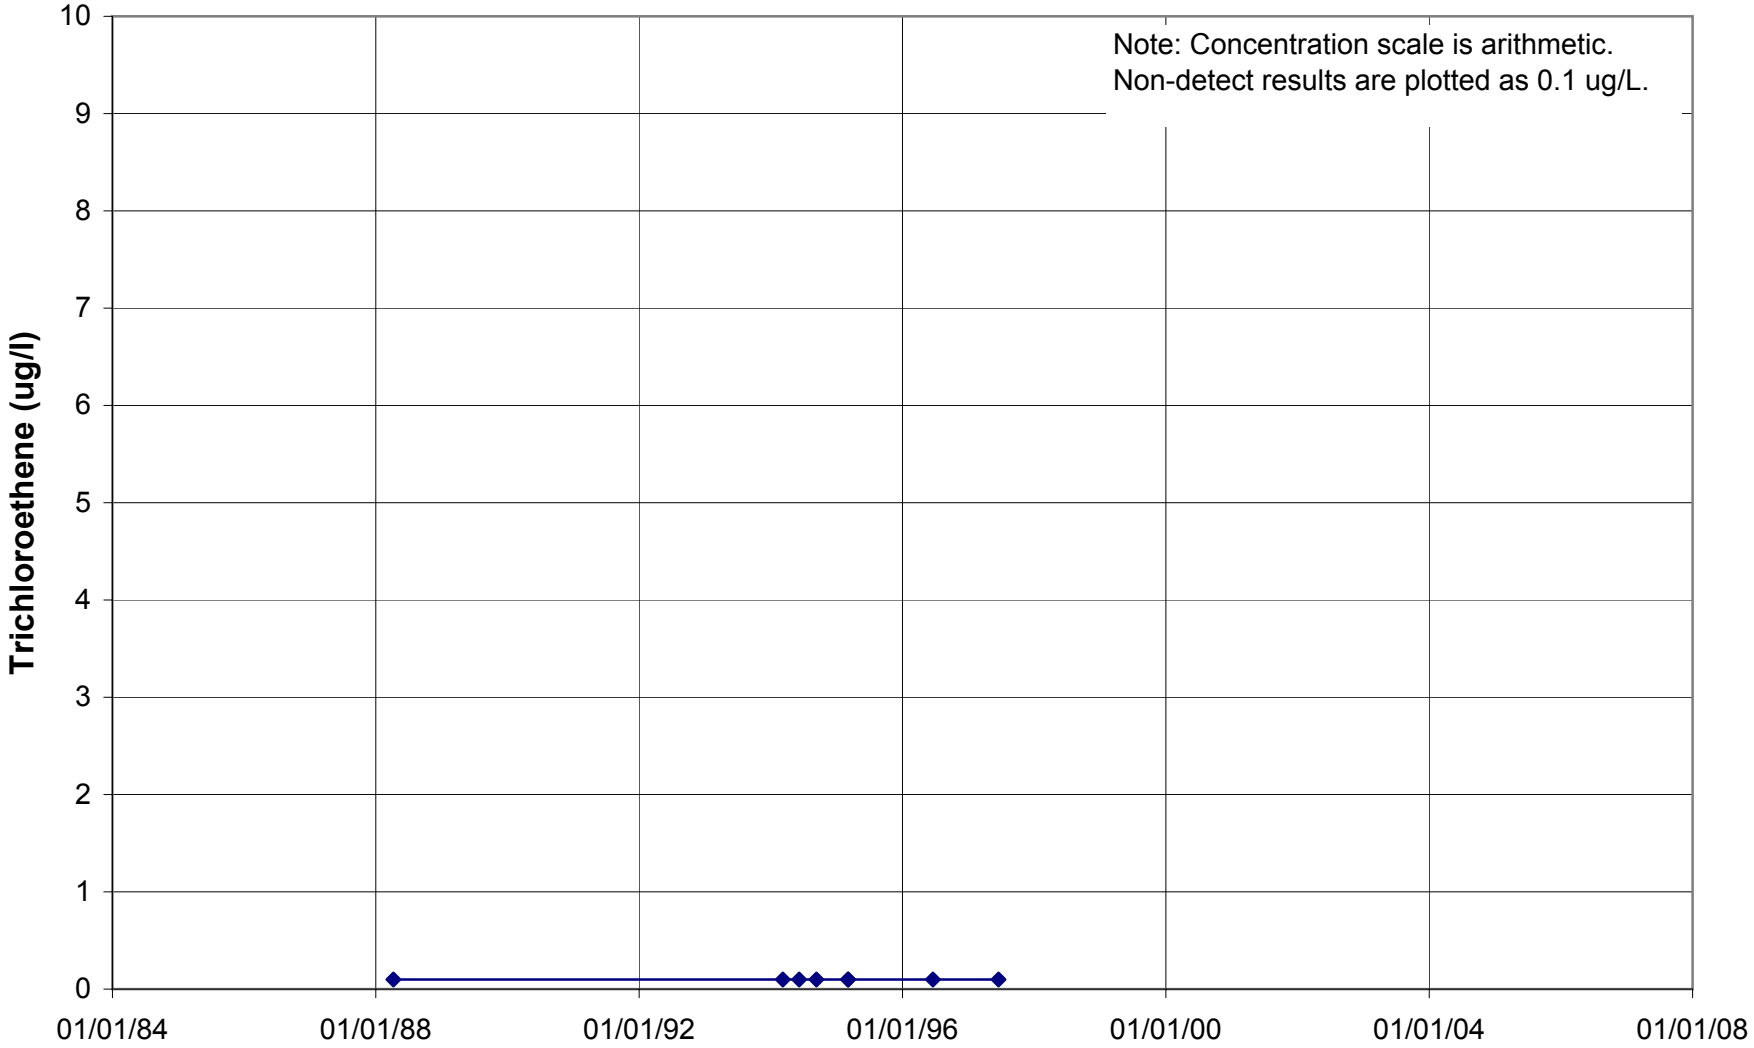

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U115

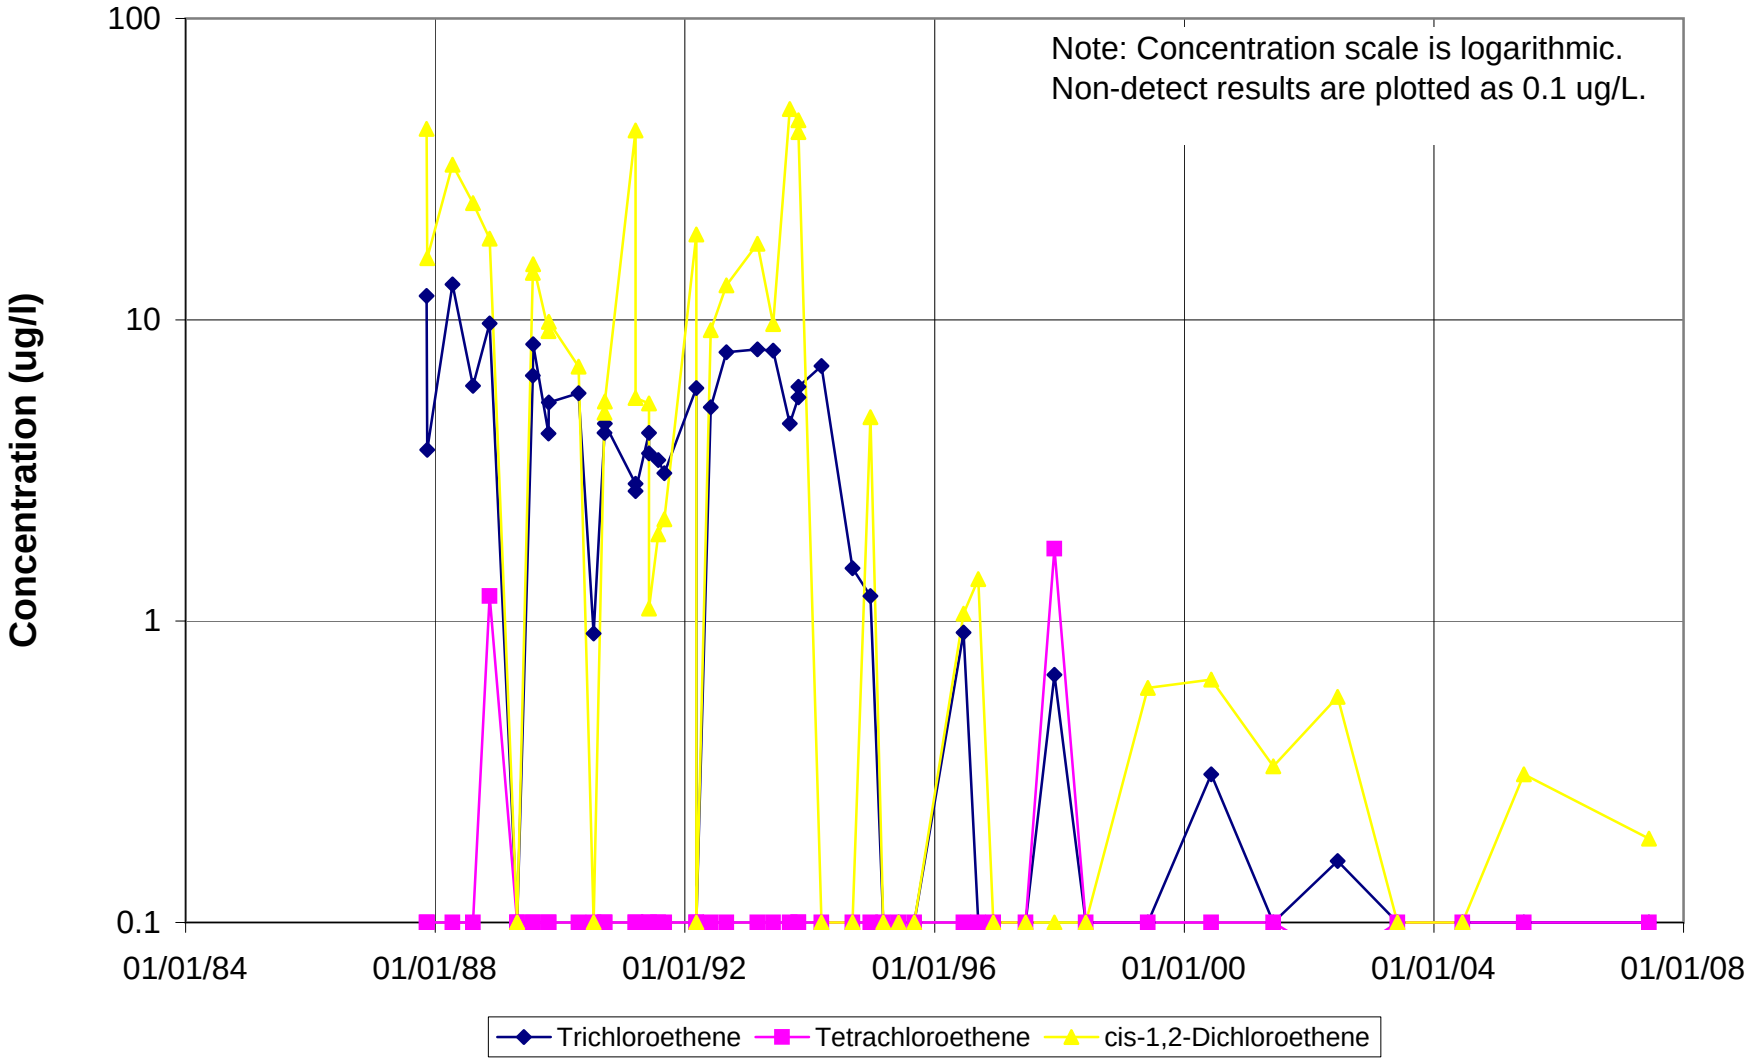

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U116

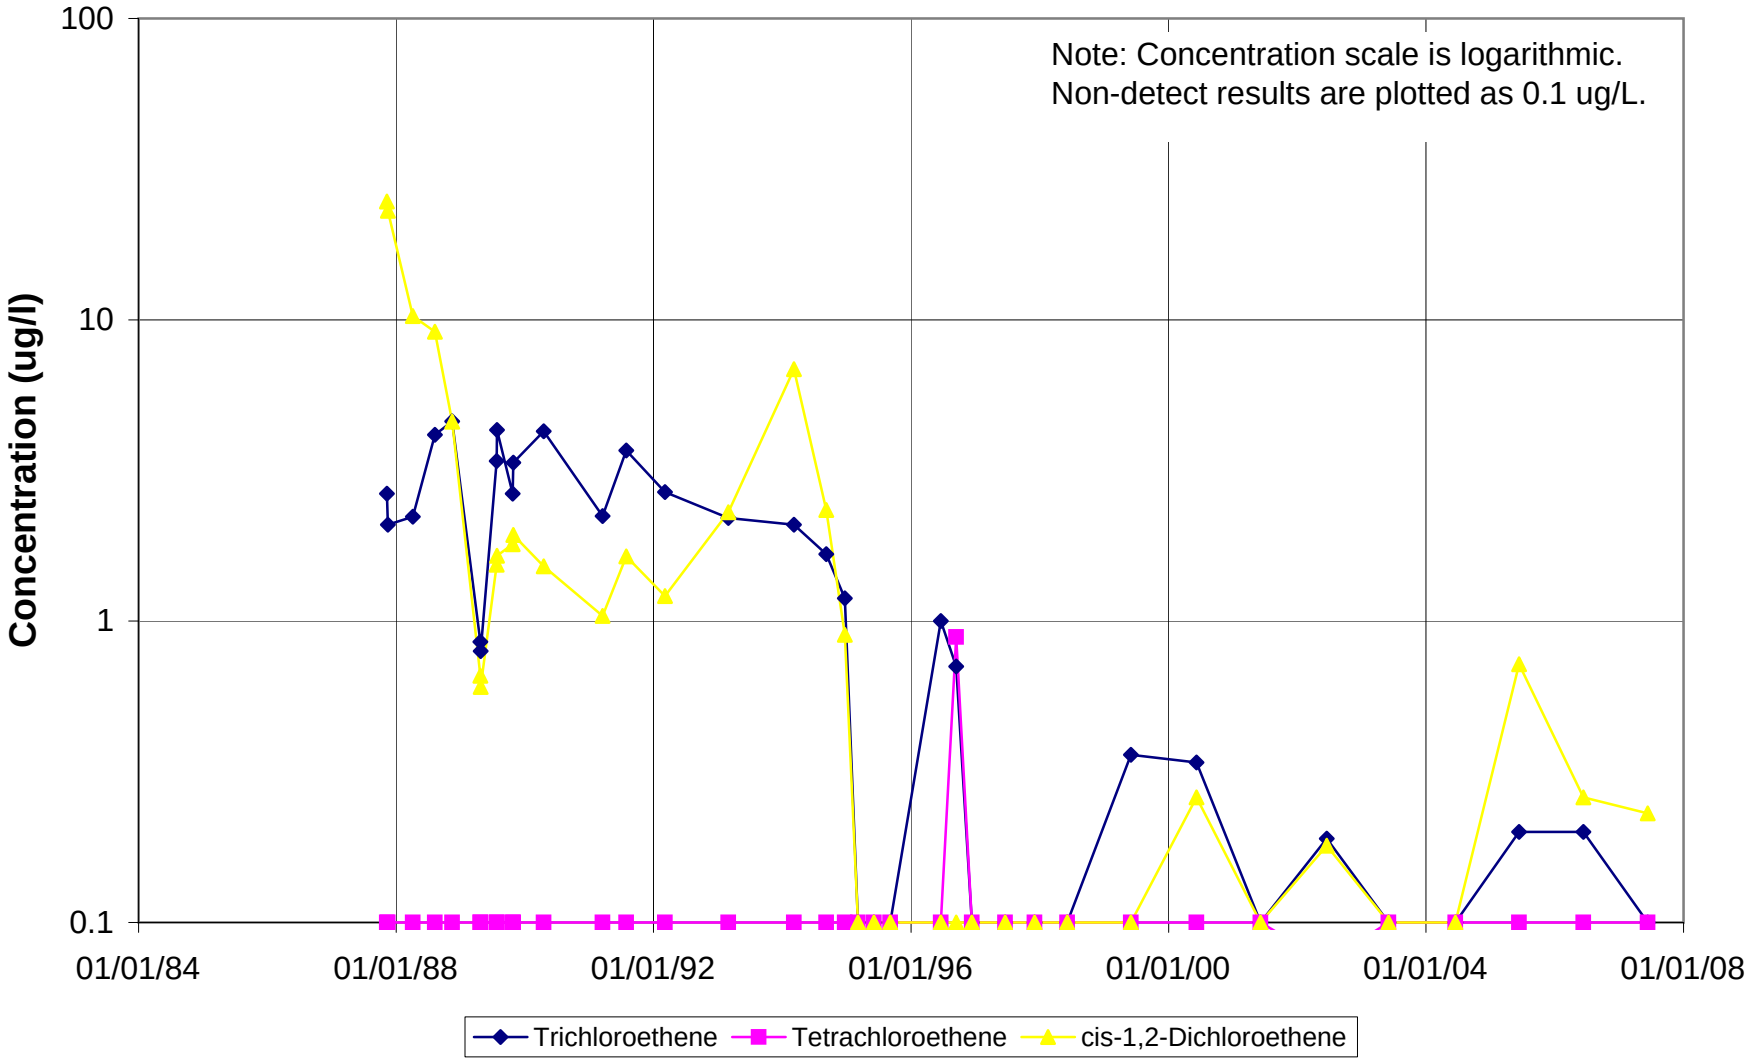

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U117

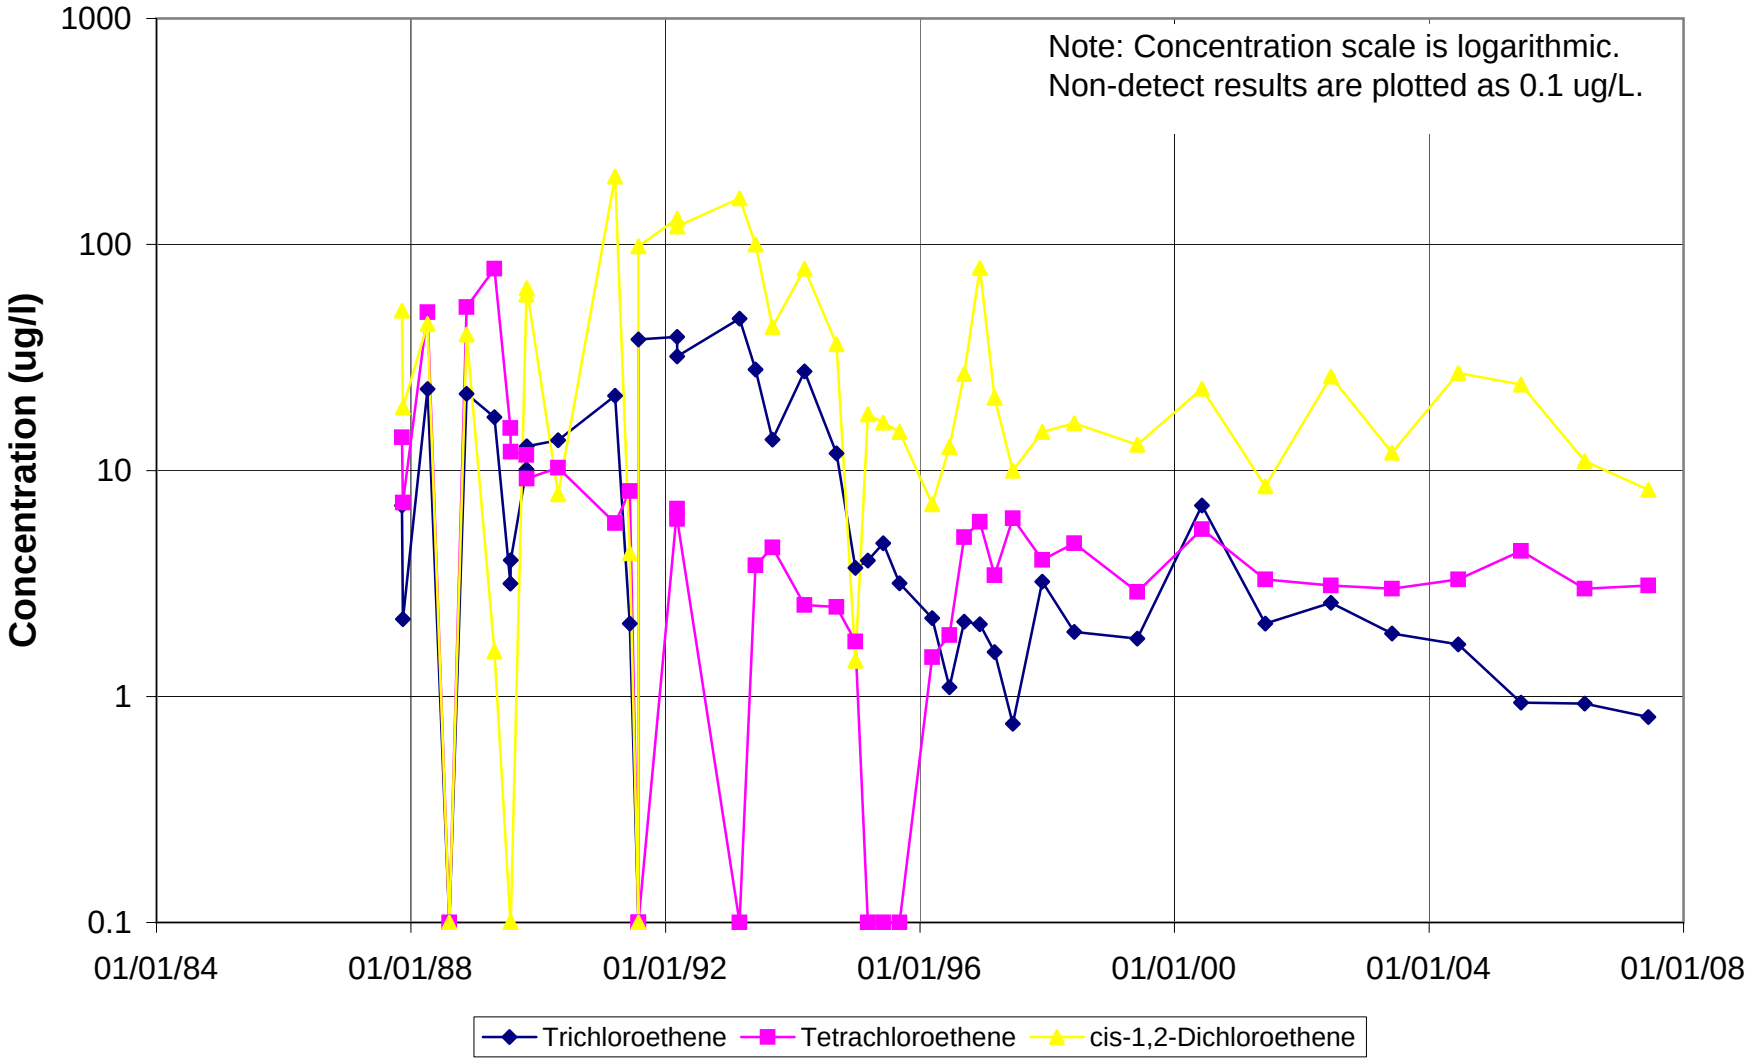

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U118

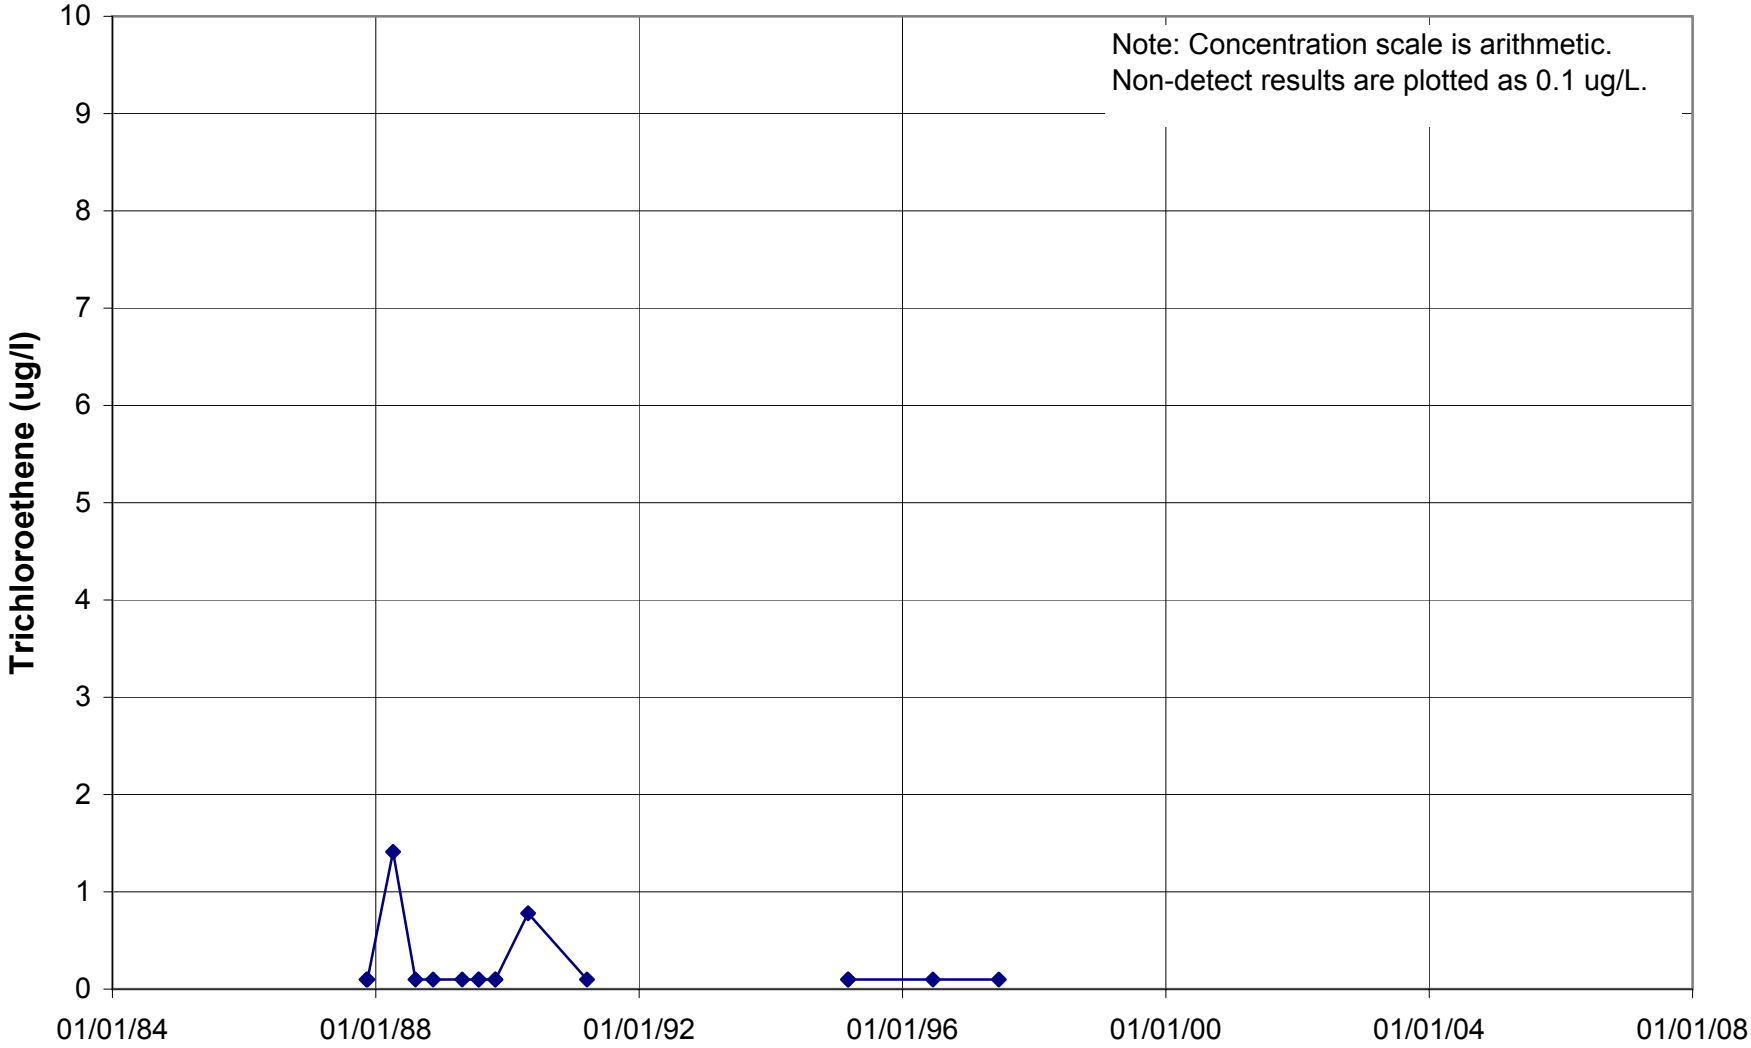

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U119

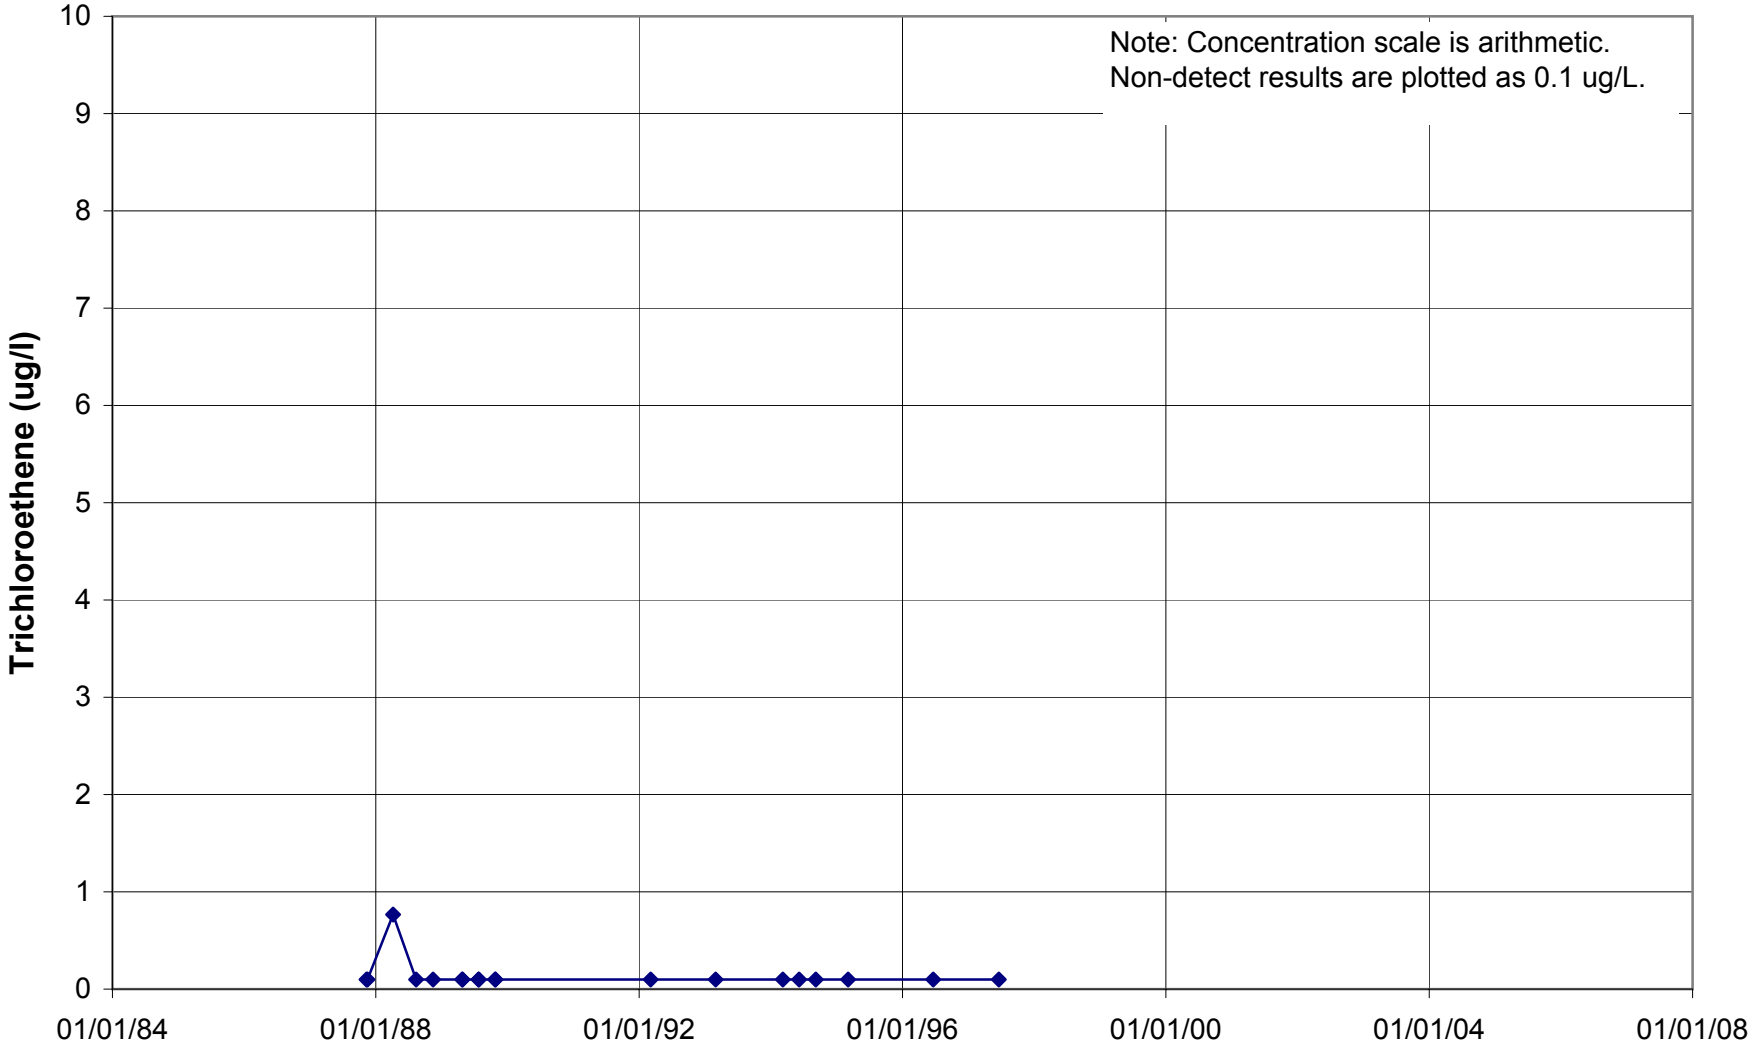

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U120

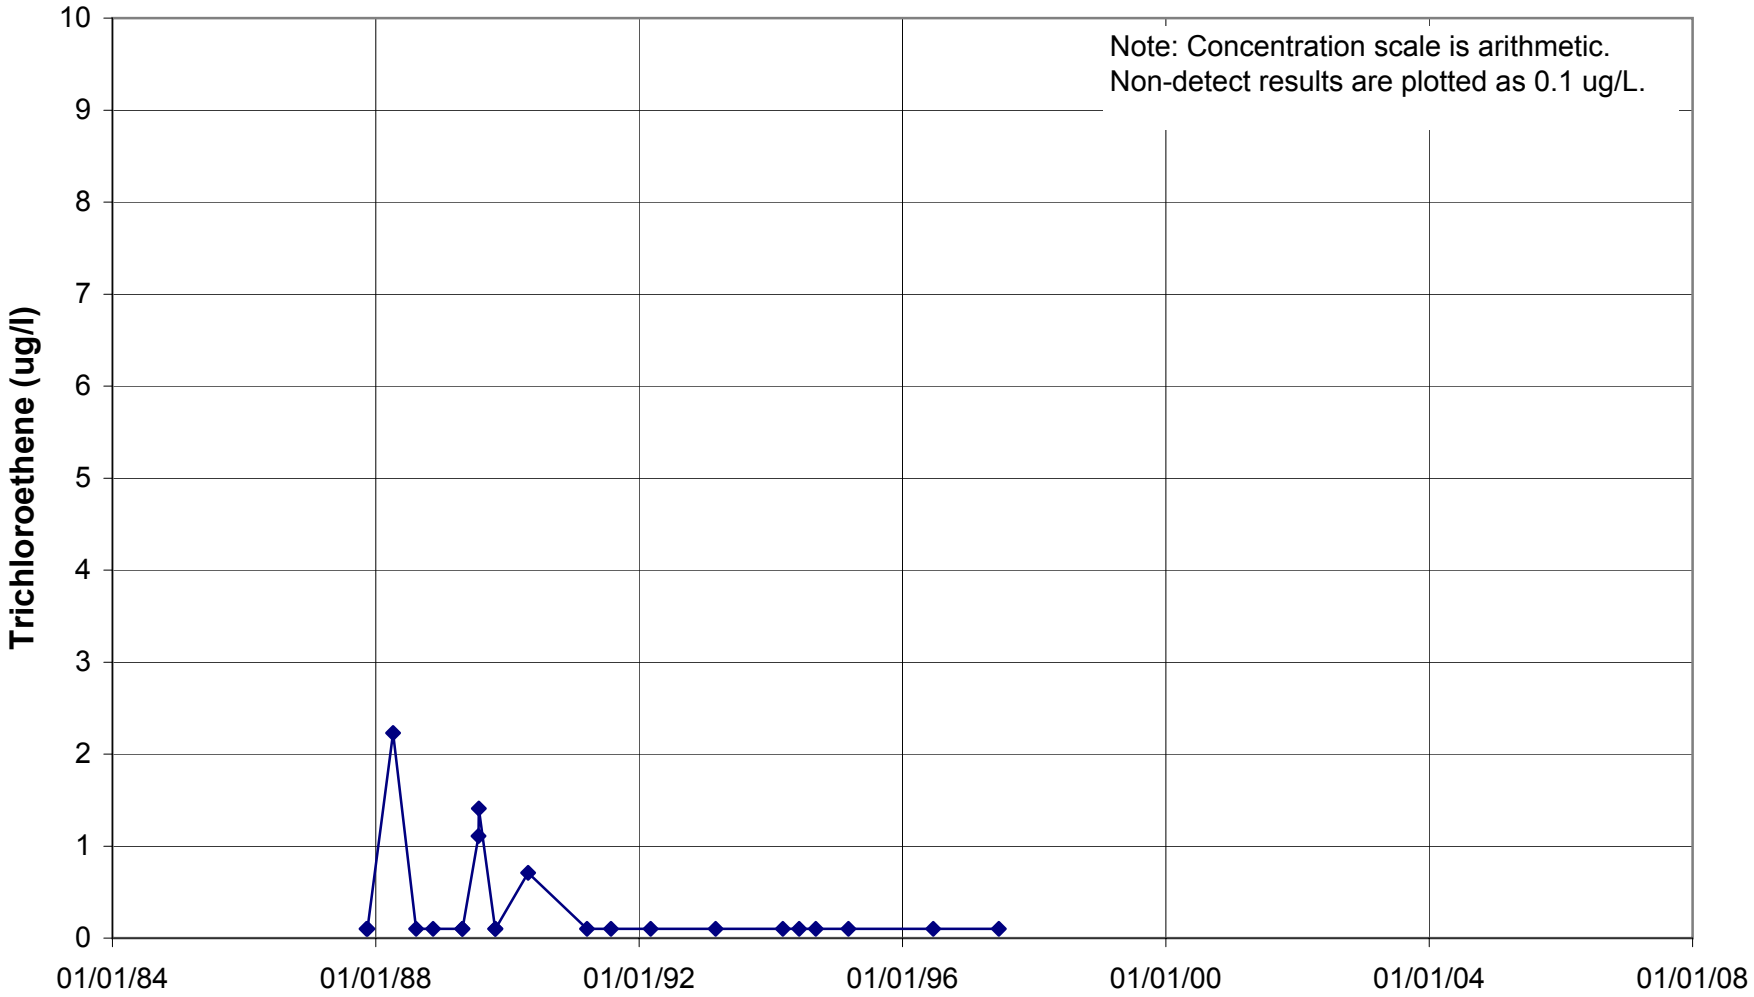

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U126

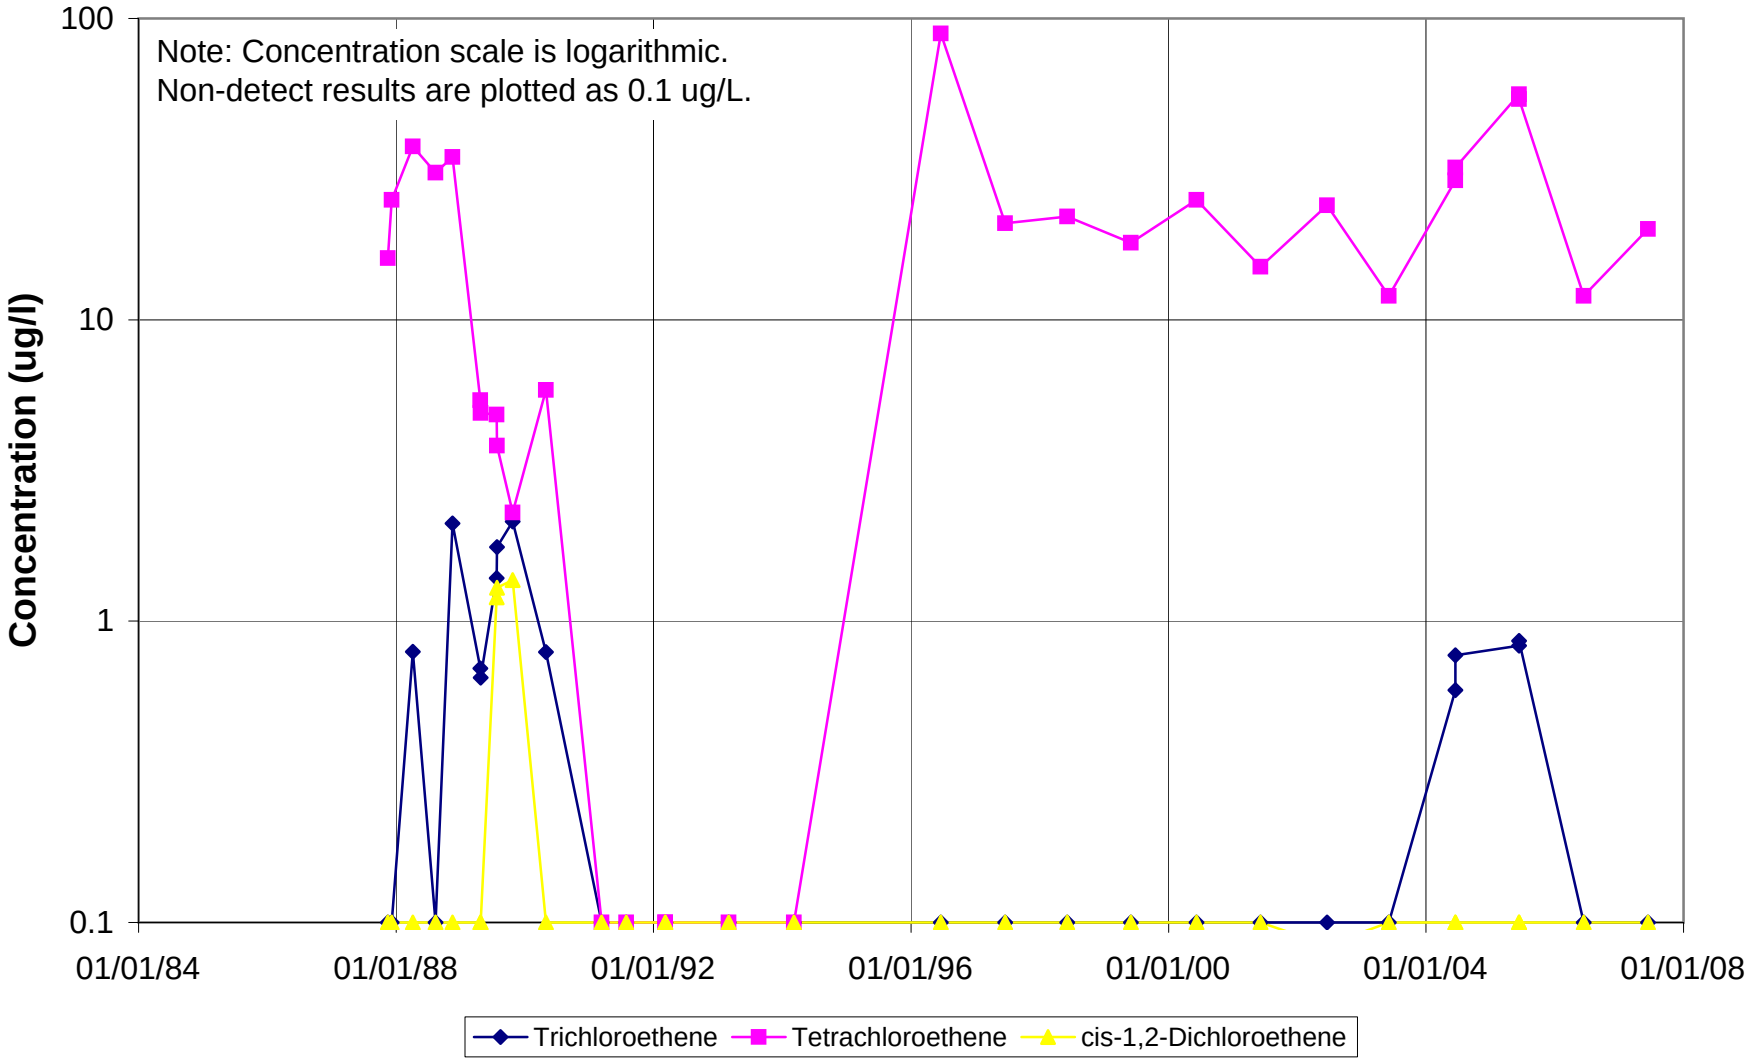

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U127

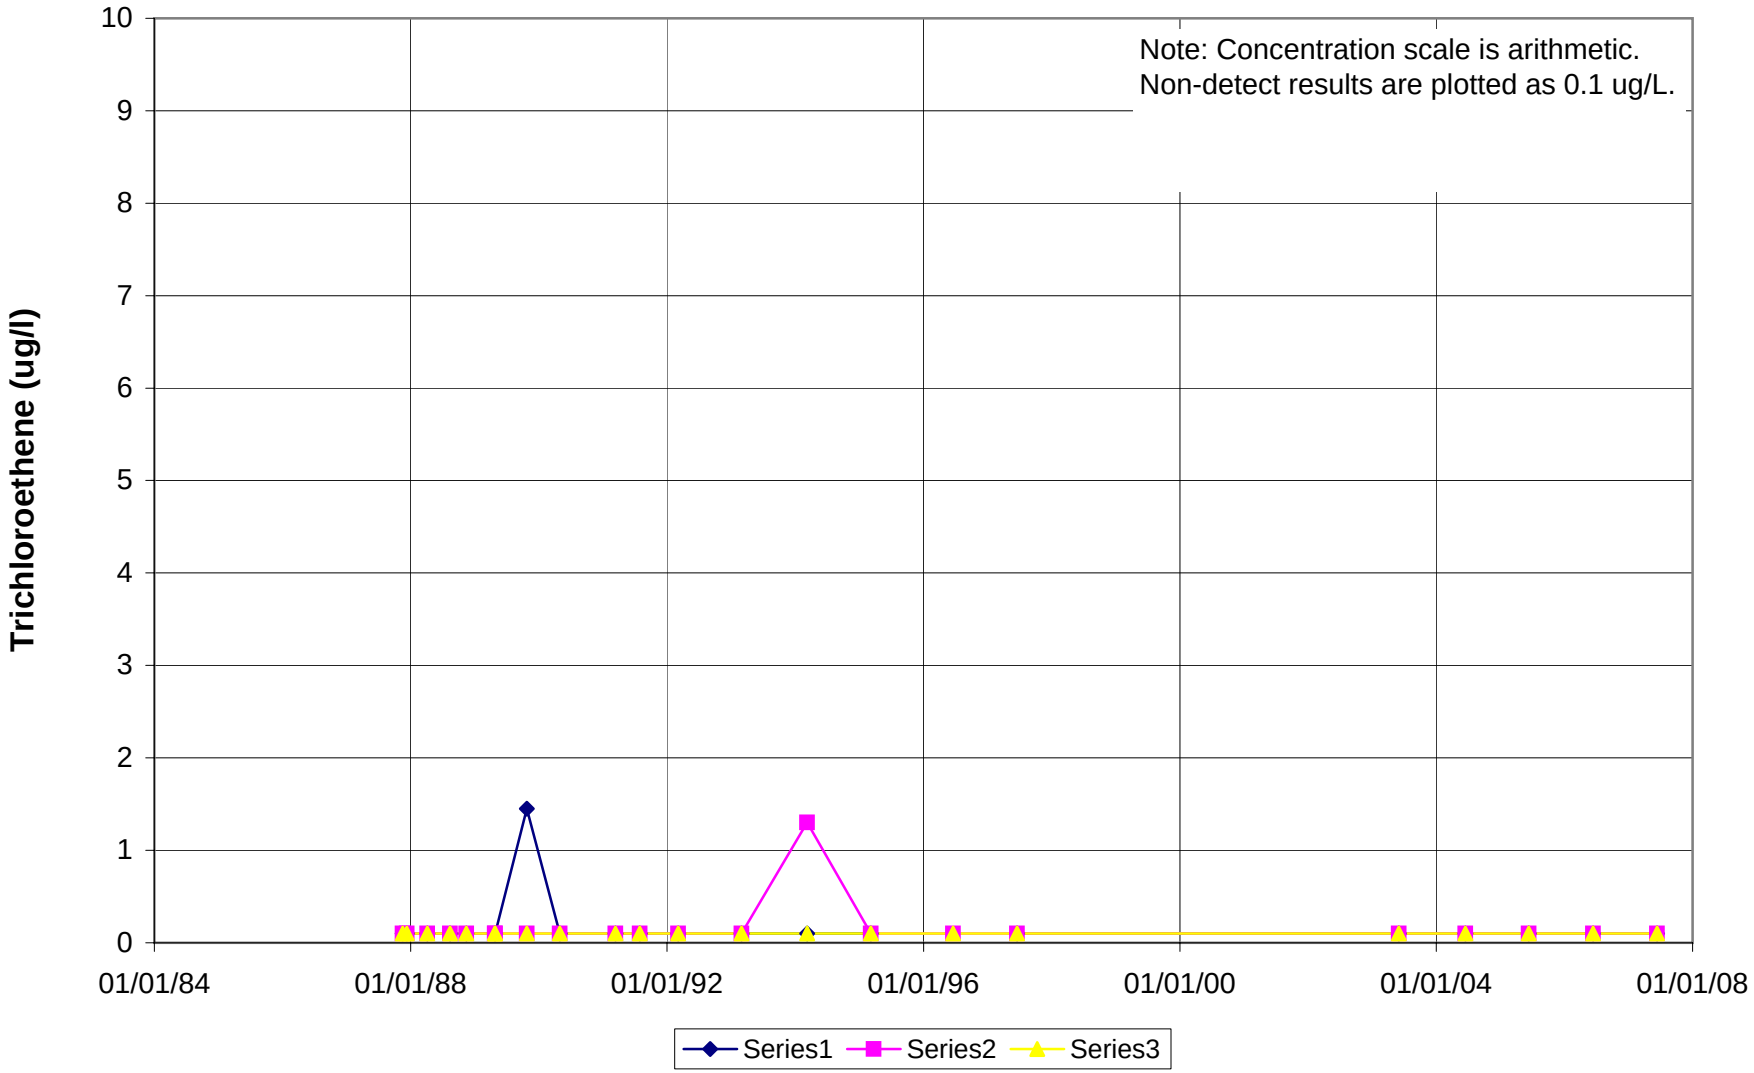

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U128

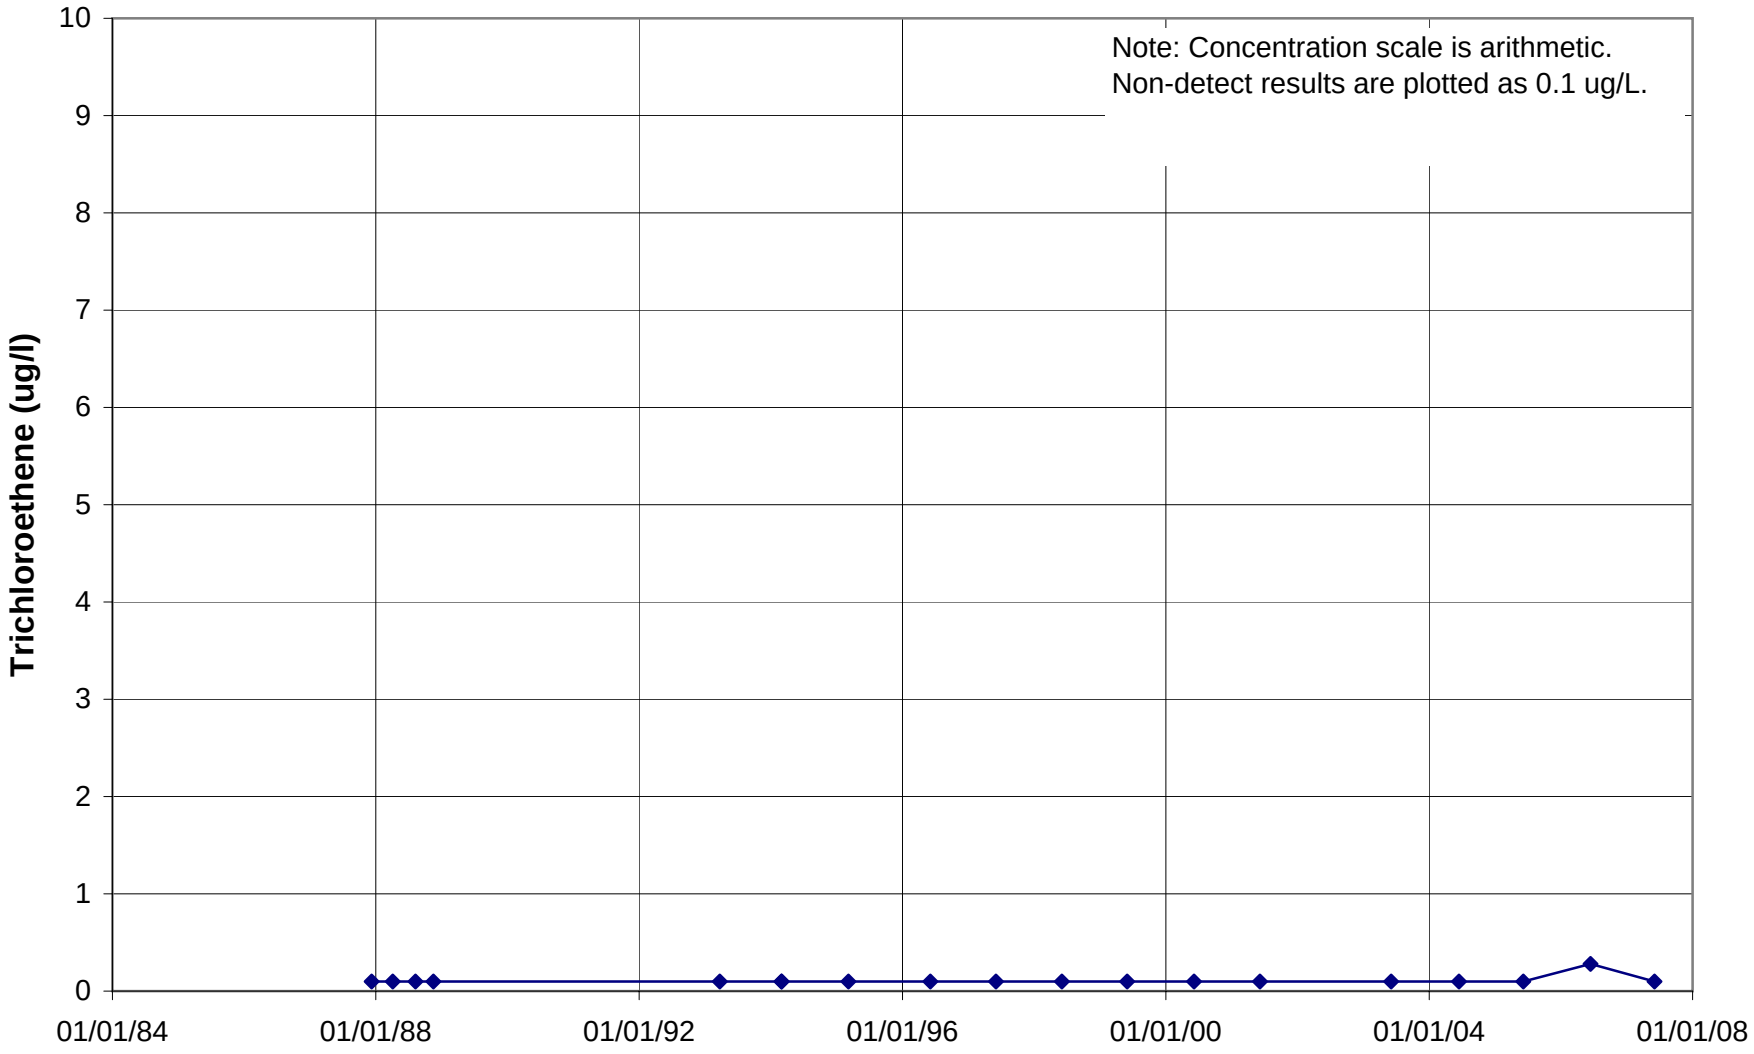

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U133

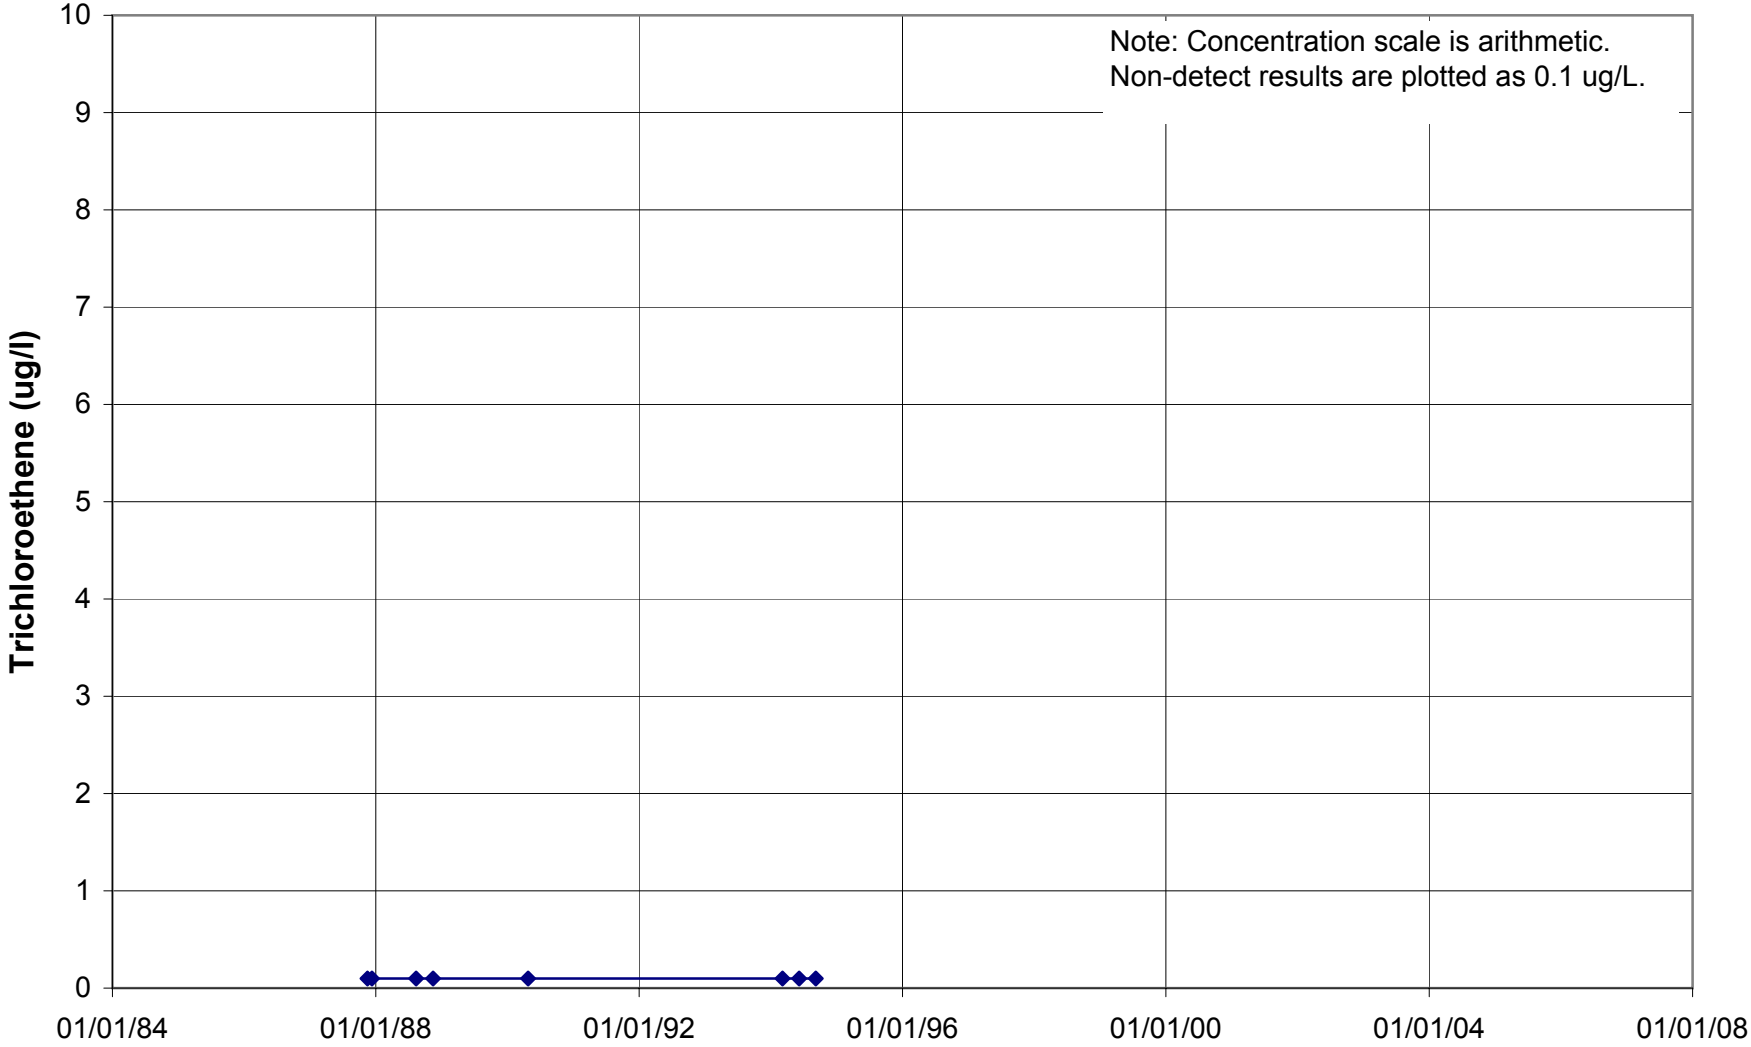

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U135

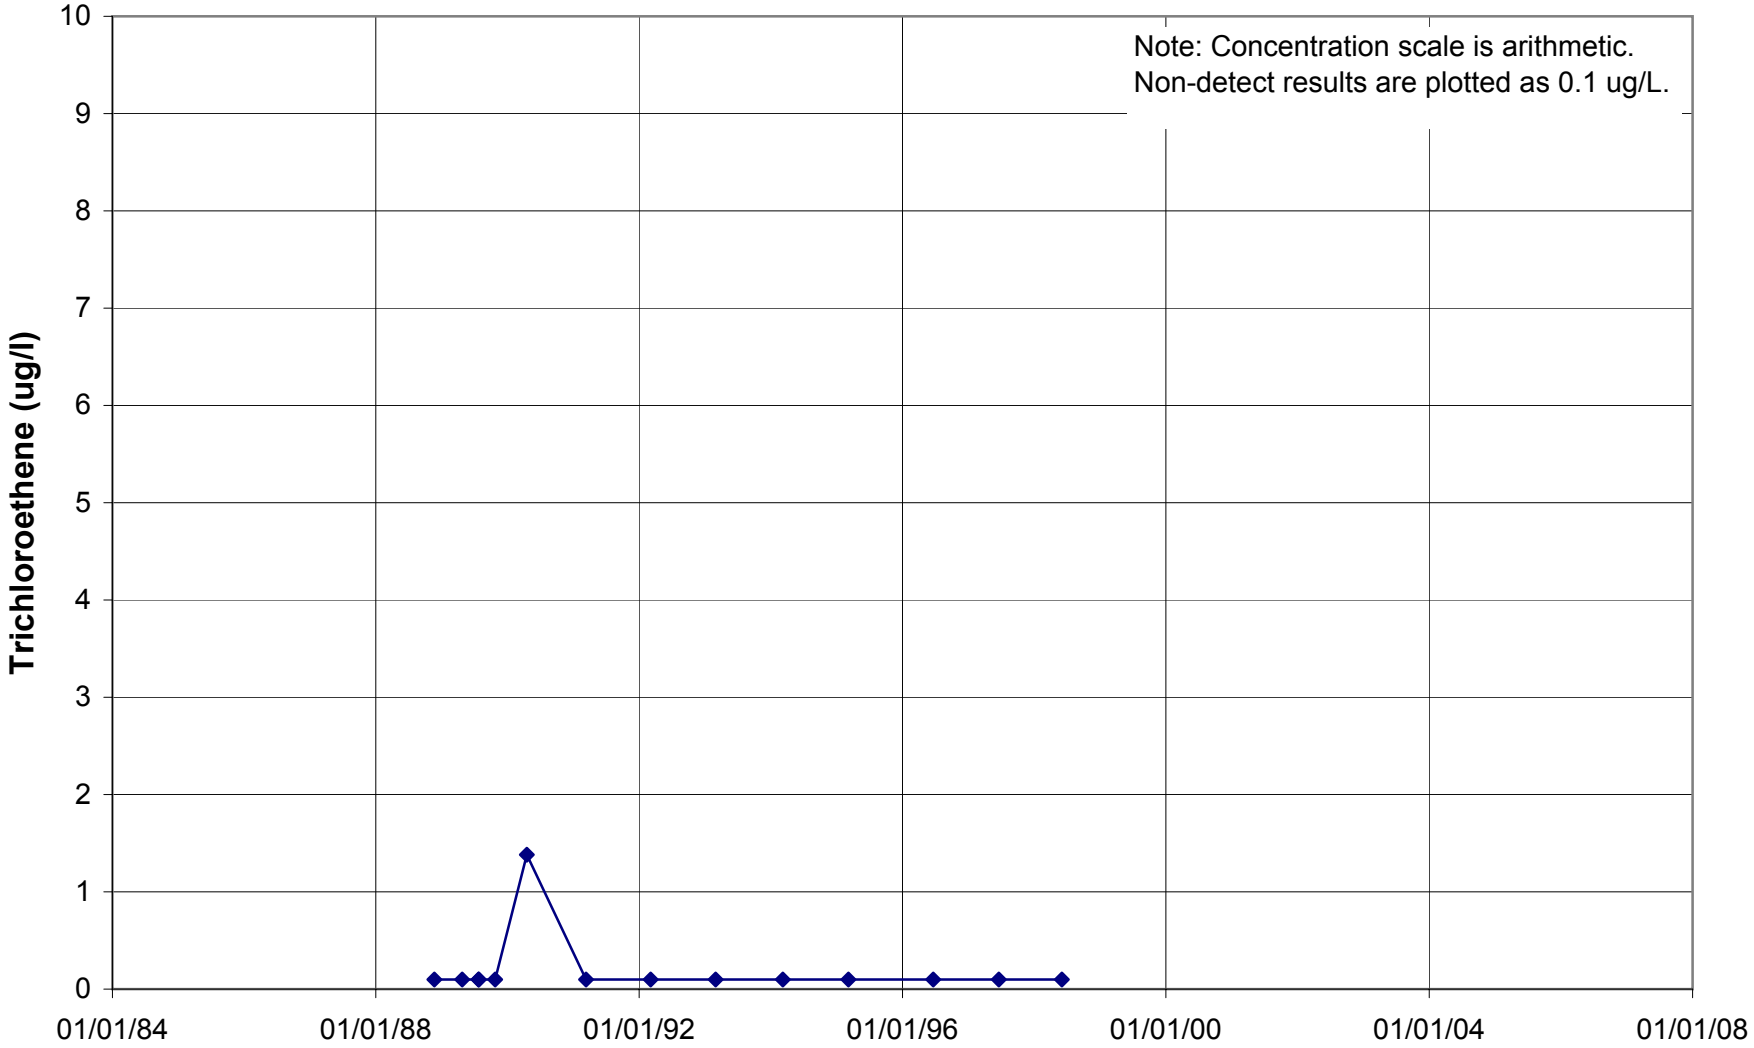

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U136

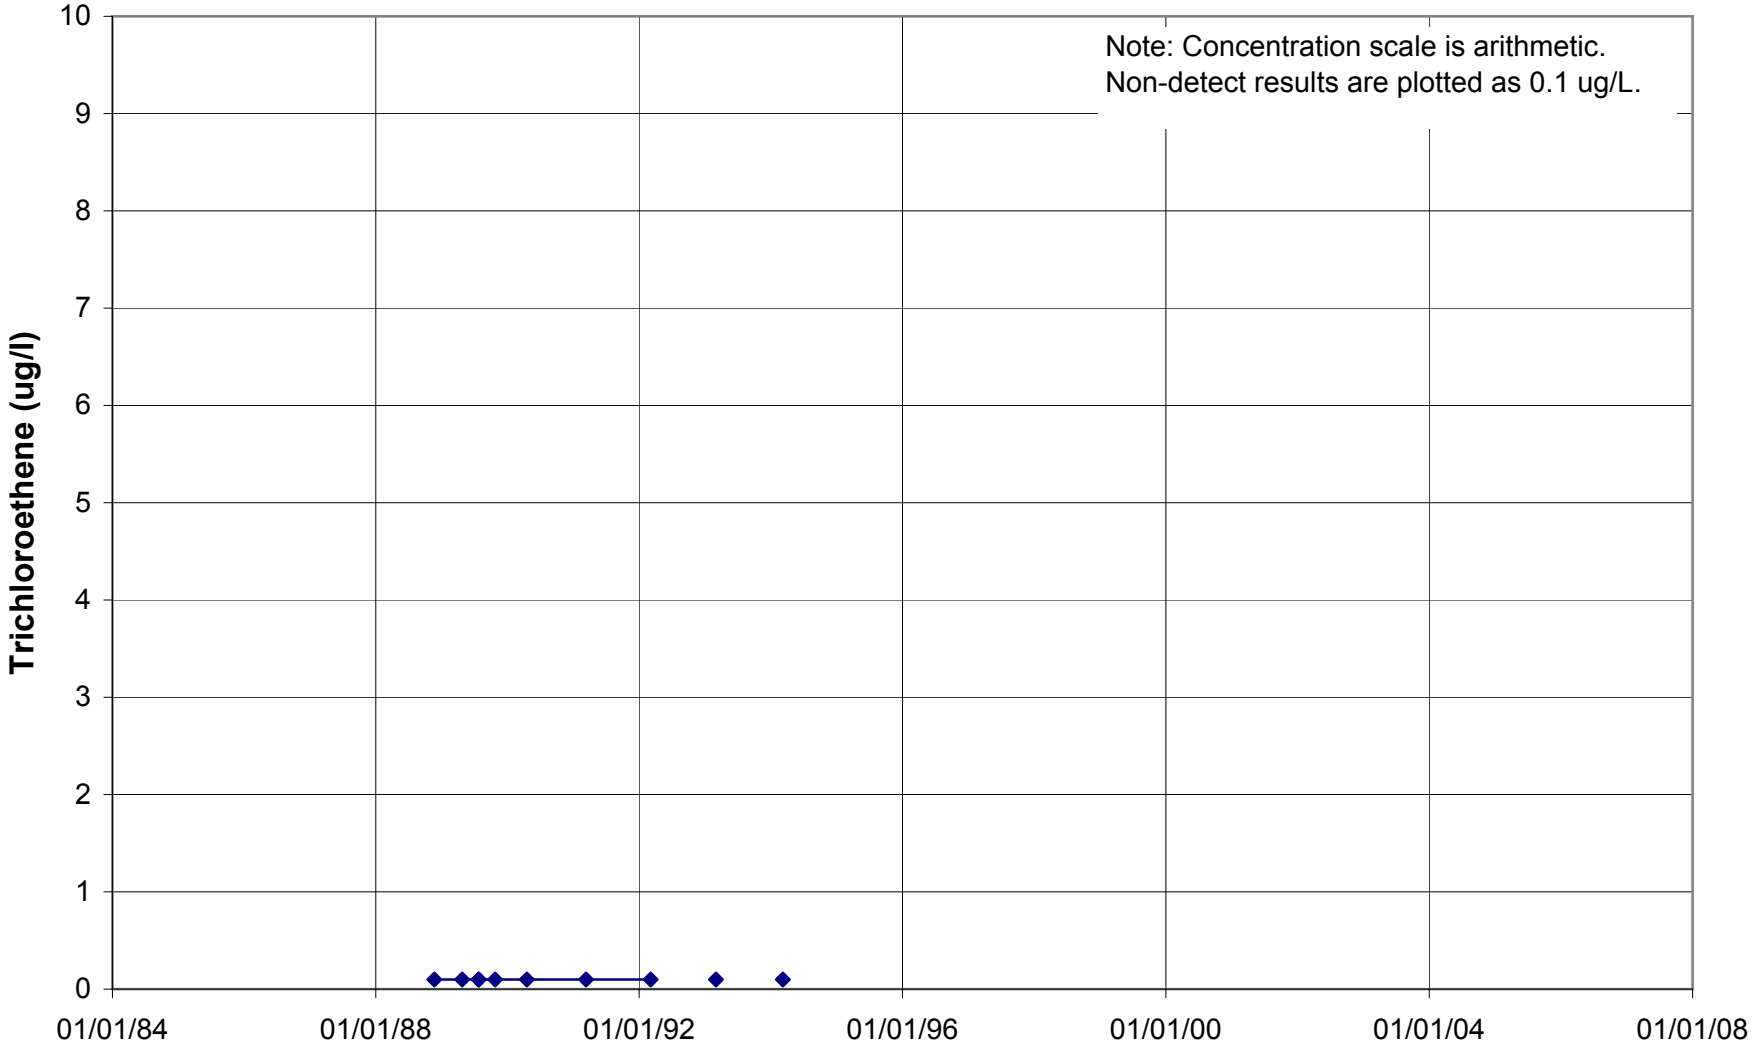

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U137

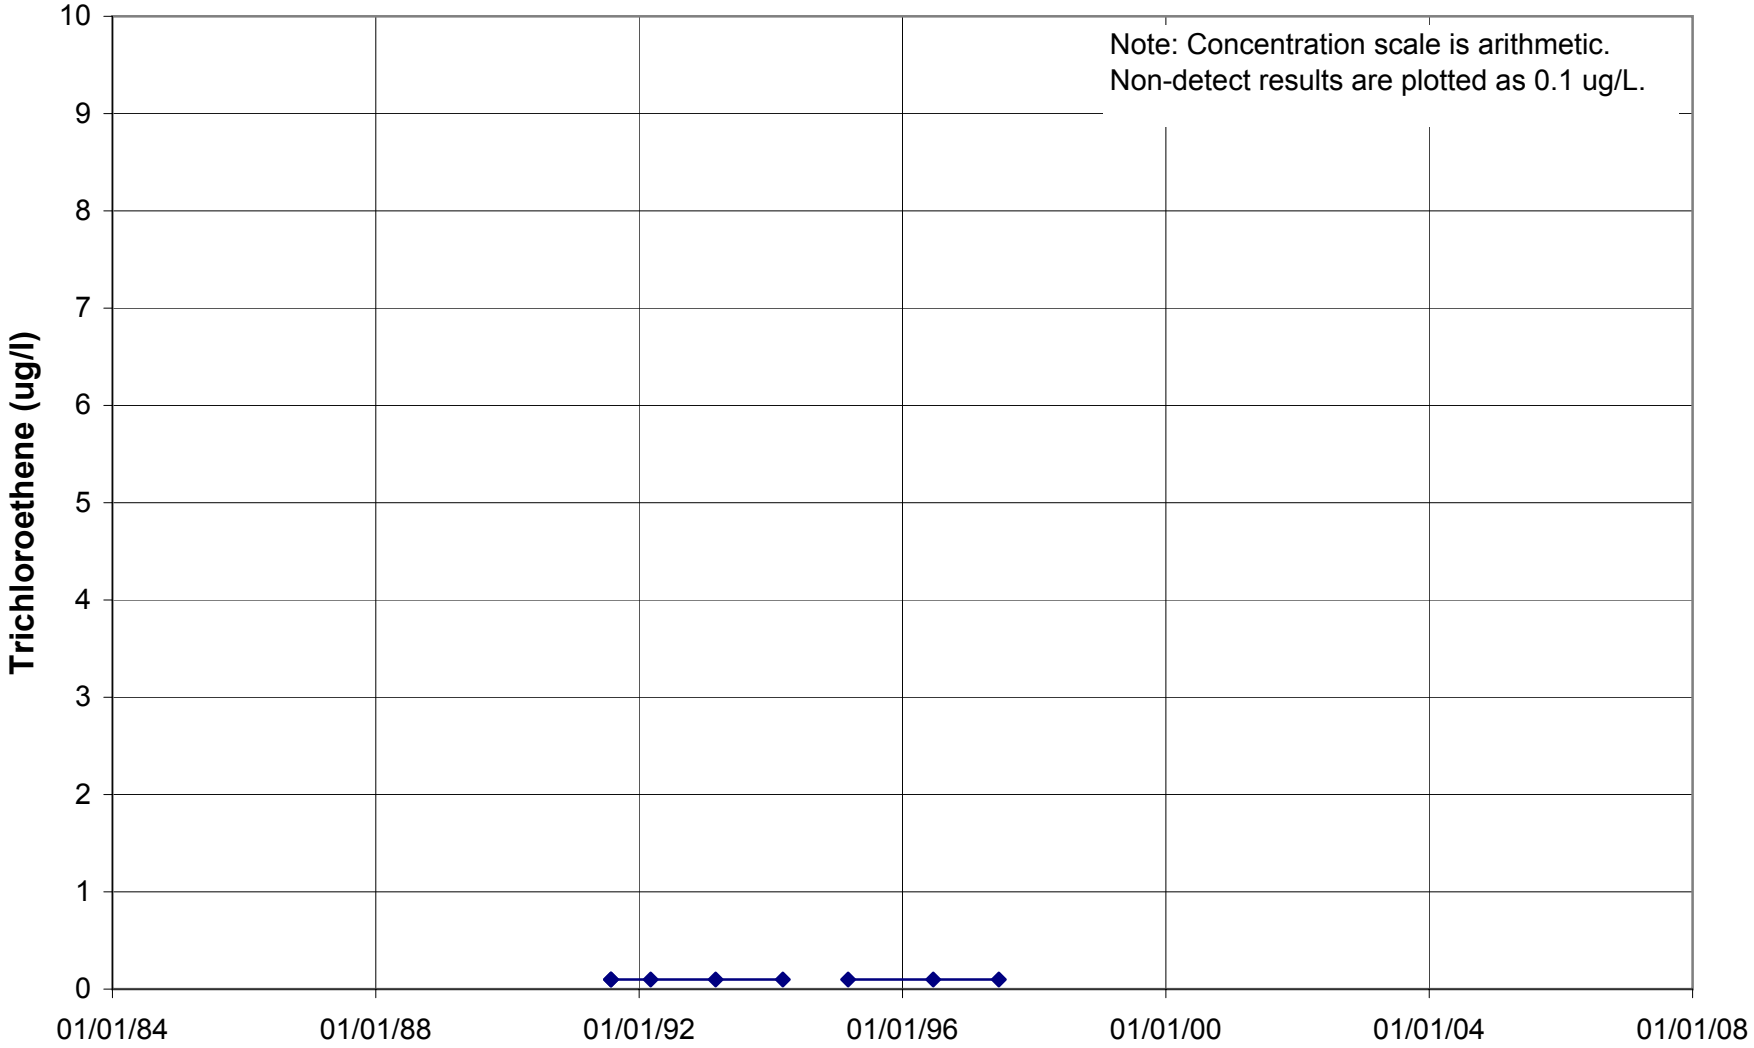

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U138

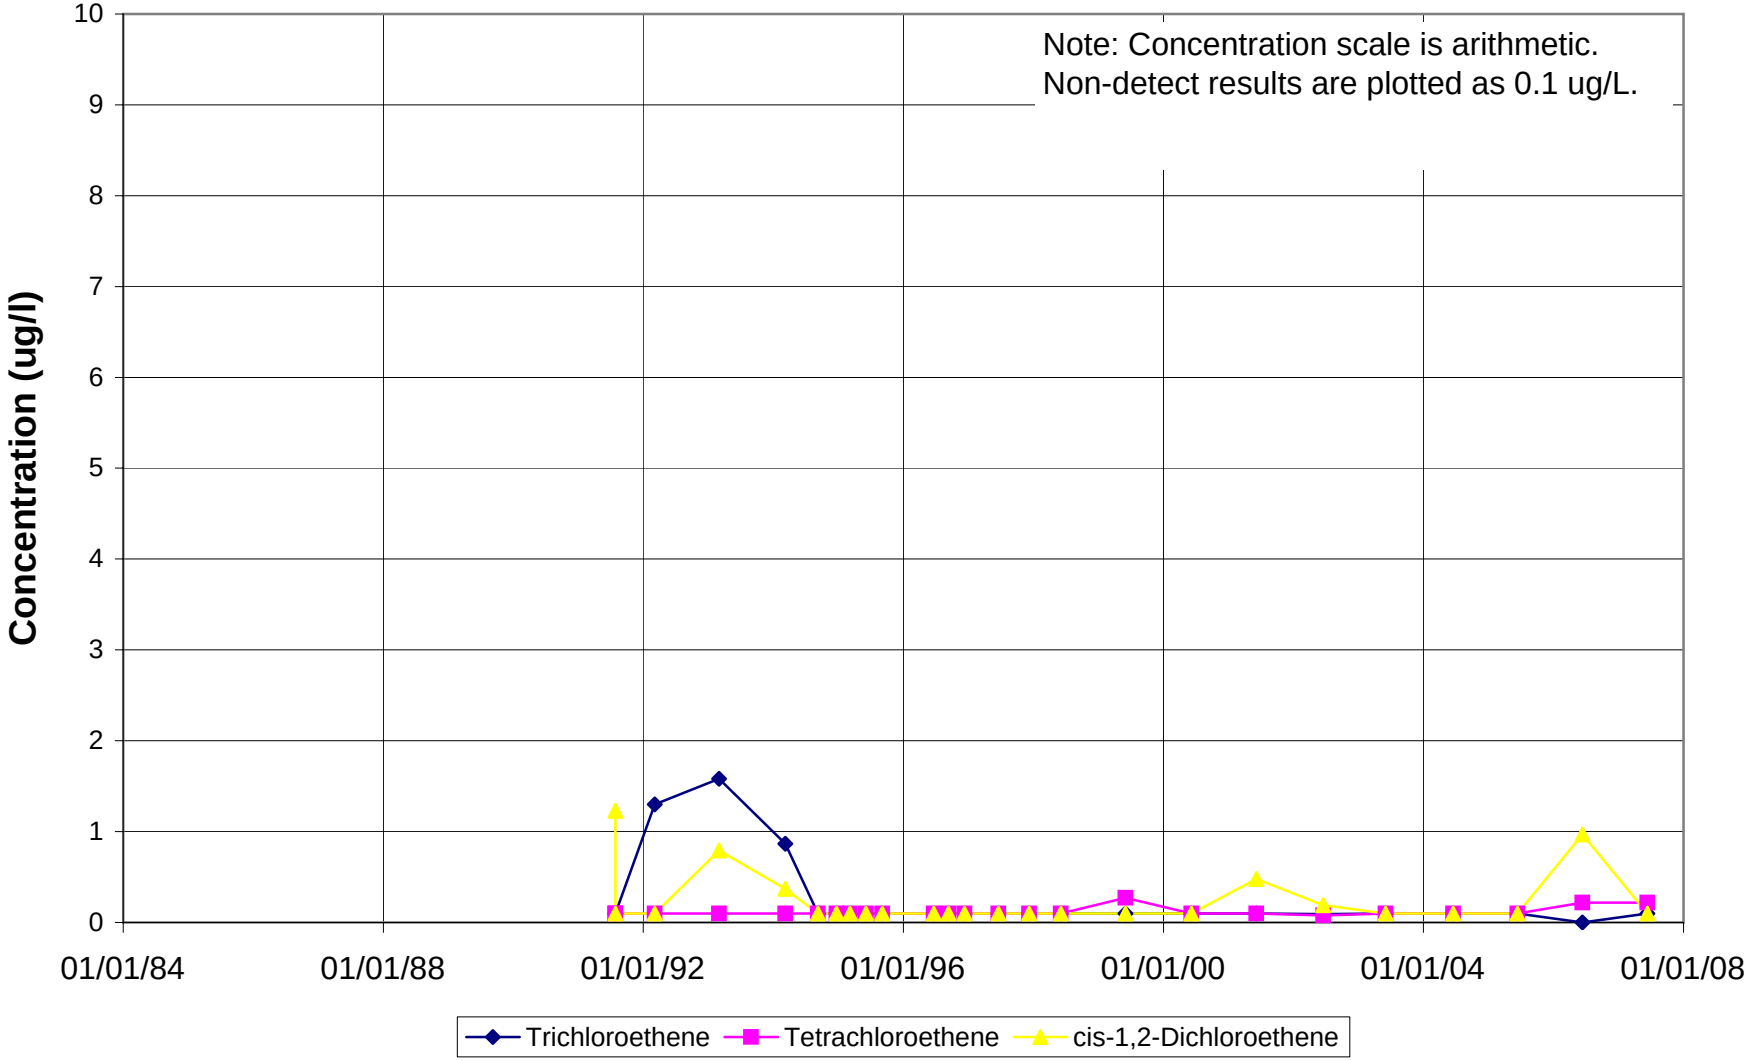

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U139

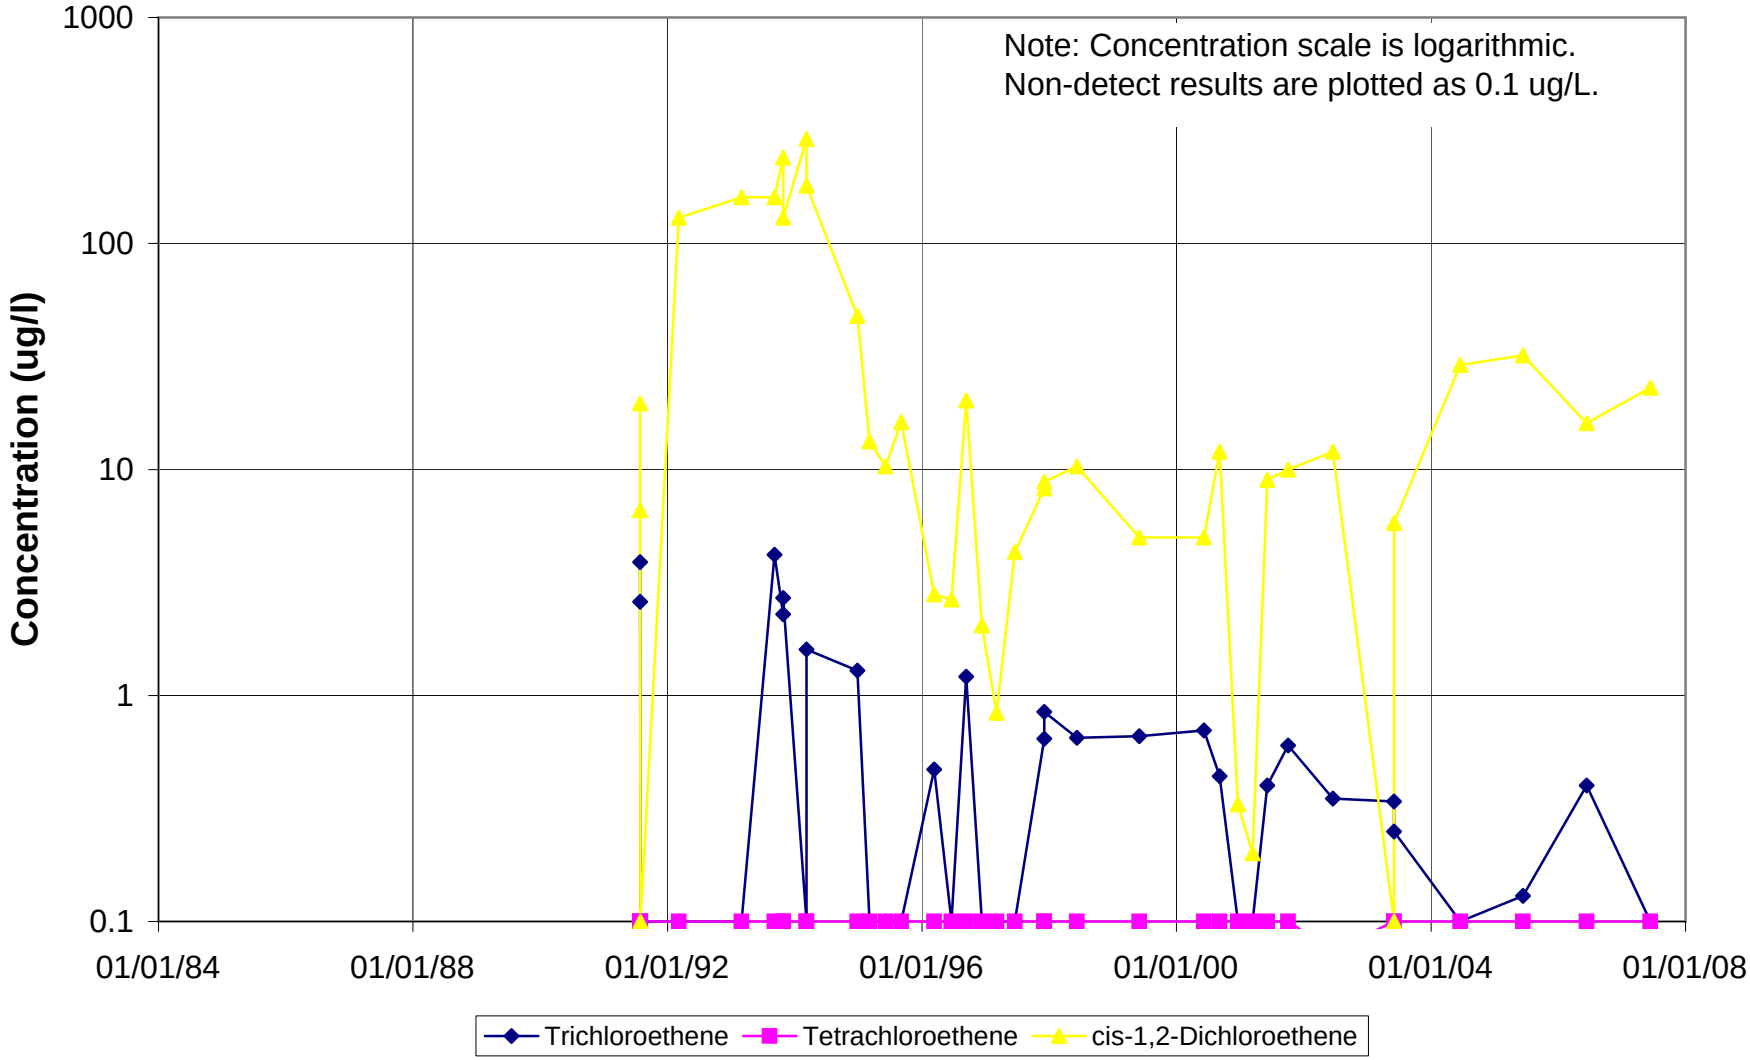

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U140

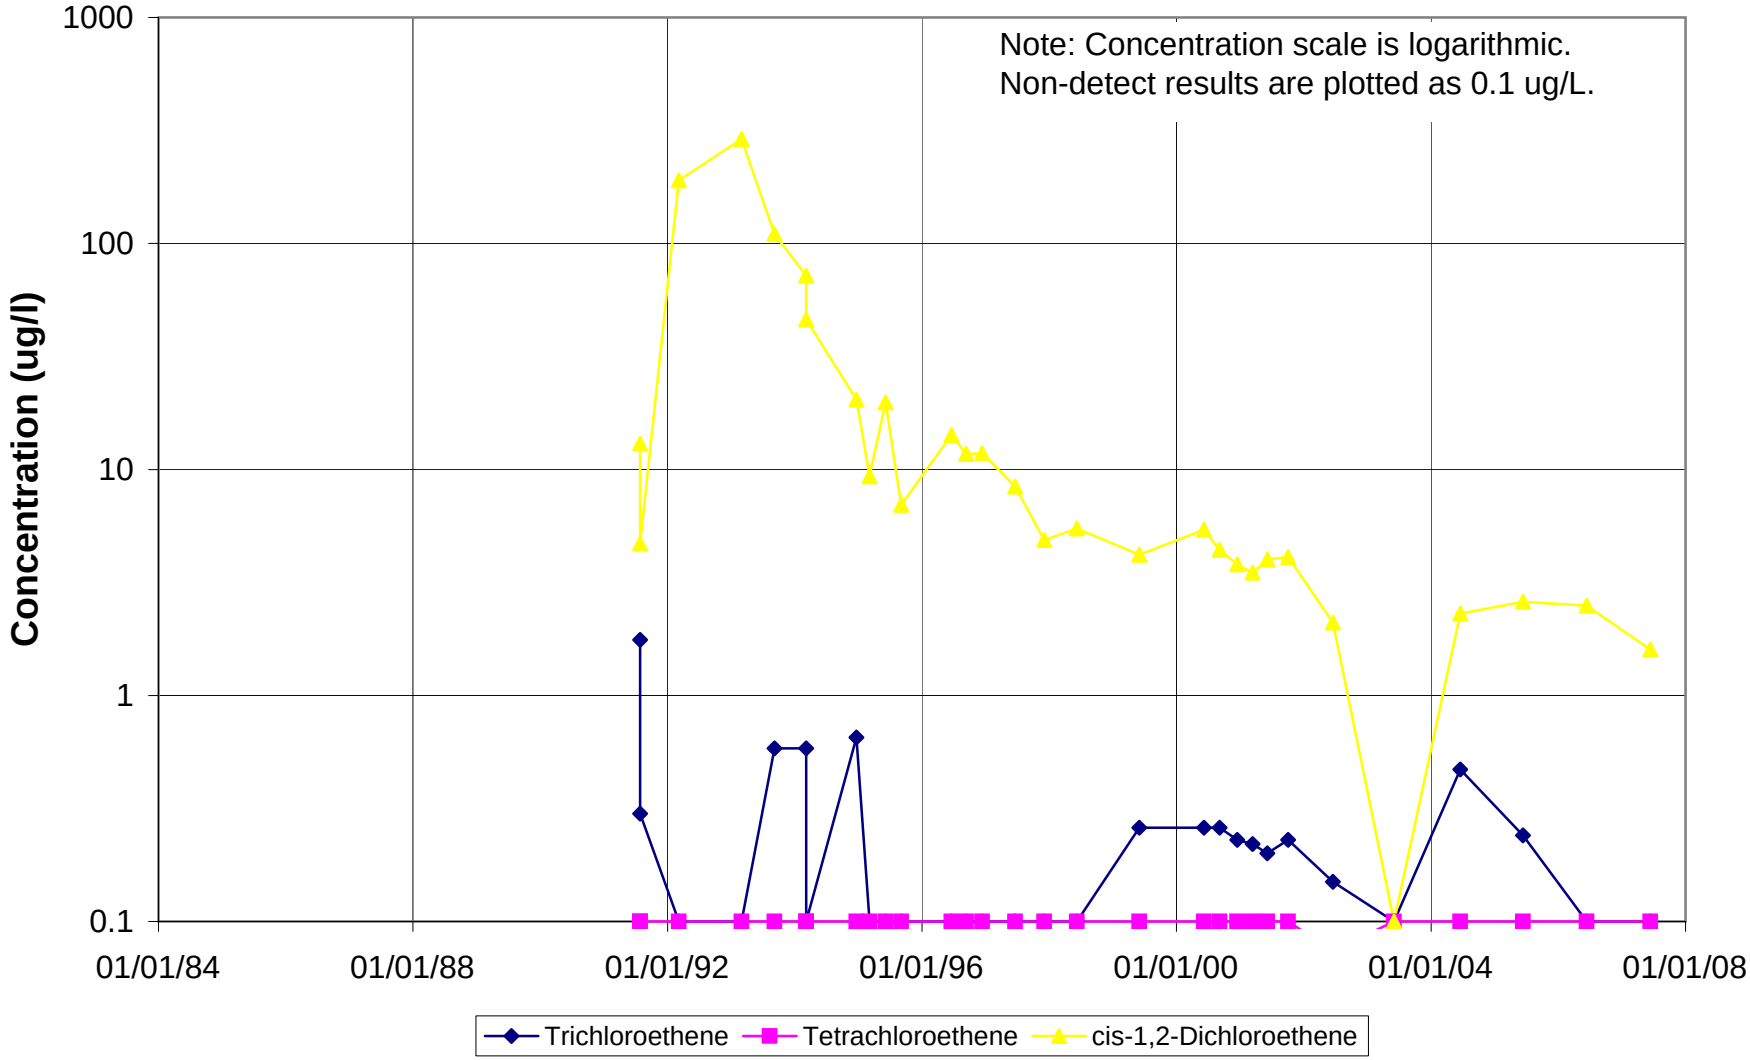

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U141

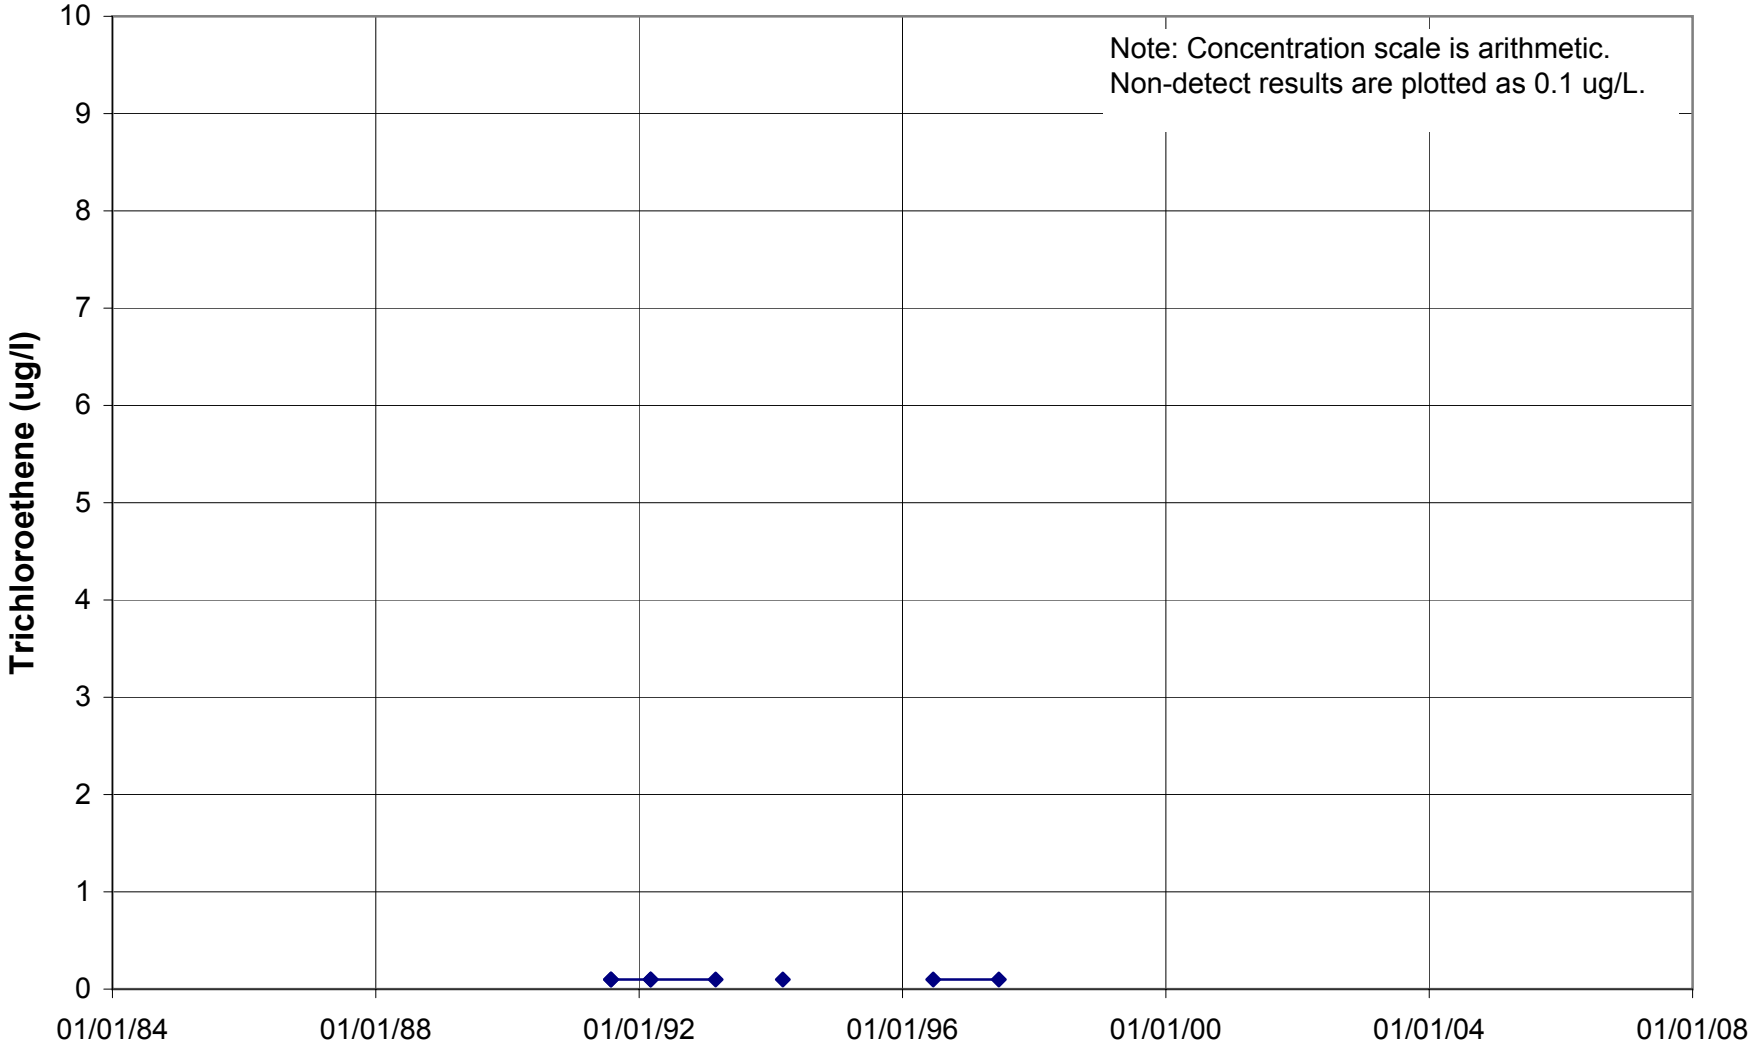

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U157

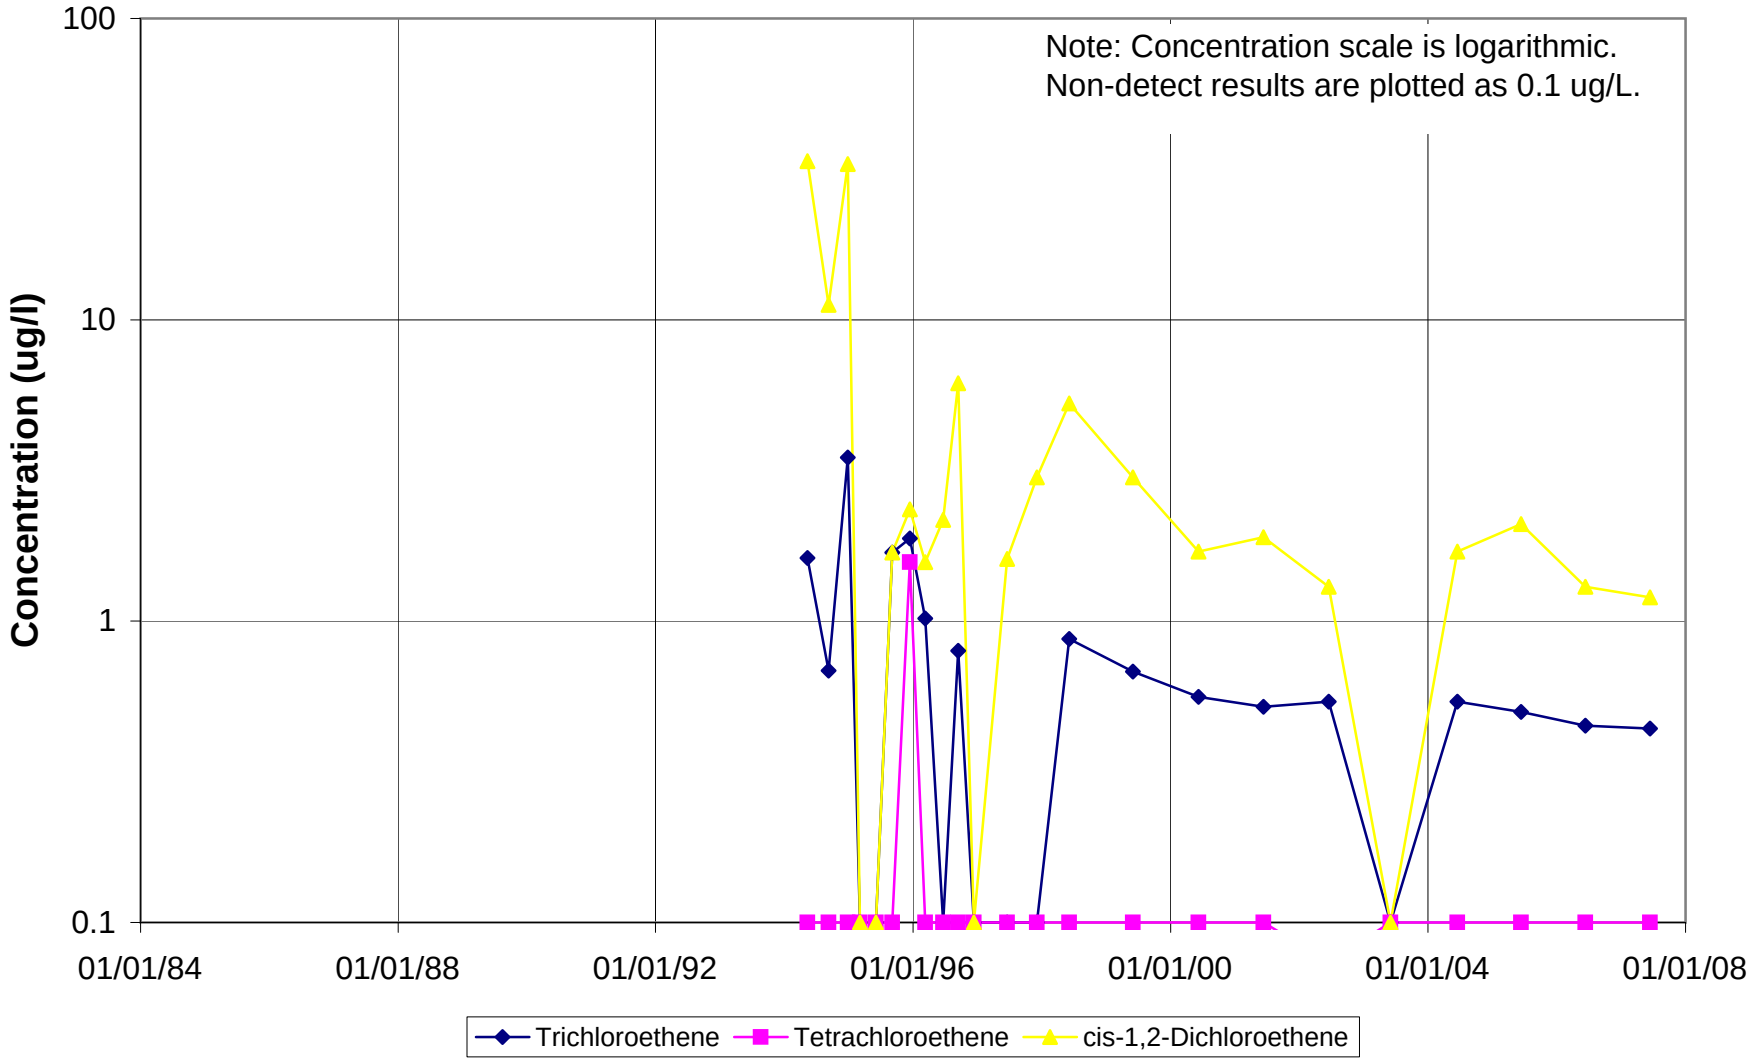

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U158

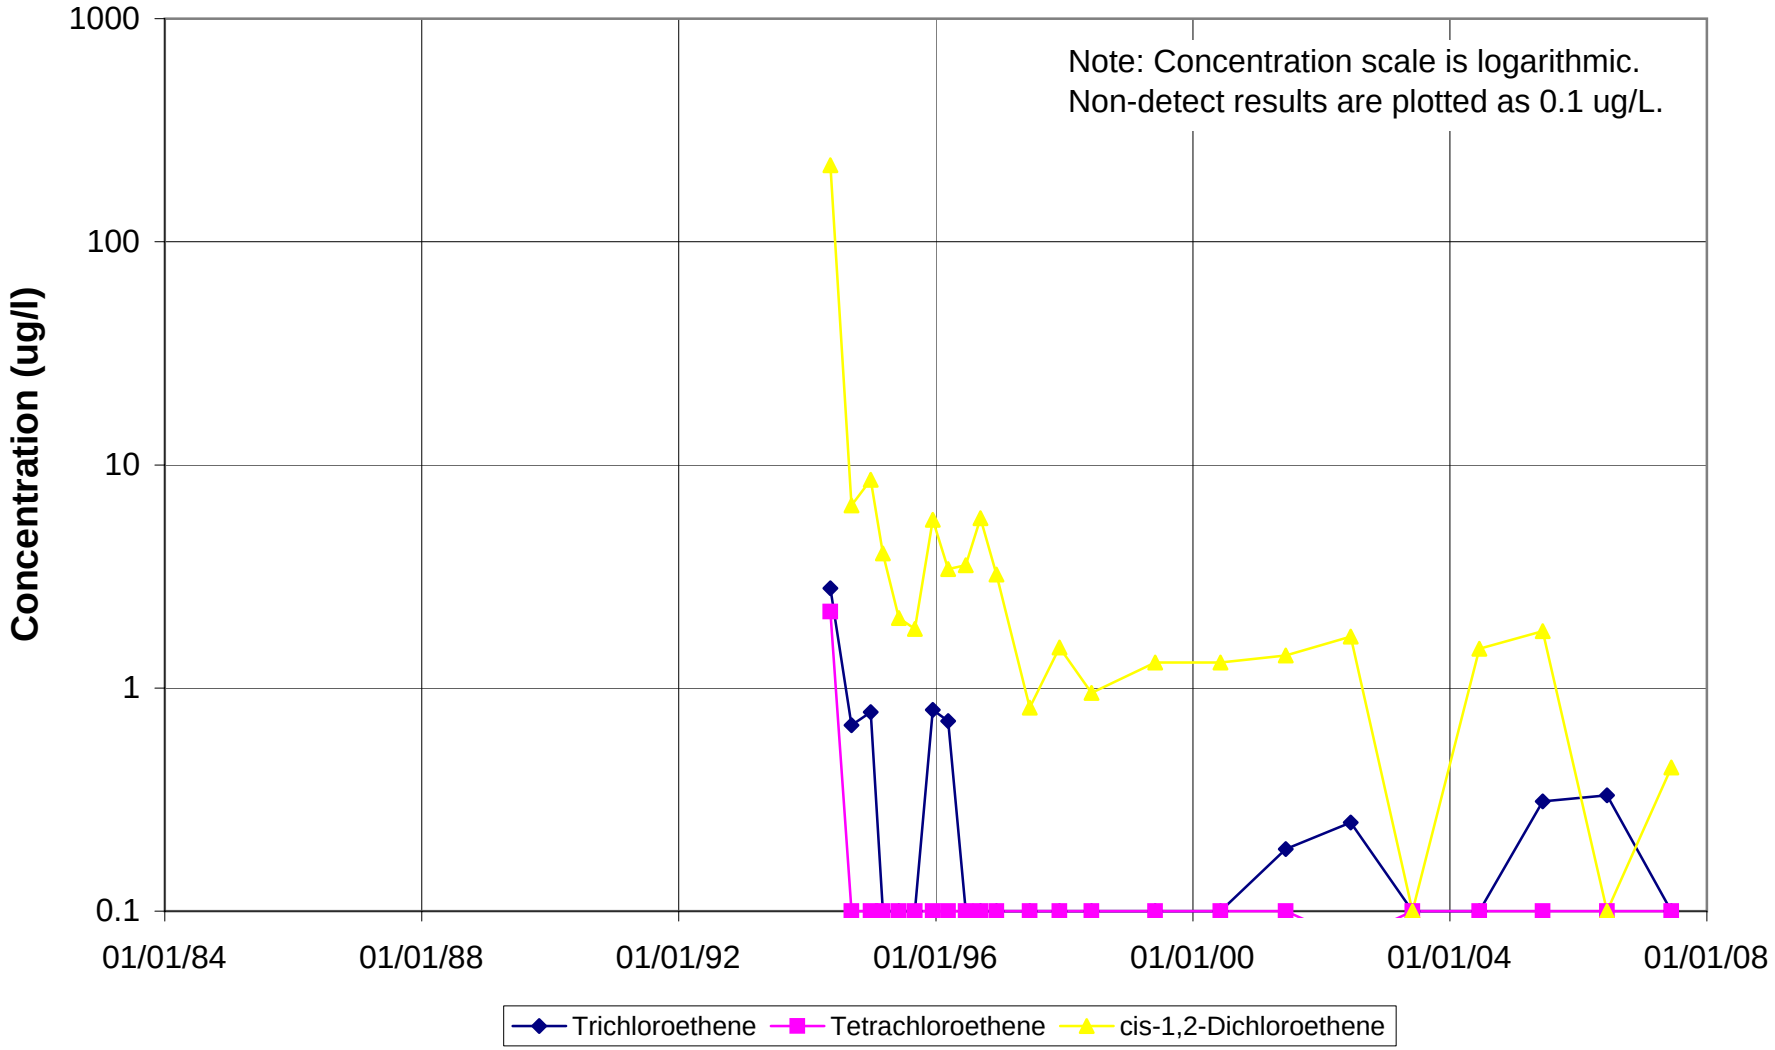

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U350

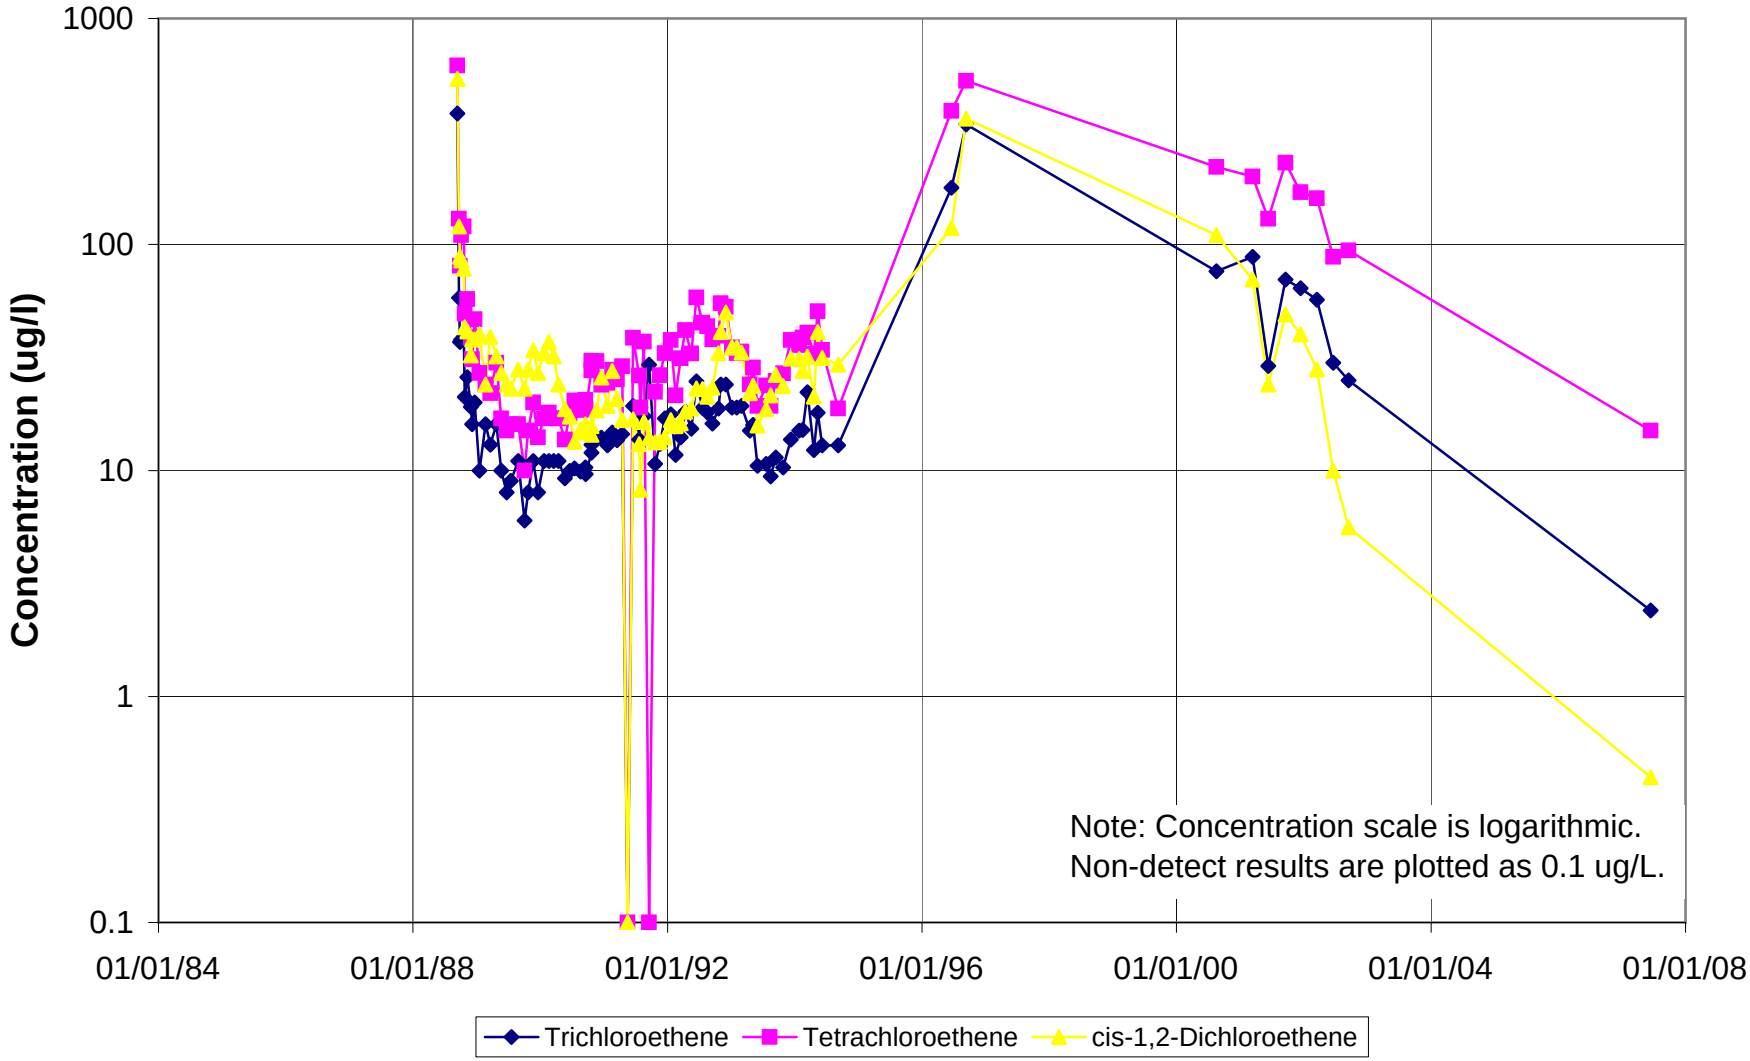

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U351 (EW-1)

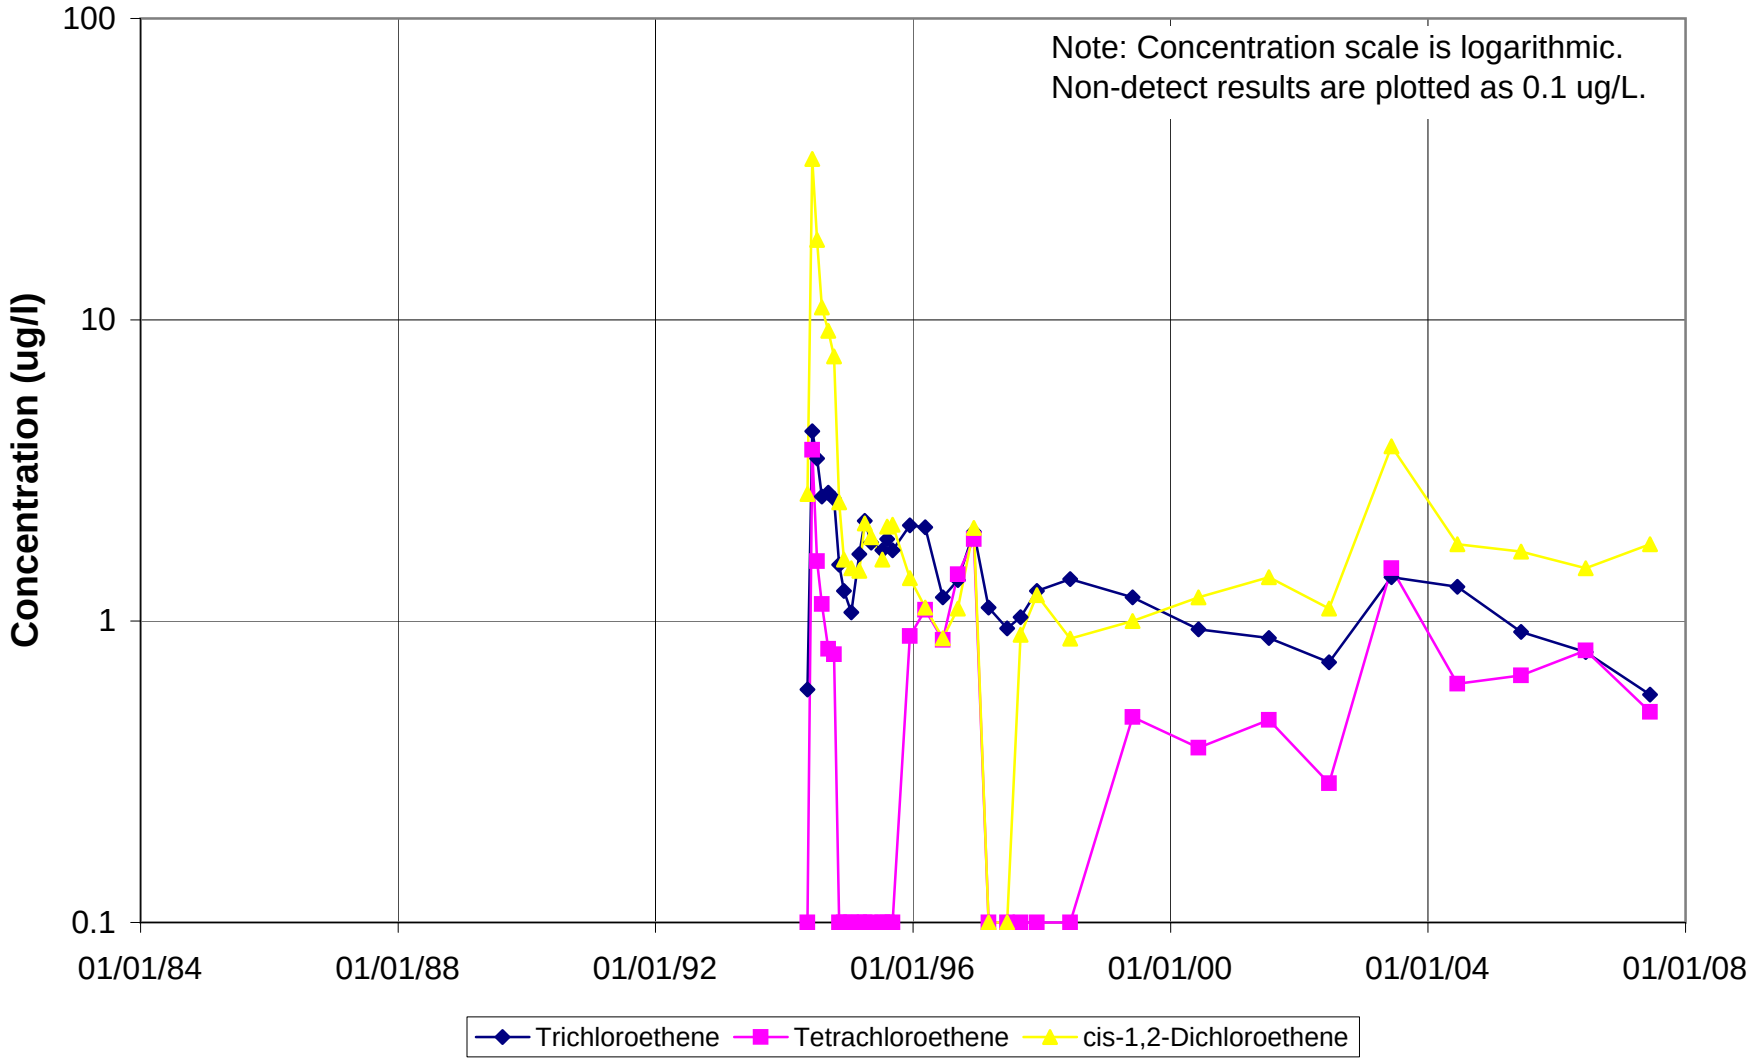

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U352 (EW-2)

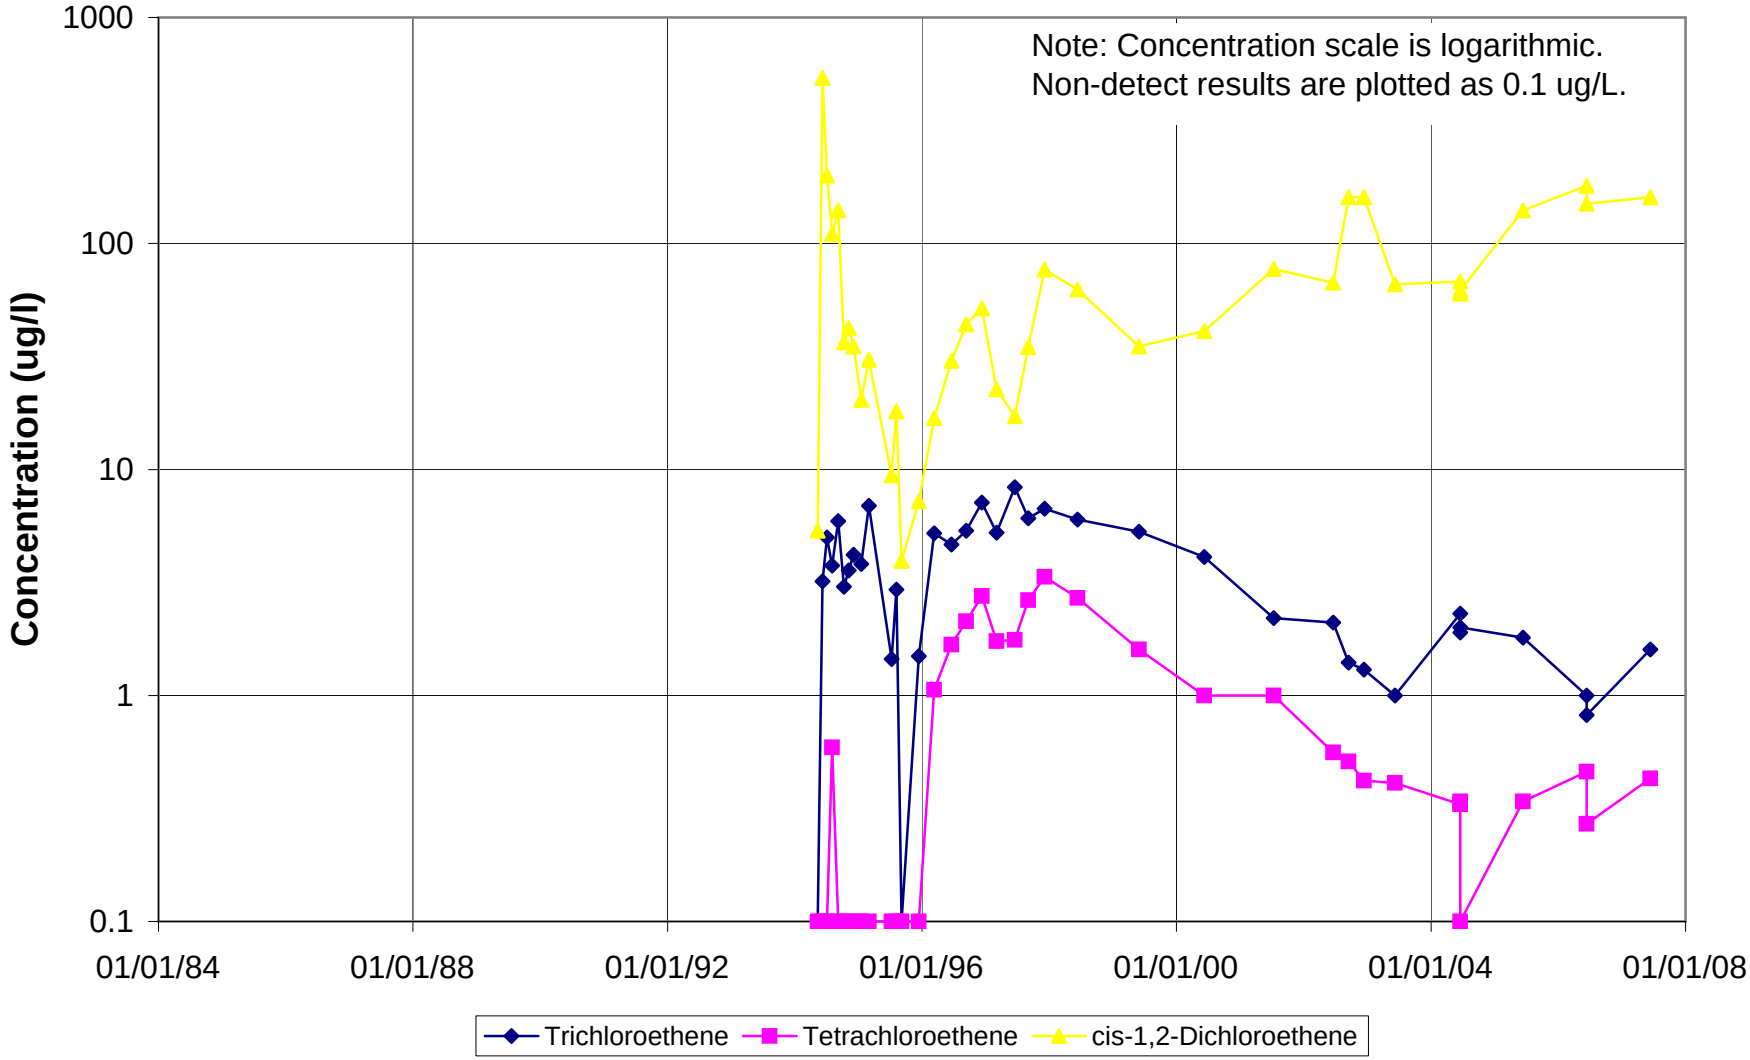

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U353 (EW-3)

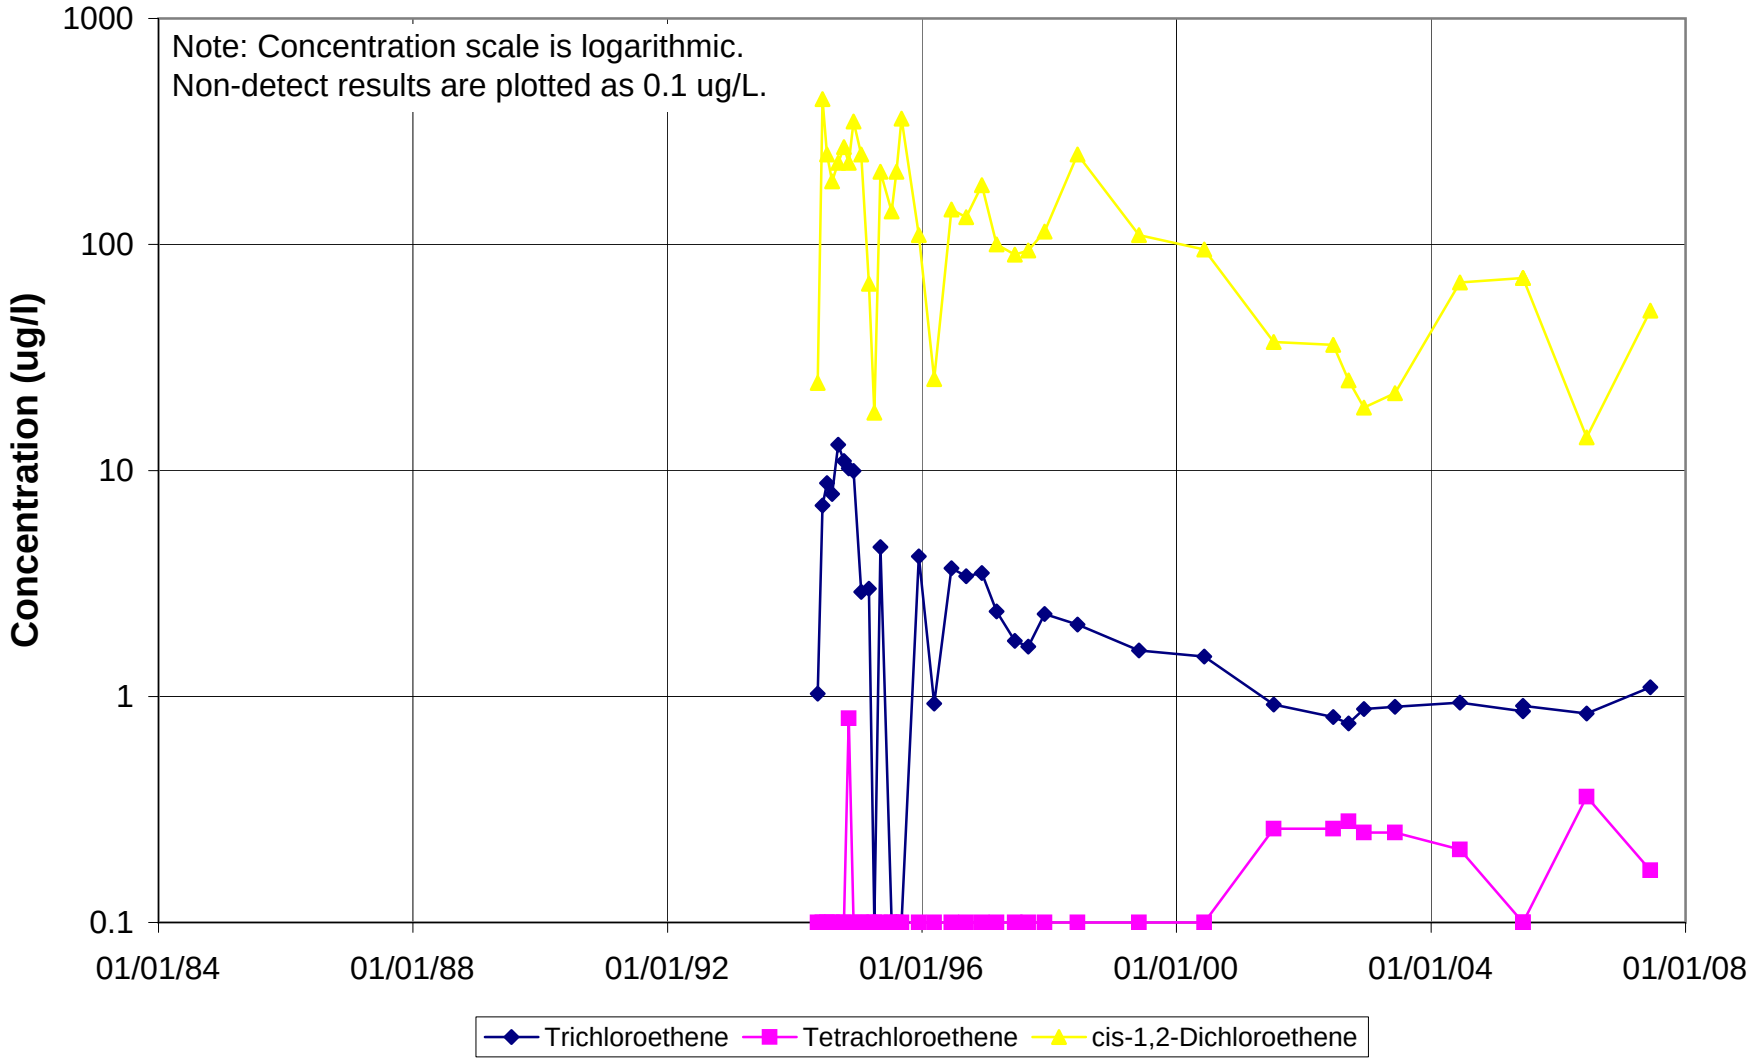

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U354 (EW-4)

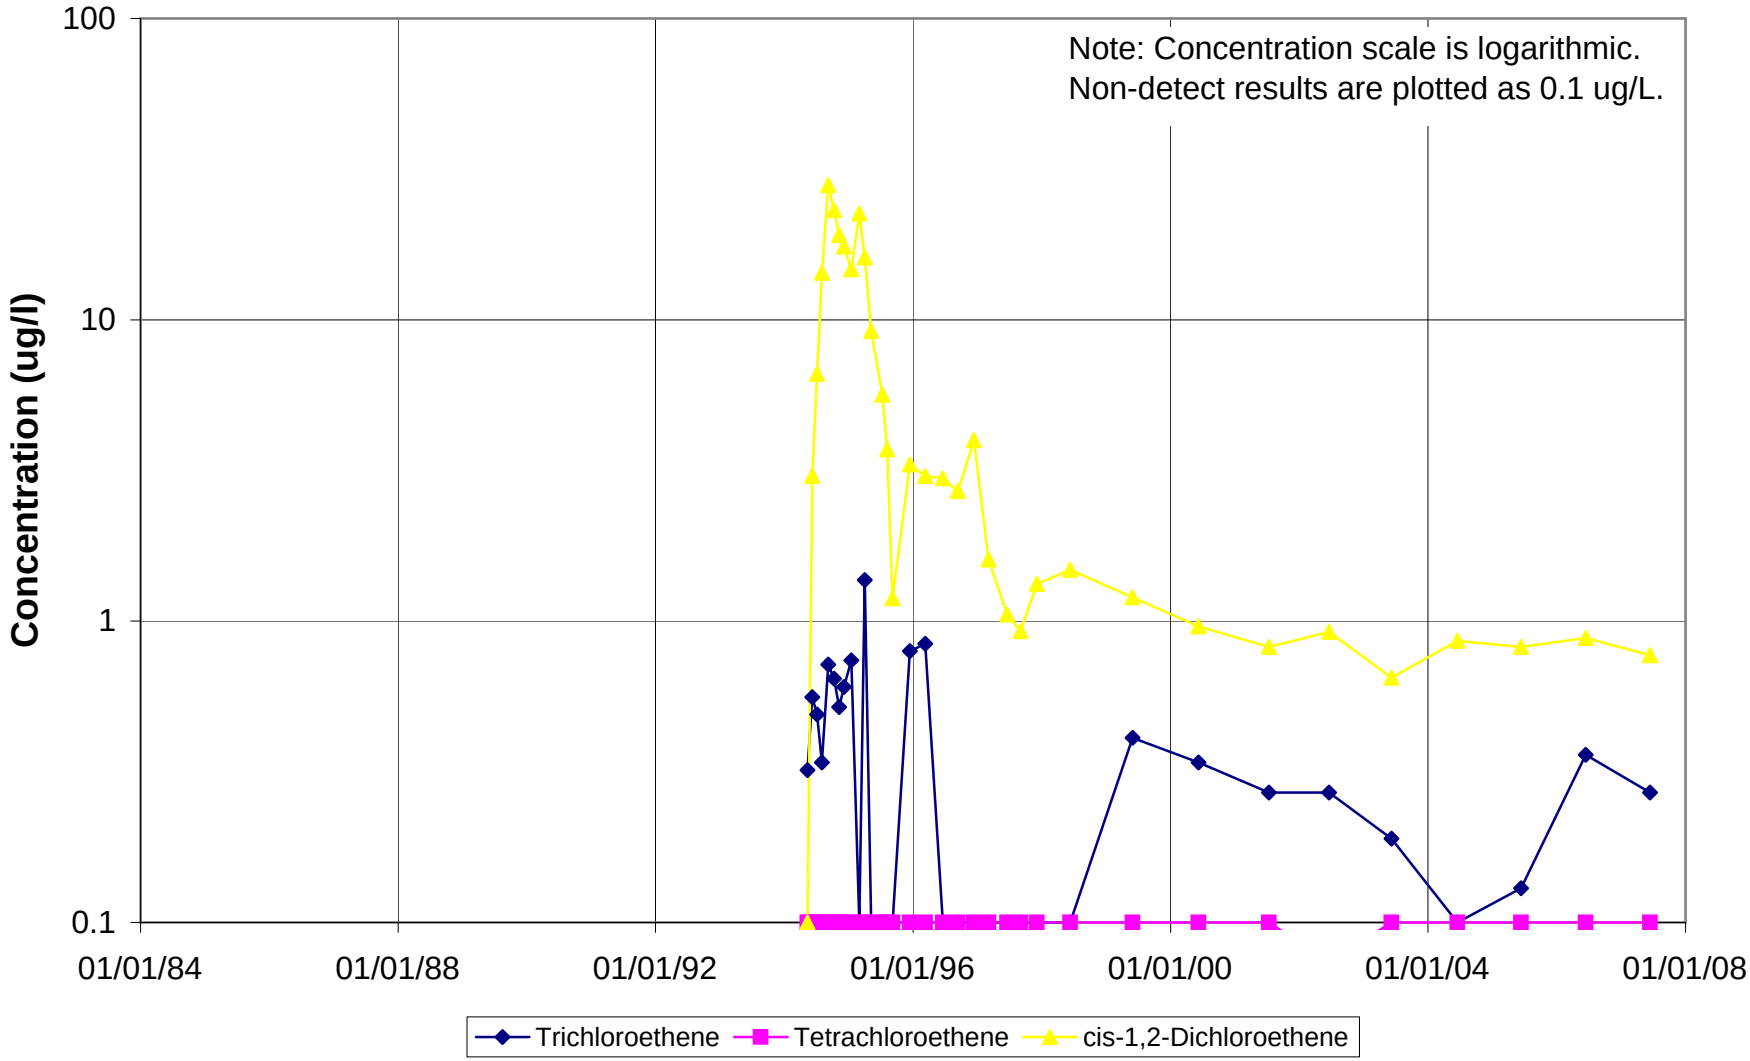

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U355 (EW-5)

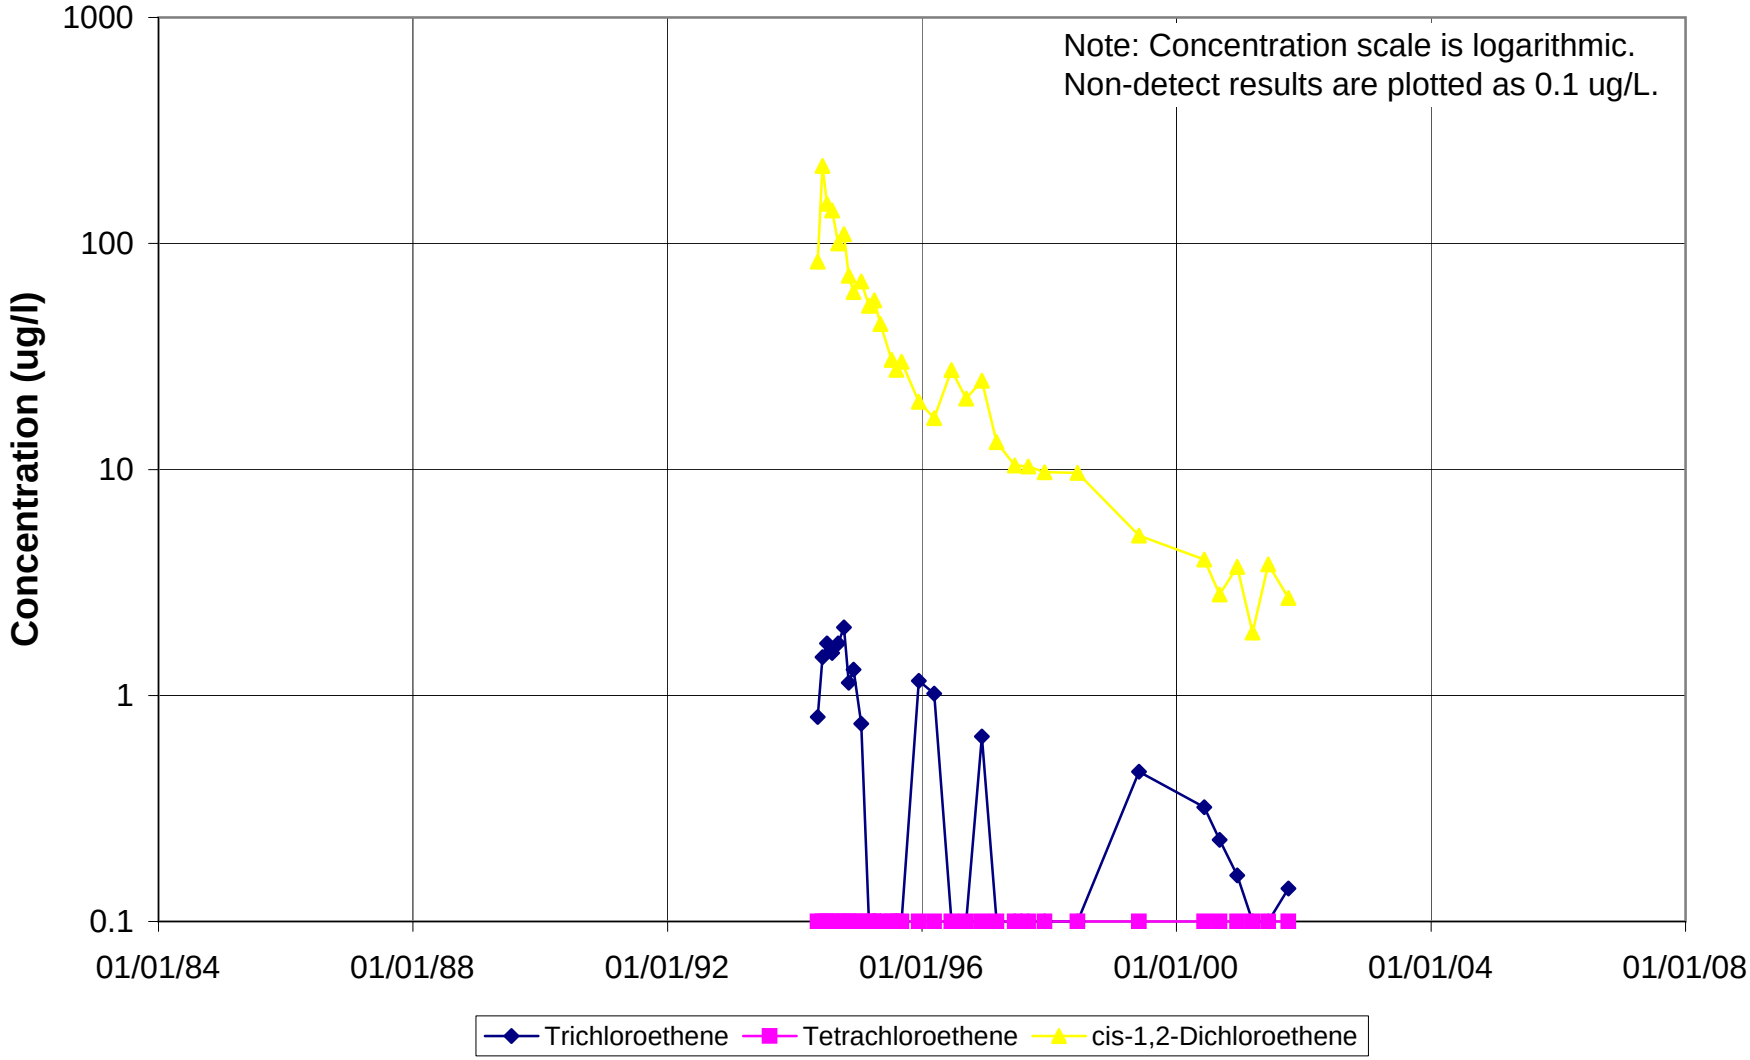

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U356 (EW-6)

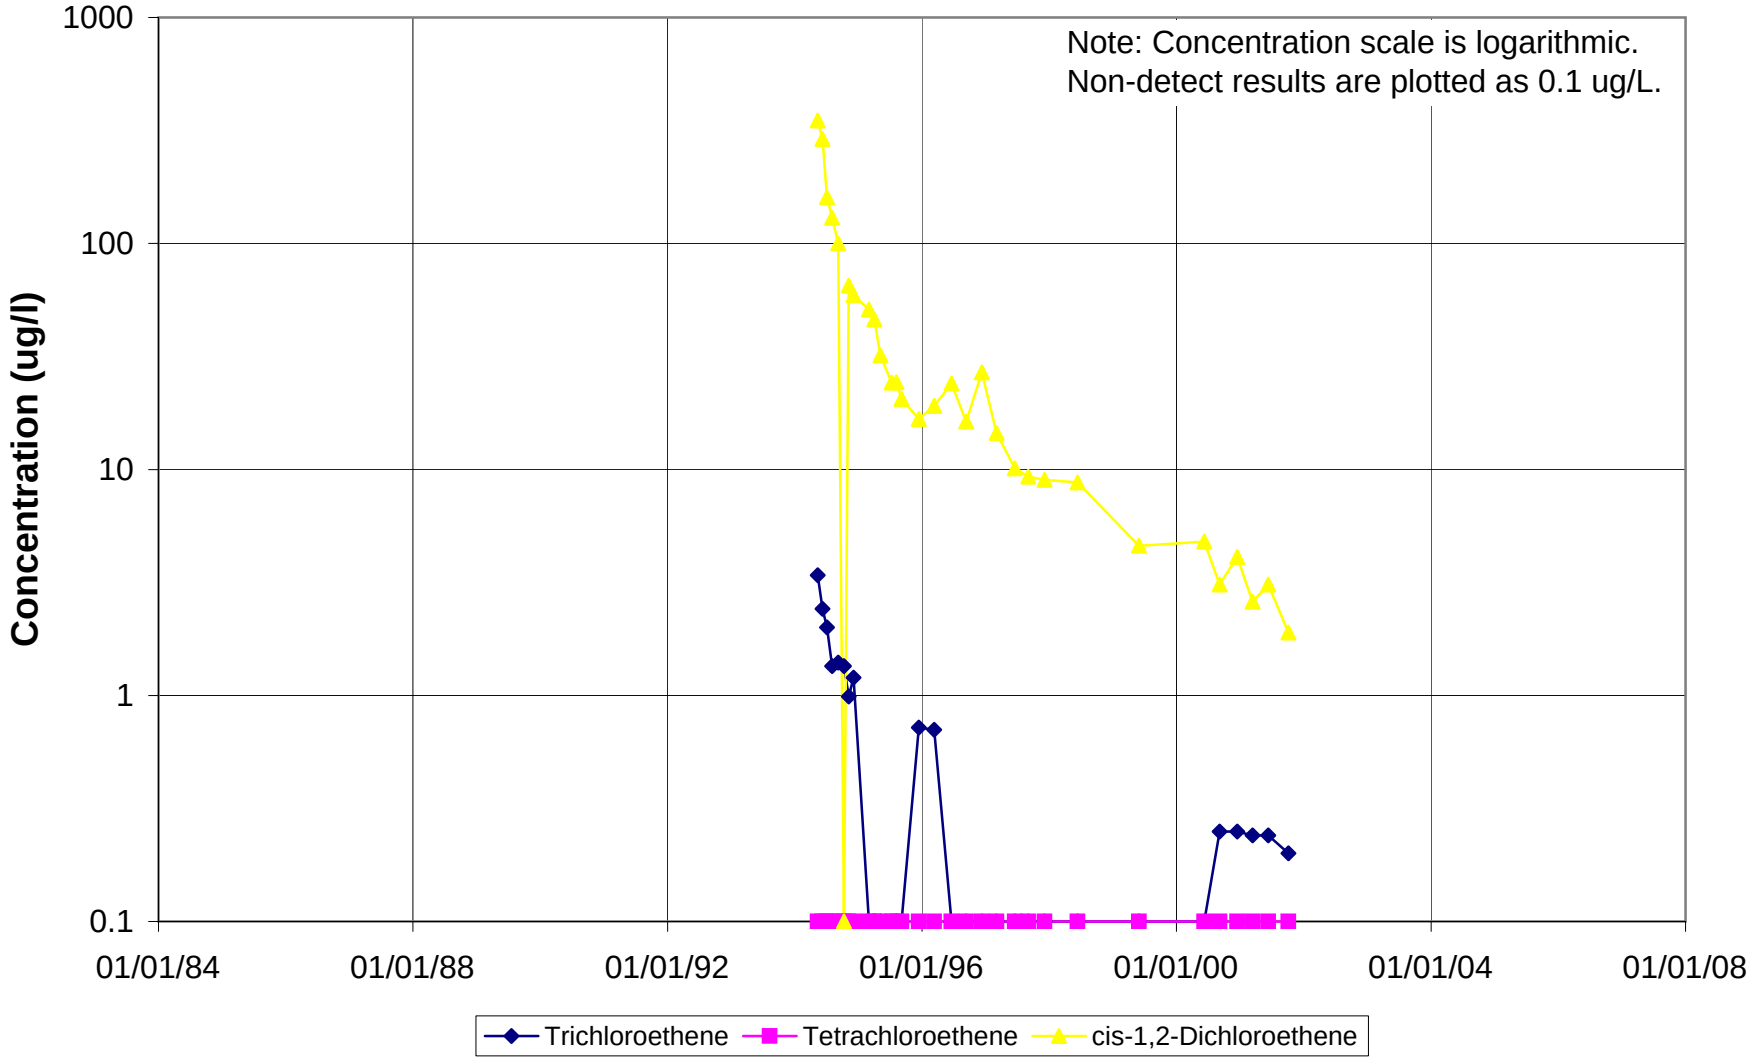

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U357 (EW-7)

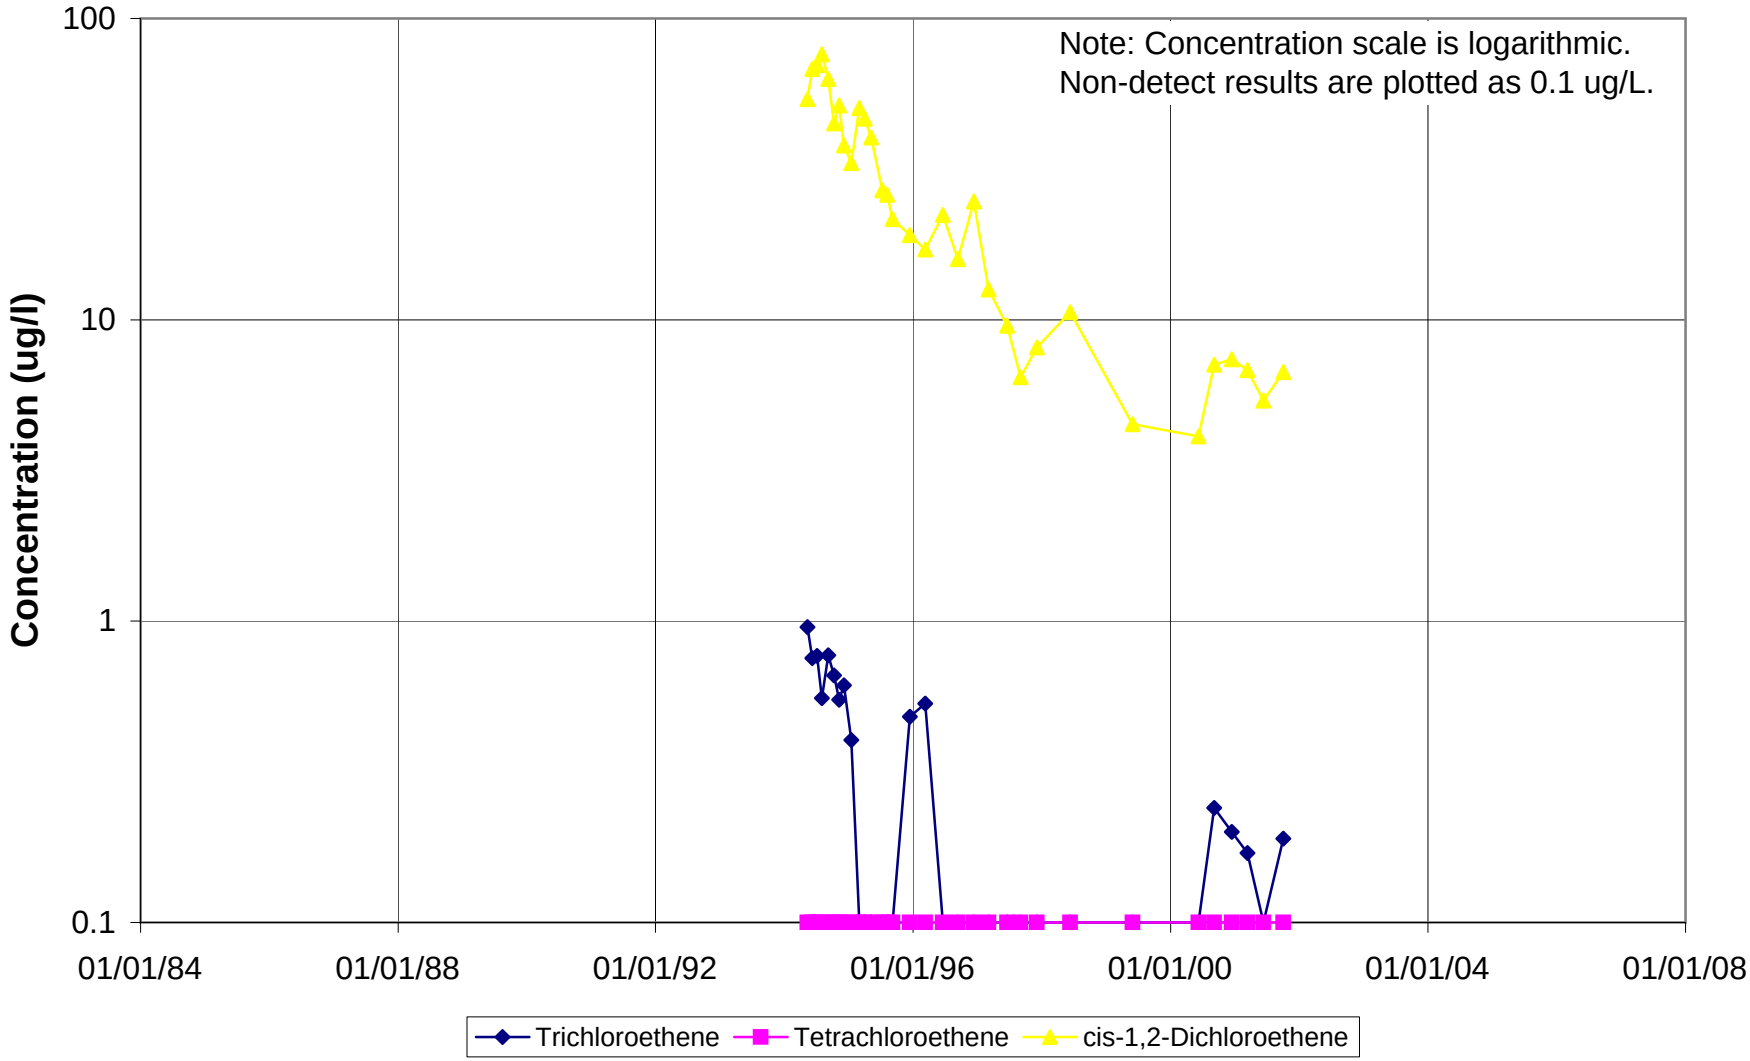

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U358 (EW-8)

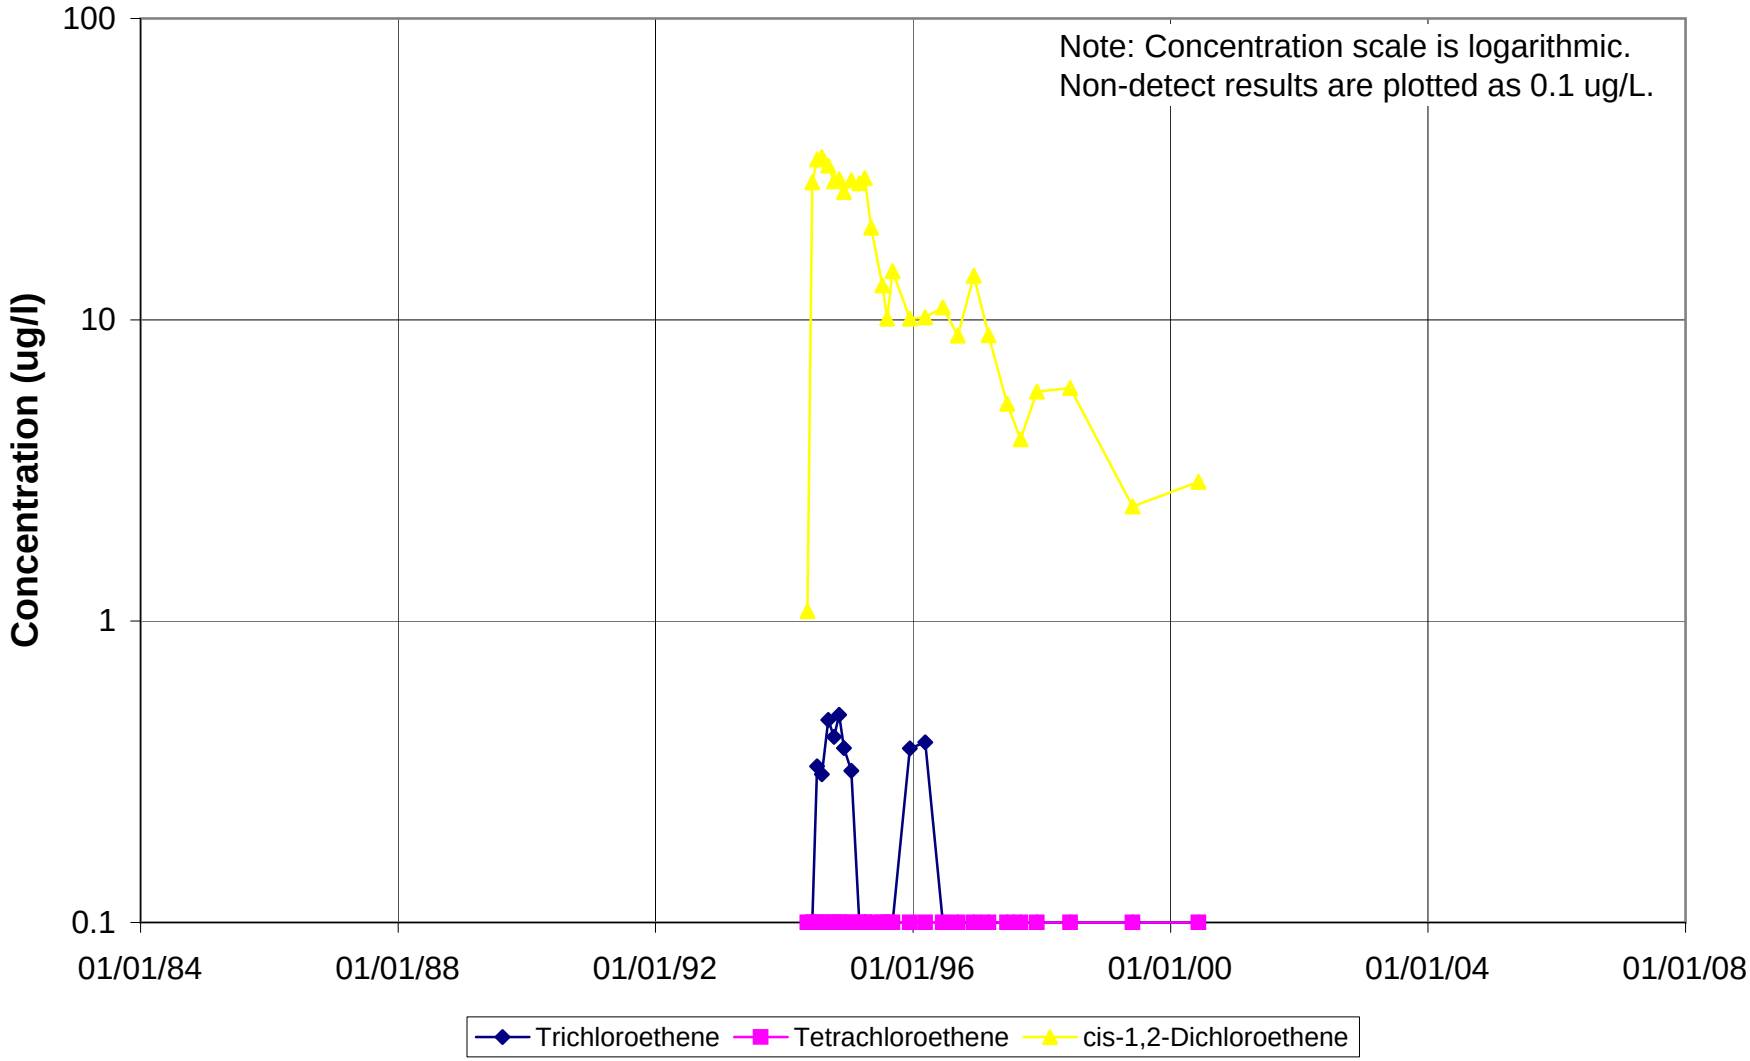

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U601

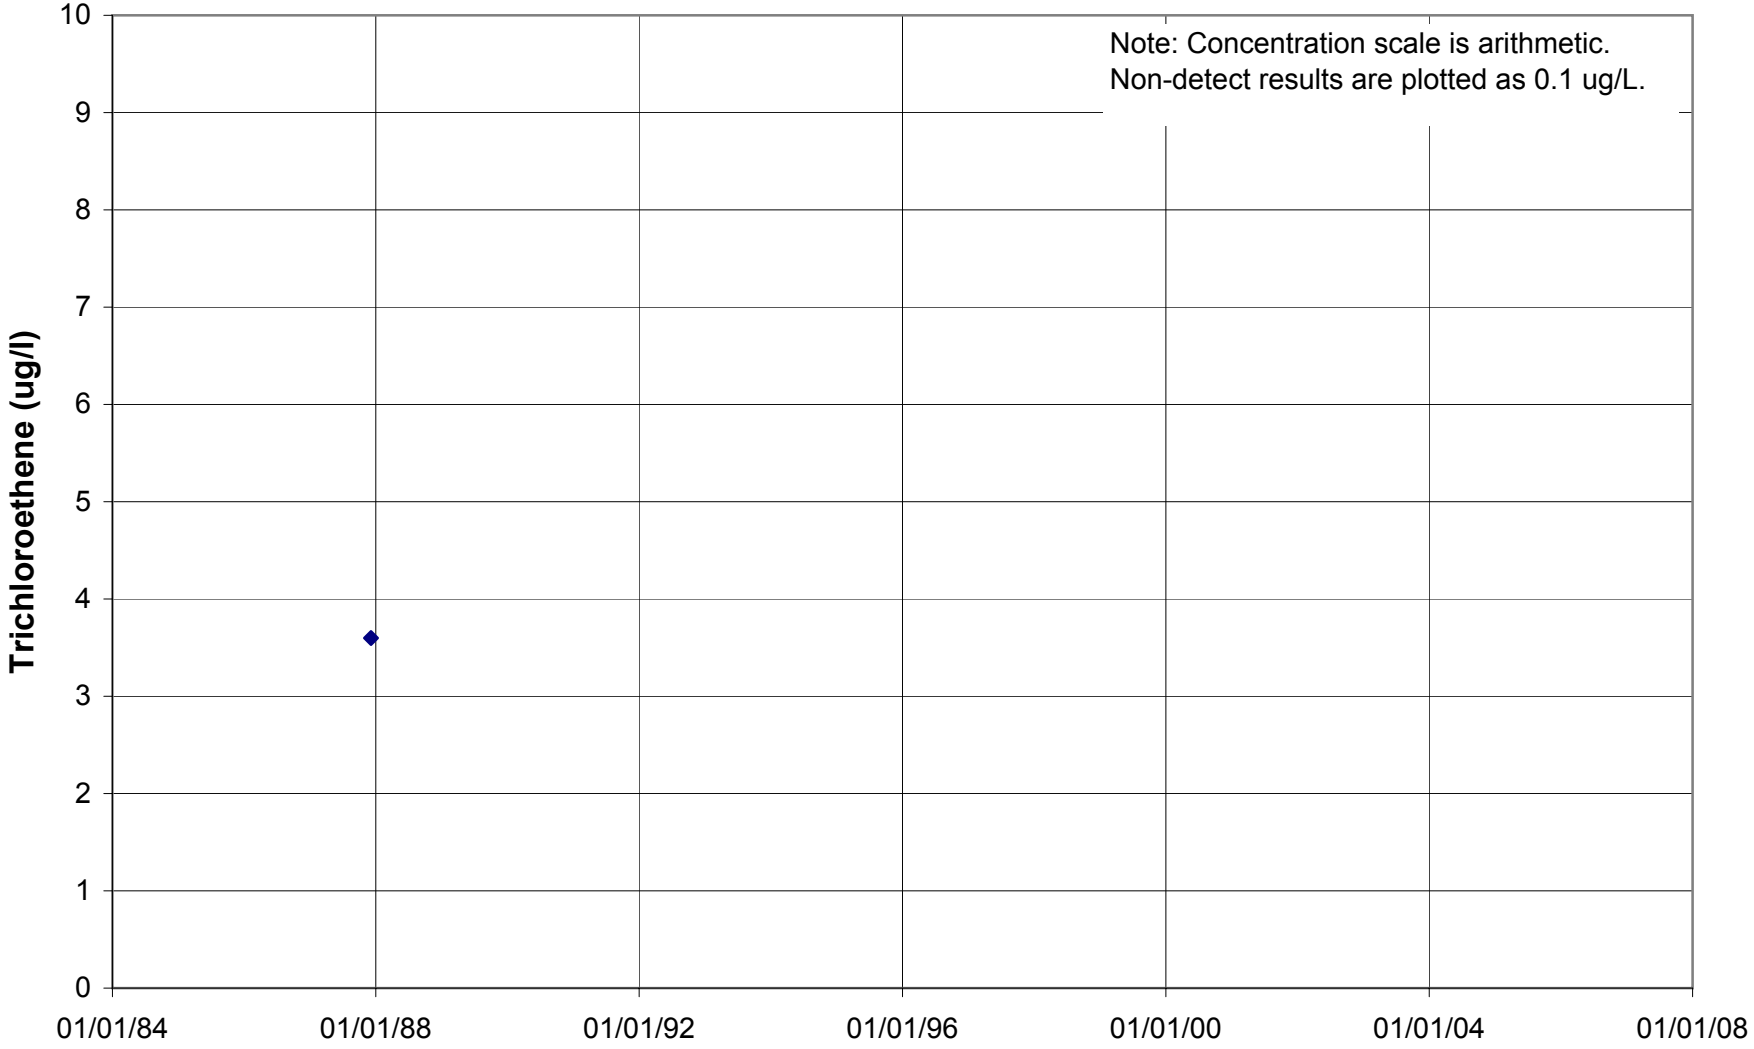

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U603

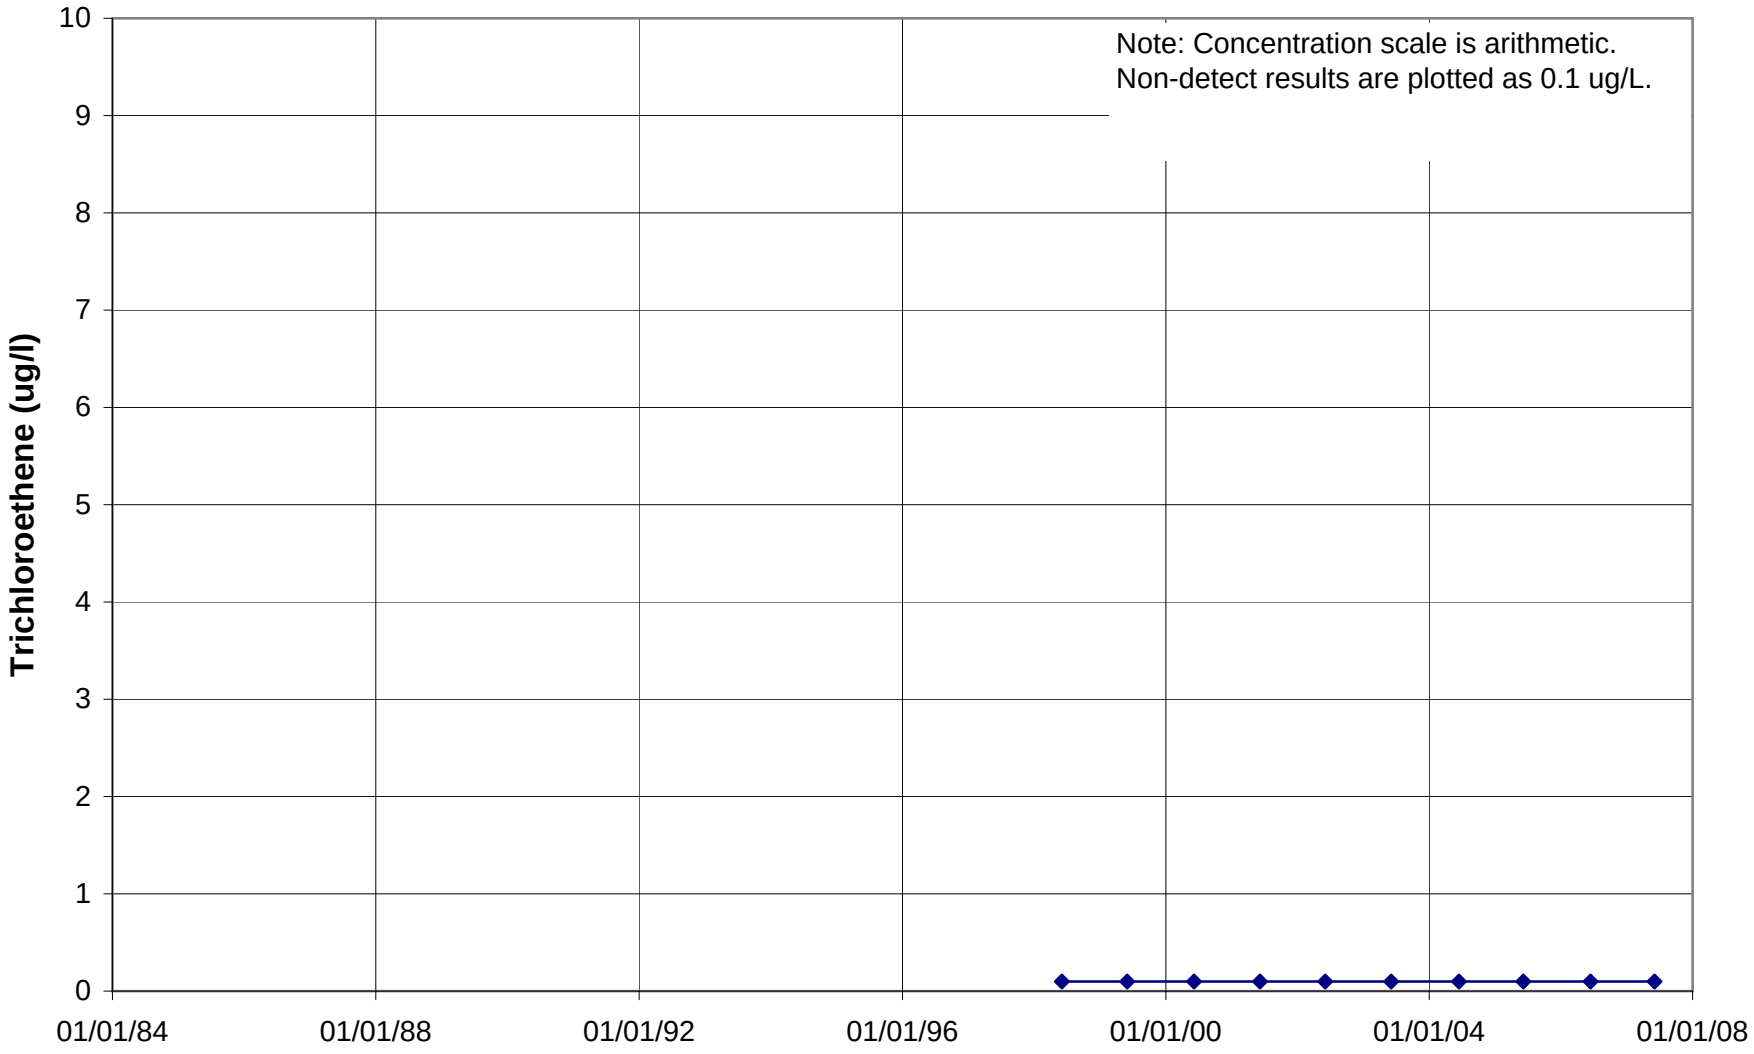

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U604

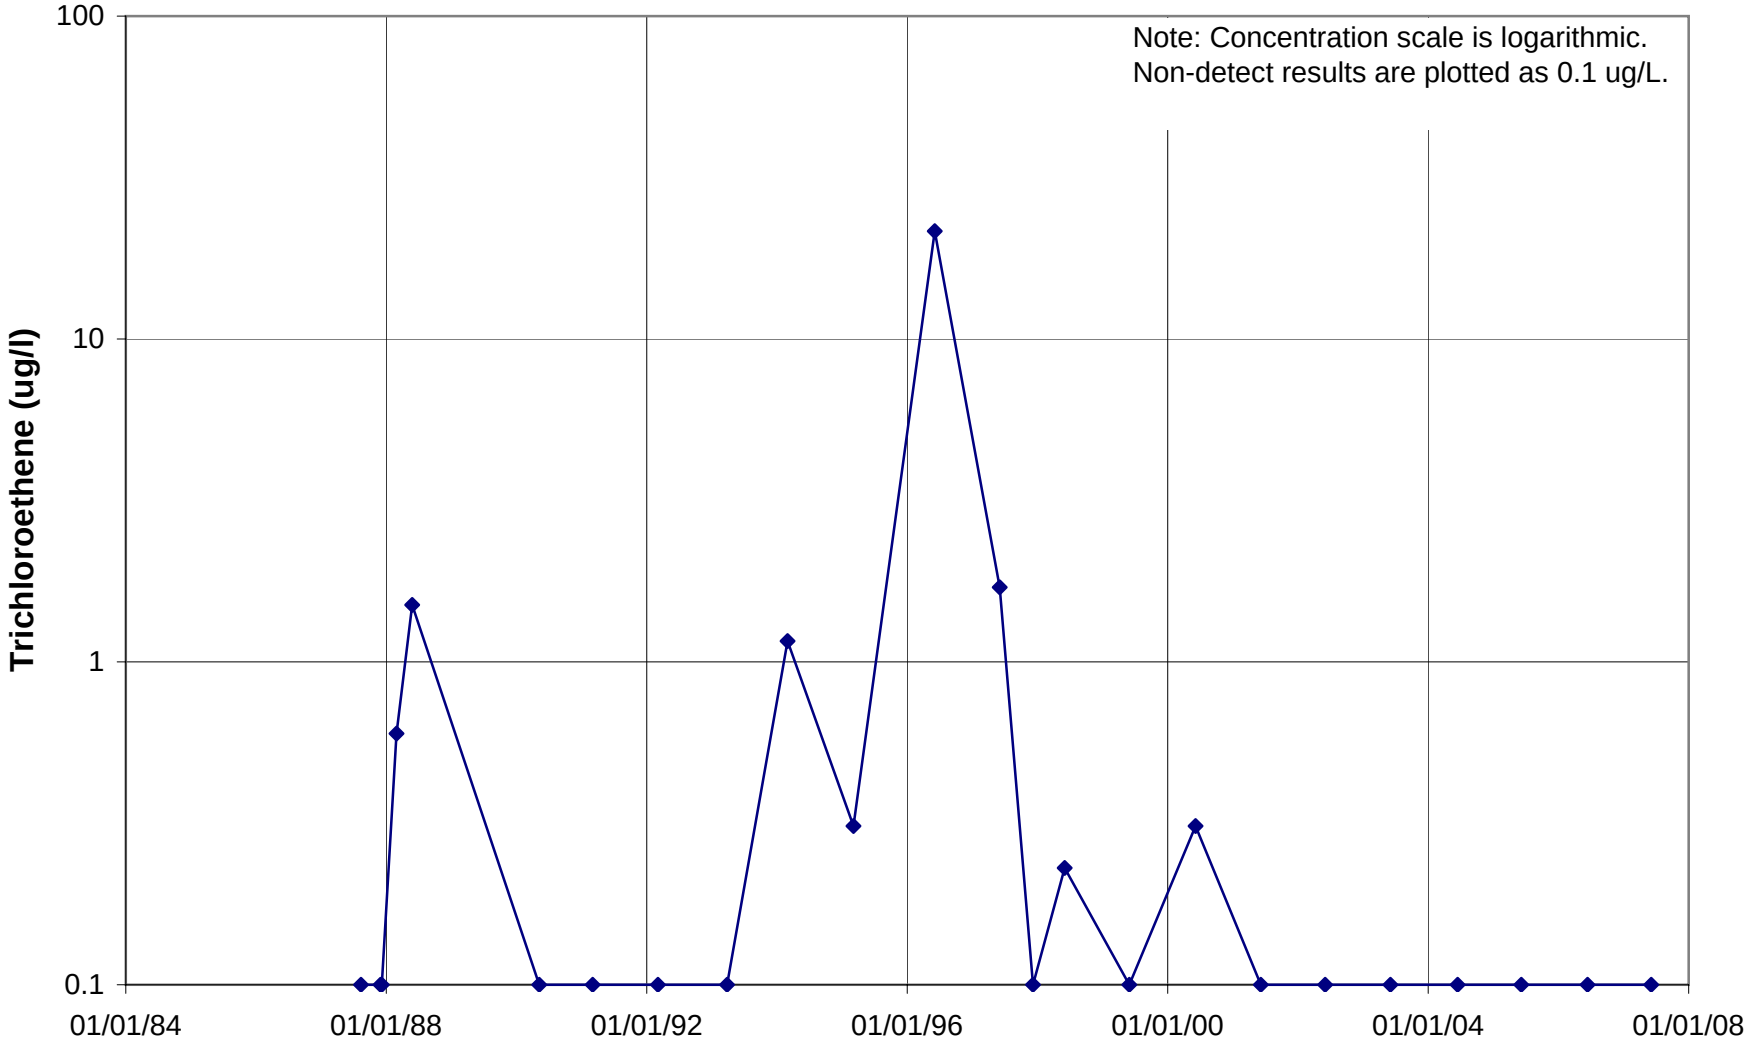

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U611

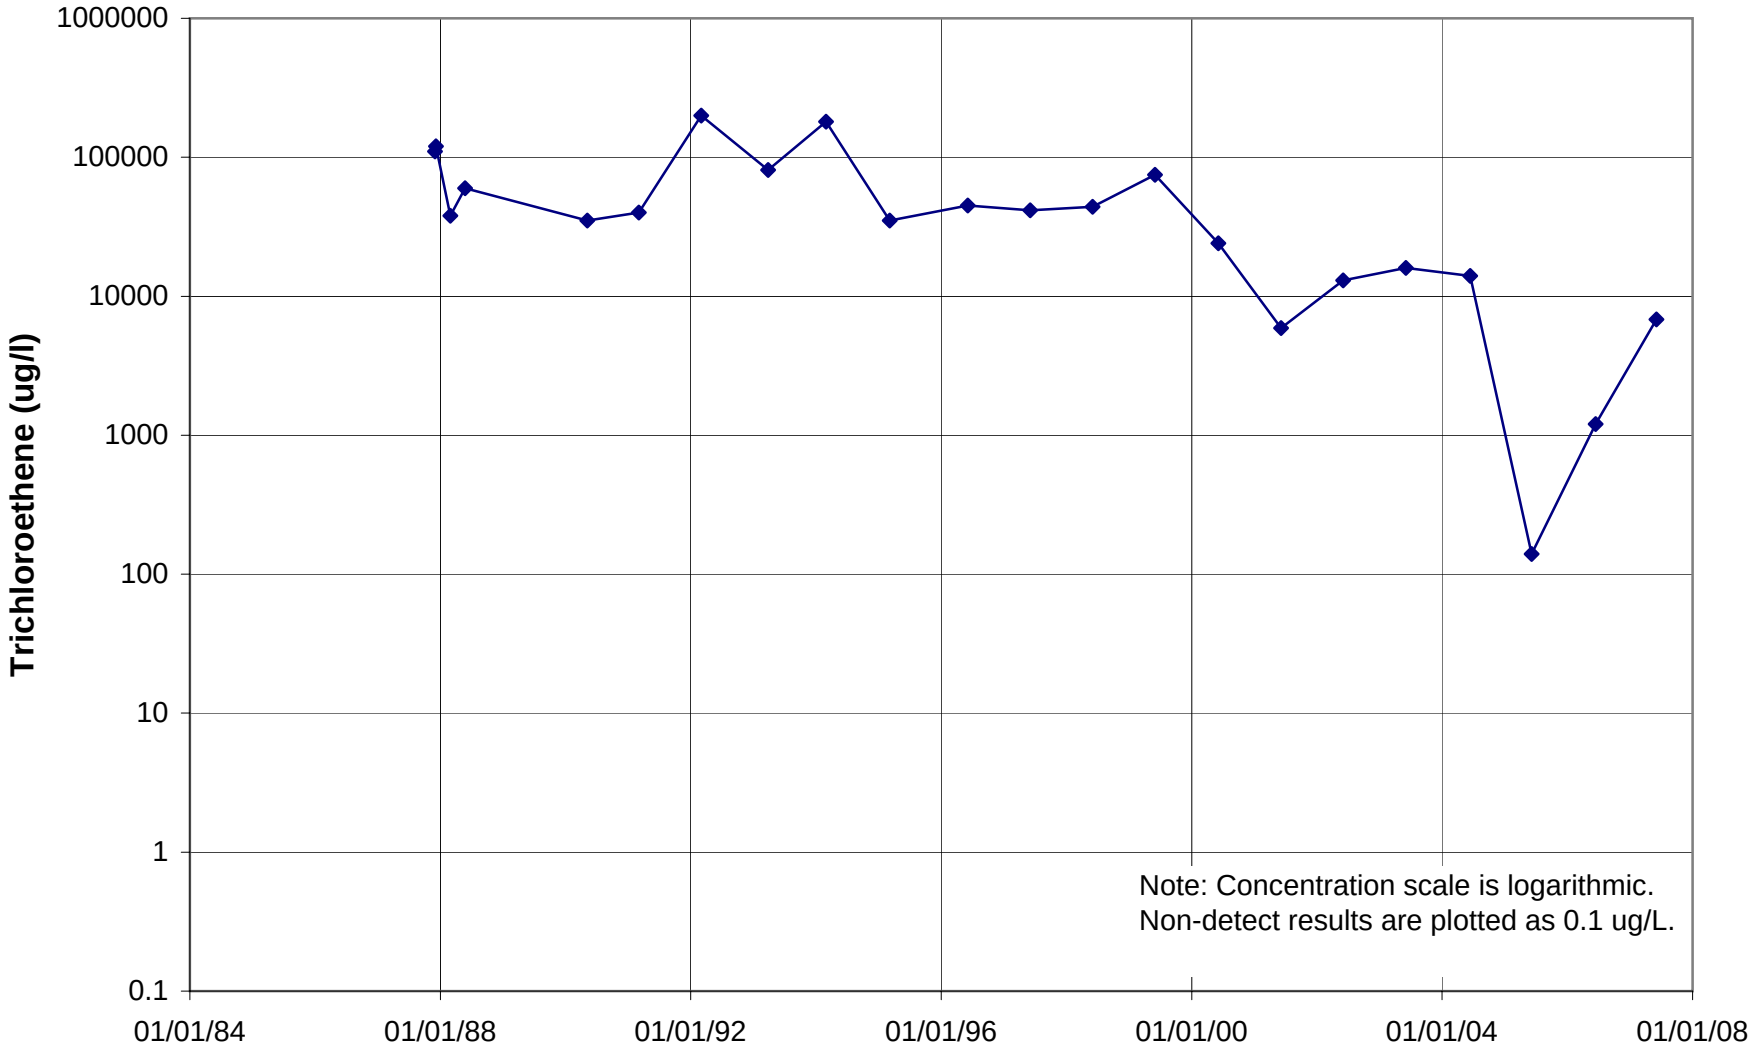

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U613

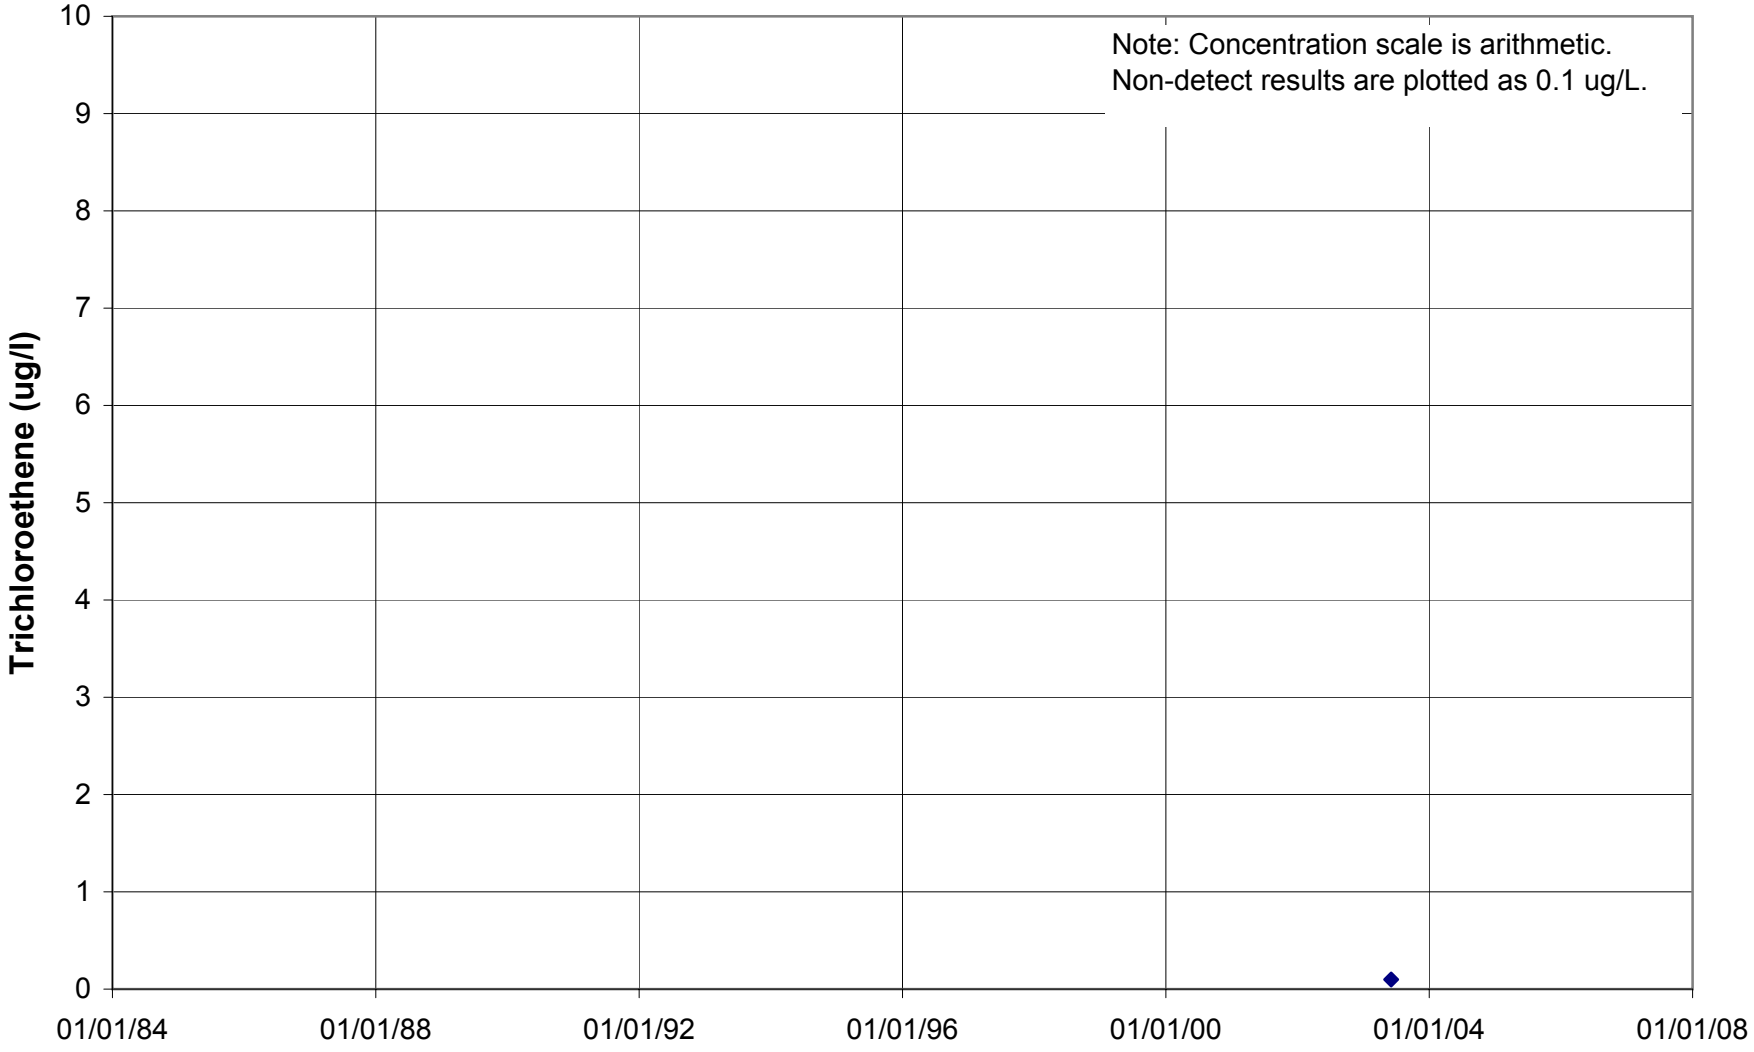

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U615

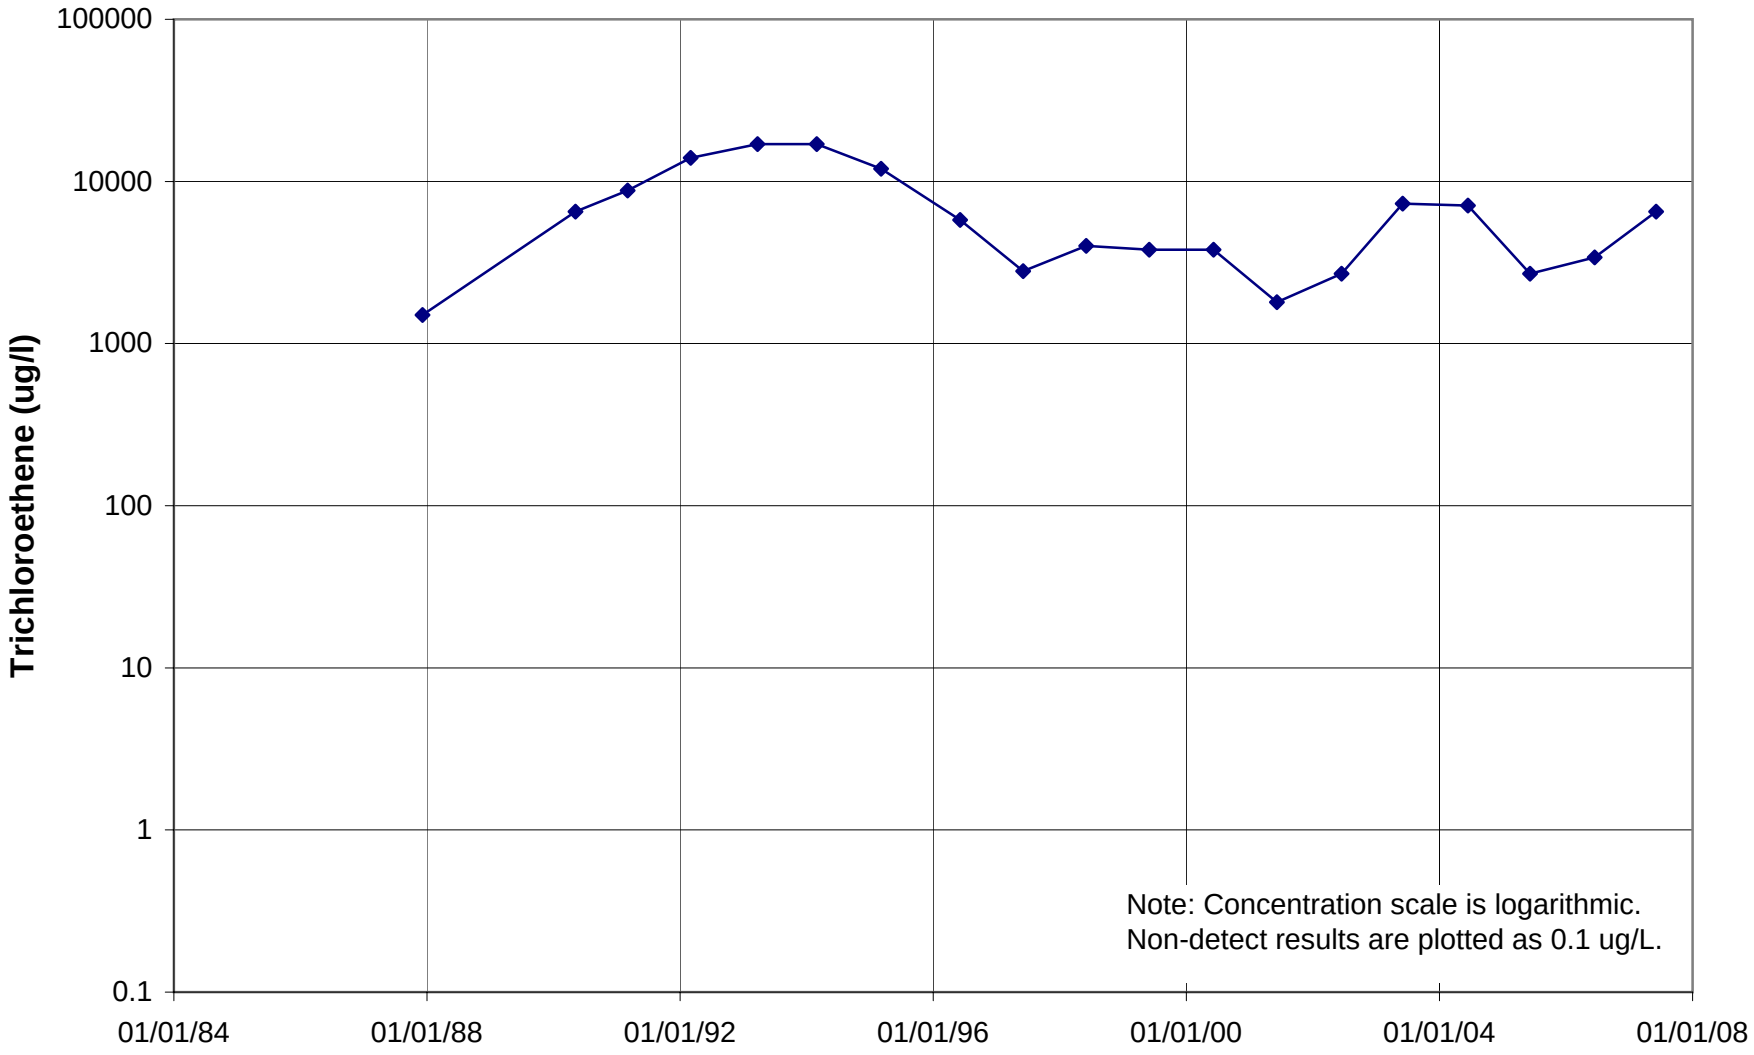

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U617

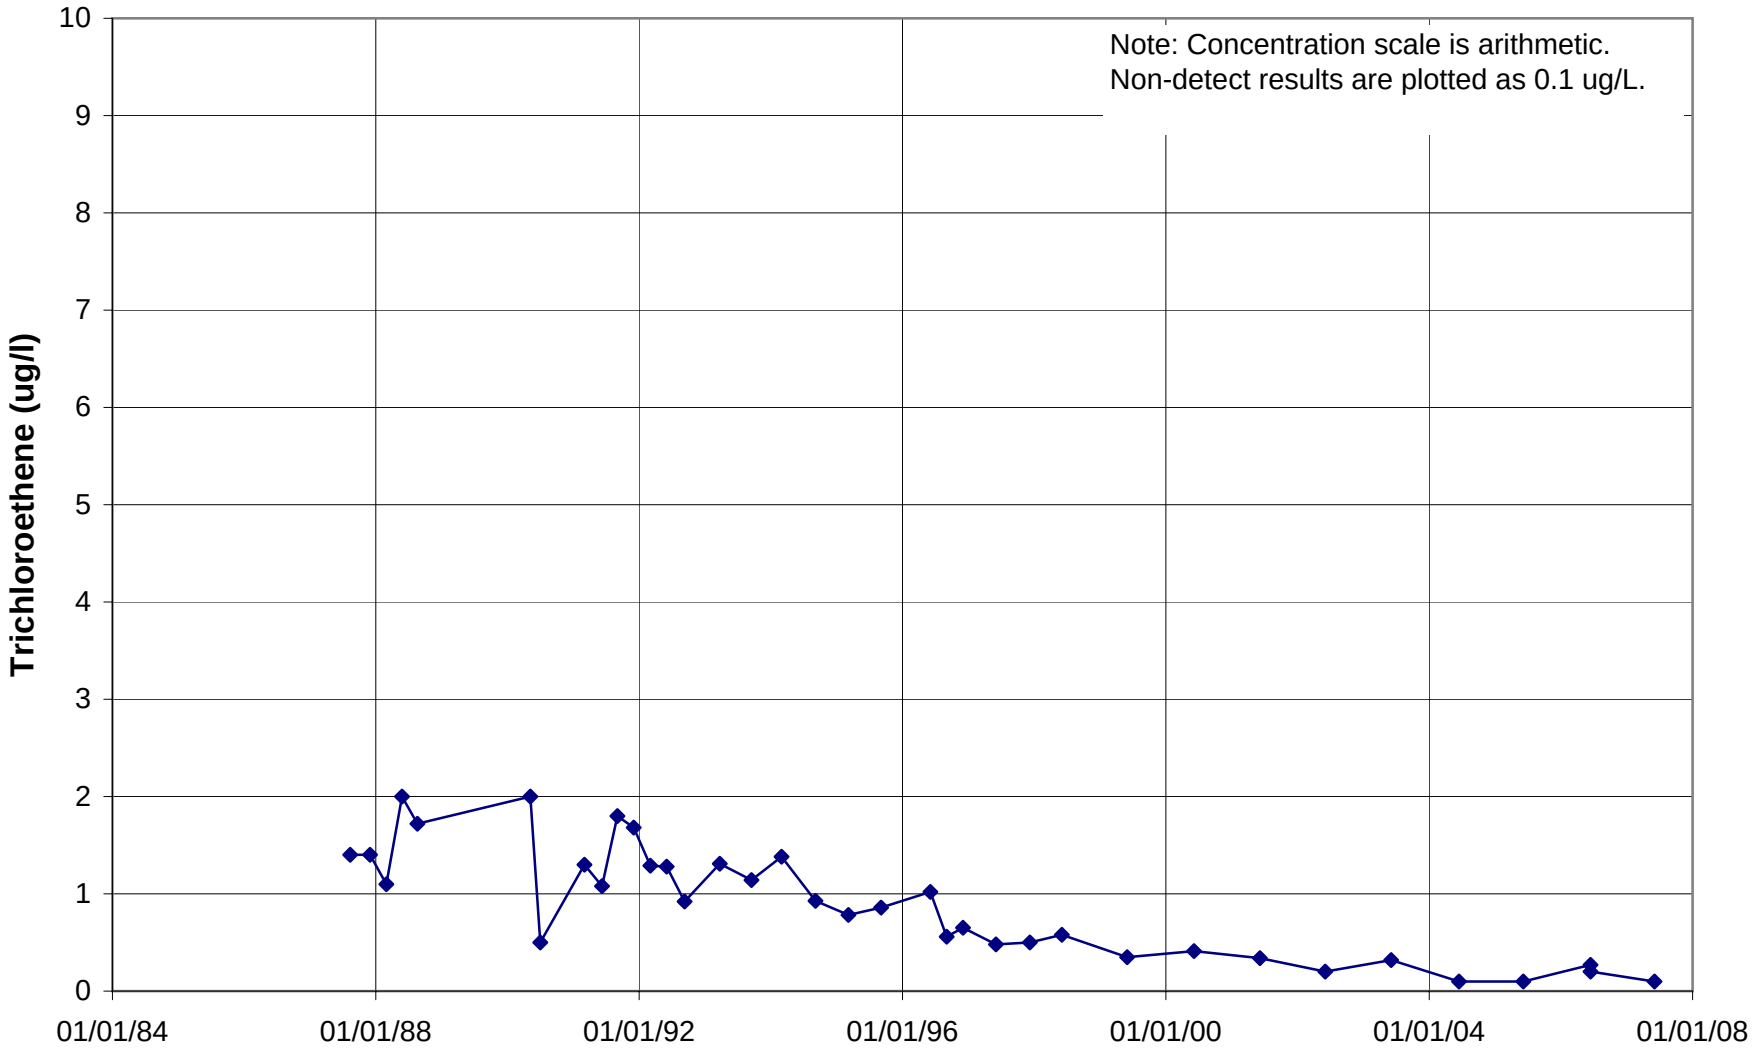

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U618

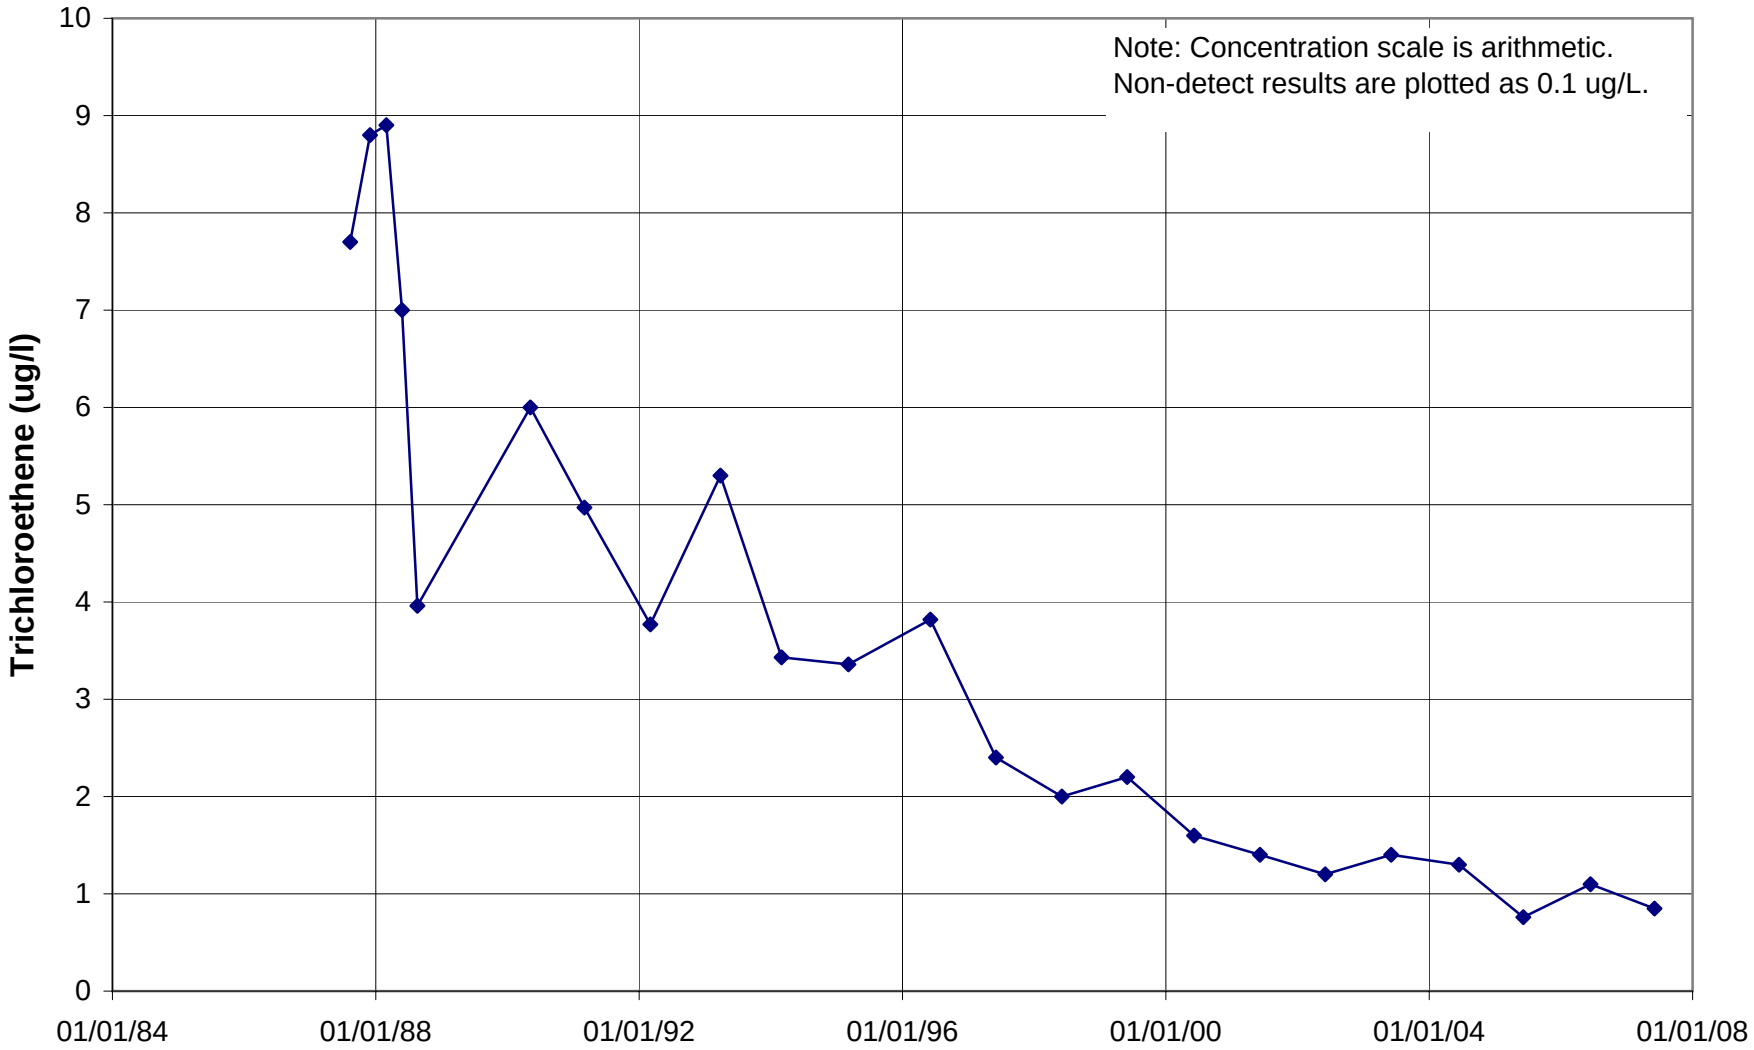

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U619

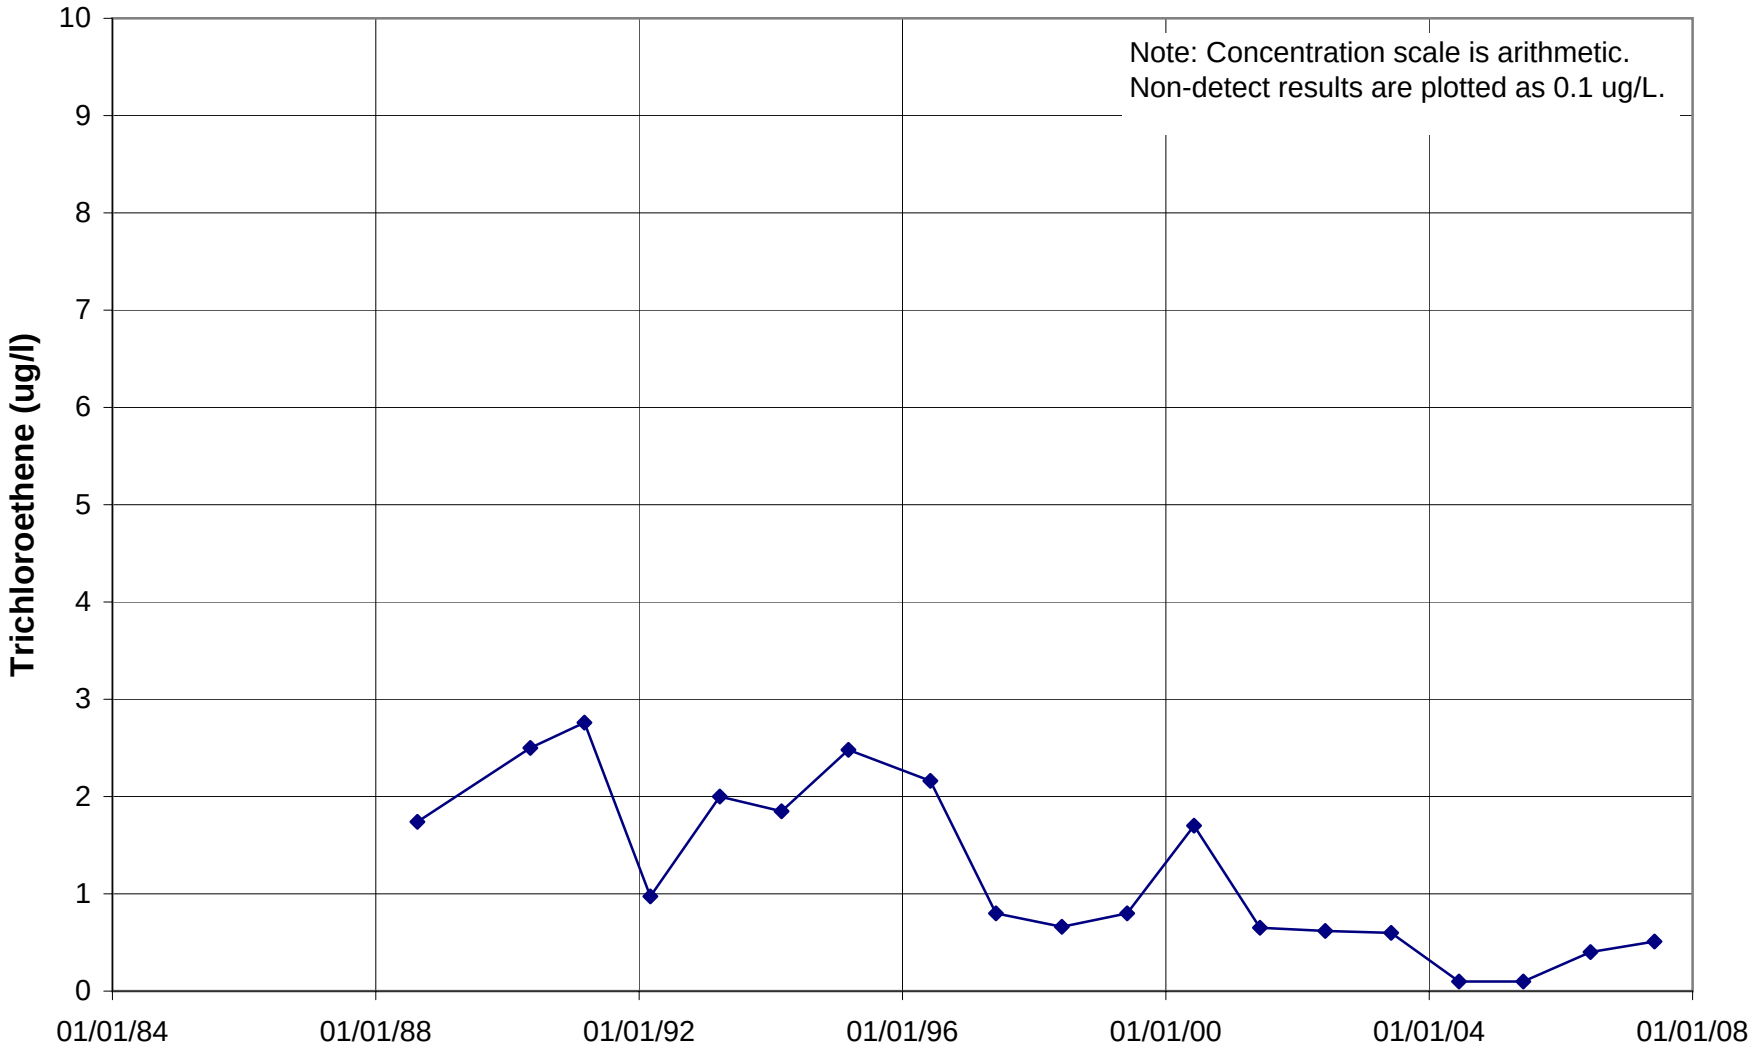

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U620

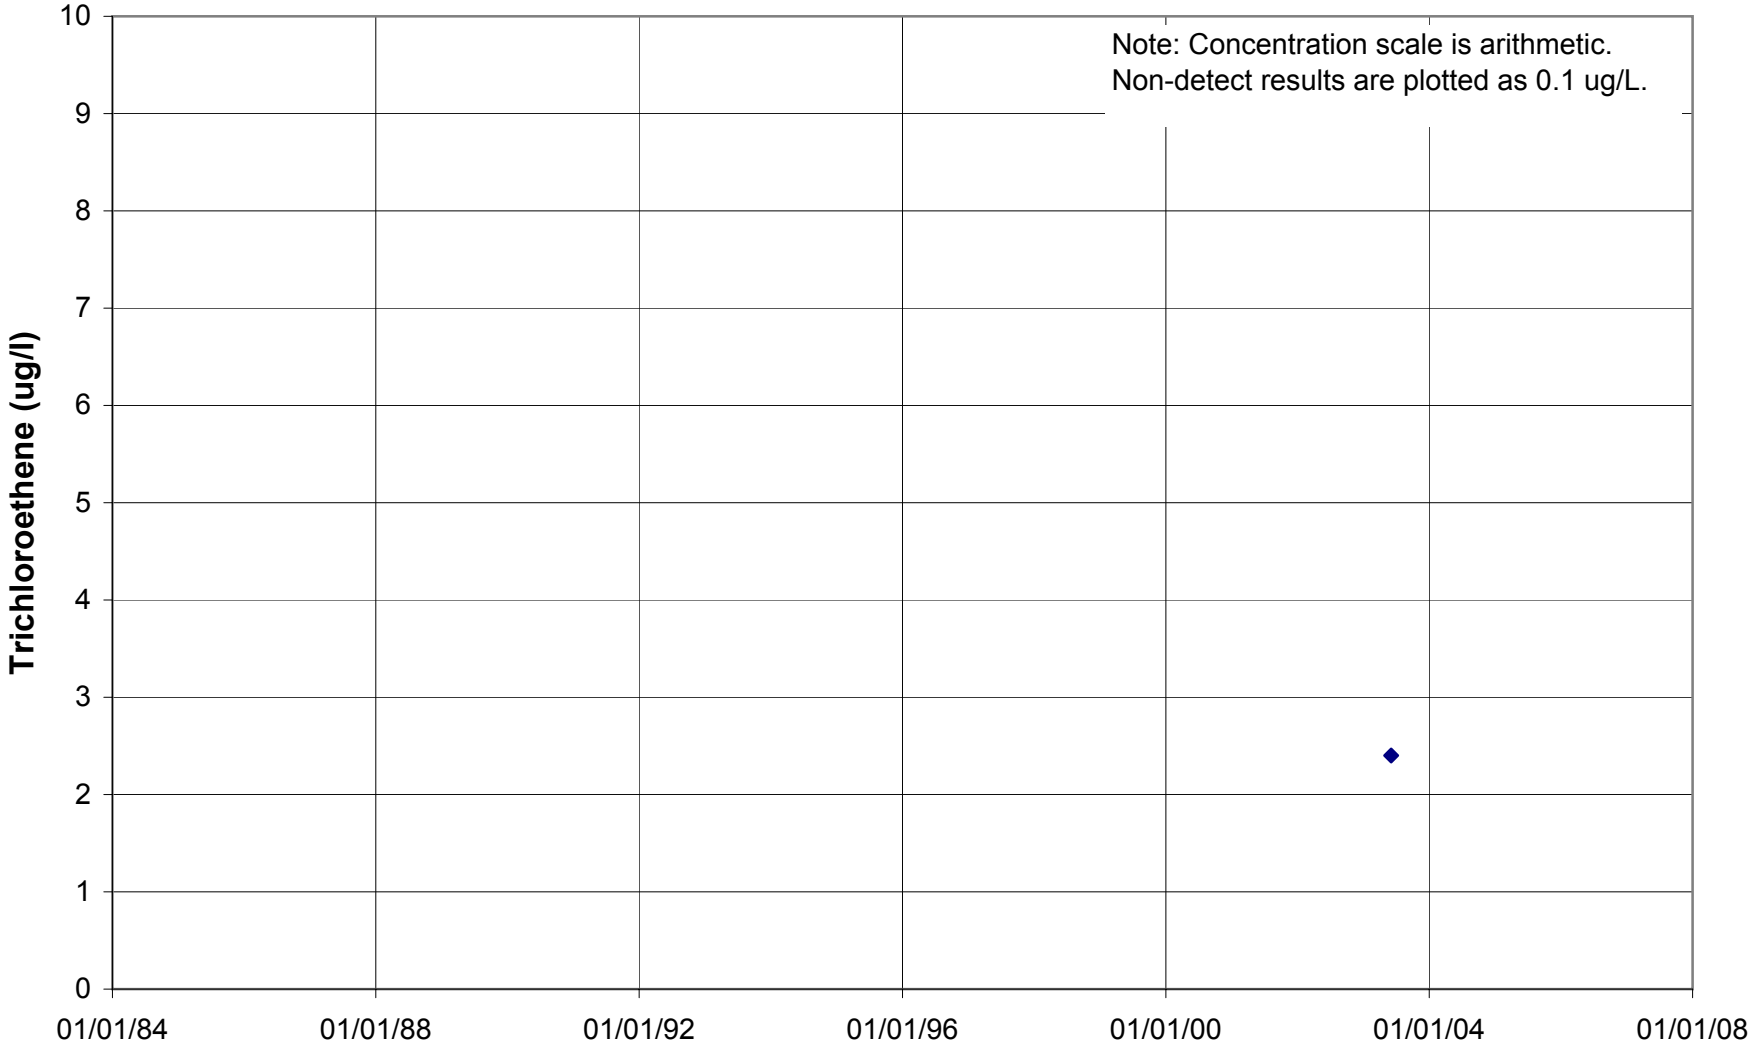

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U621

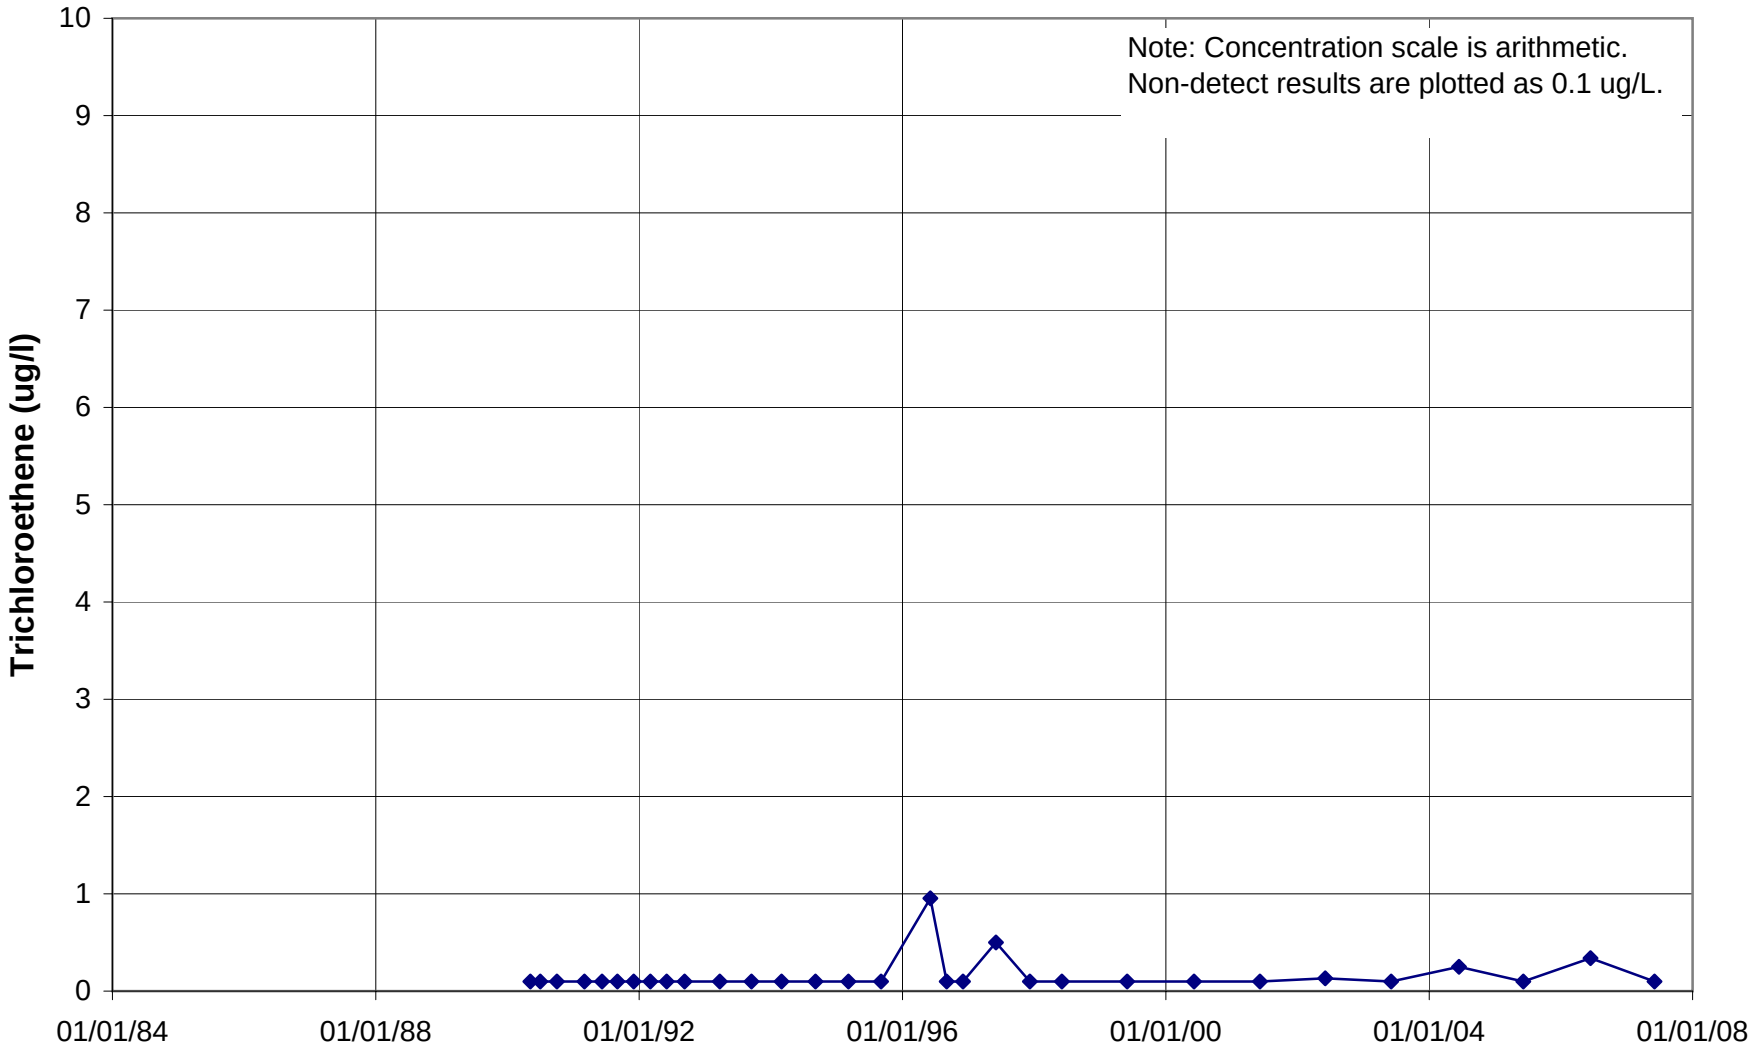

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U626

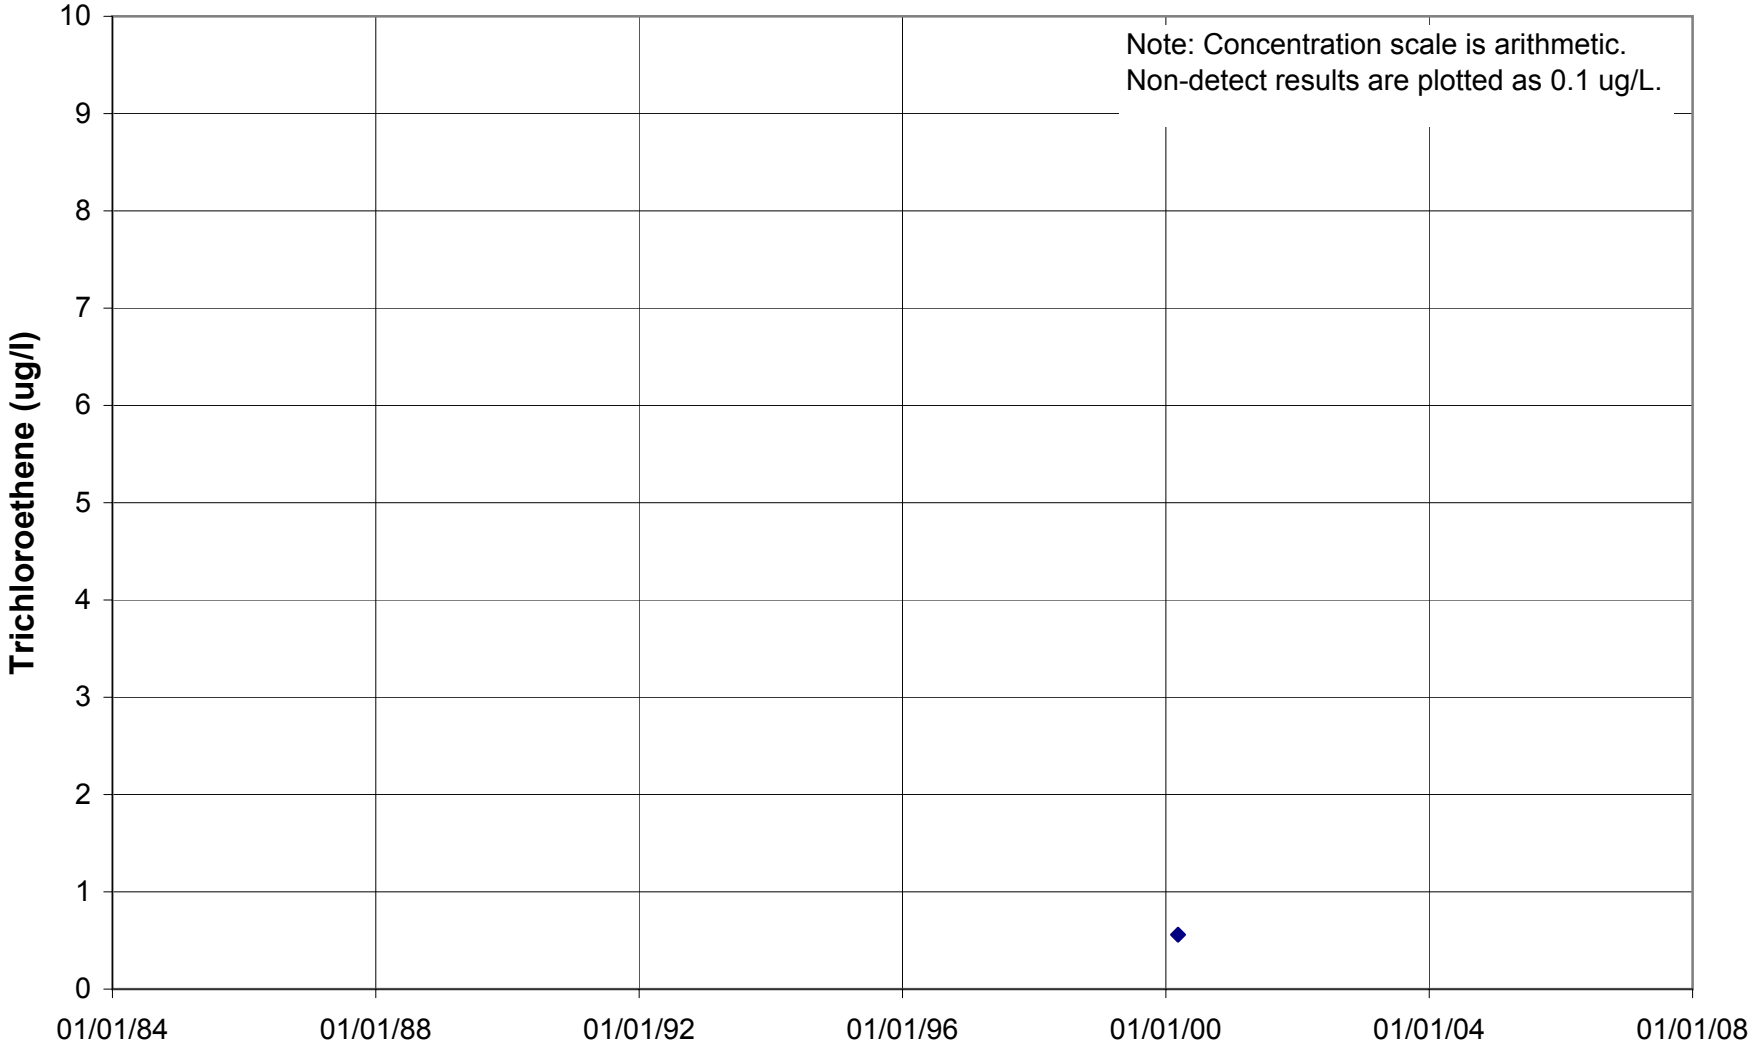

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U627

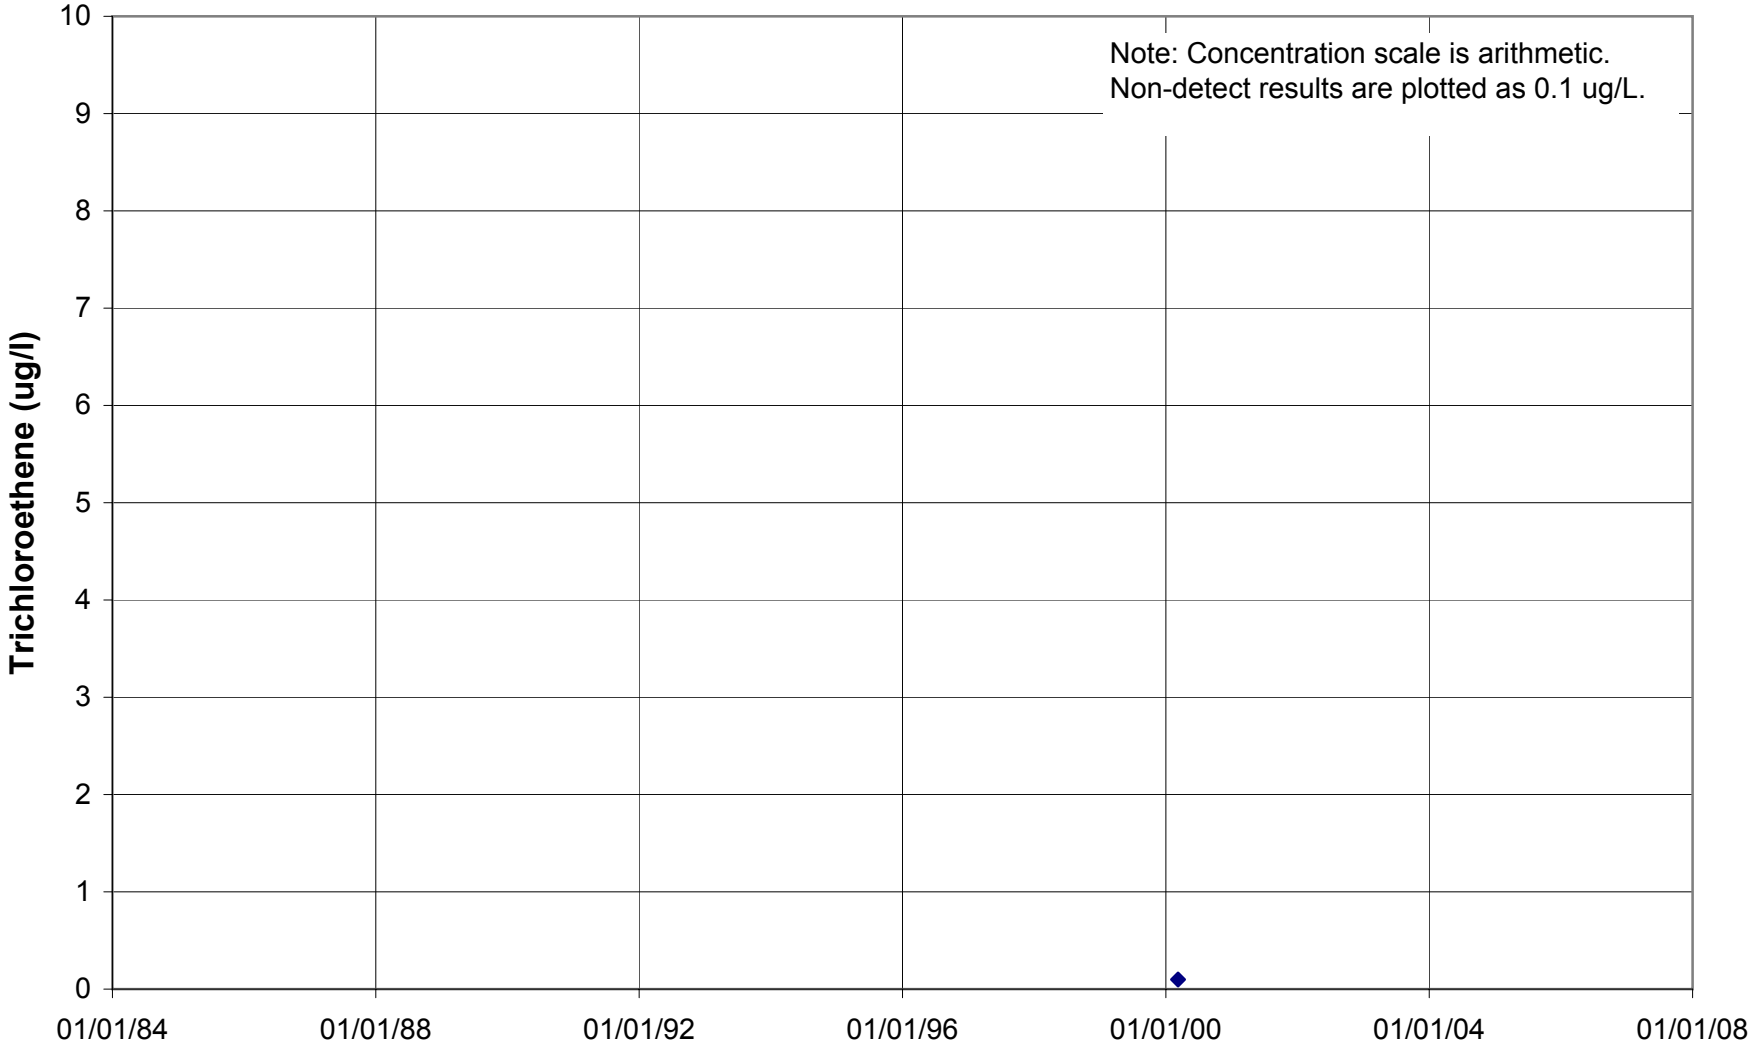

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U628

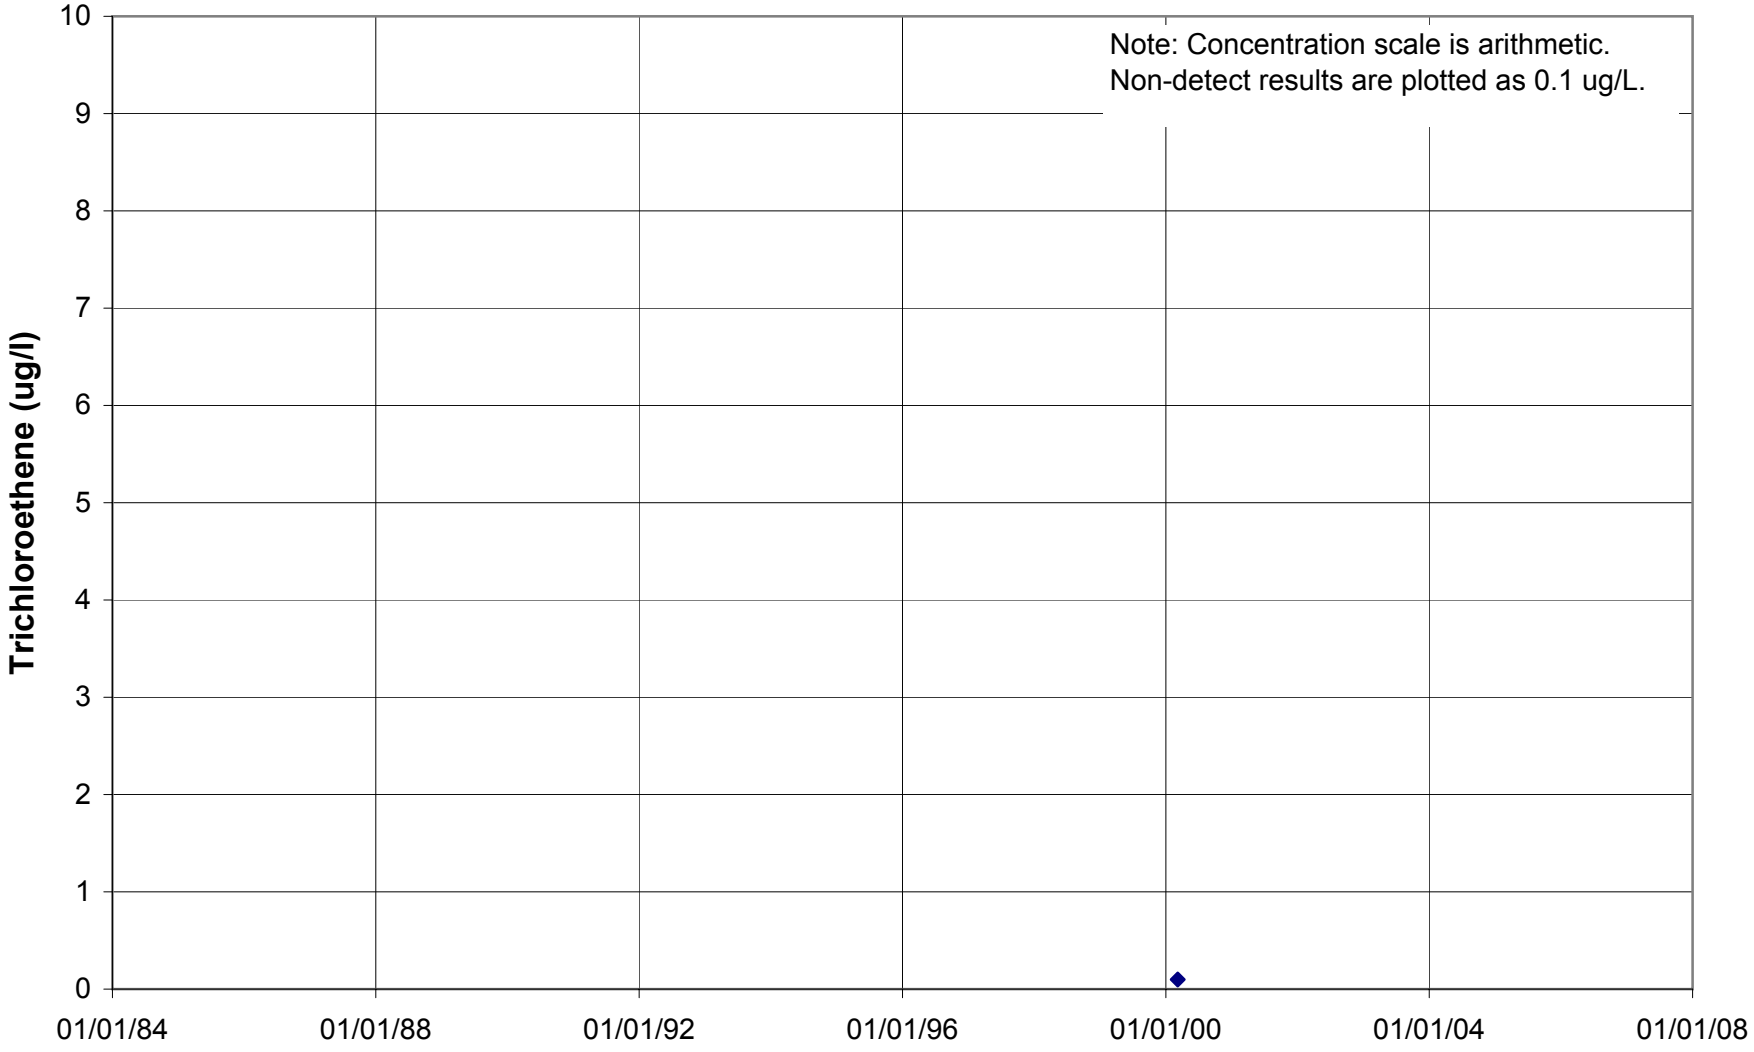

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U636

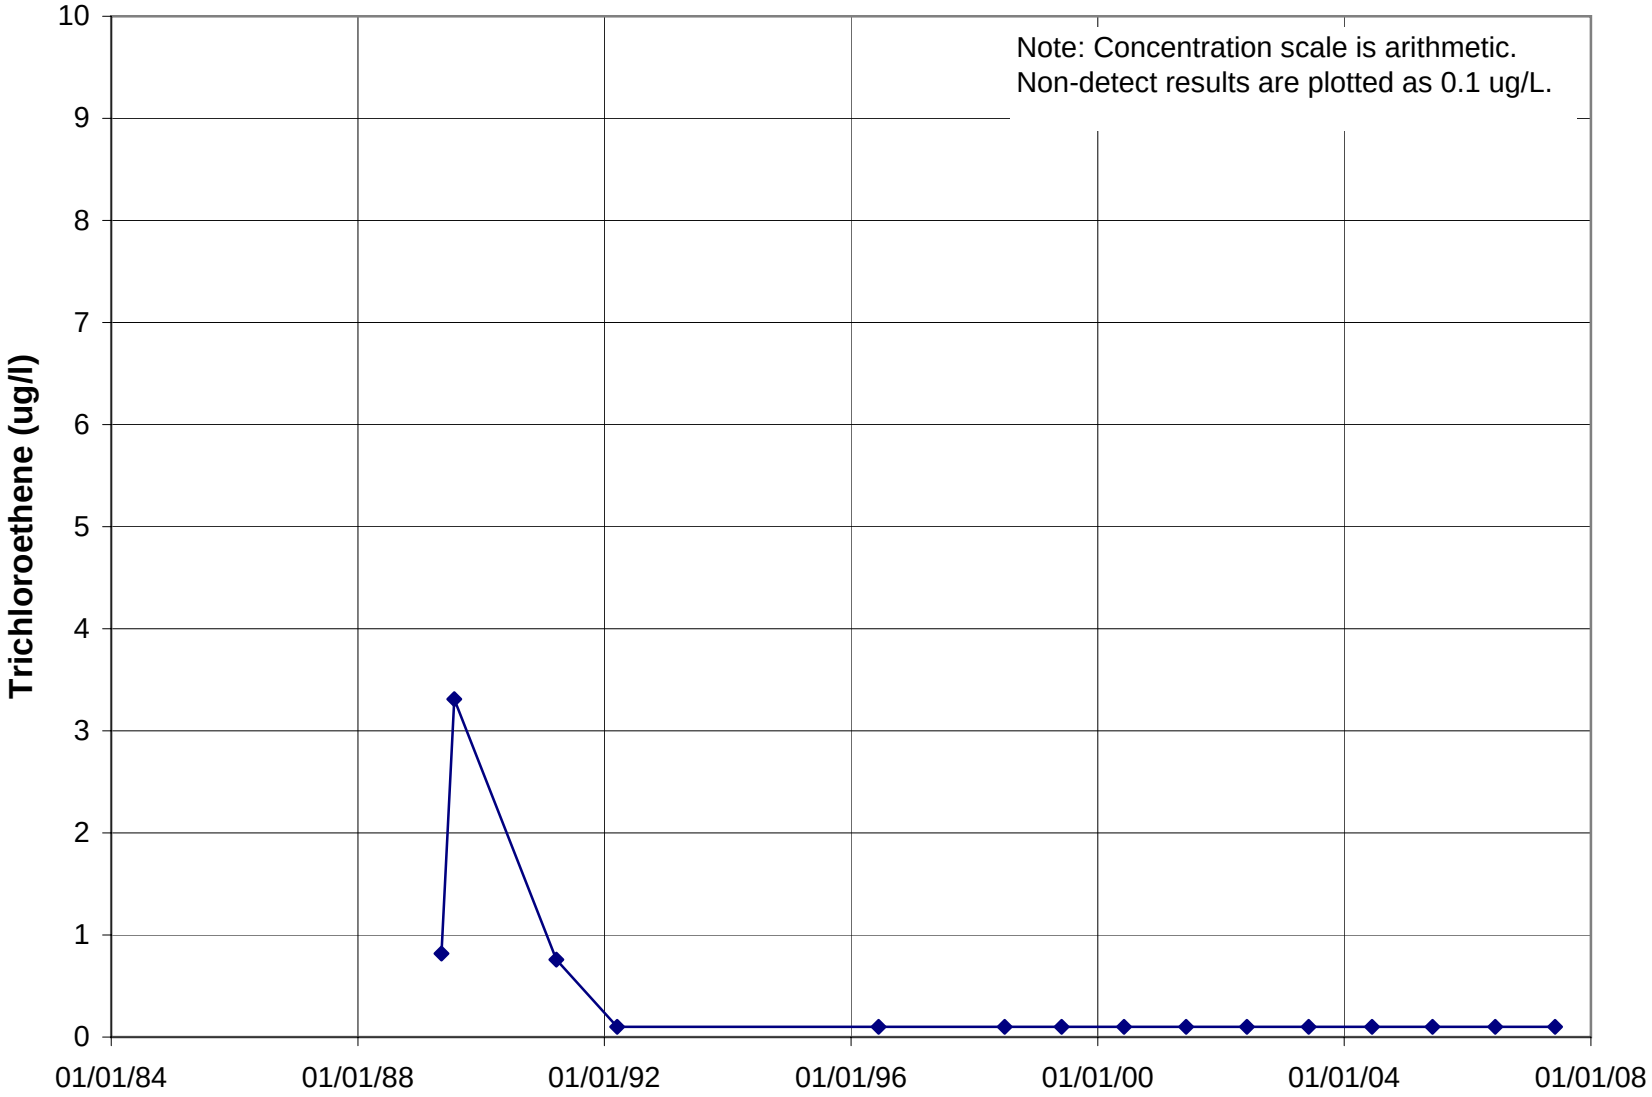

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U639

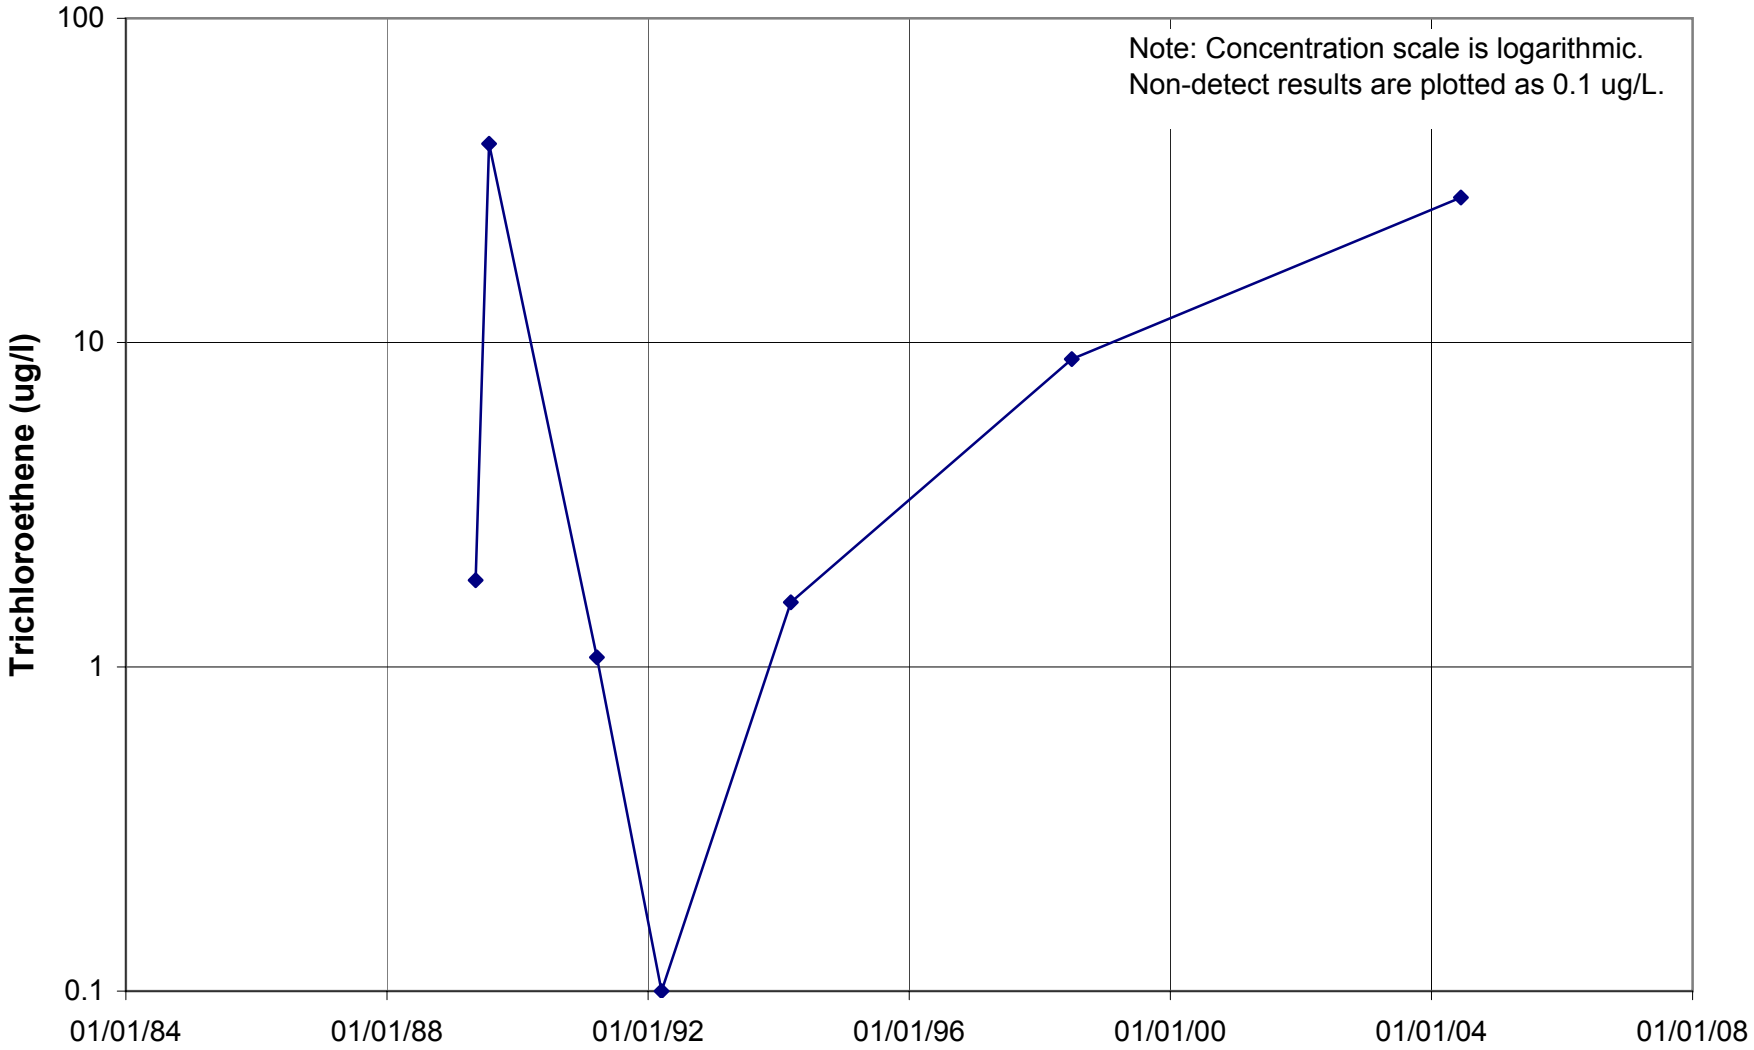

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U640

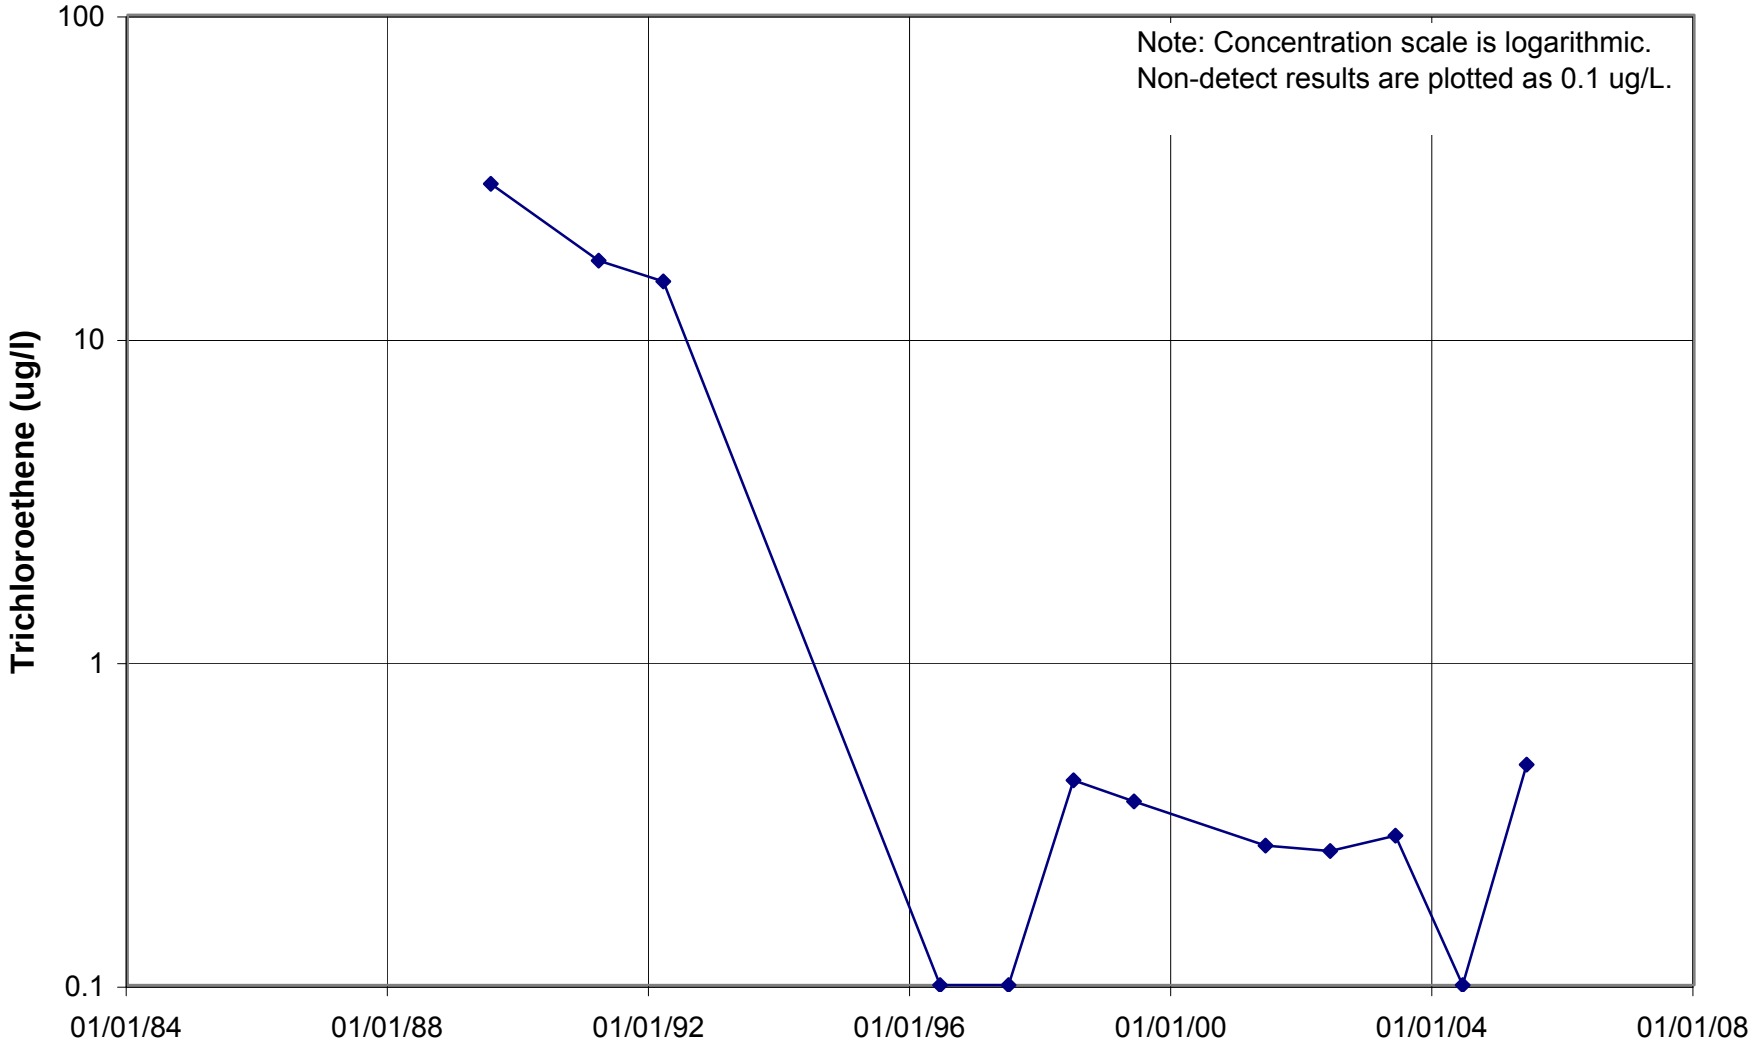

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U666

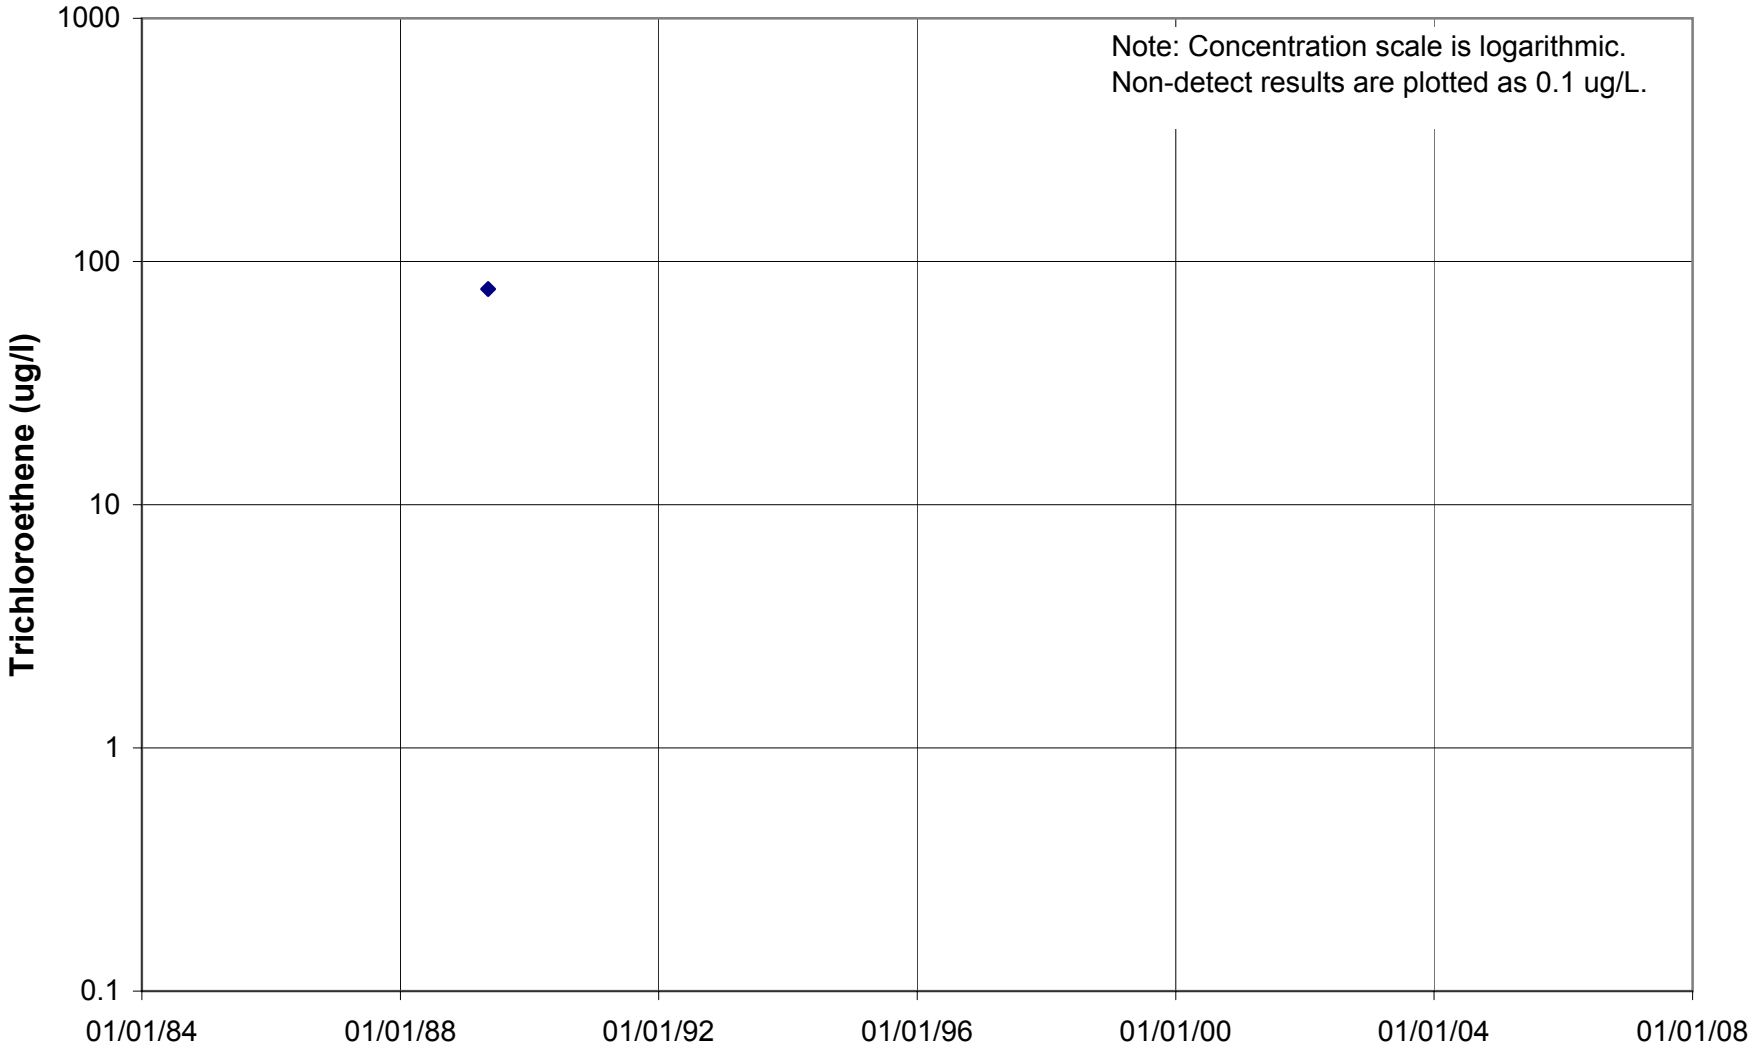

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U667

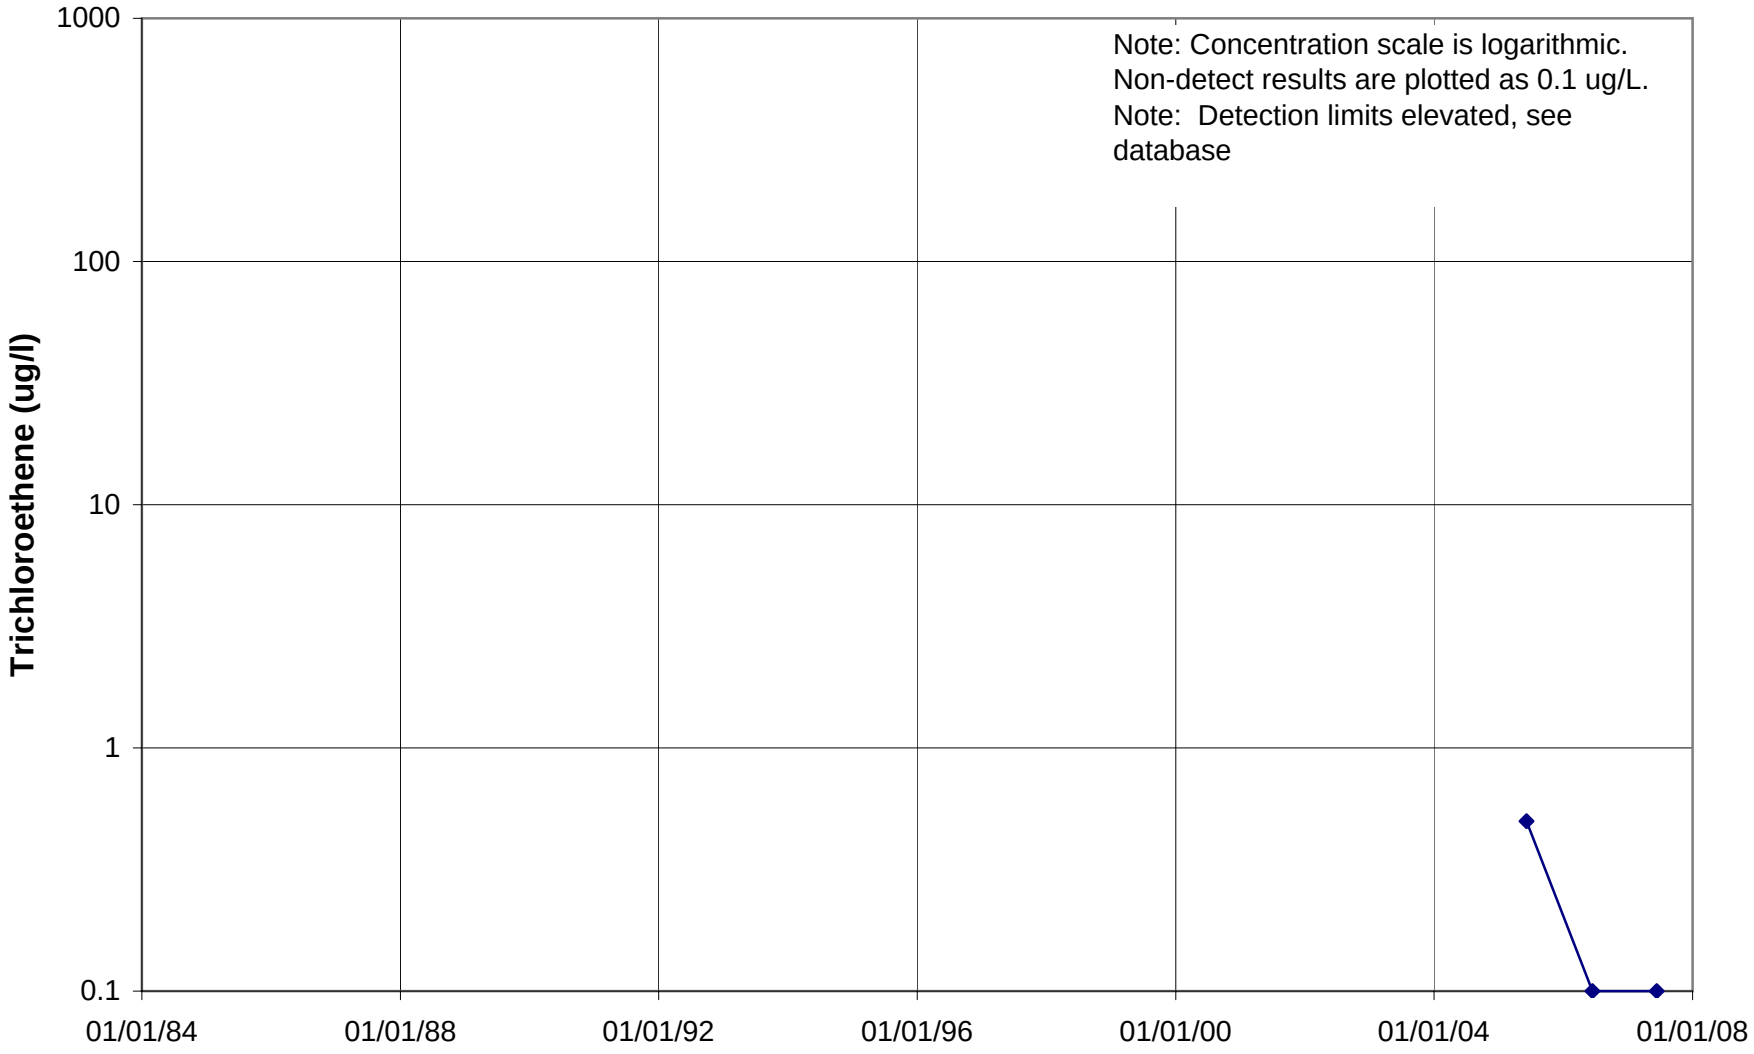

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U901

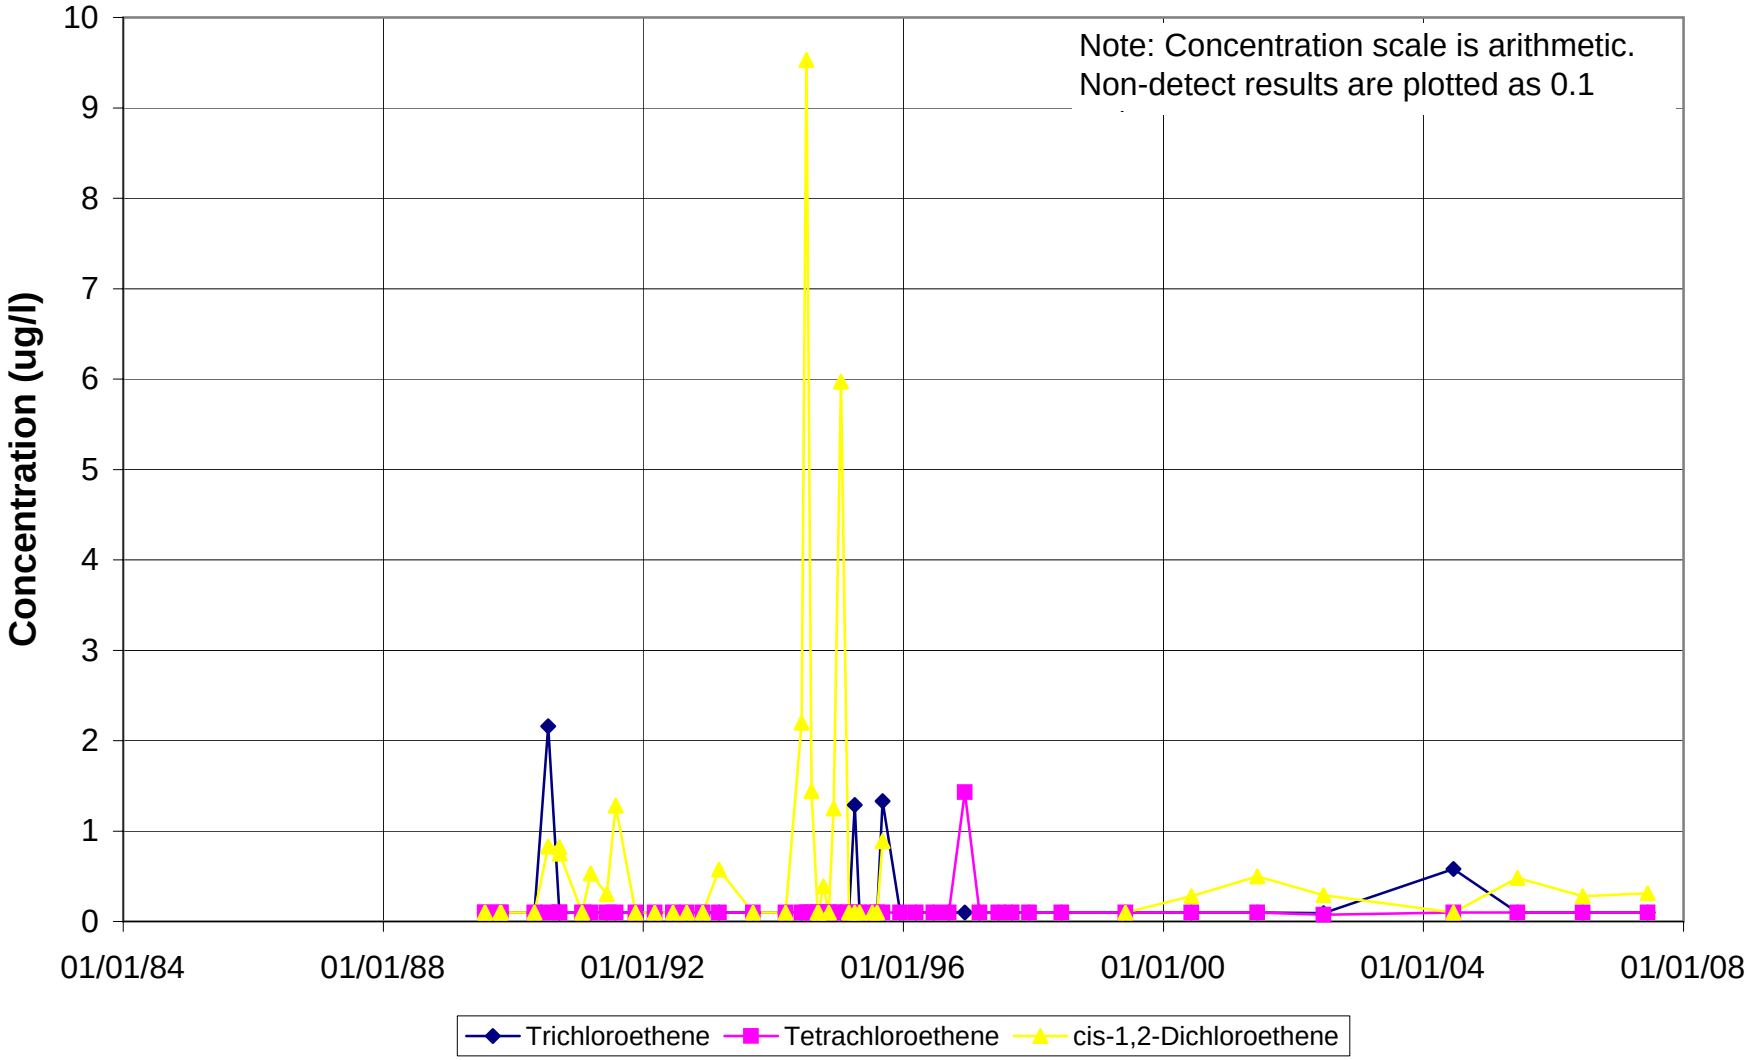

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U902

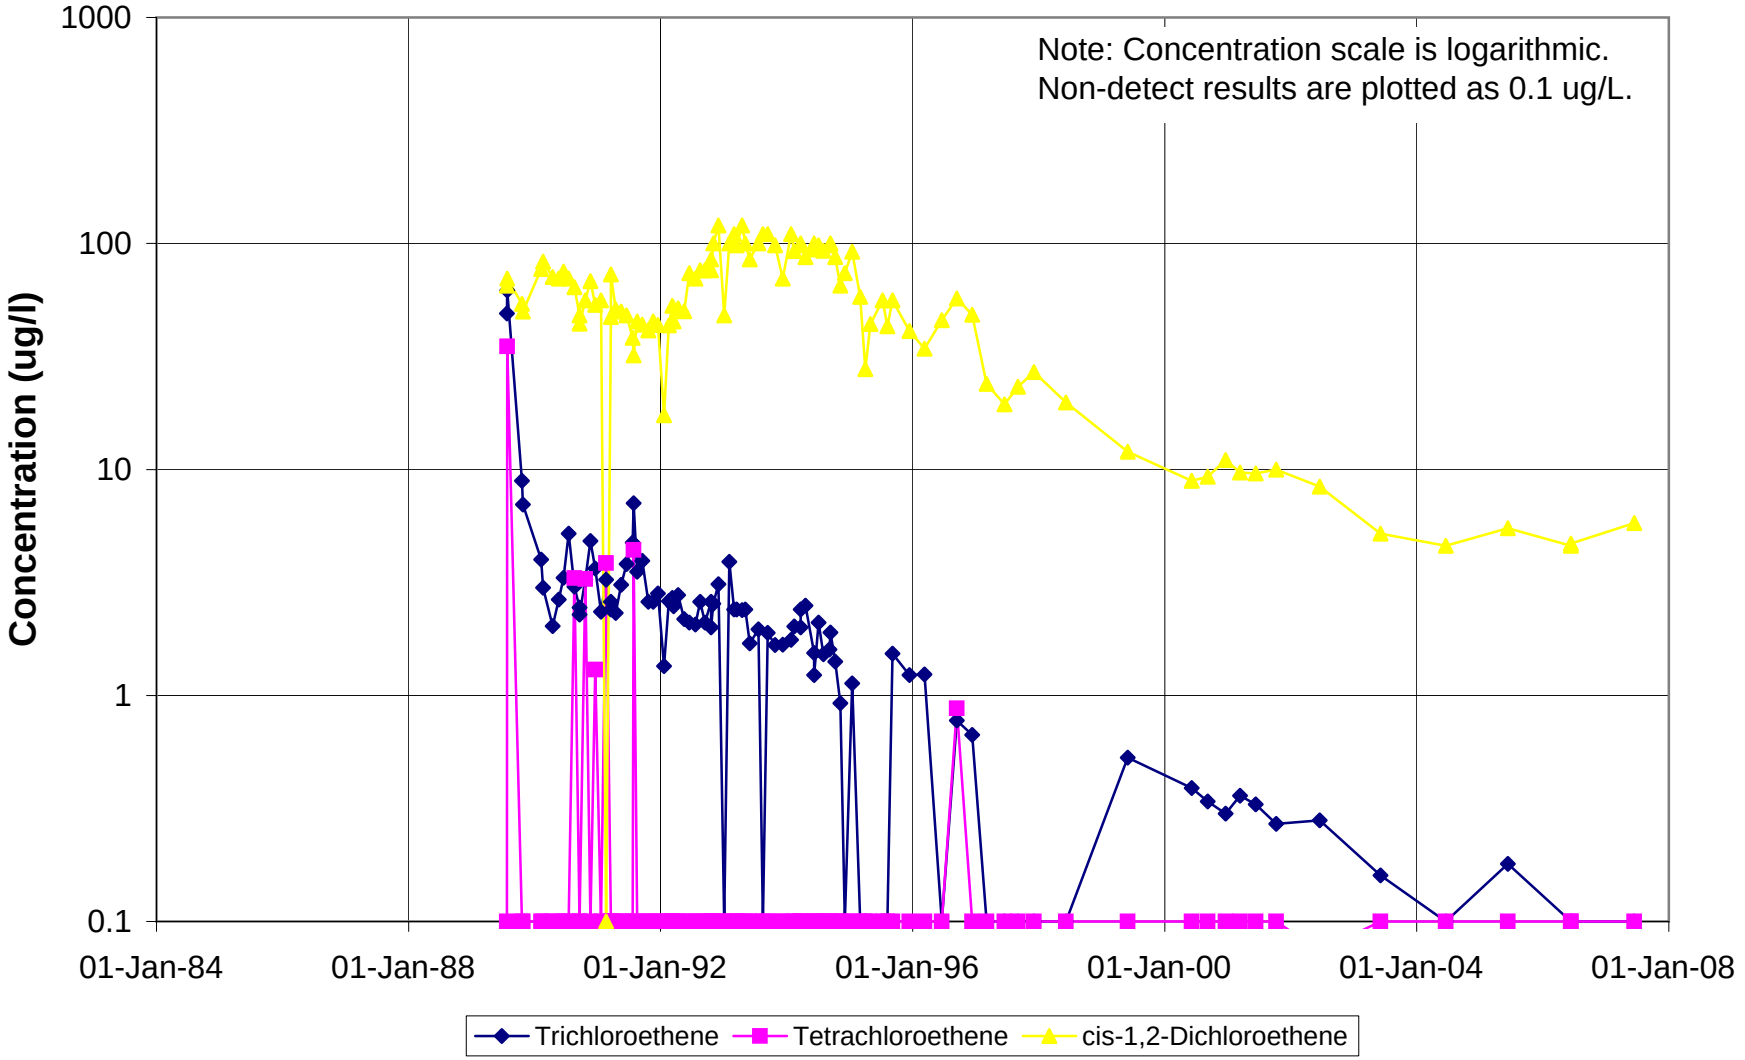

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

01U903

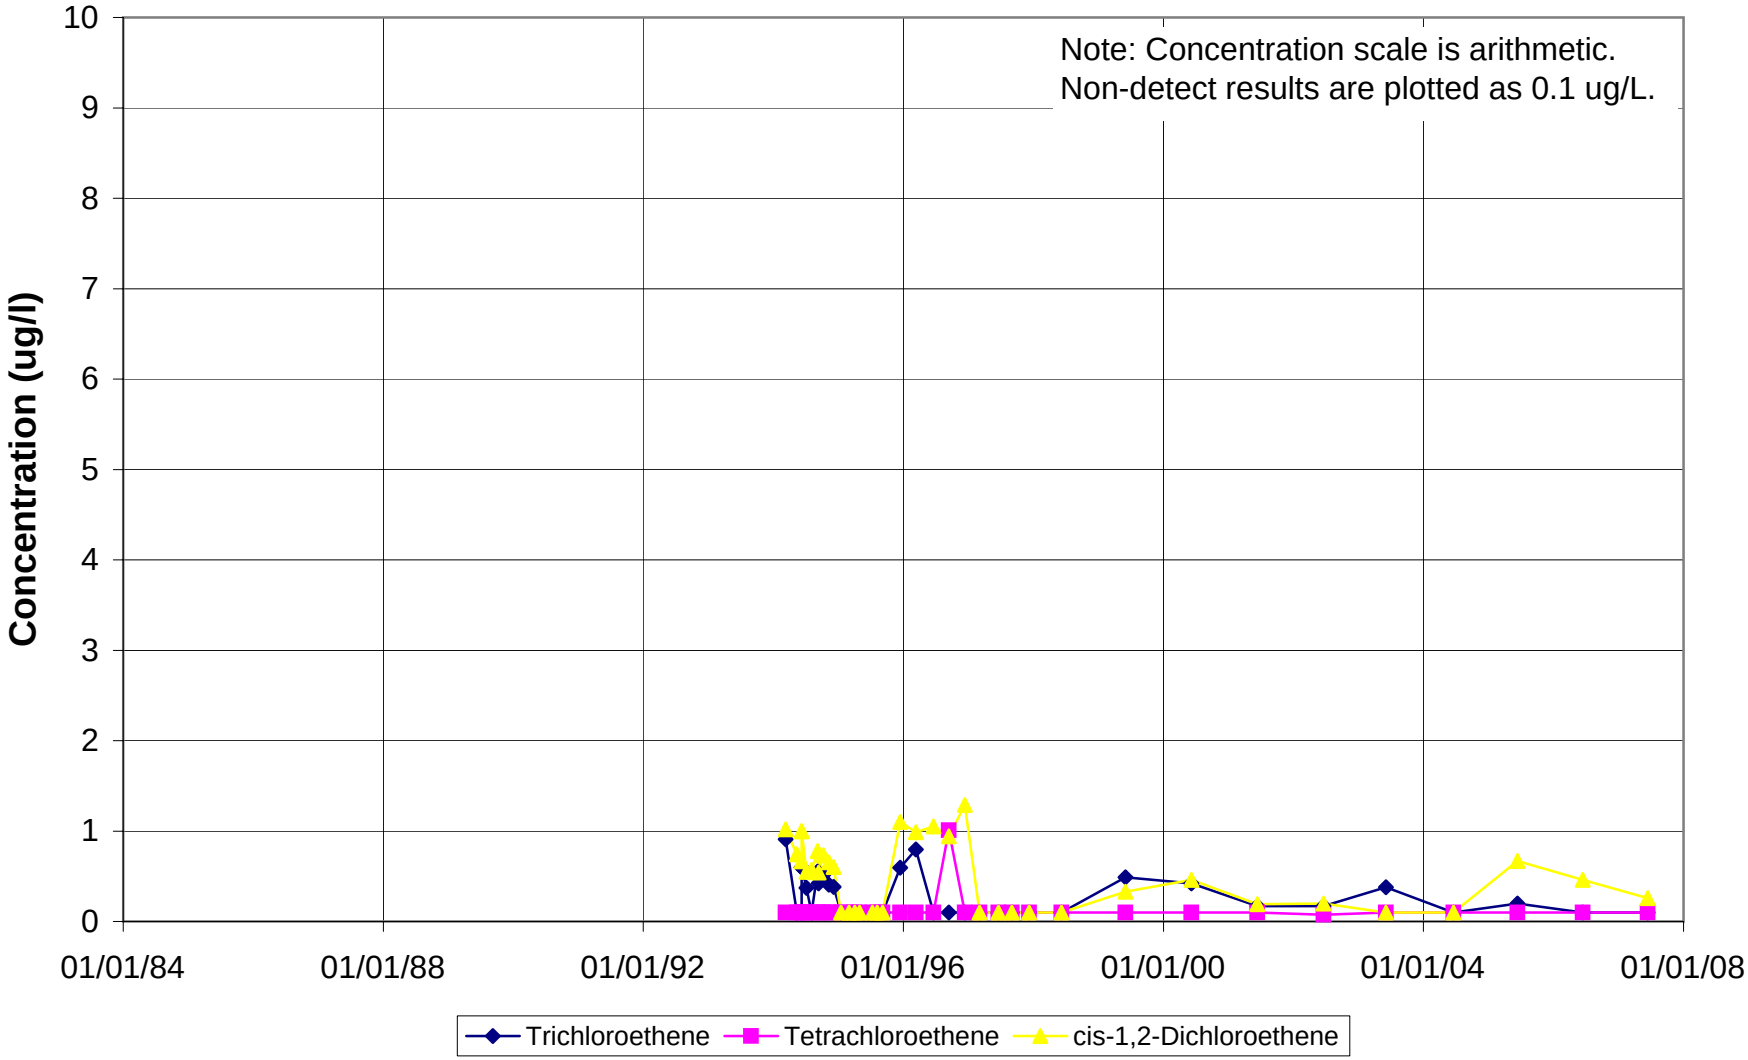

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

01U904

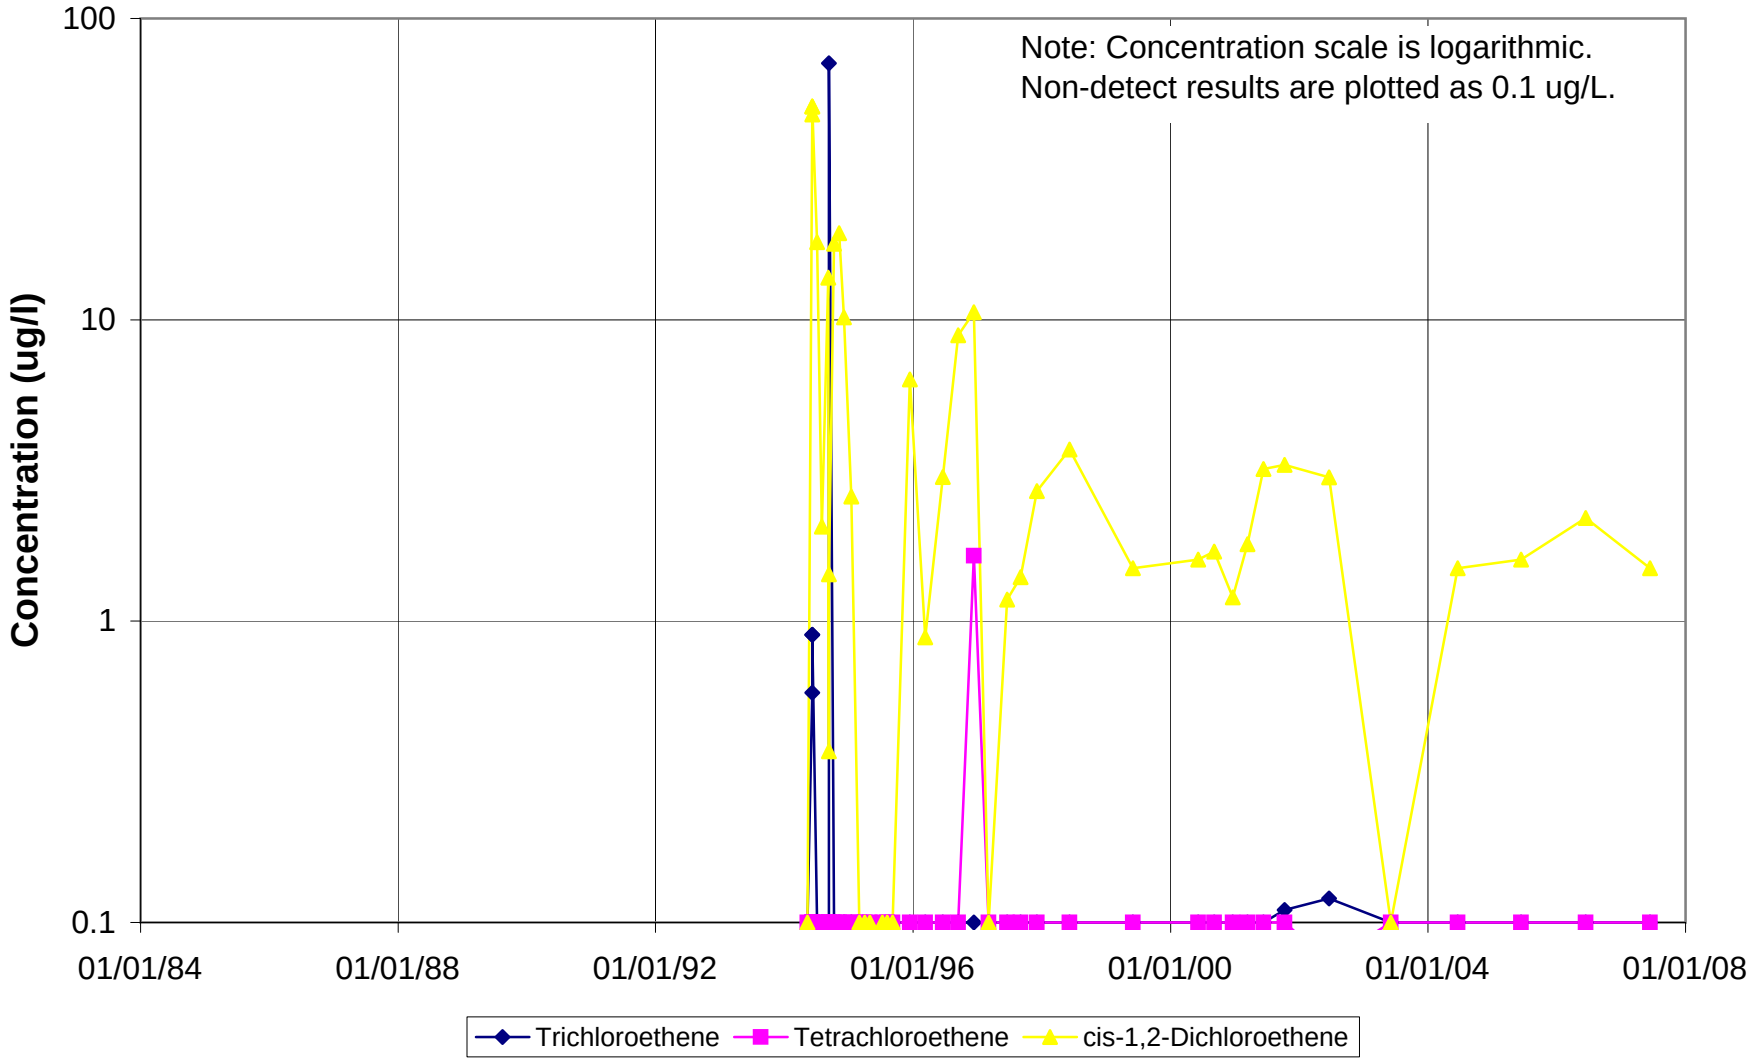

TO RETURN TO MAP: Click on "Go to Previous View" Button in the Tool Bar

03F302 (B1)

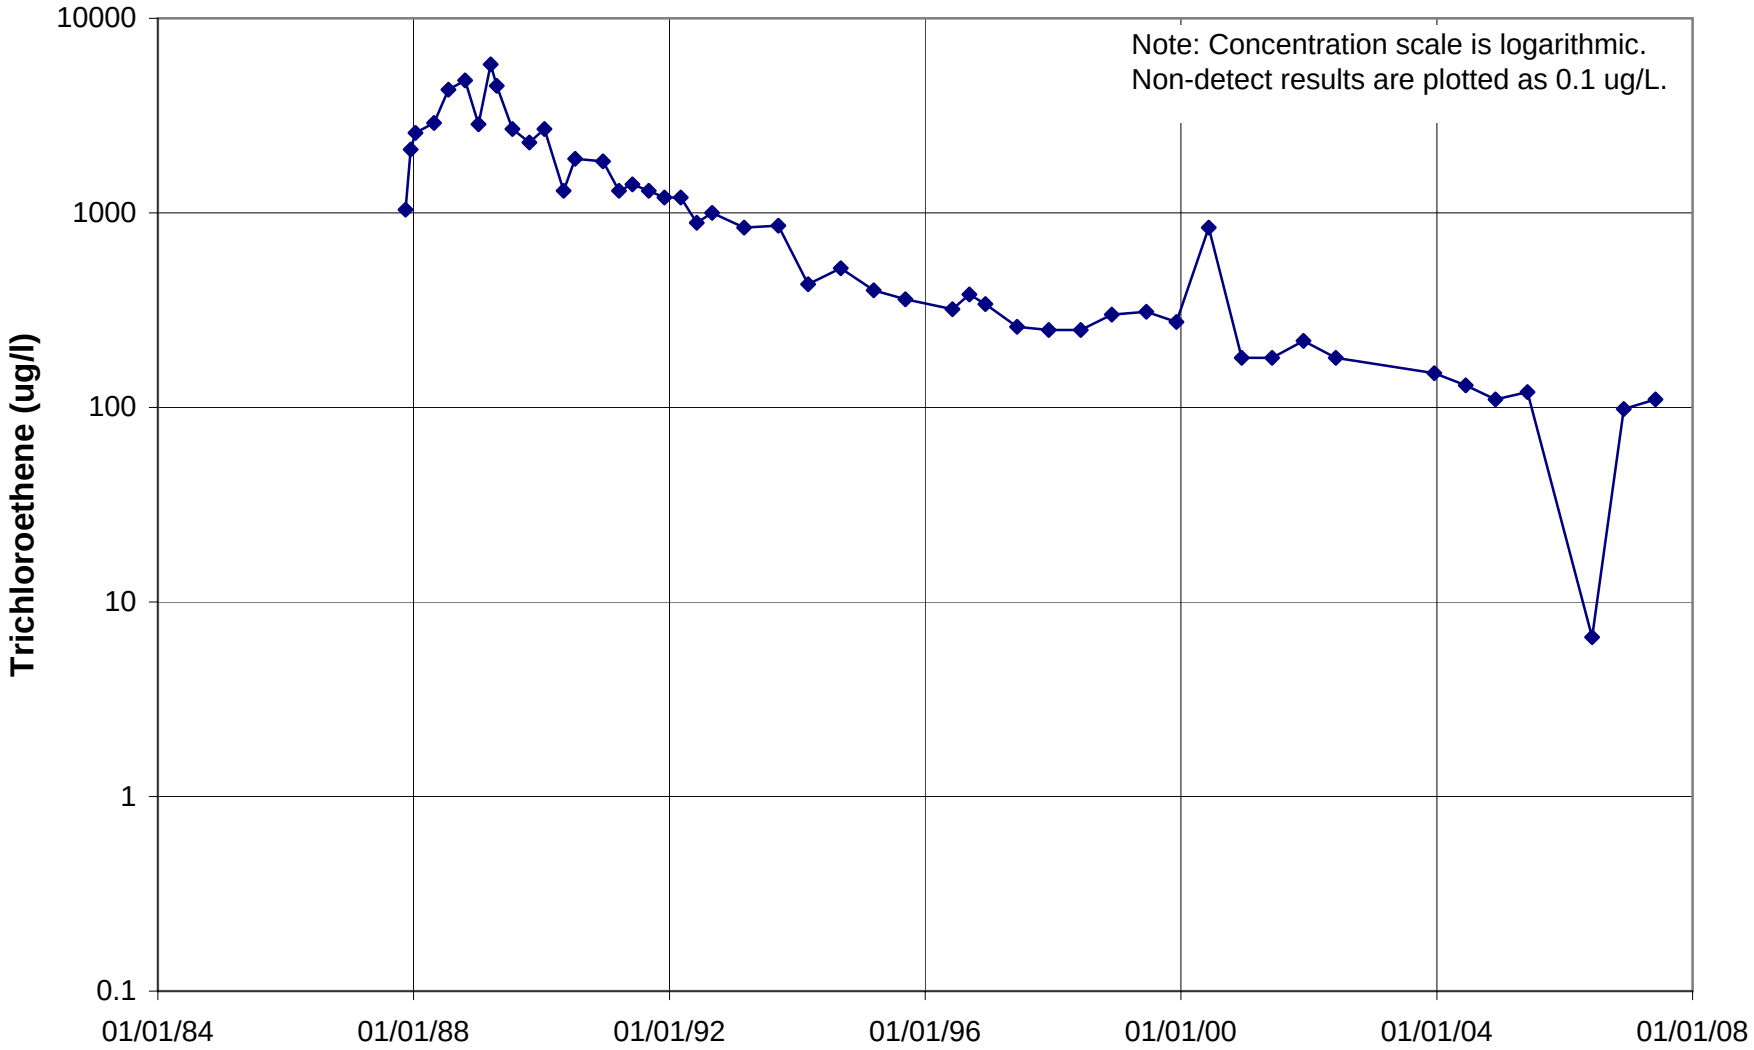

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03F303 (B2)

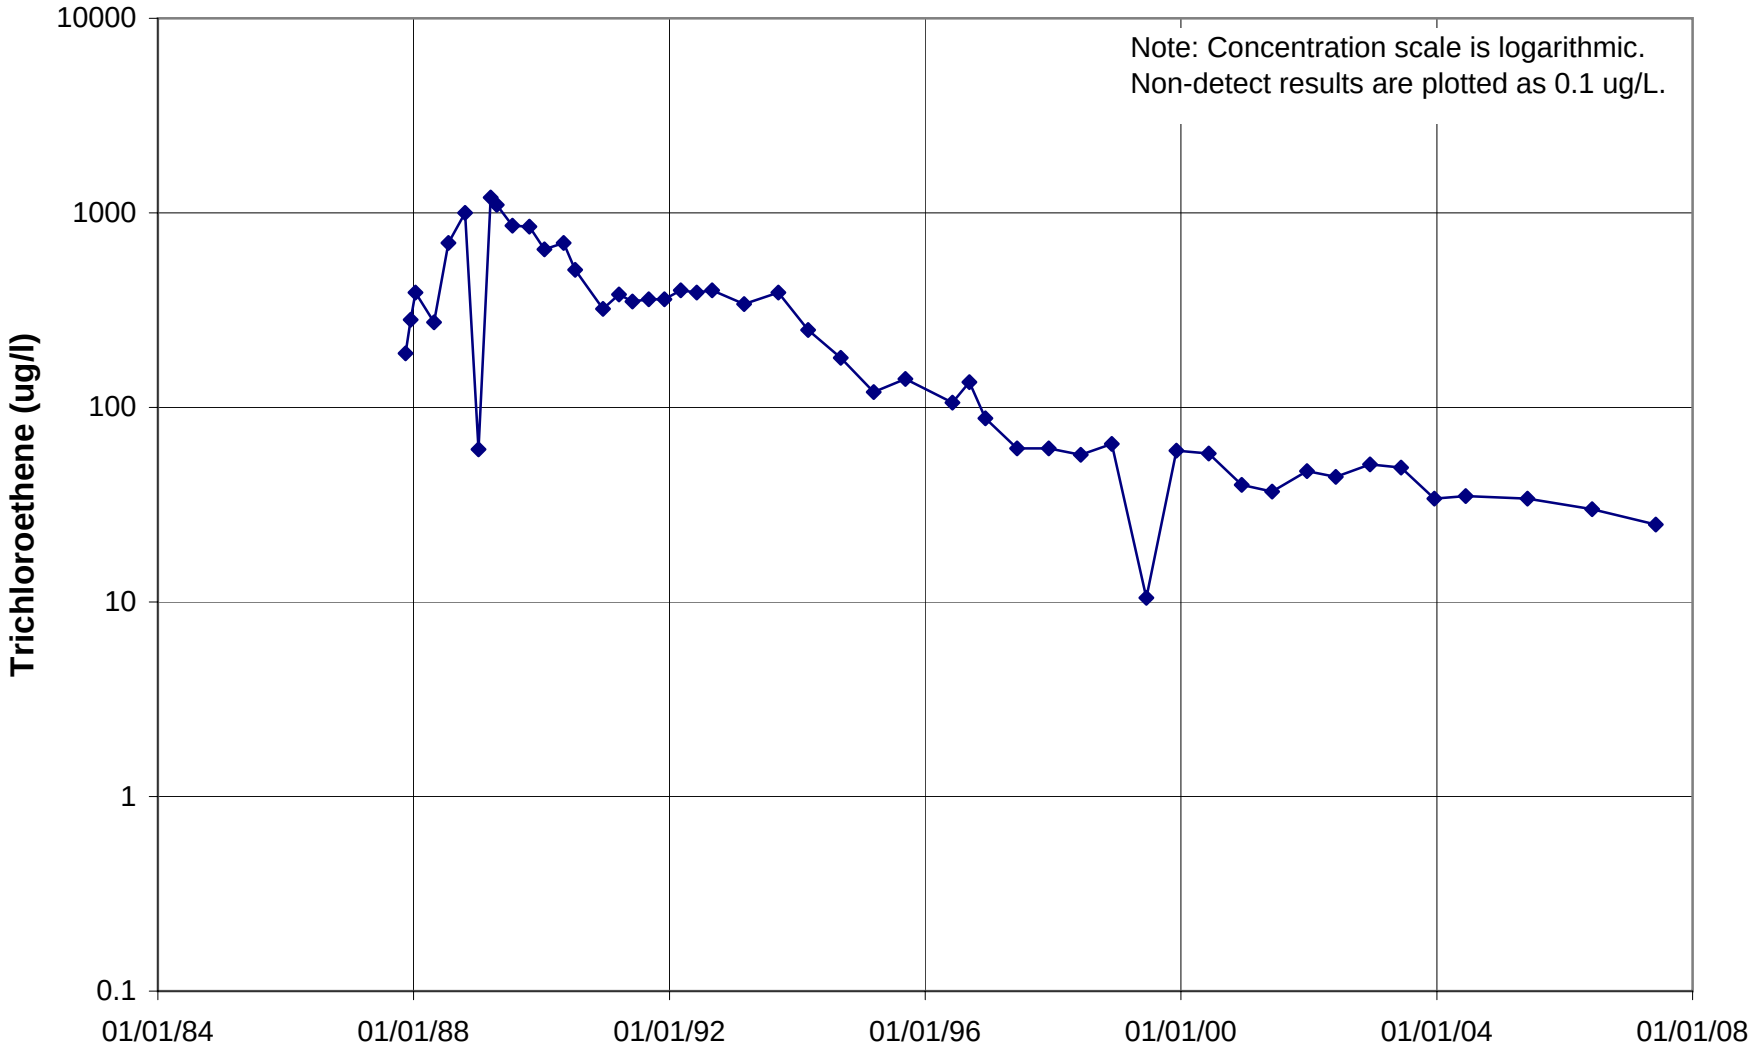

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03F304 (B3)

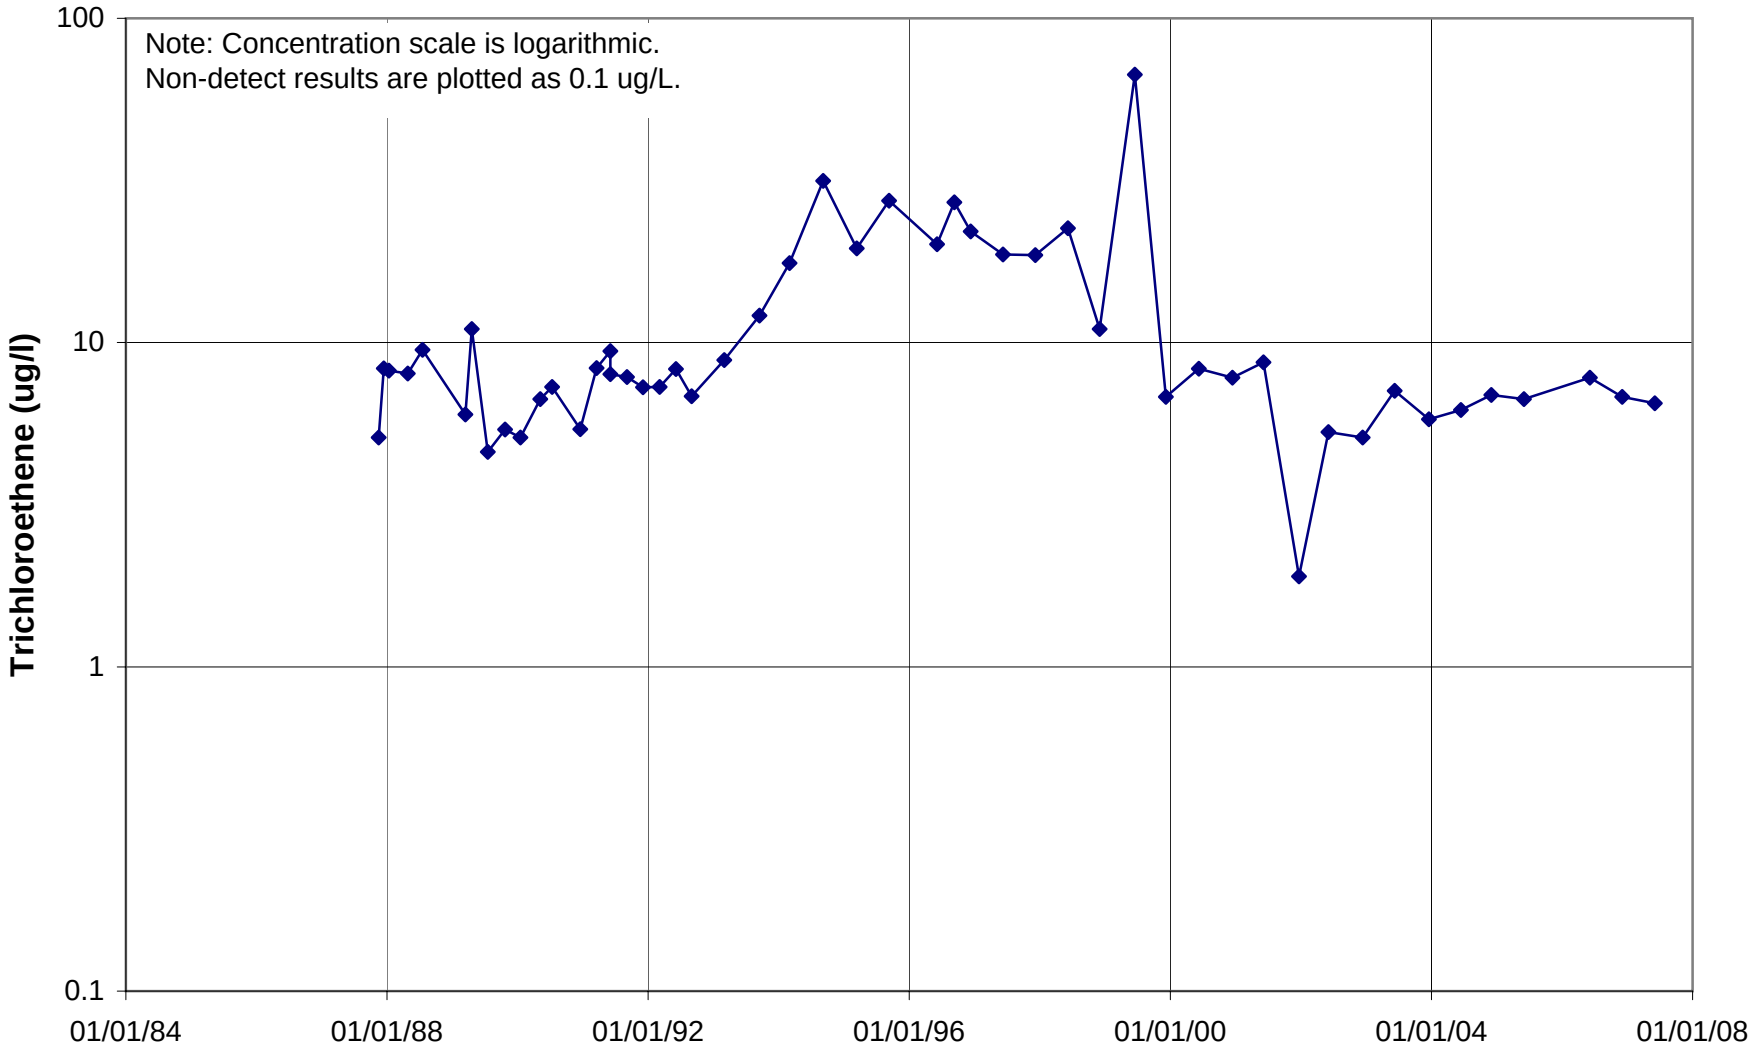

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03F305 (B4)

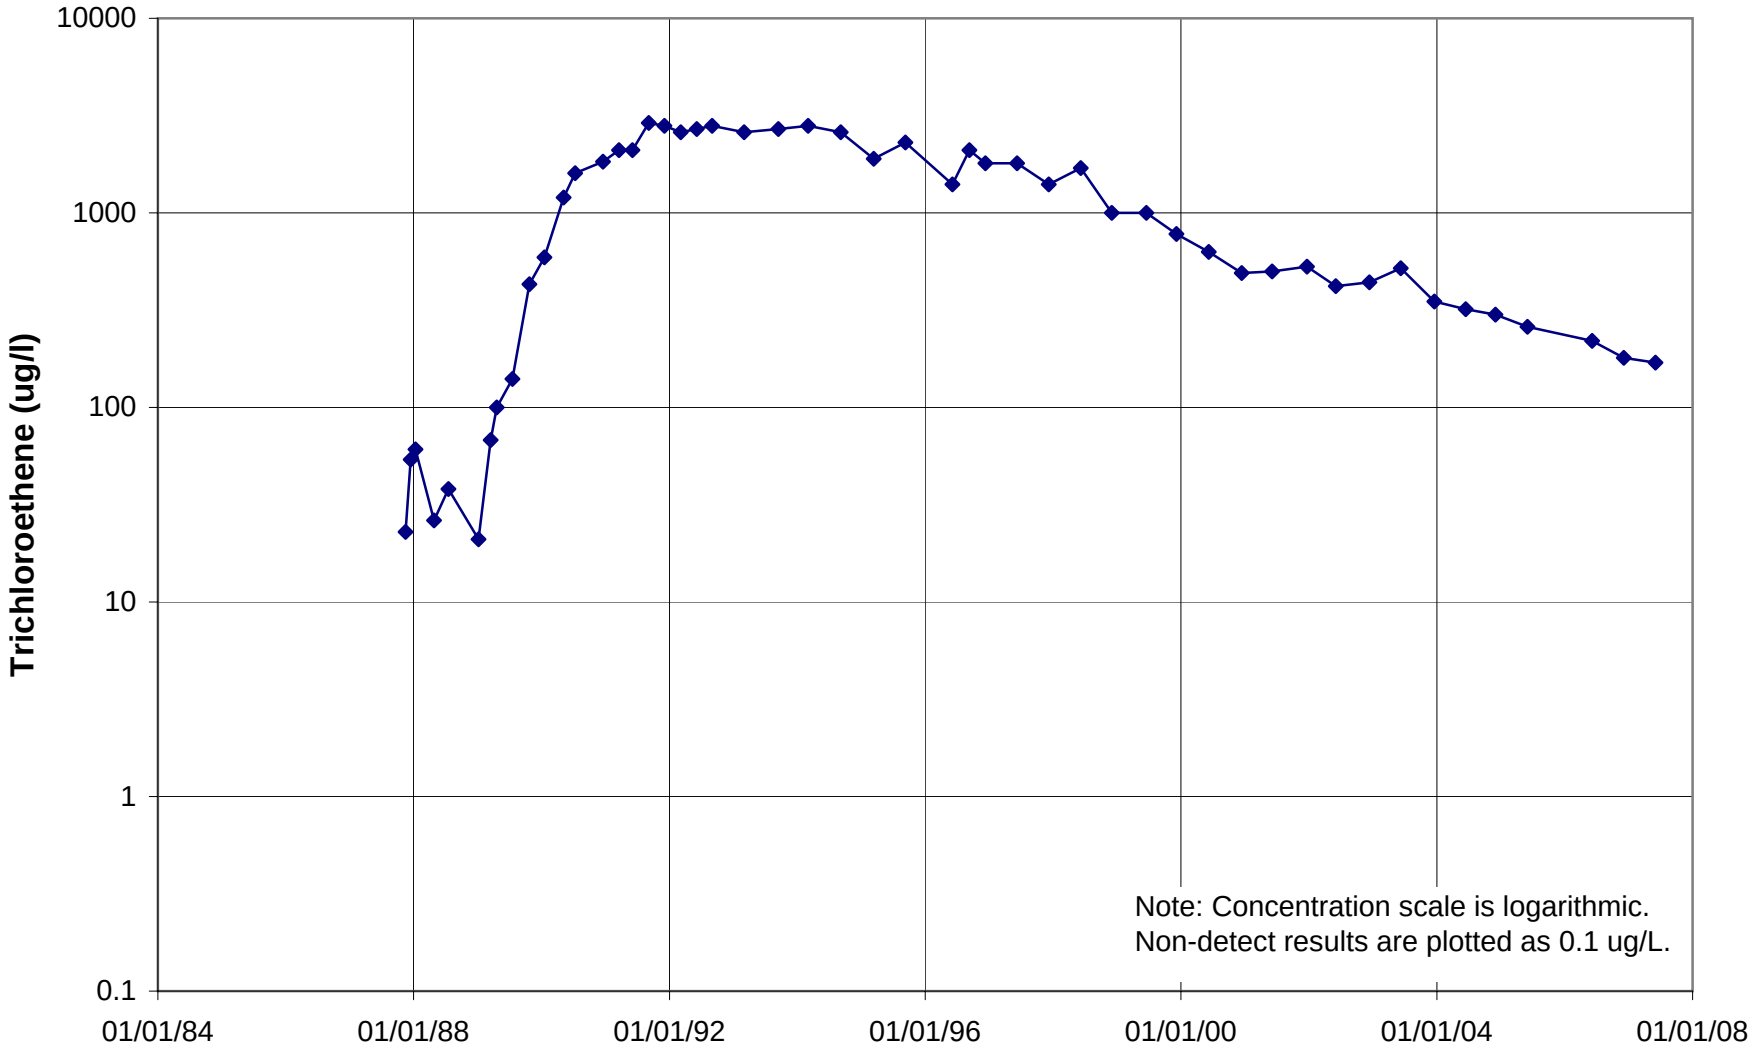

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03F306 (B5)

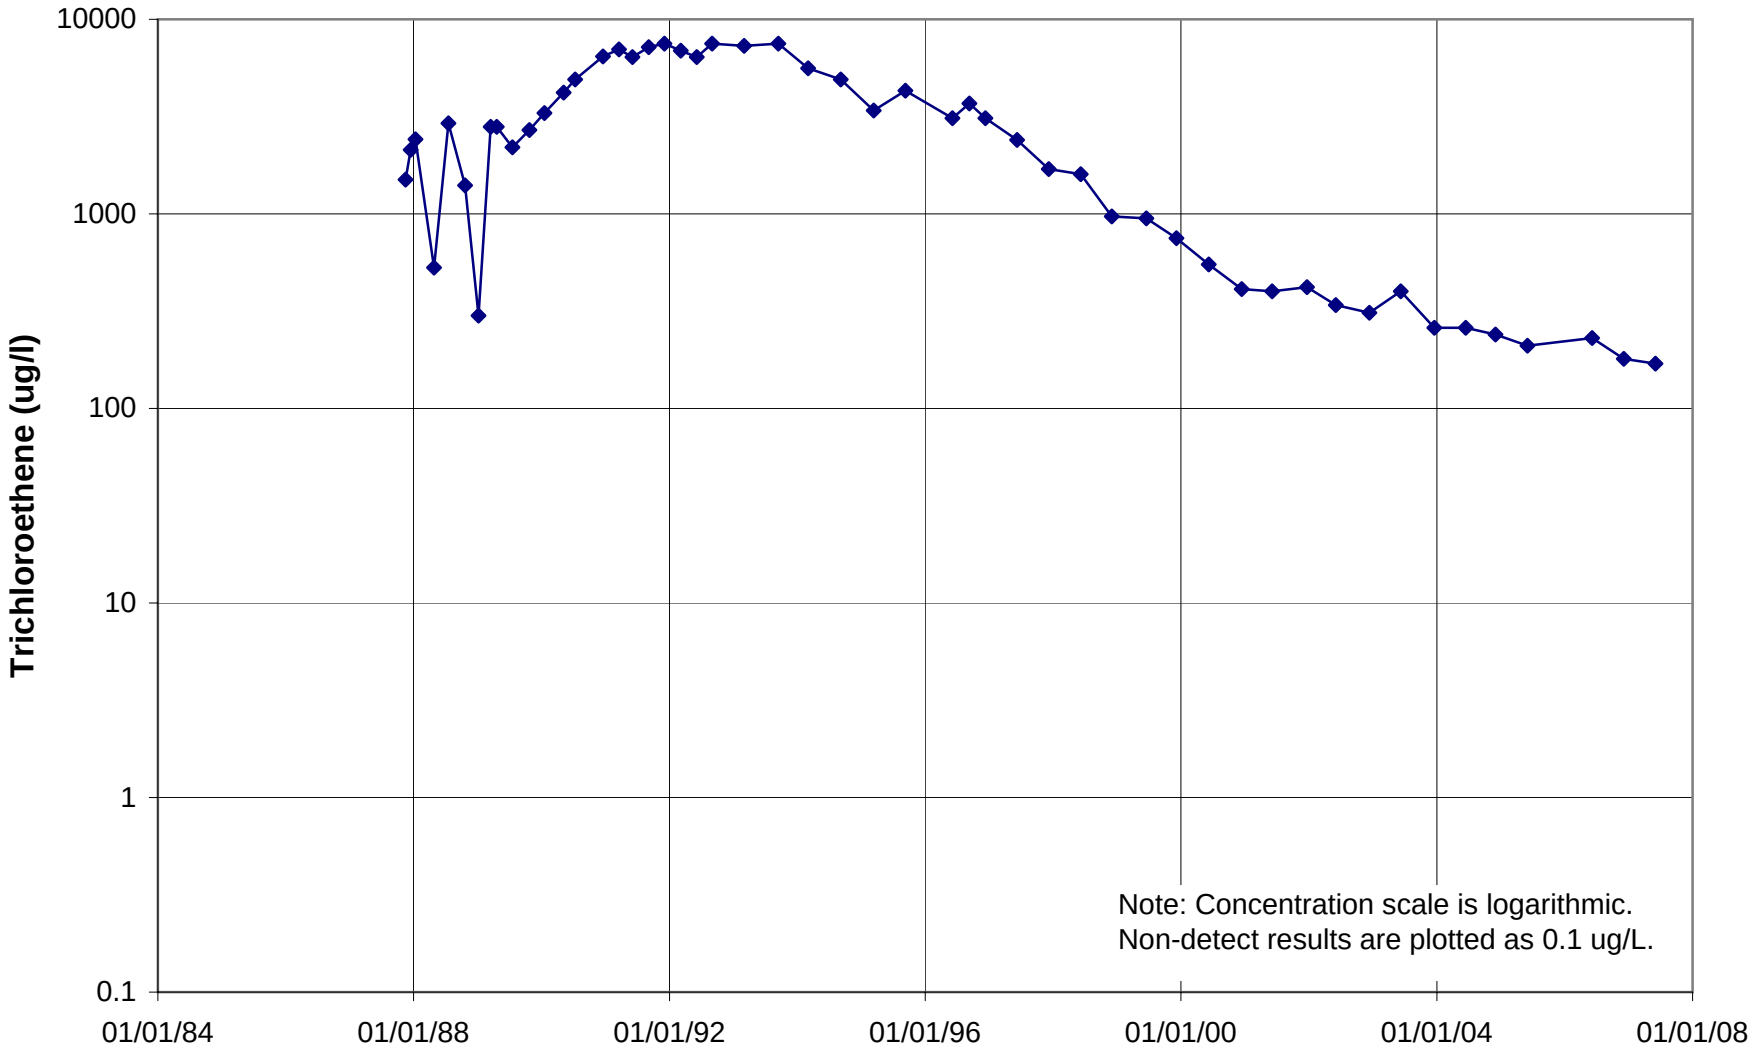

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03F307 (B6)

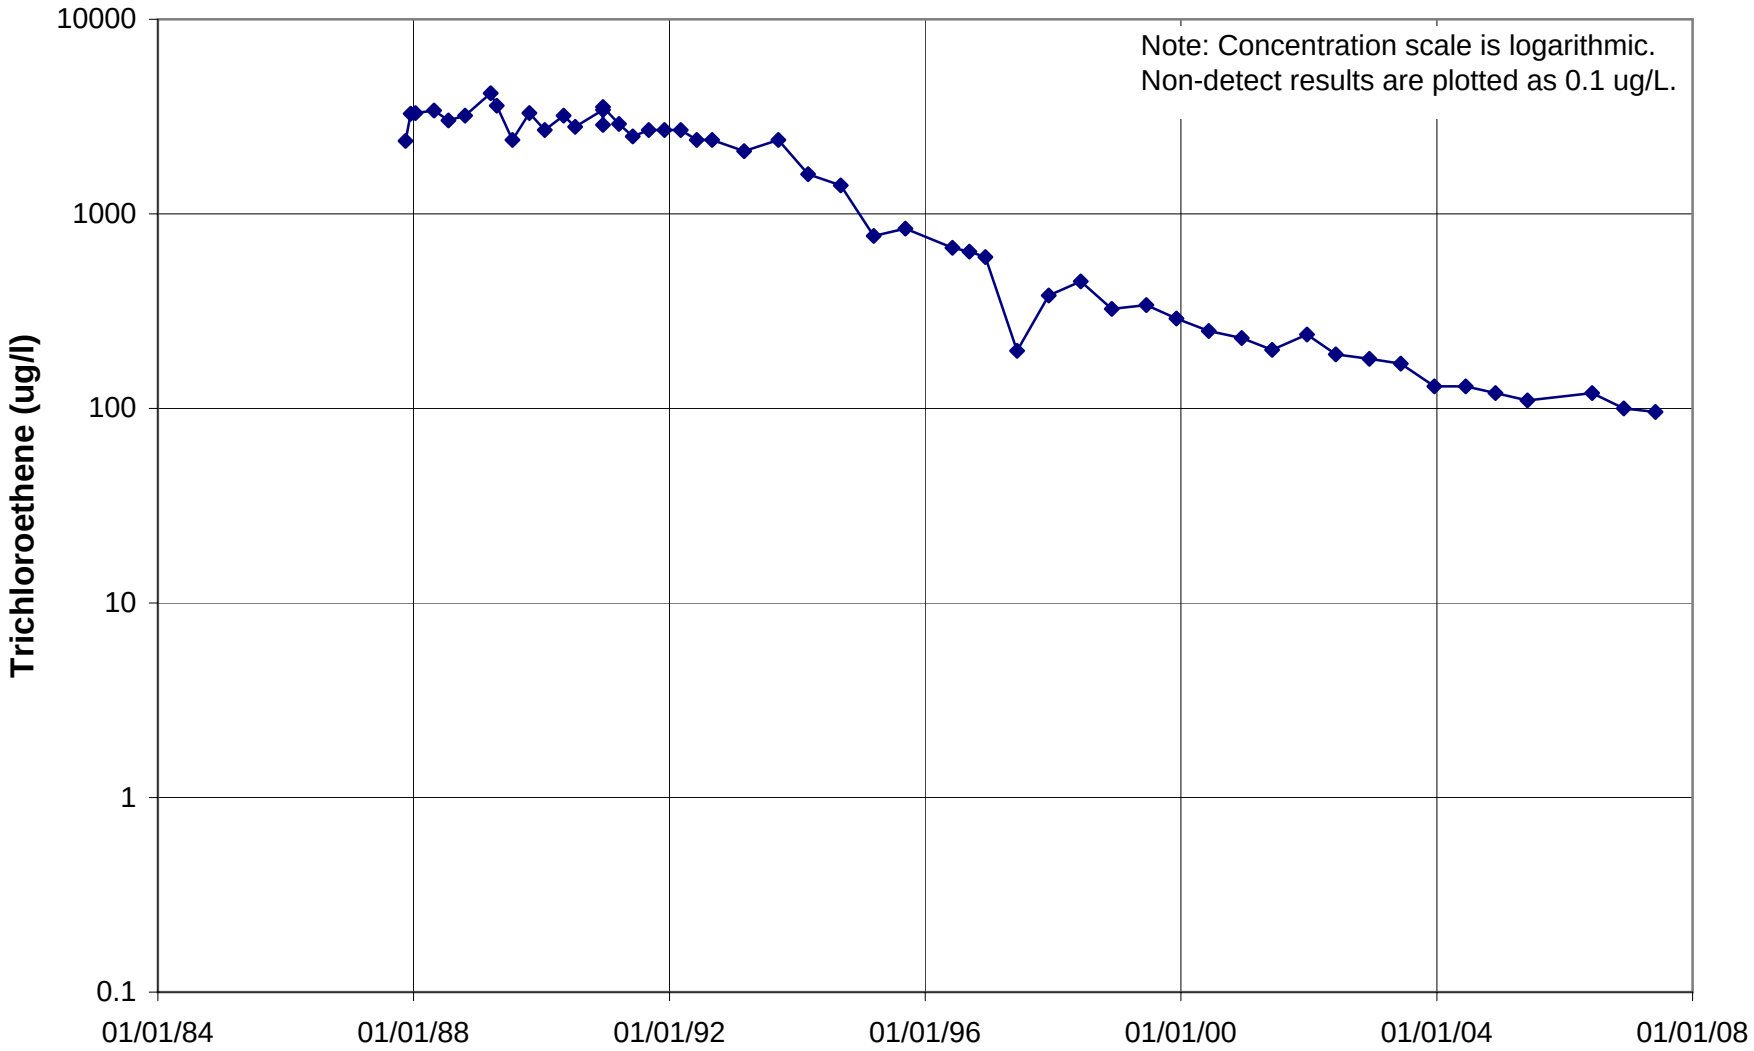

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03F308 (B7)

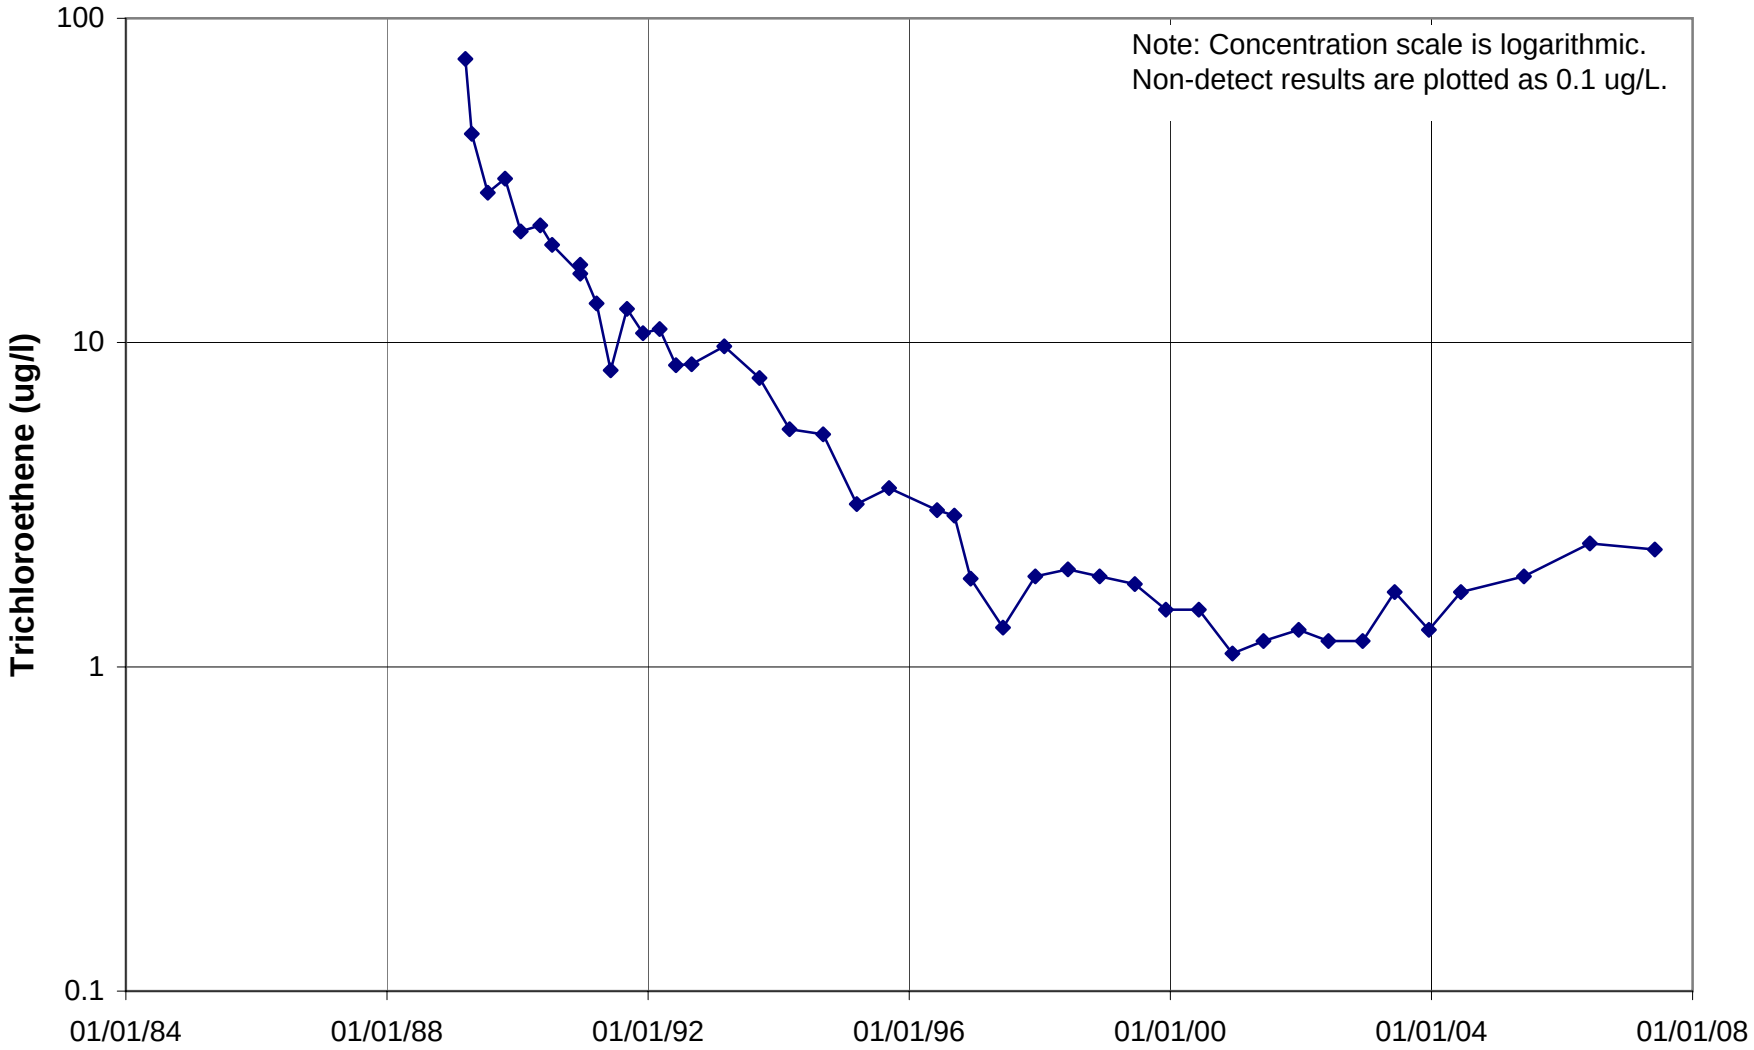

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03F312 (B11)

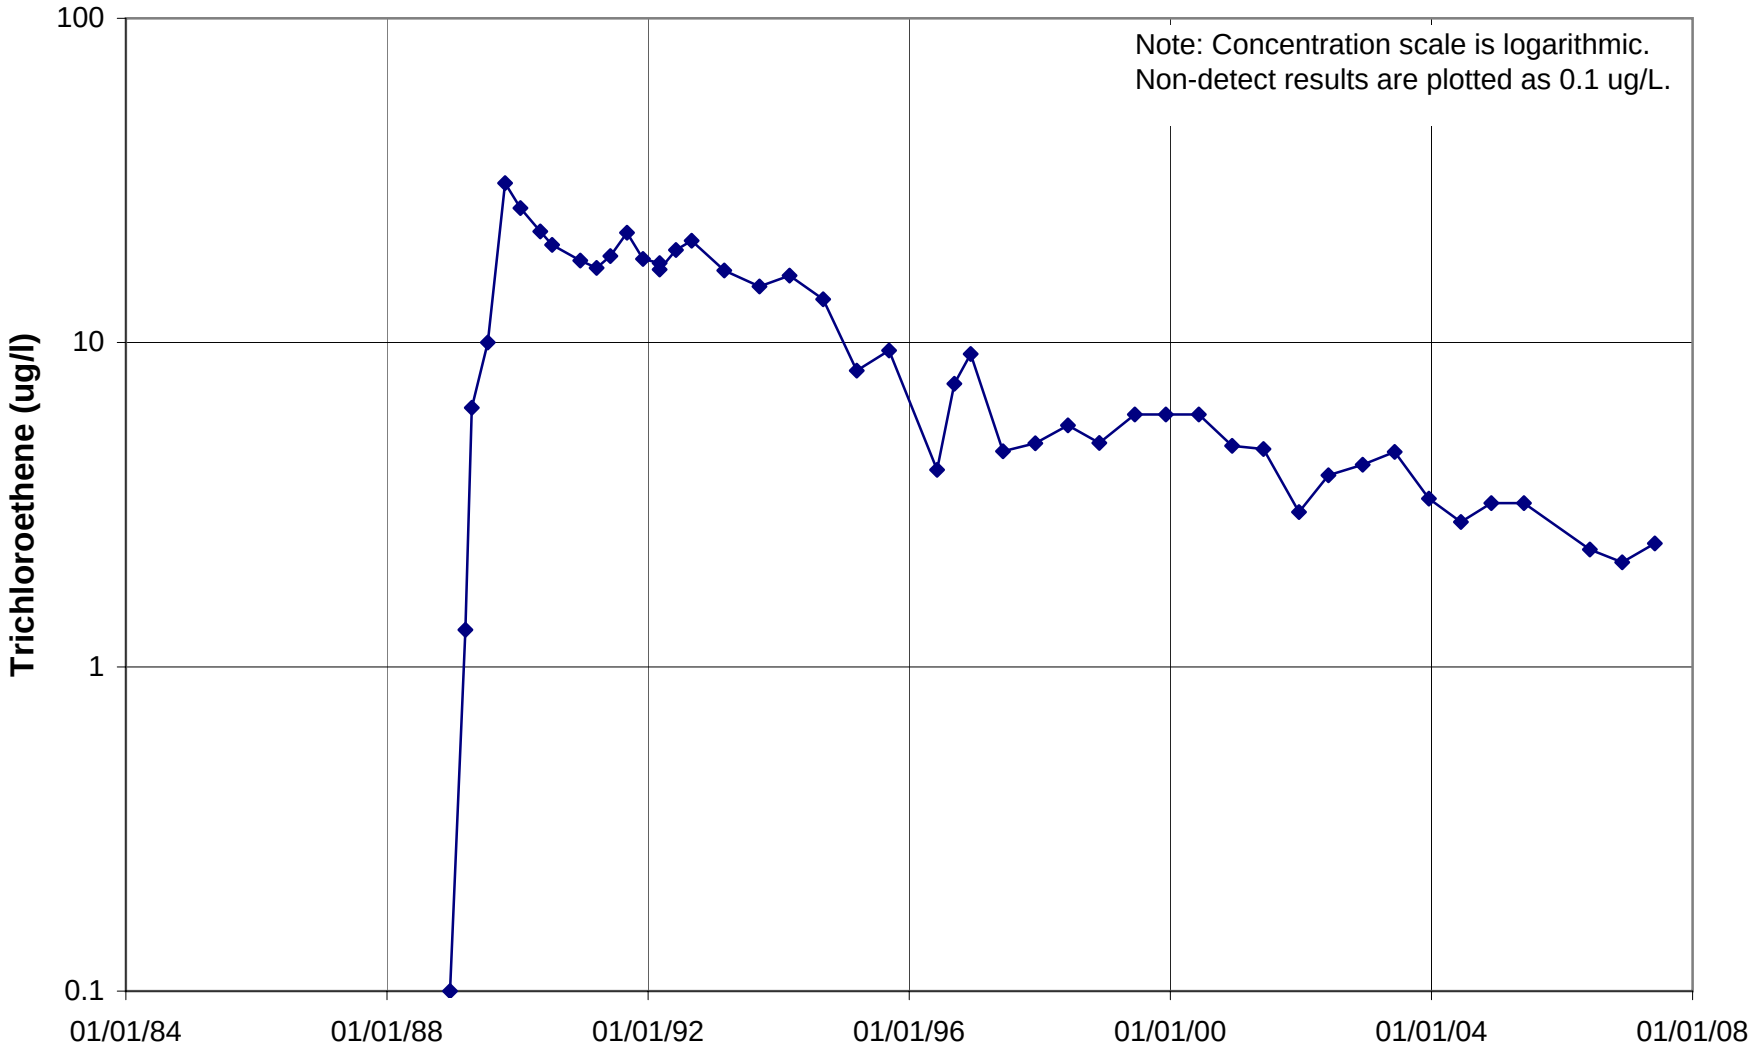

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03F319 (B13)

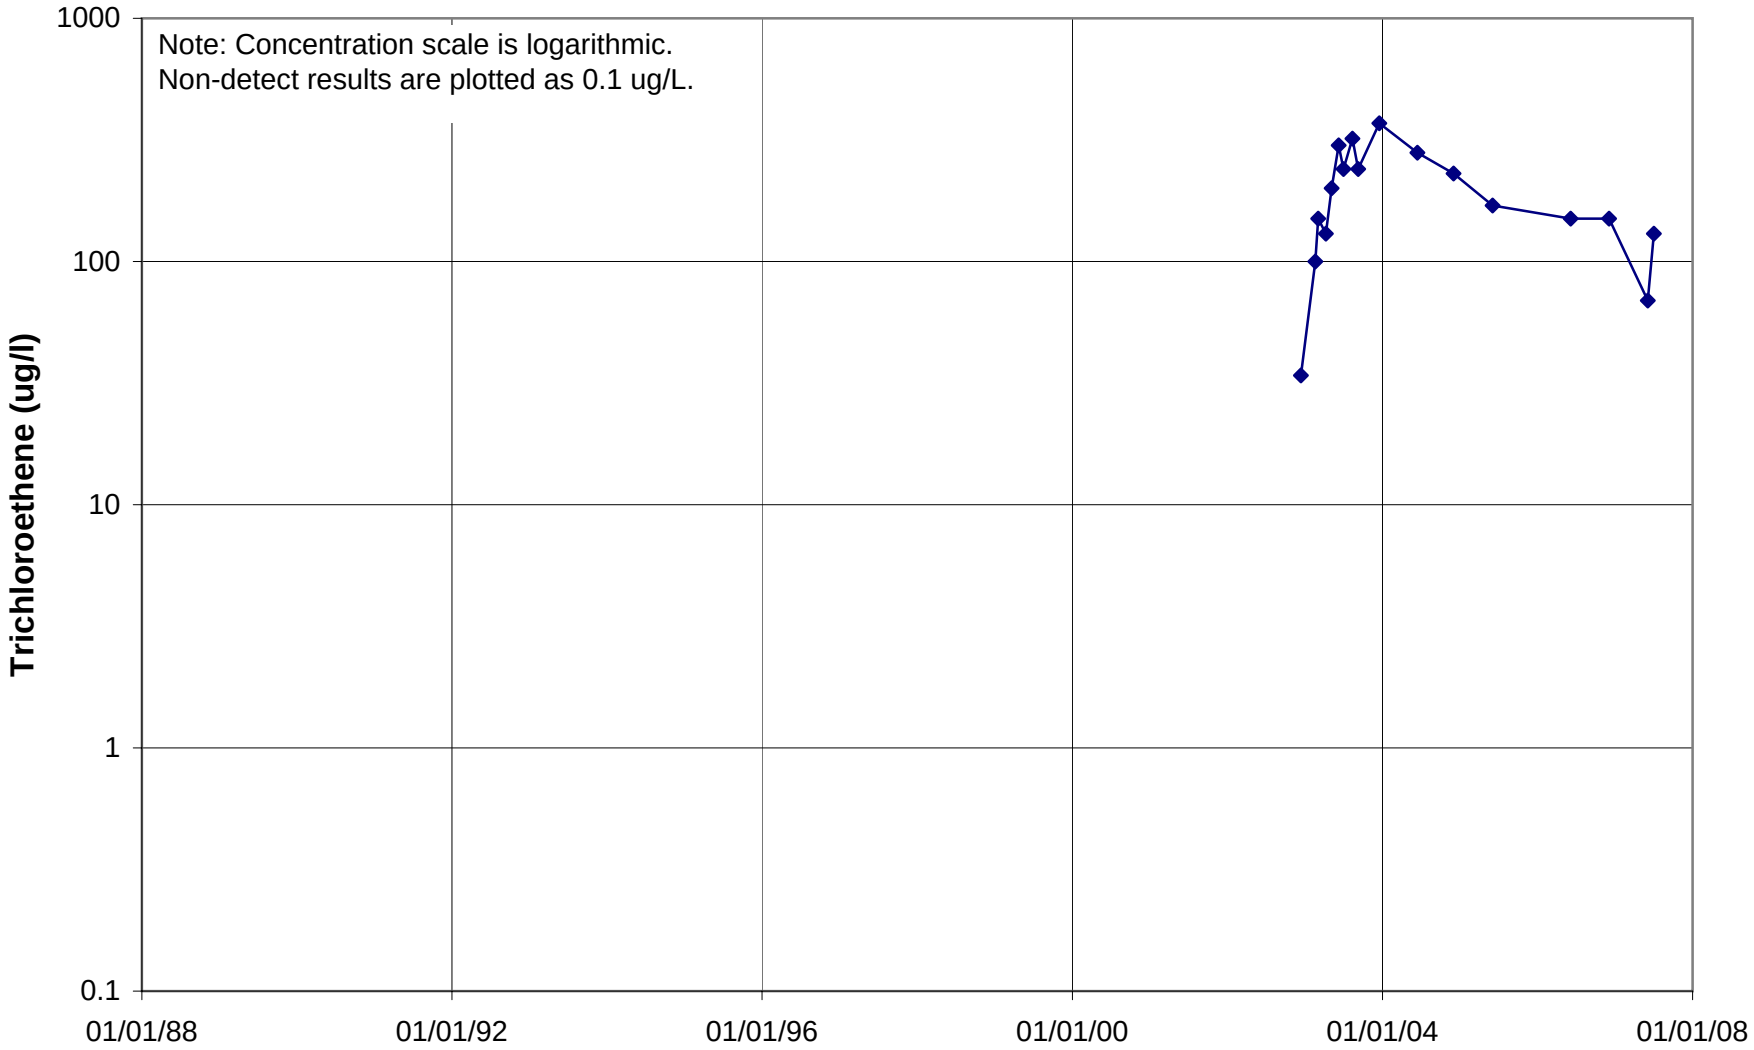

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L001

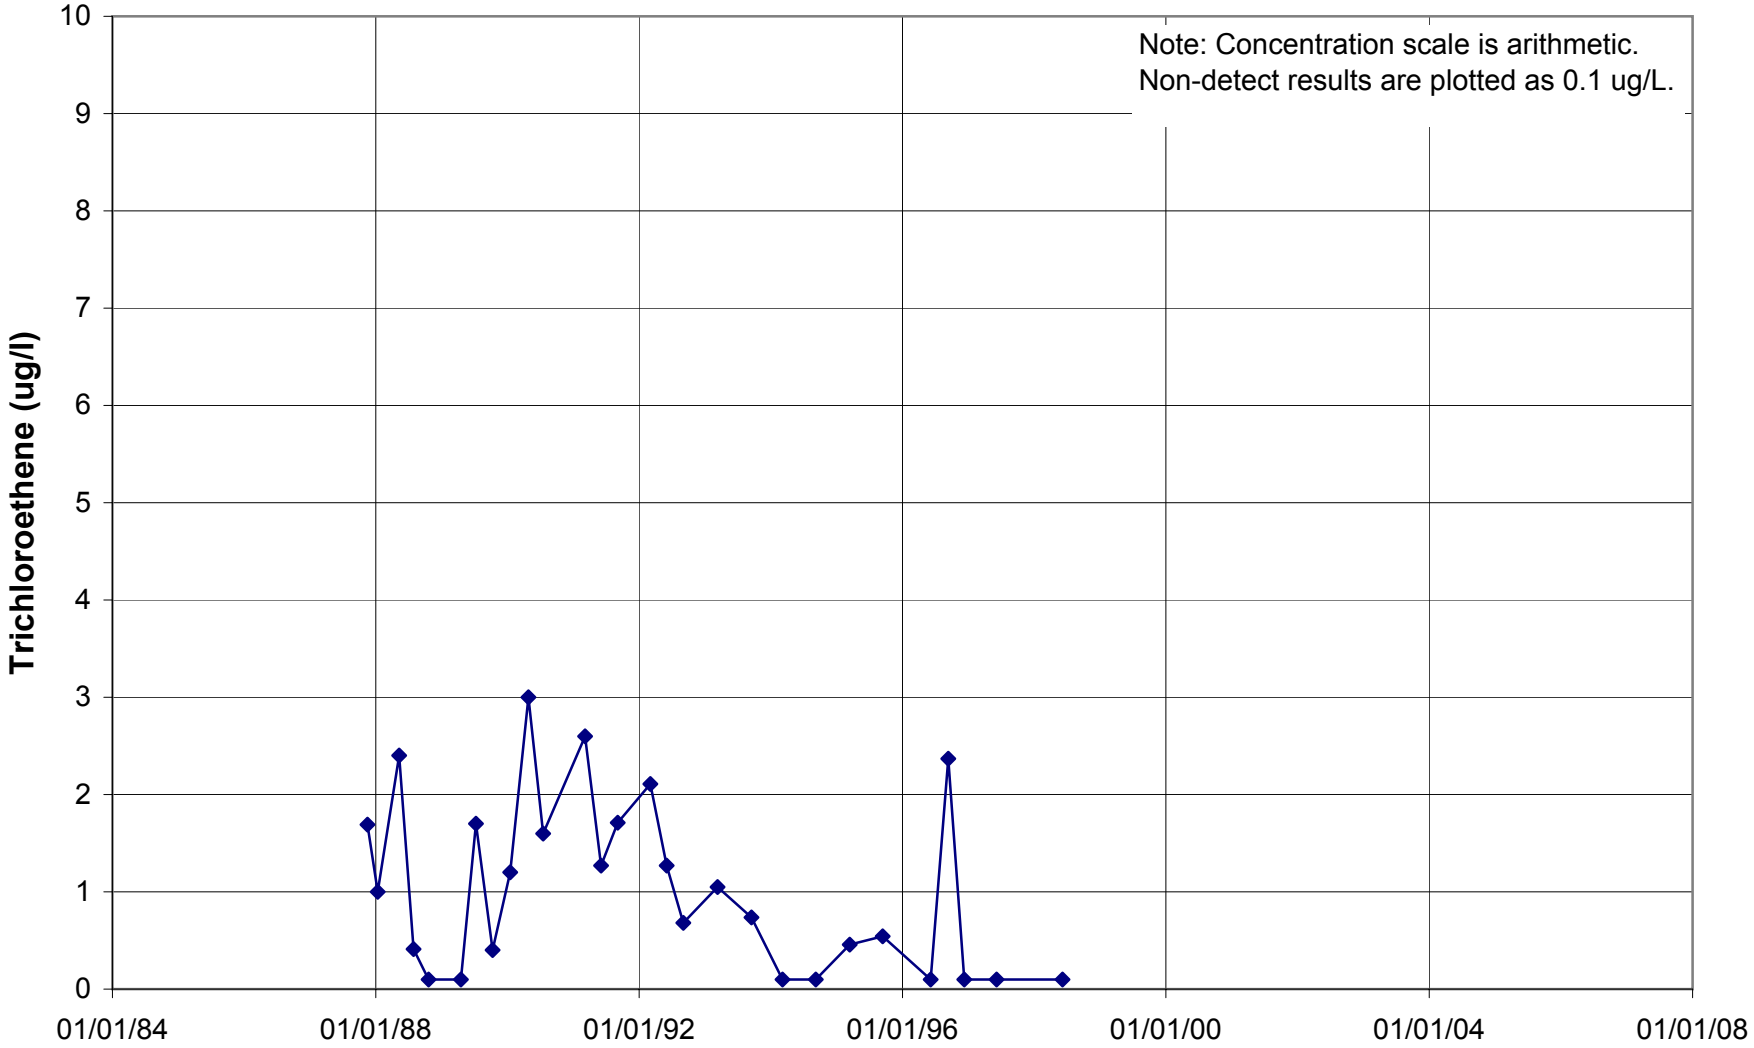

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L002

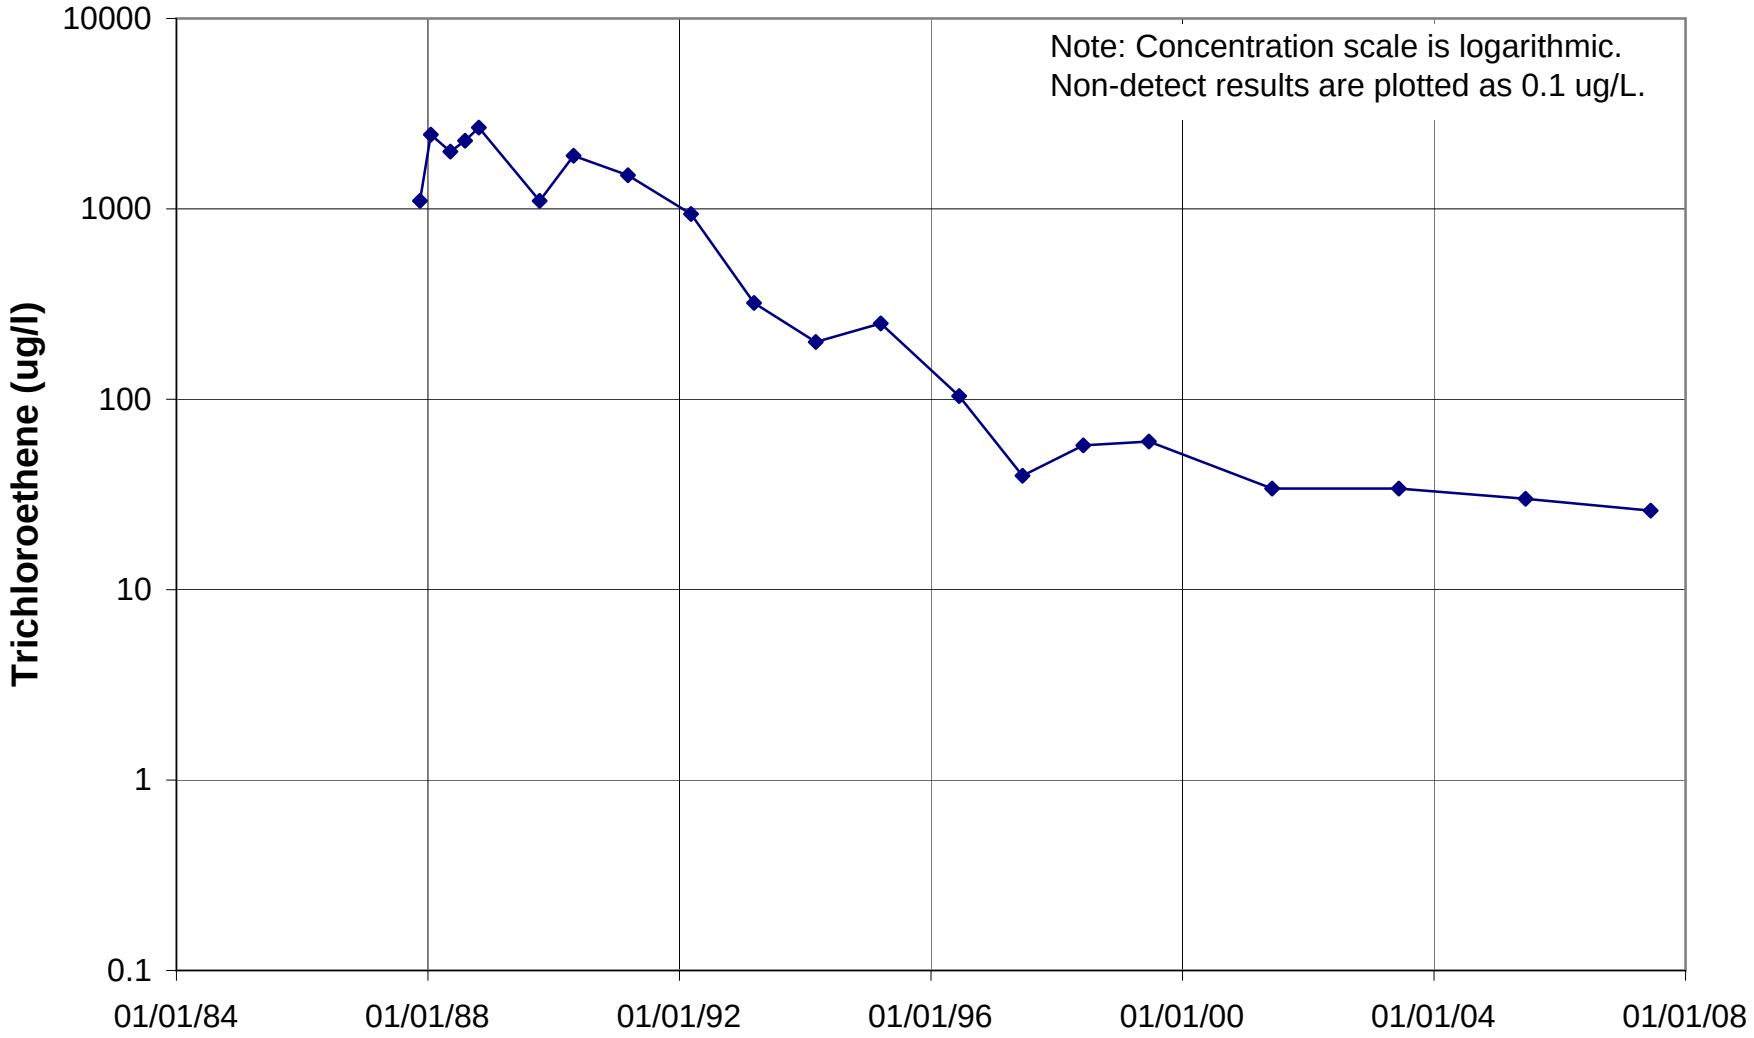

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L003

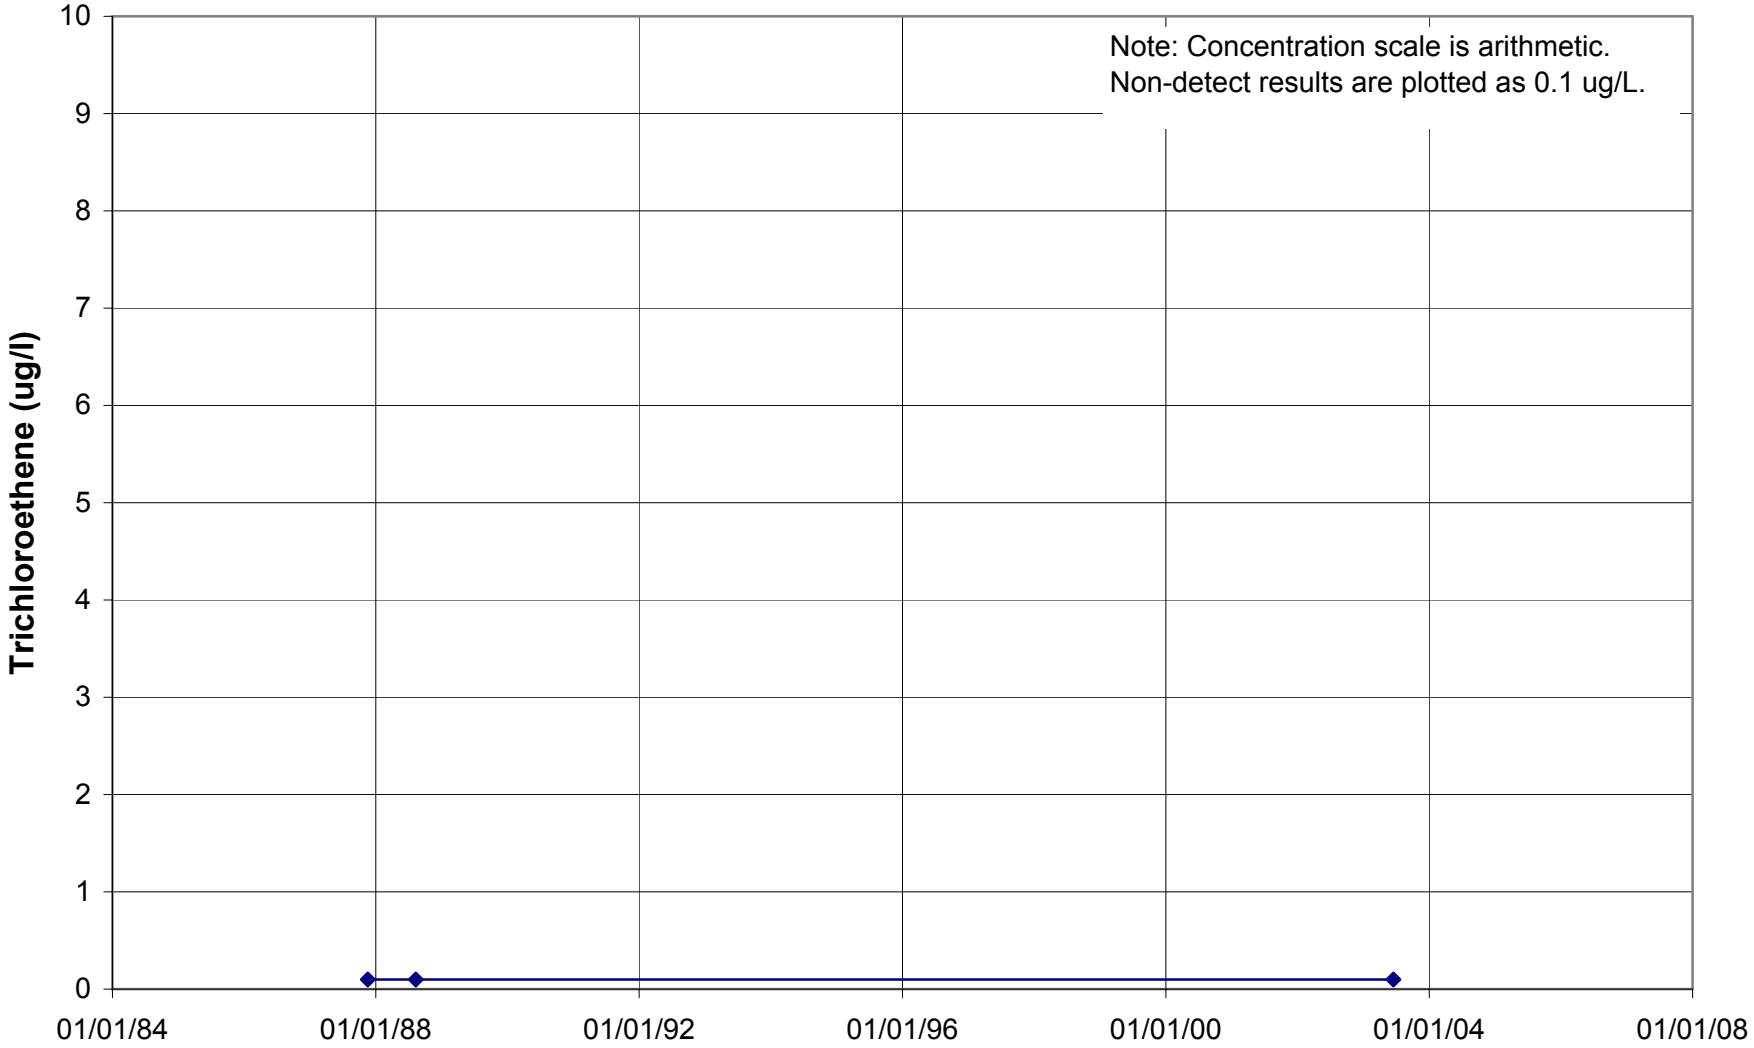

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L004

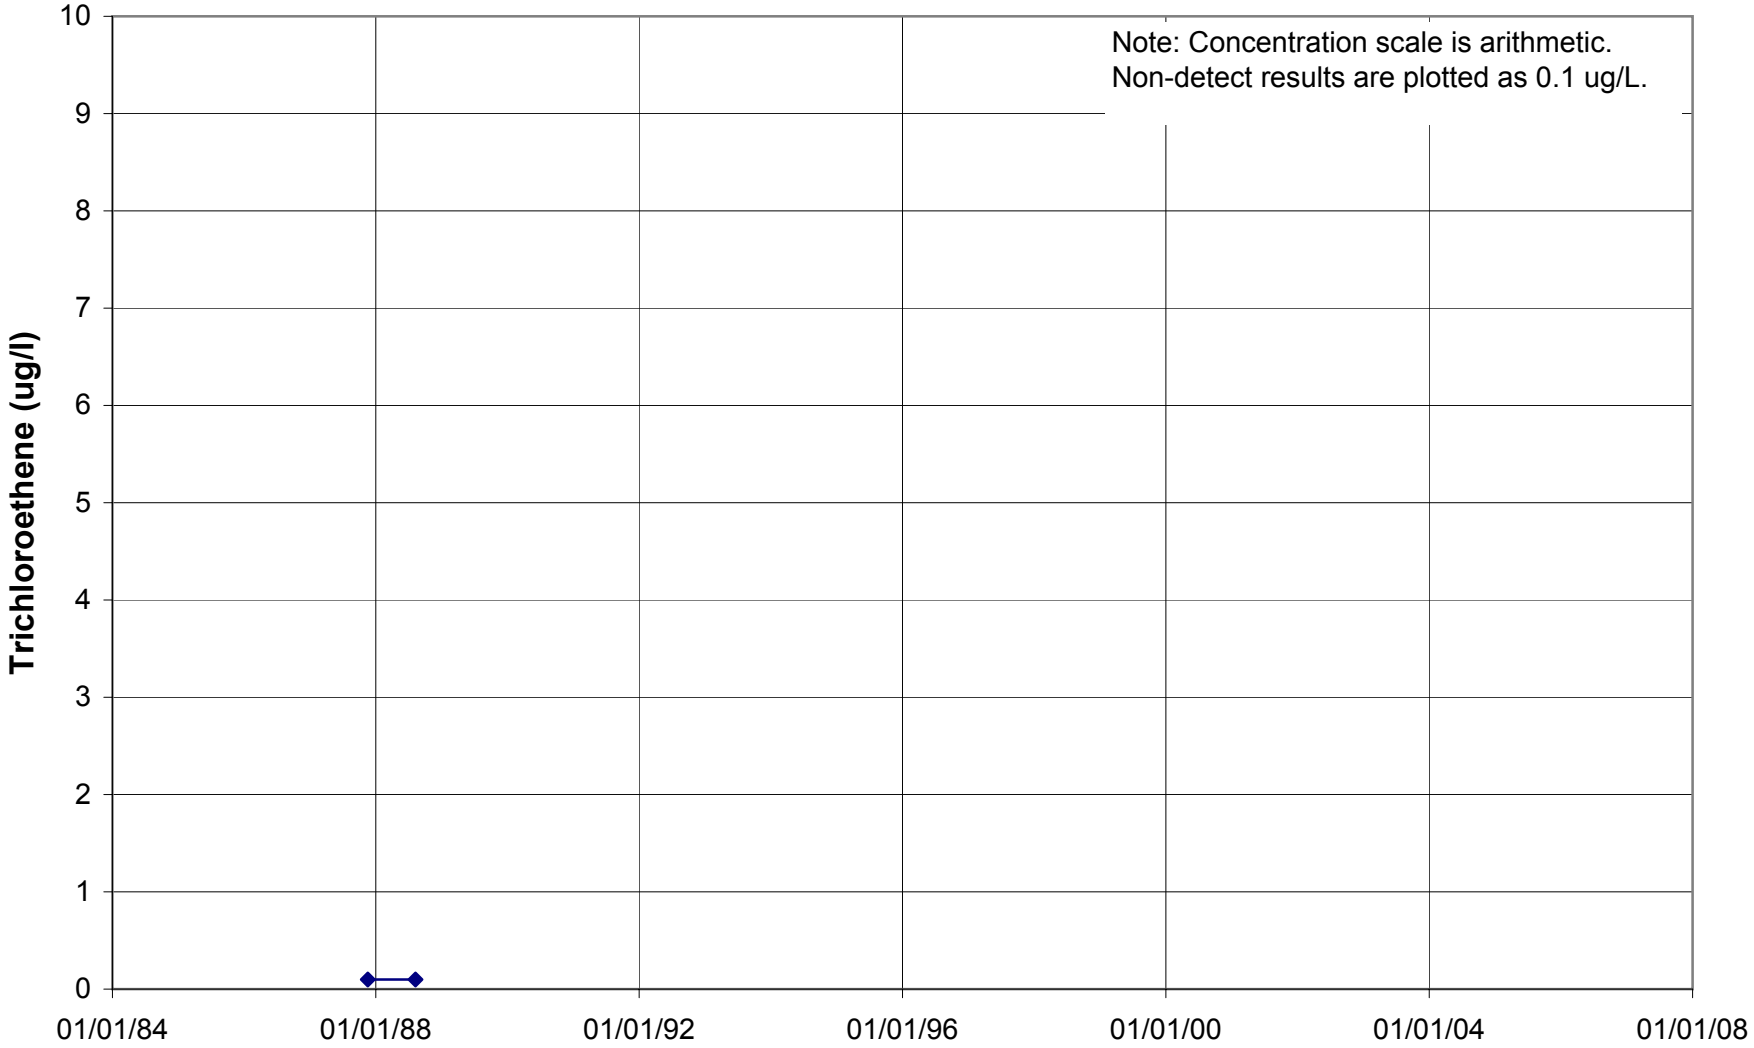

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L005

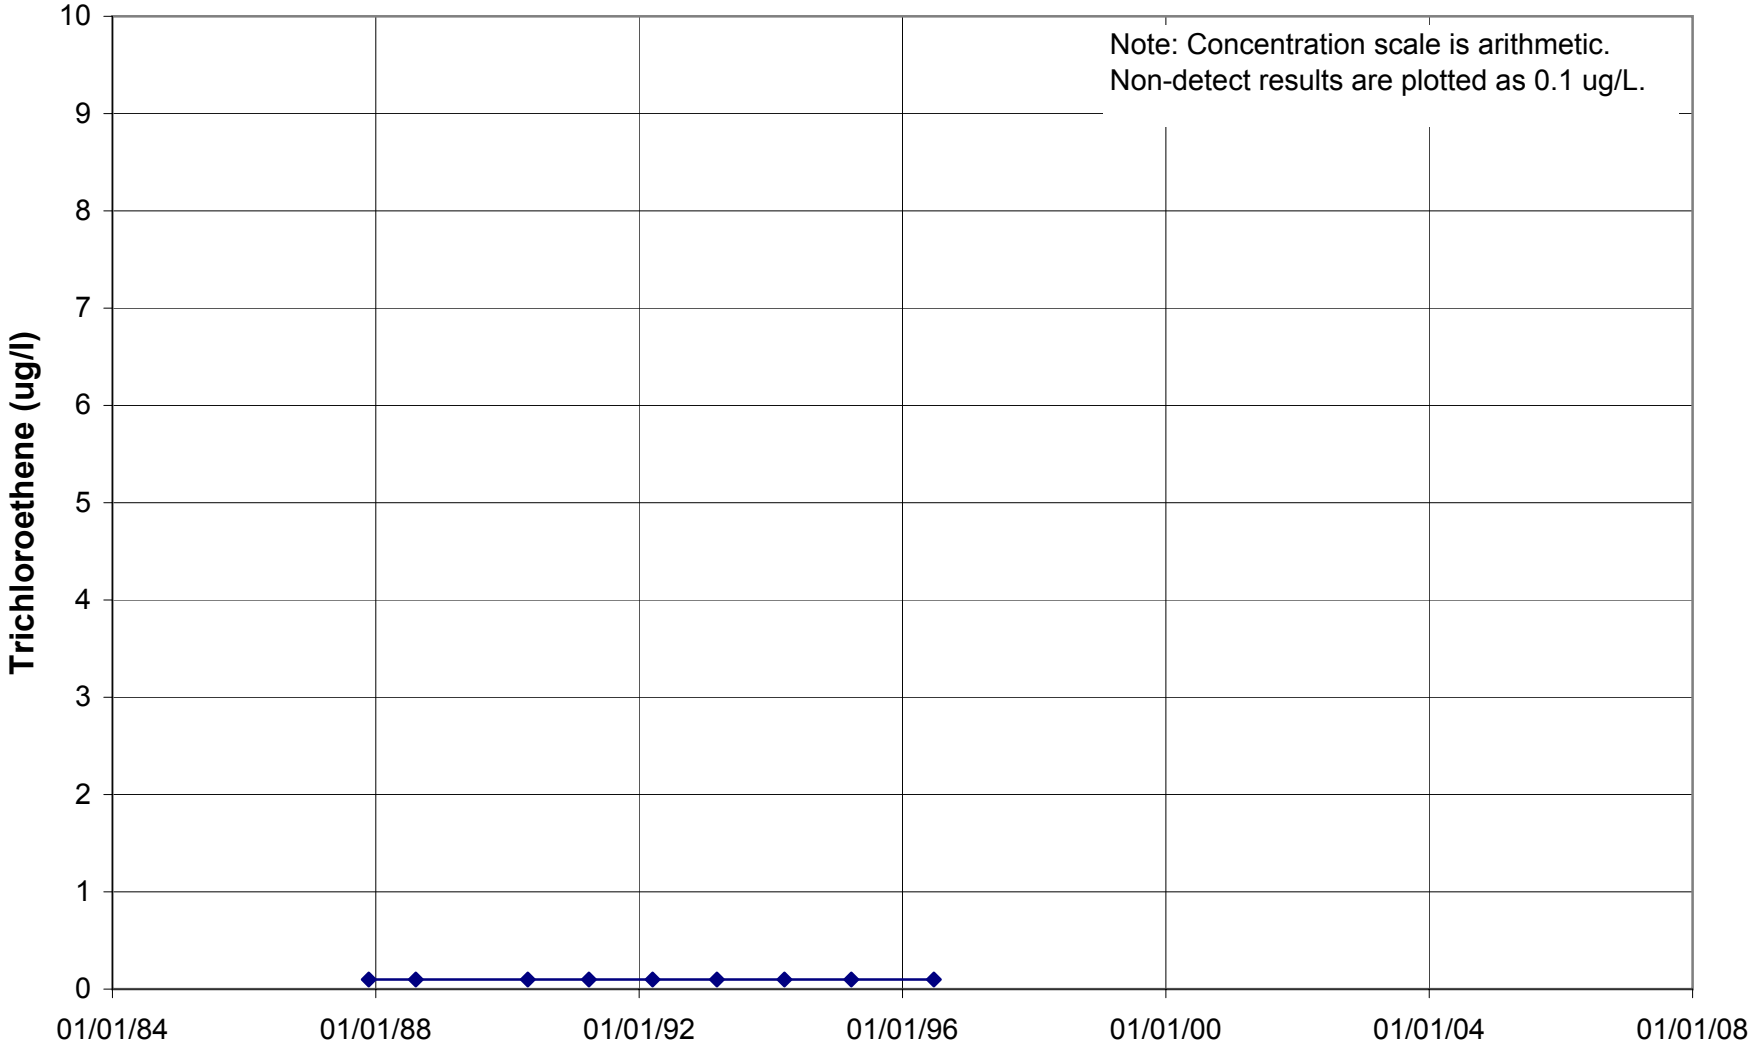

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L007

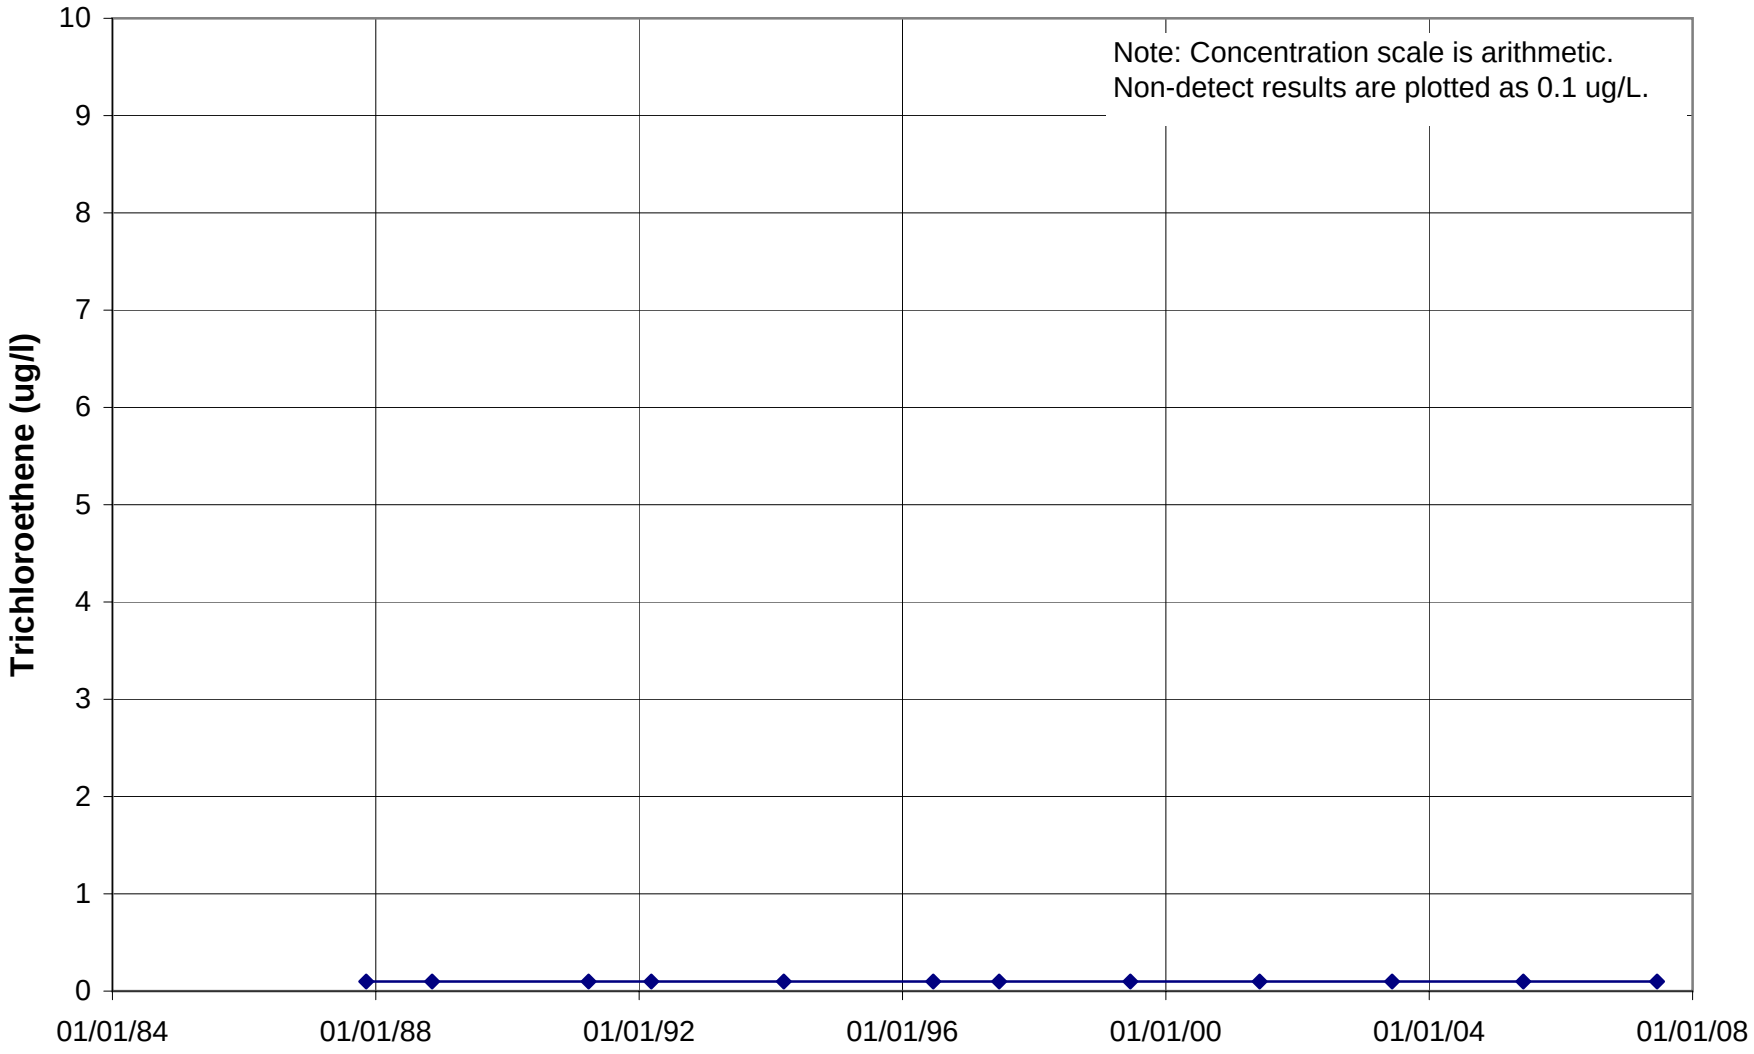

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L010

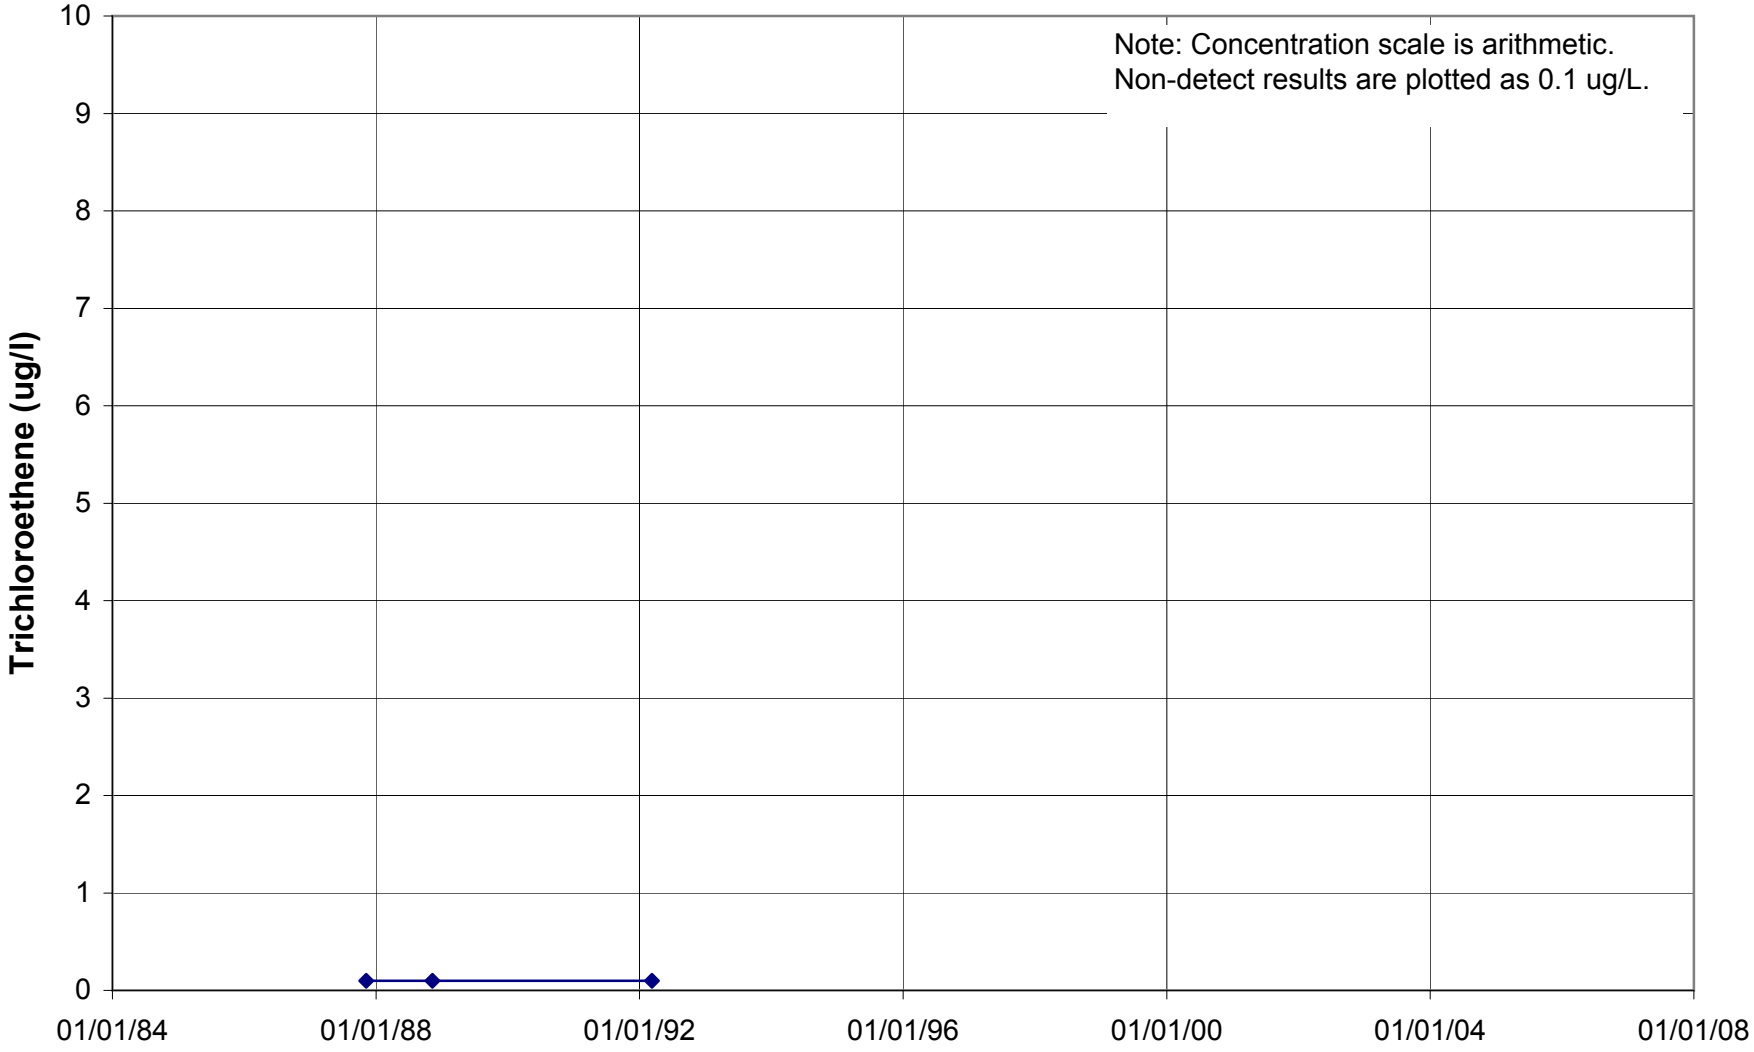

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L012

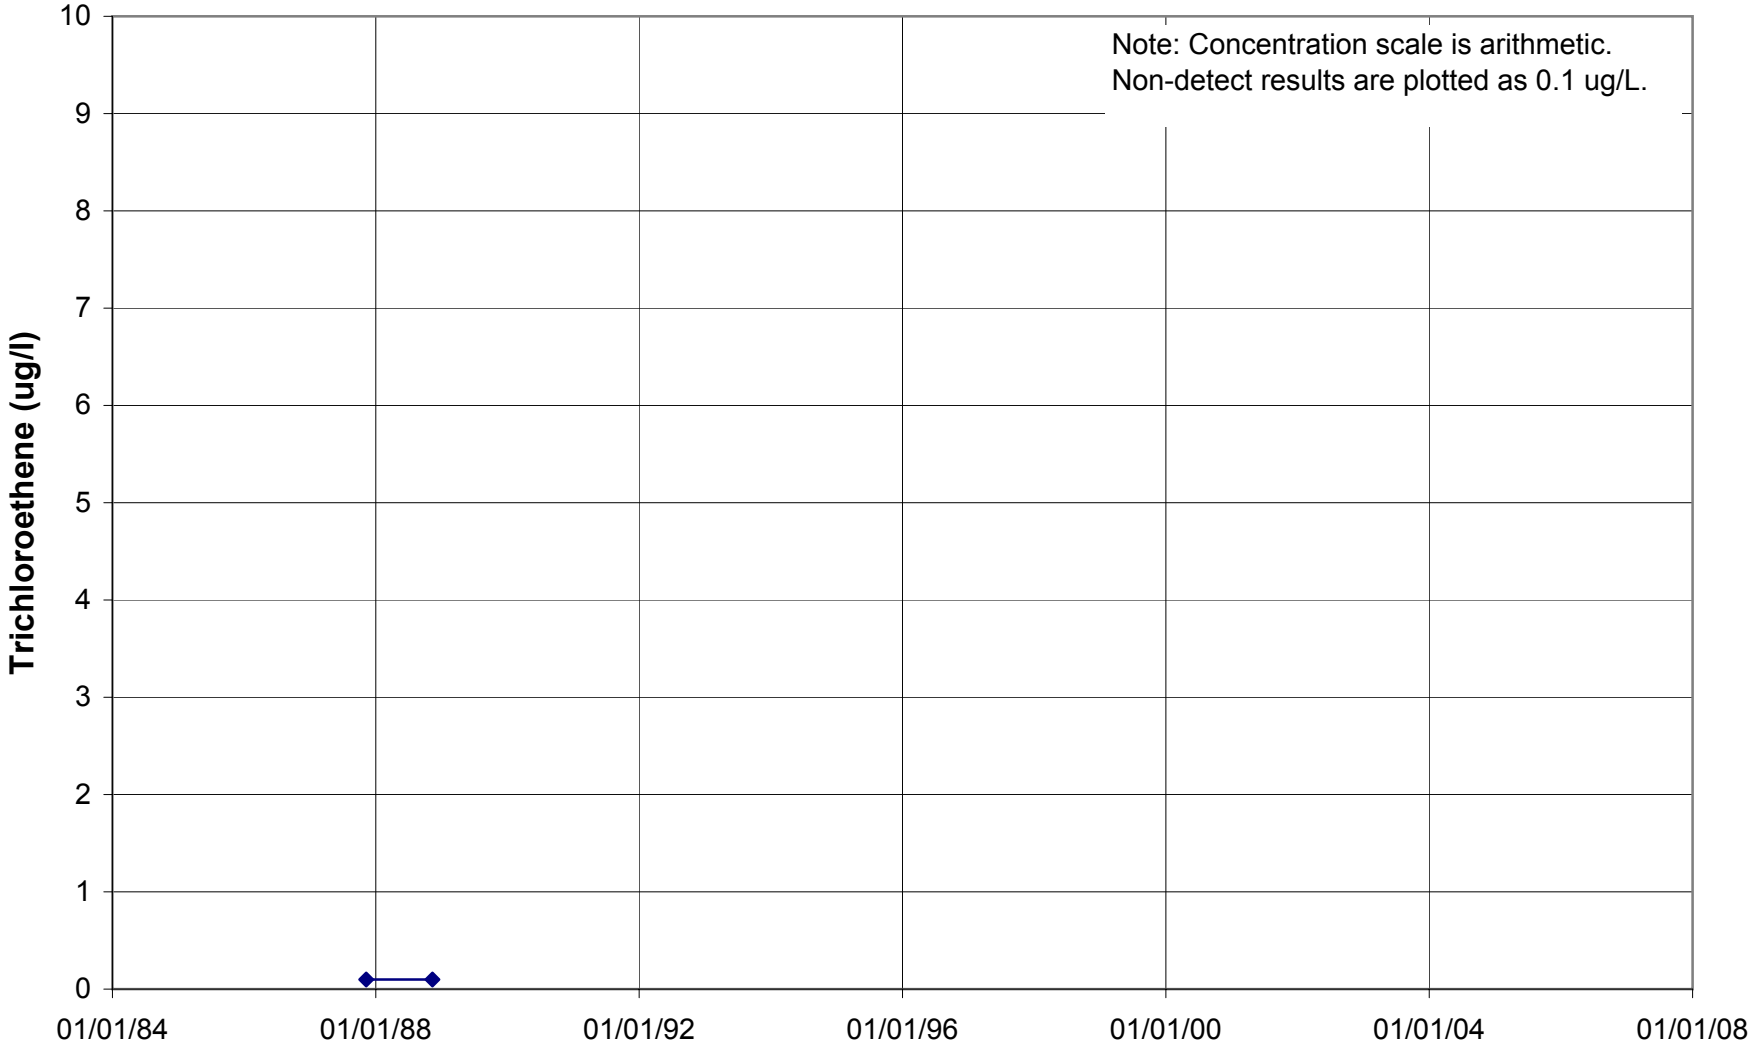

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L013

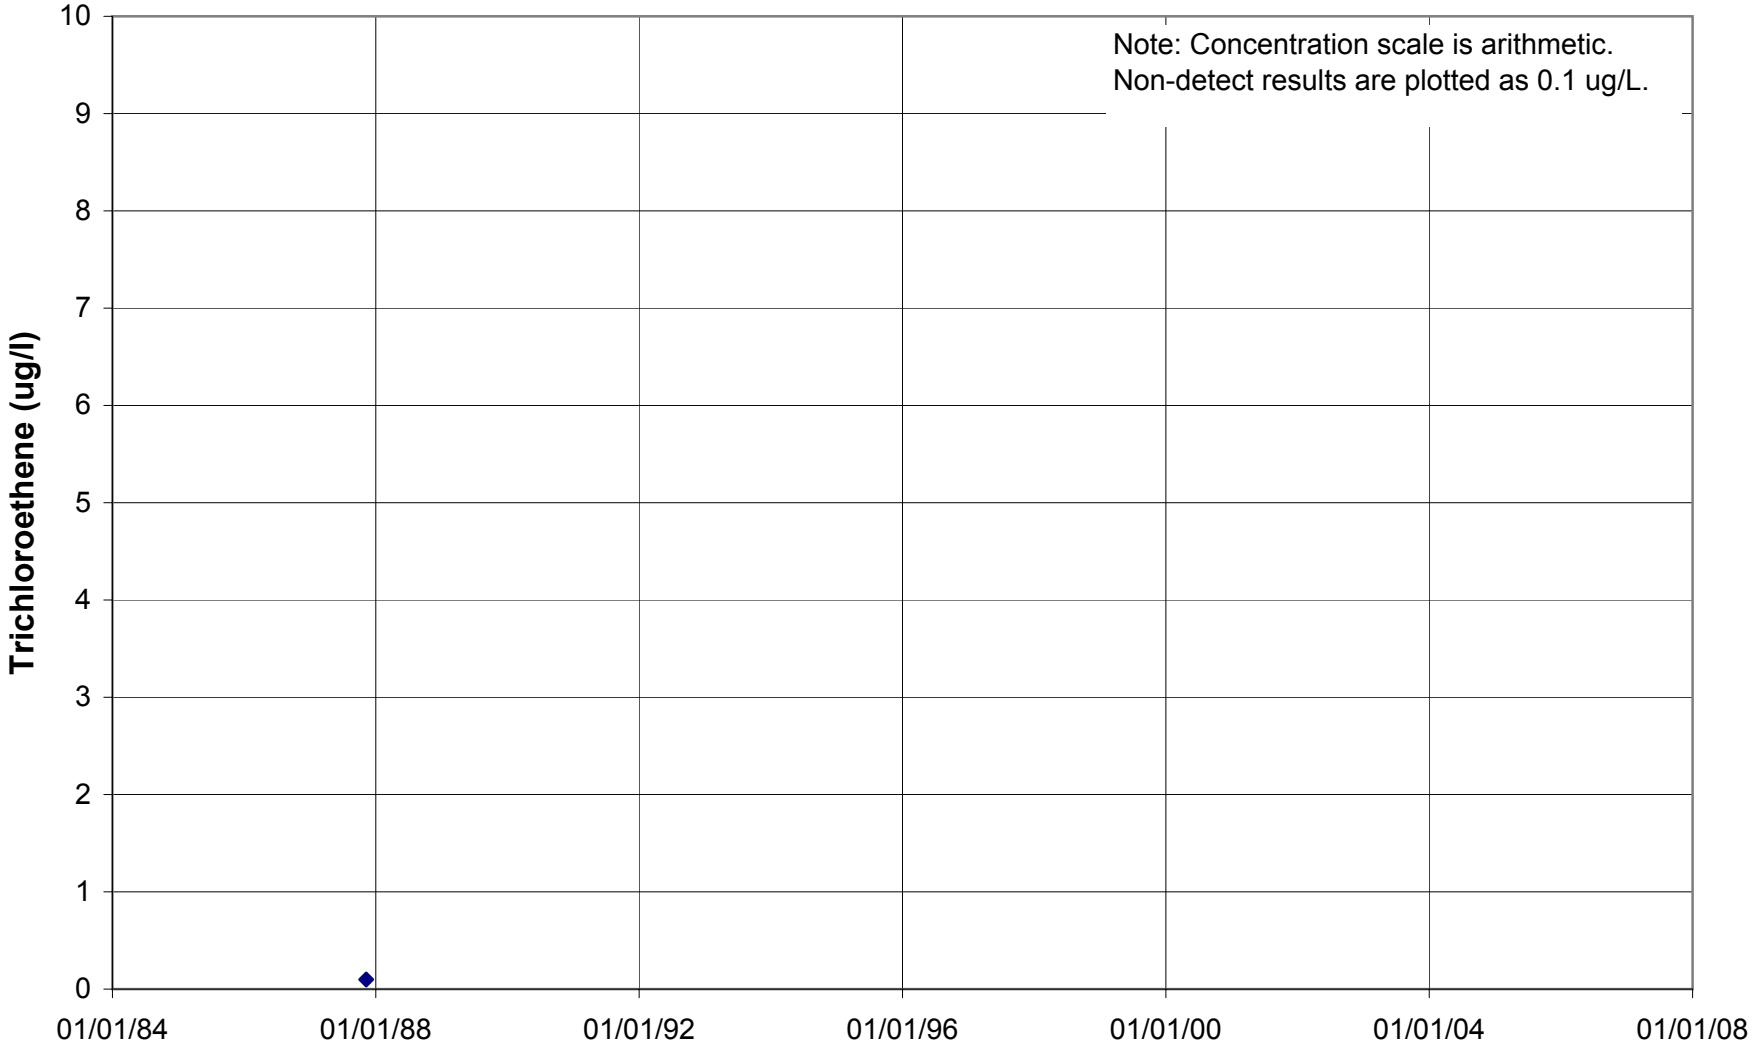

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L014

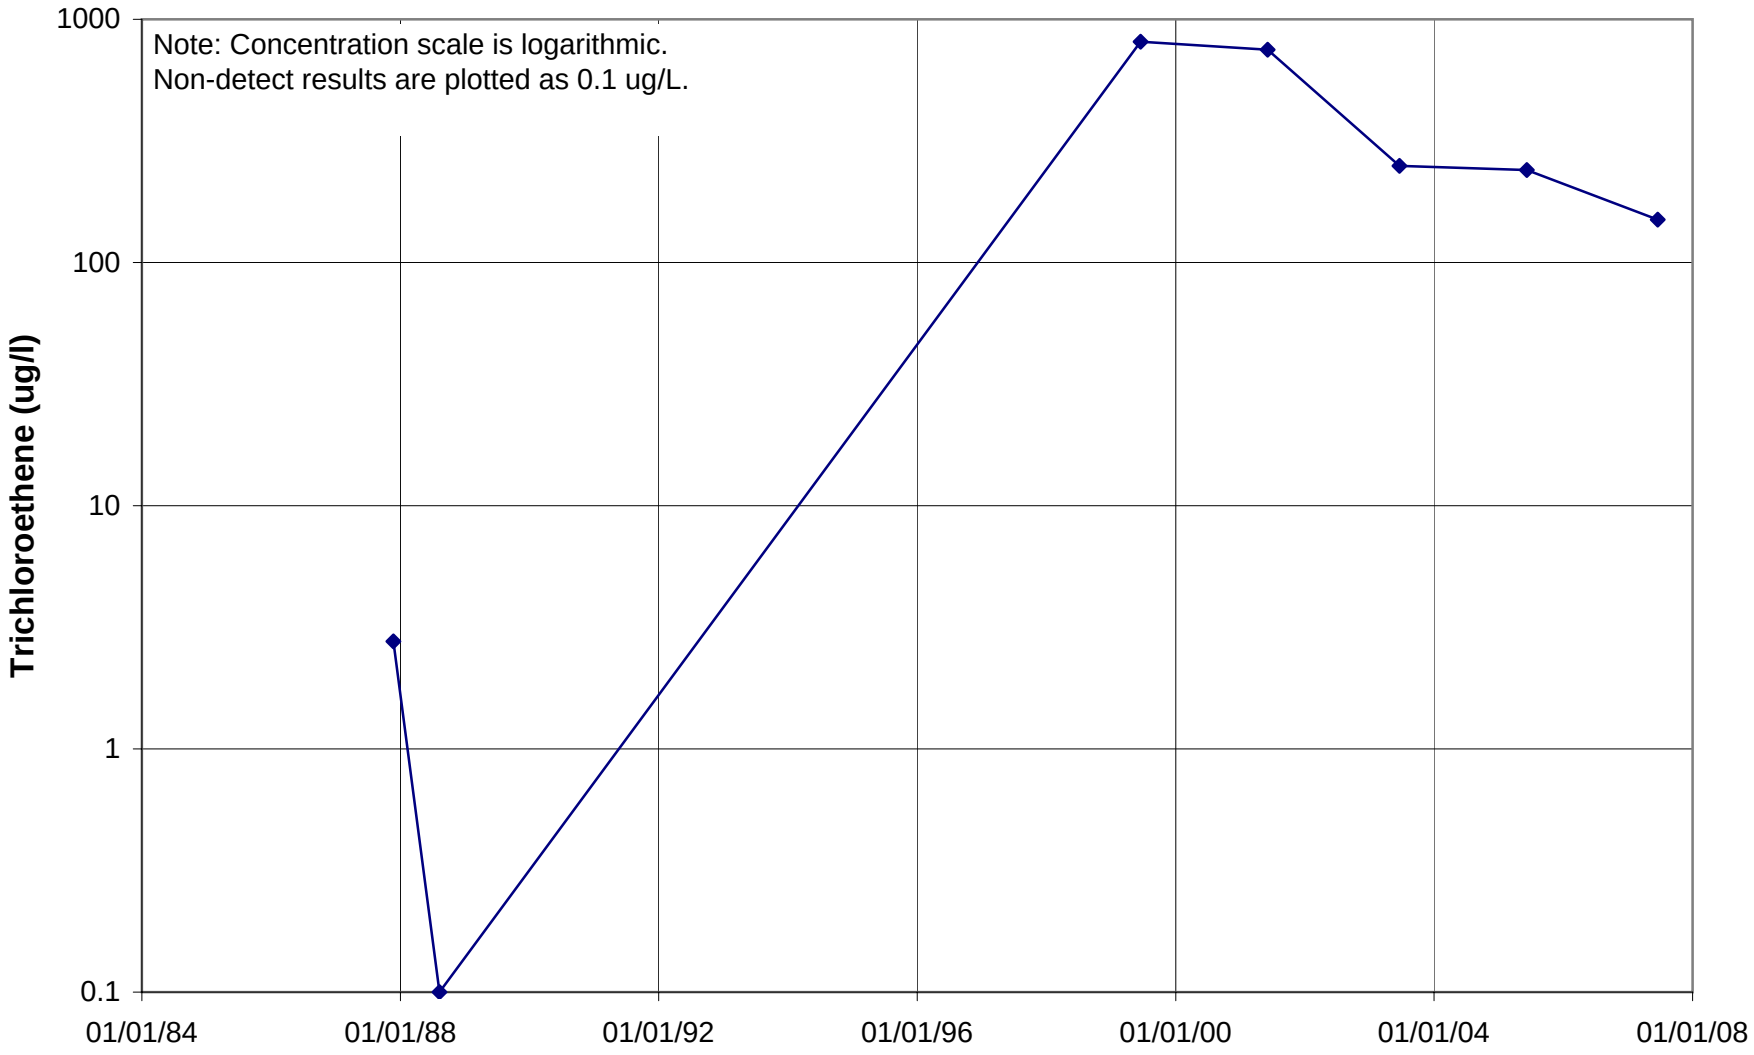

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L017

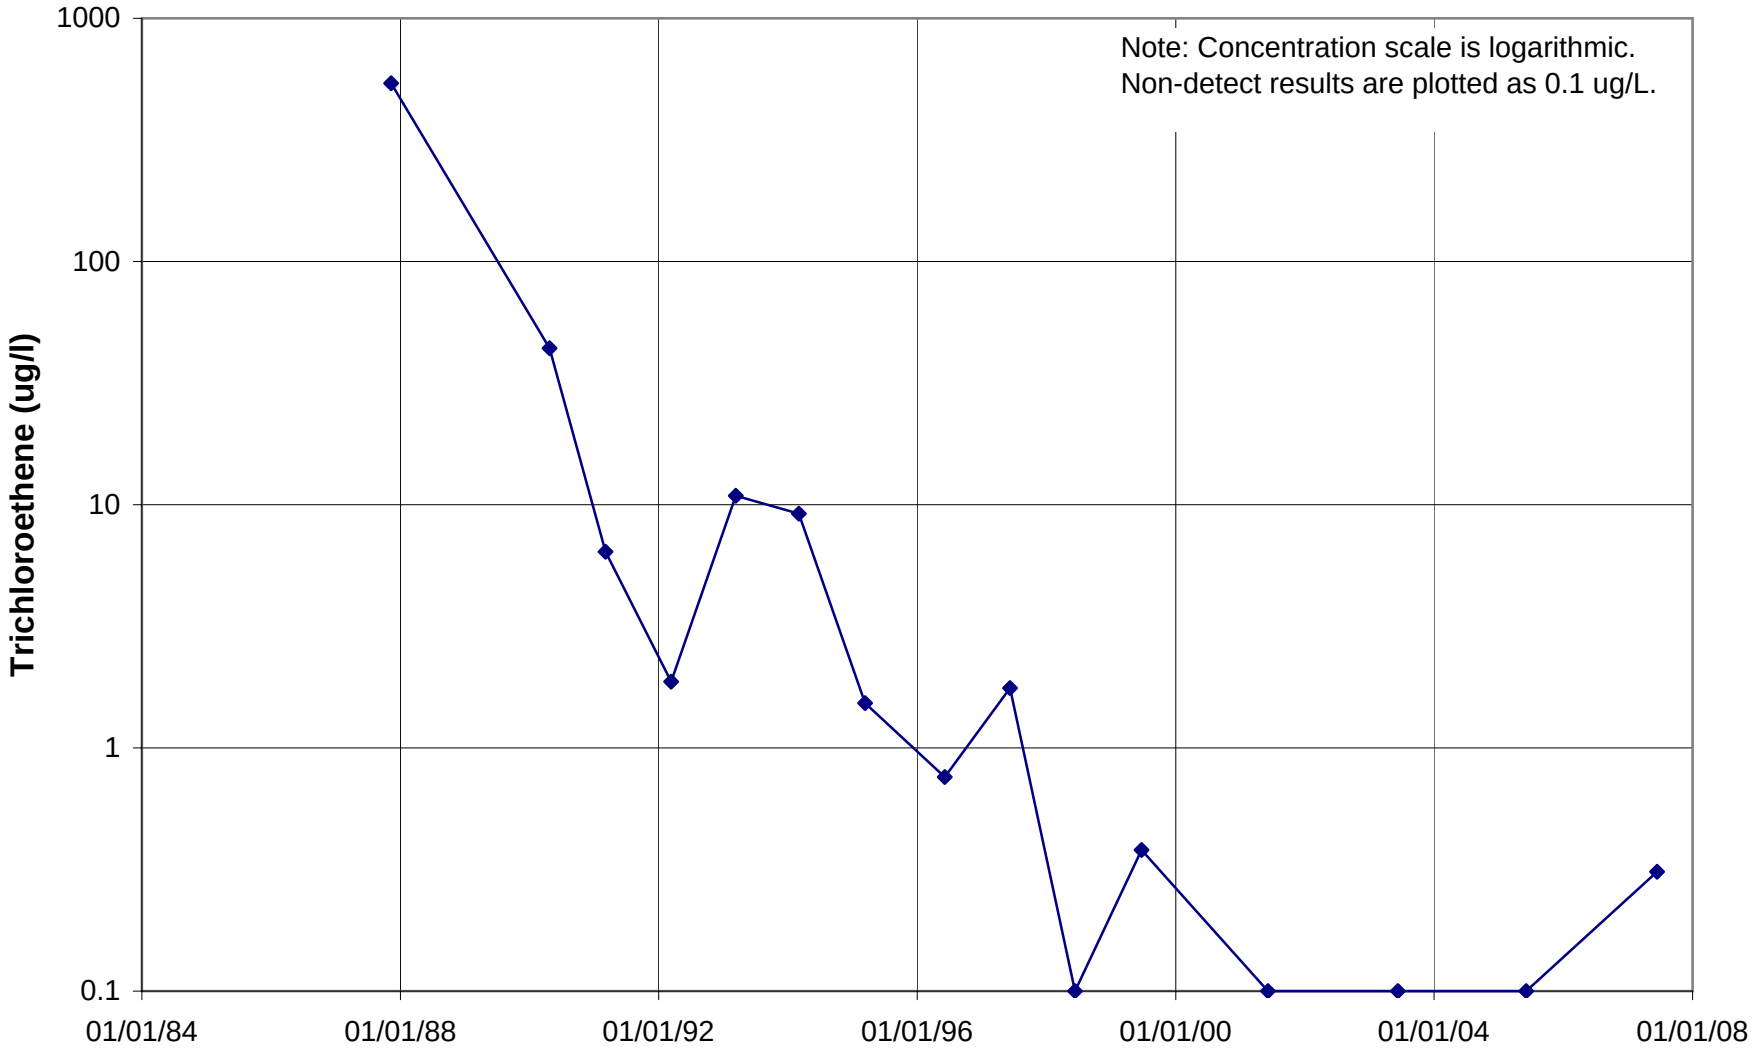

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L018

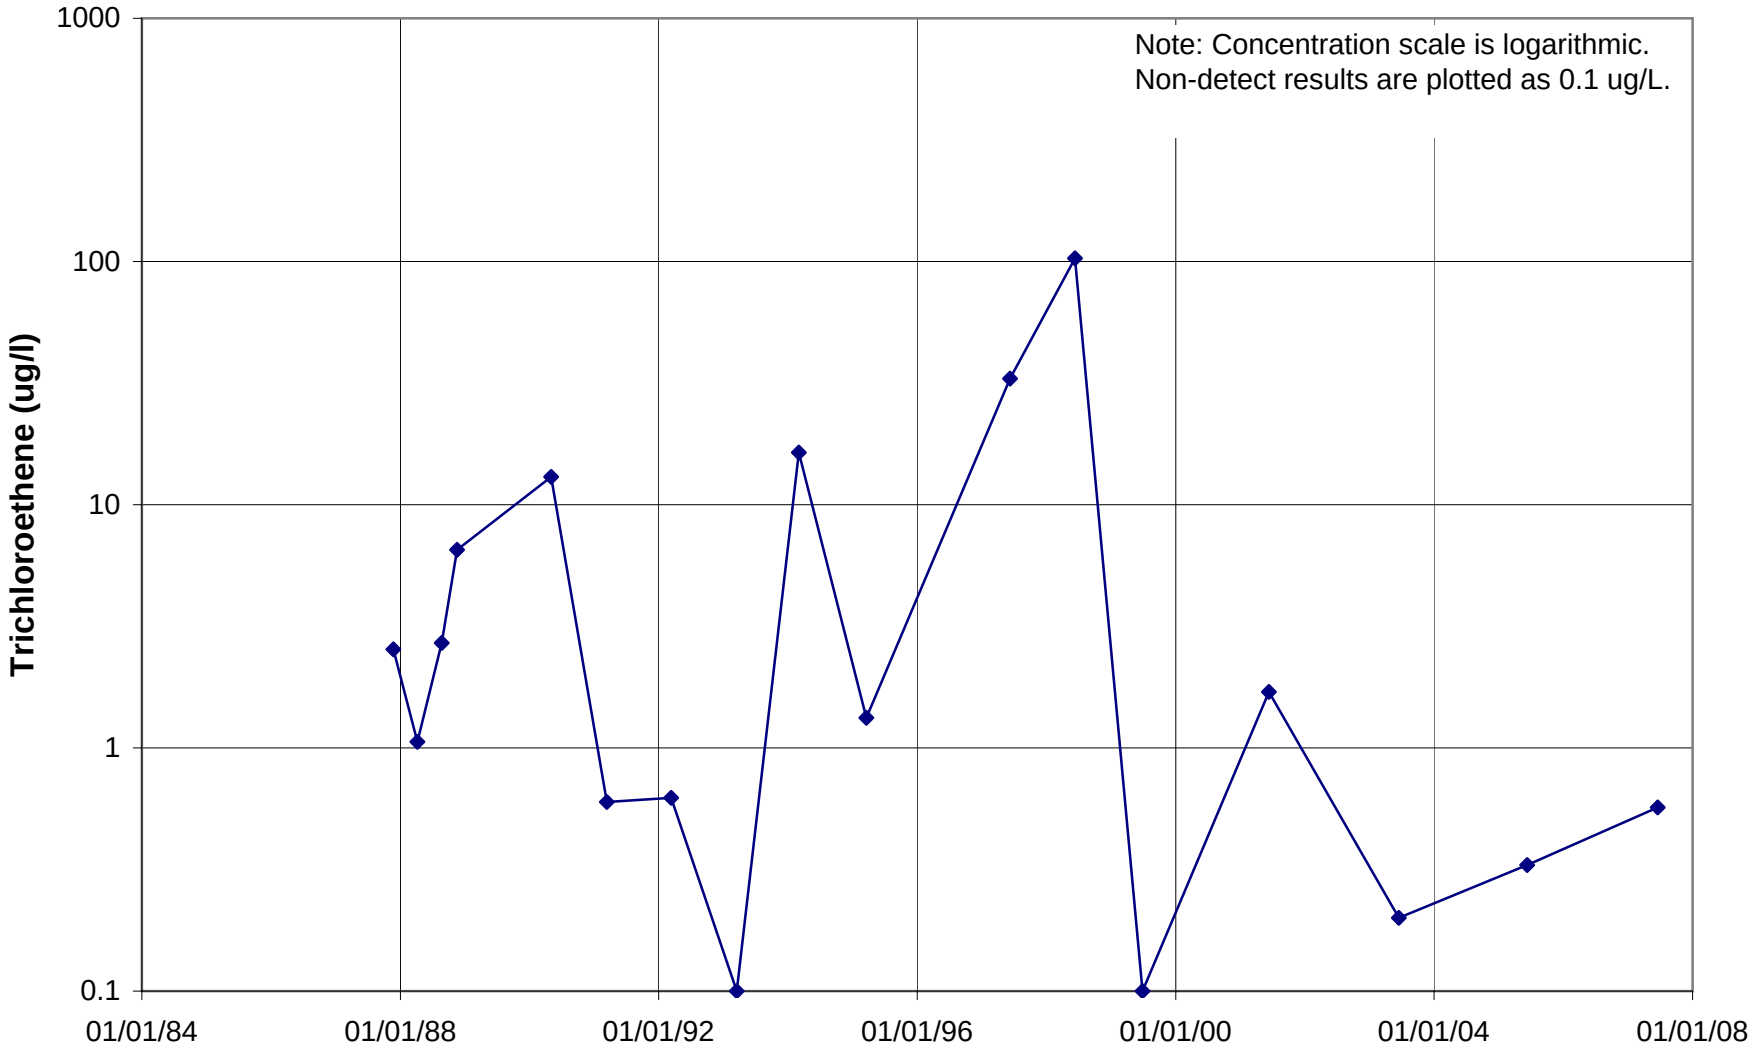

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L020

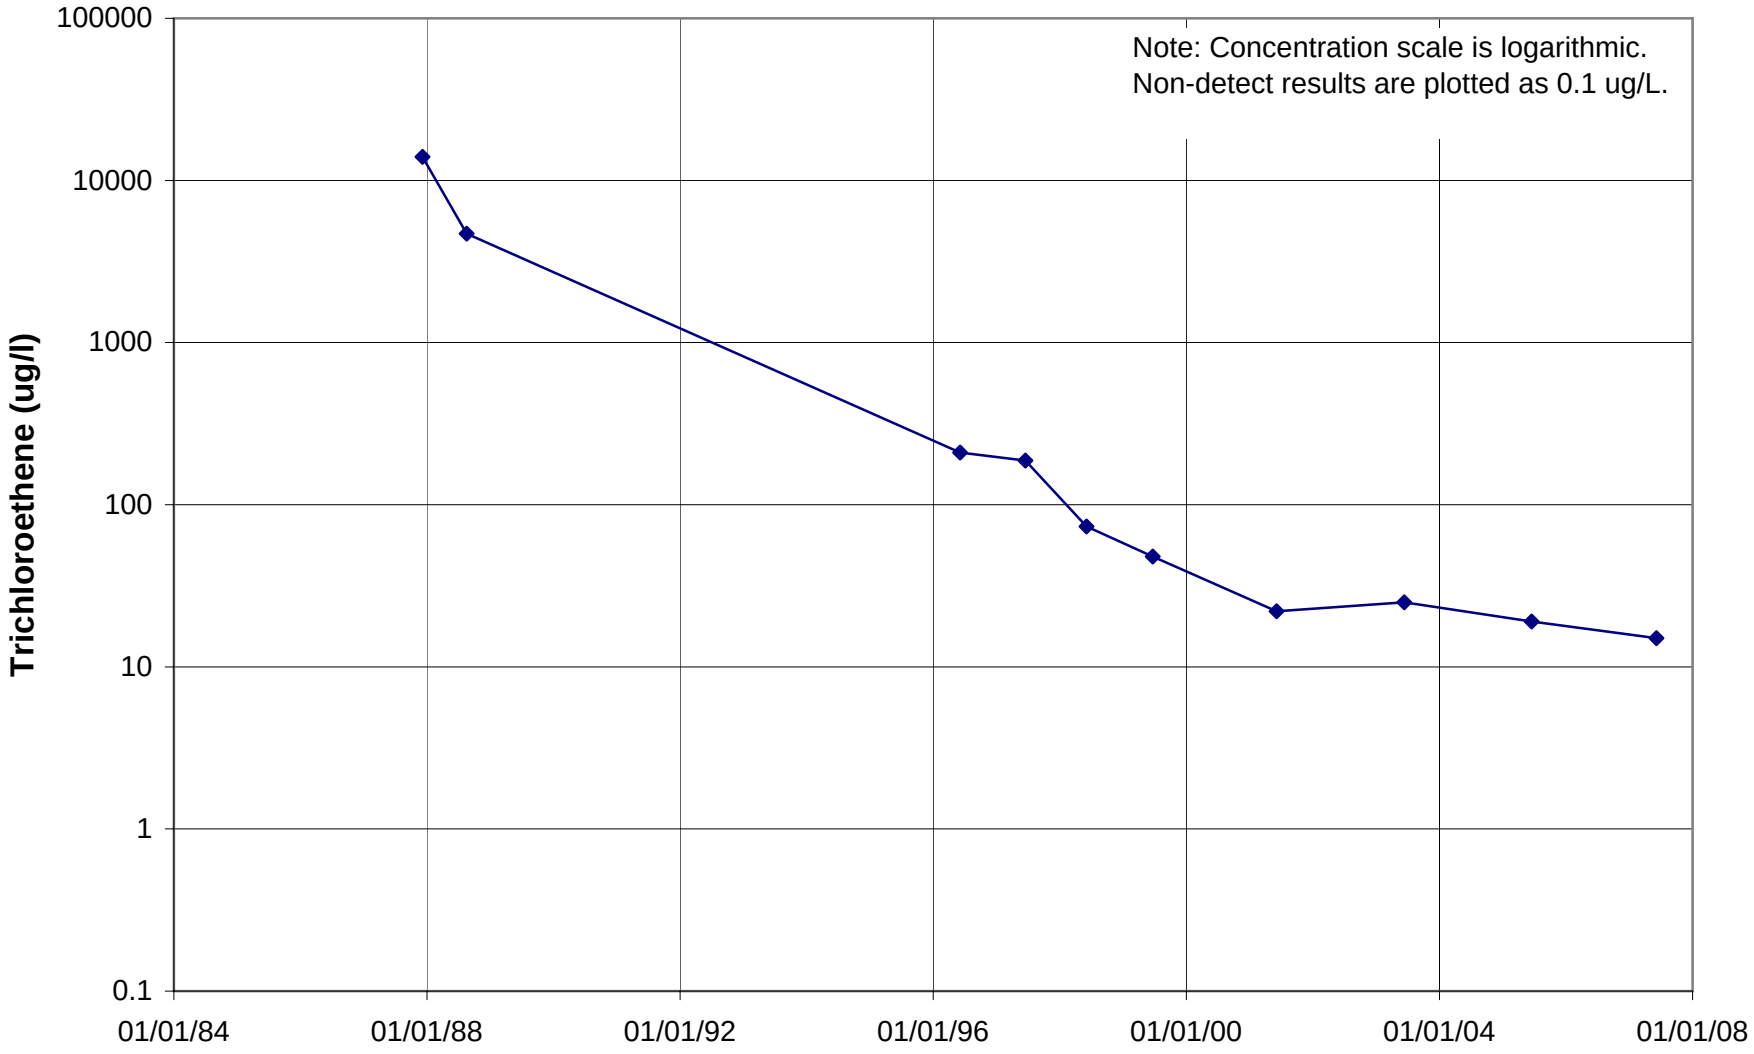

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L021

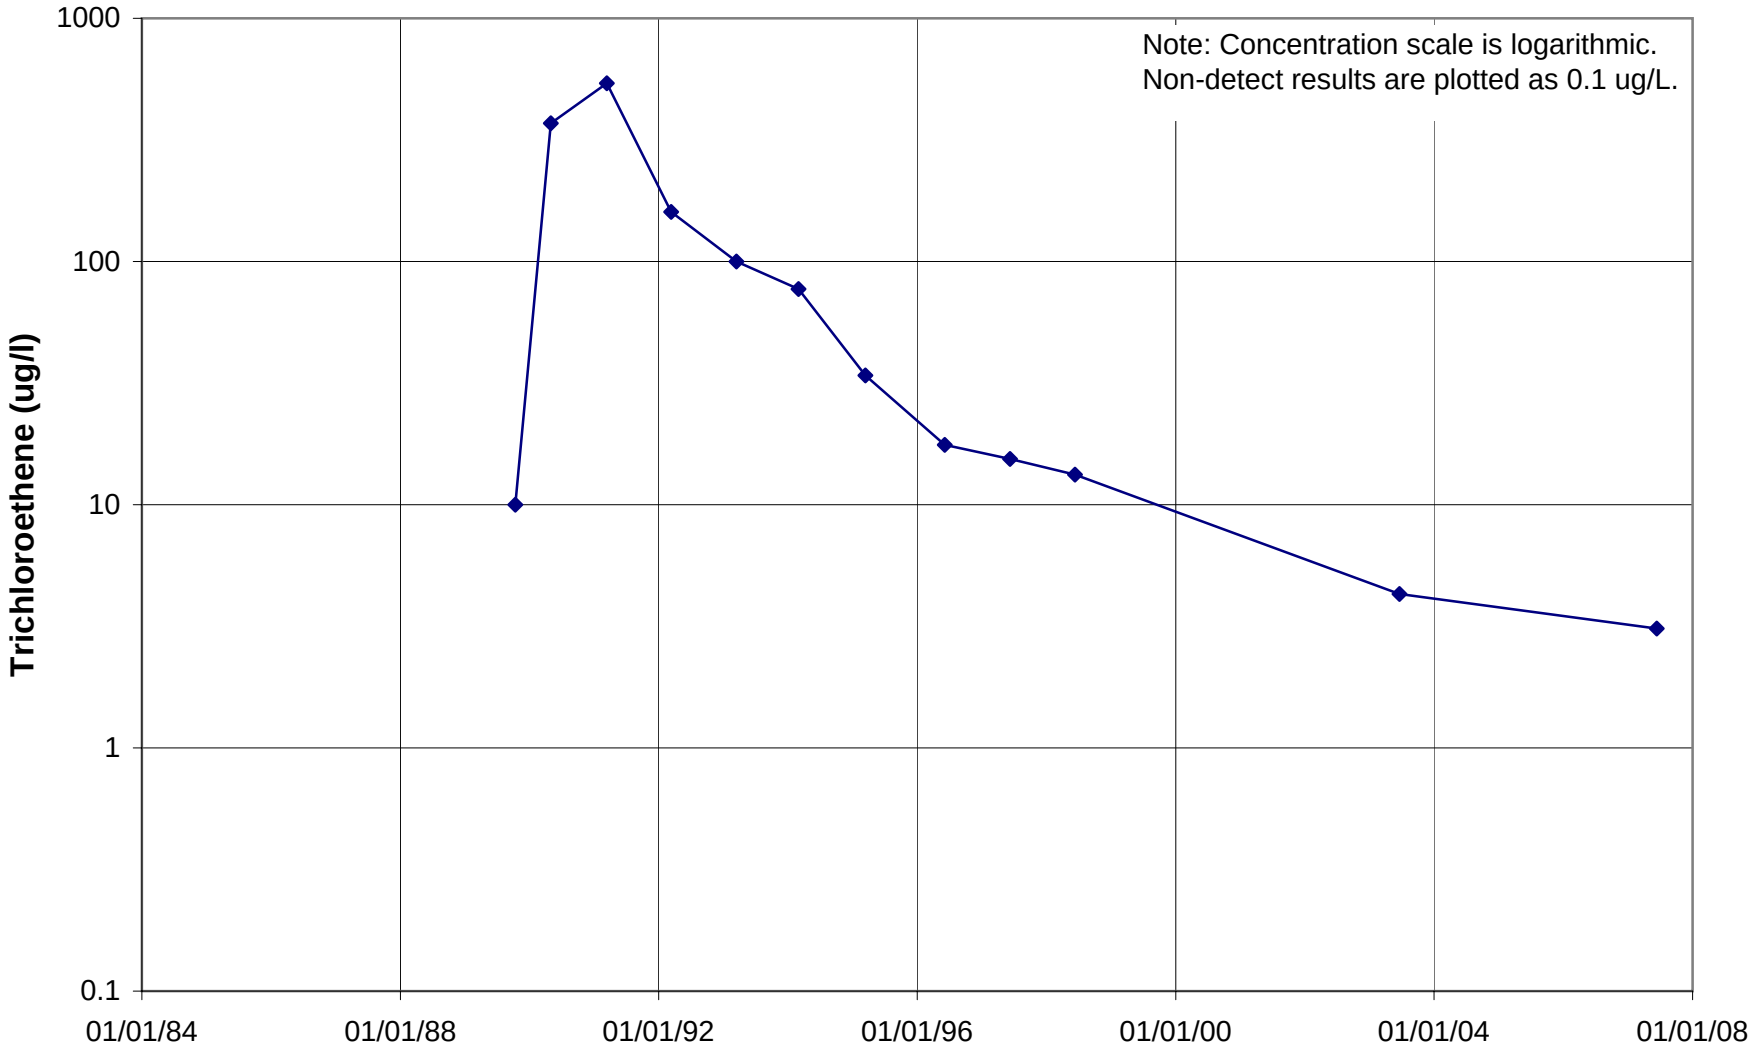

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L029

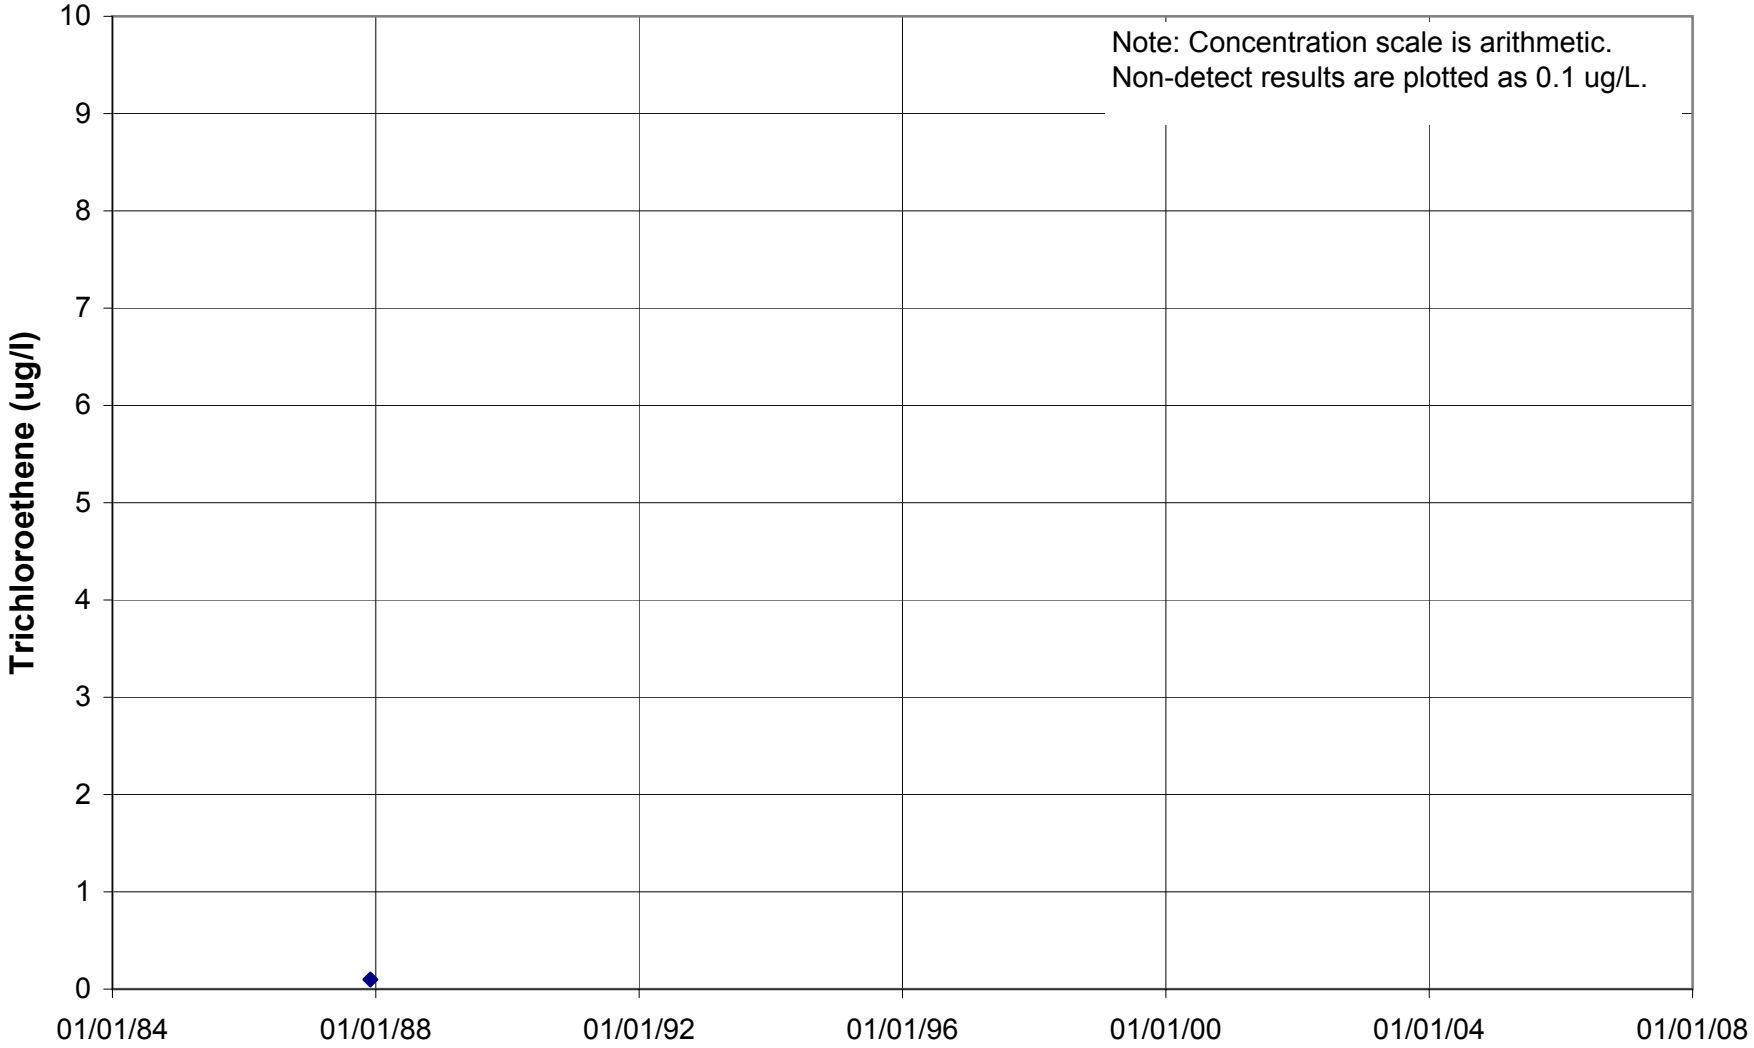

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L077

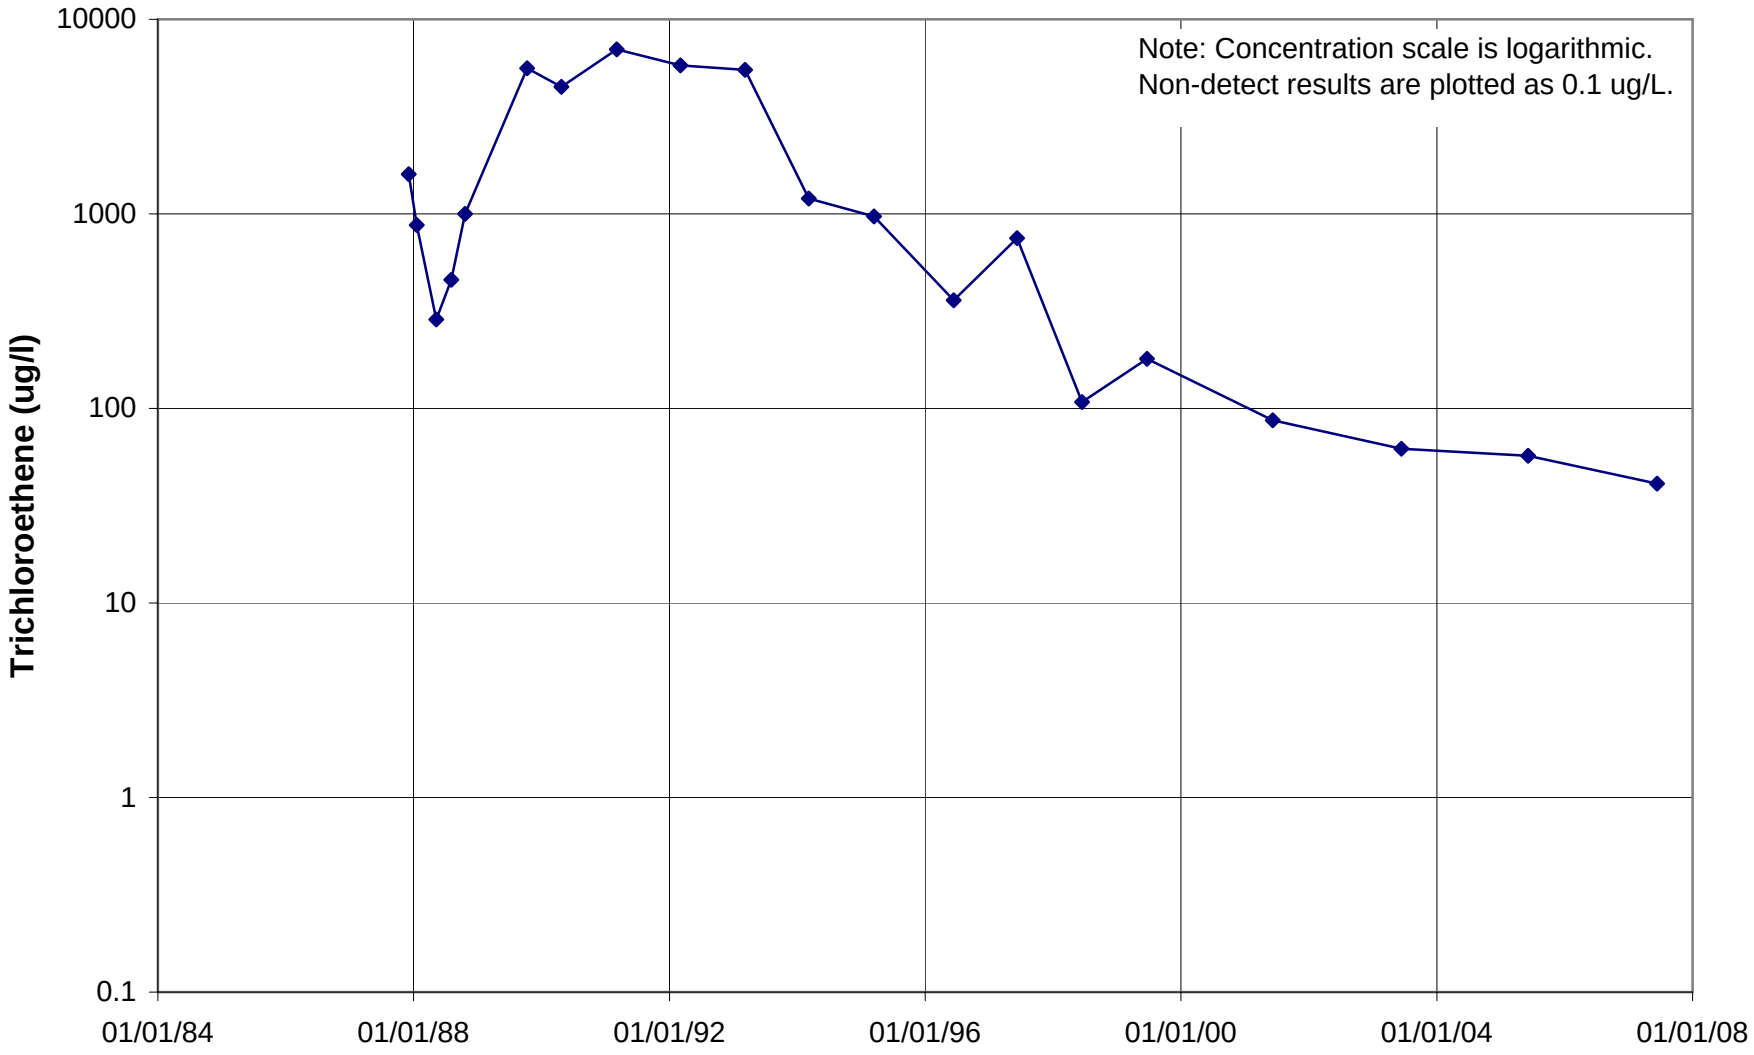

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L078

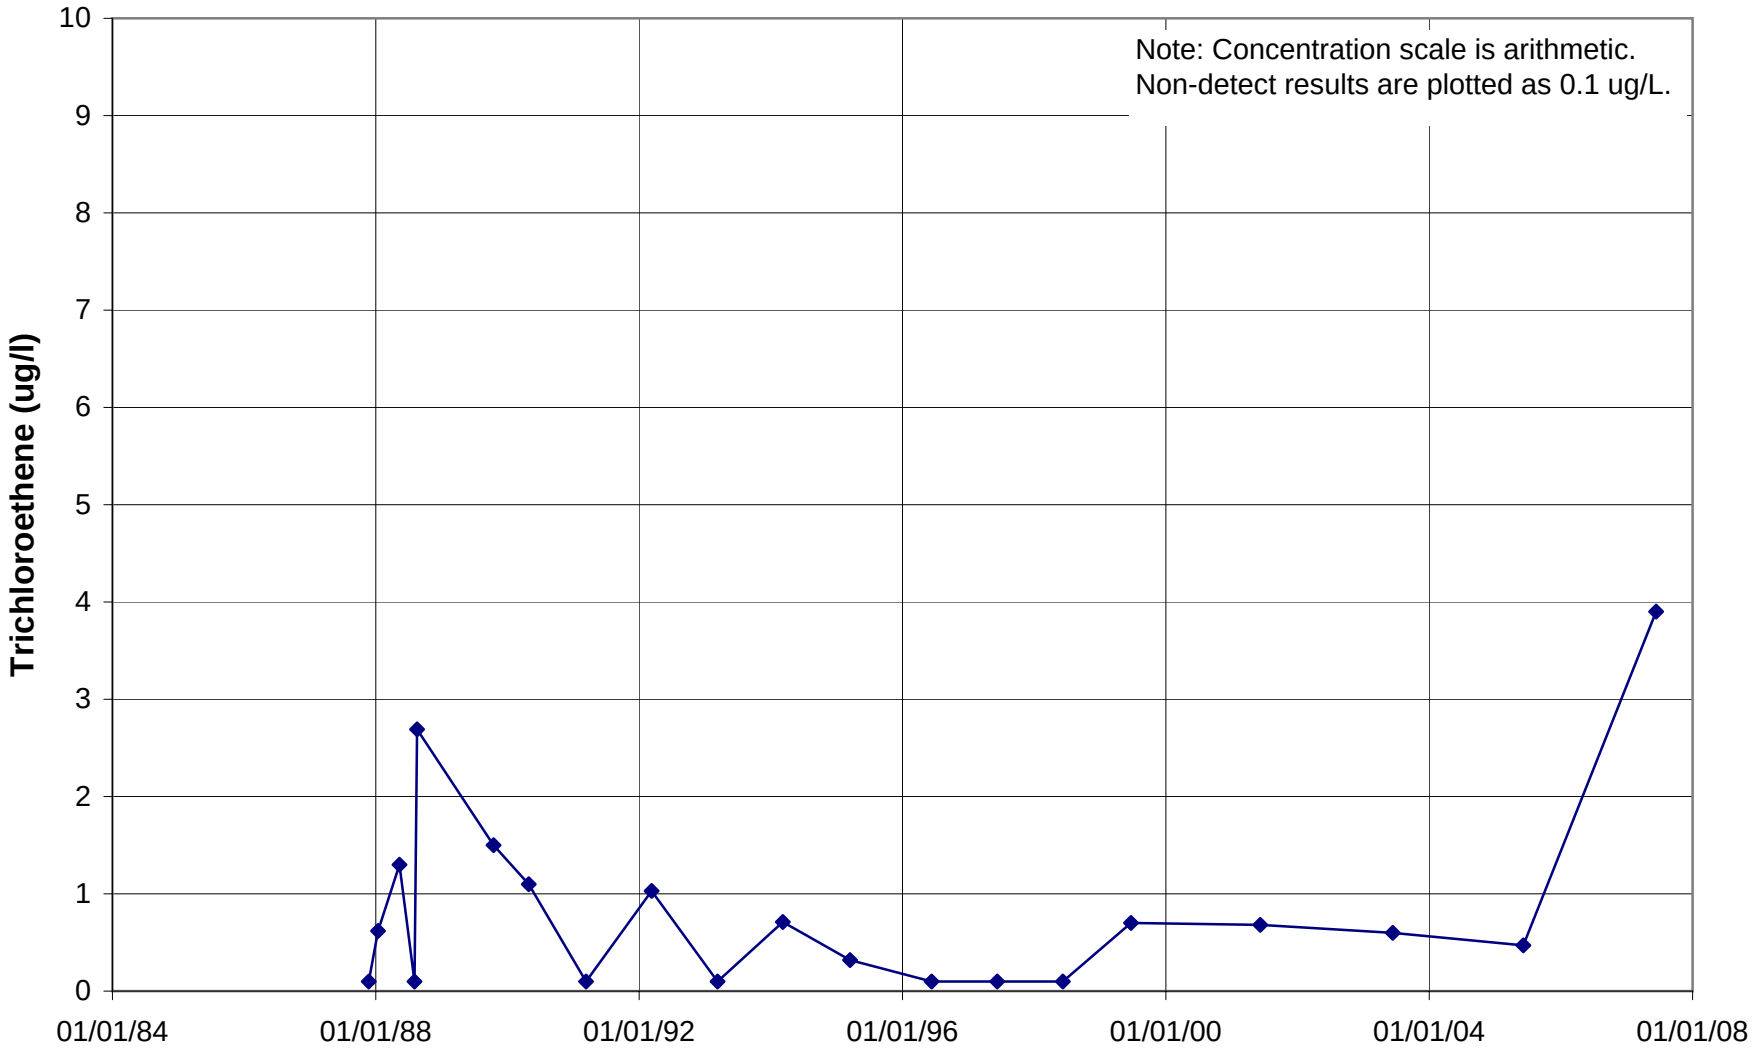

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L079

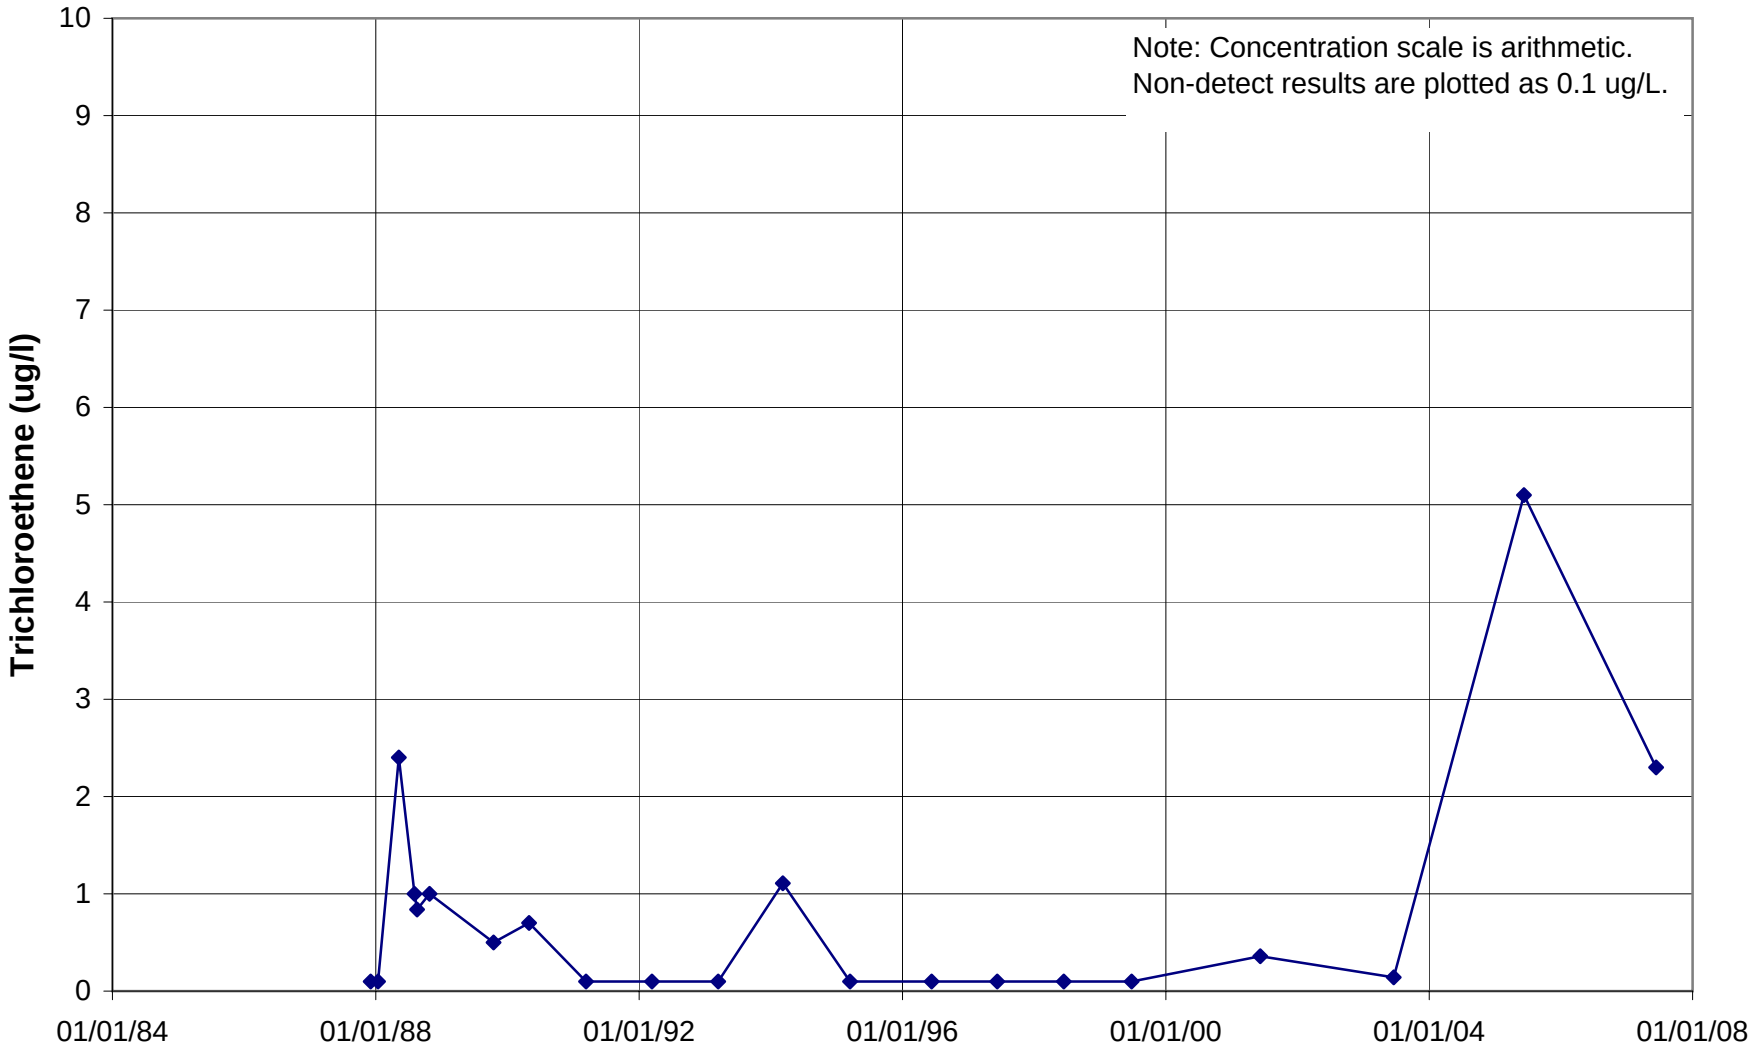

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L080

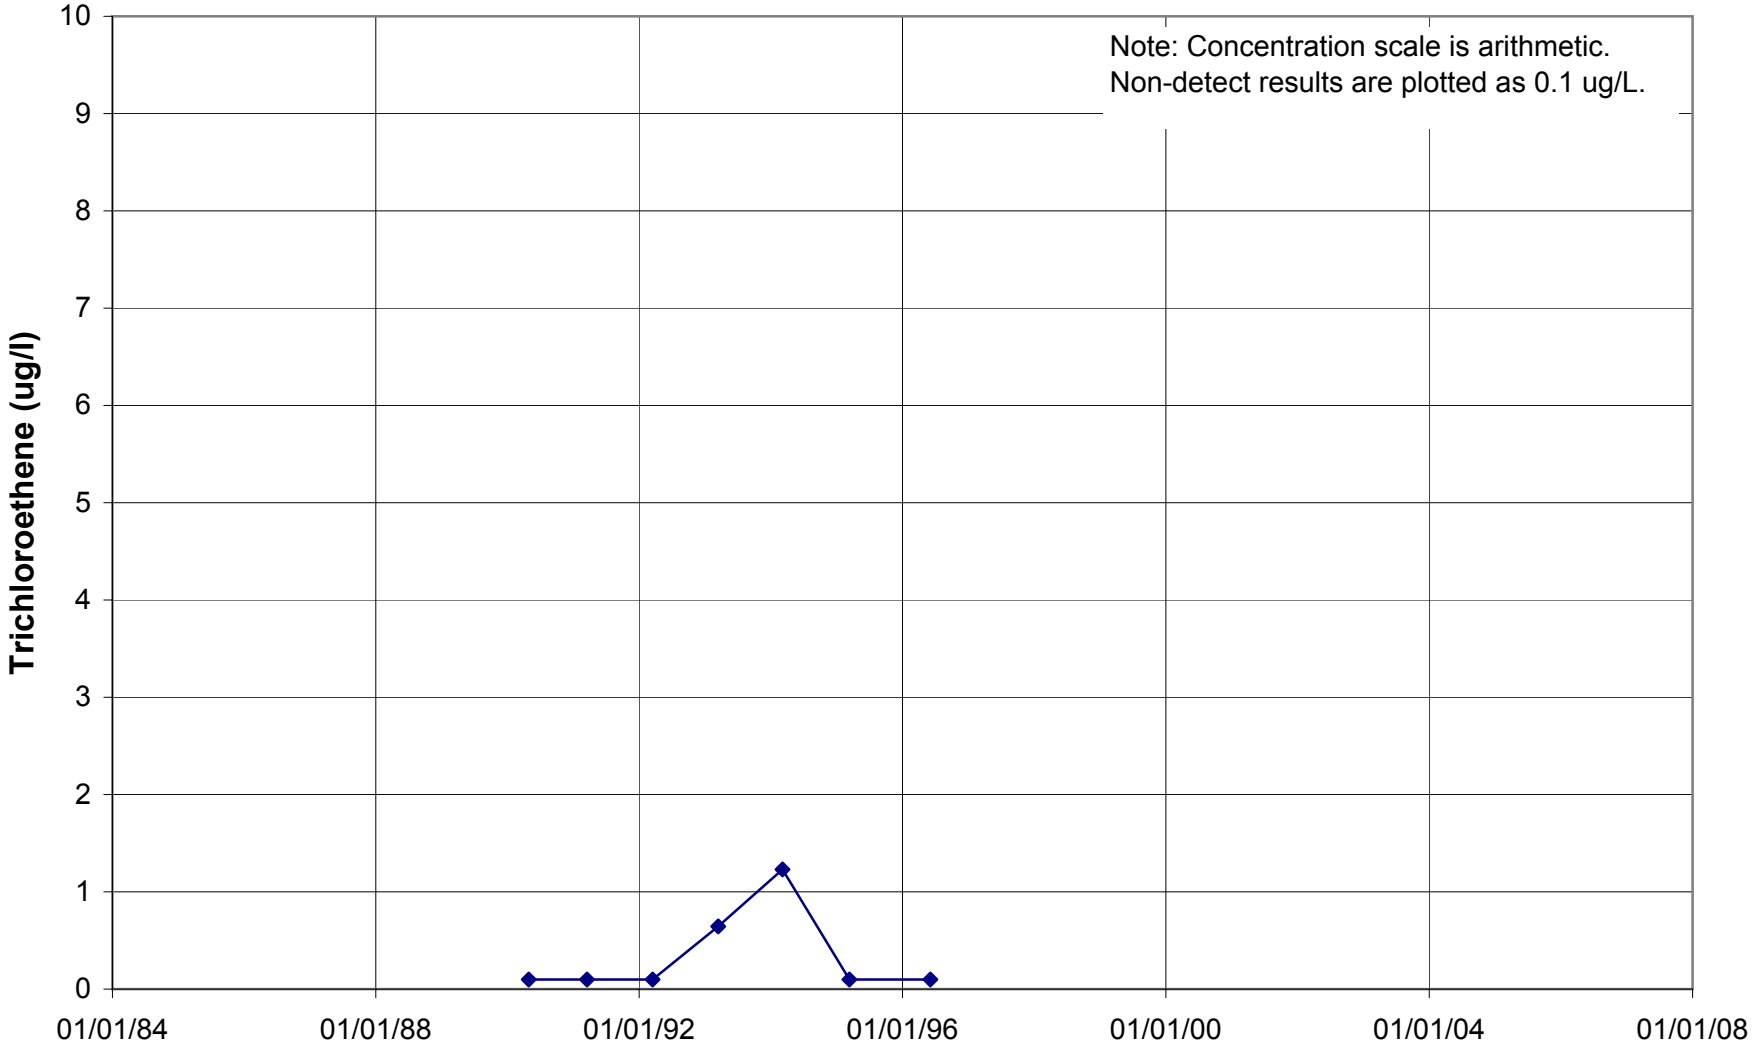

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L081

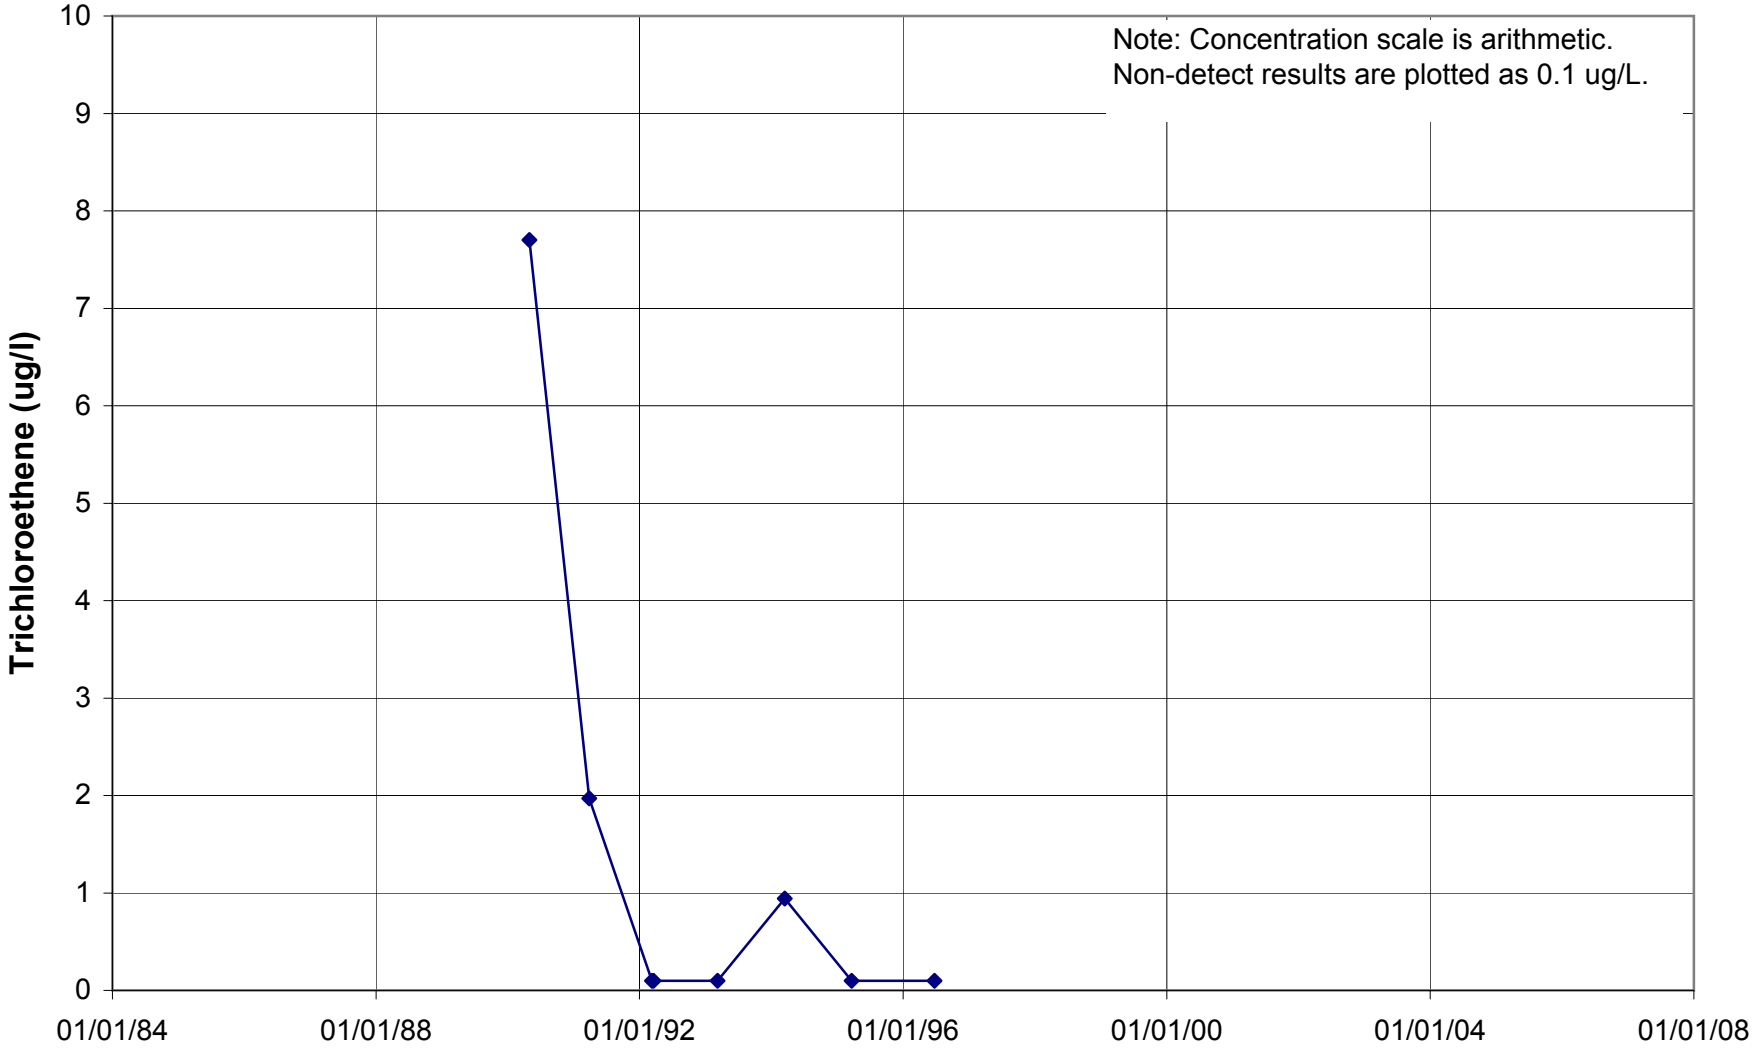

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L084

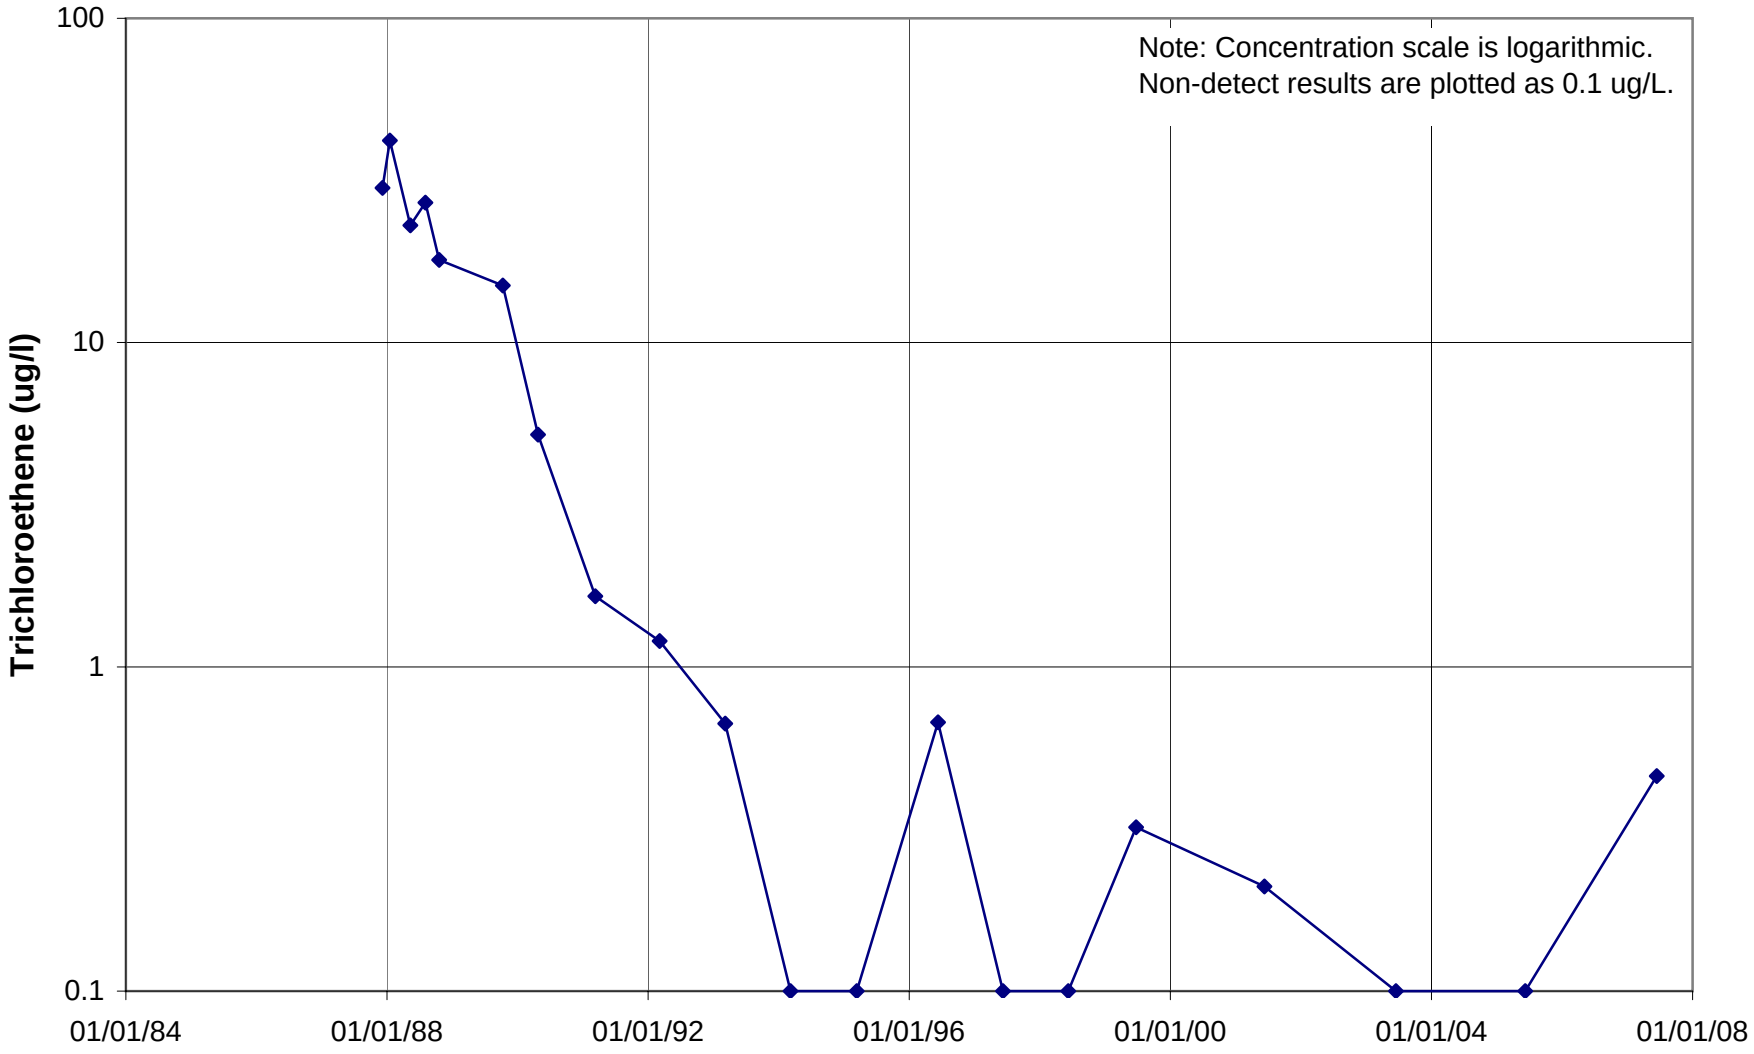

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L113

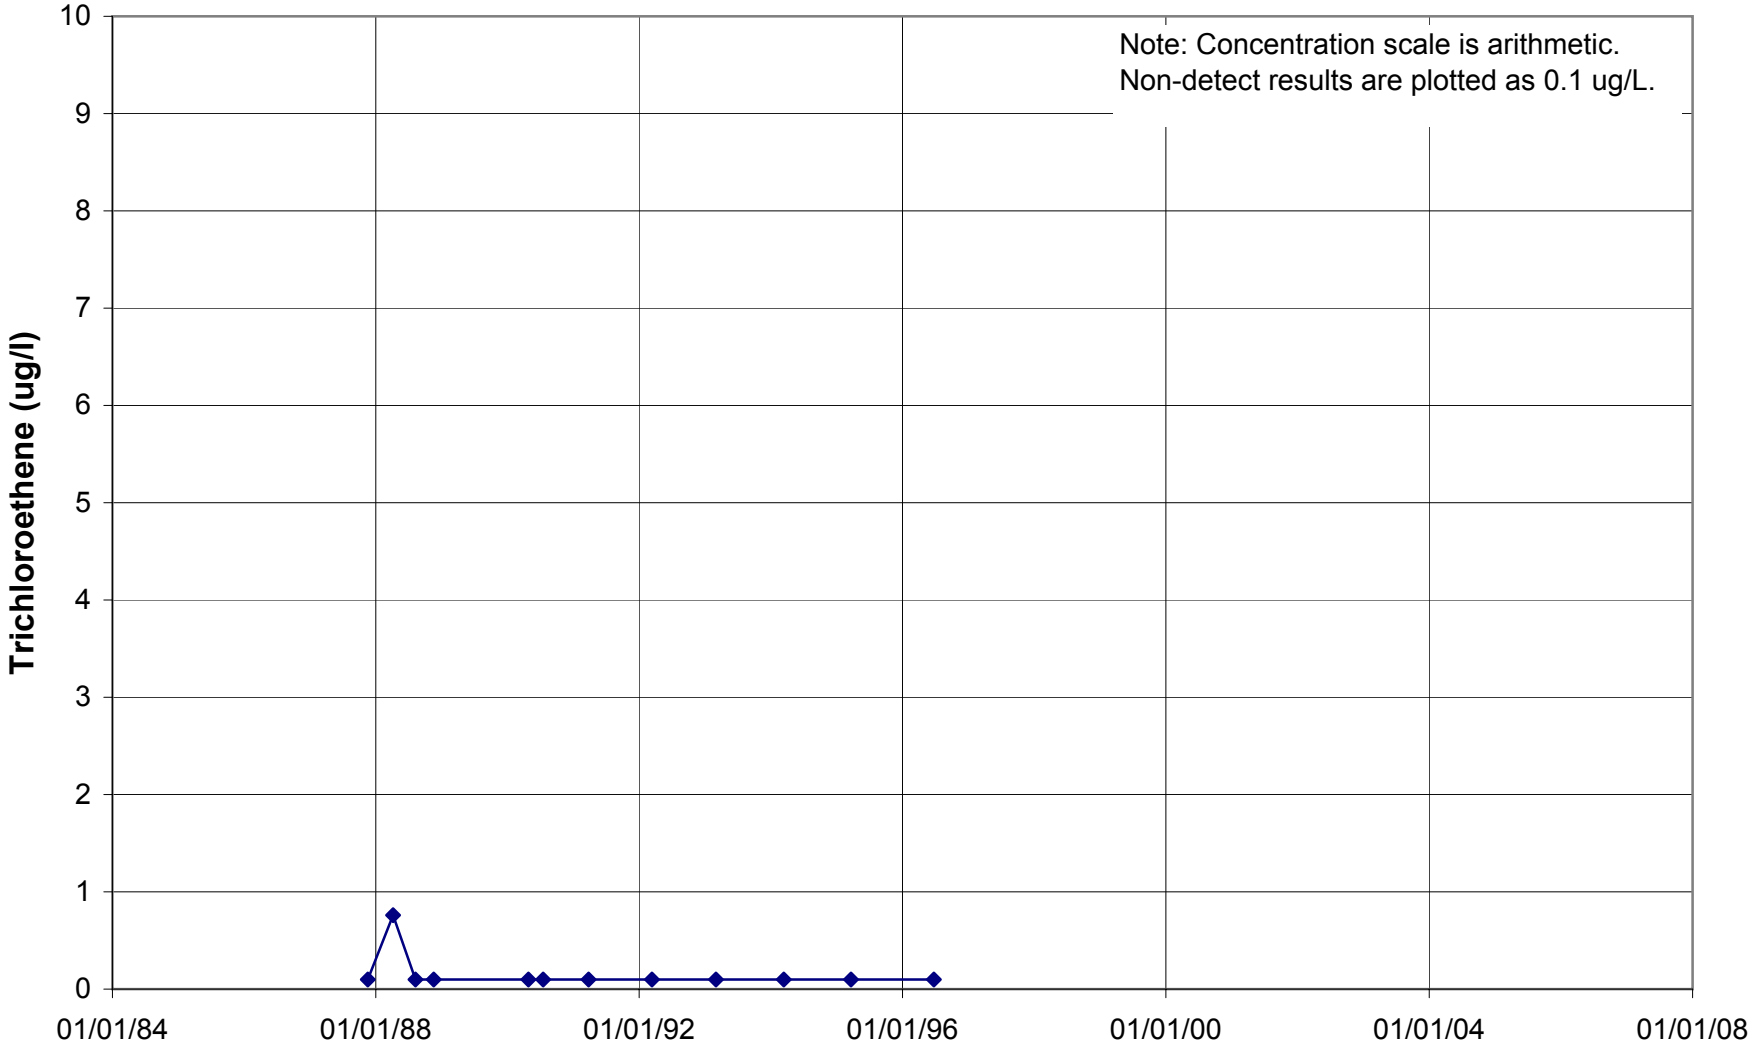

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L673

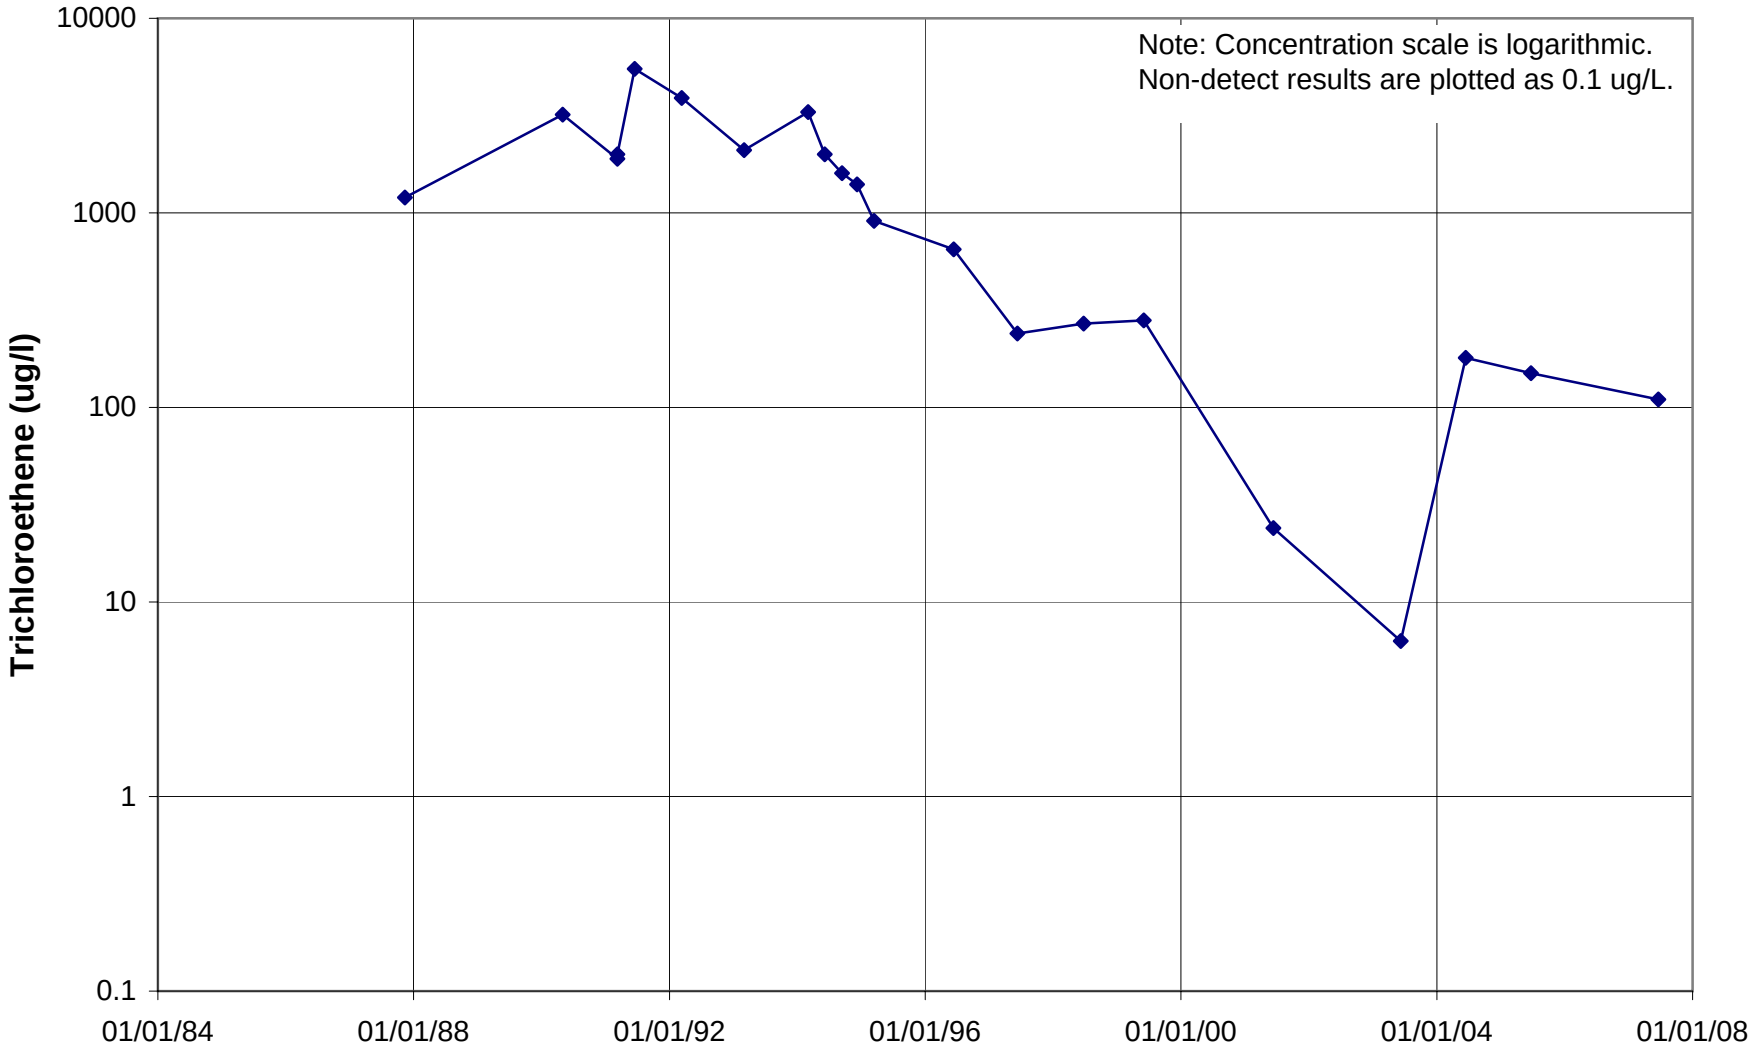

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L802

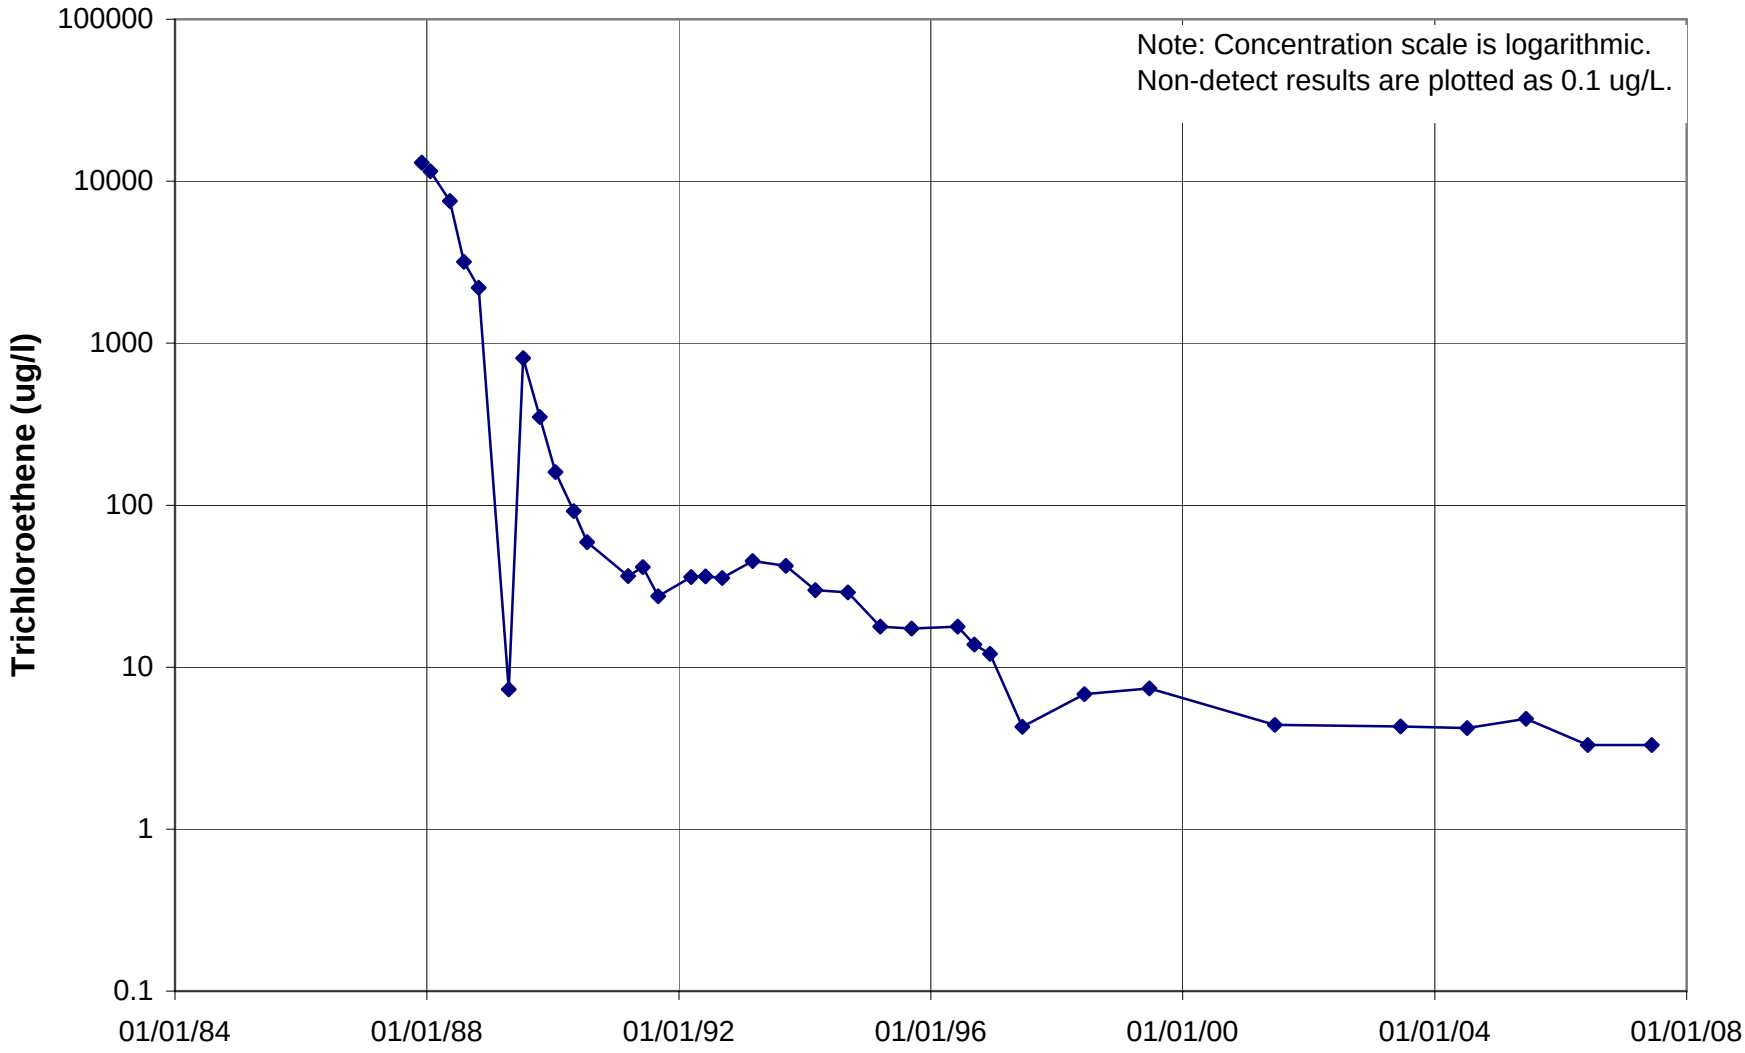

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L806

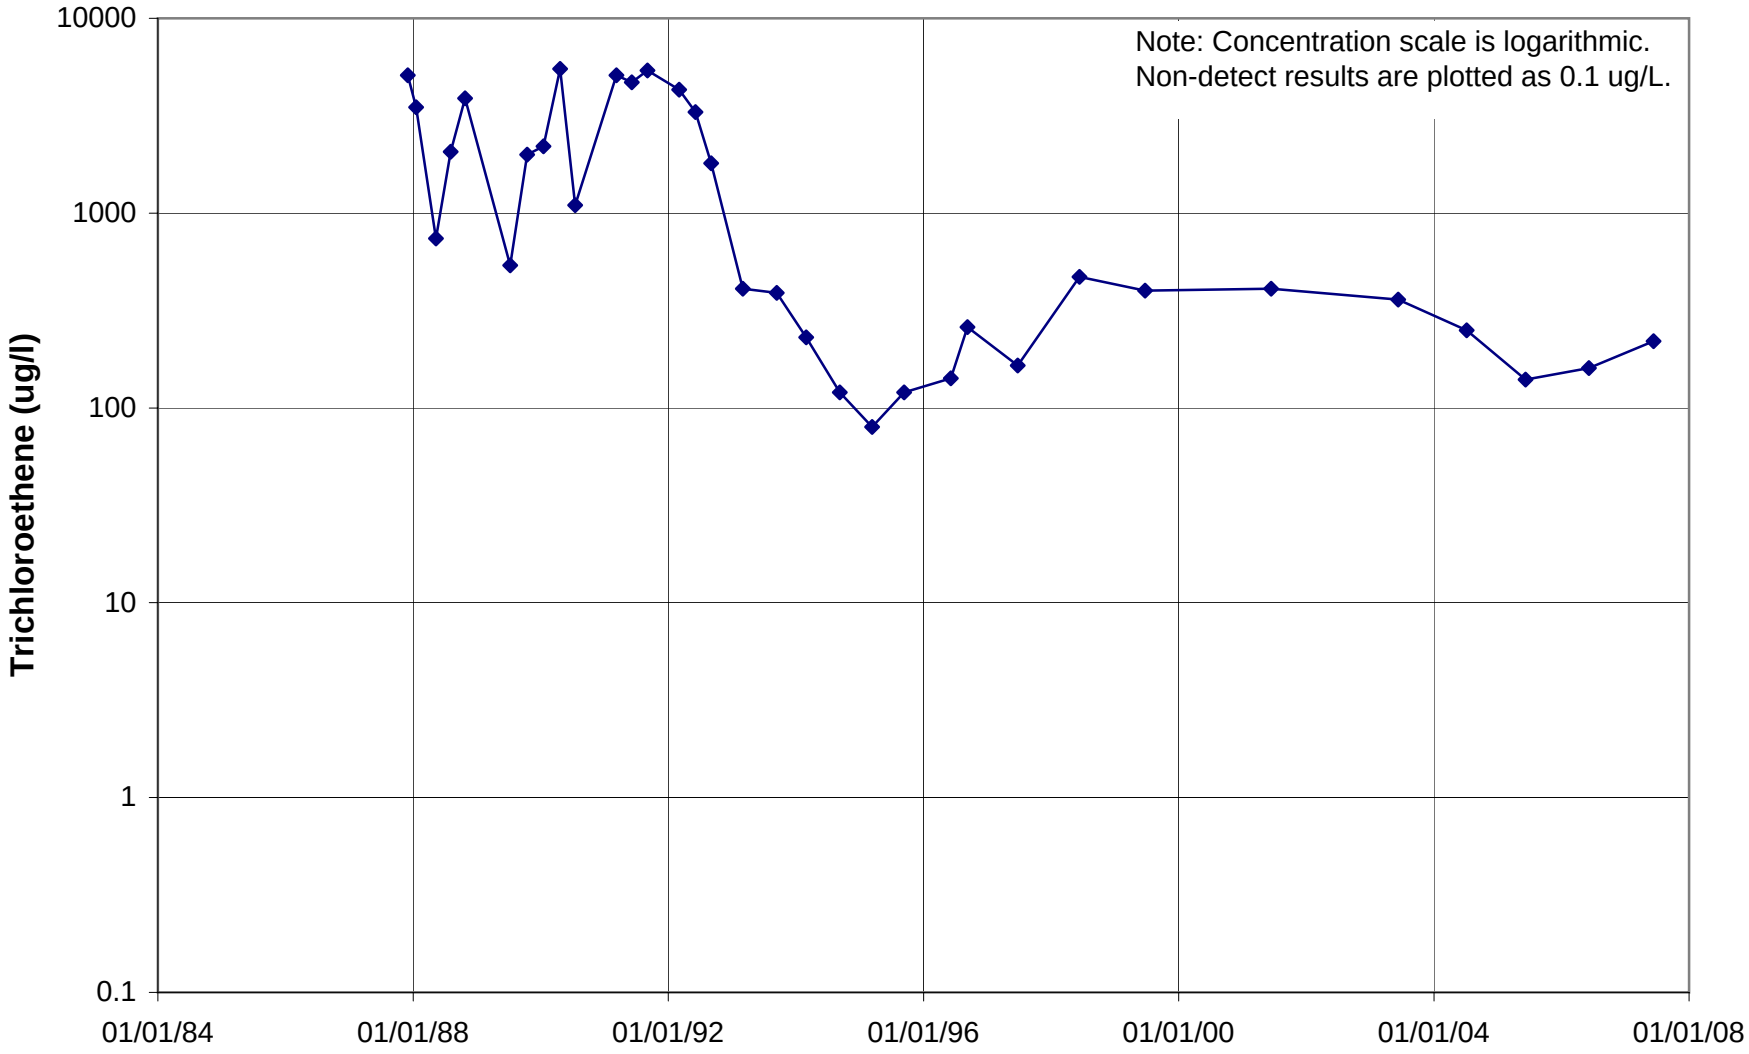

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L809

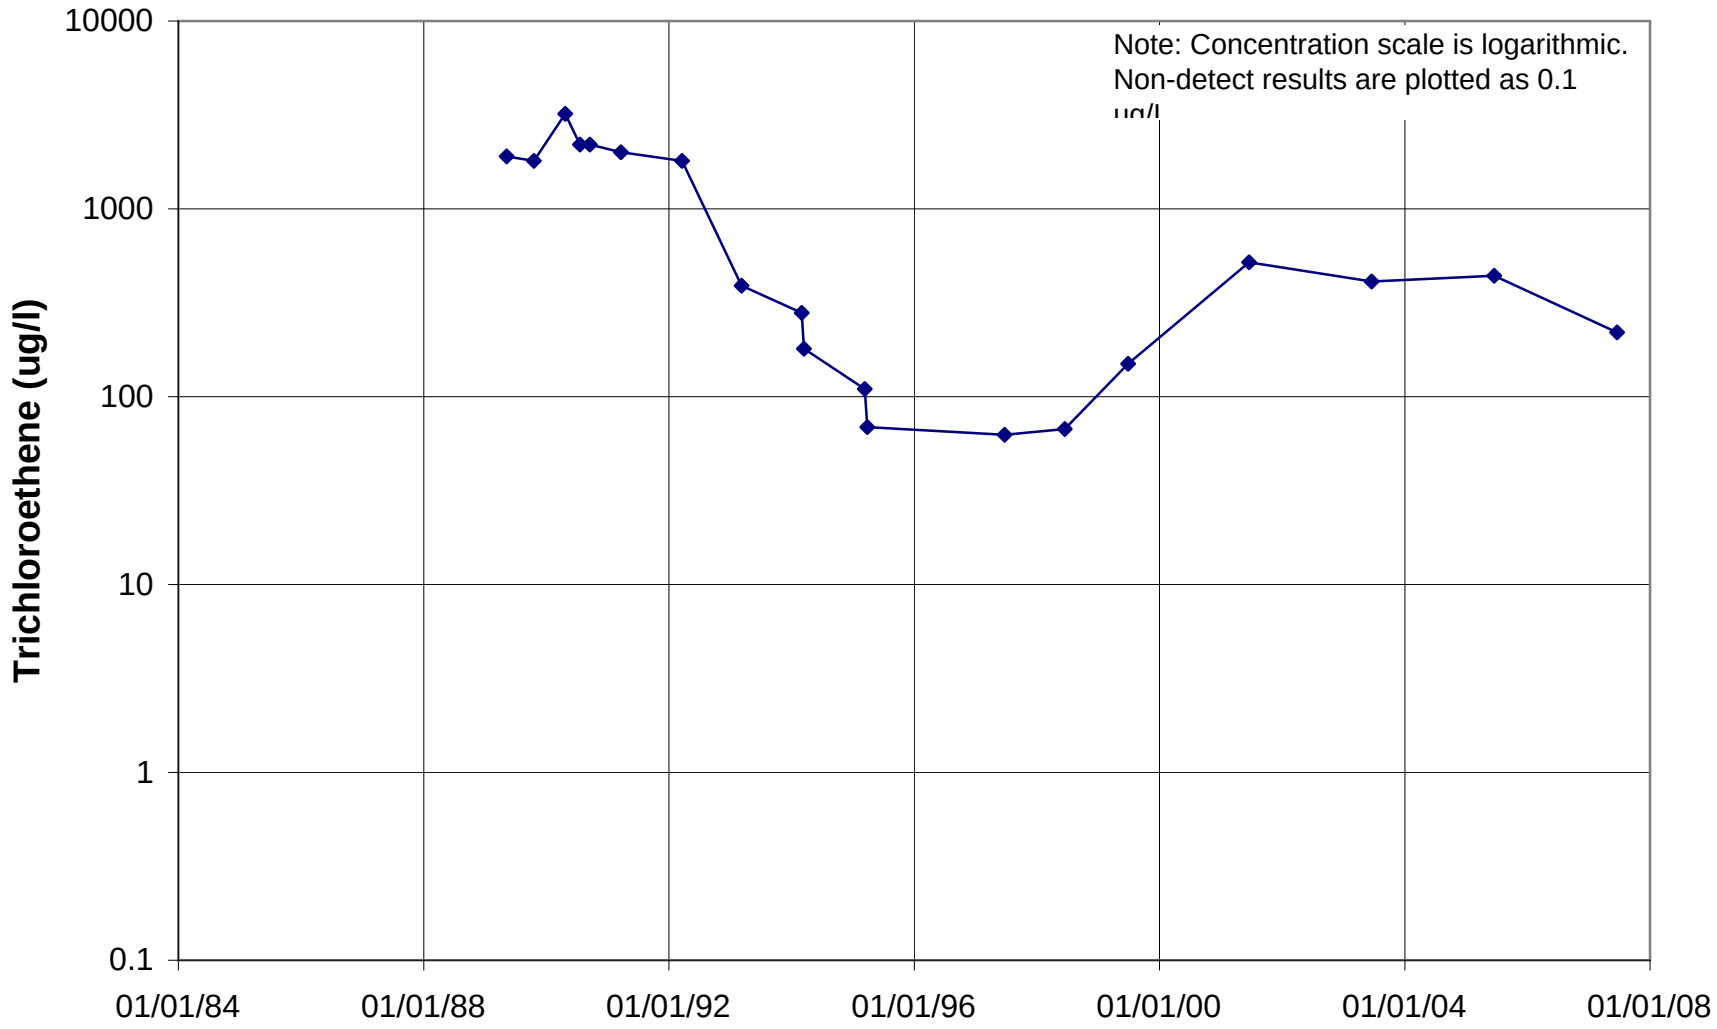

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L811

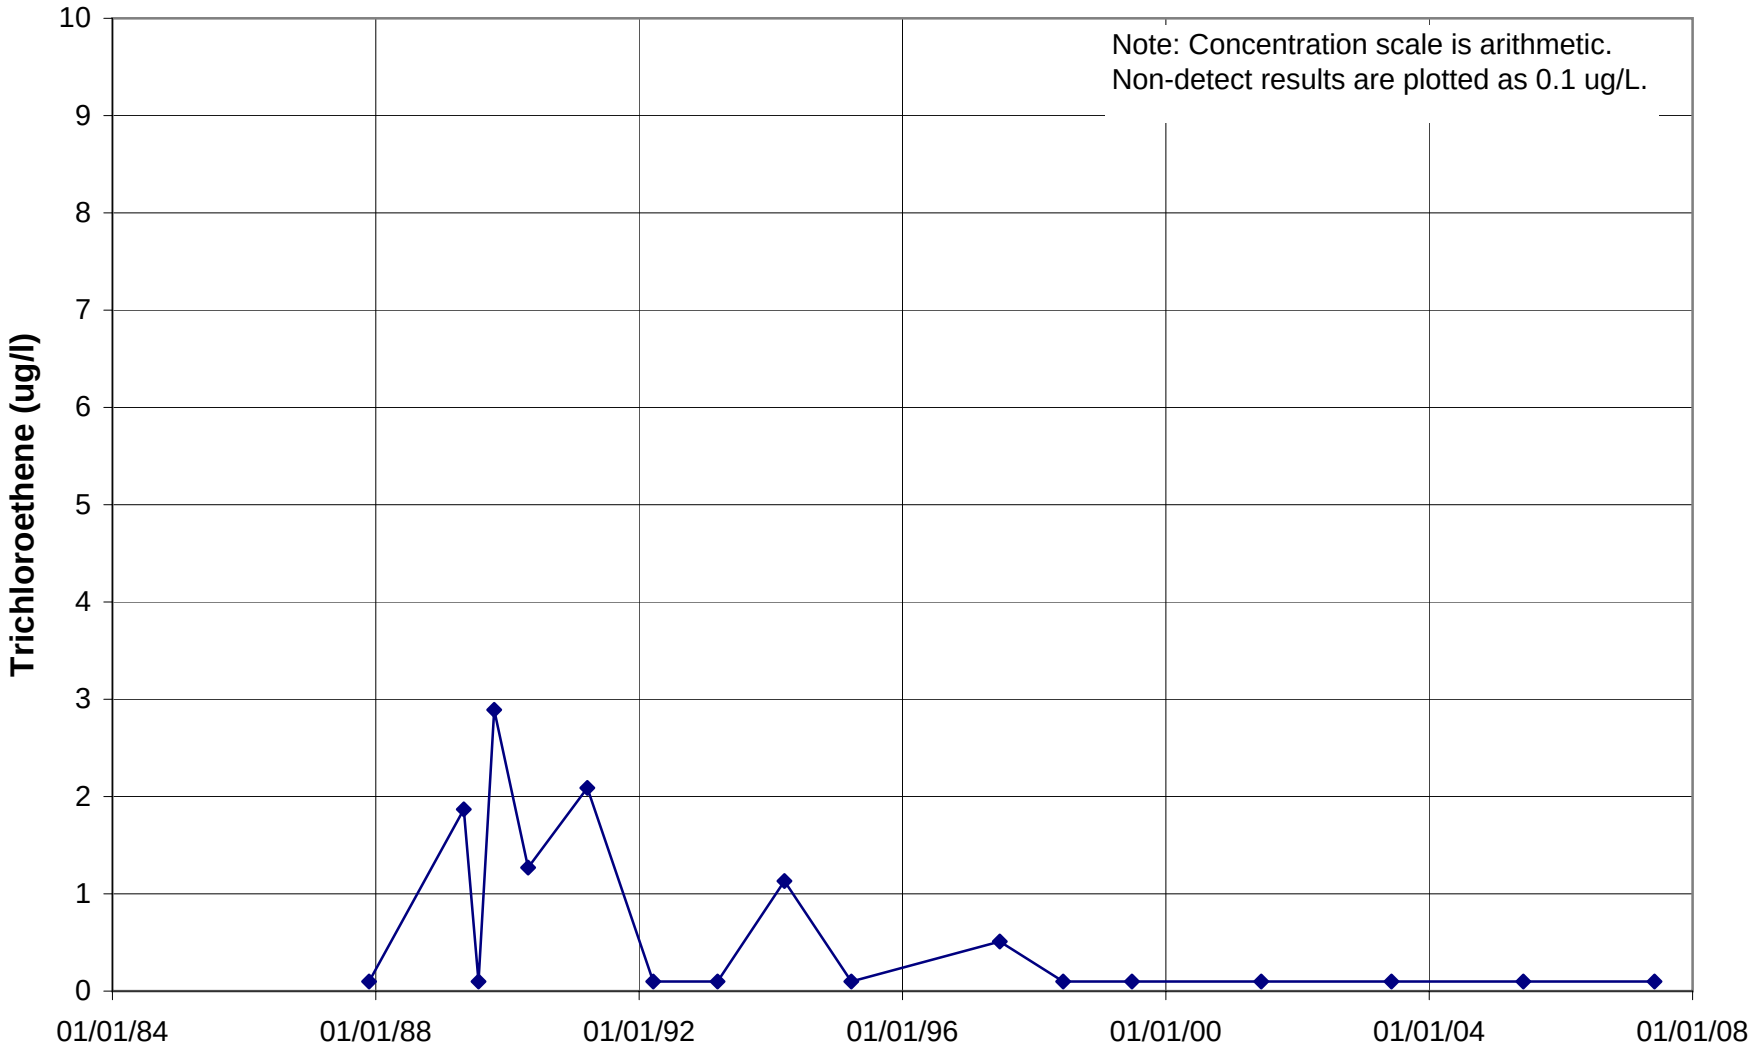

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L822

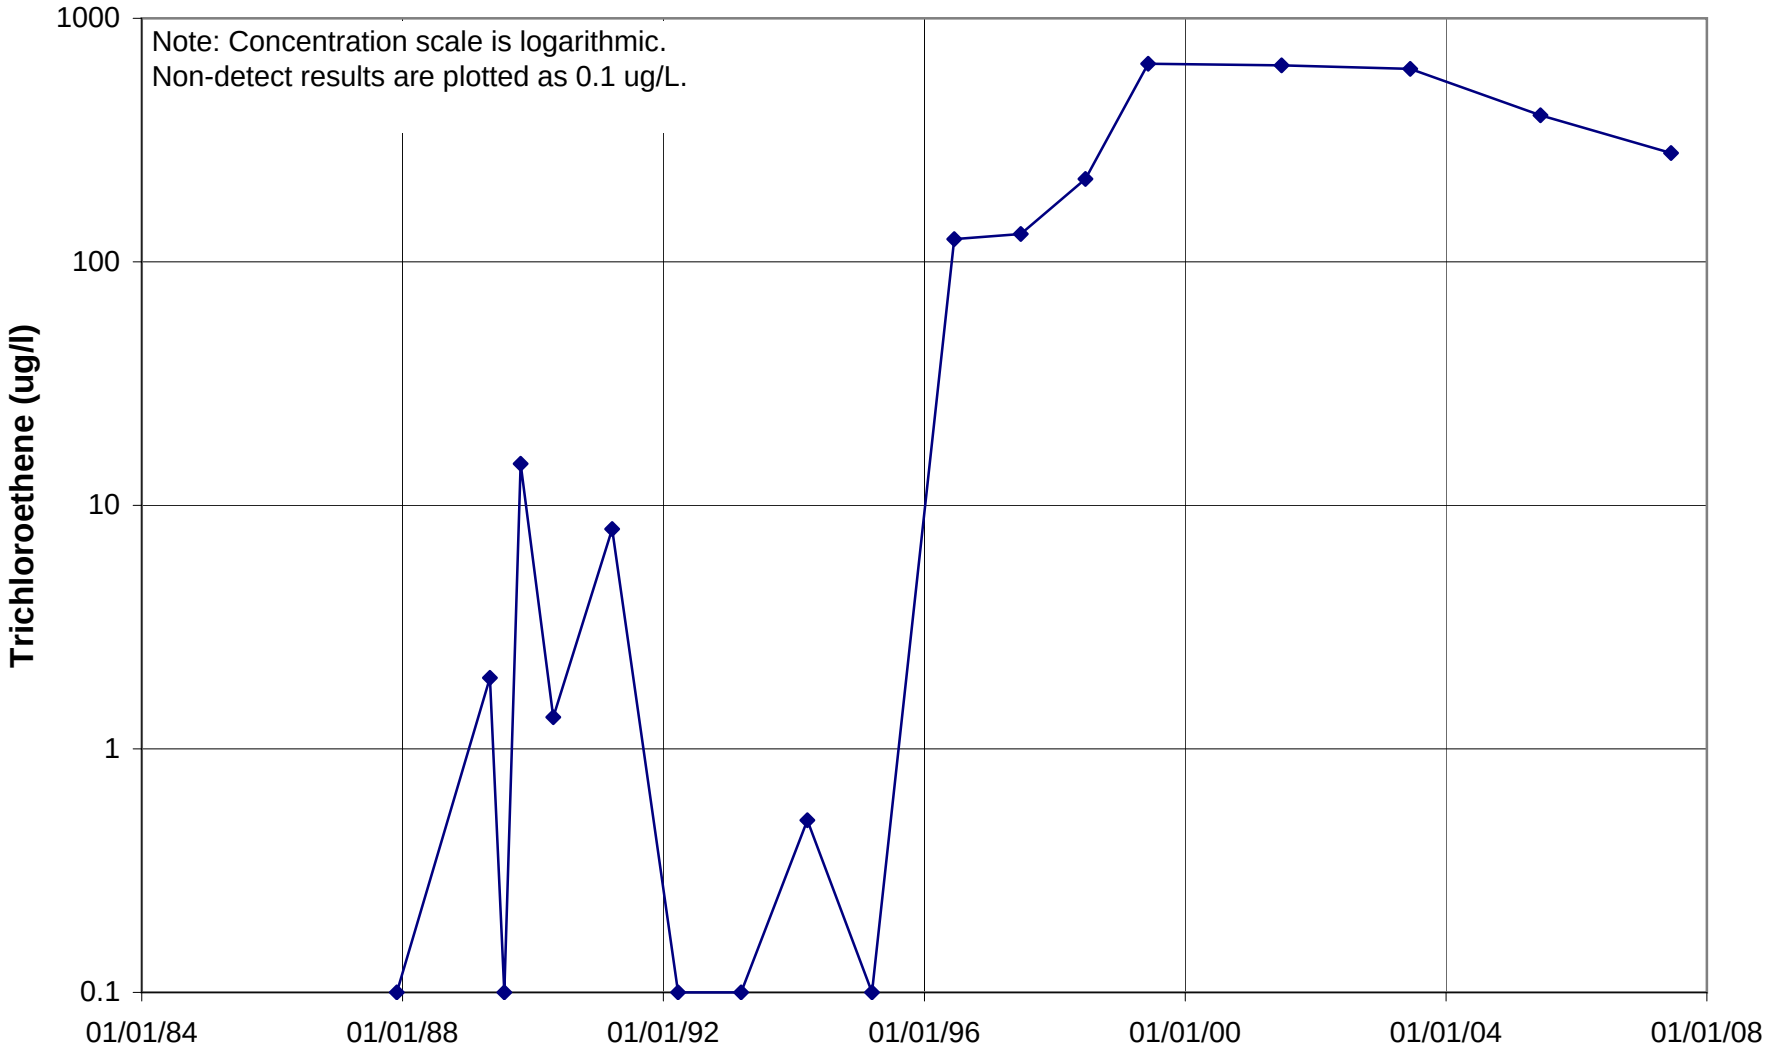

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L832

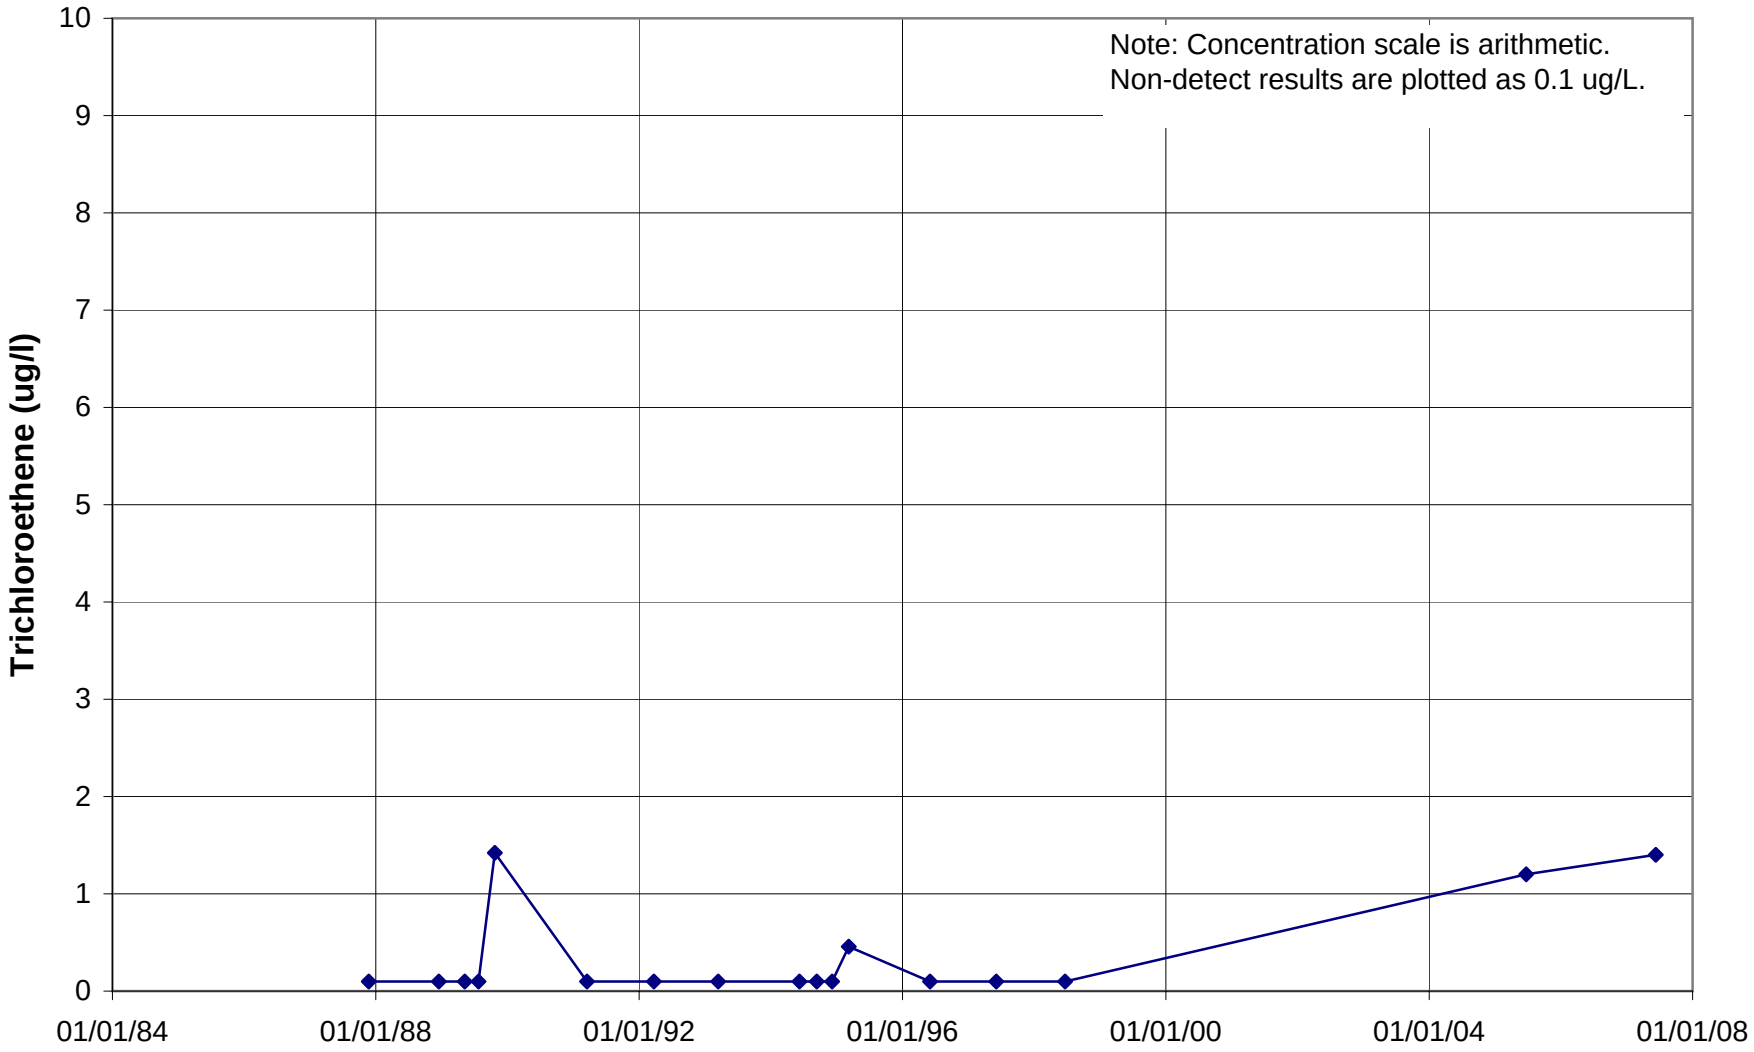

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L833

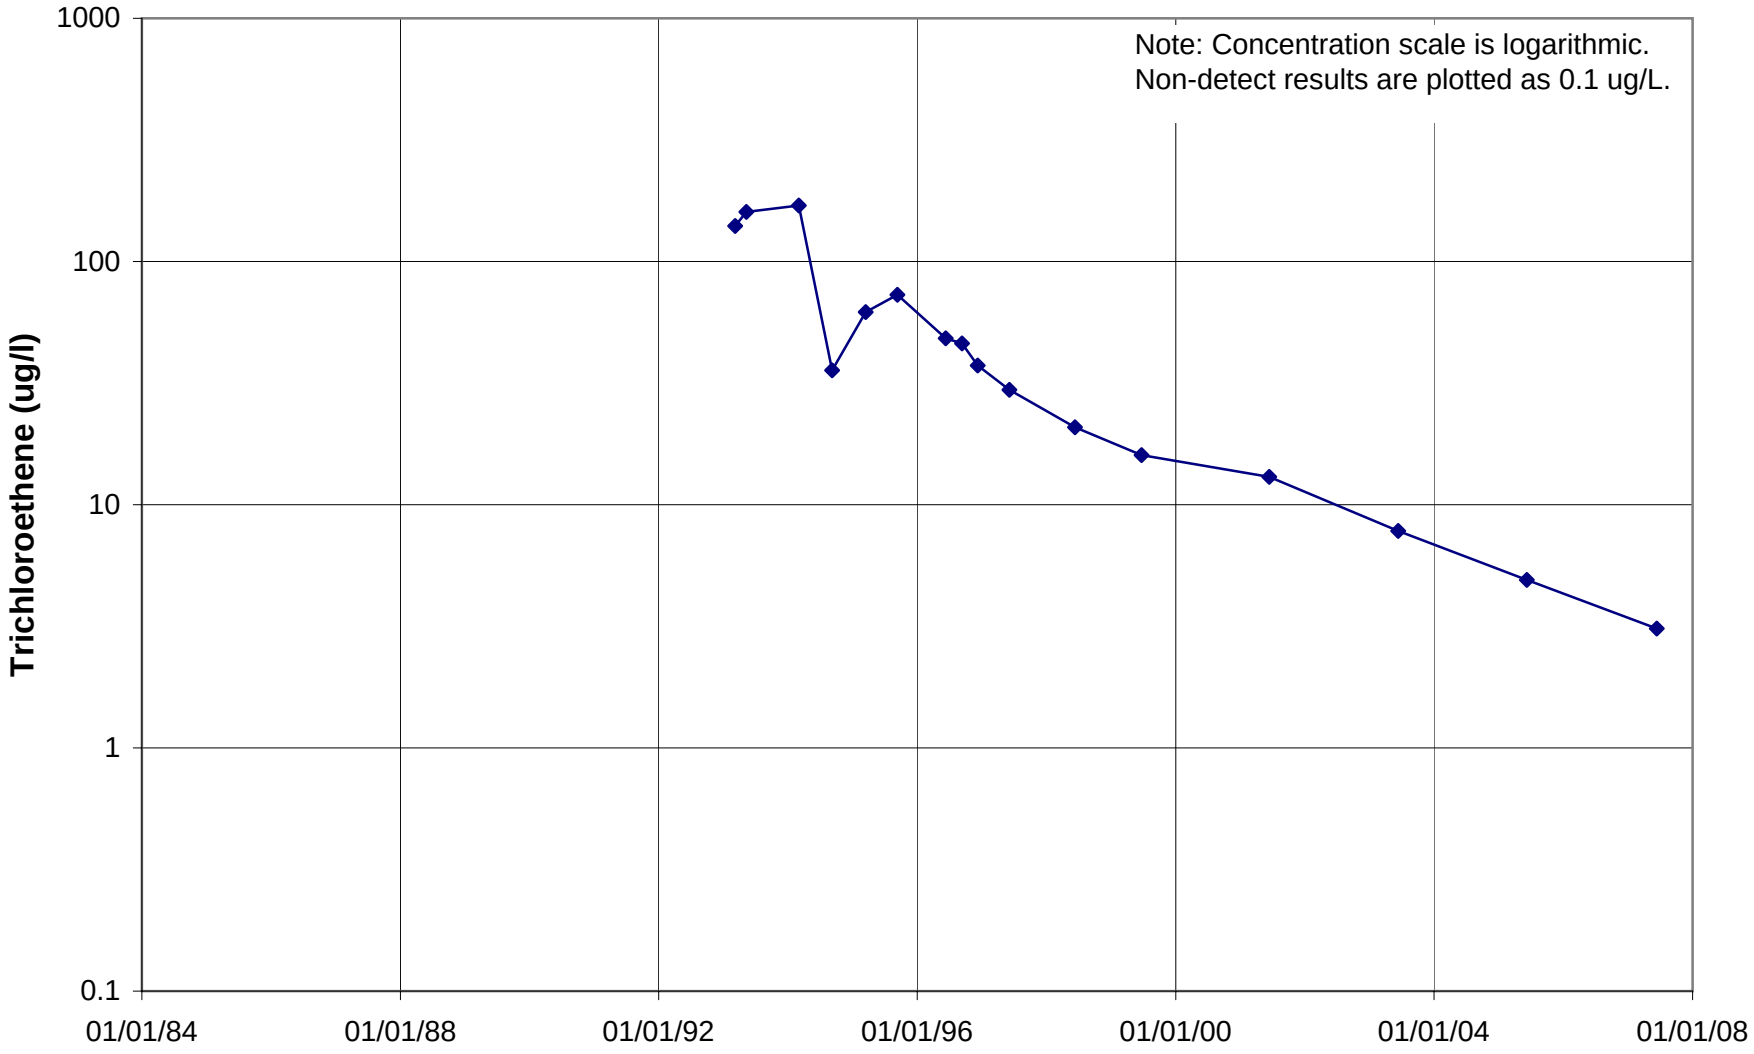

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L841

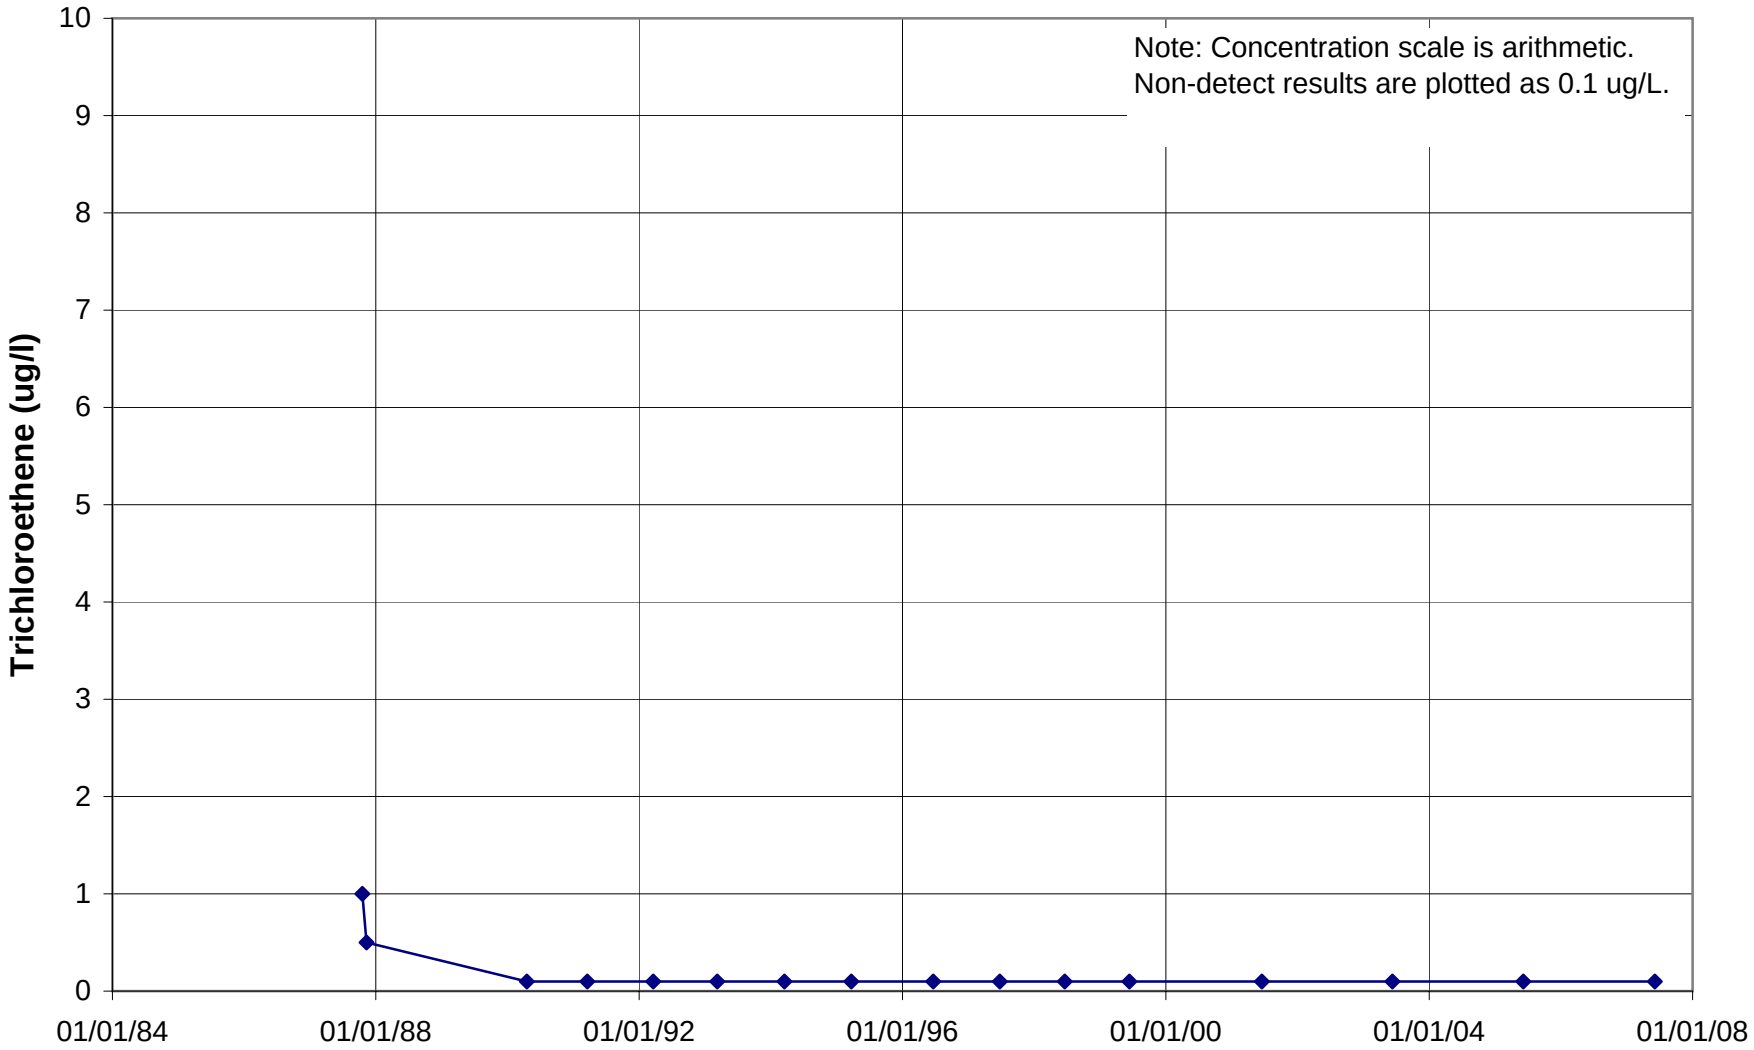

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L846

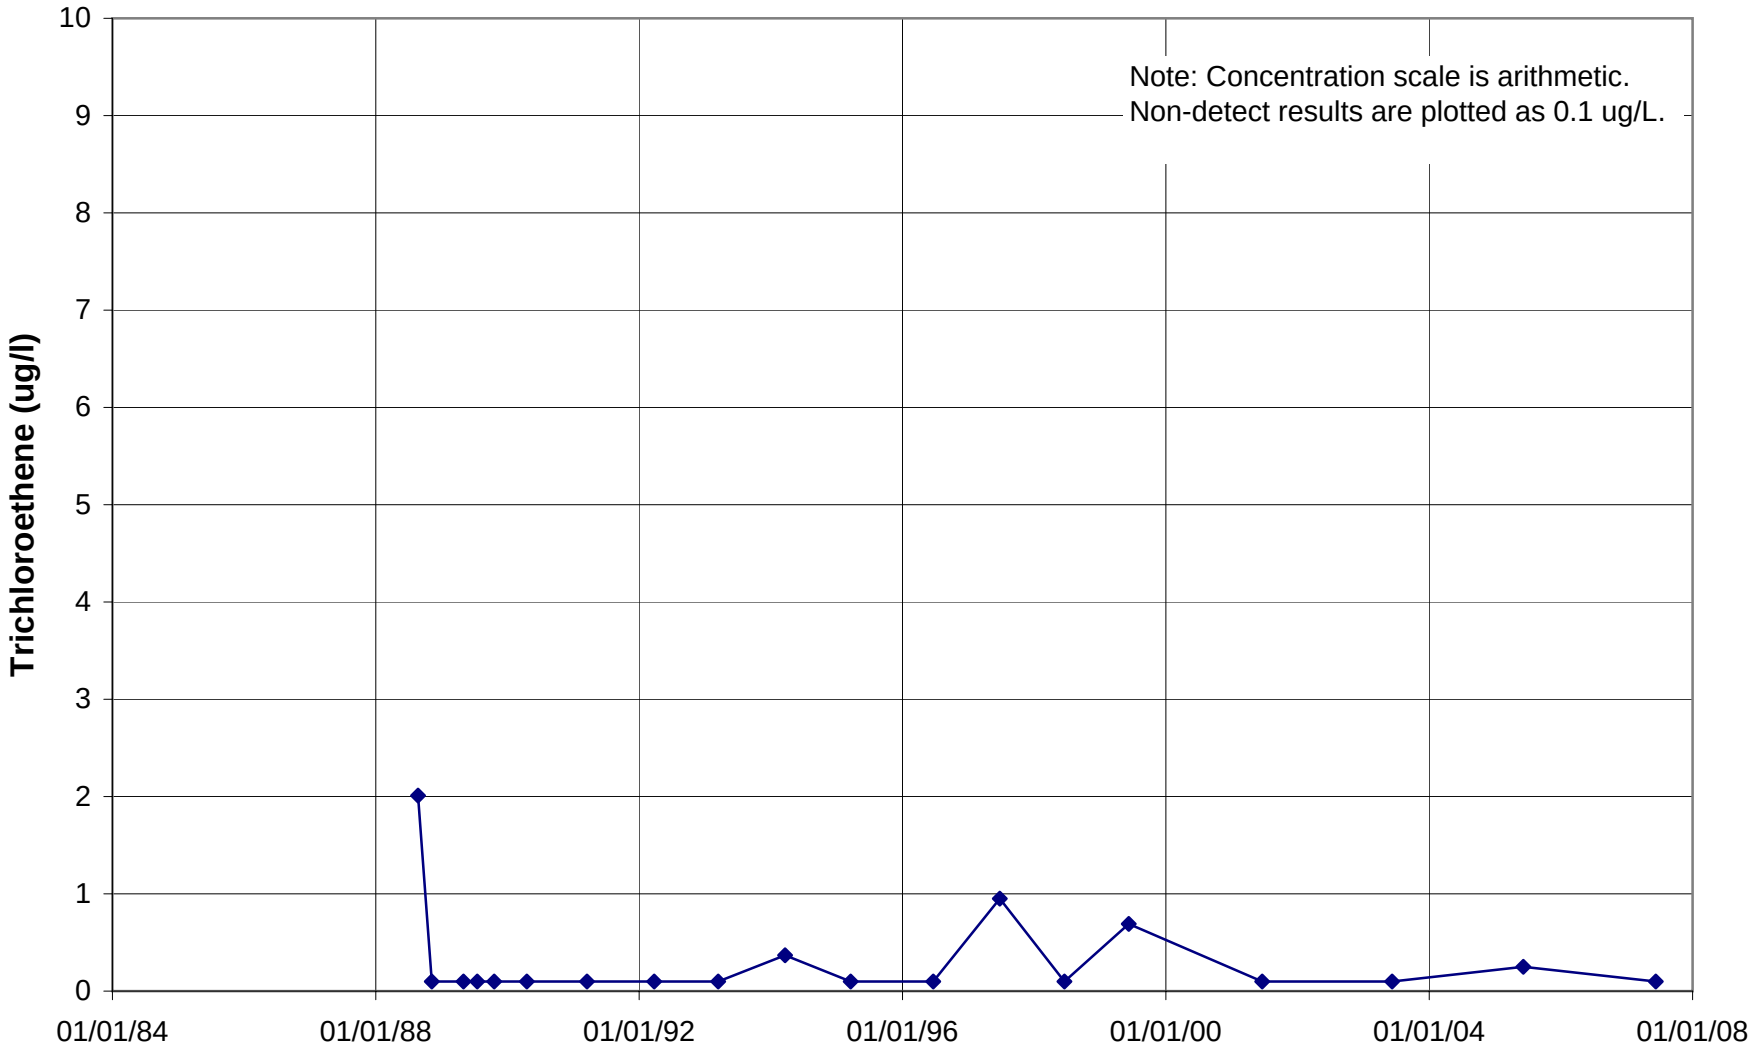

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L848

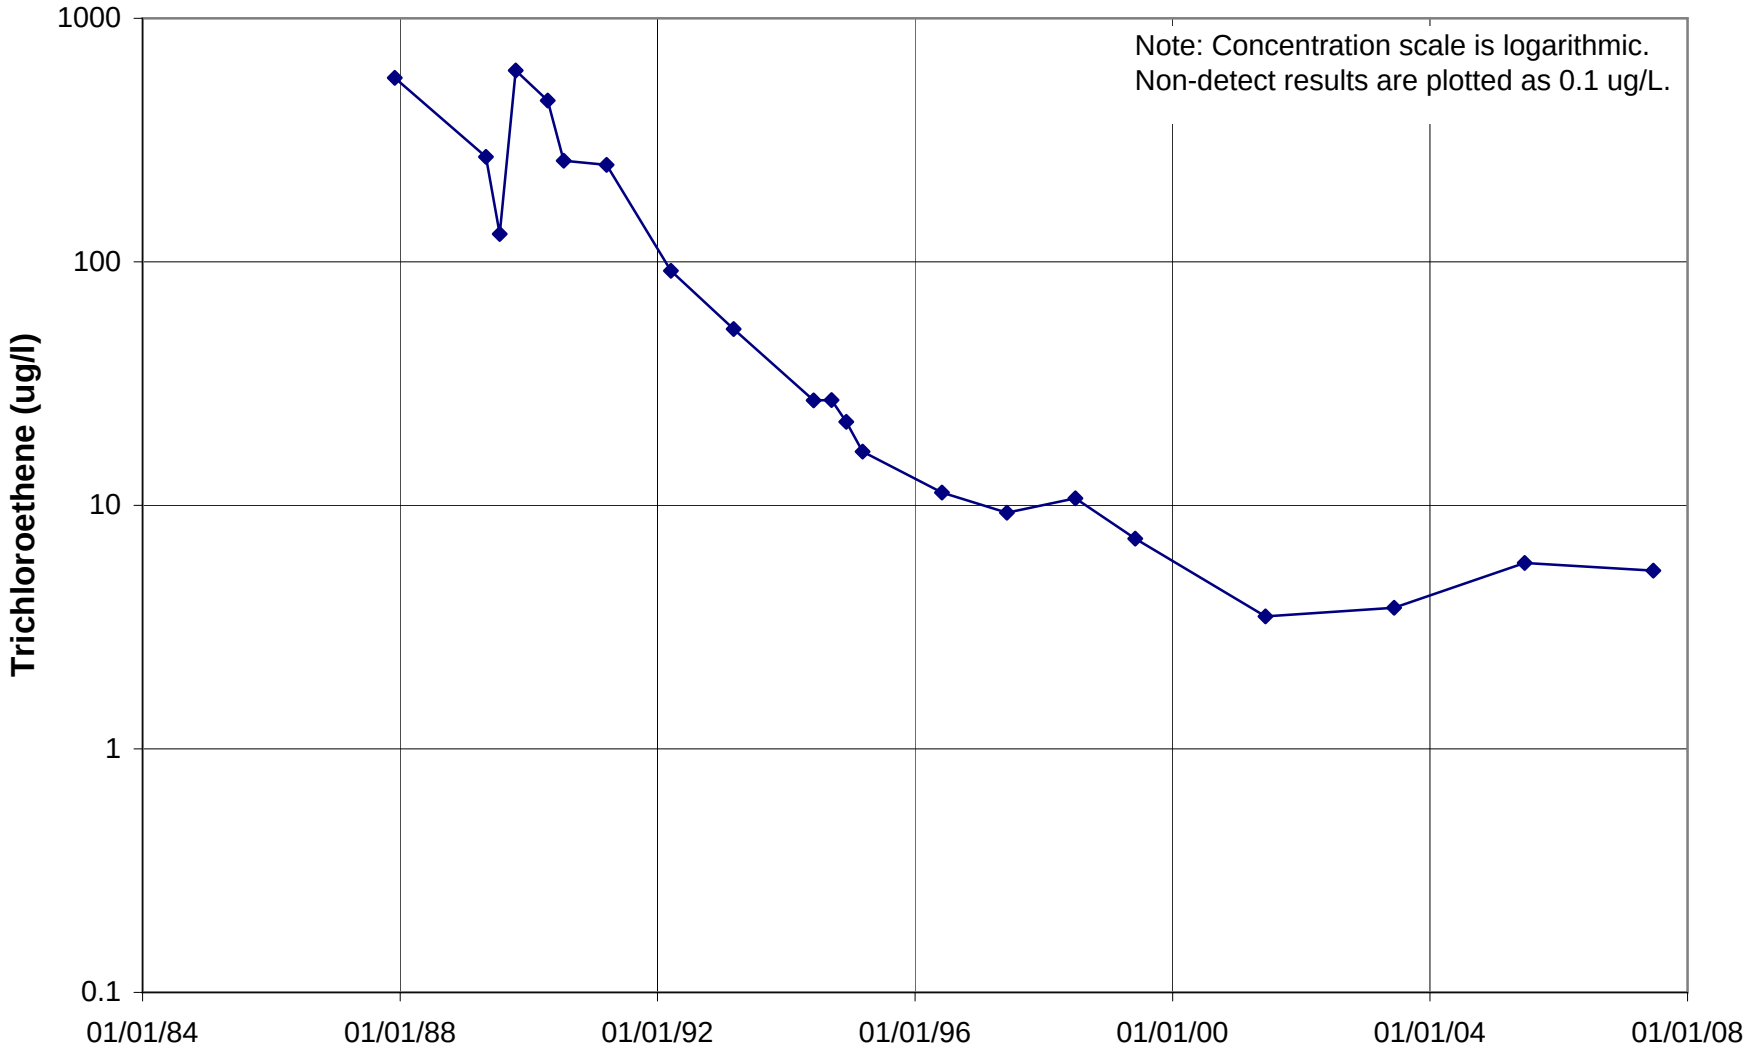

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L853

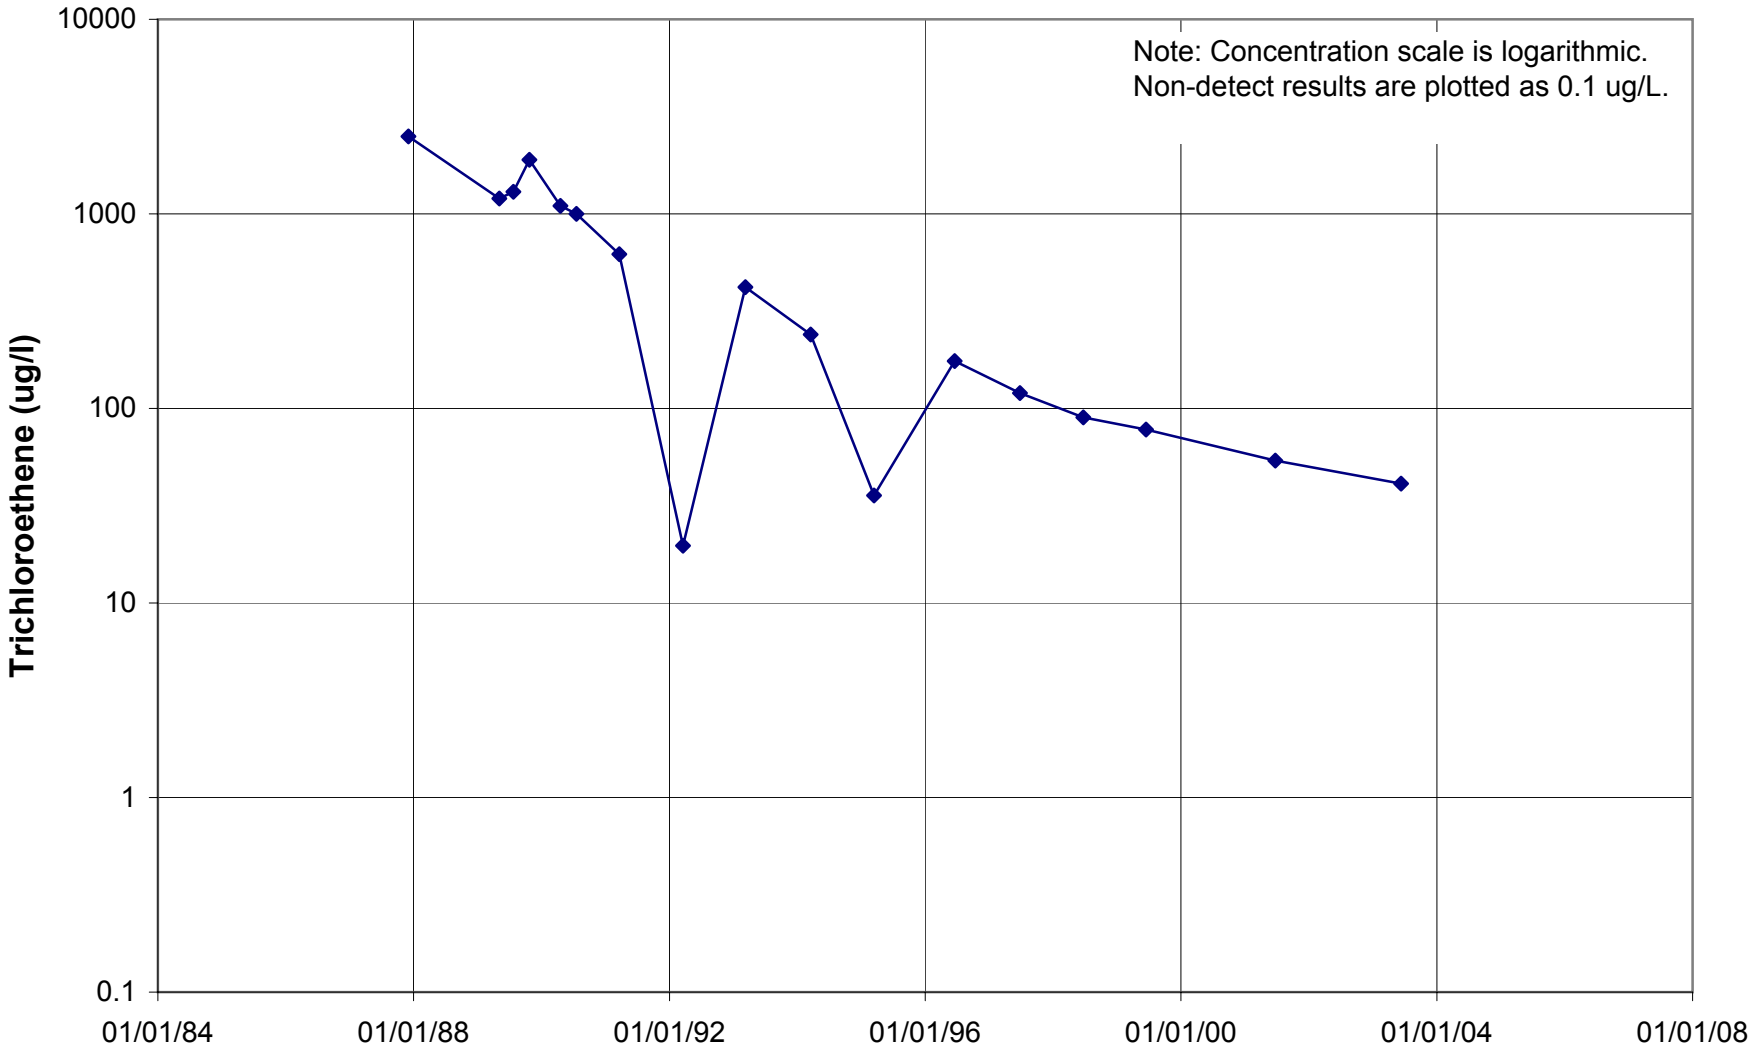

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L854

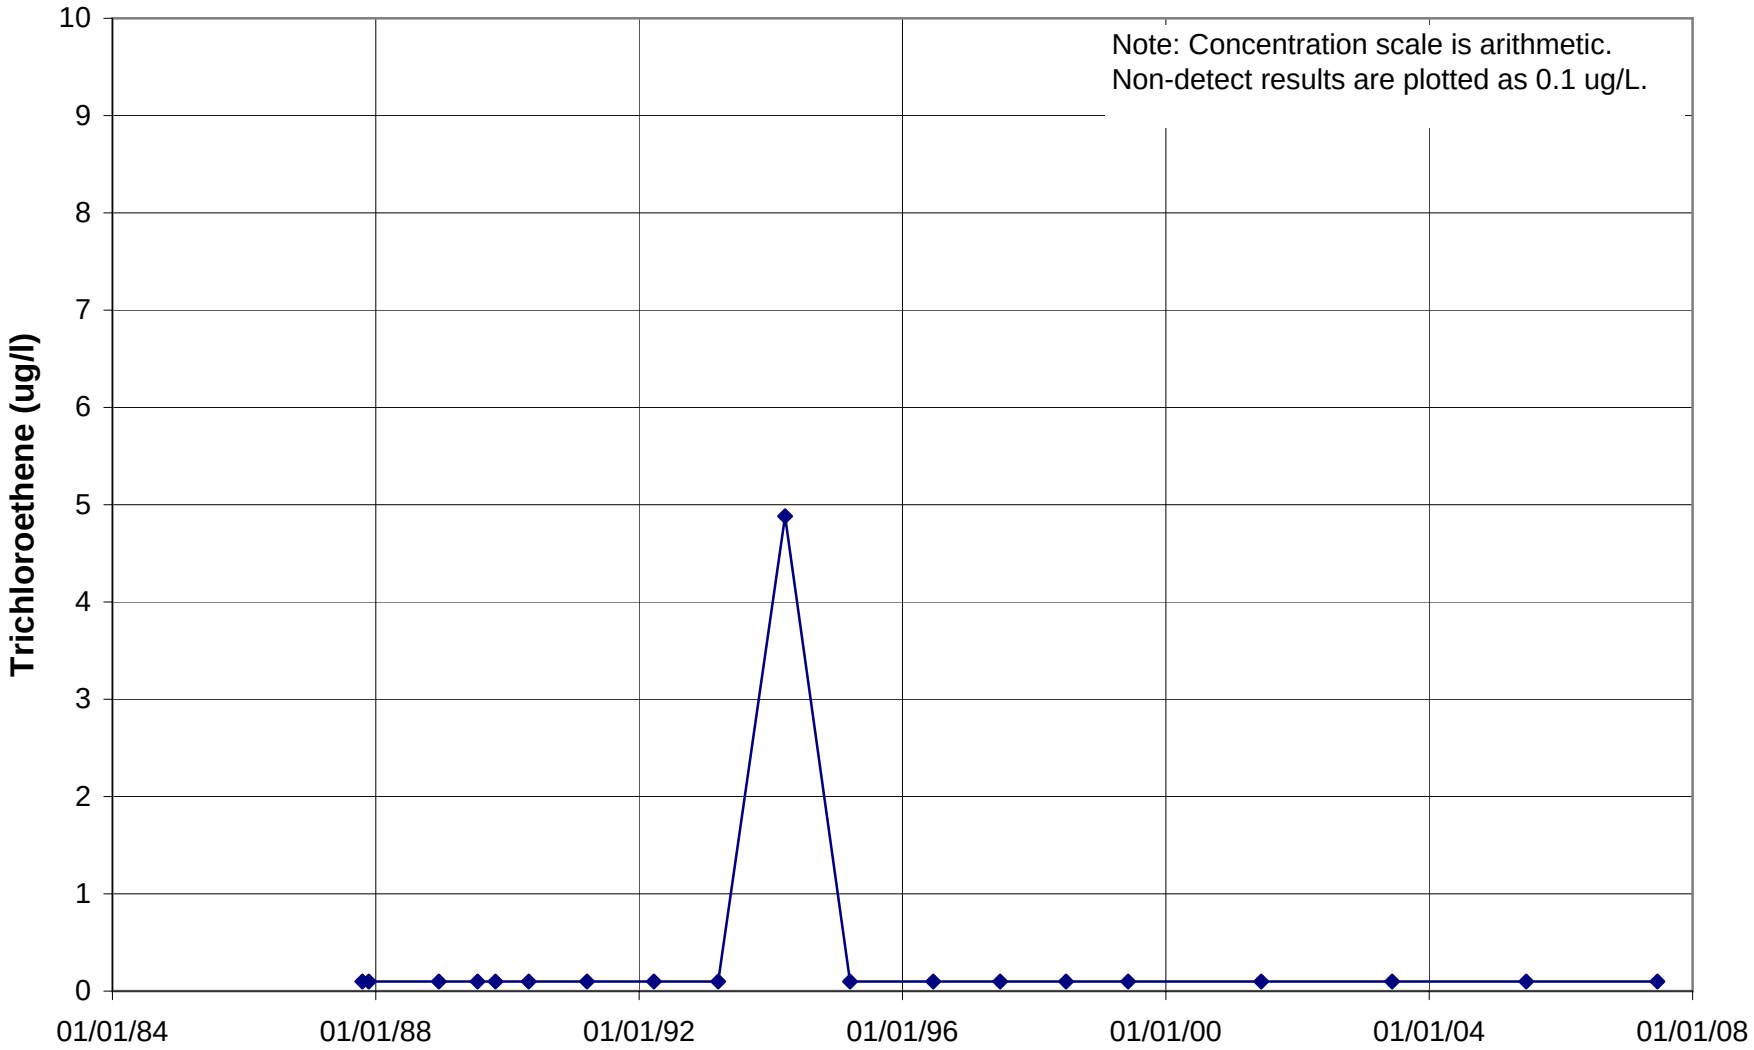

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L859

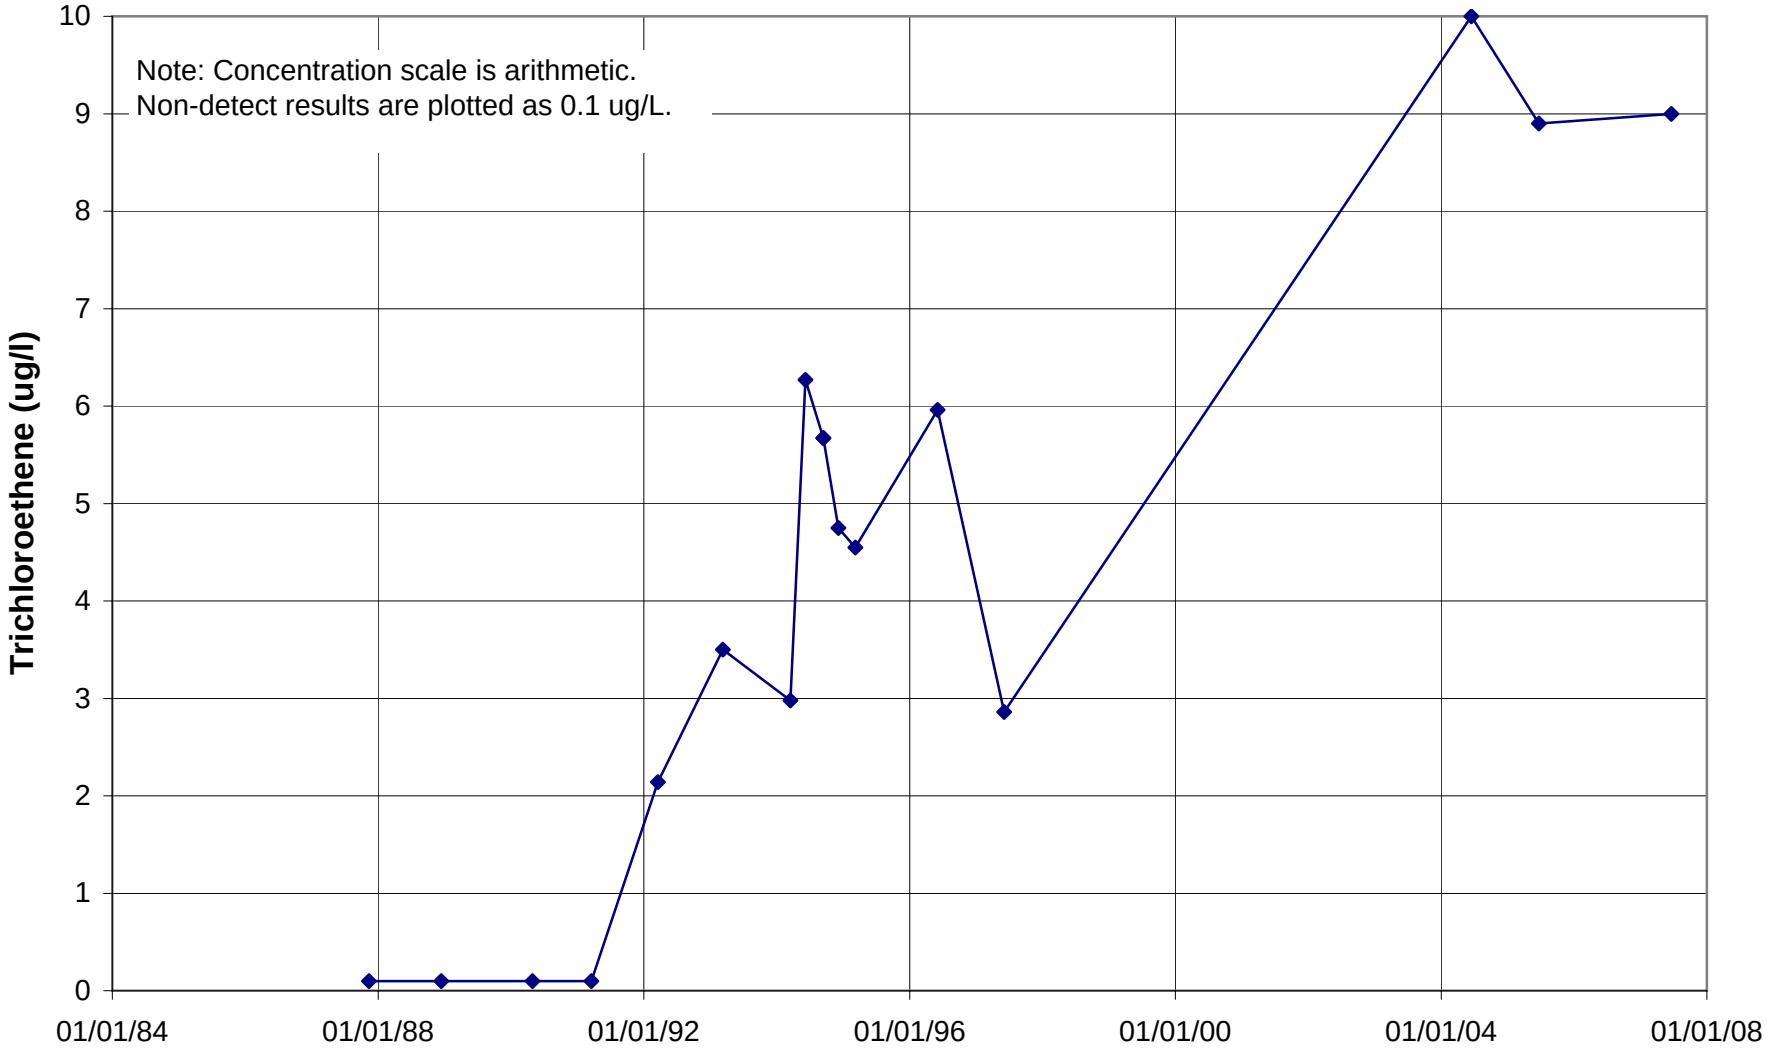

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L860

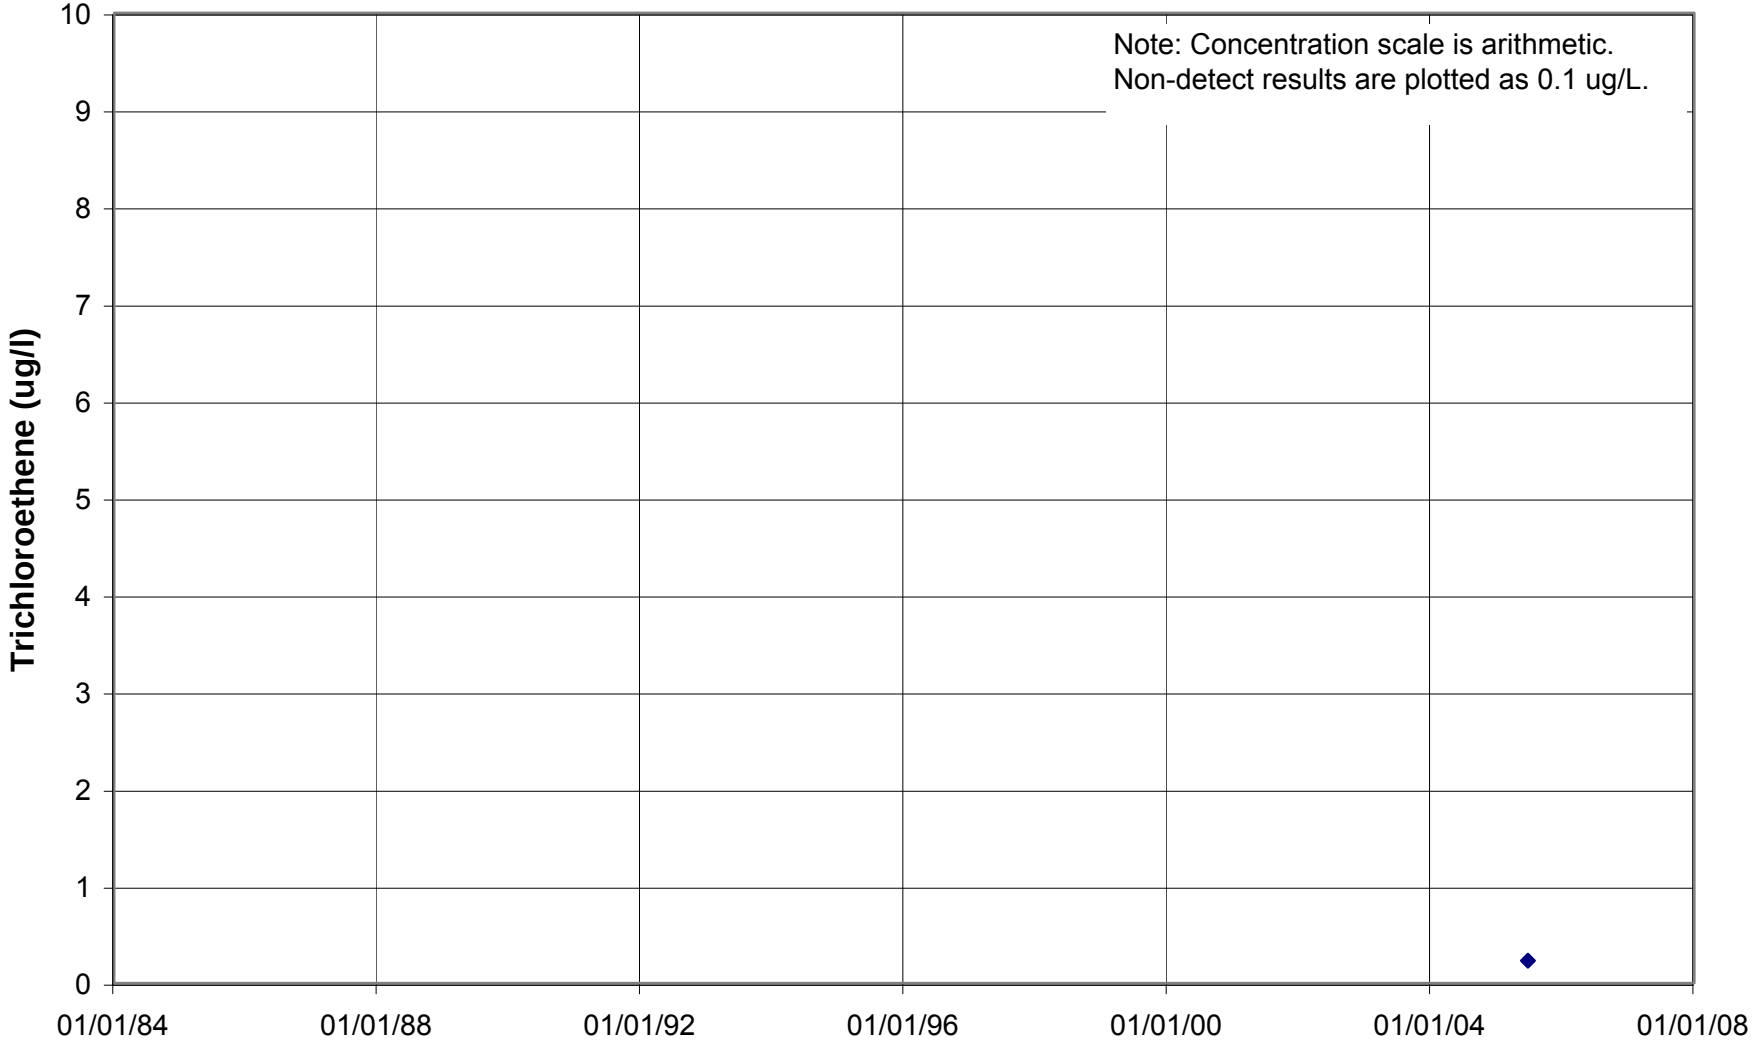

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03L861

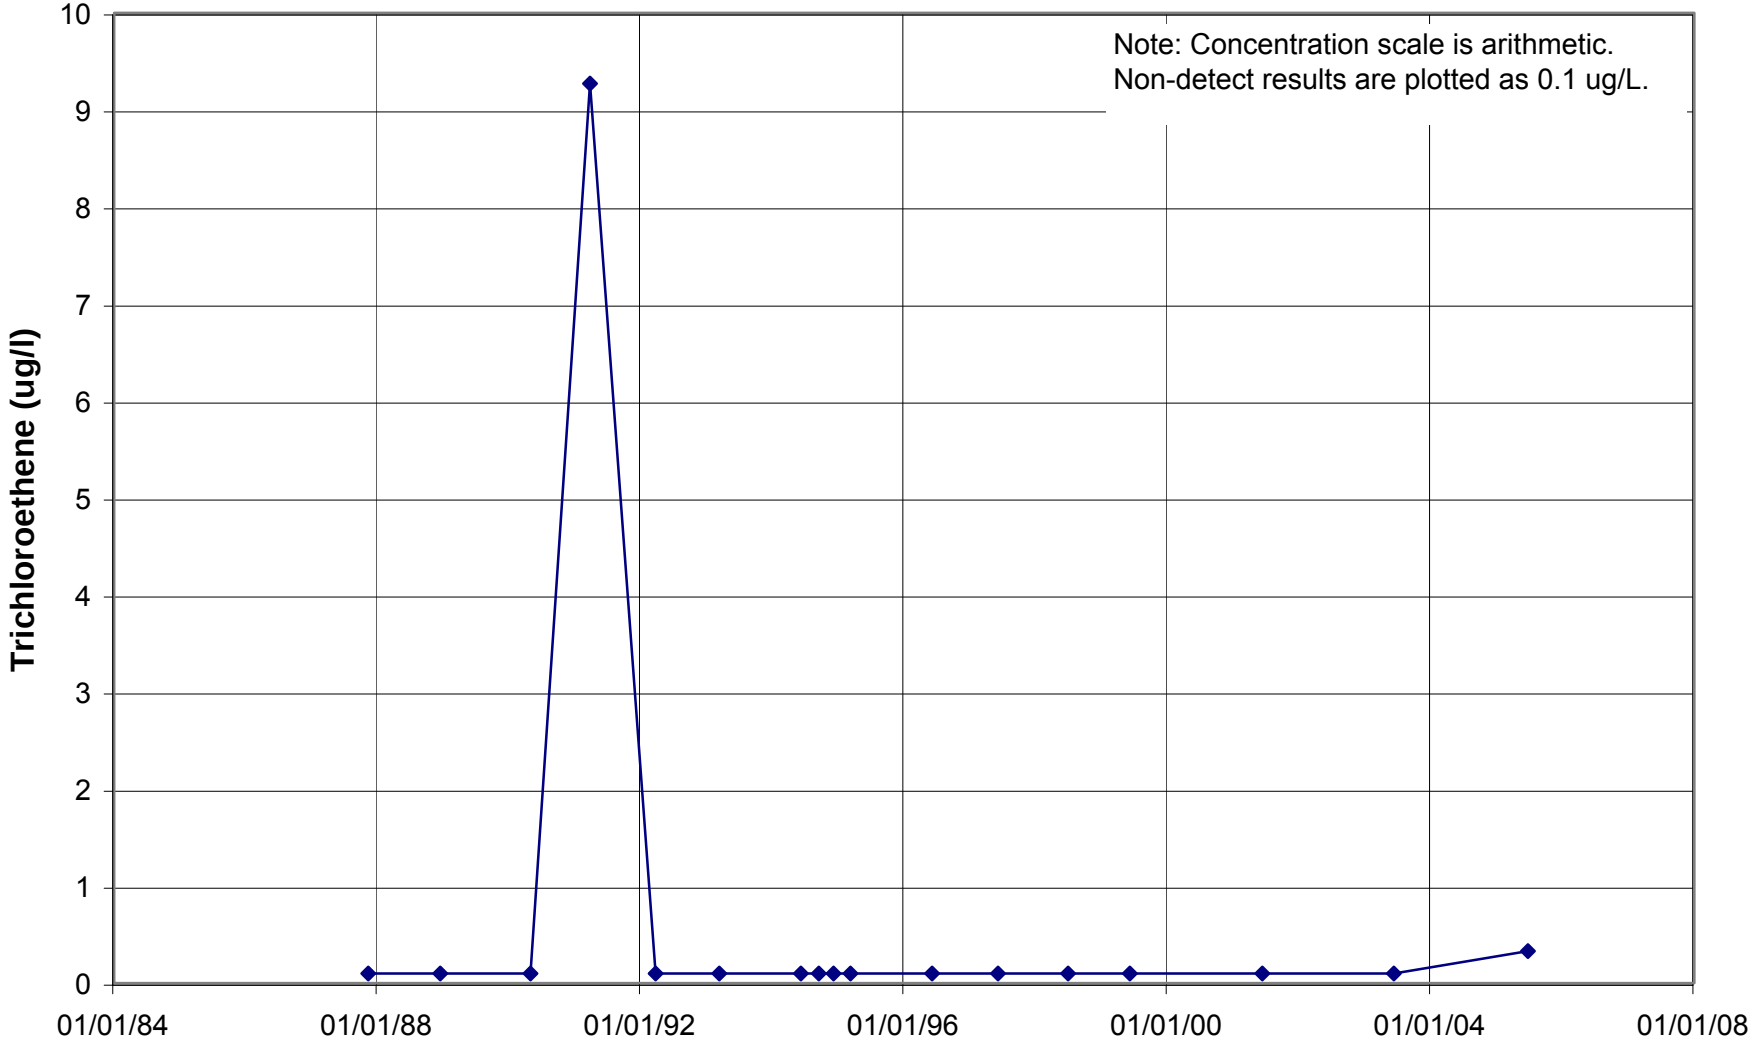

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M002

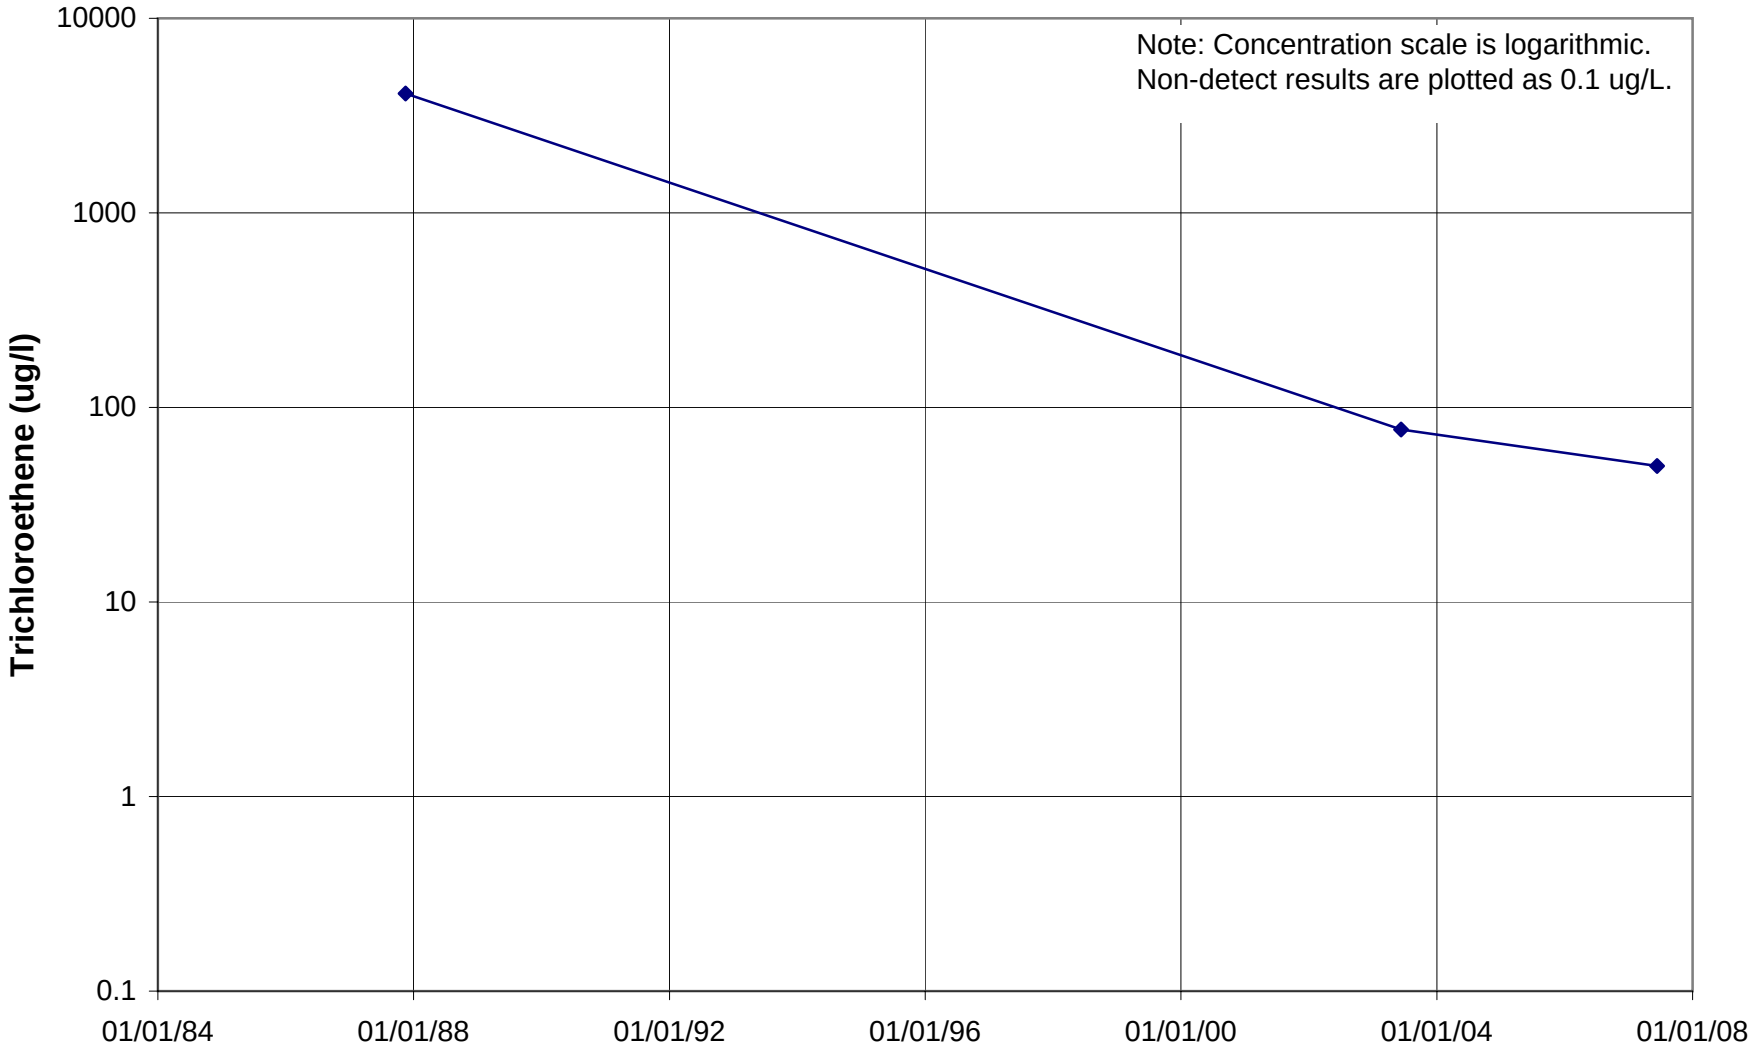

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M003

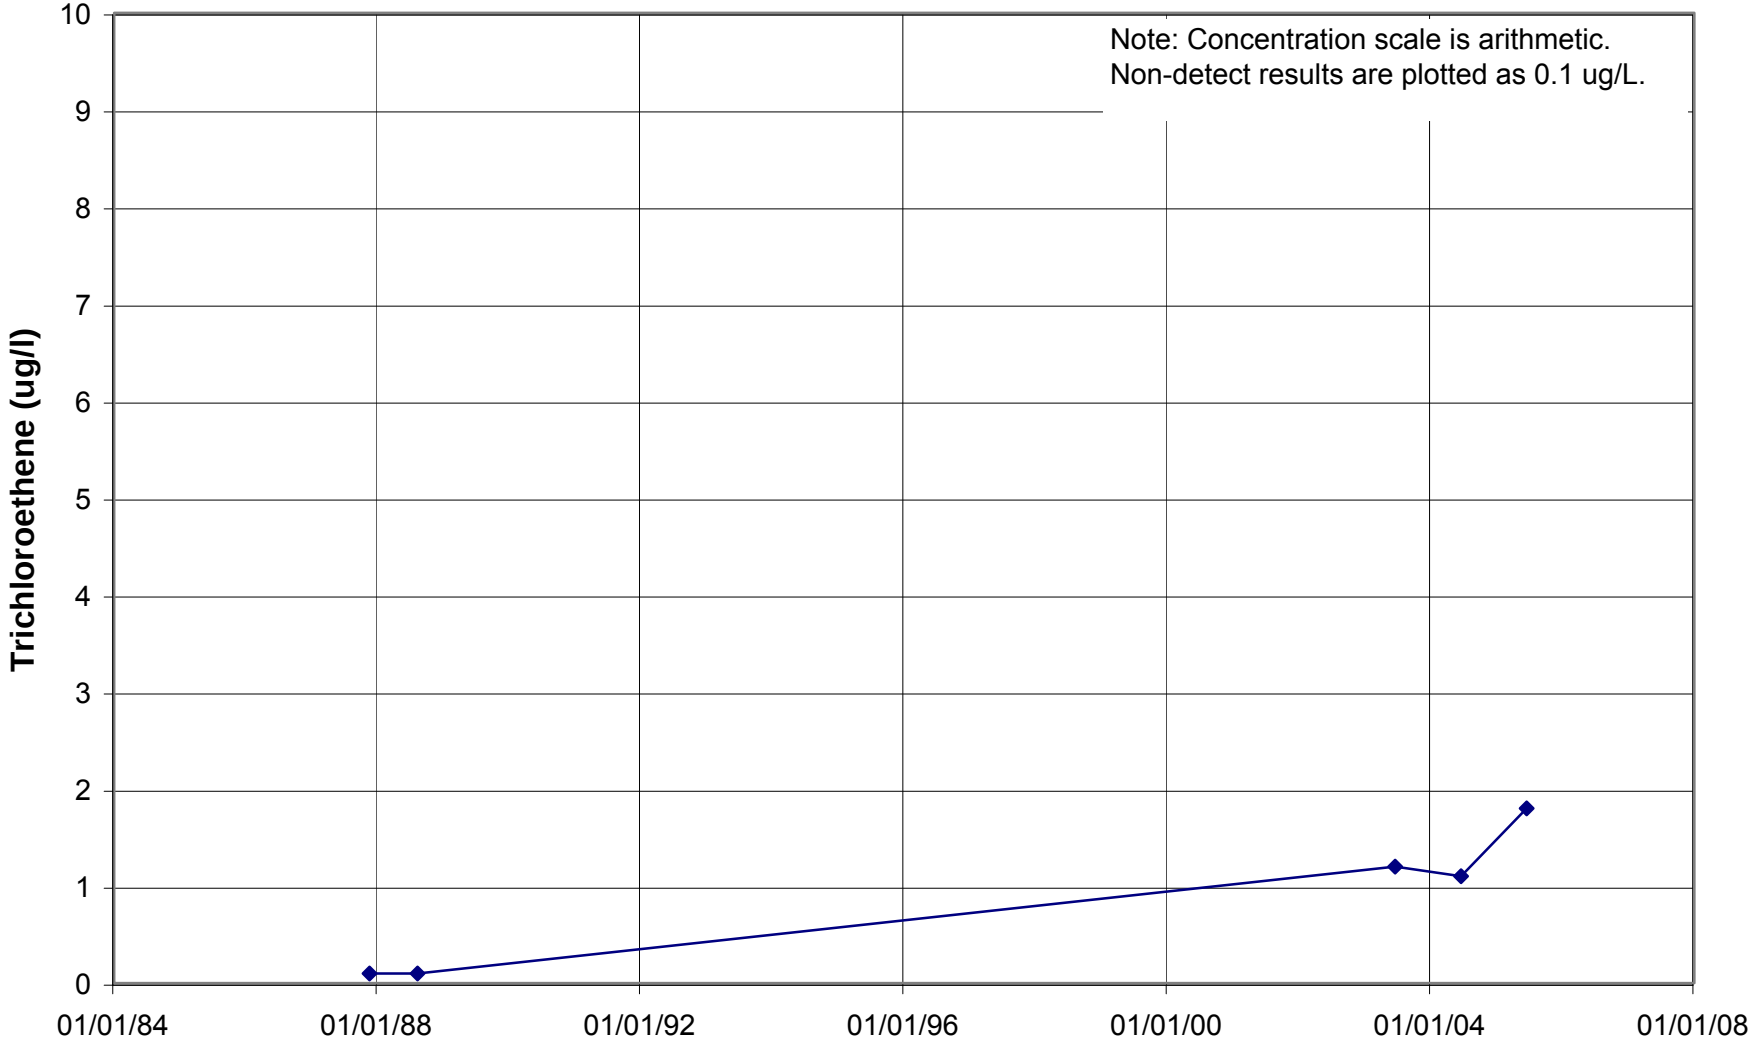

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M004

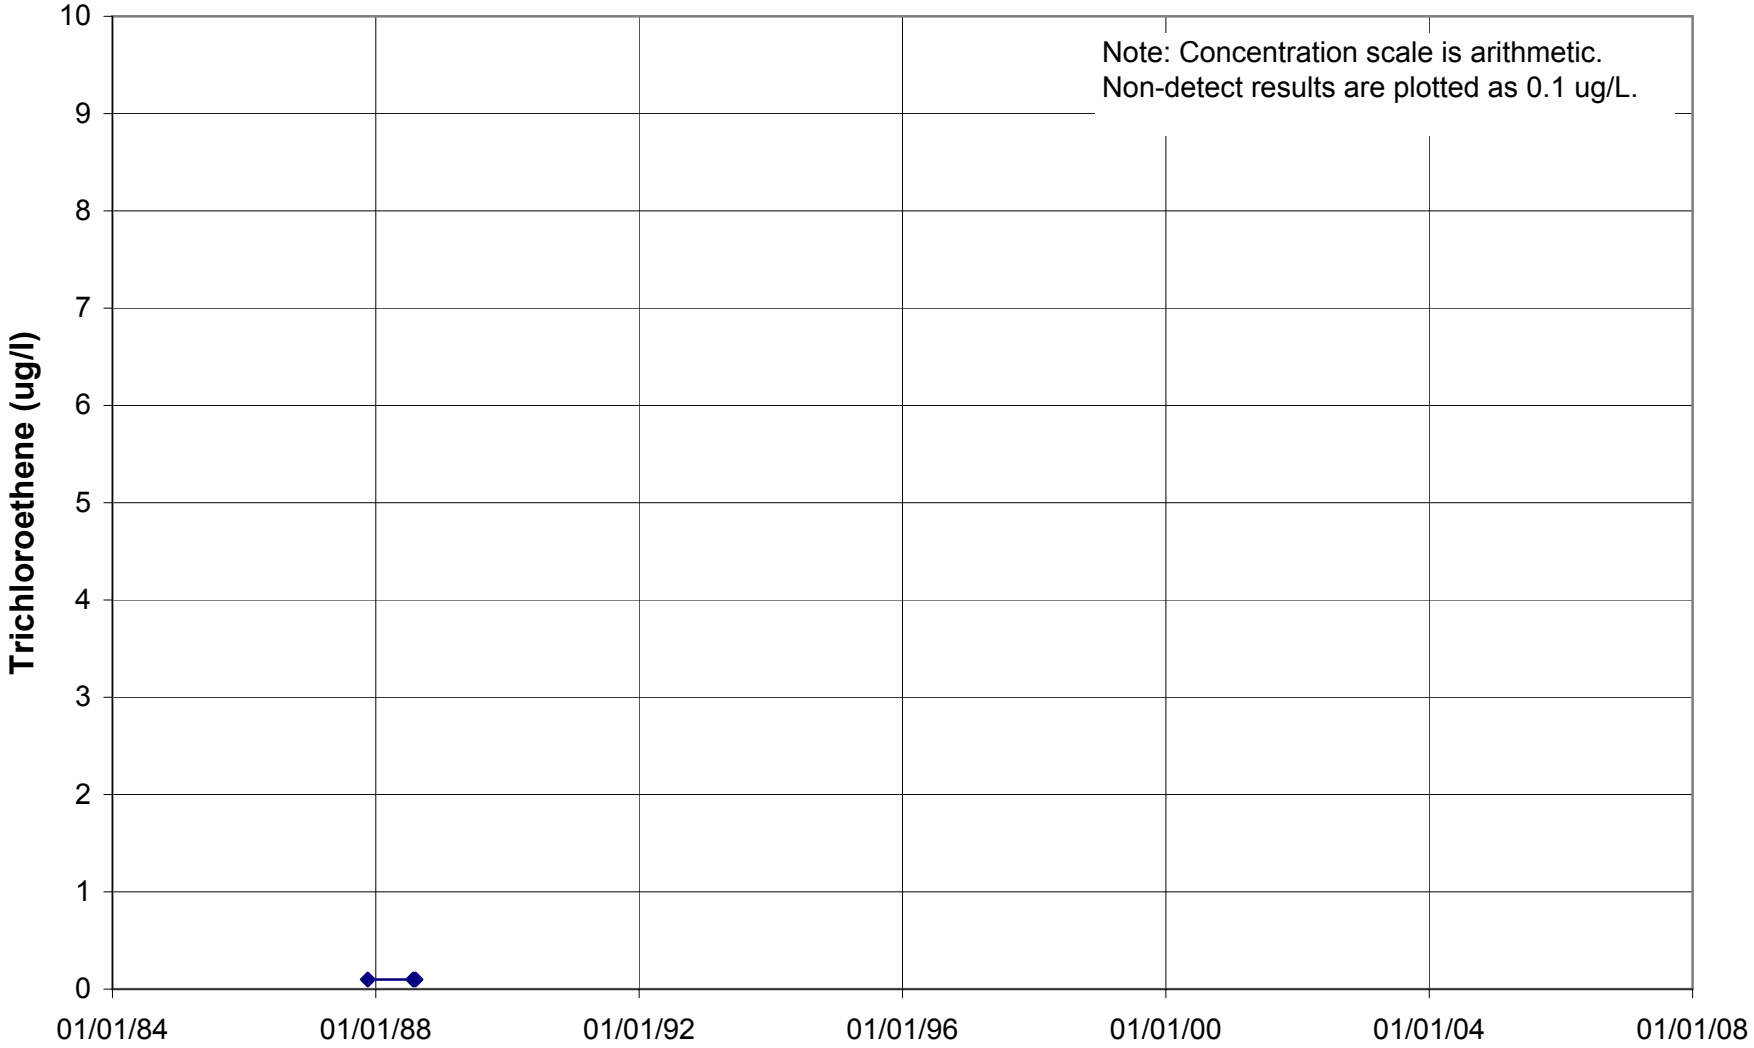

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M005

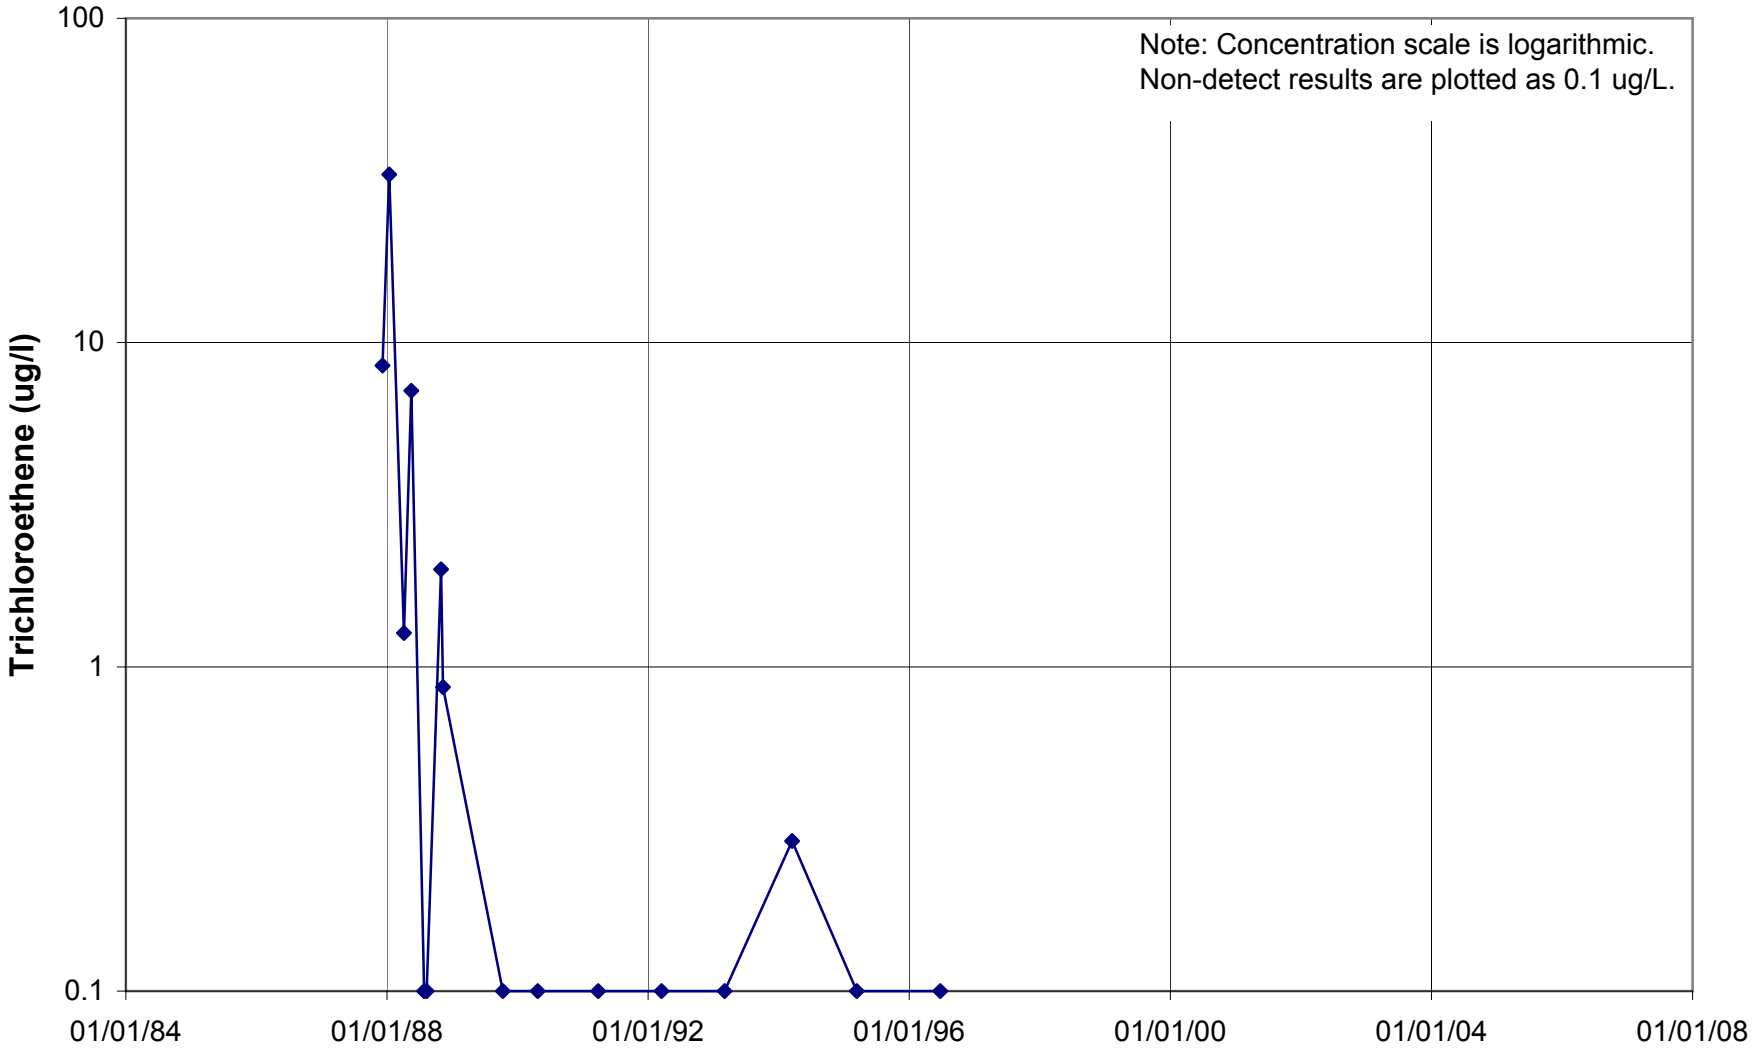

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M010

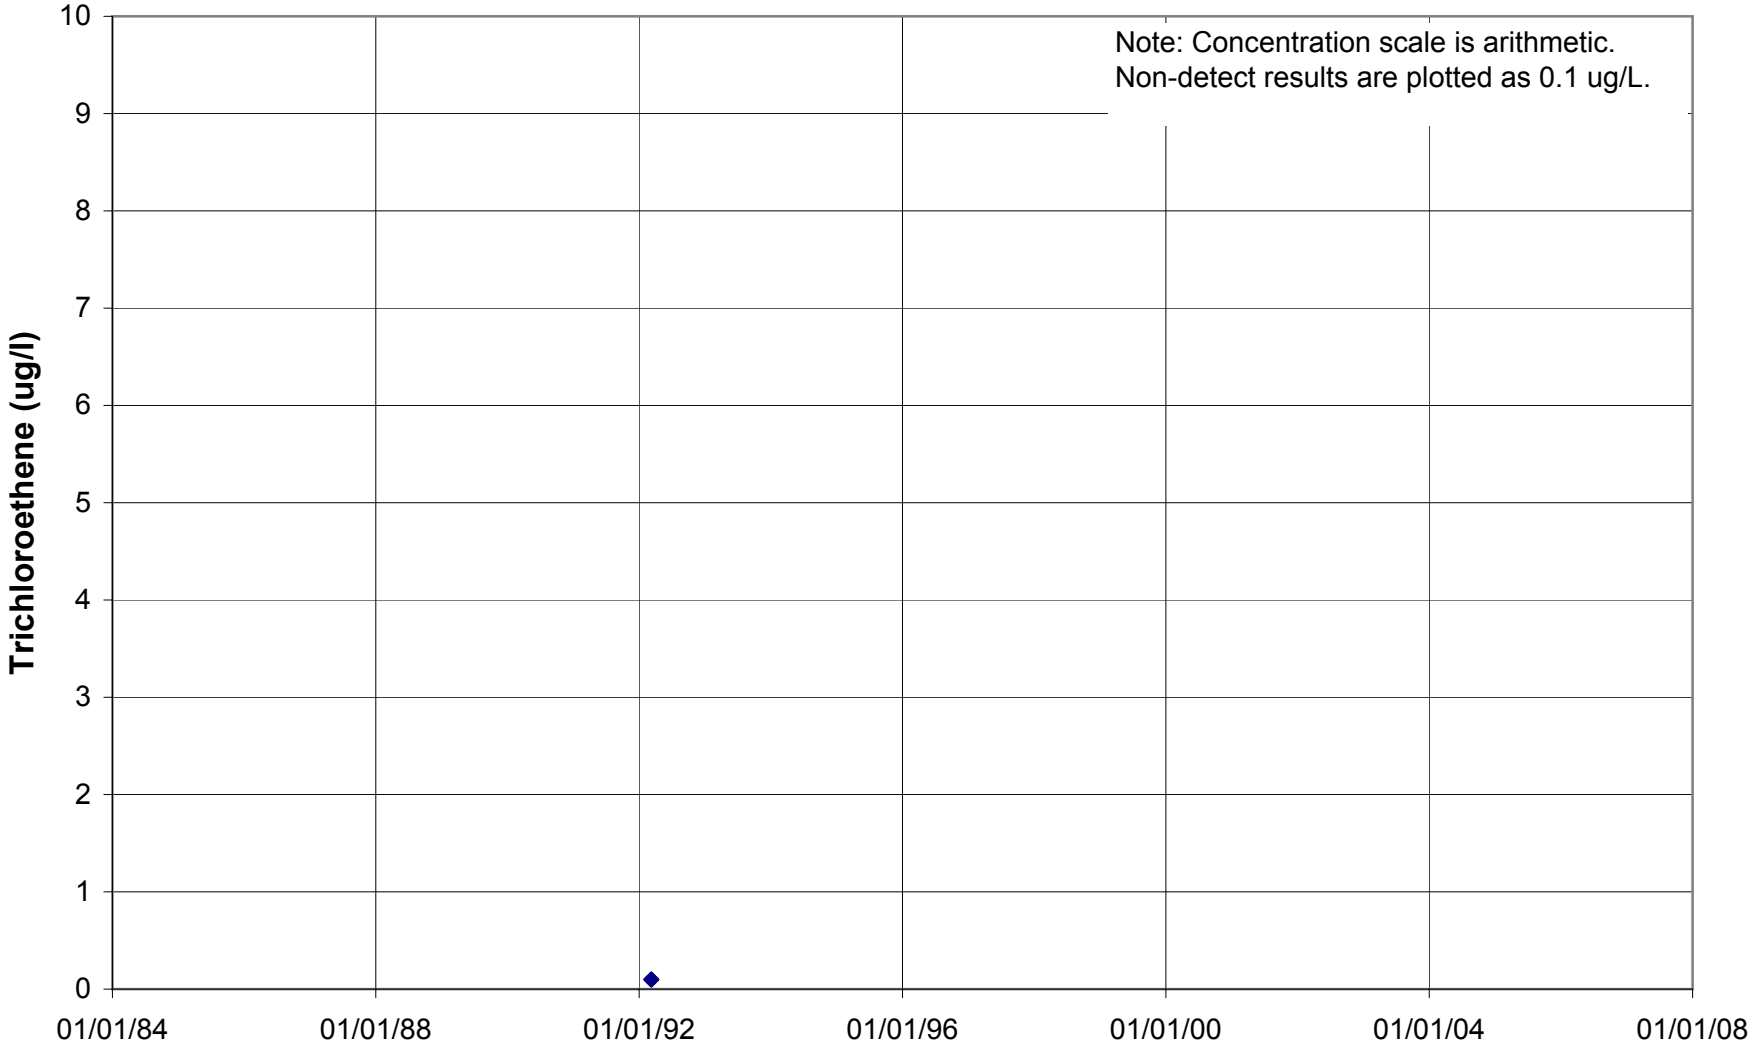

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M013

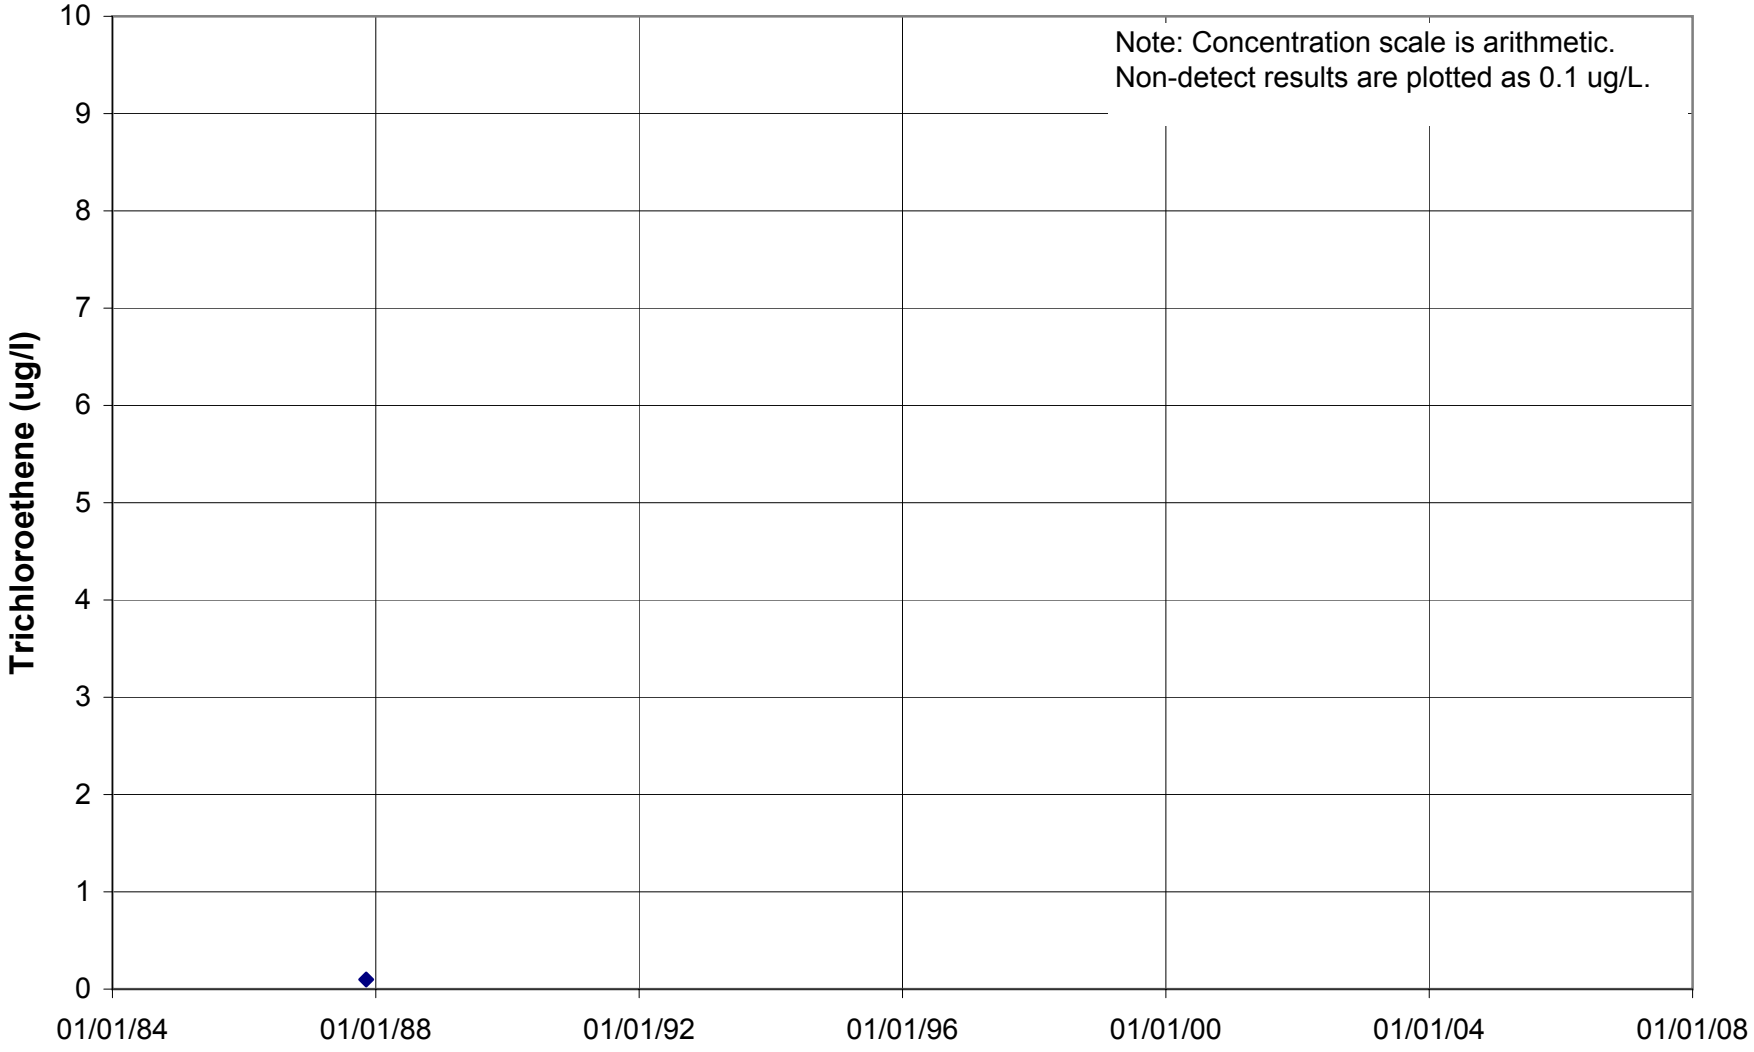

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M017

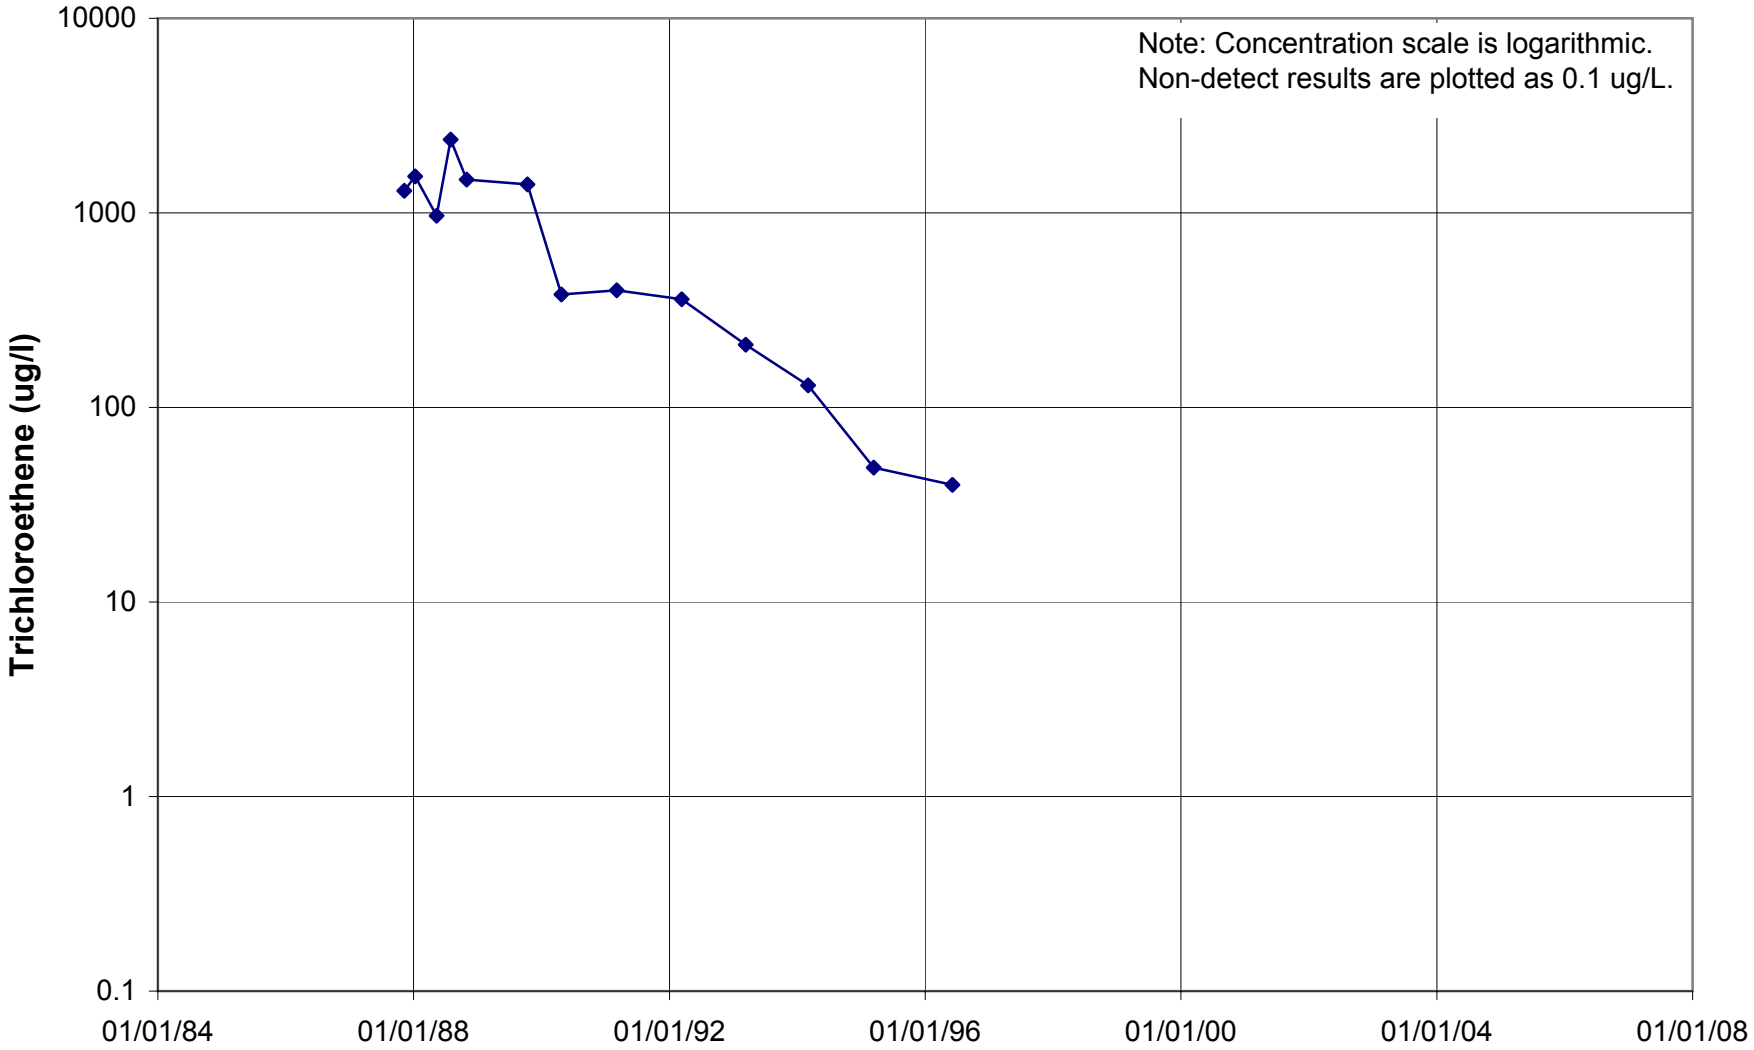

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M020

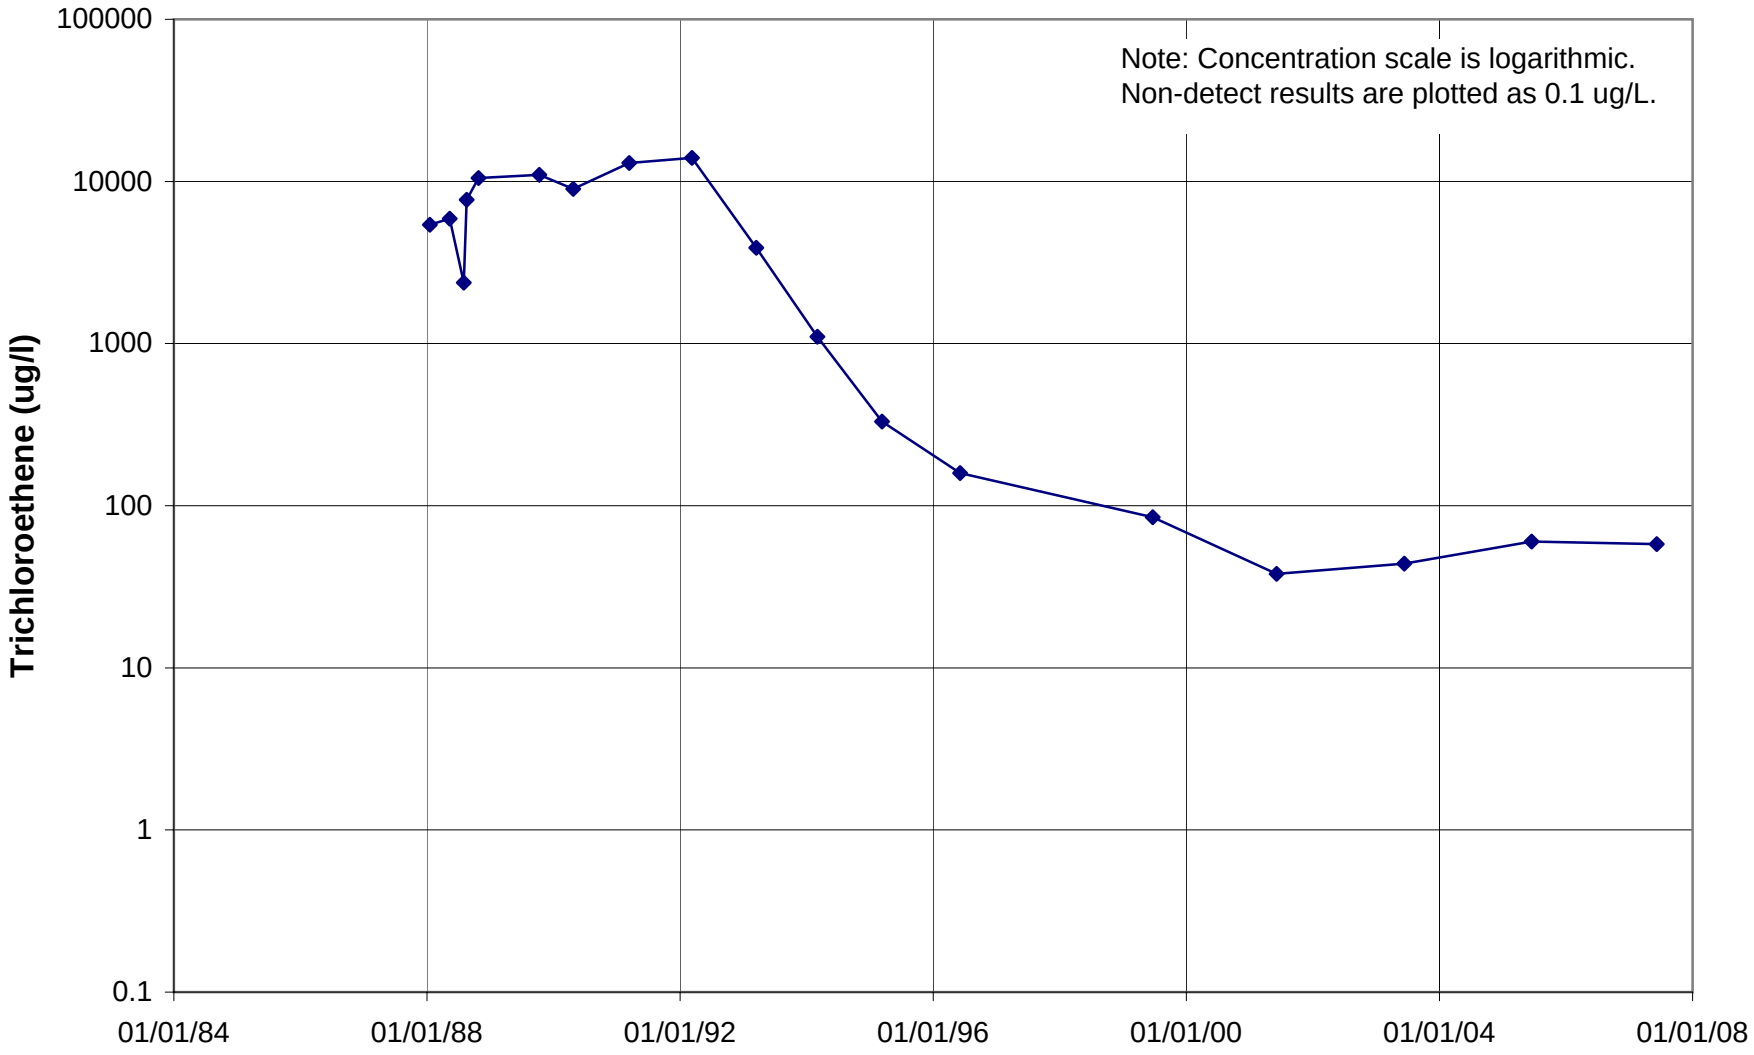

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M713

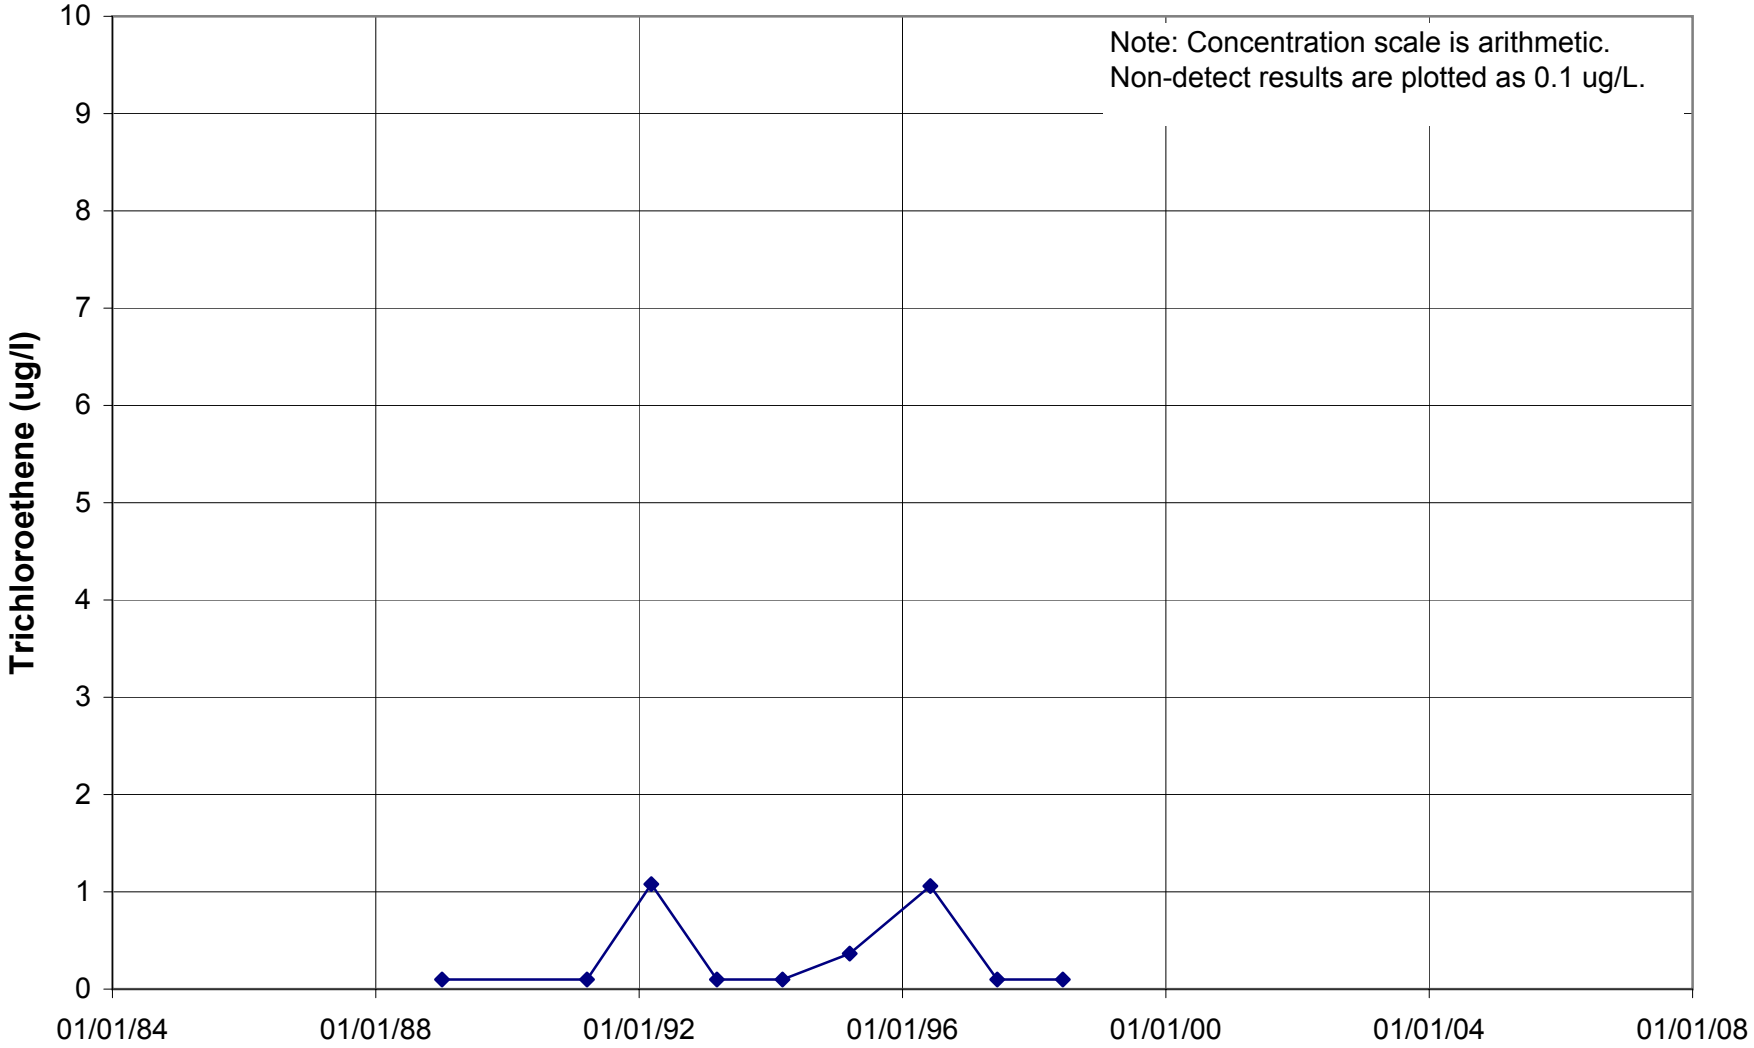

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M802

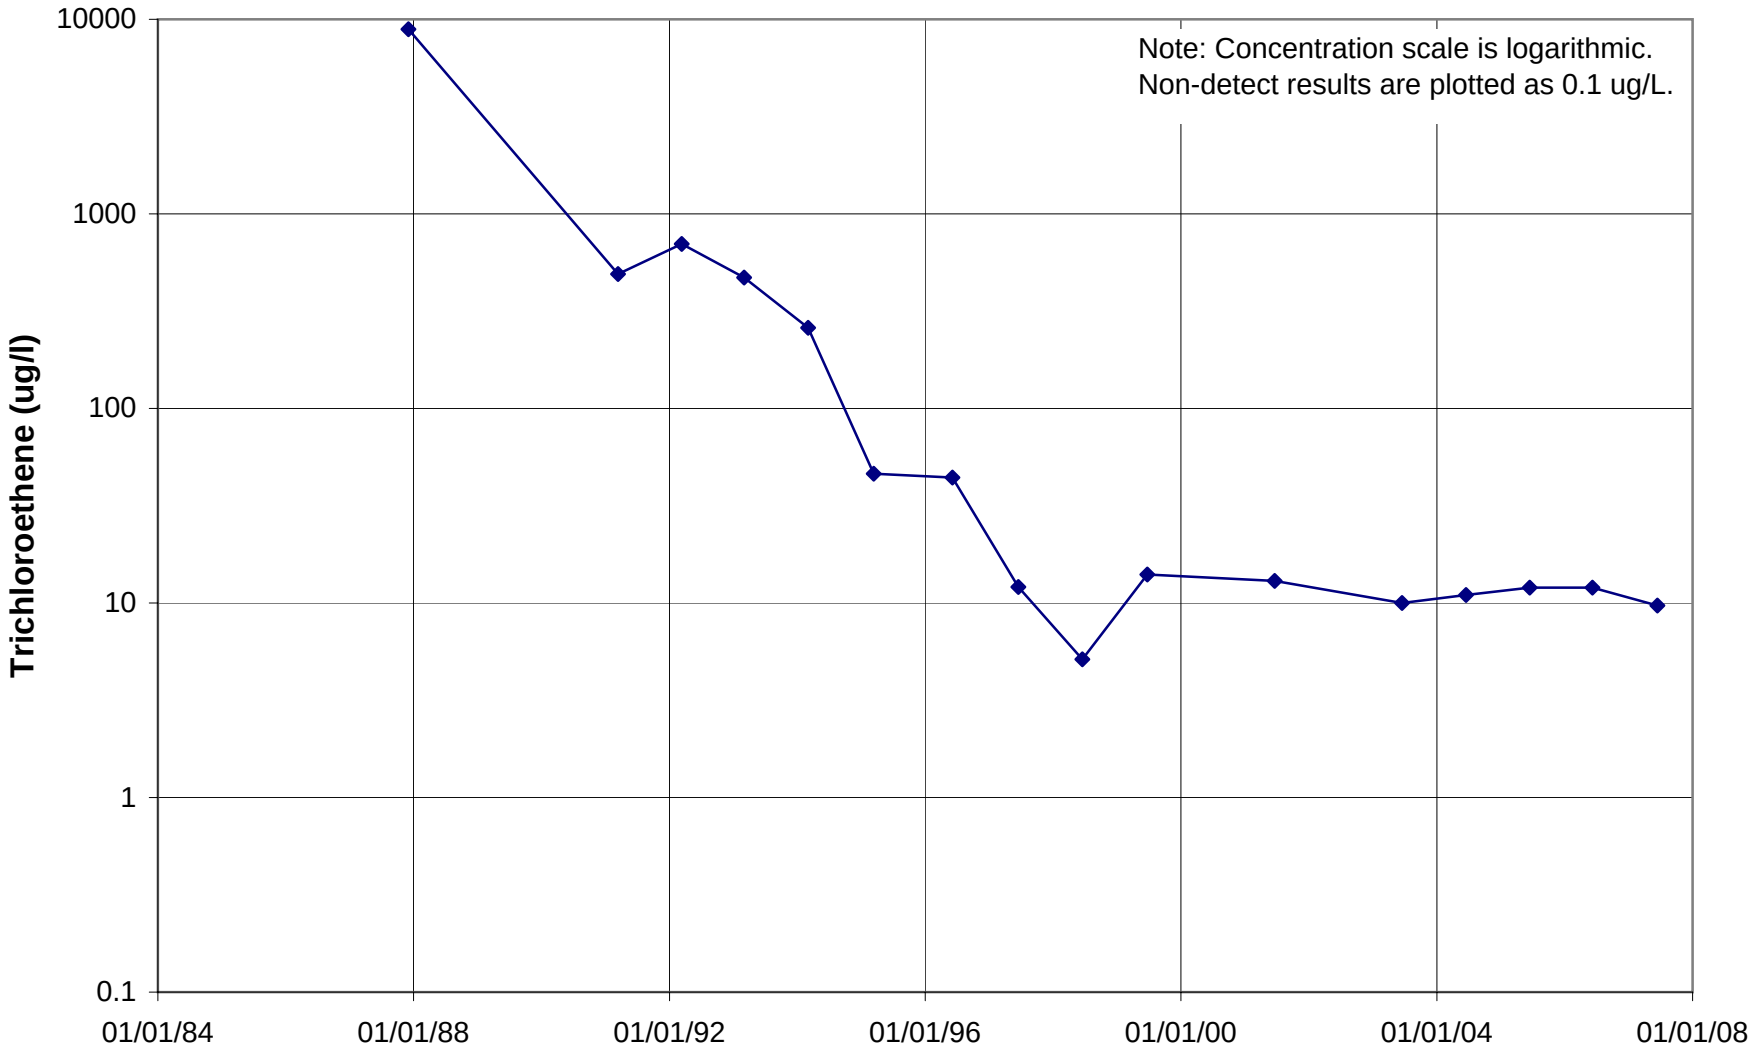

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M806

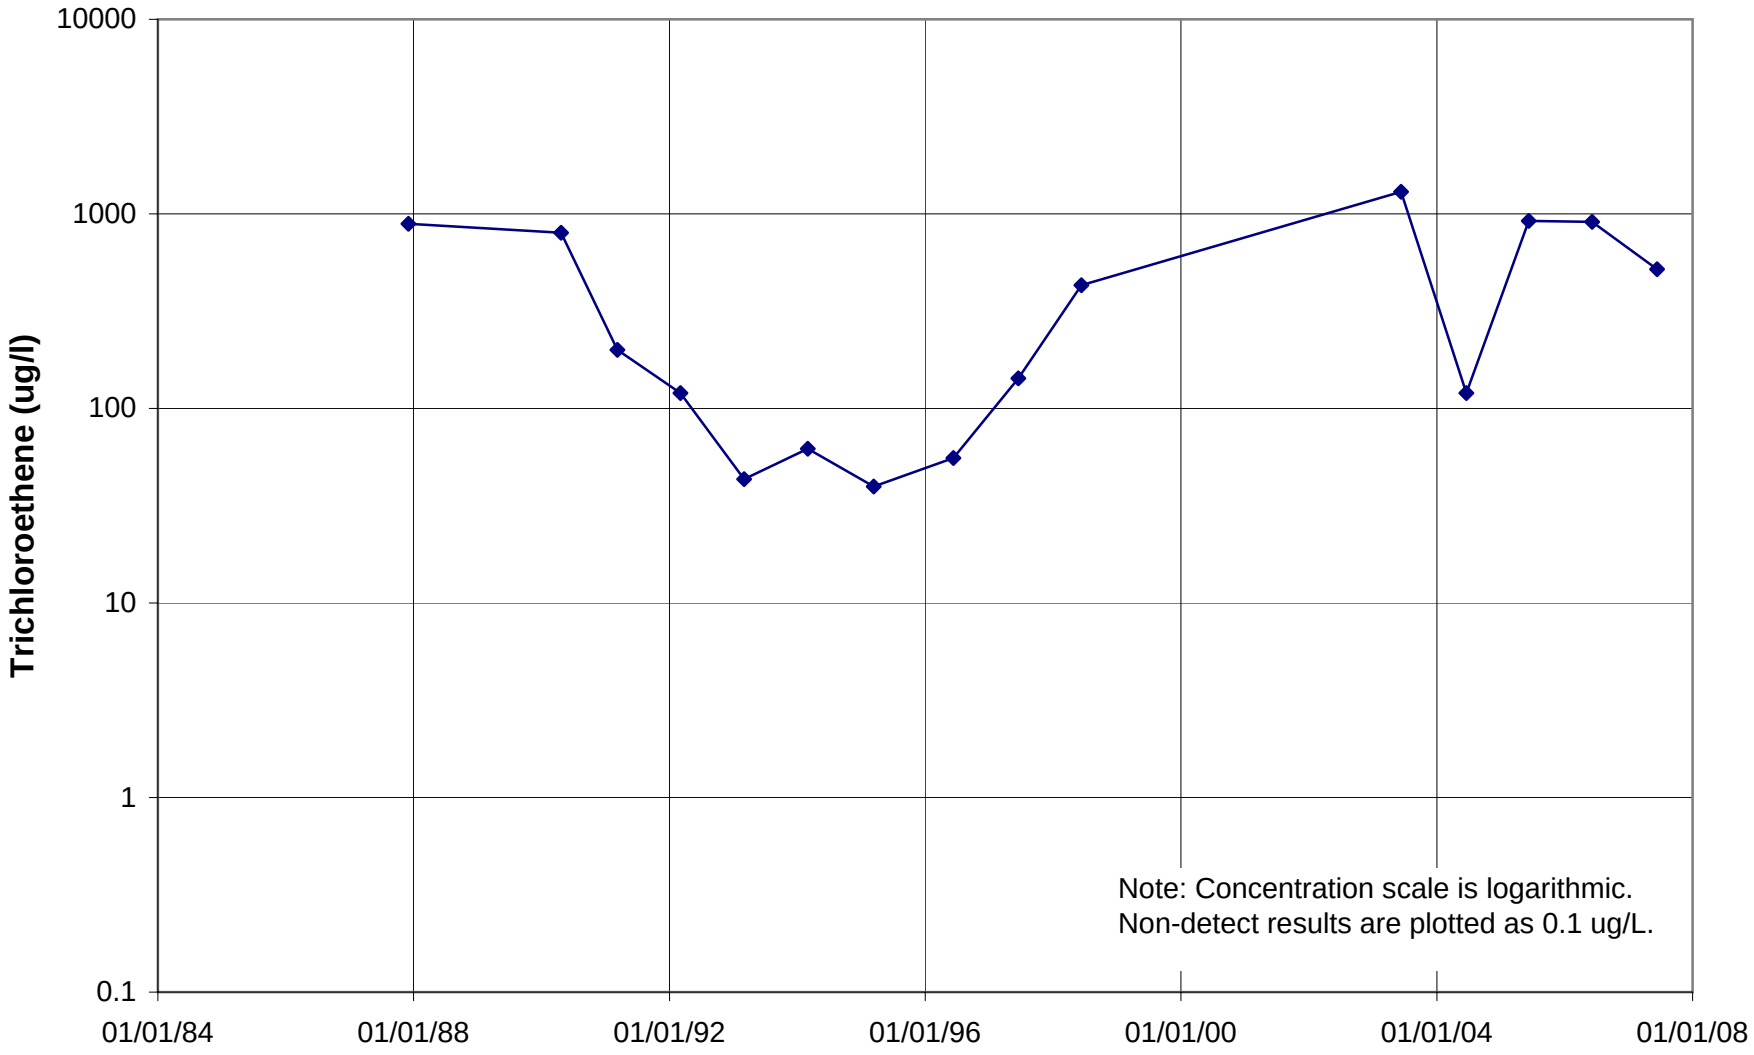

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M843

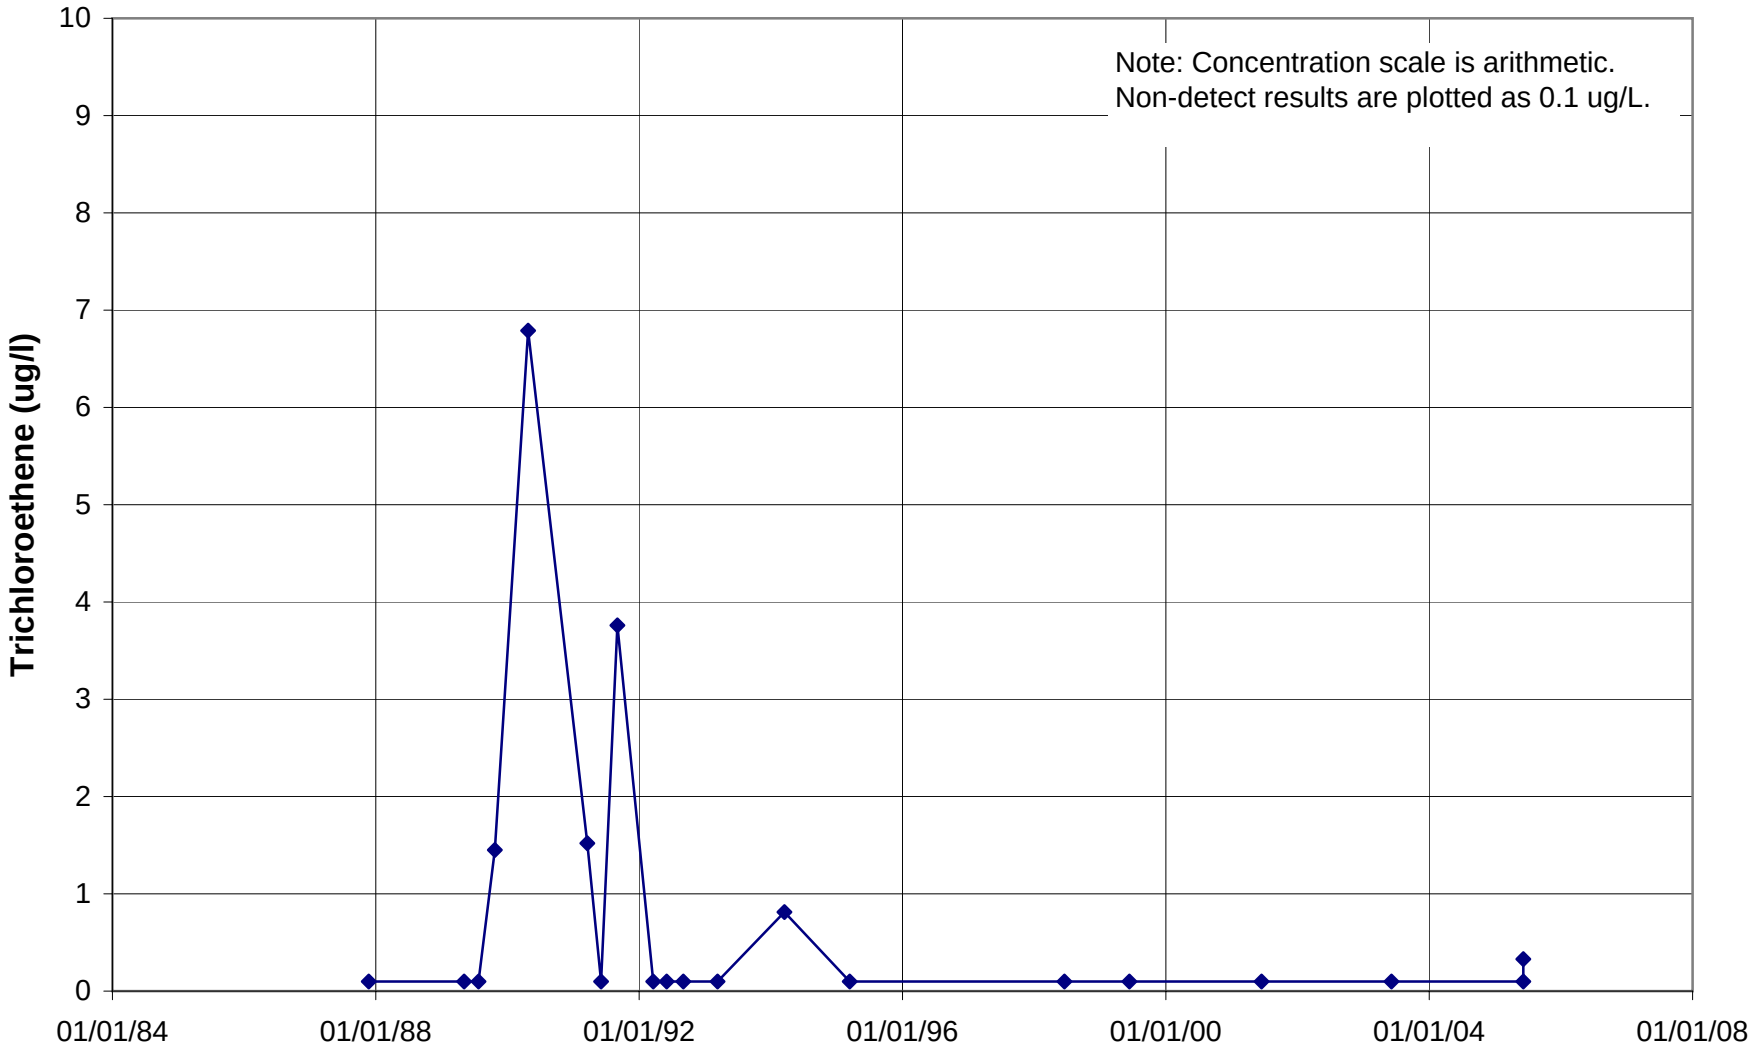

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03M848

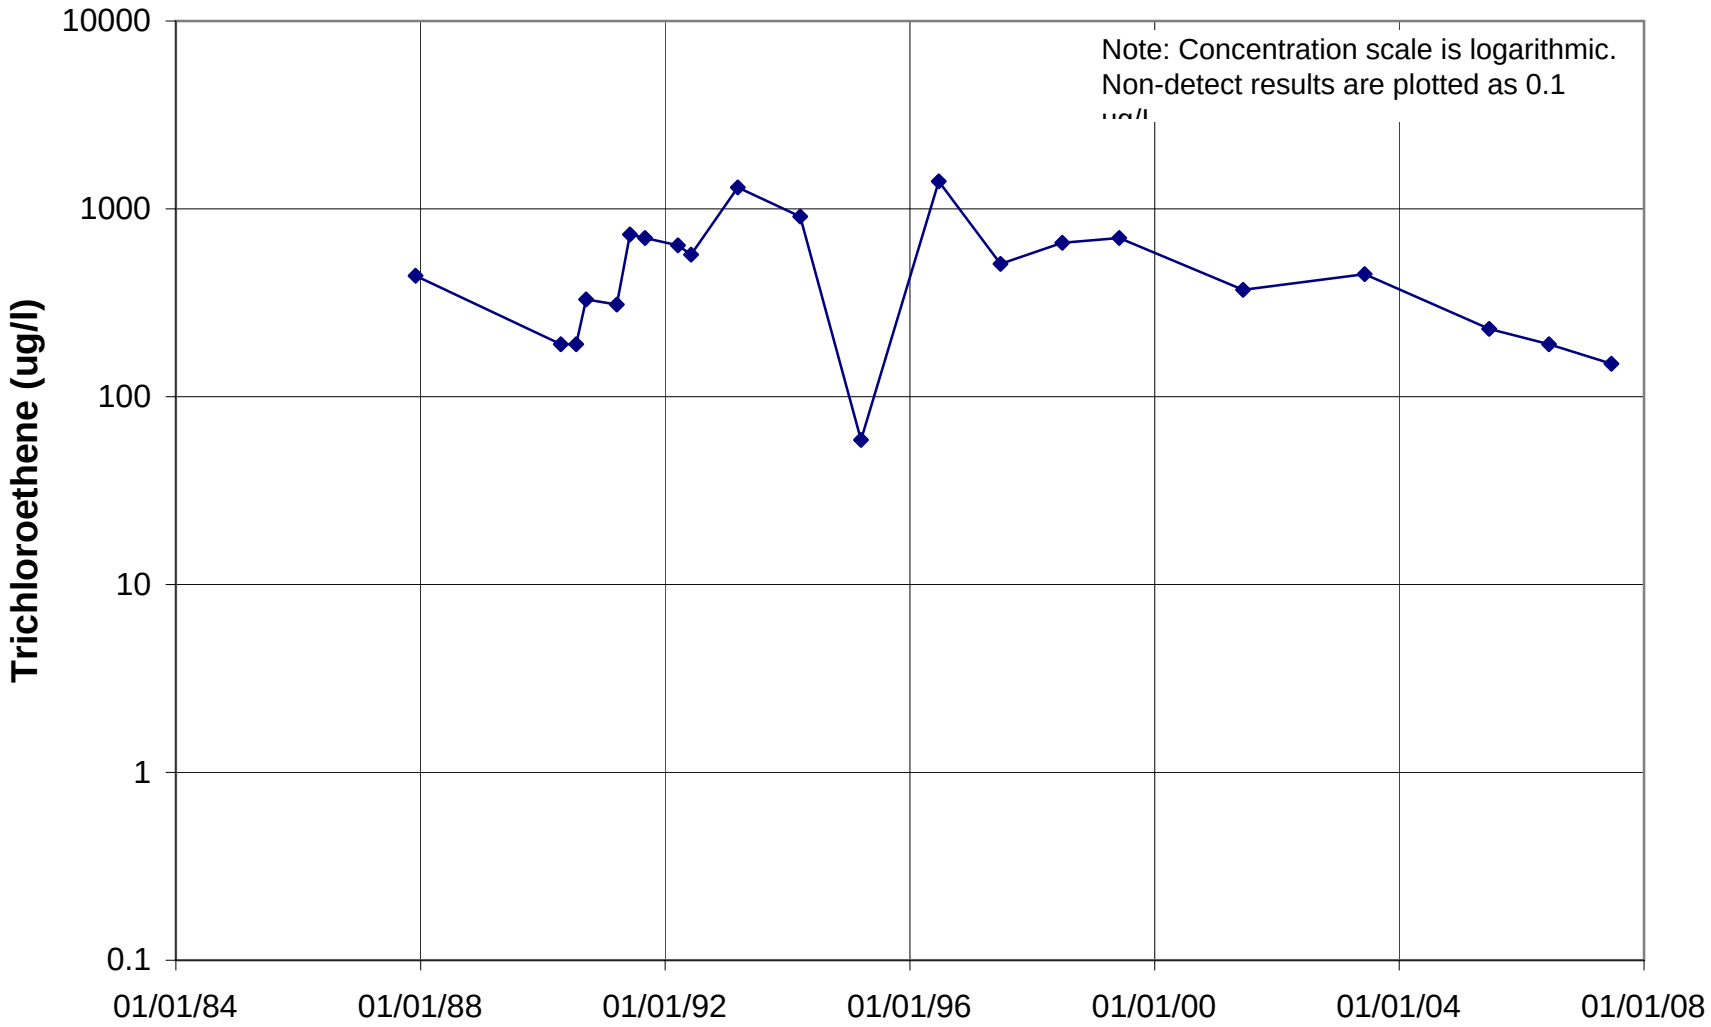

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U001

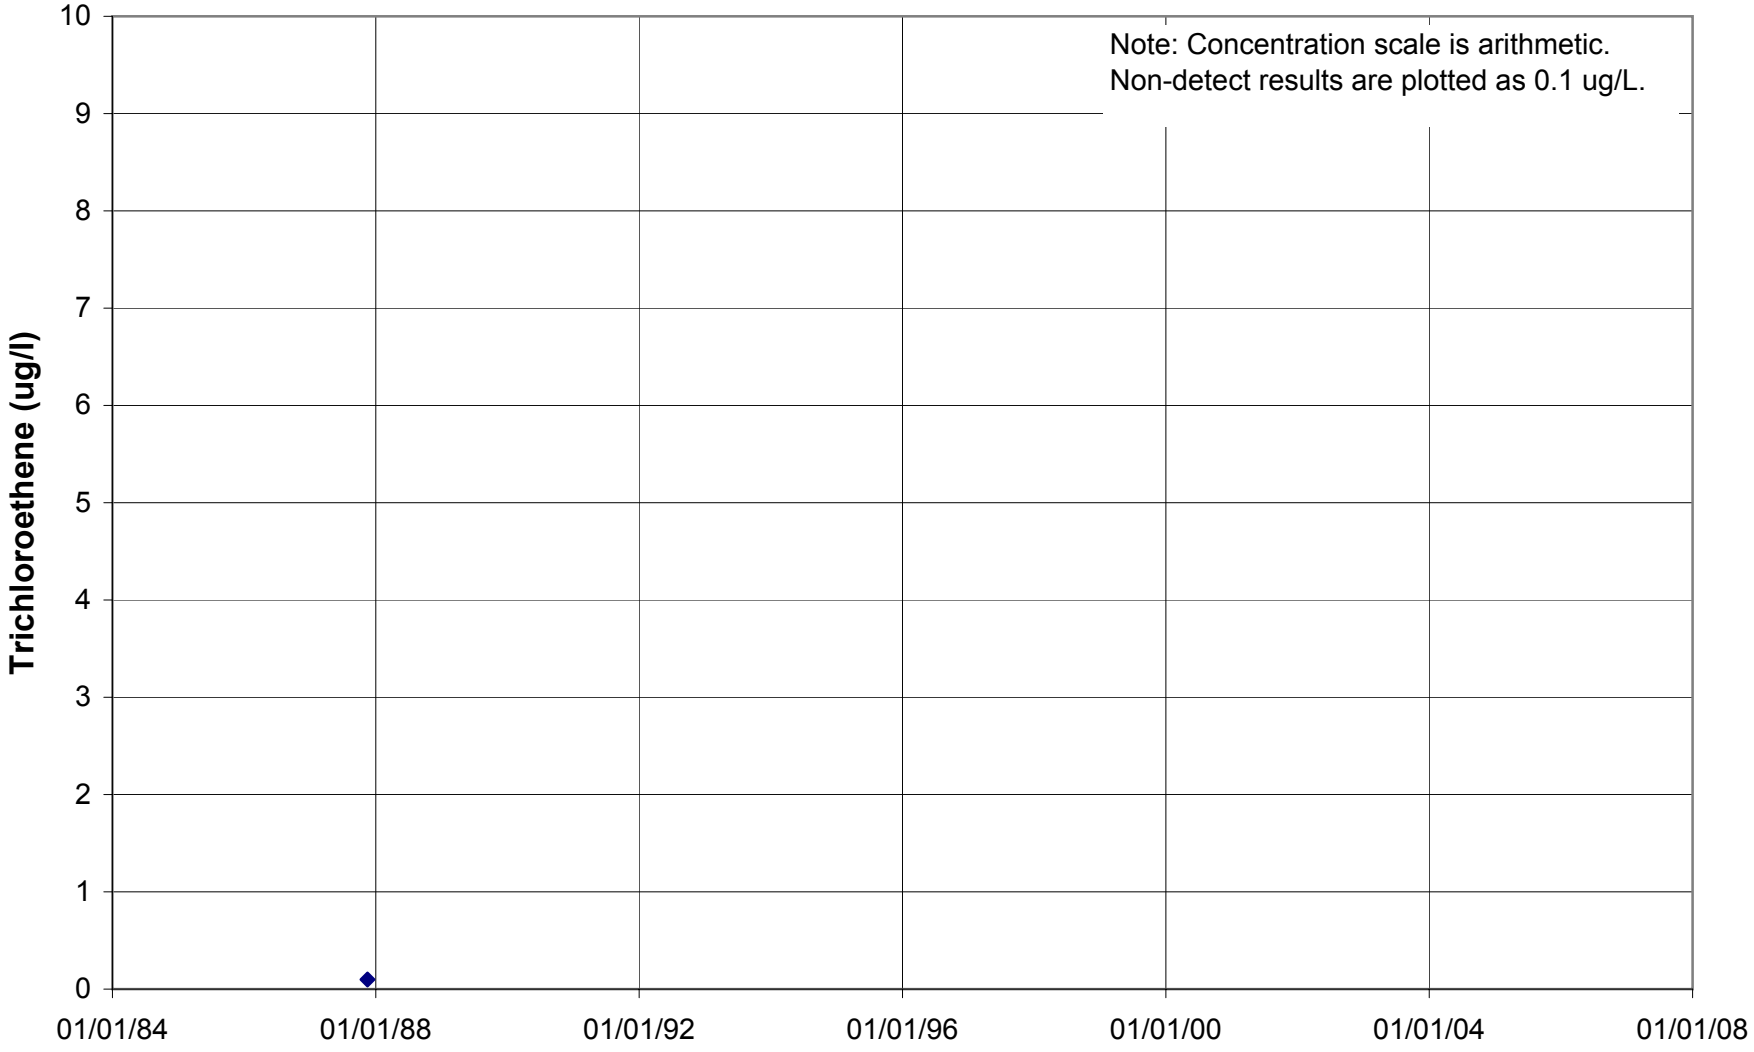

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U002

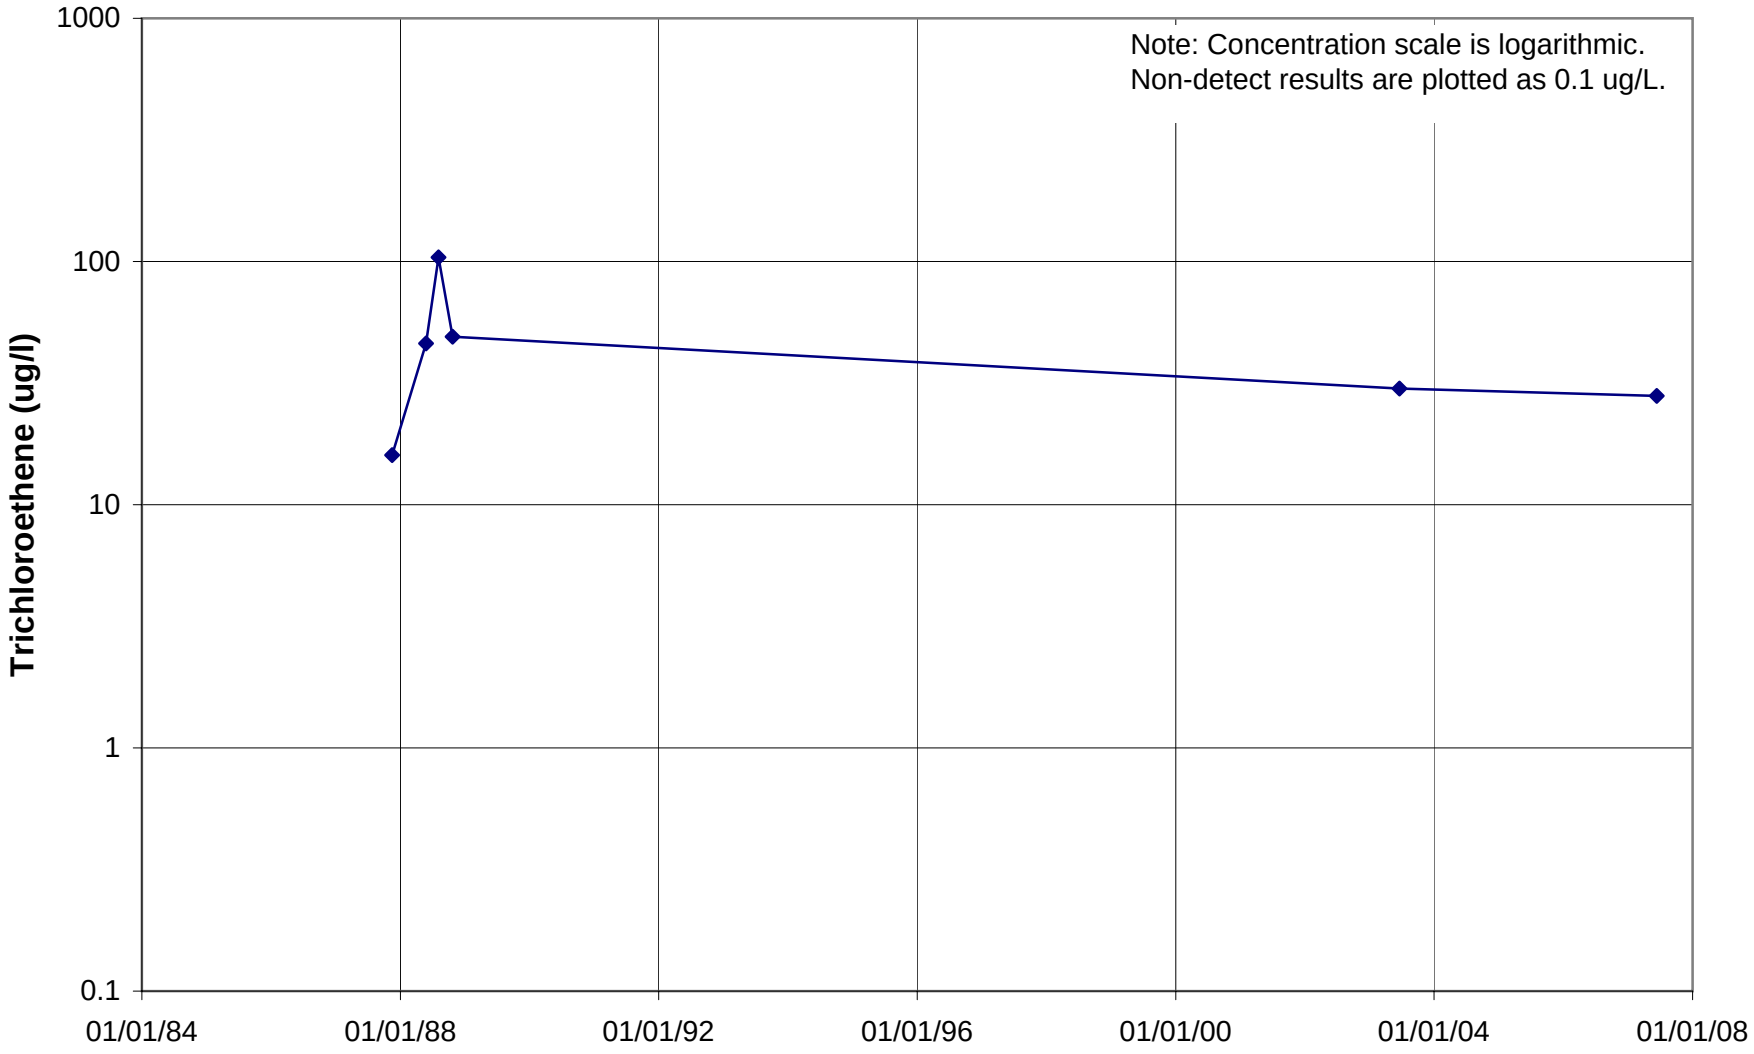

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U003

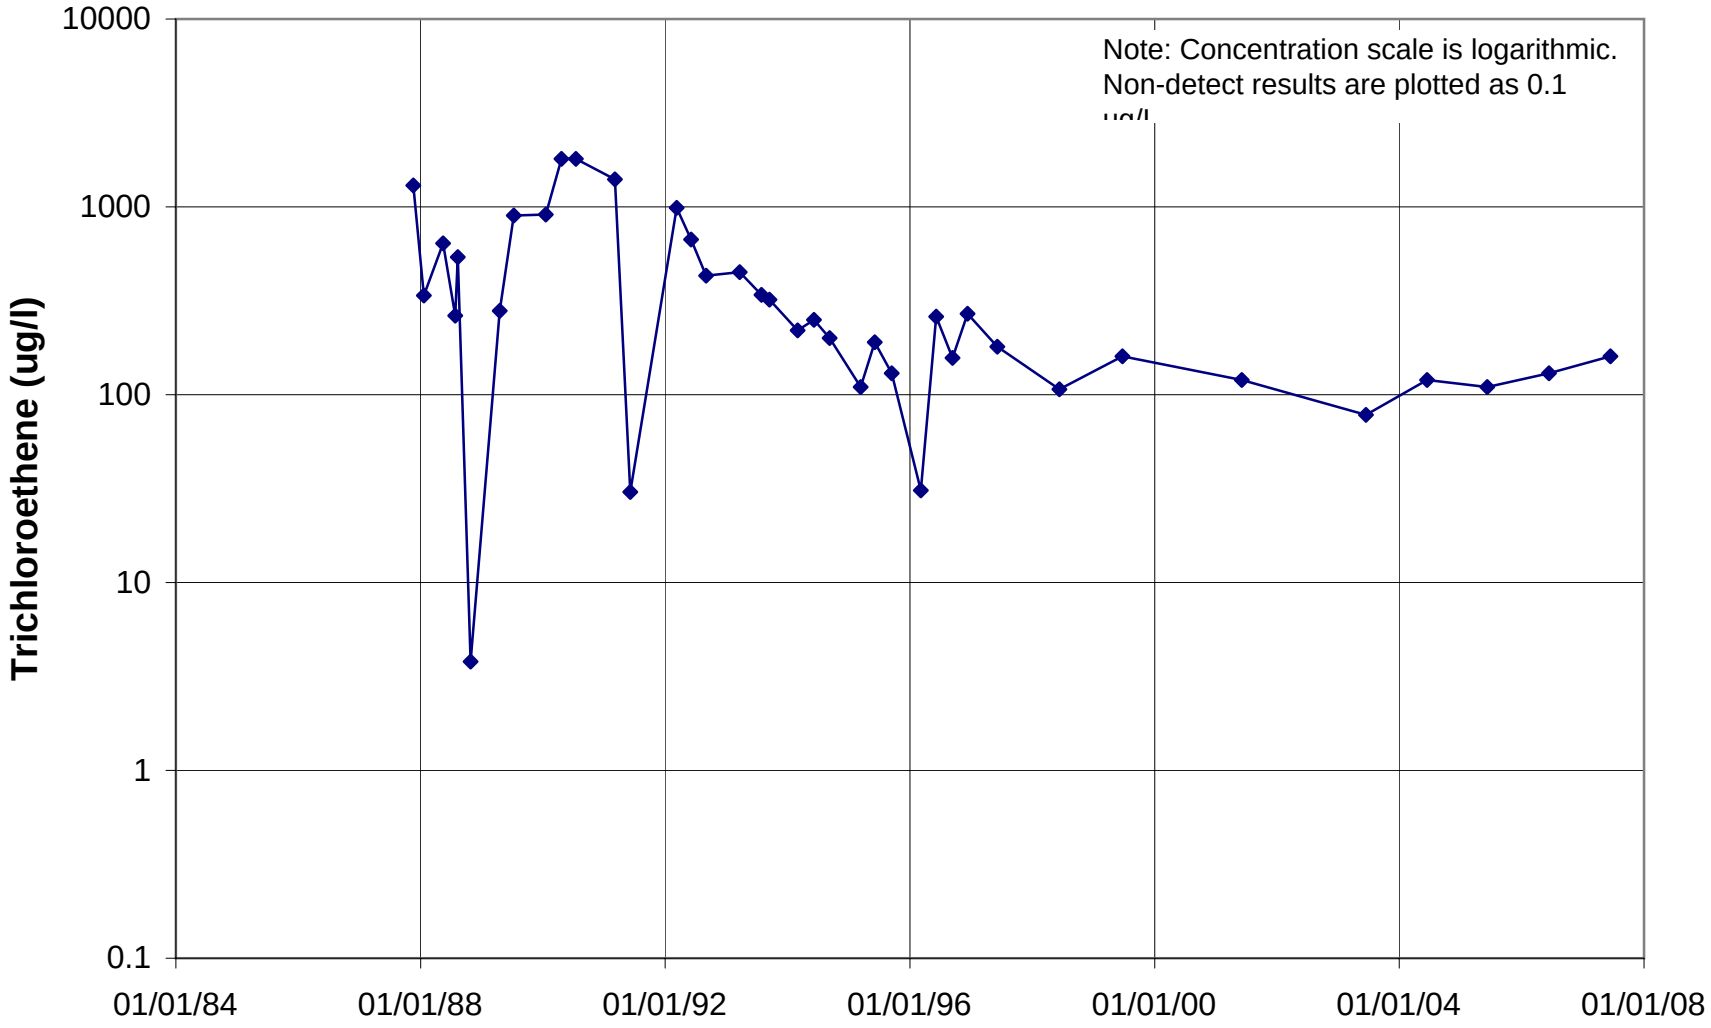

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U004

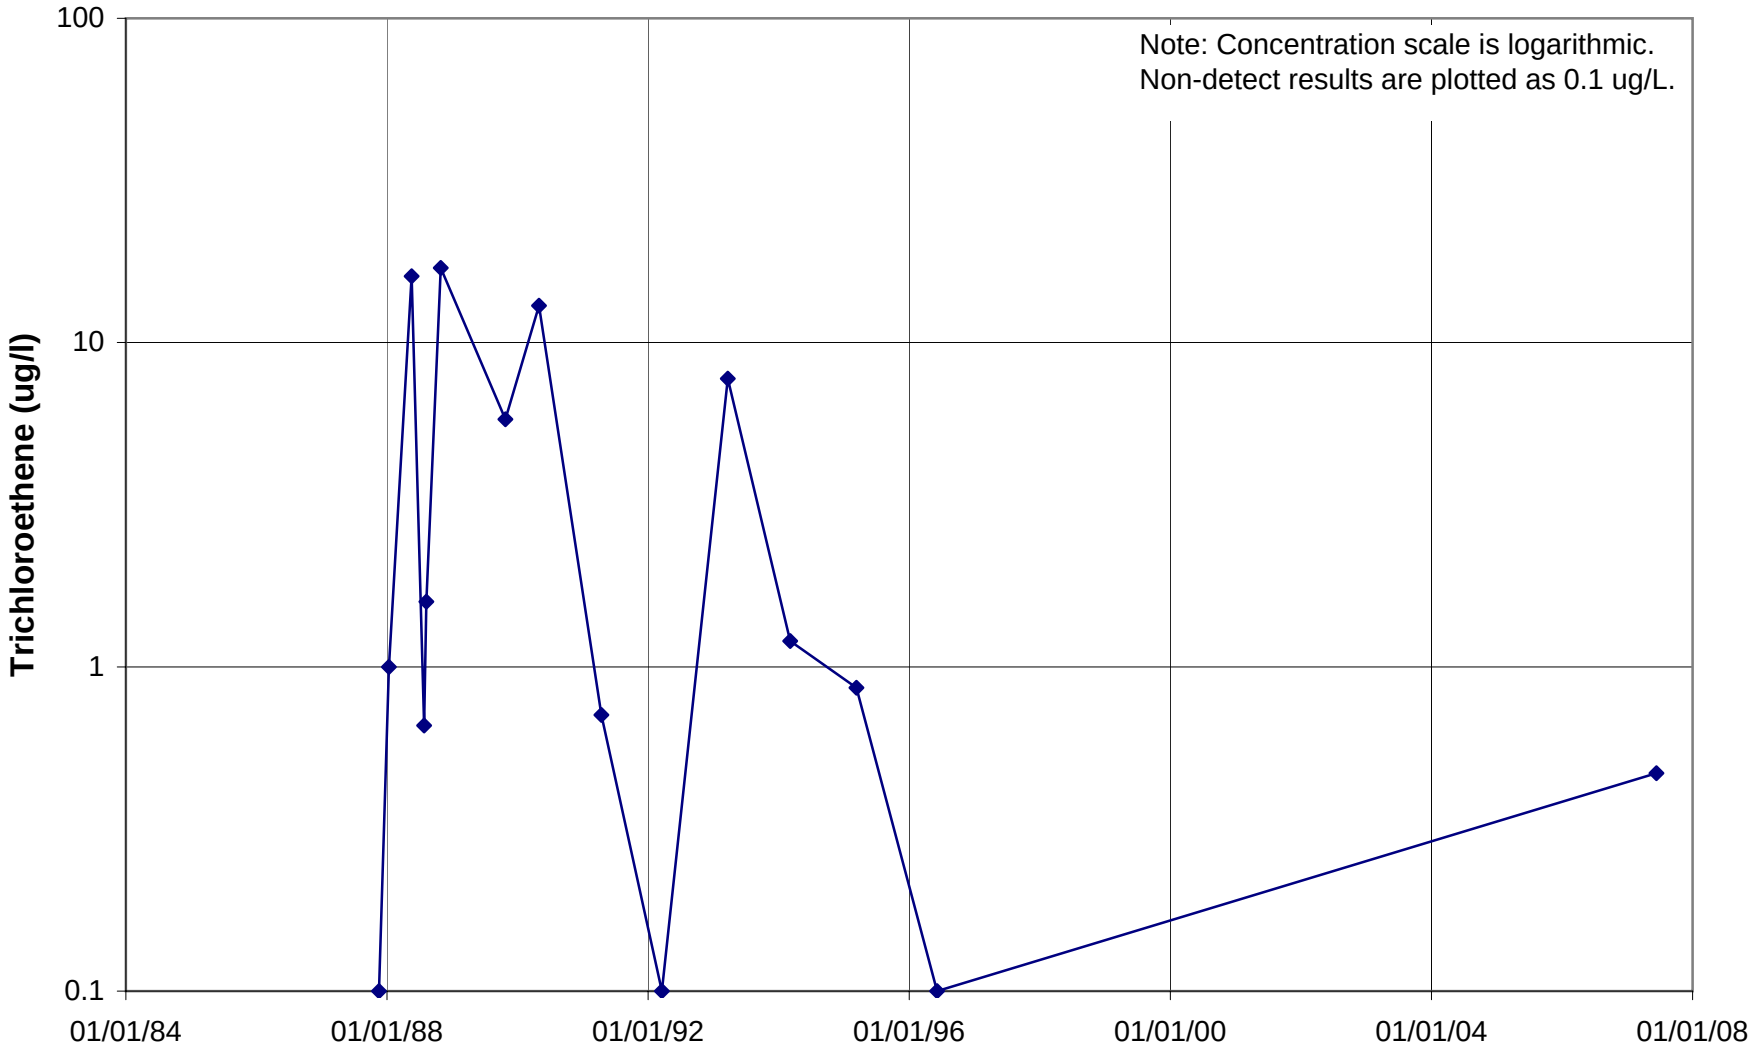

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U005

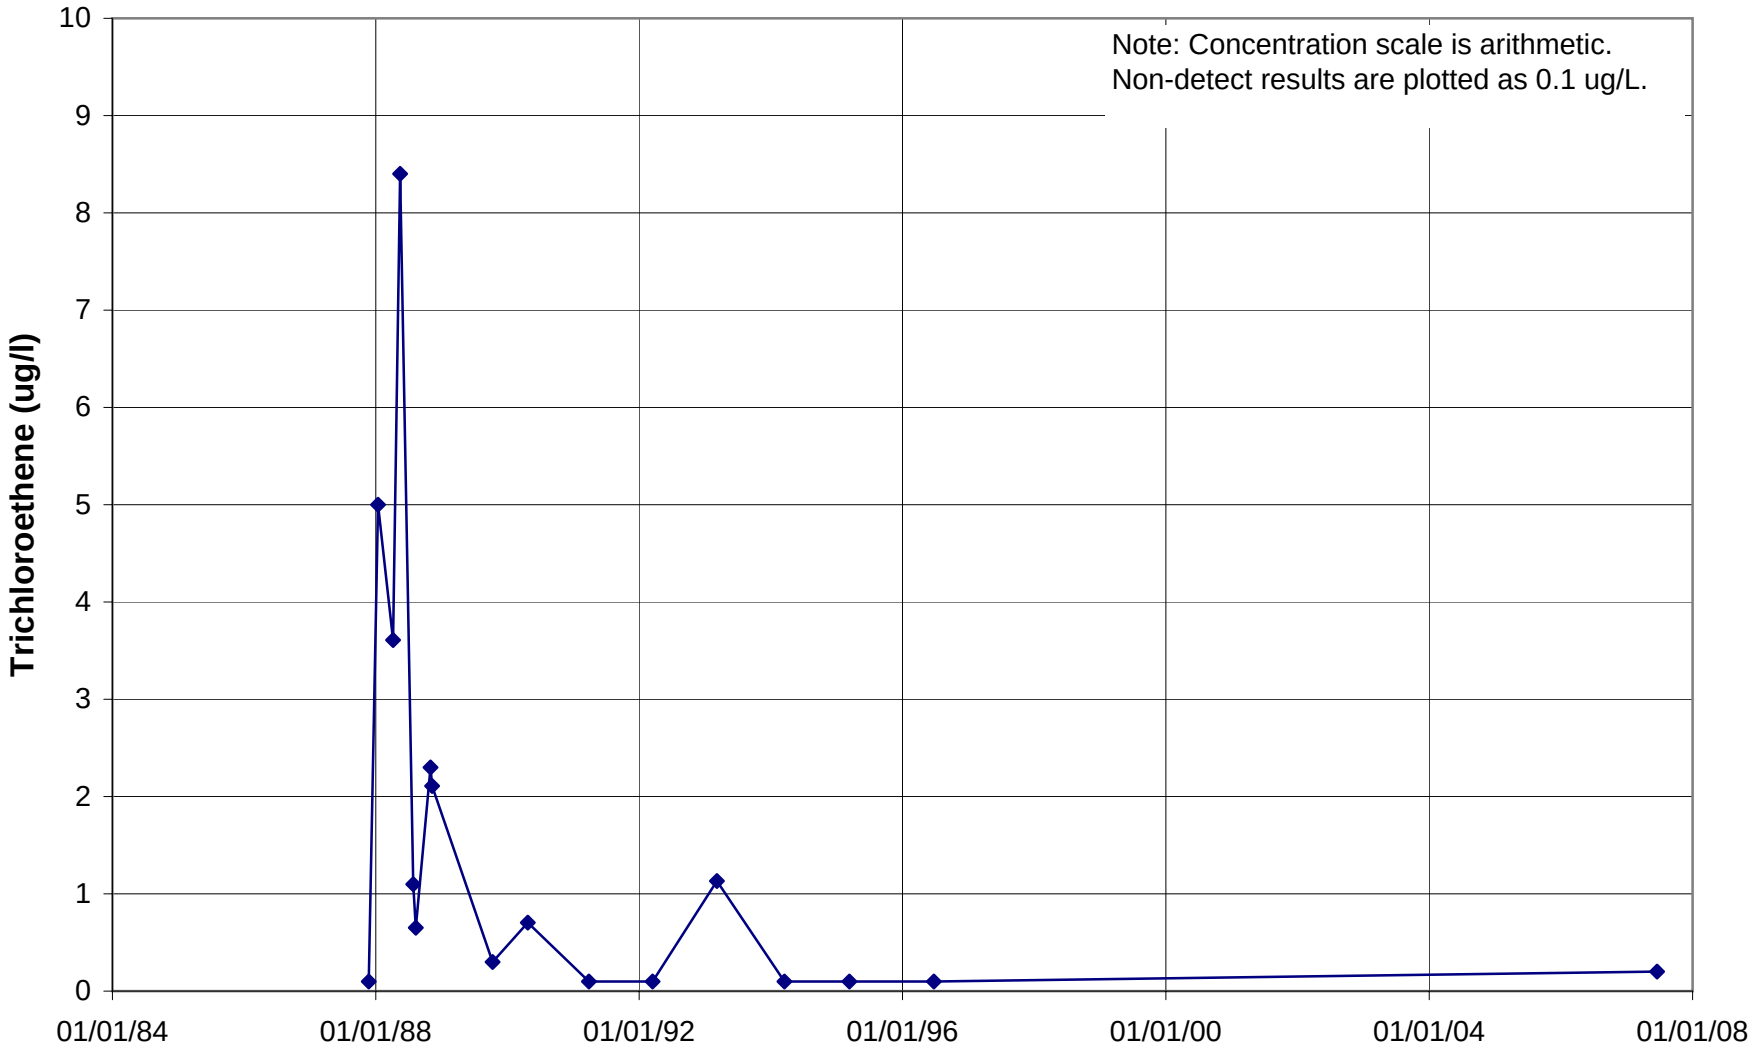

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U007

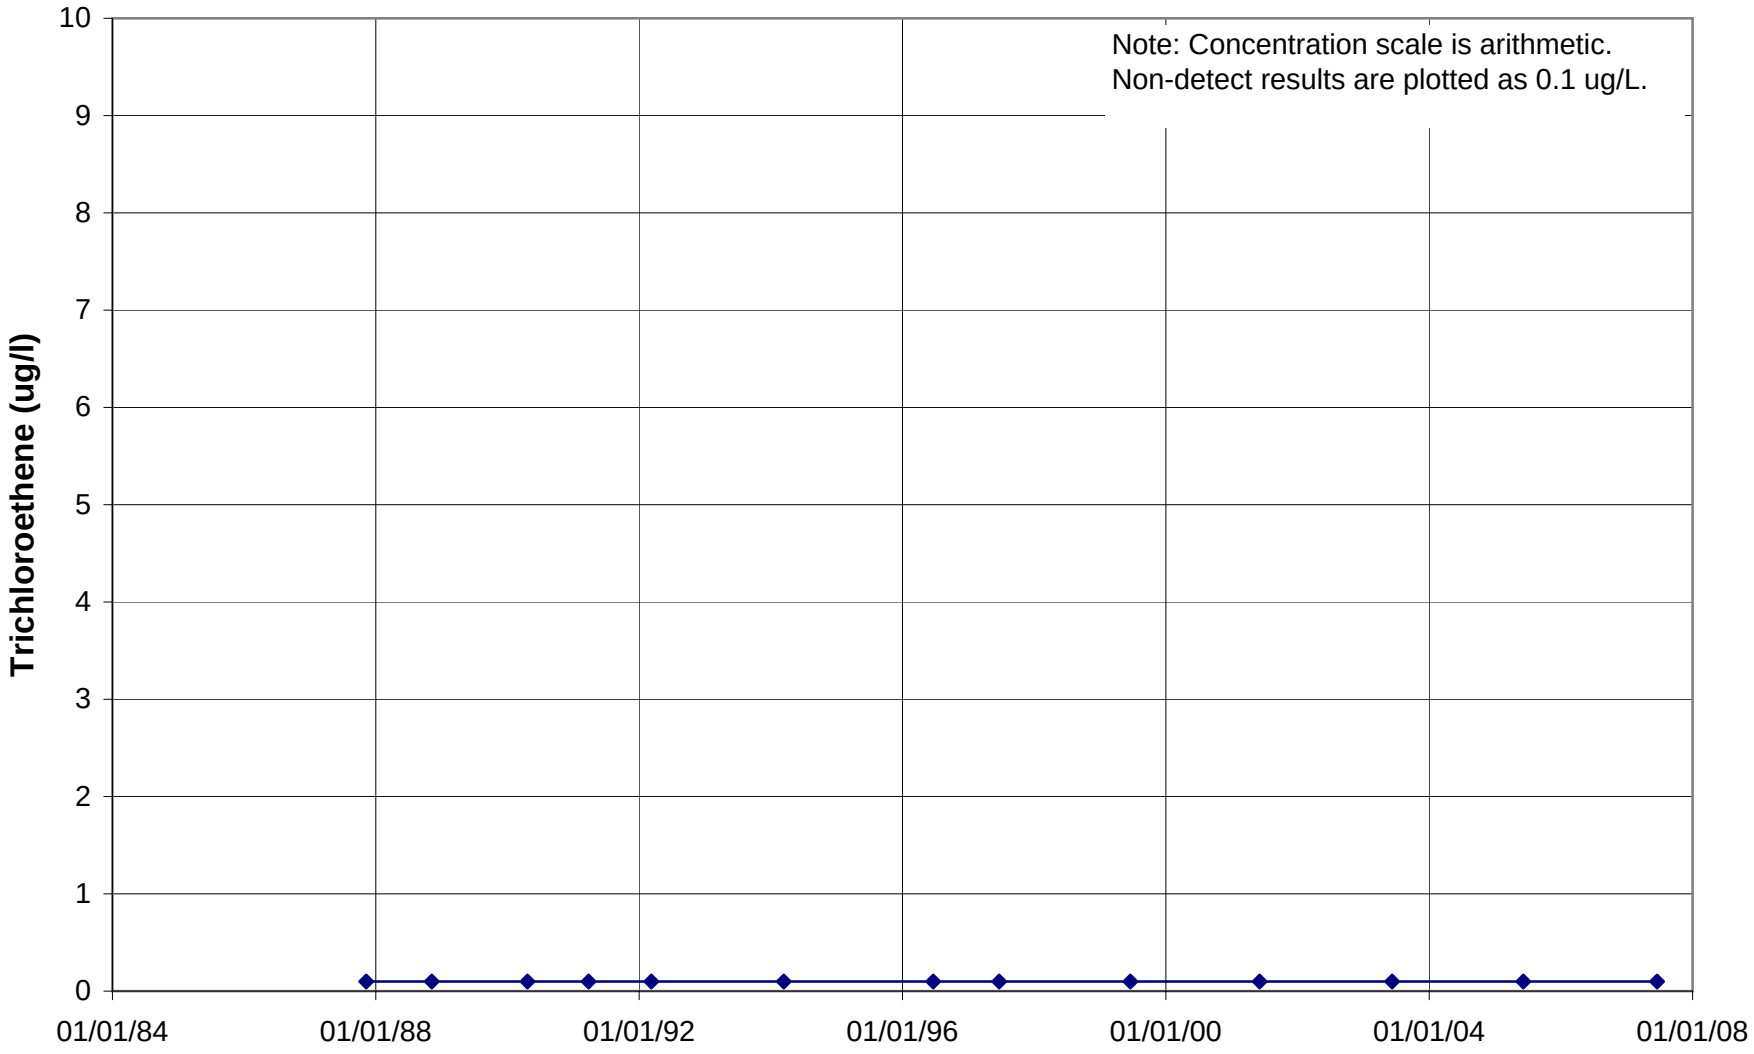

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U008

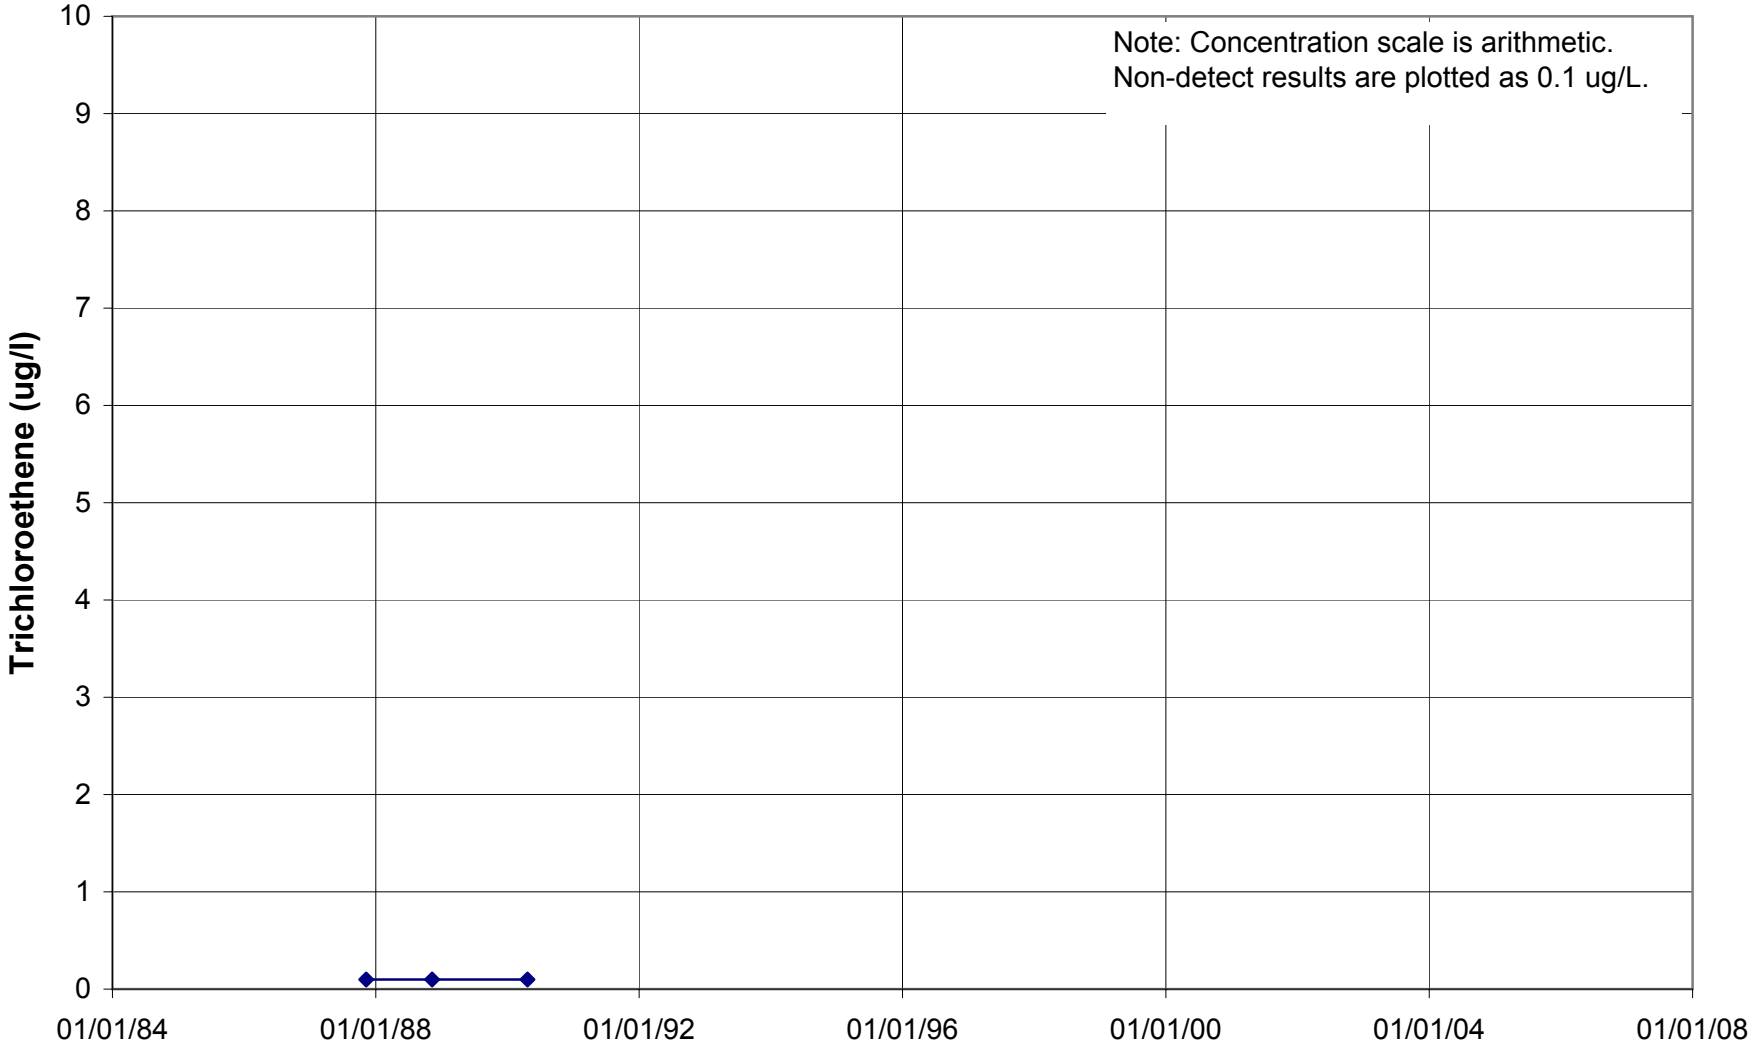

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U009

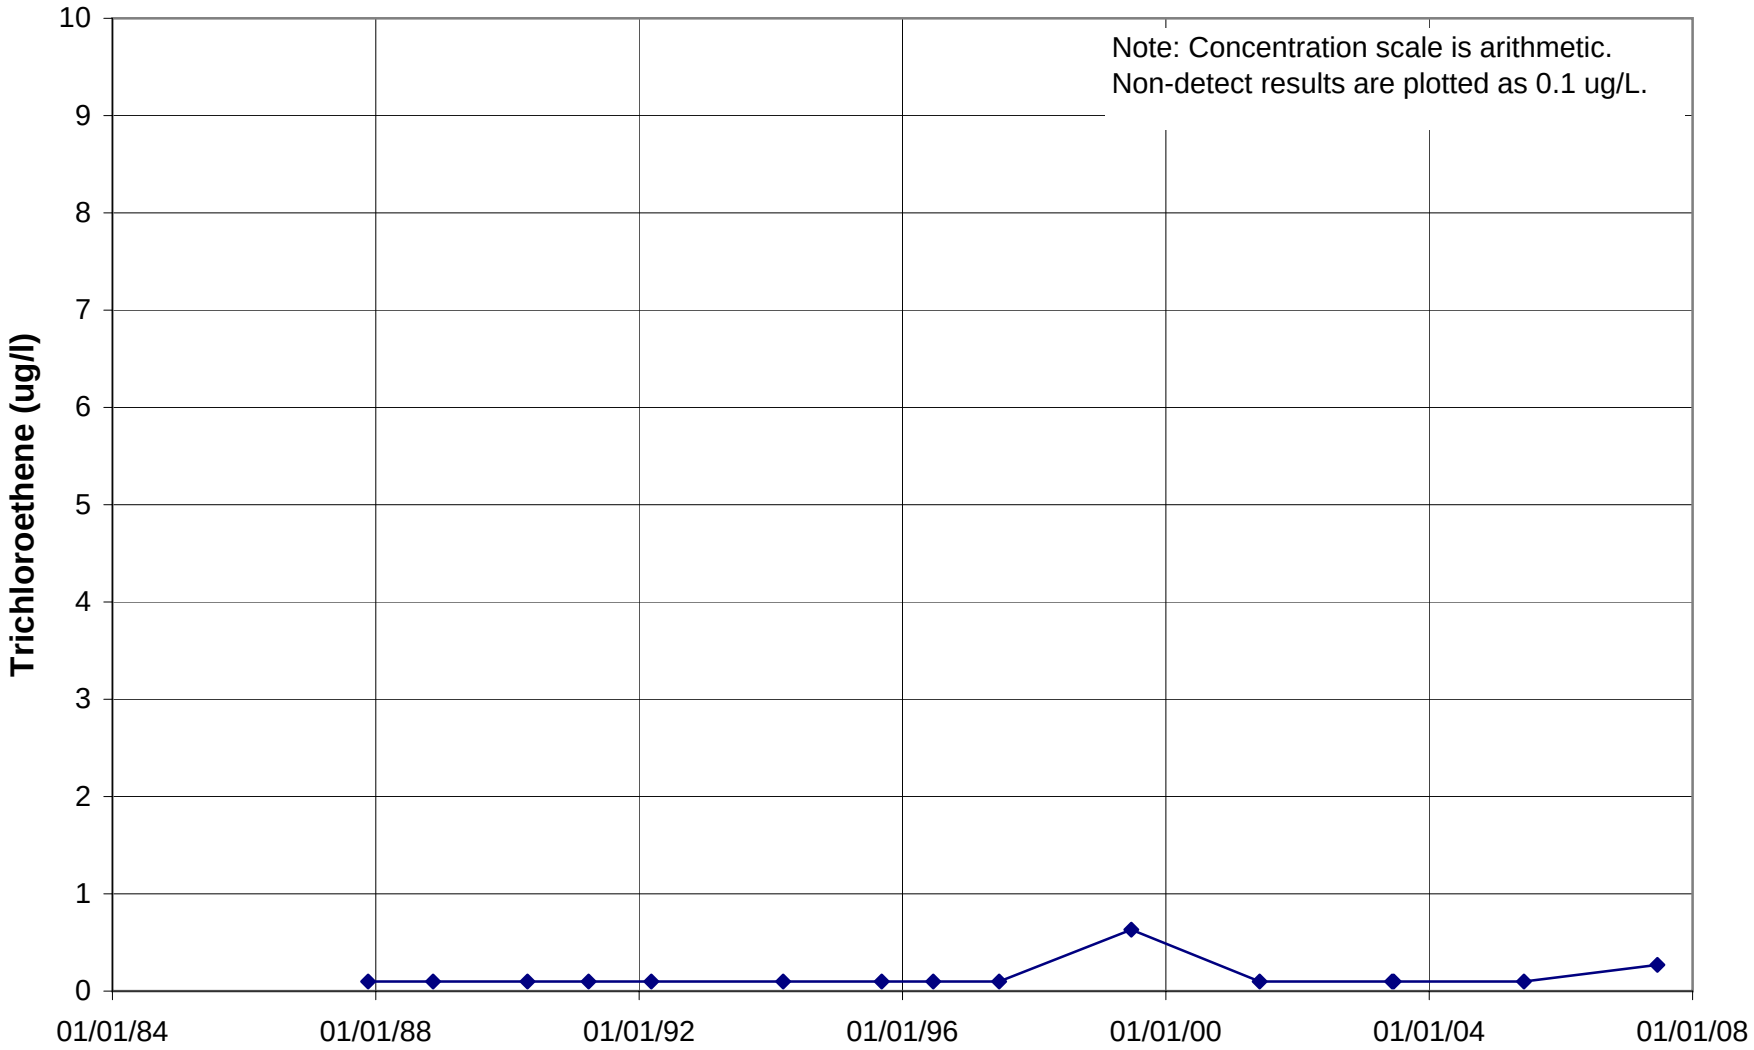

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U010

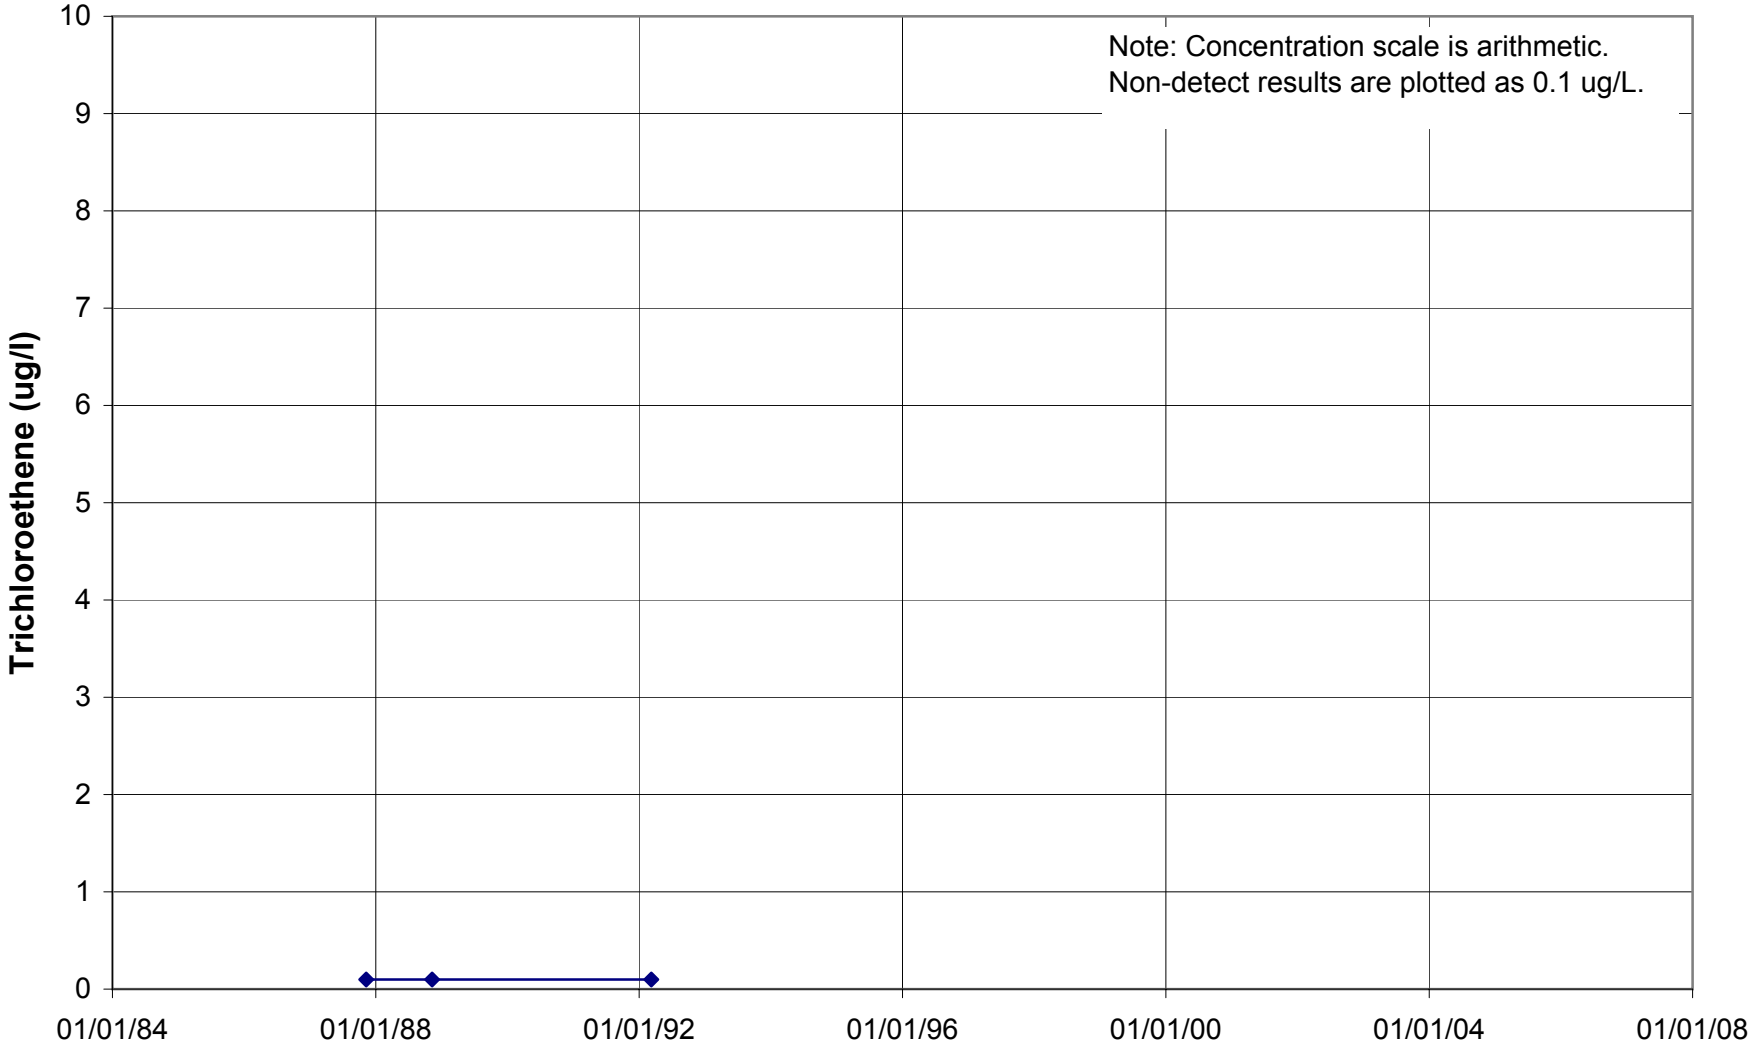

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U012

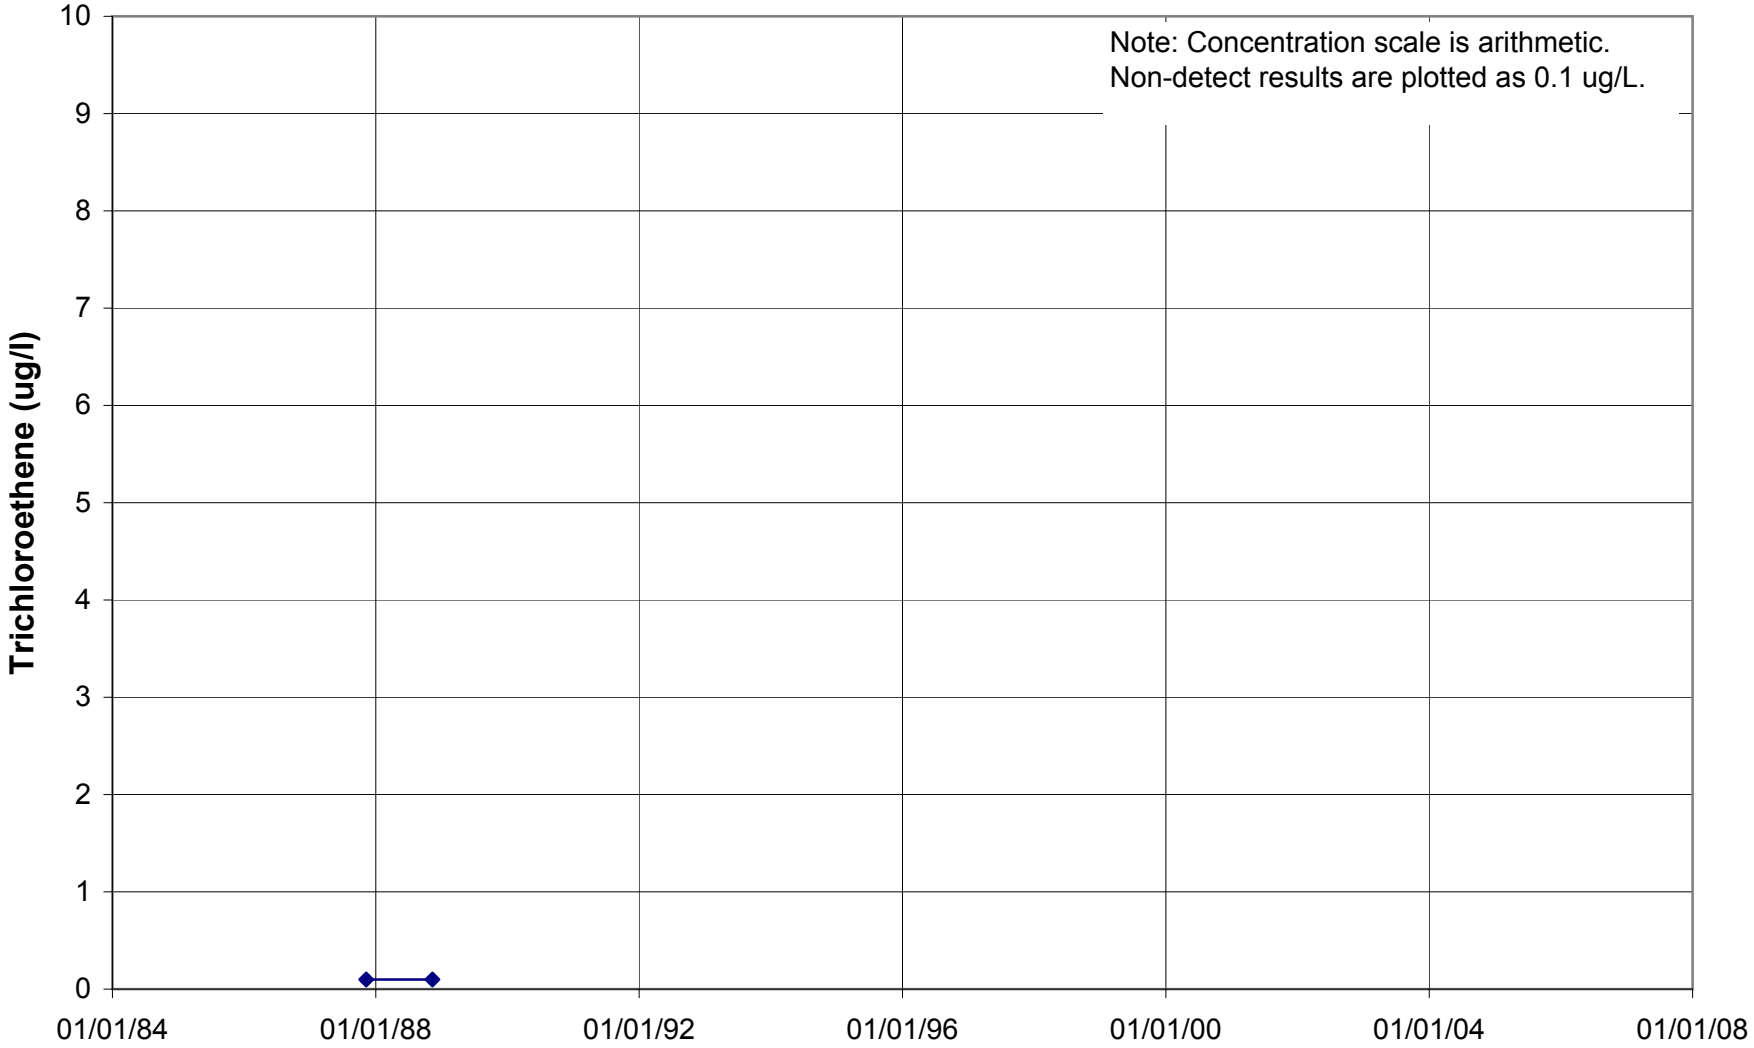

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U013

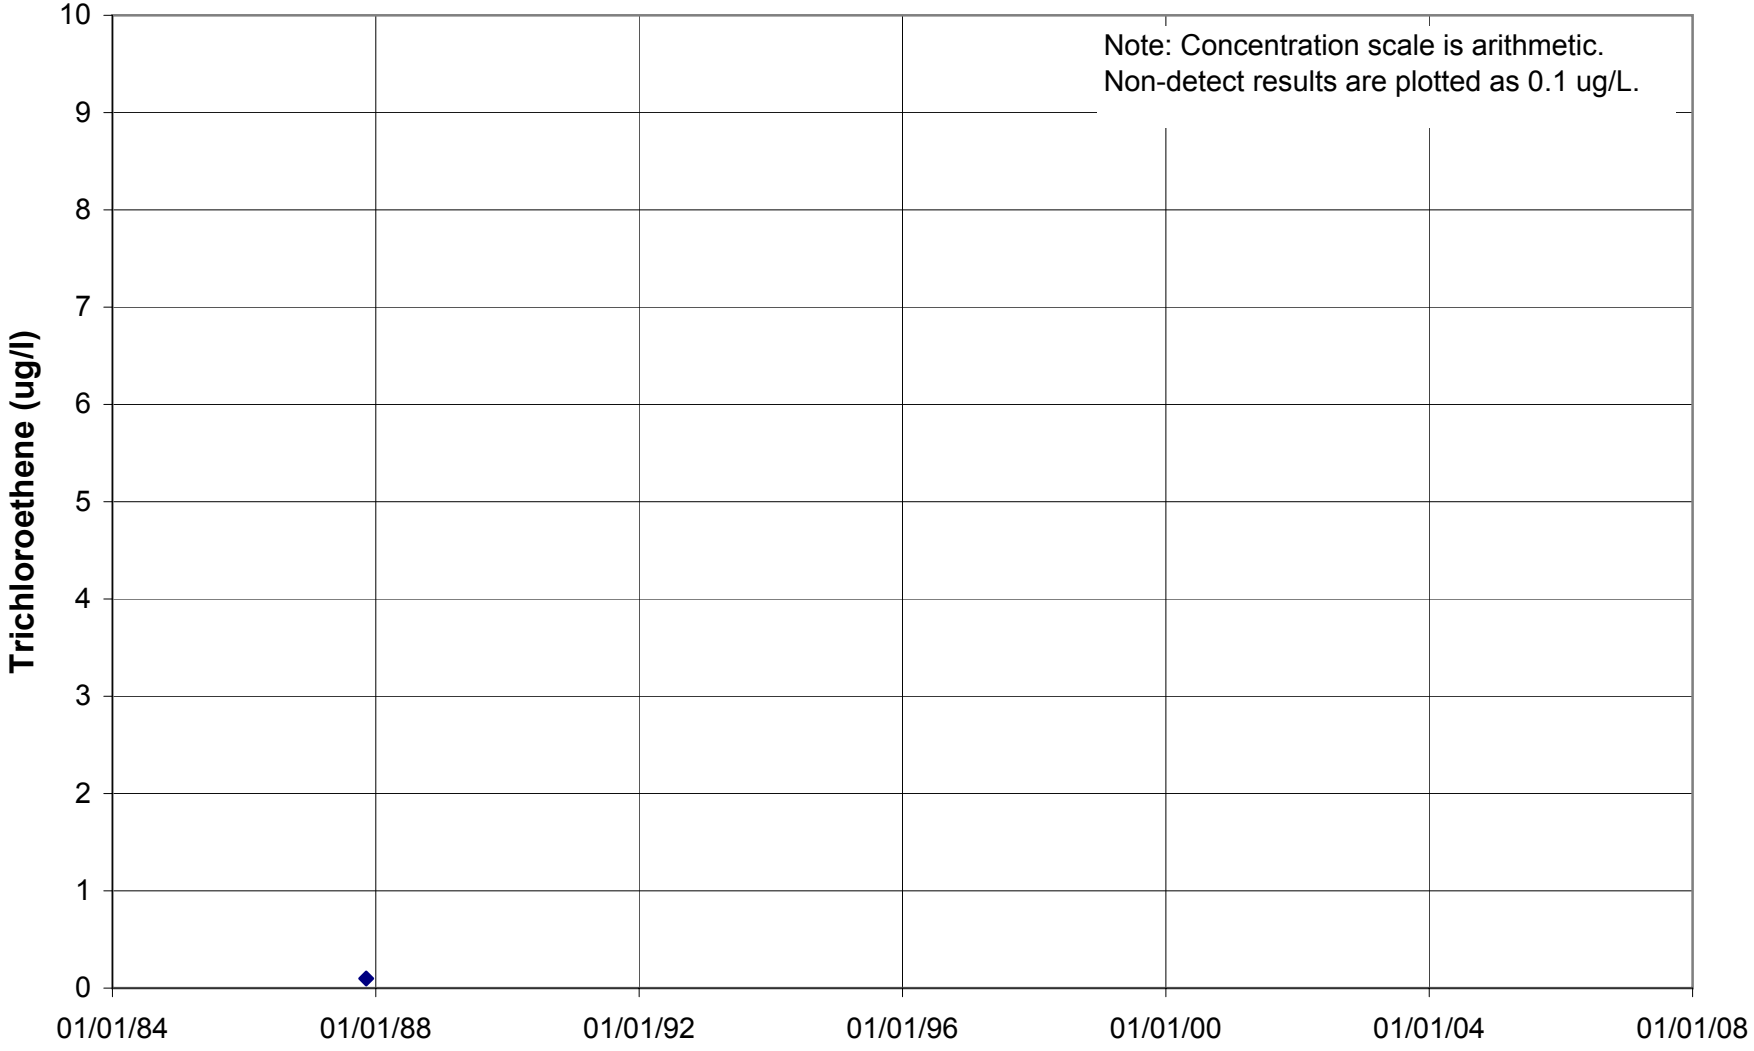

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U014

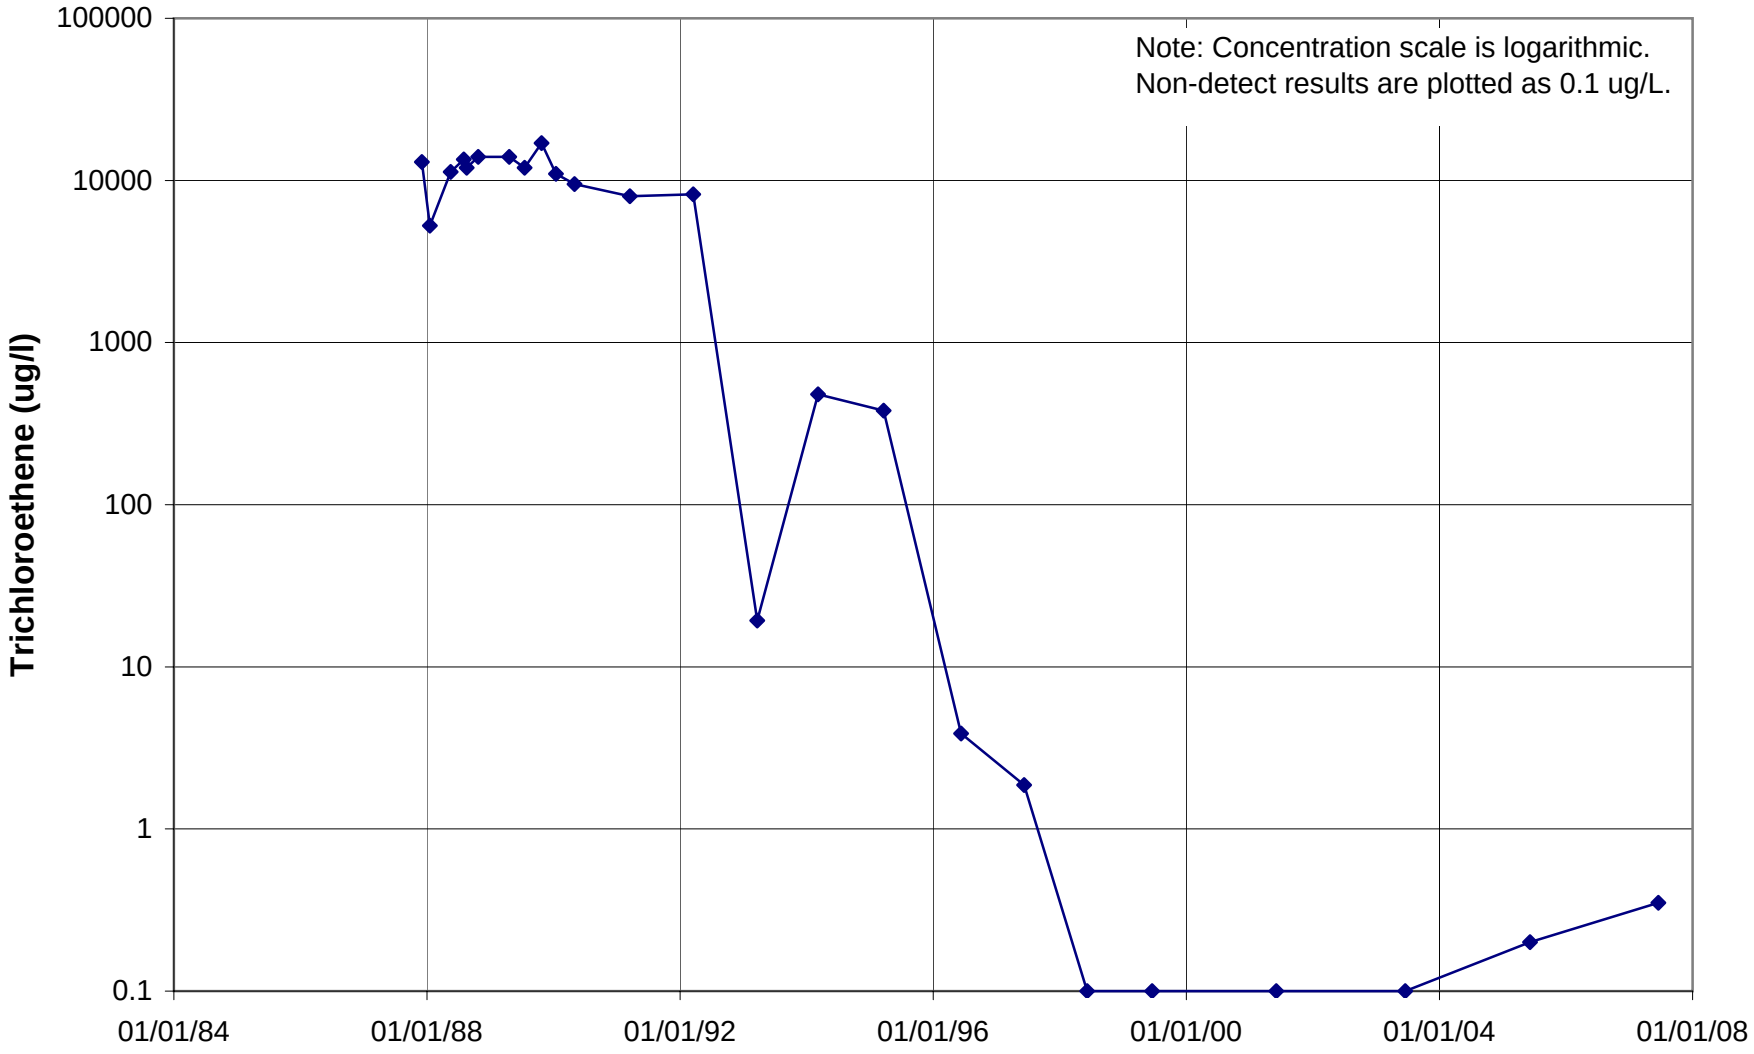

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U016

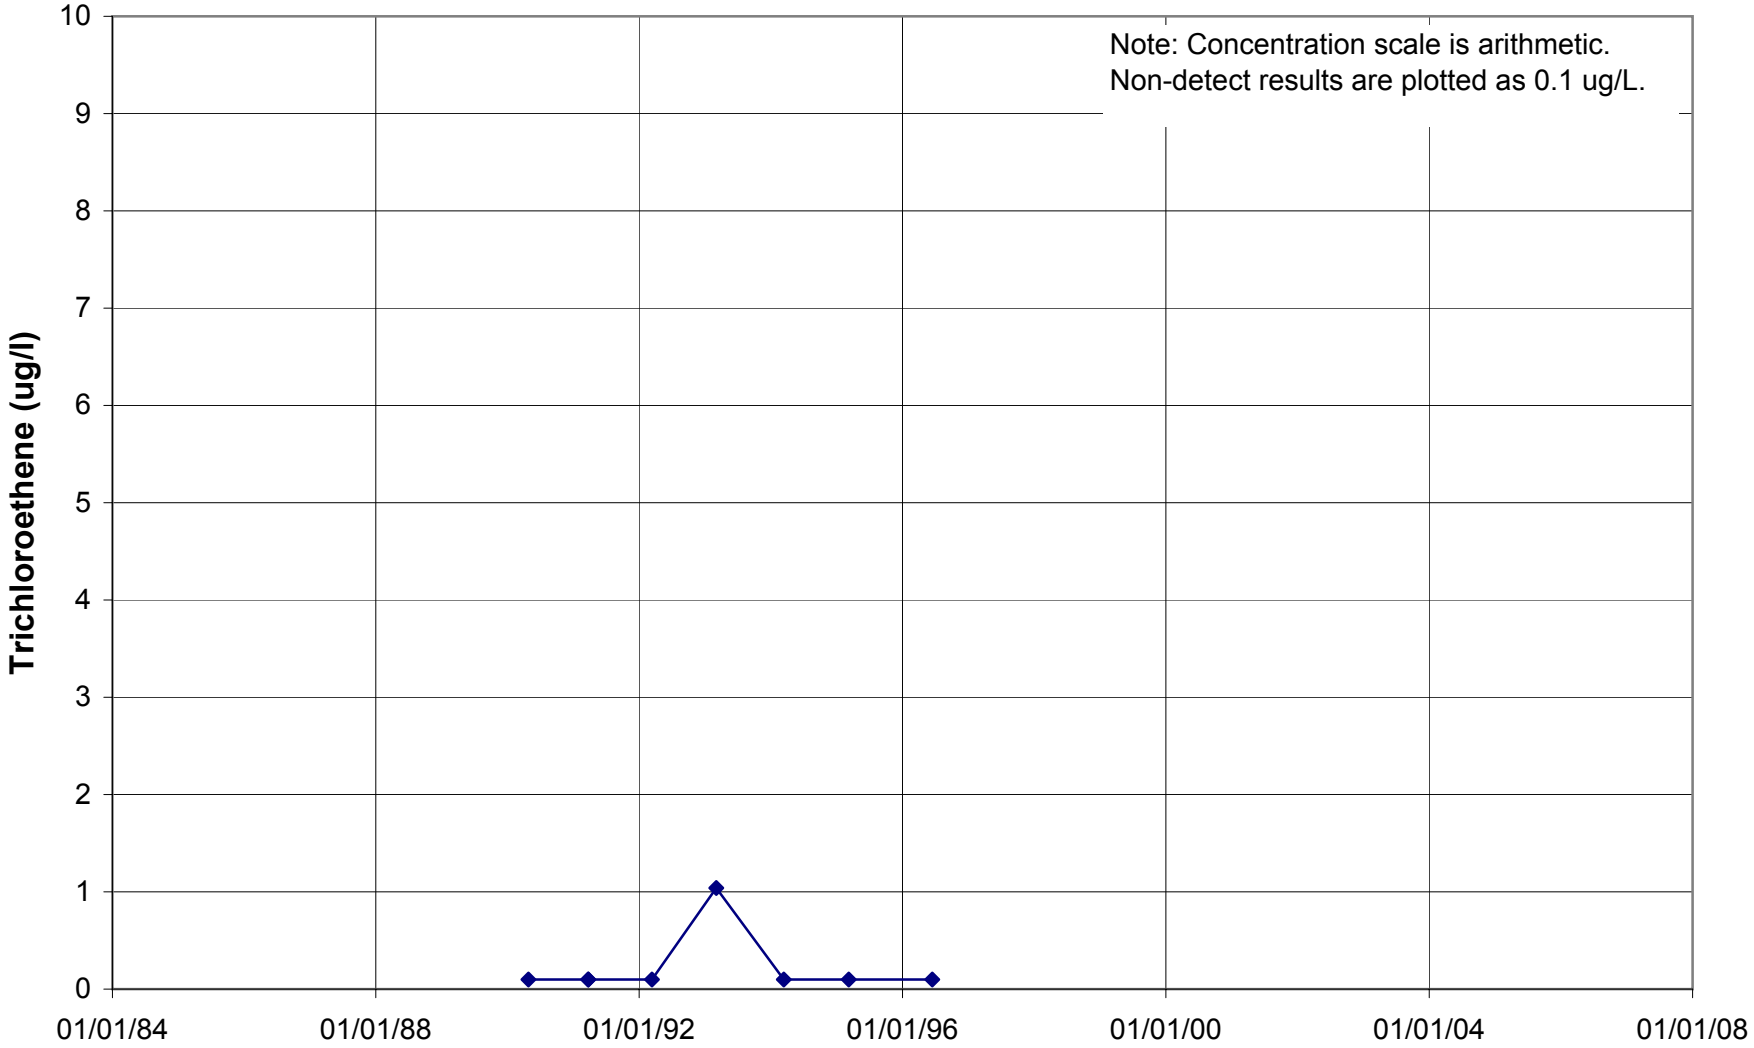

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U017

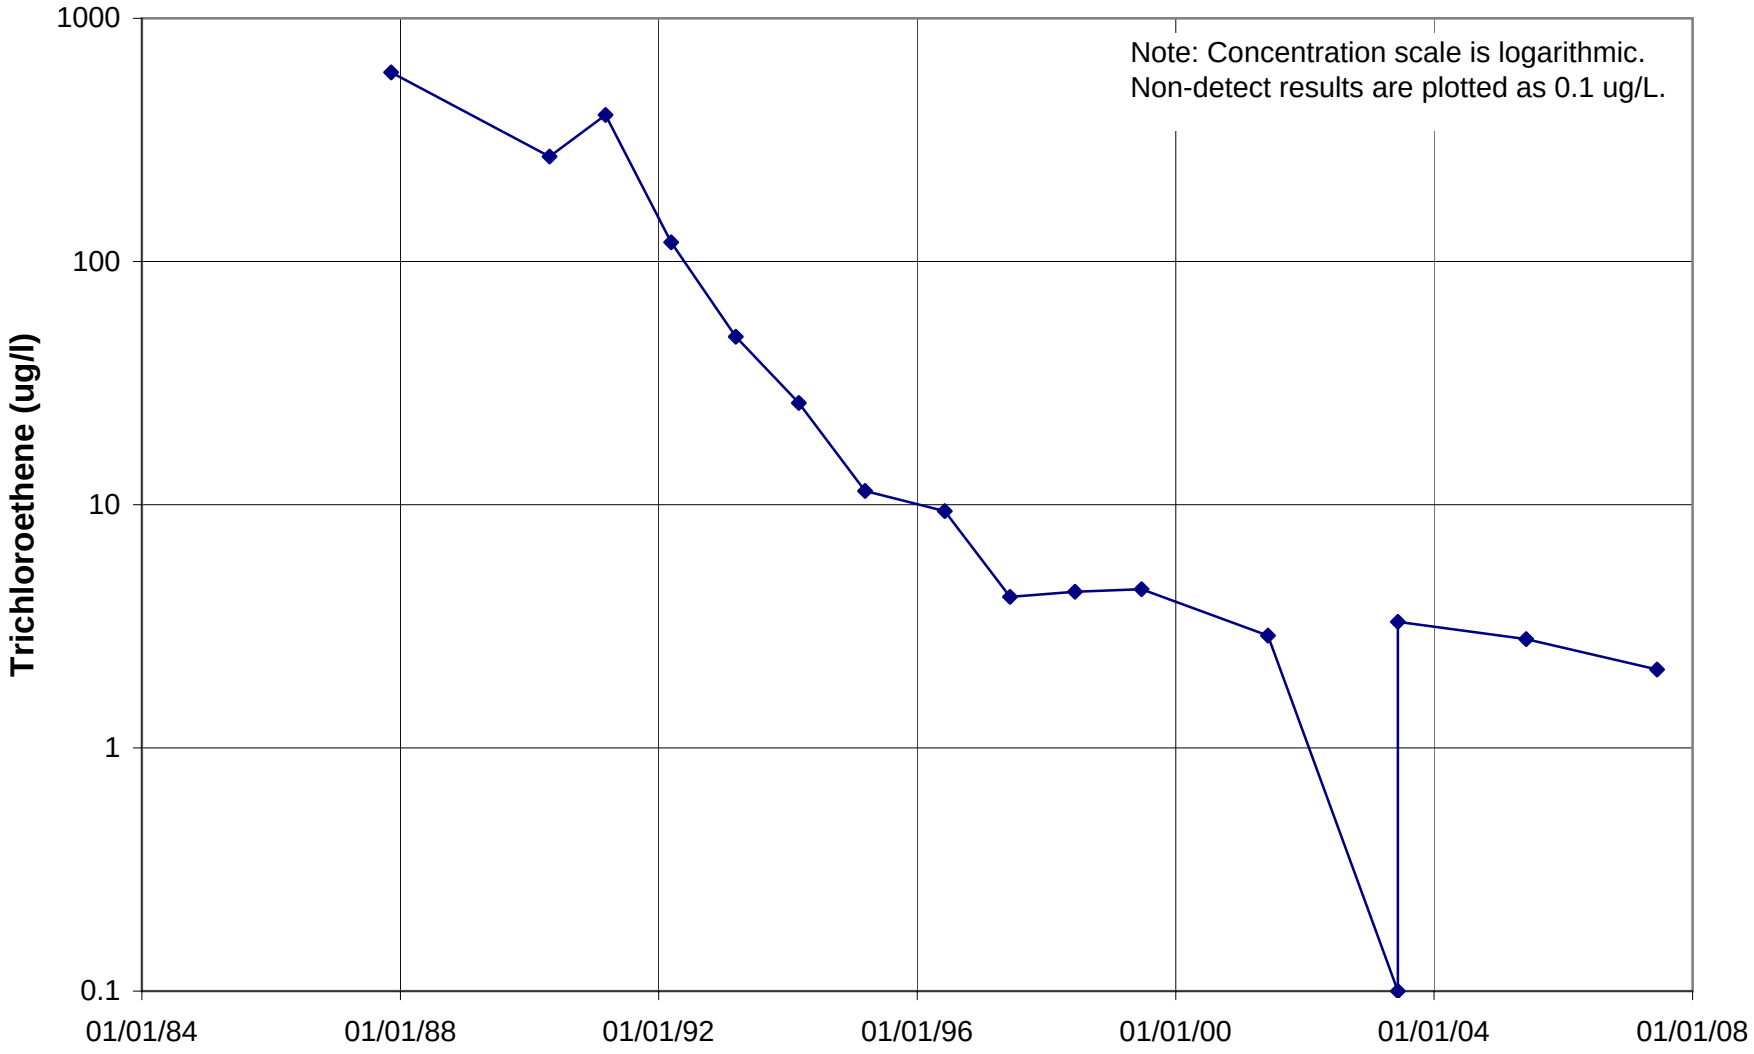

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U018

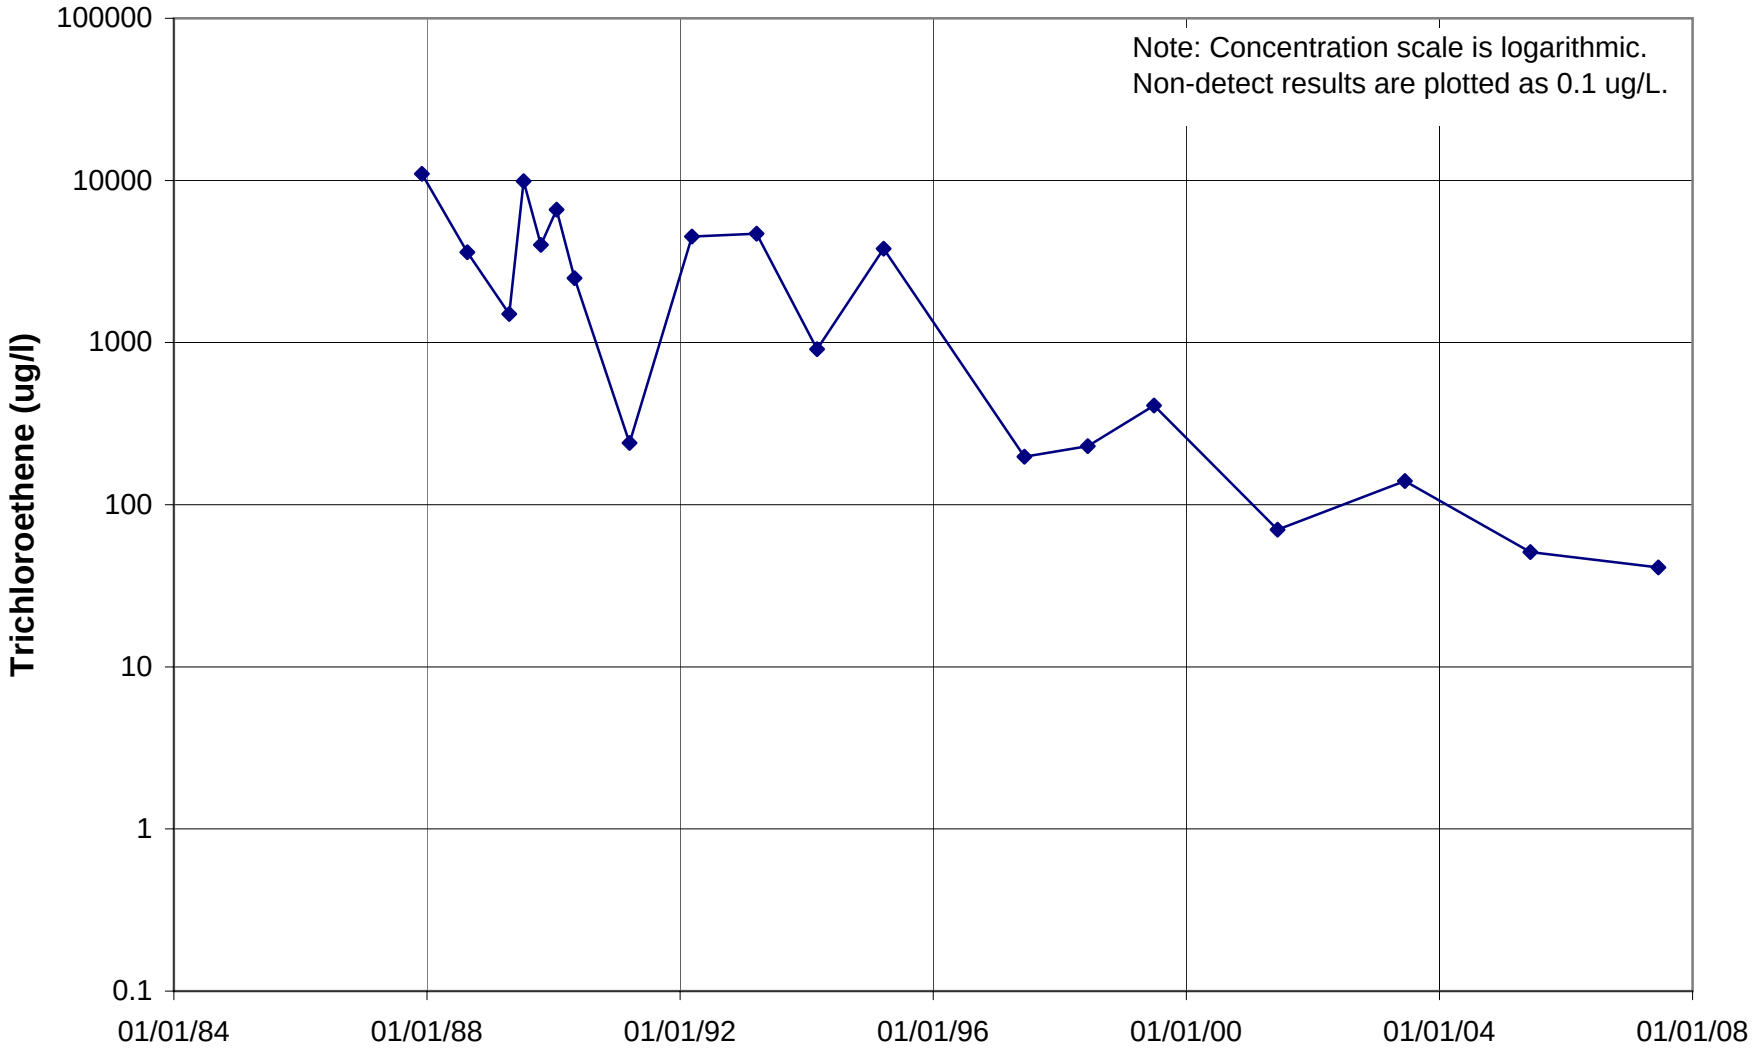

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U019

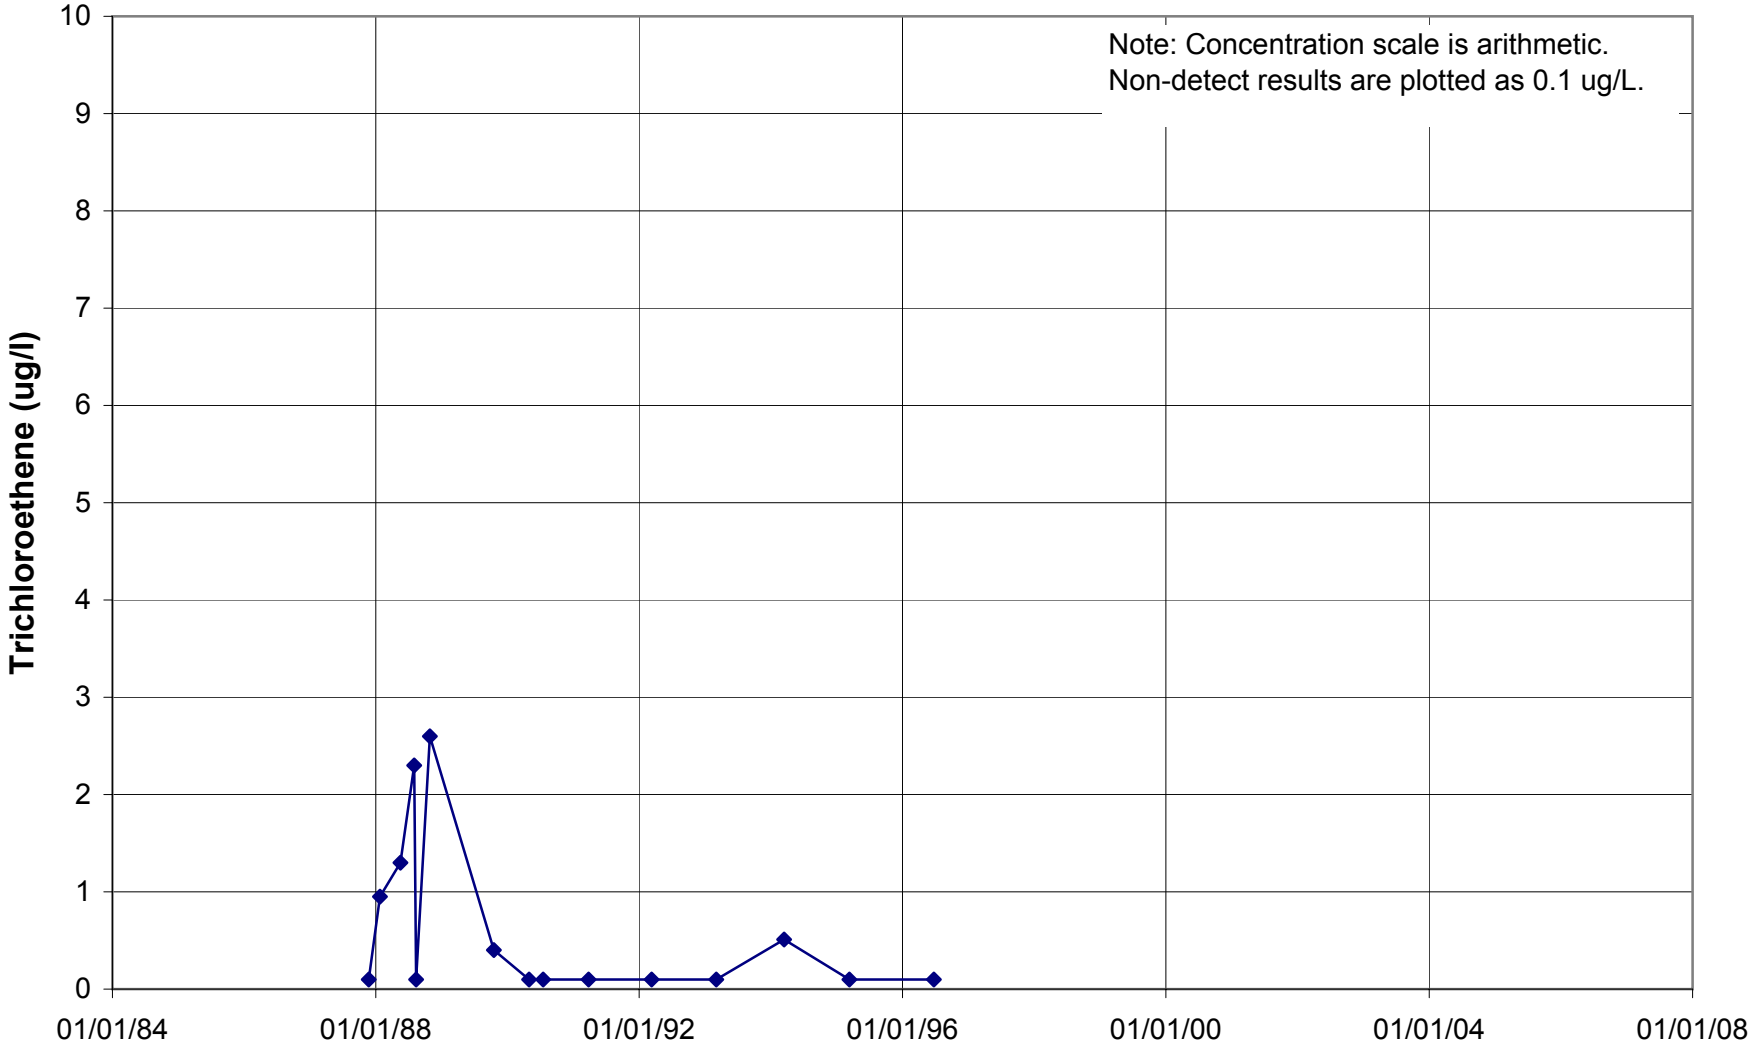

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U020

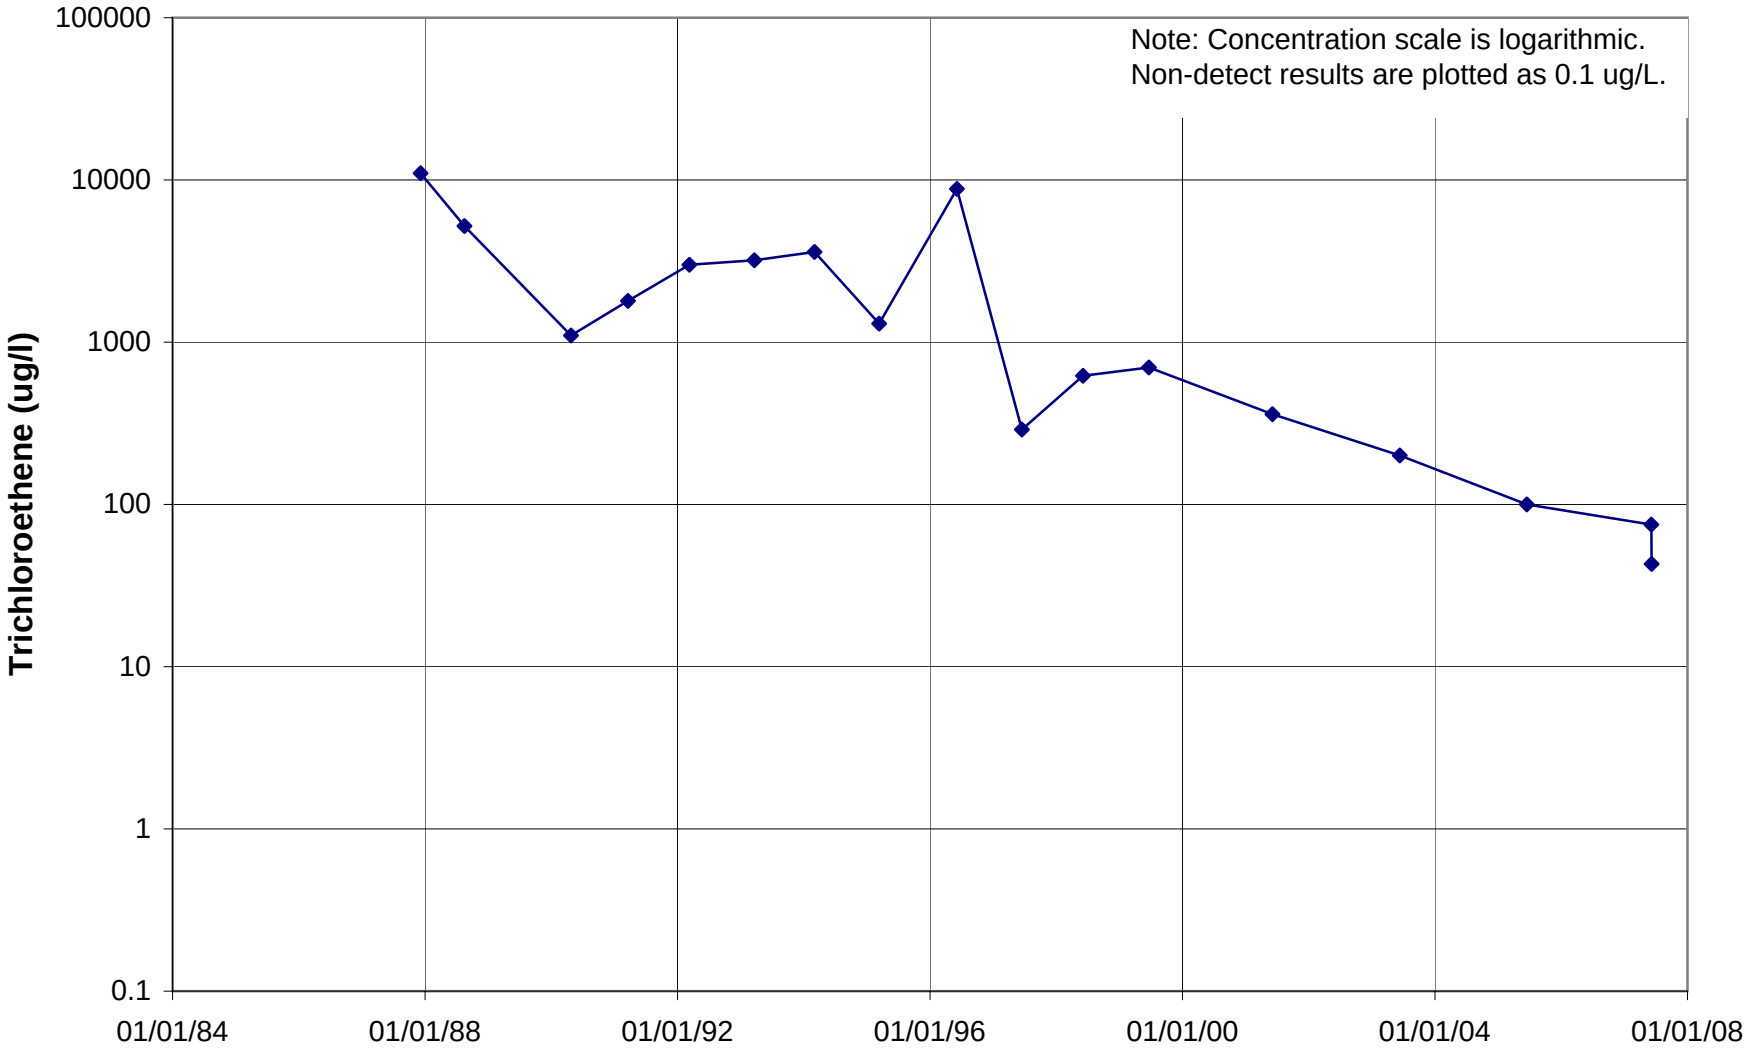

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U021

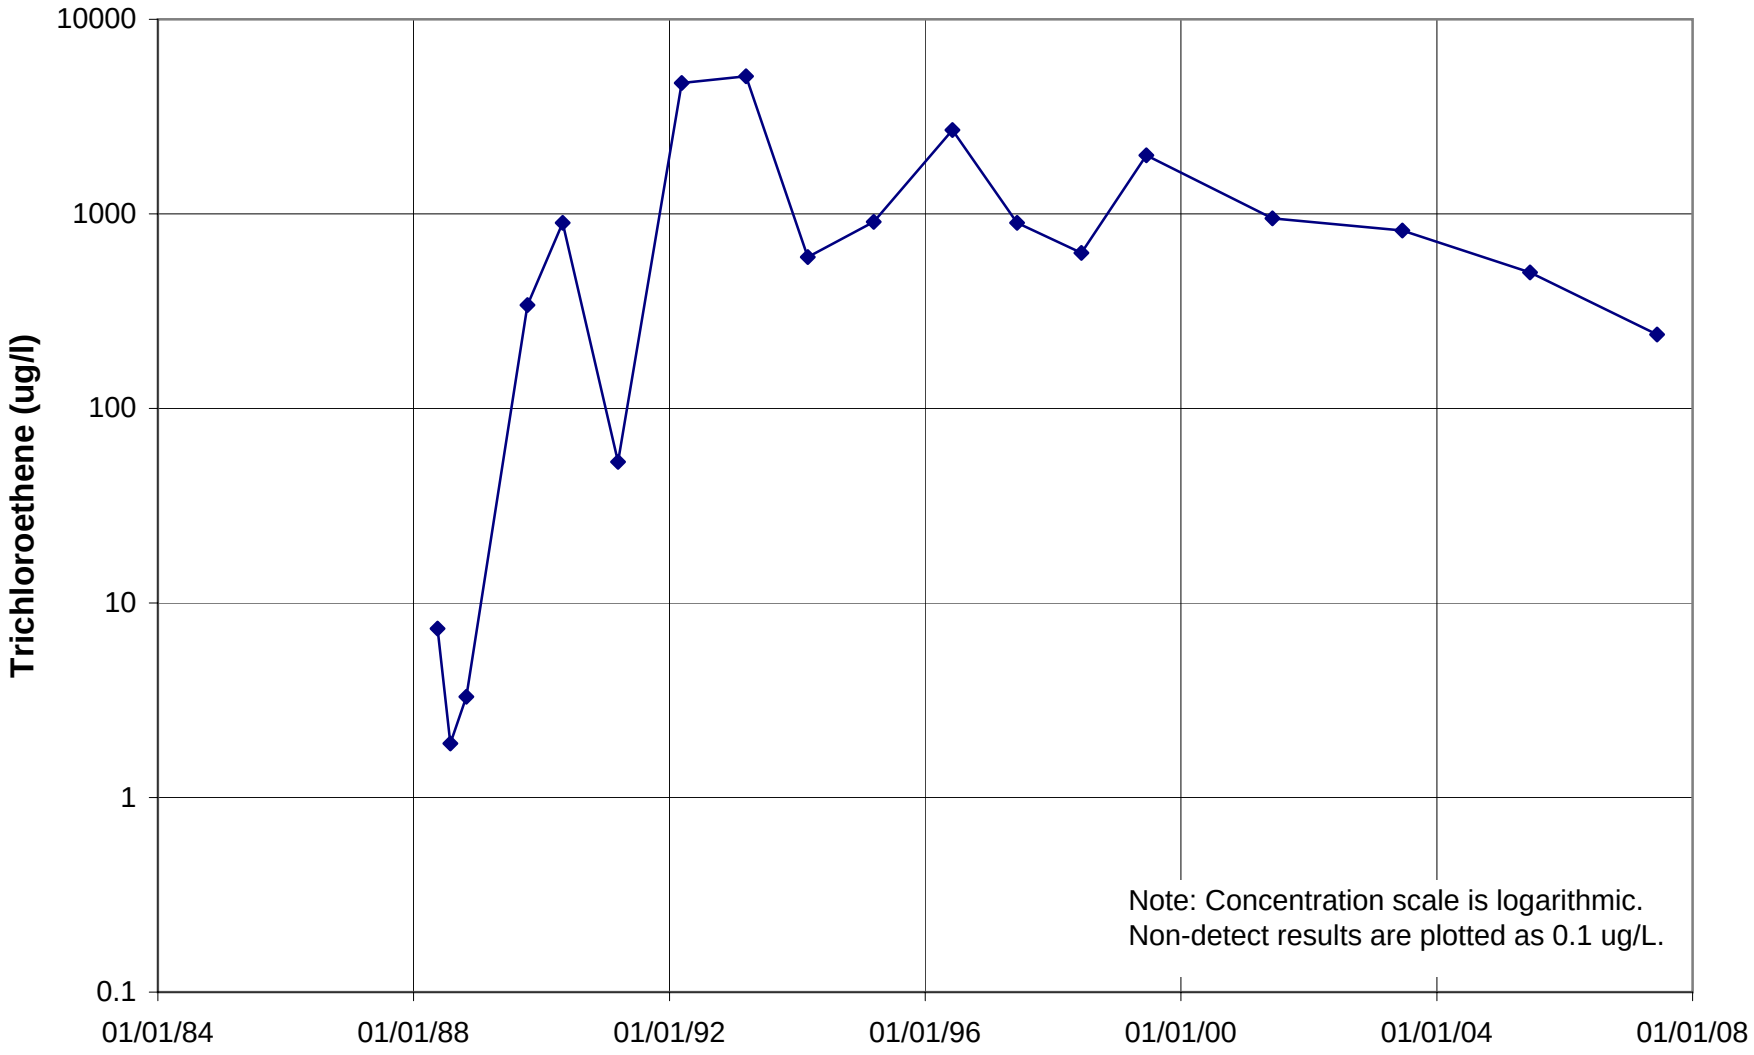

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U022

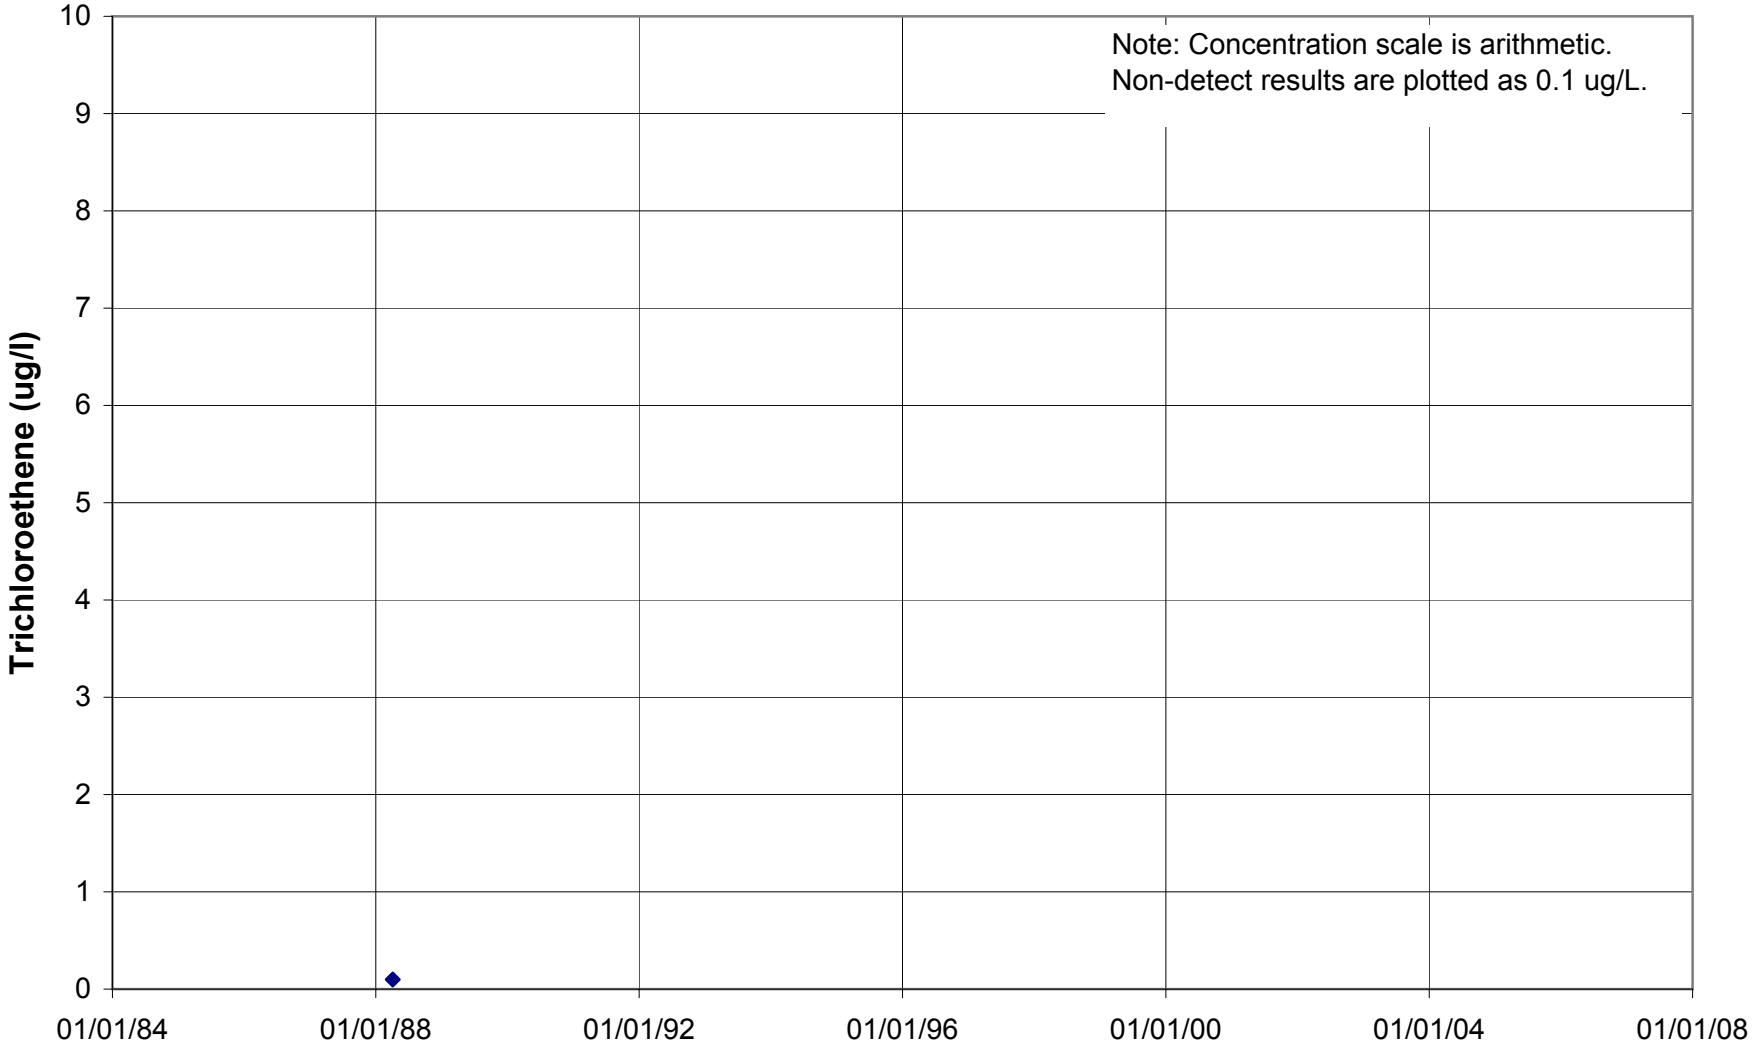

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U023

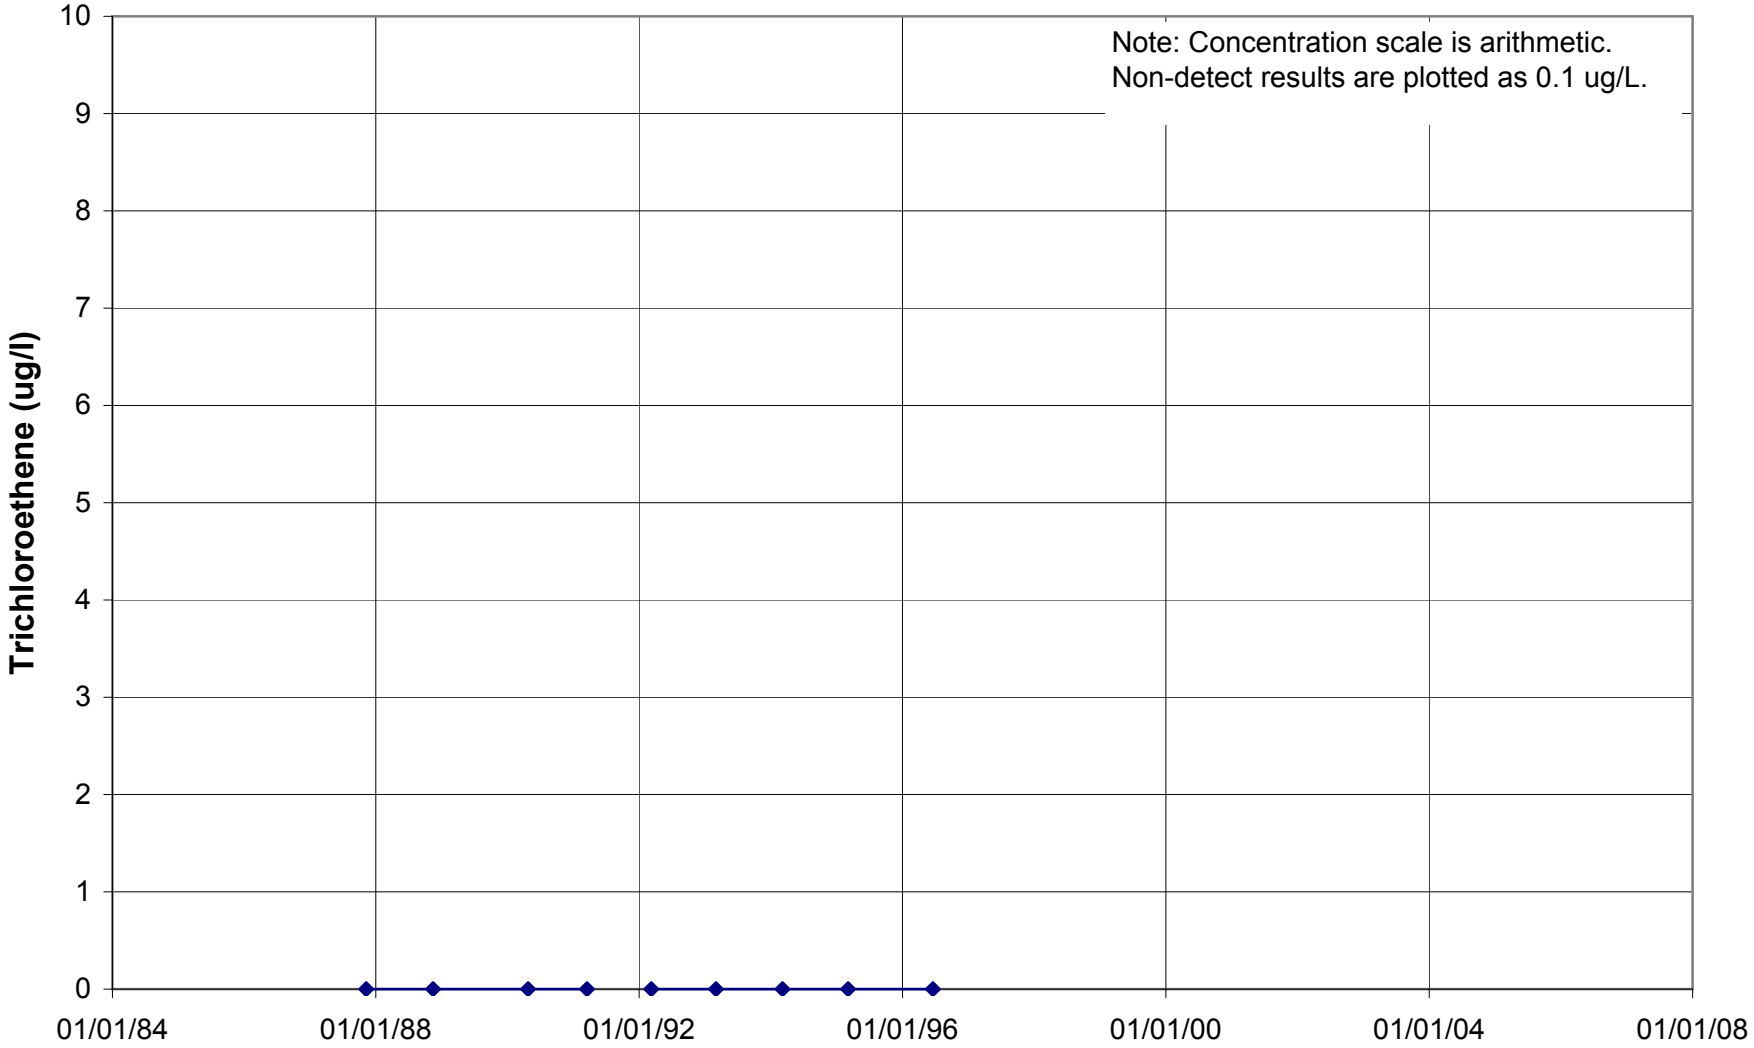

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U024

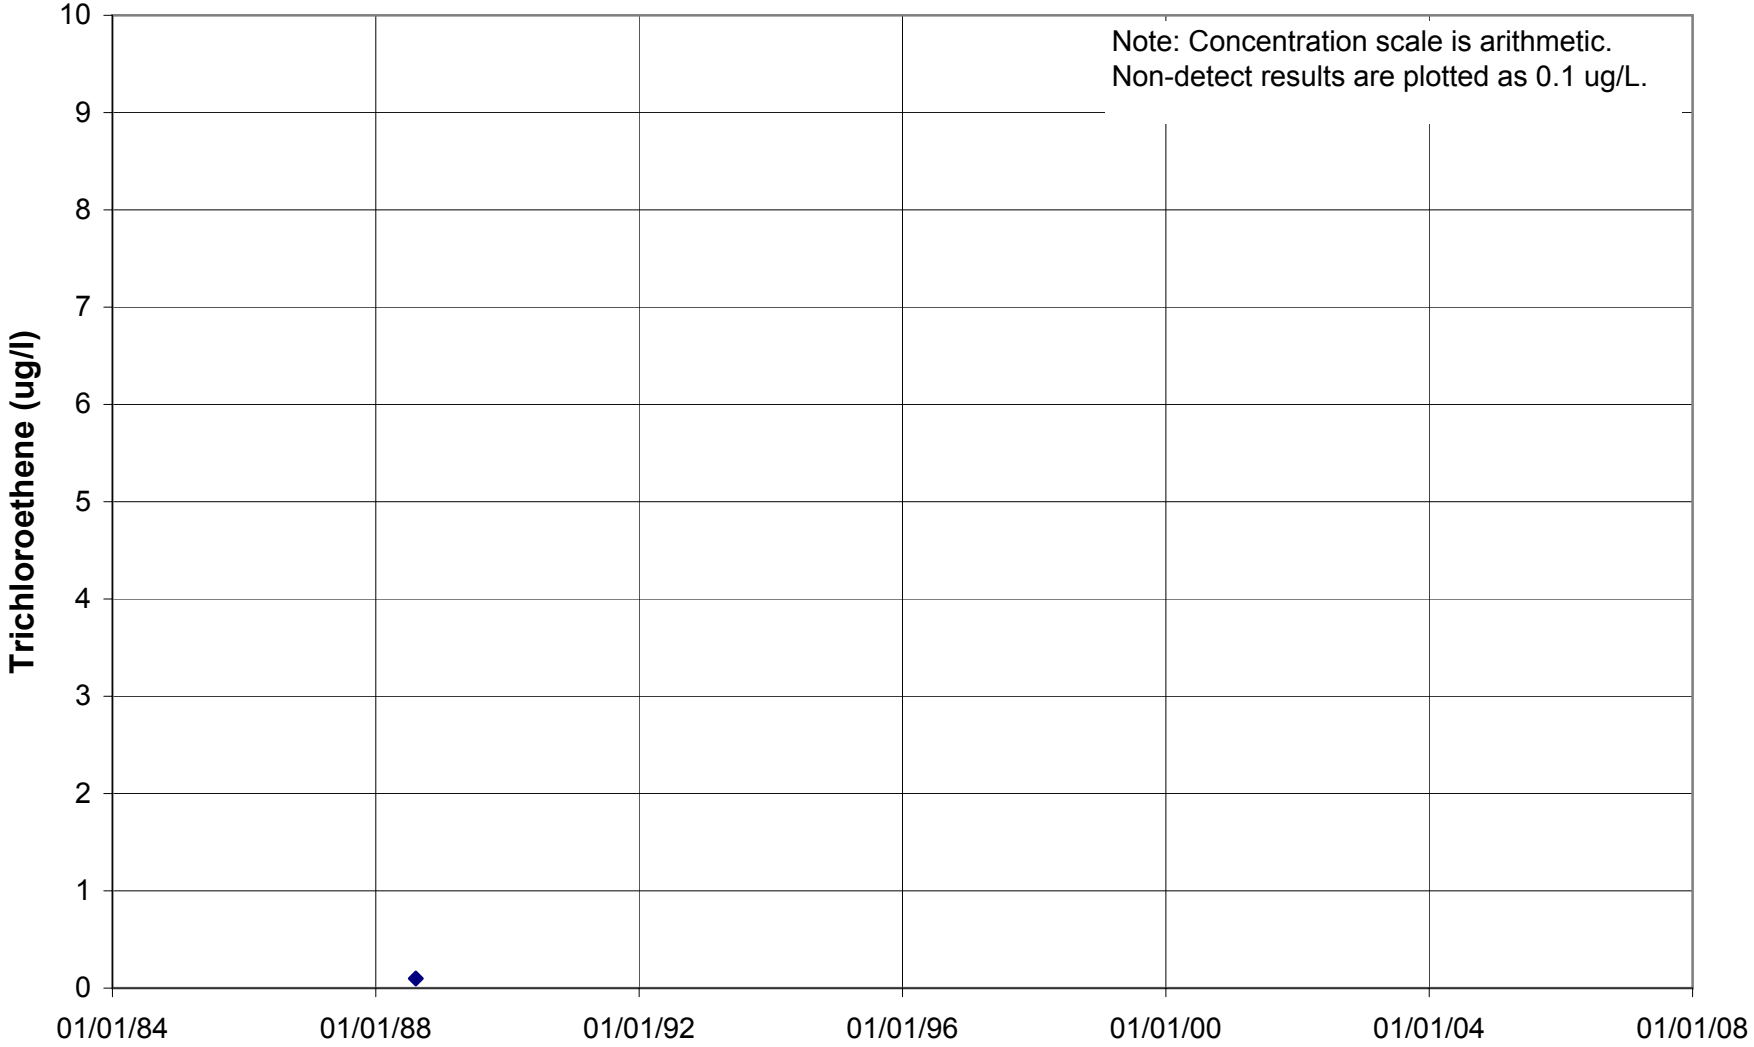

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U027

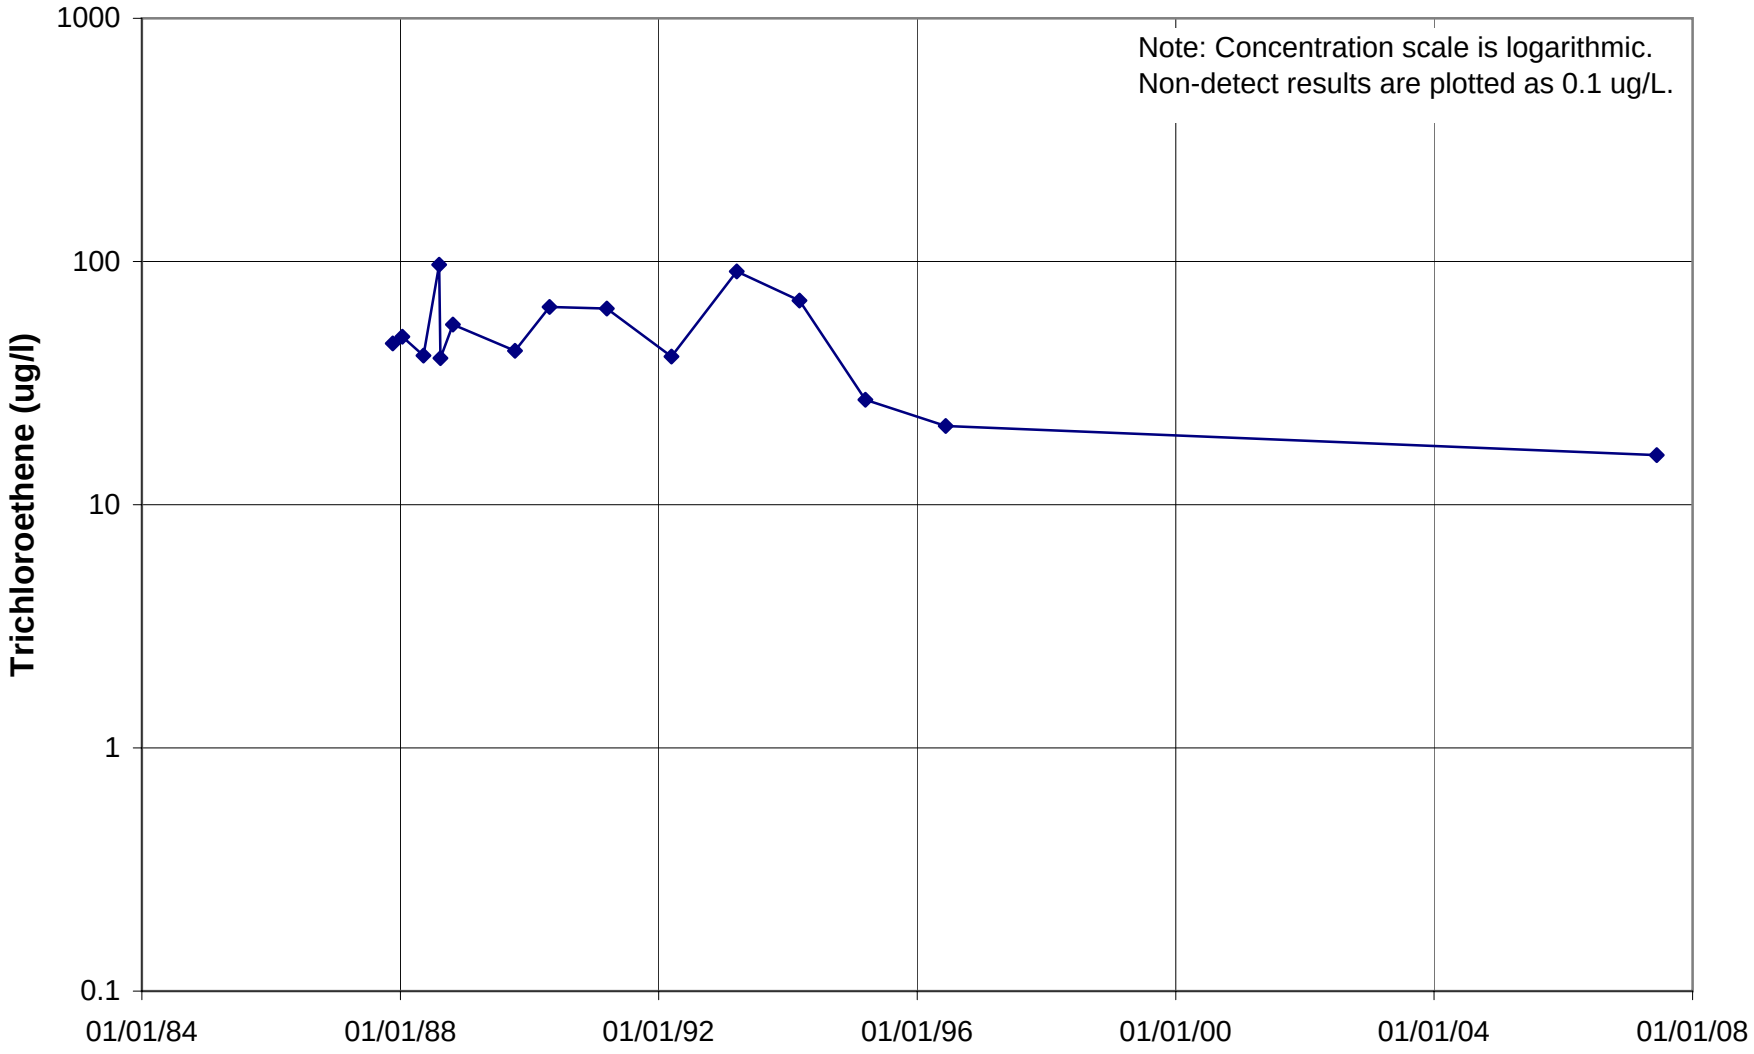

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U028

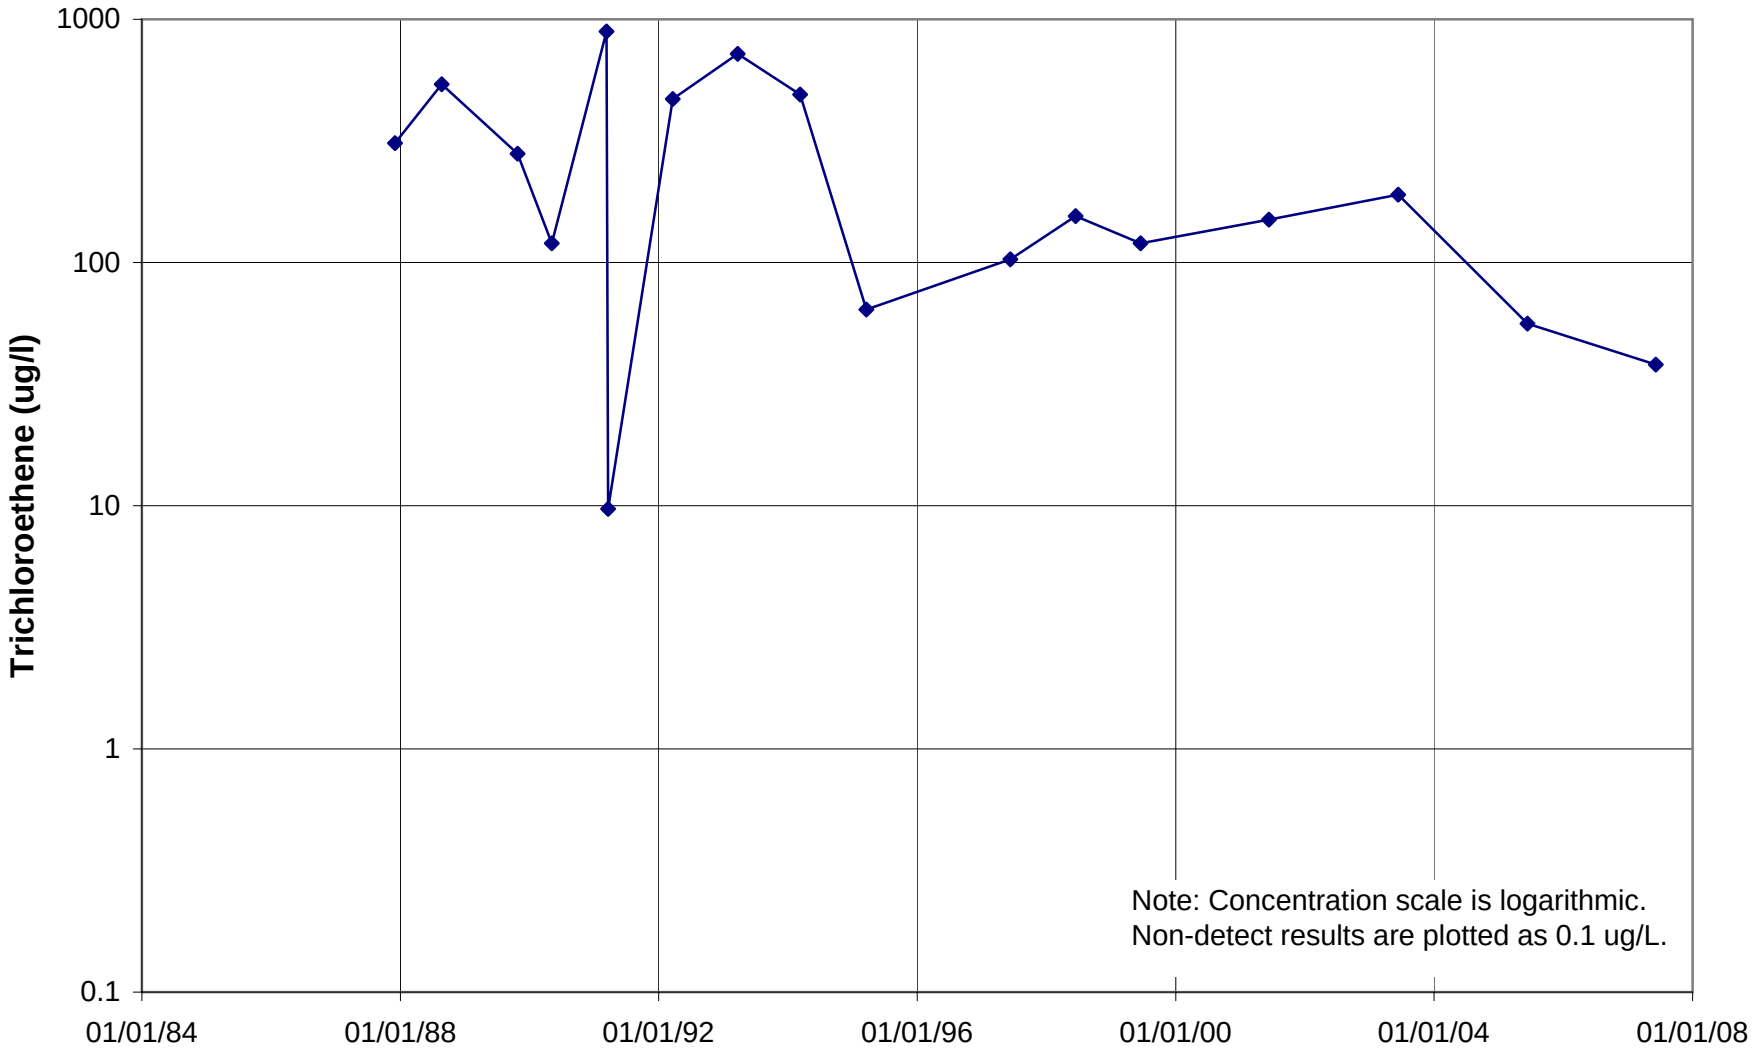

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U029

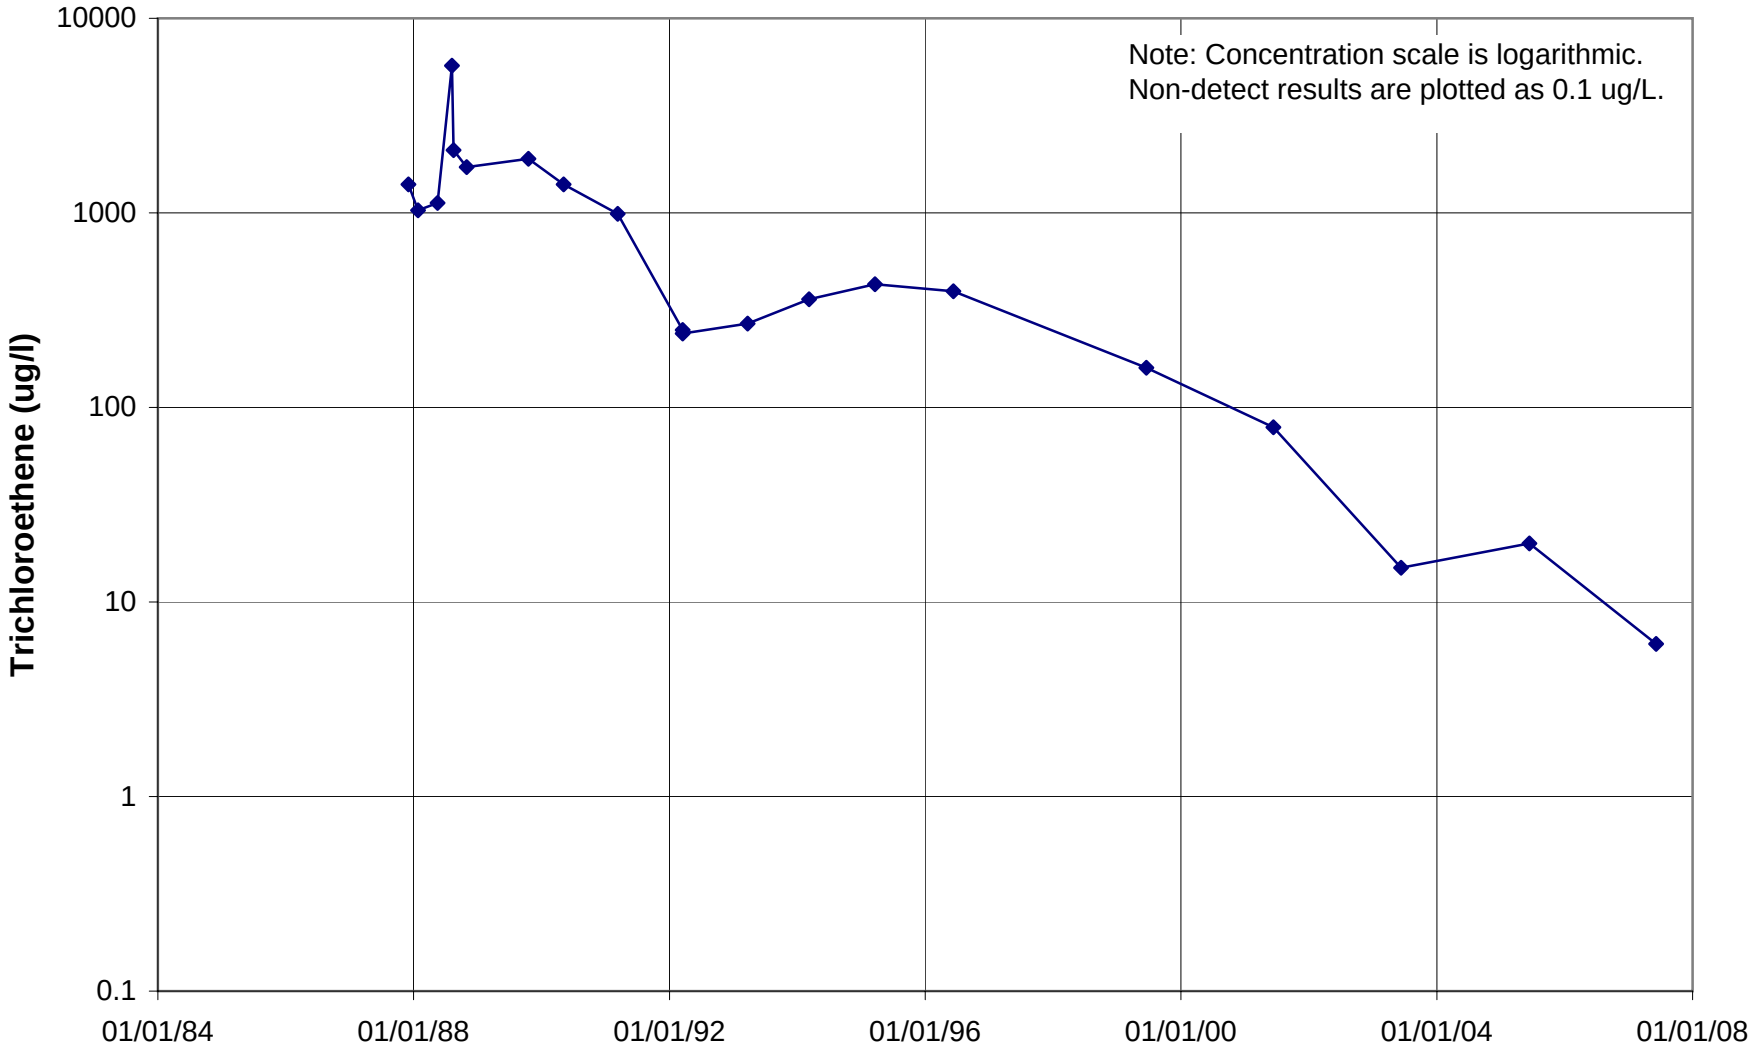

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U030

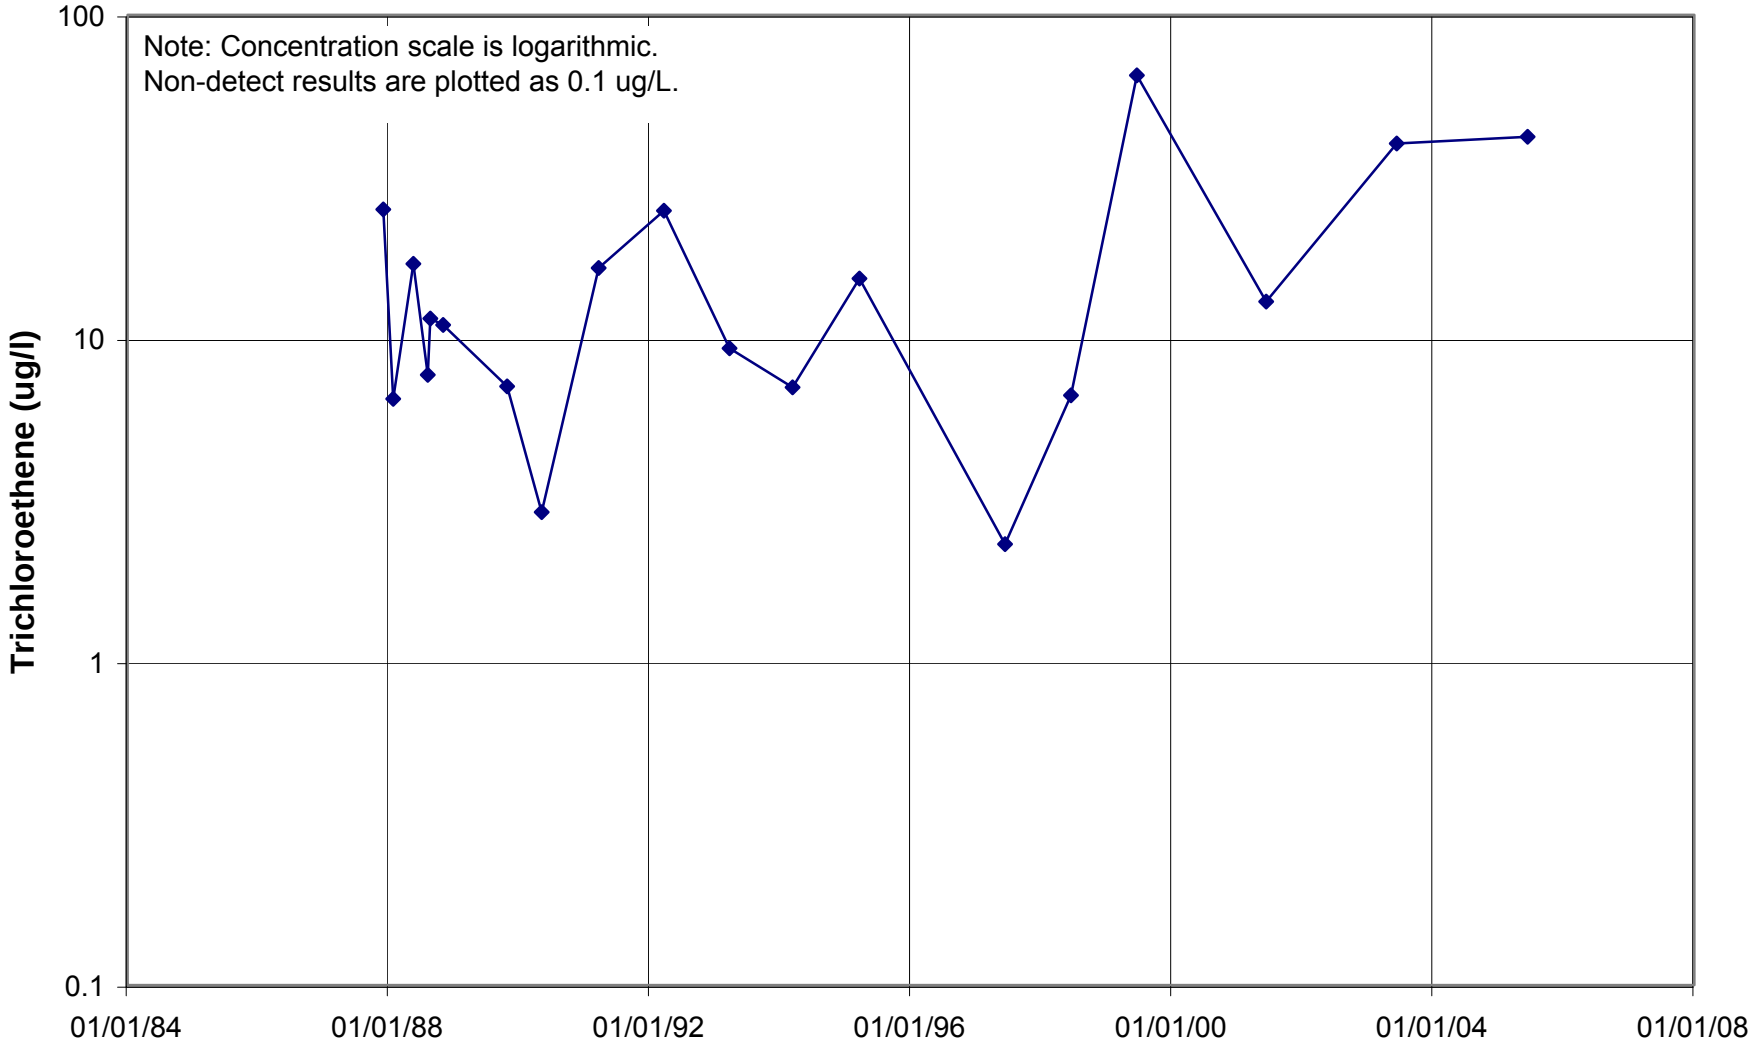

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U031

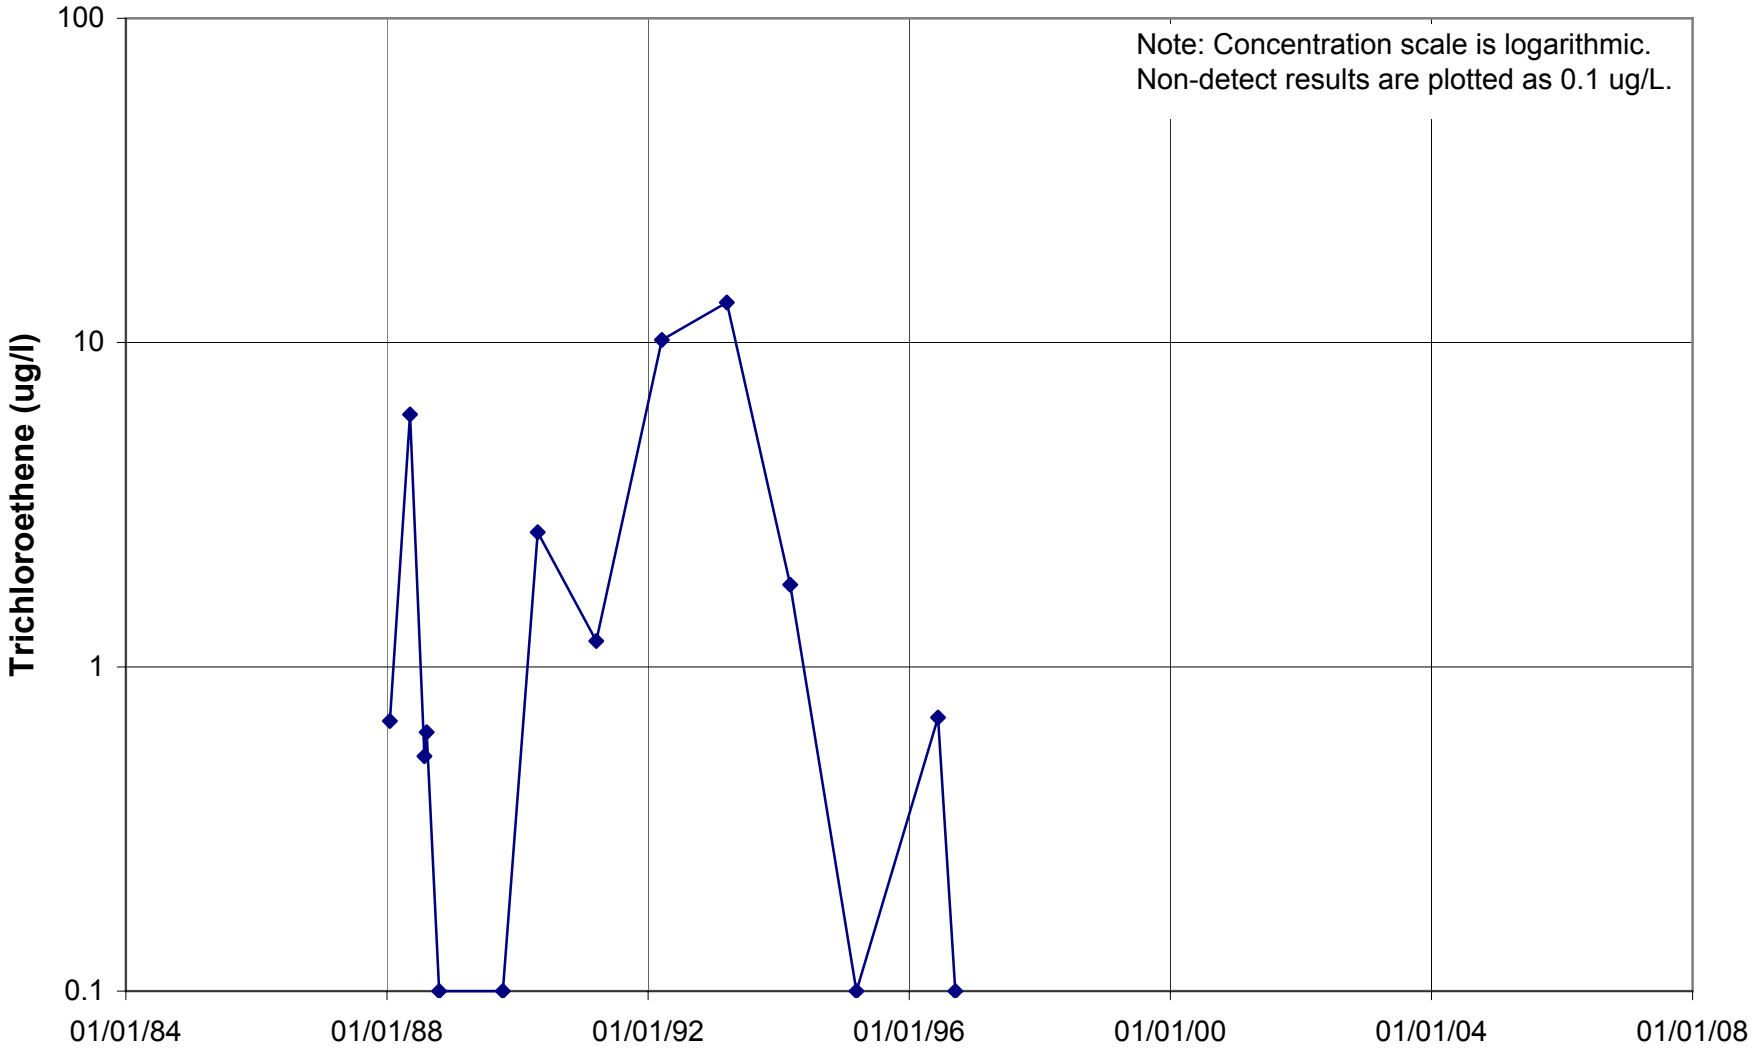

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U032

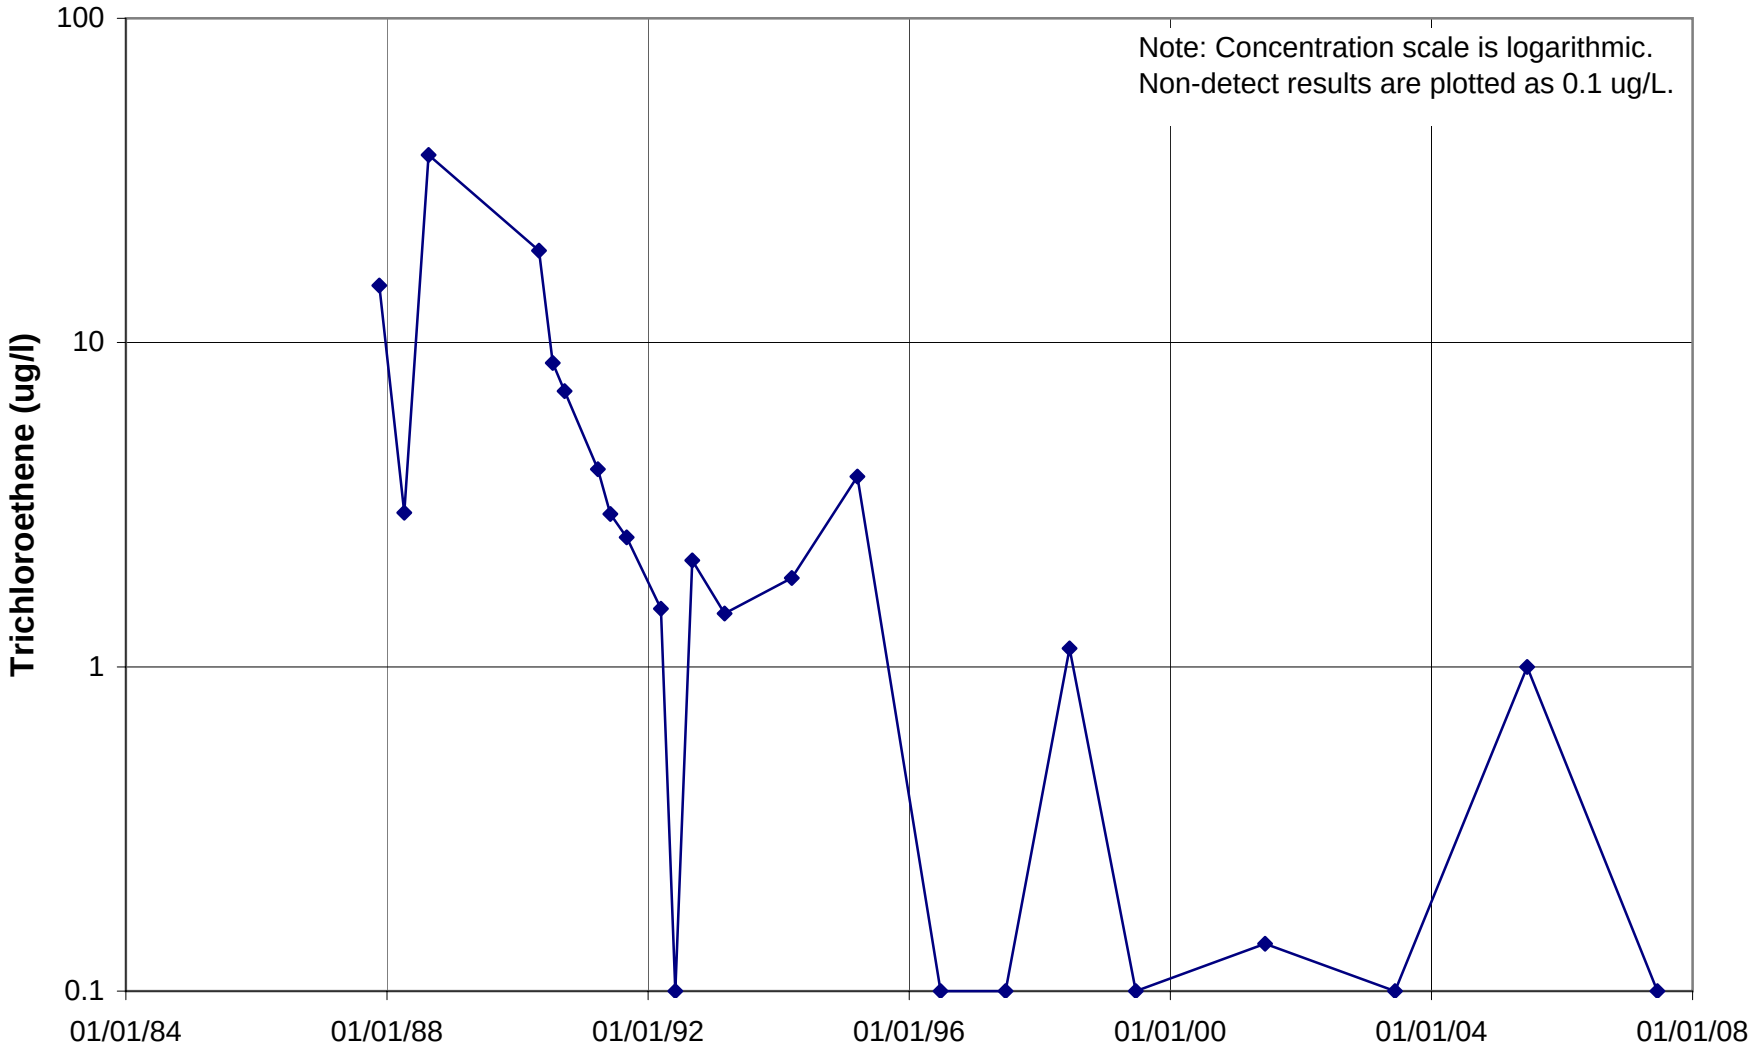

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U075

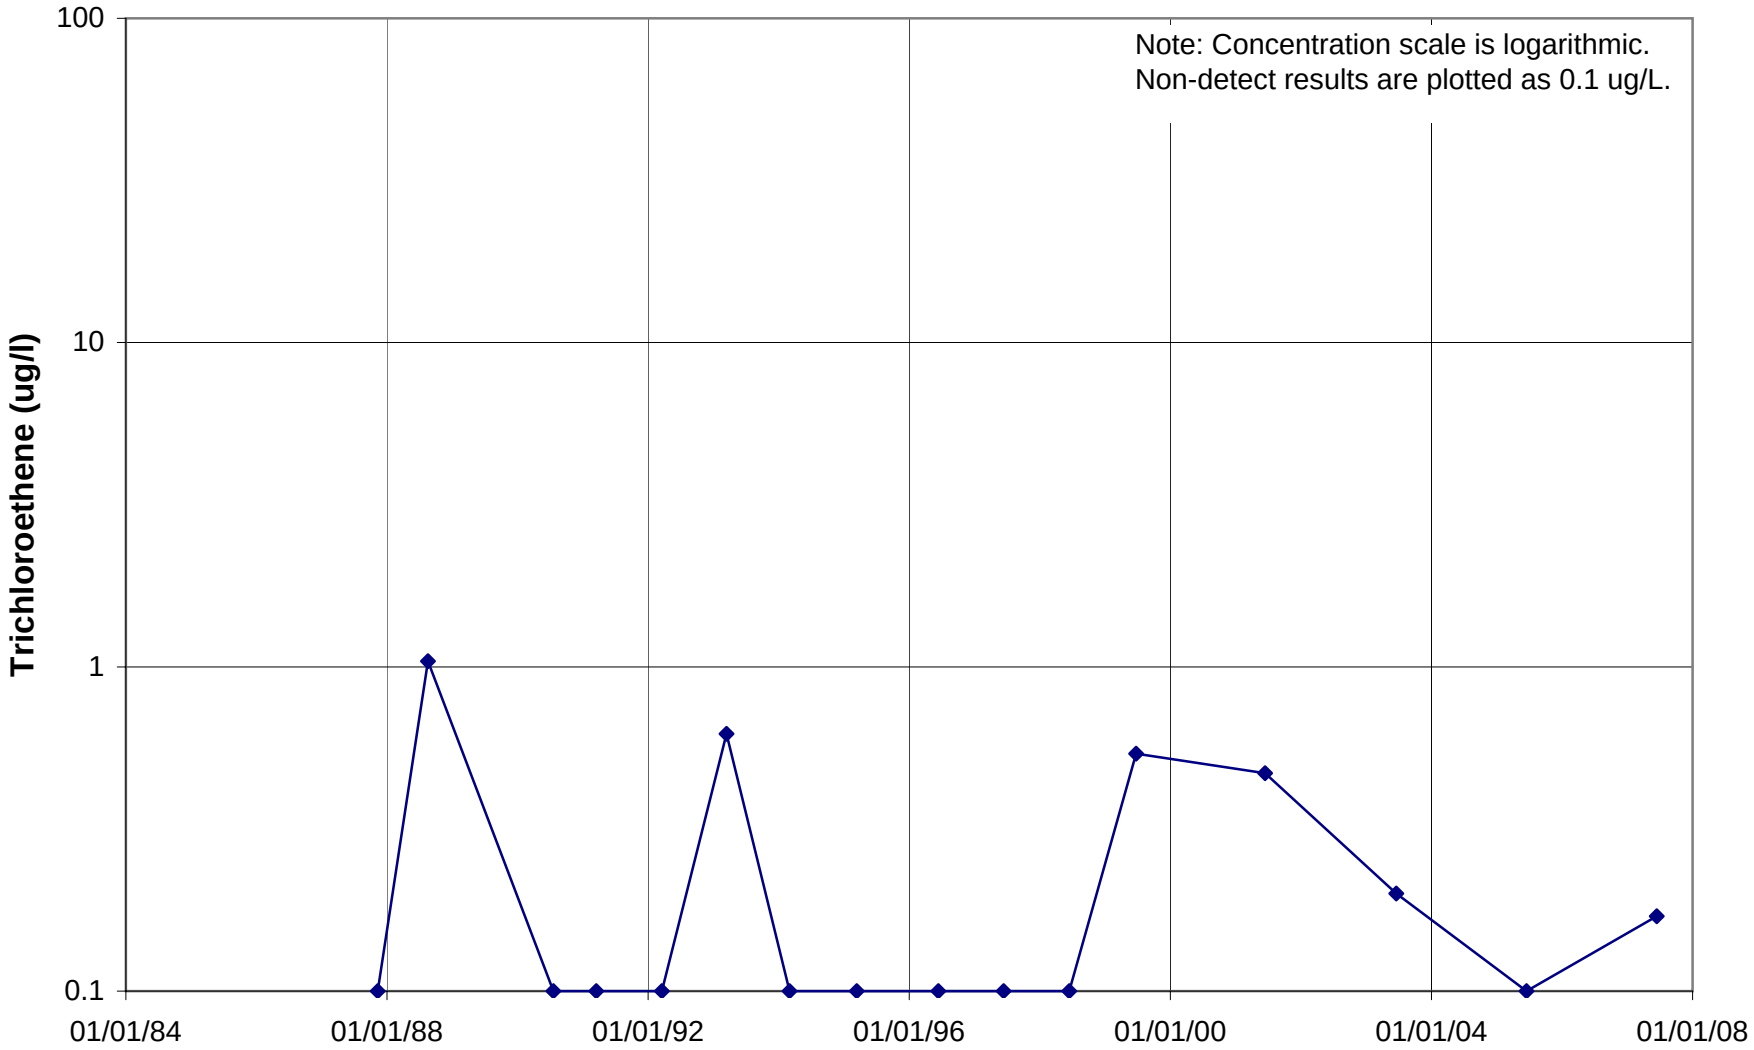

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U076

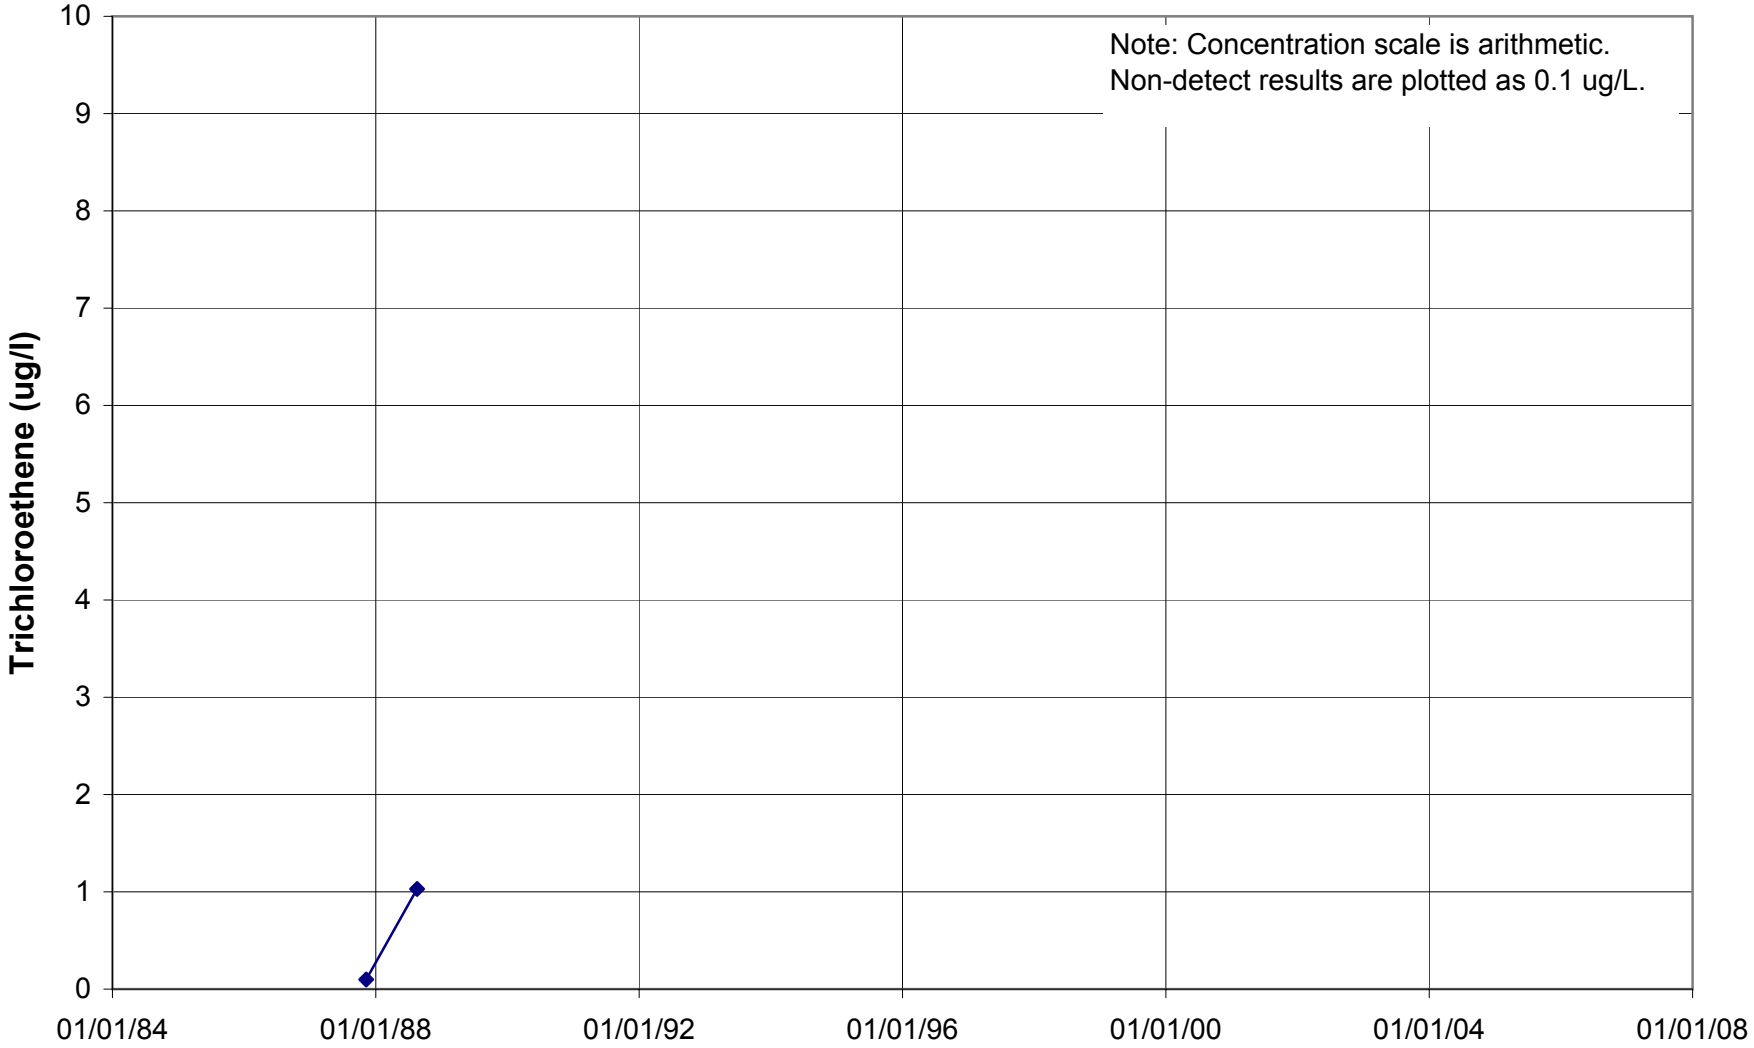

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U077

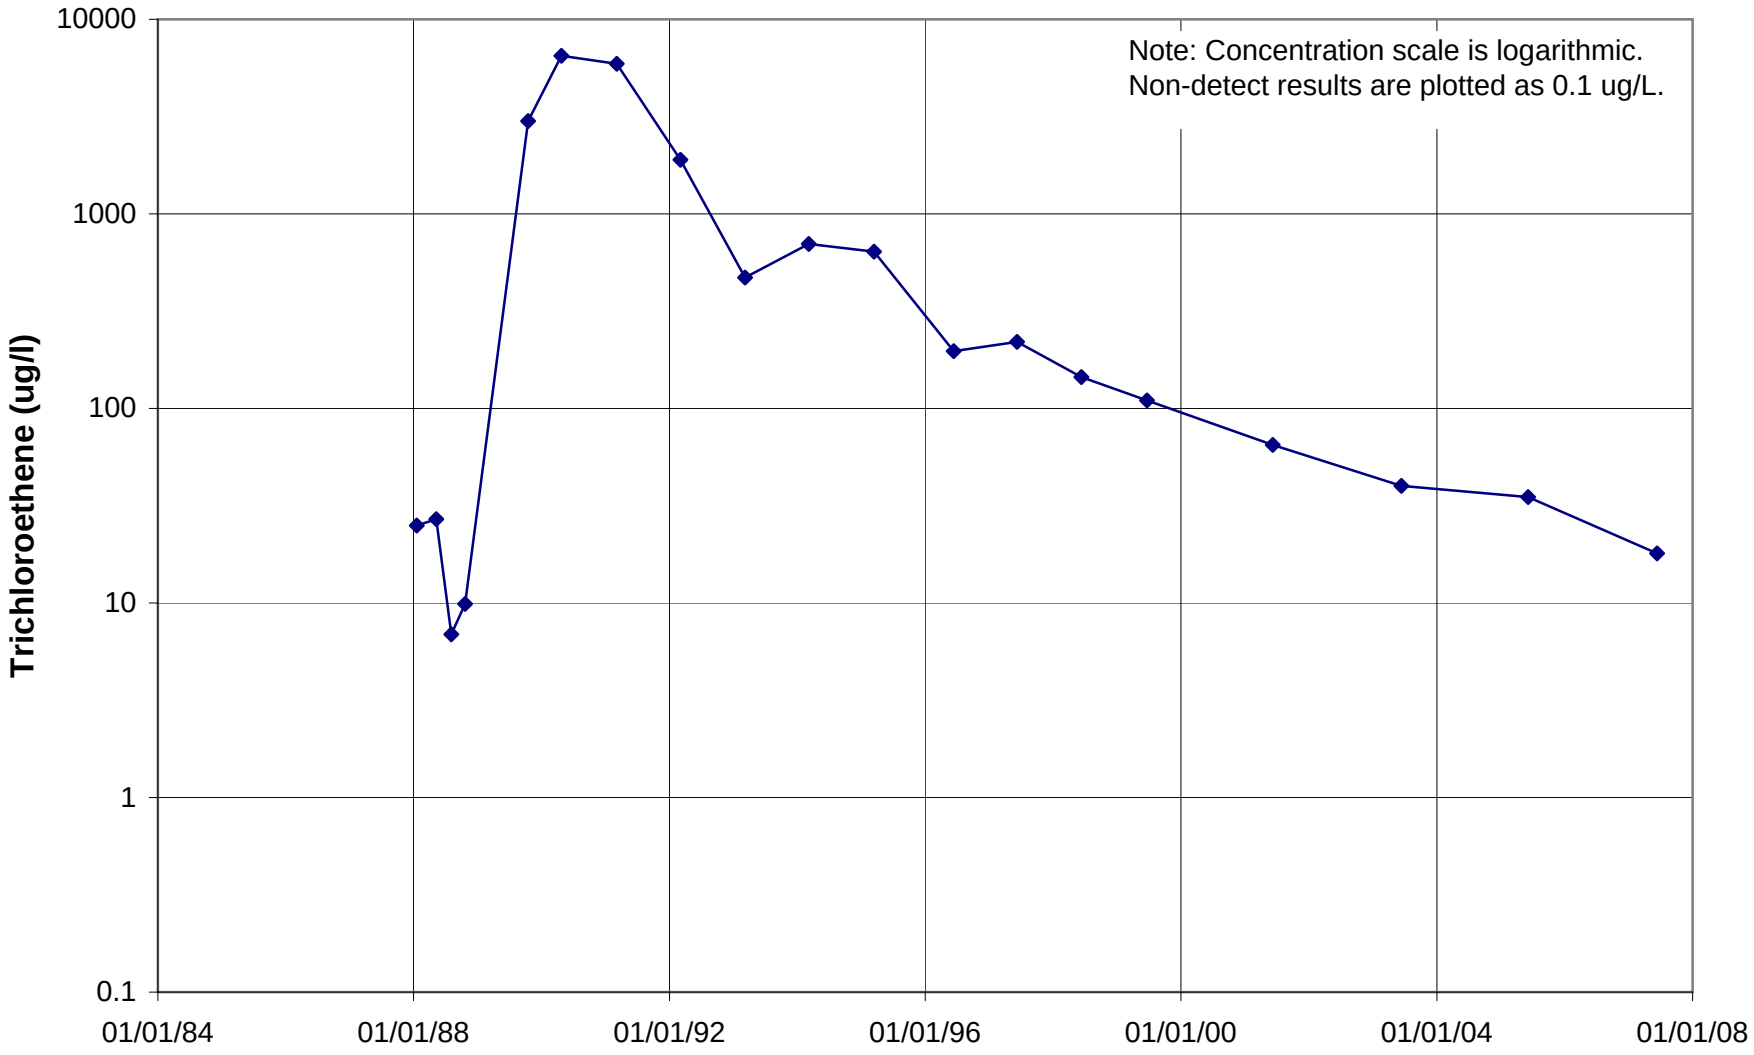

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U078

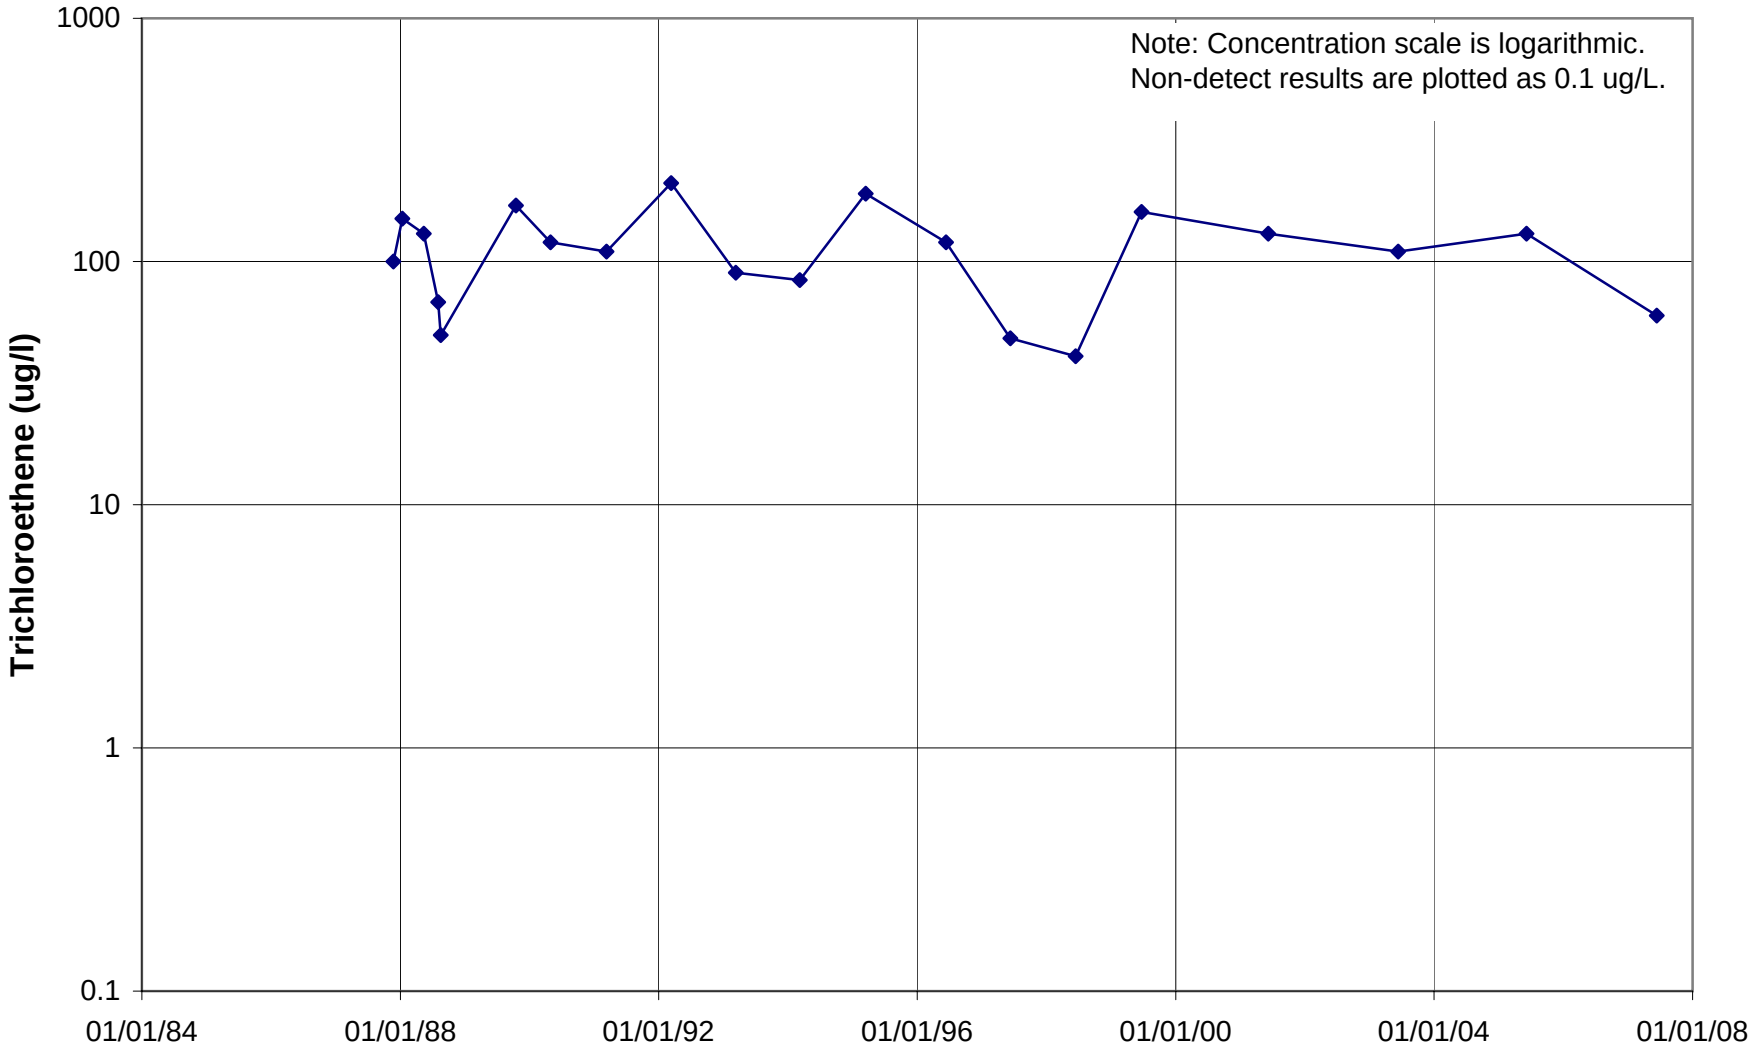

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U079

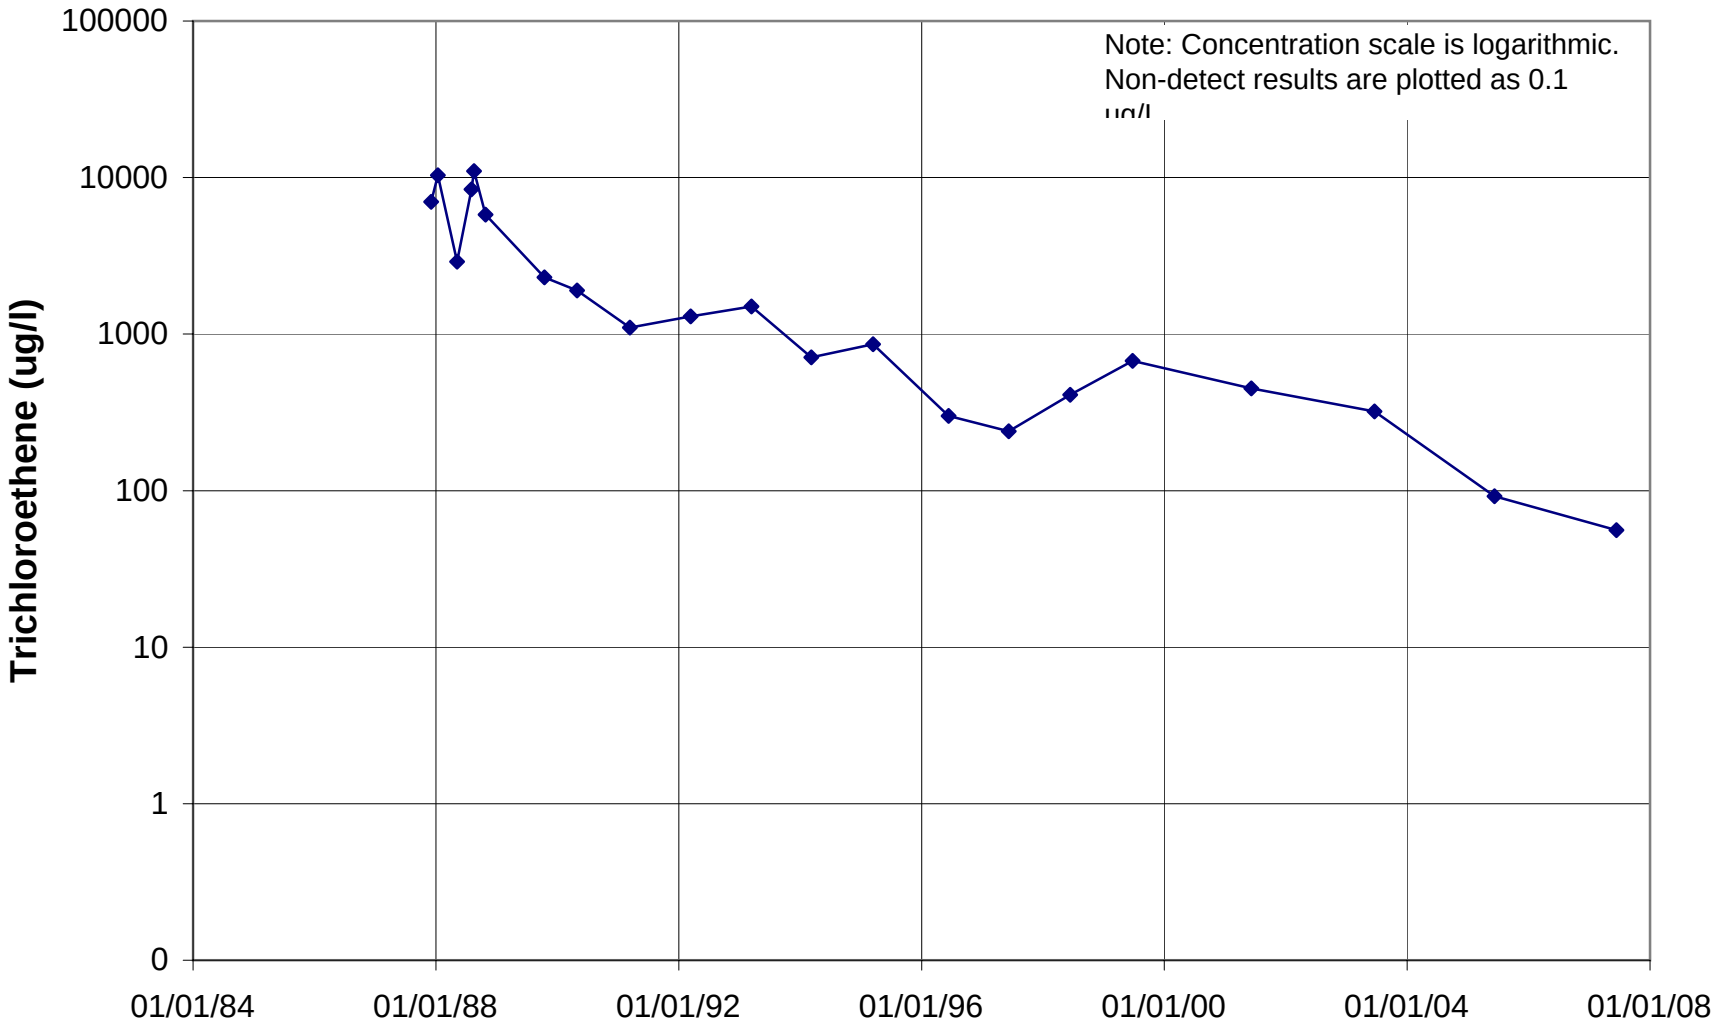

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U082

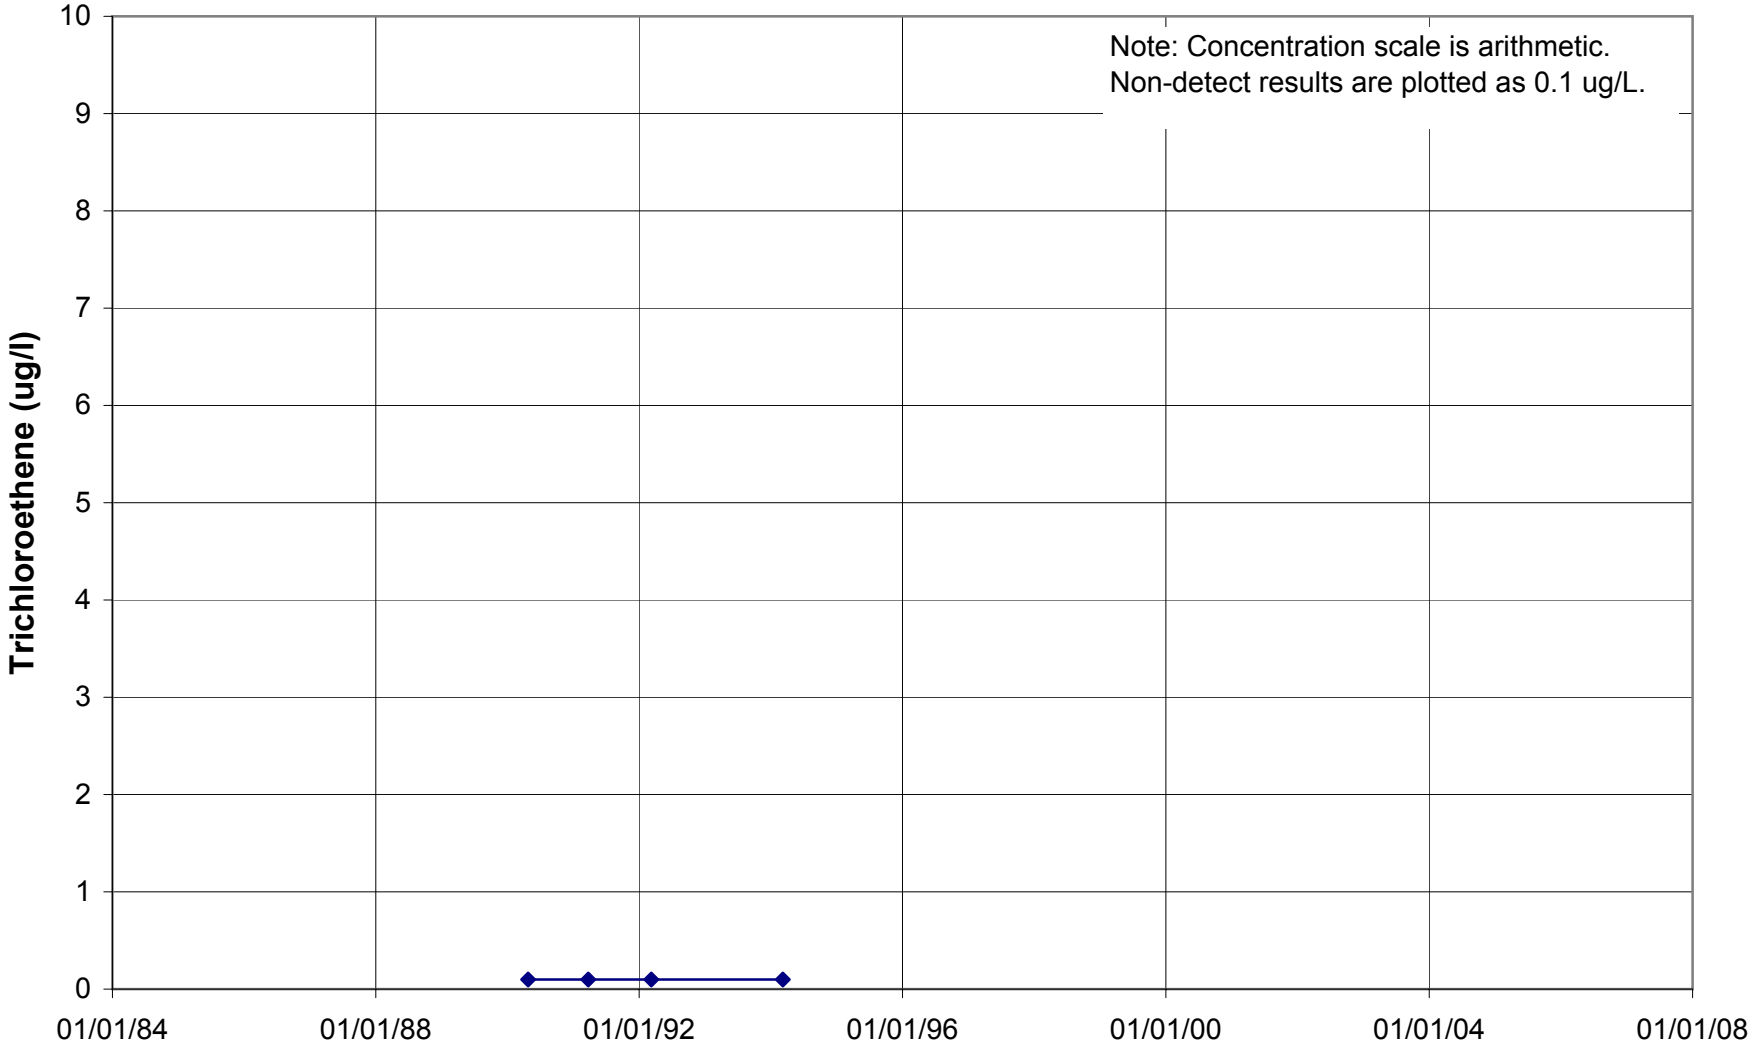

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U087

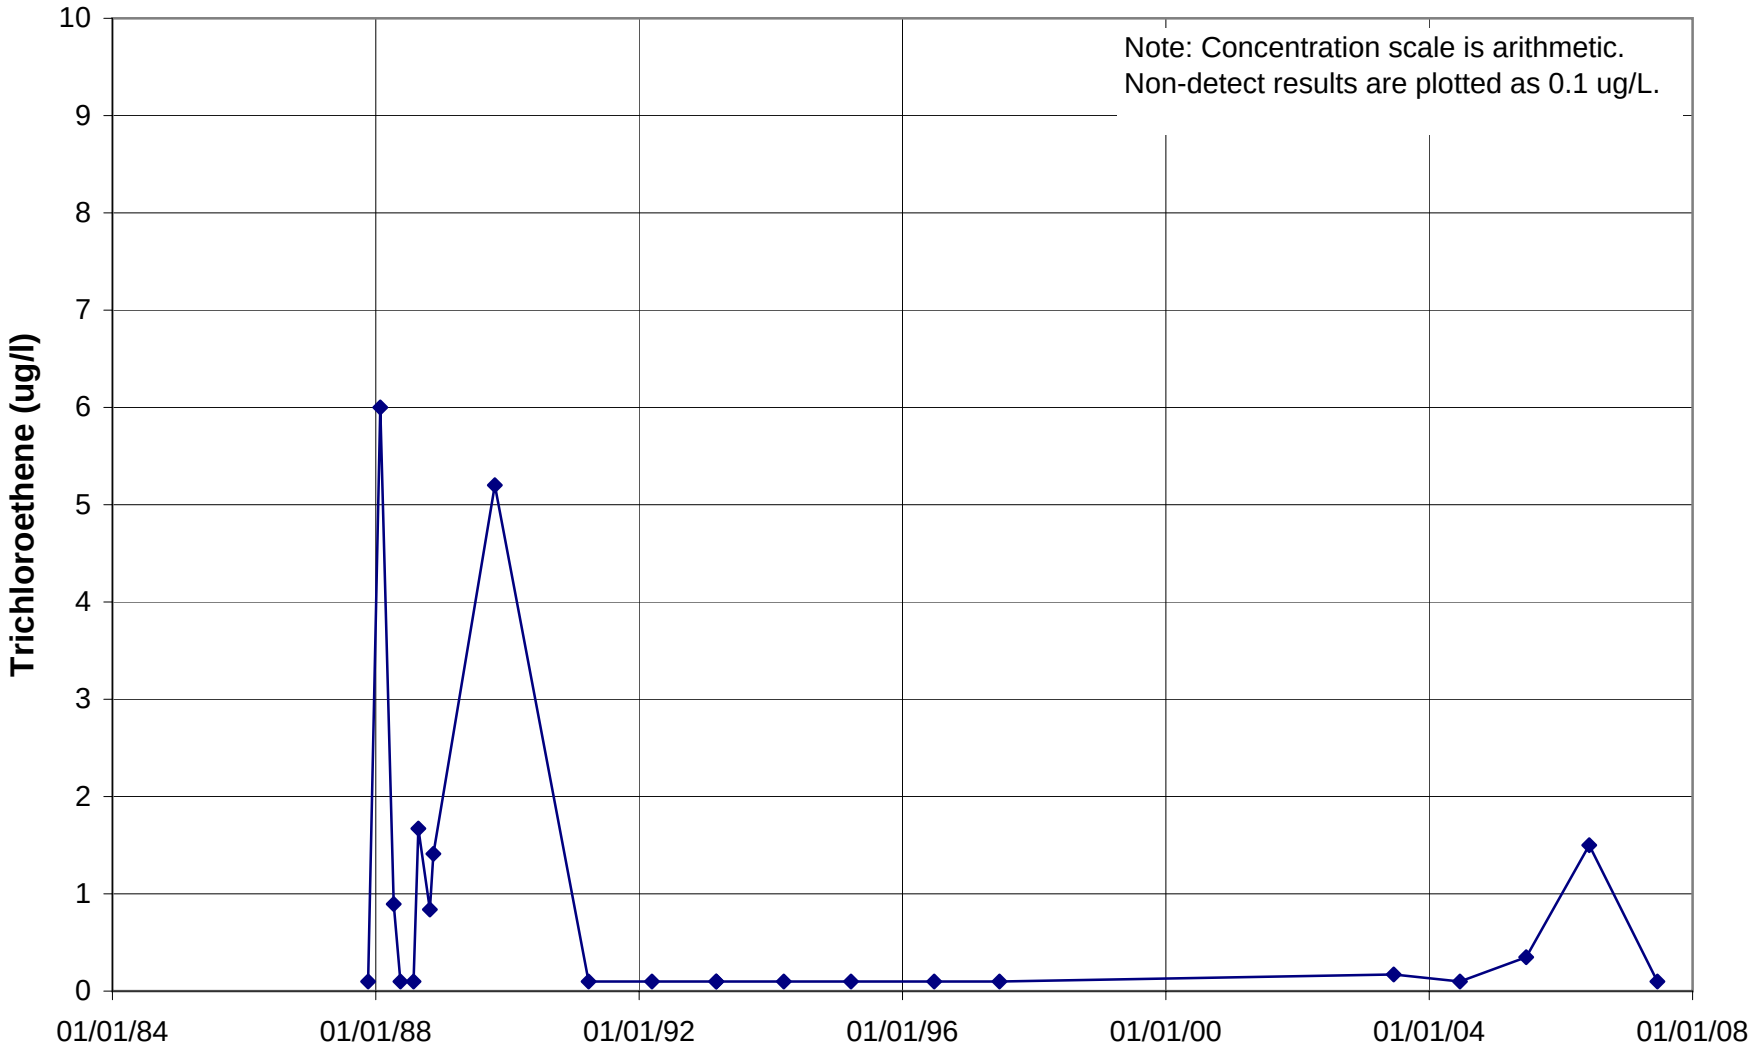

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U088

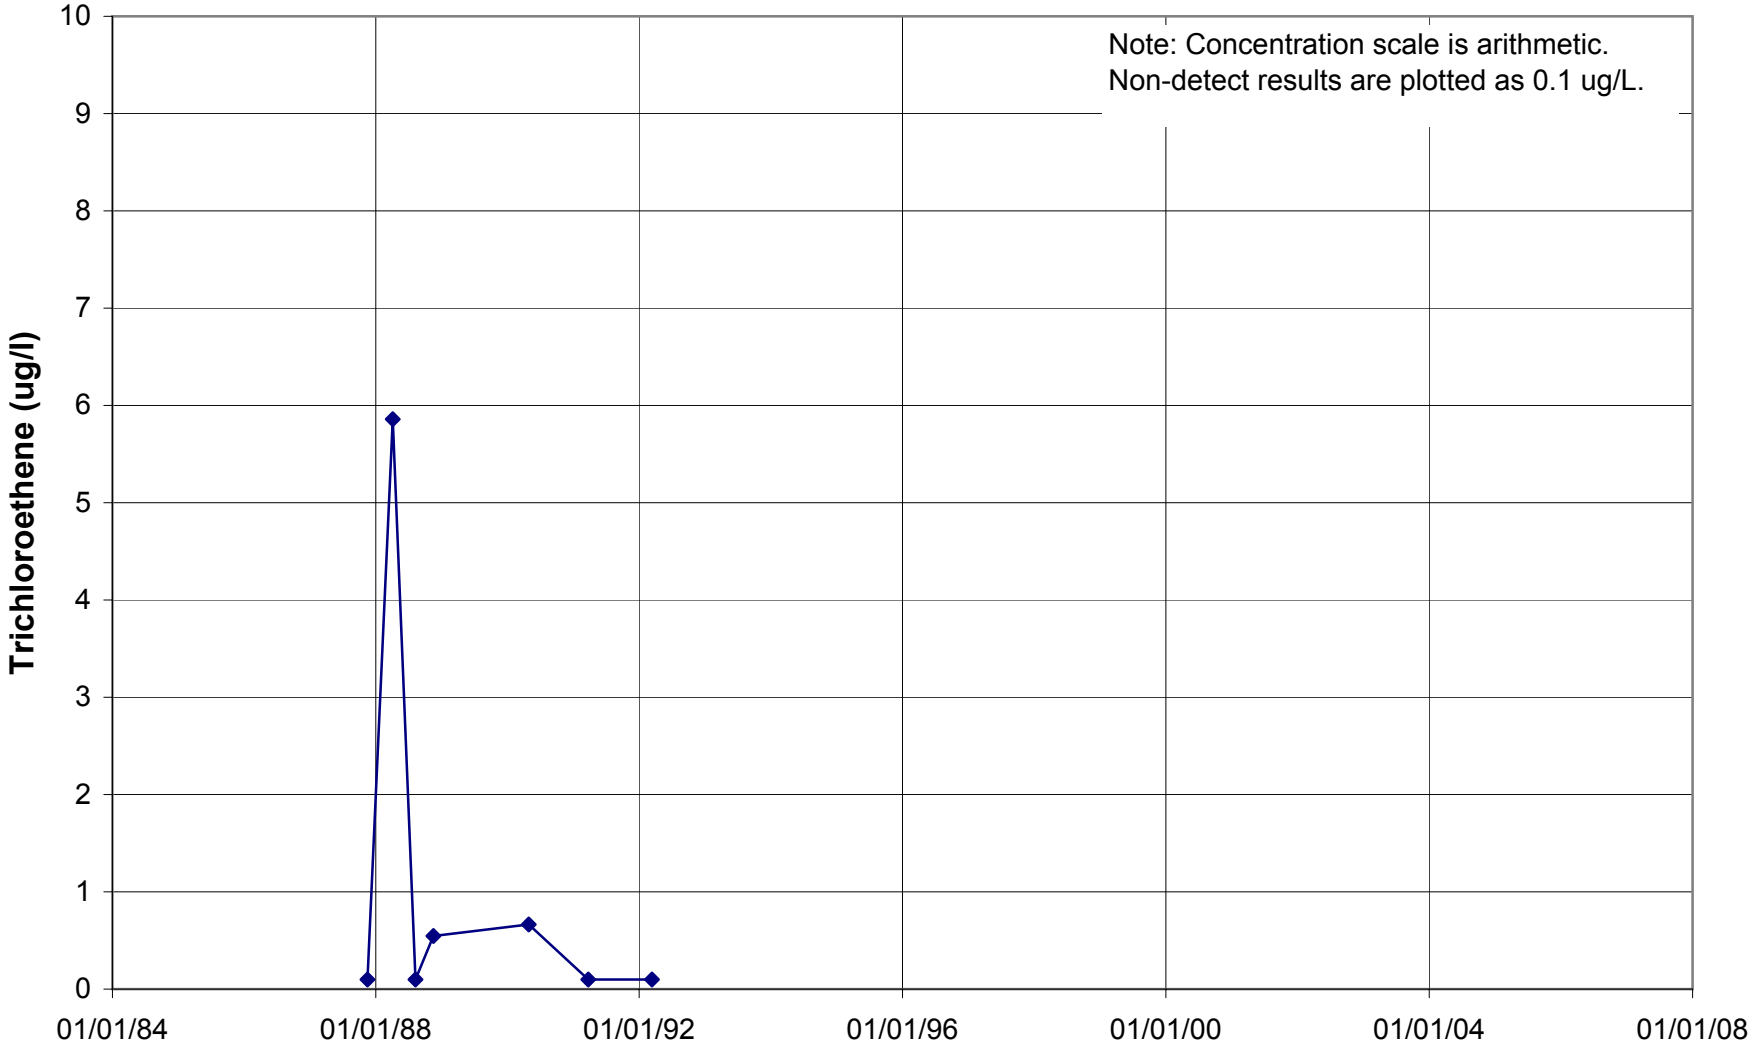

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U089

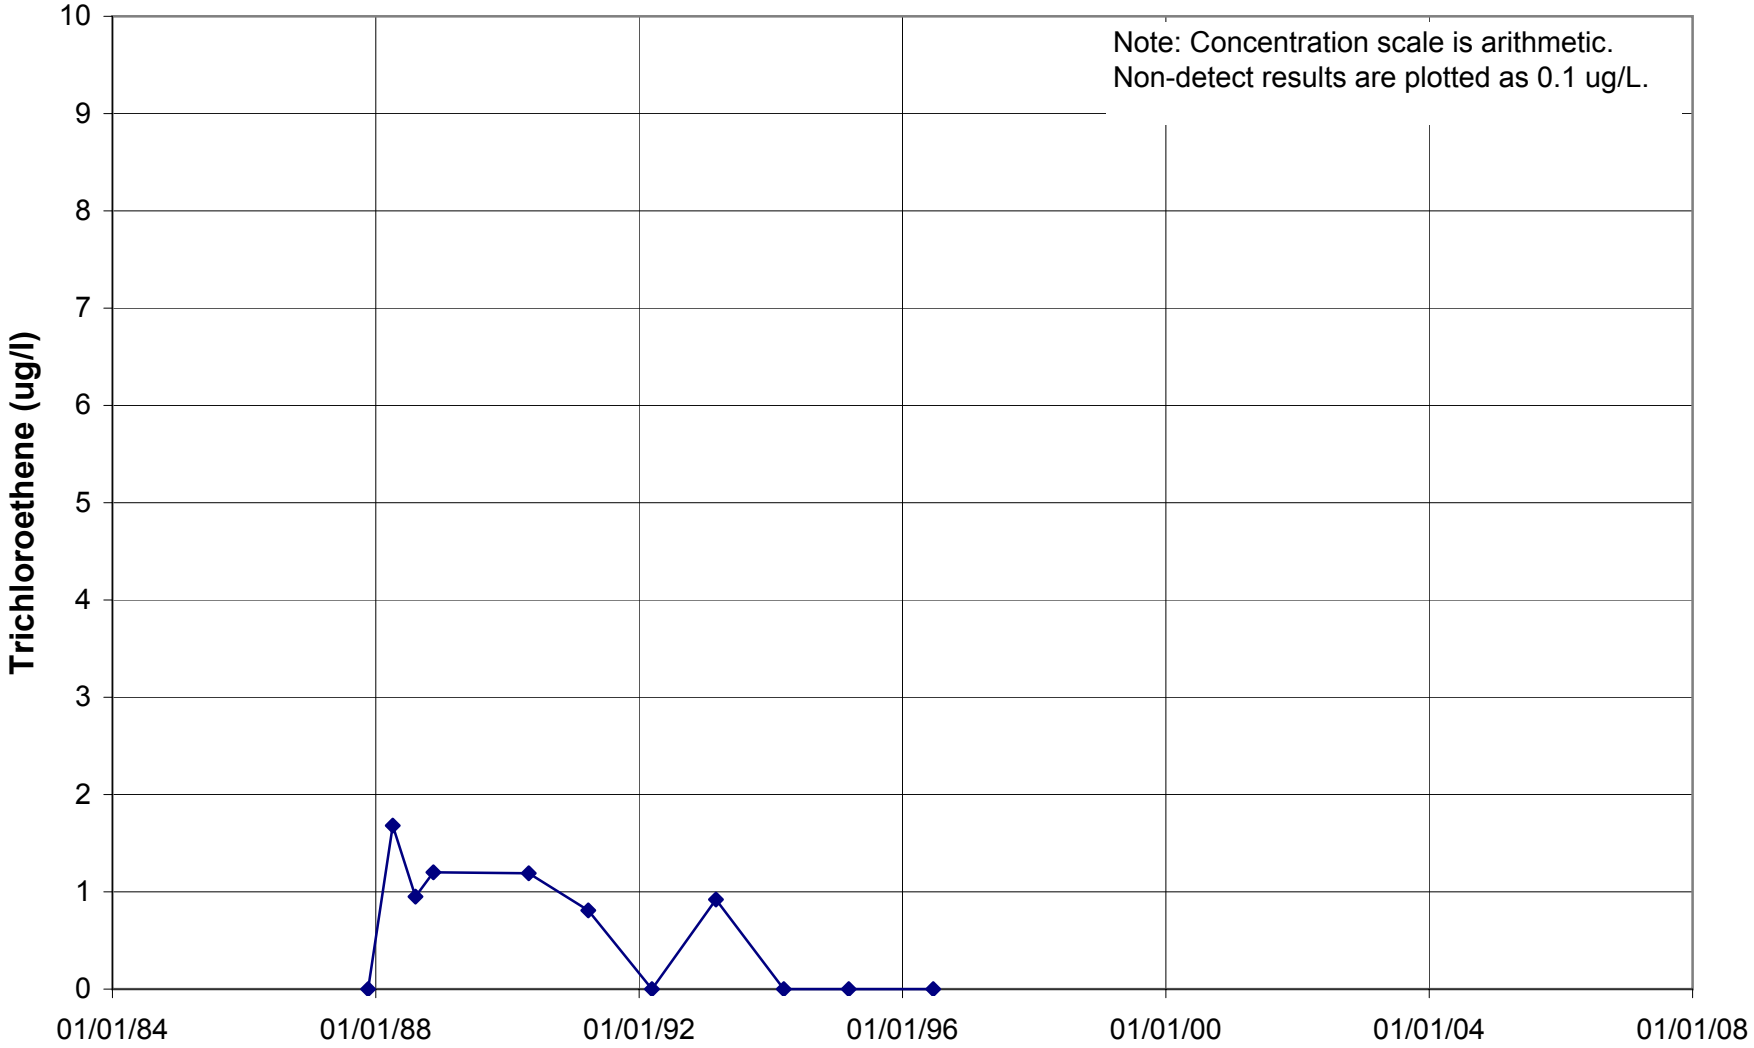

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U090

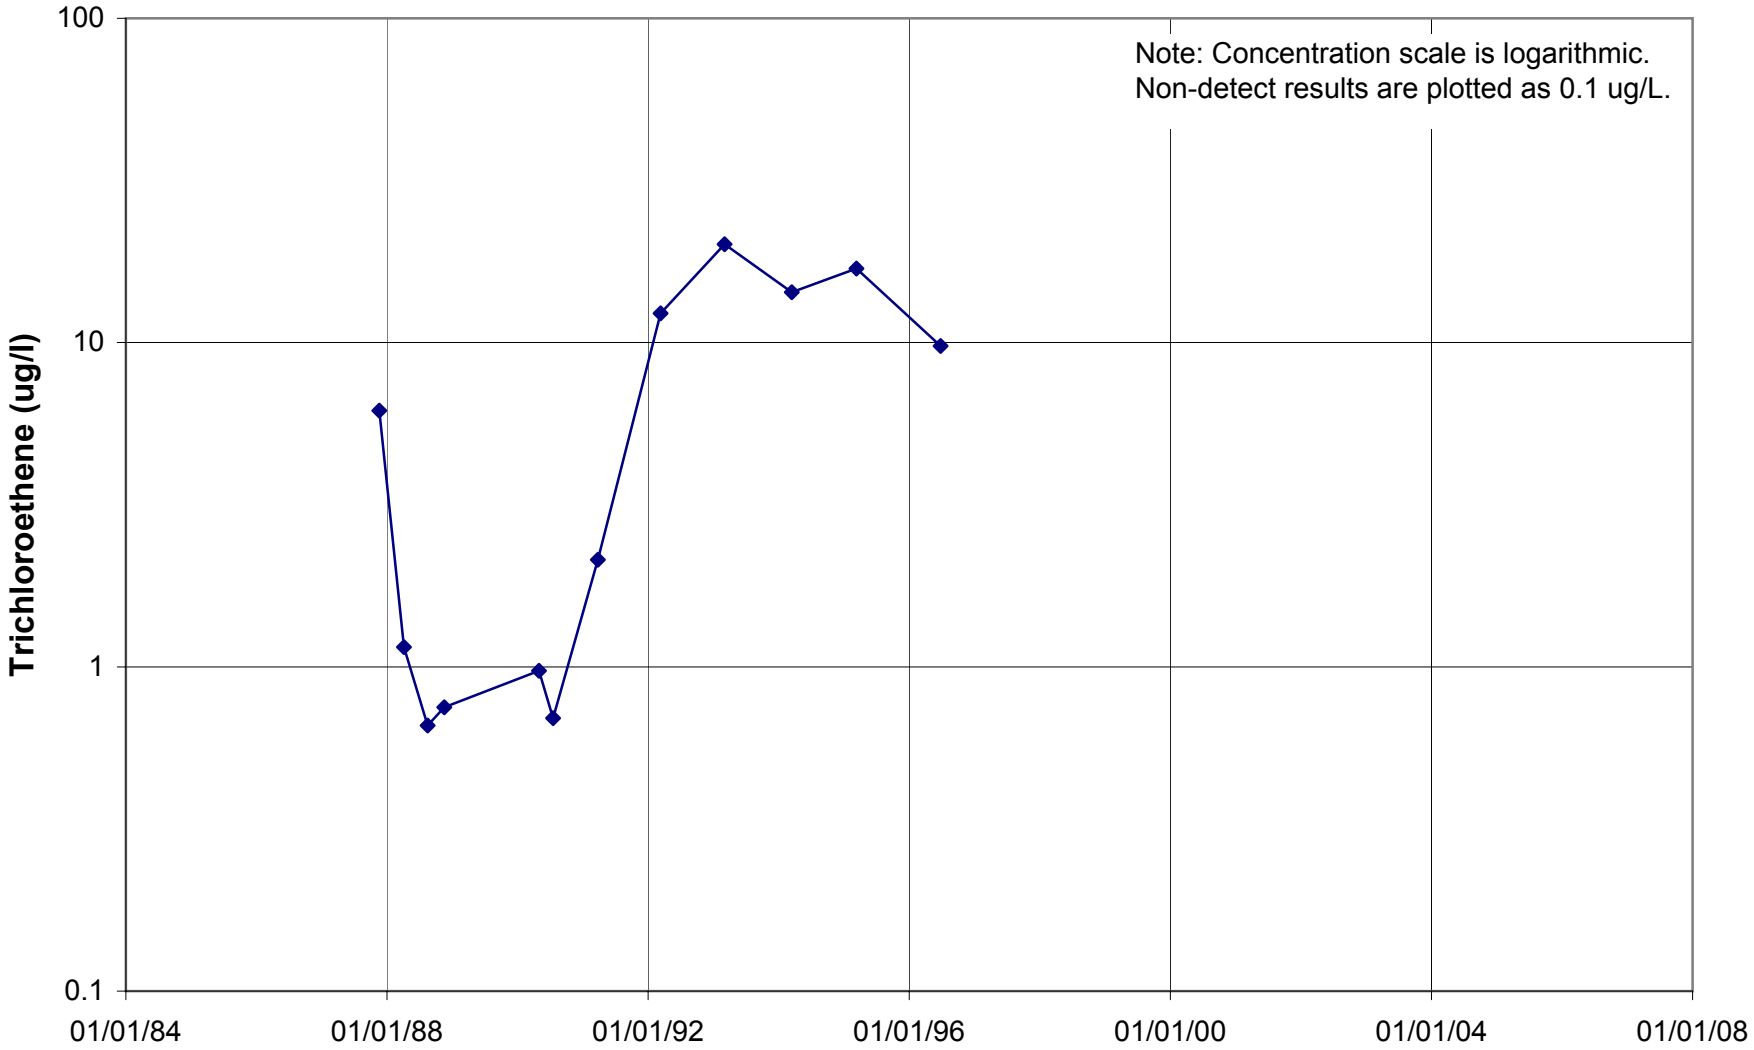

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U092

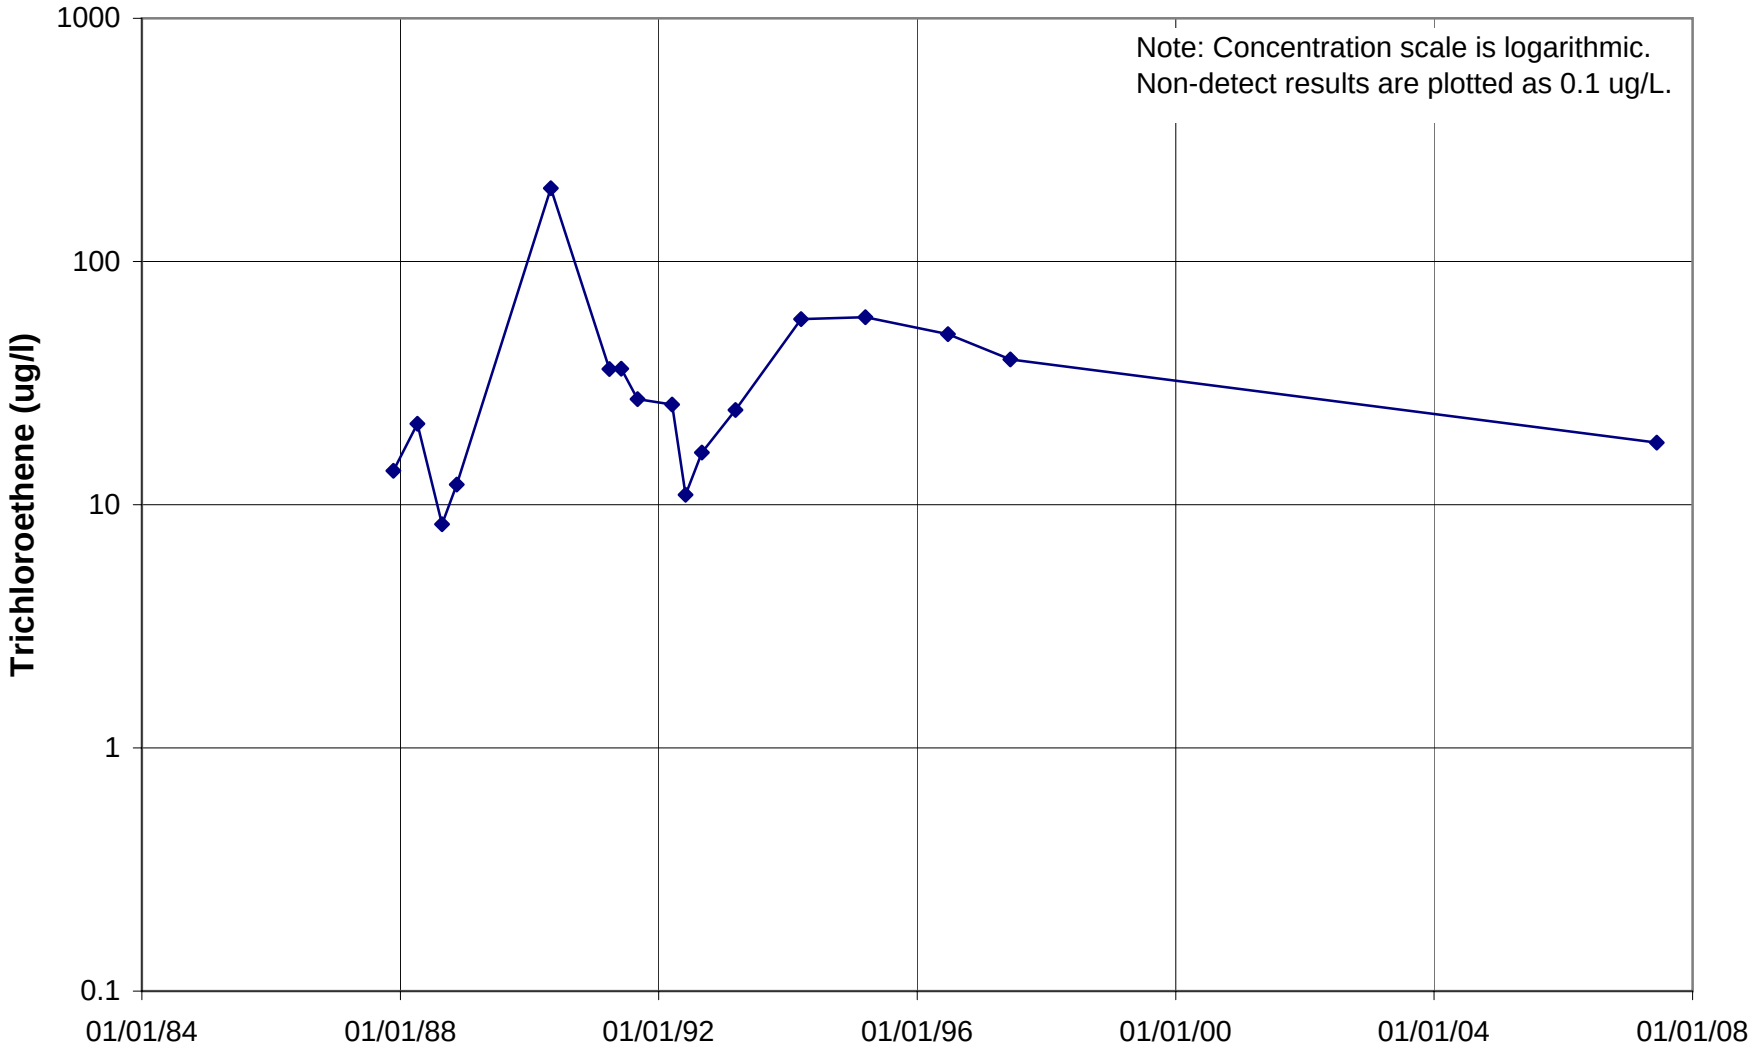

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U093

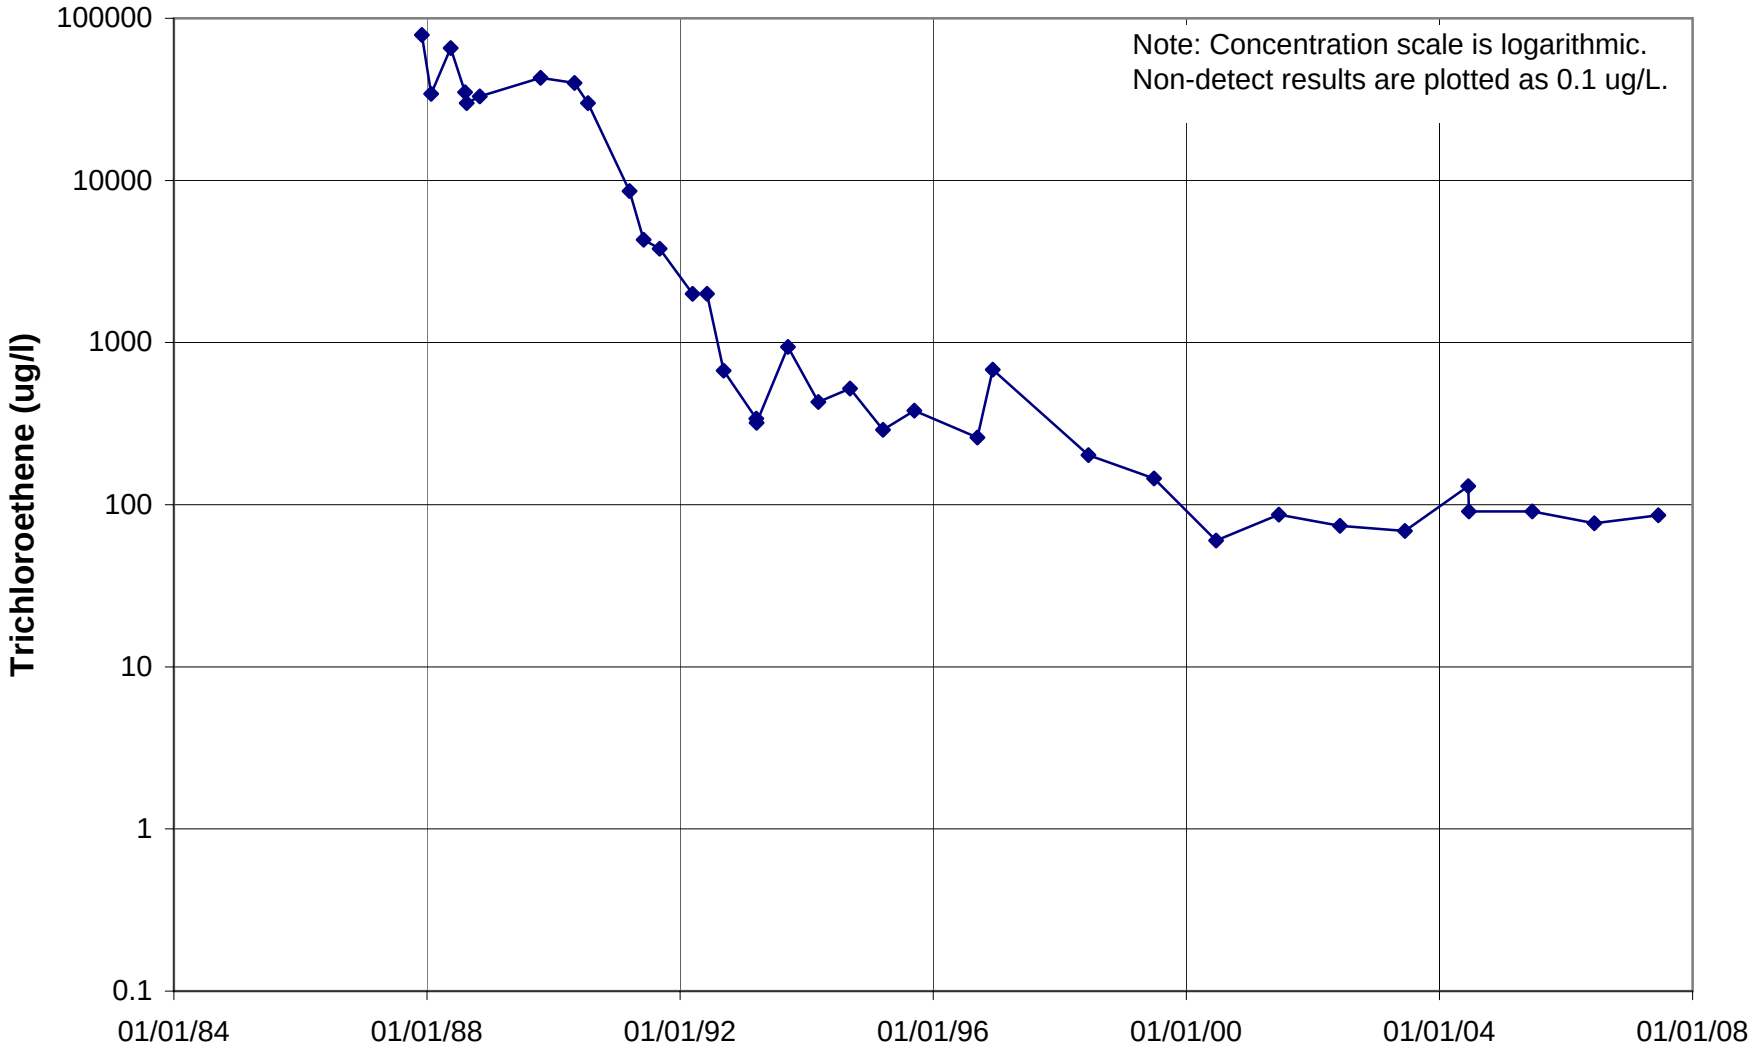

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U094

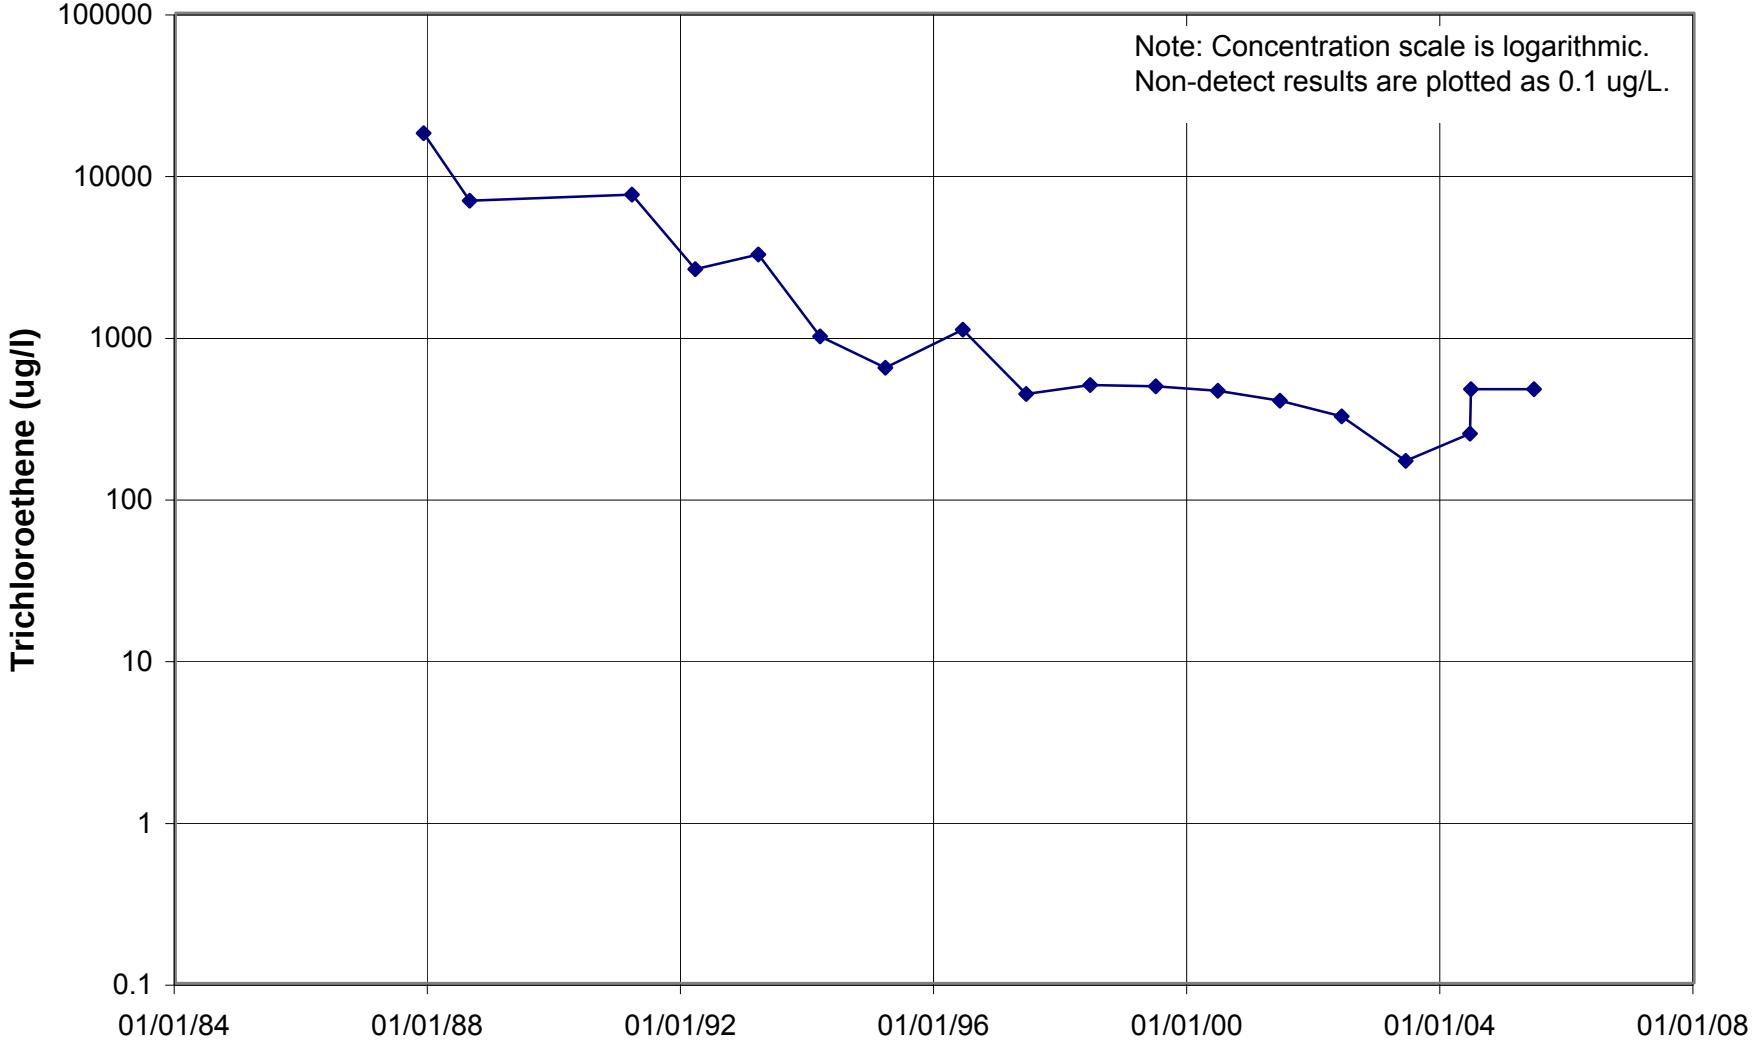

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U096

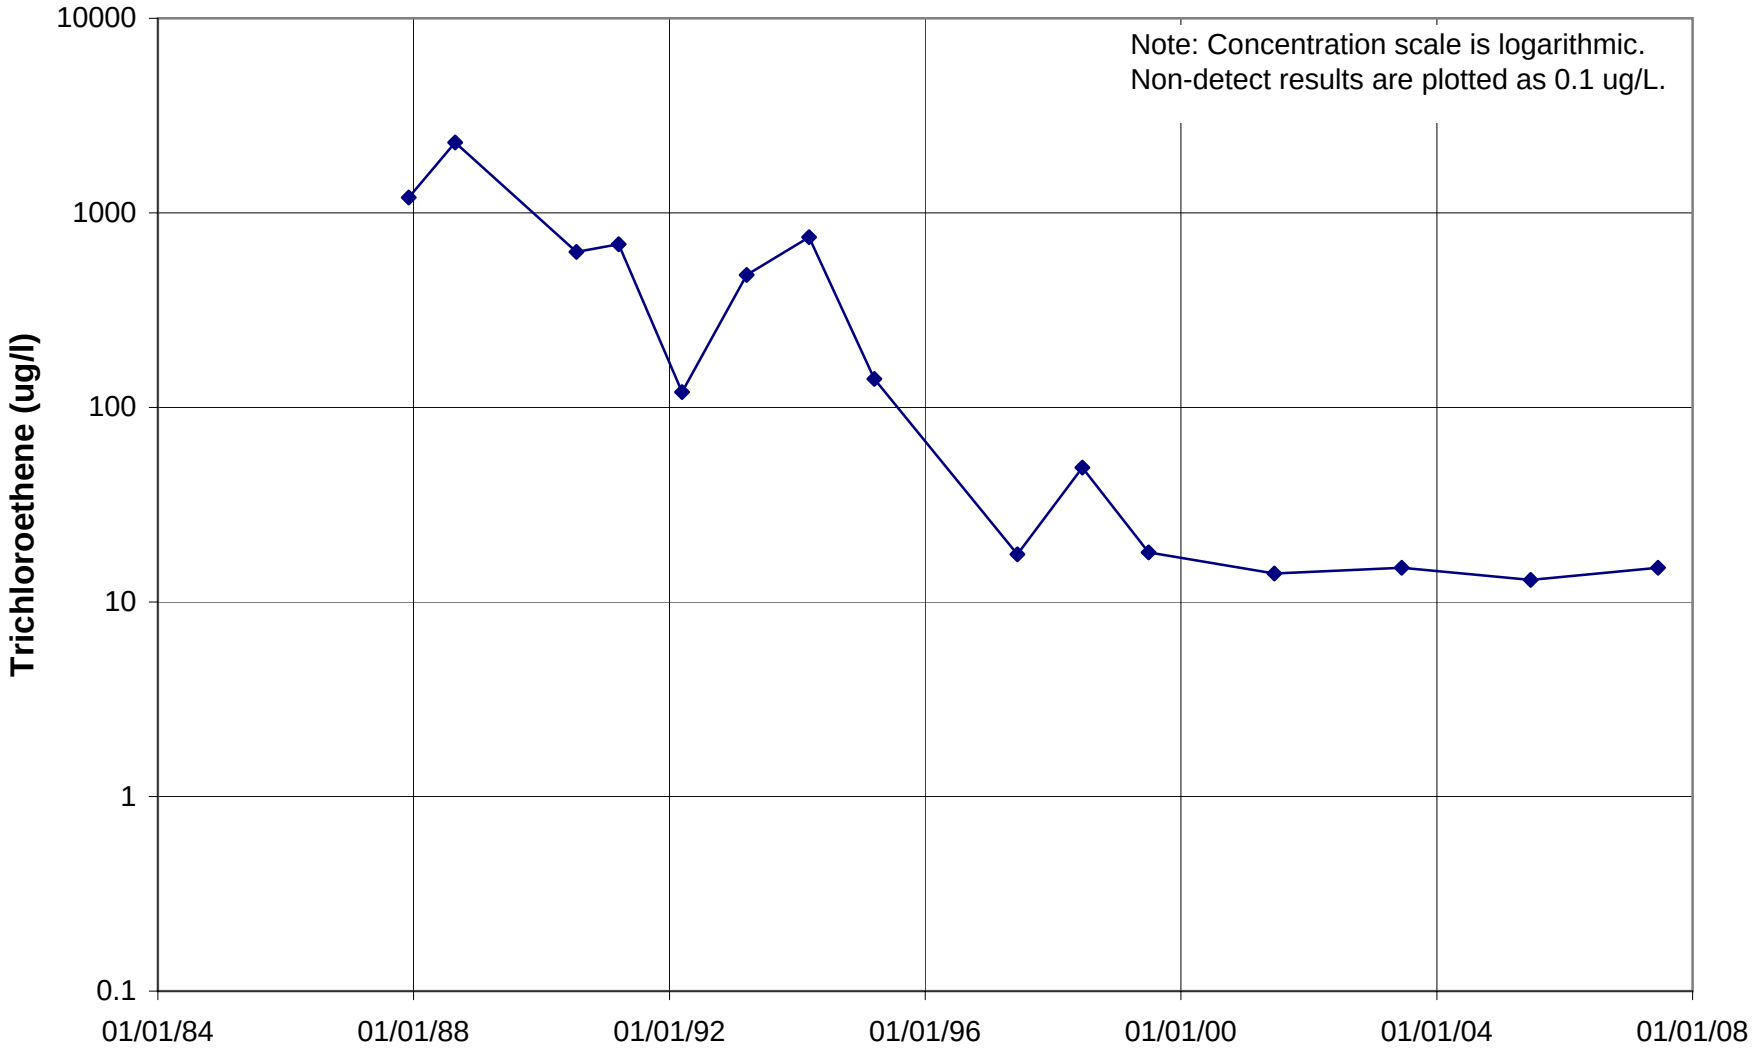

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U097

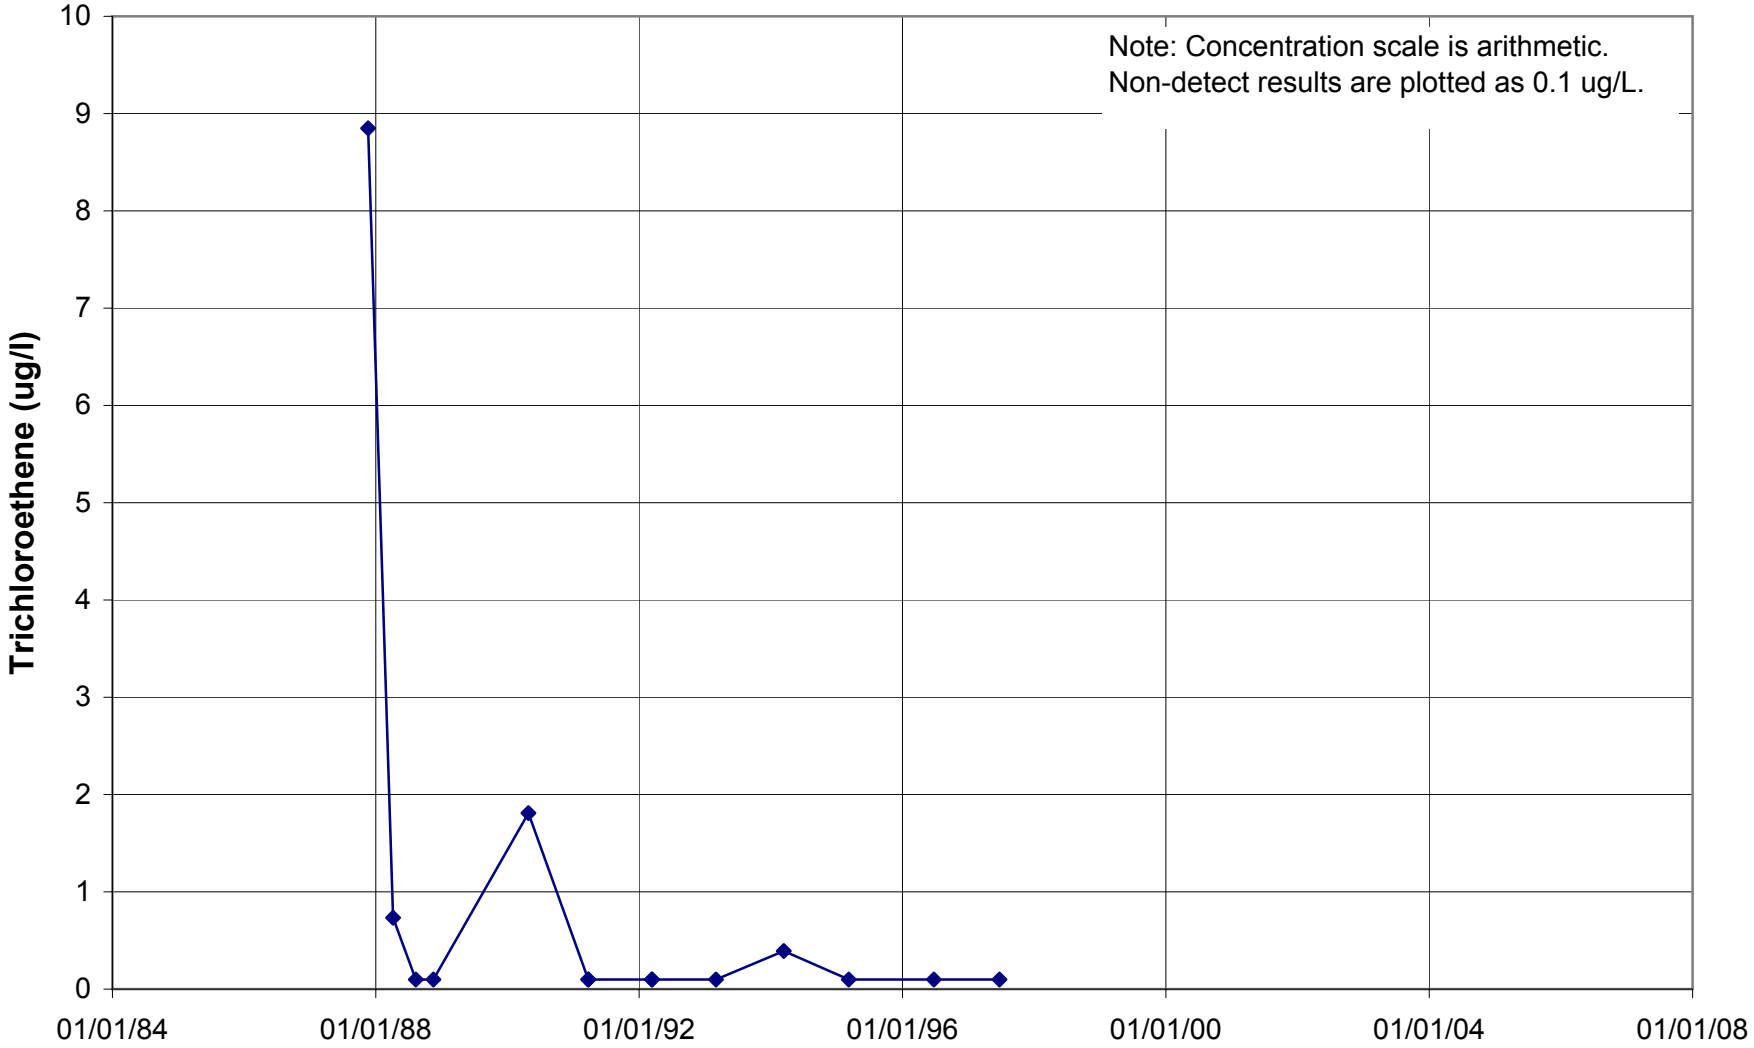

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U099

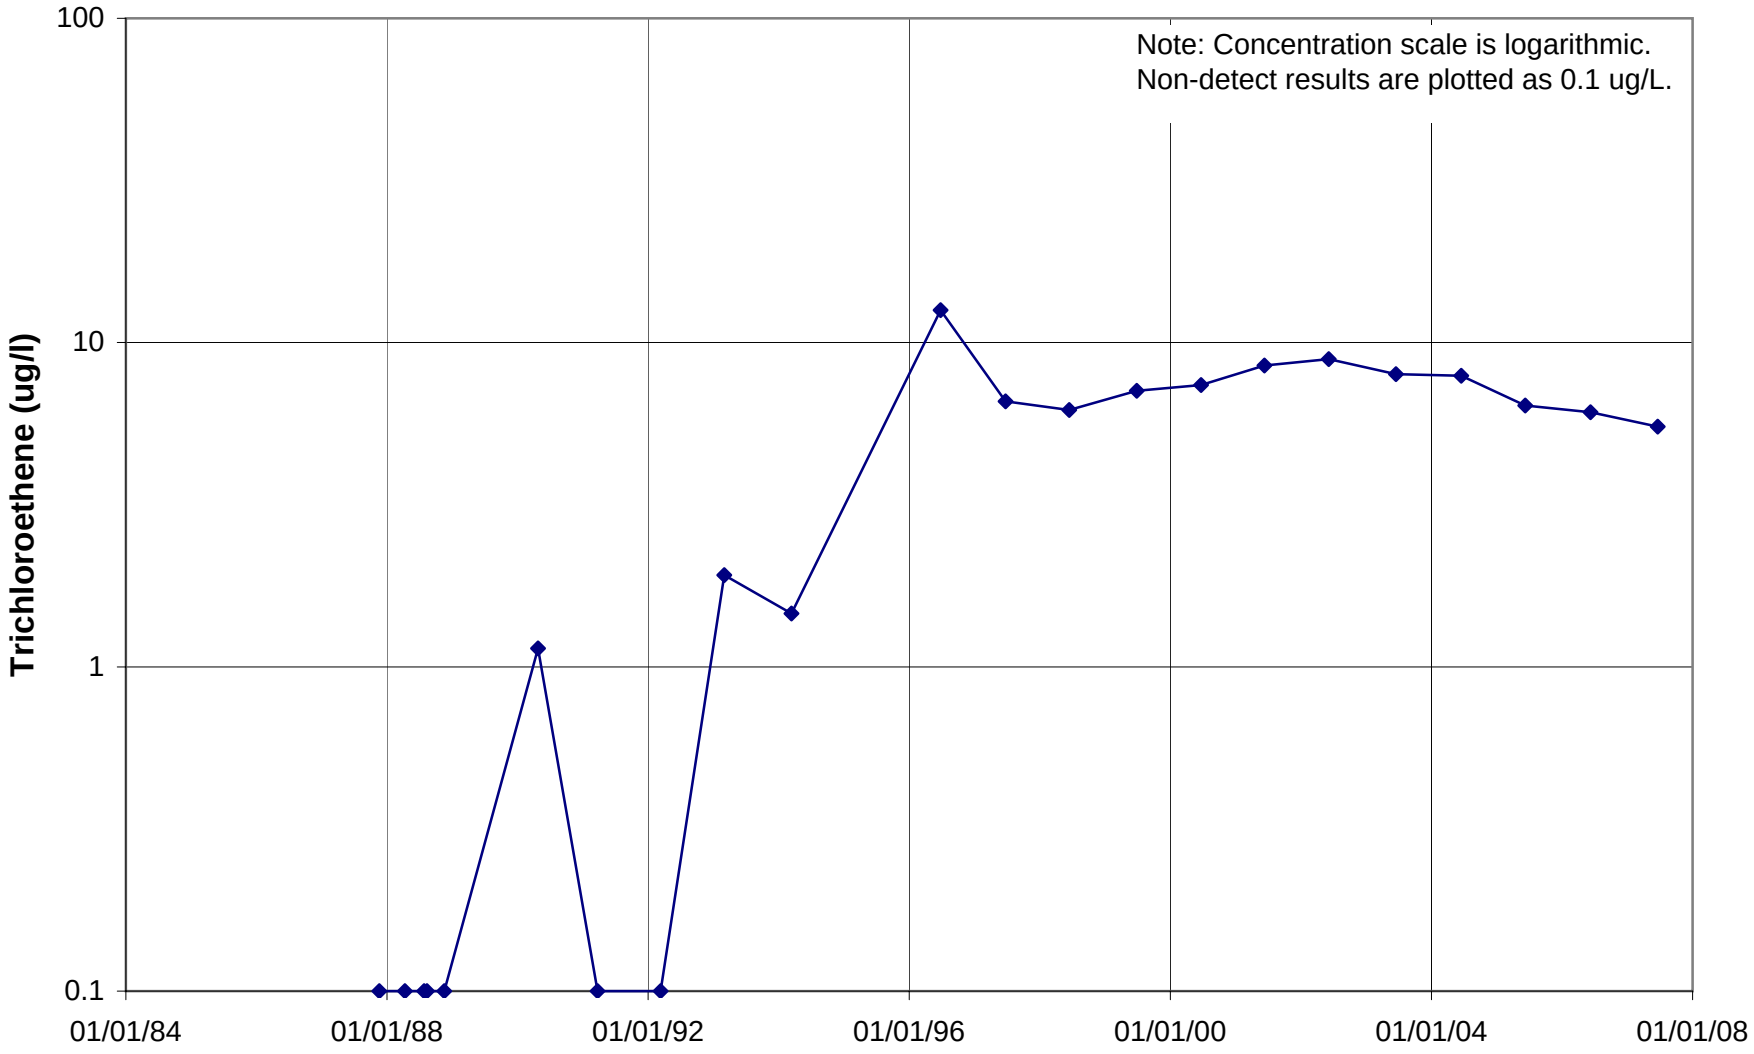

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U111

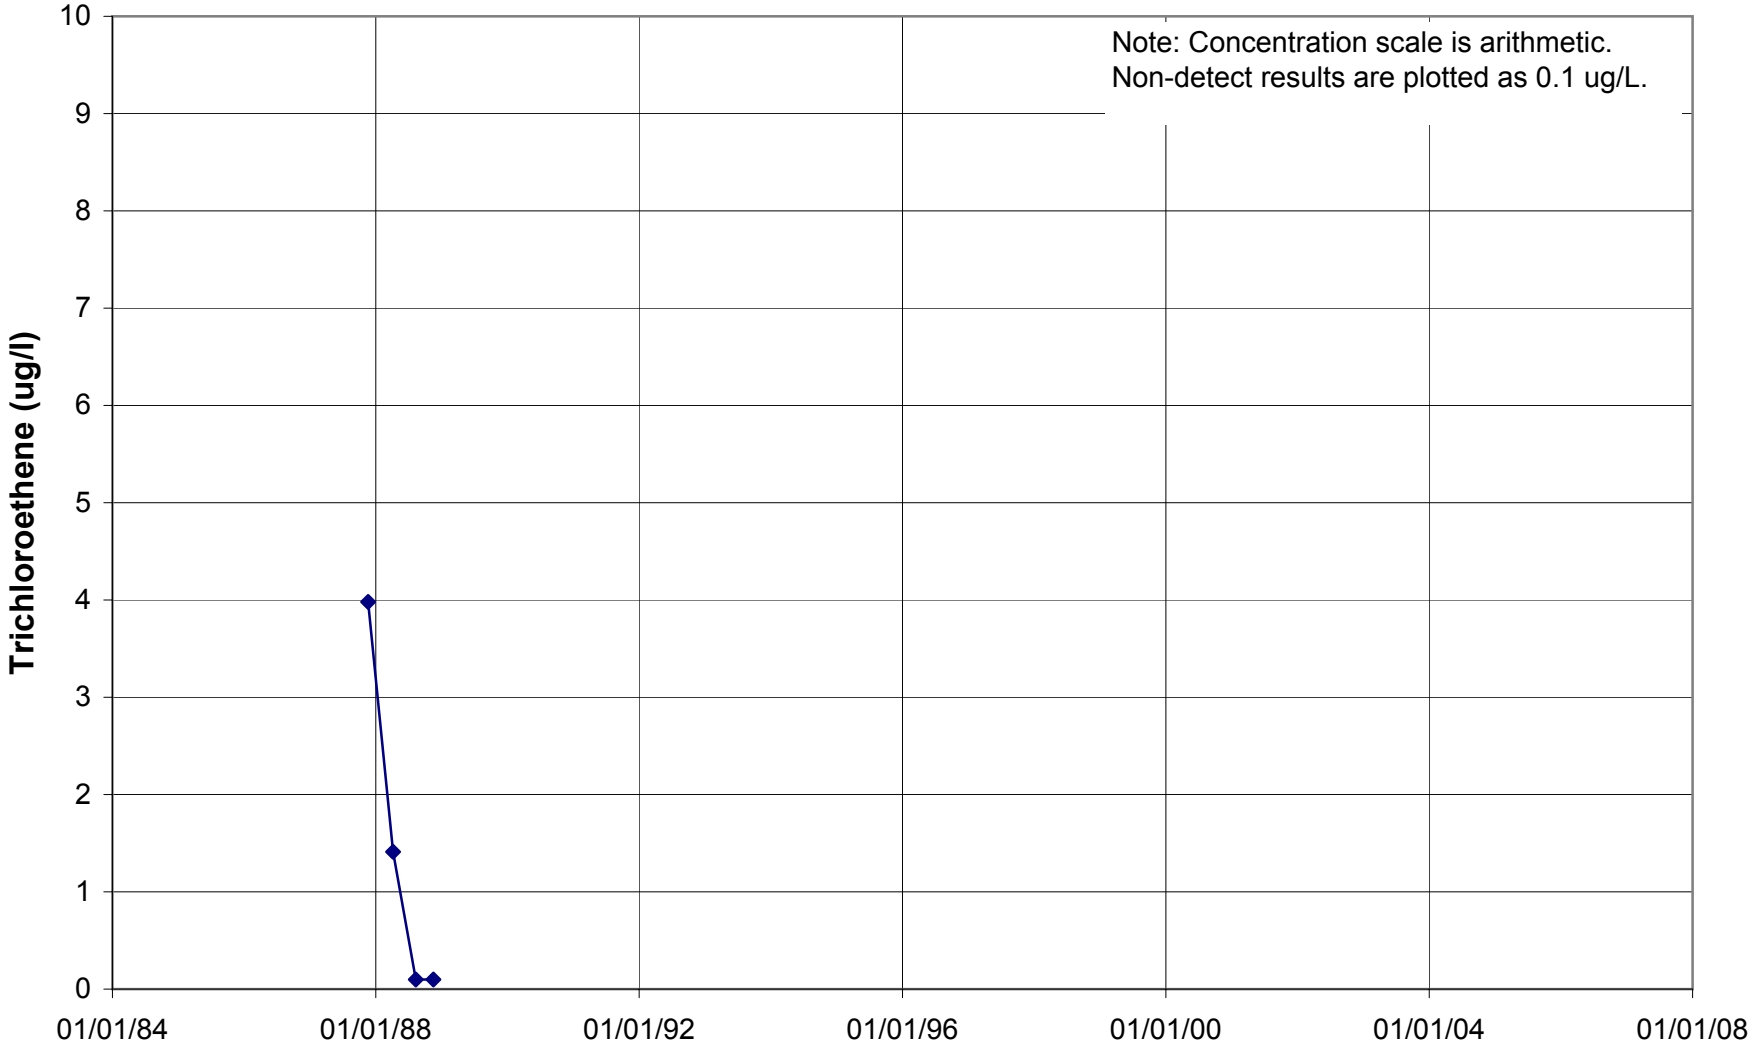

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U112

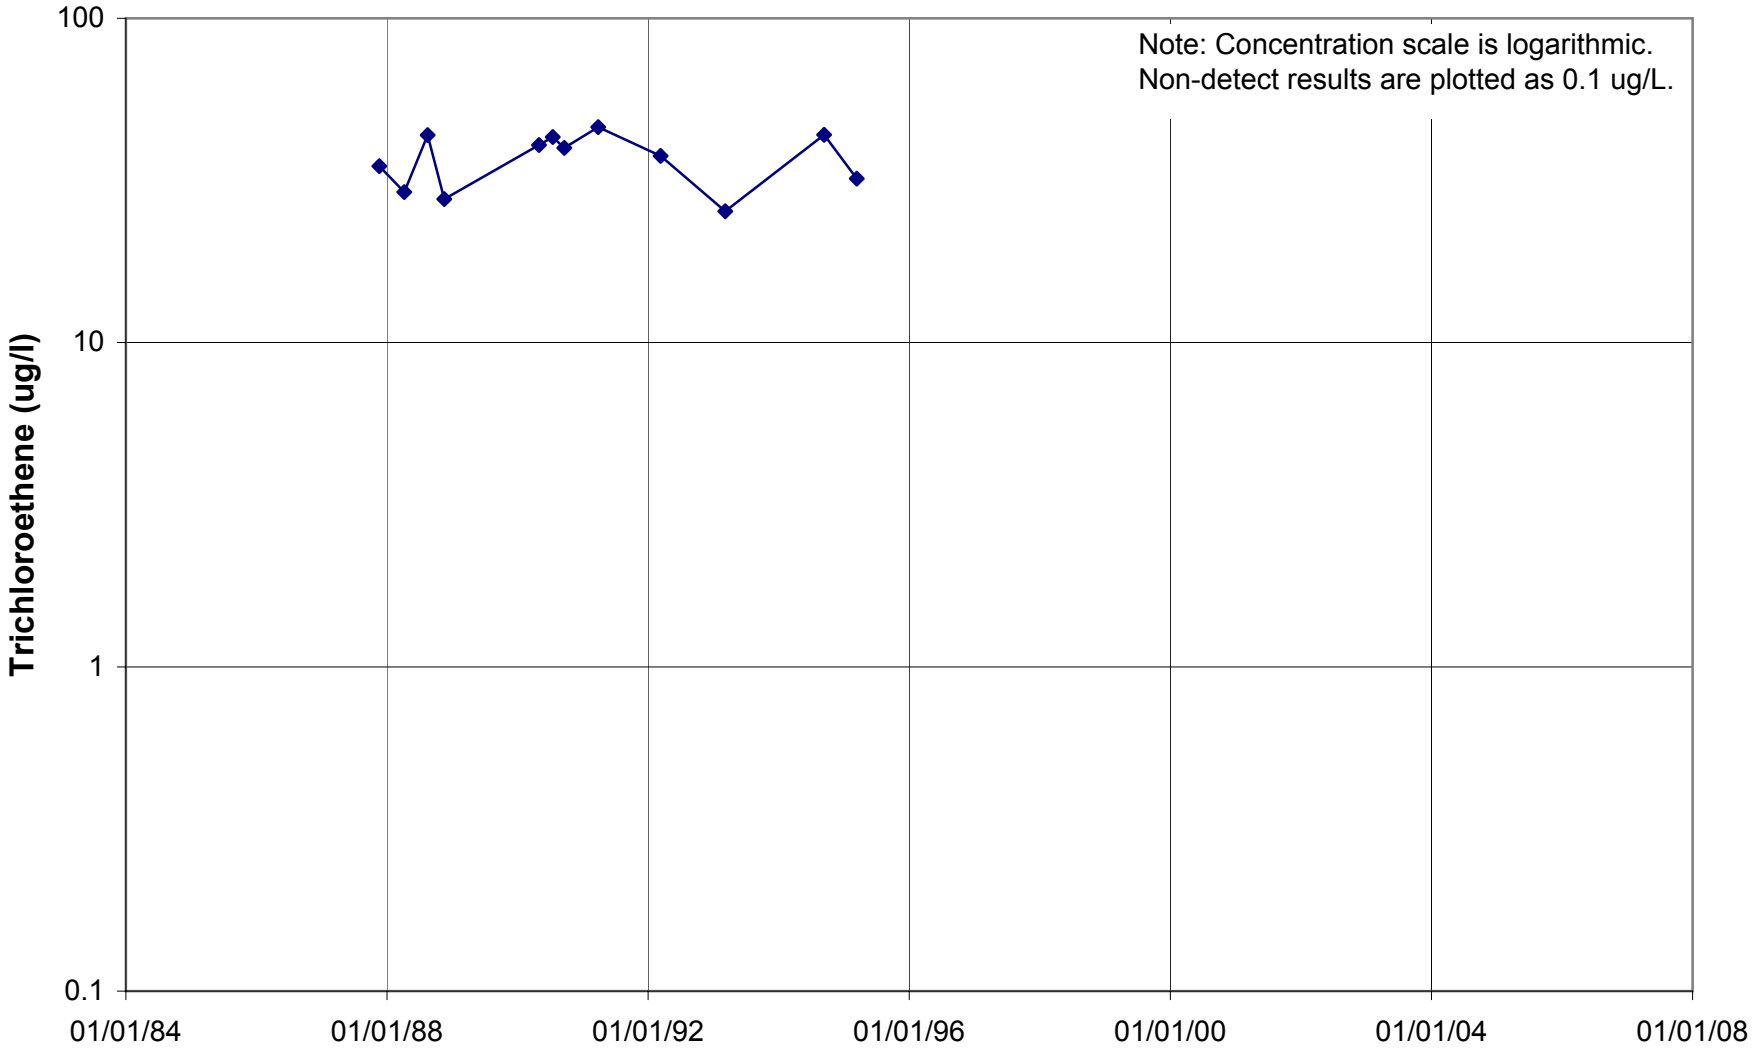

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U113

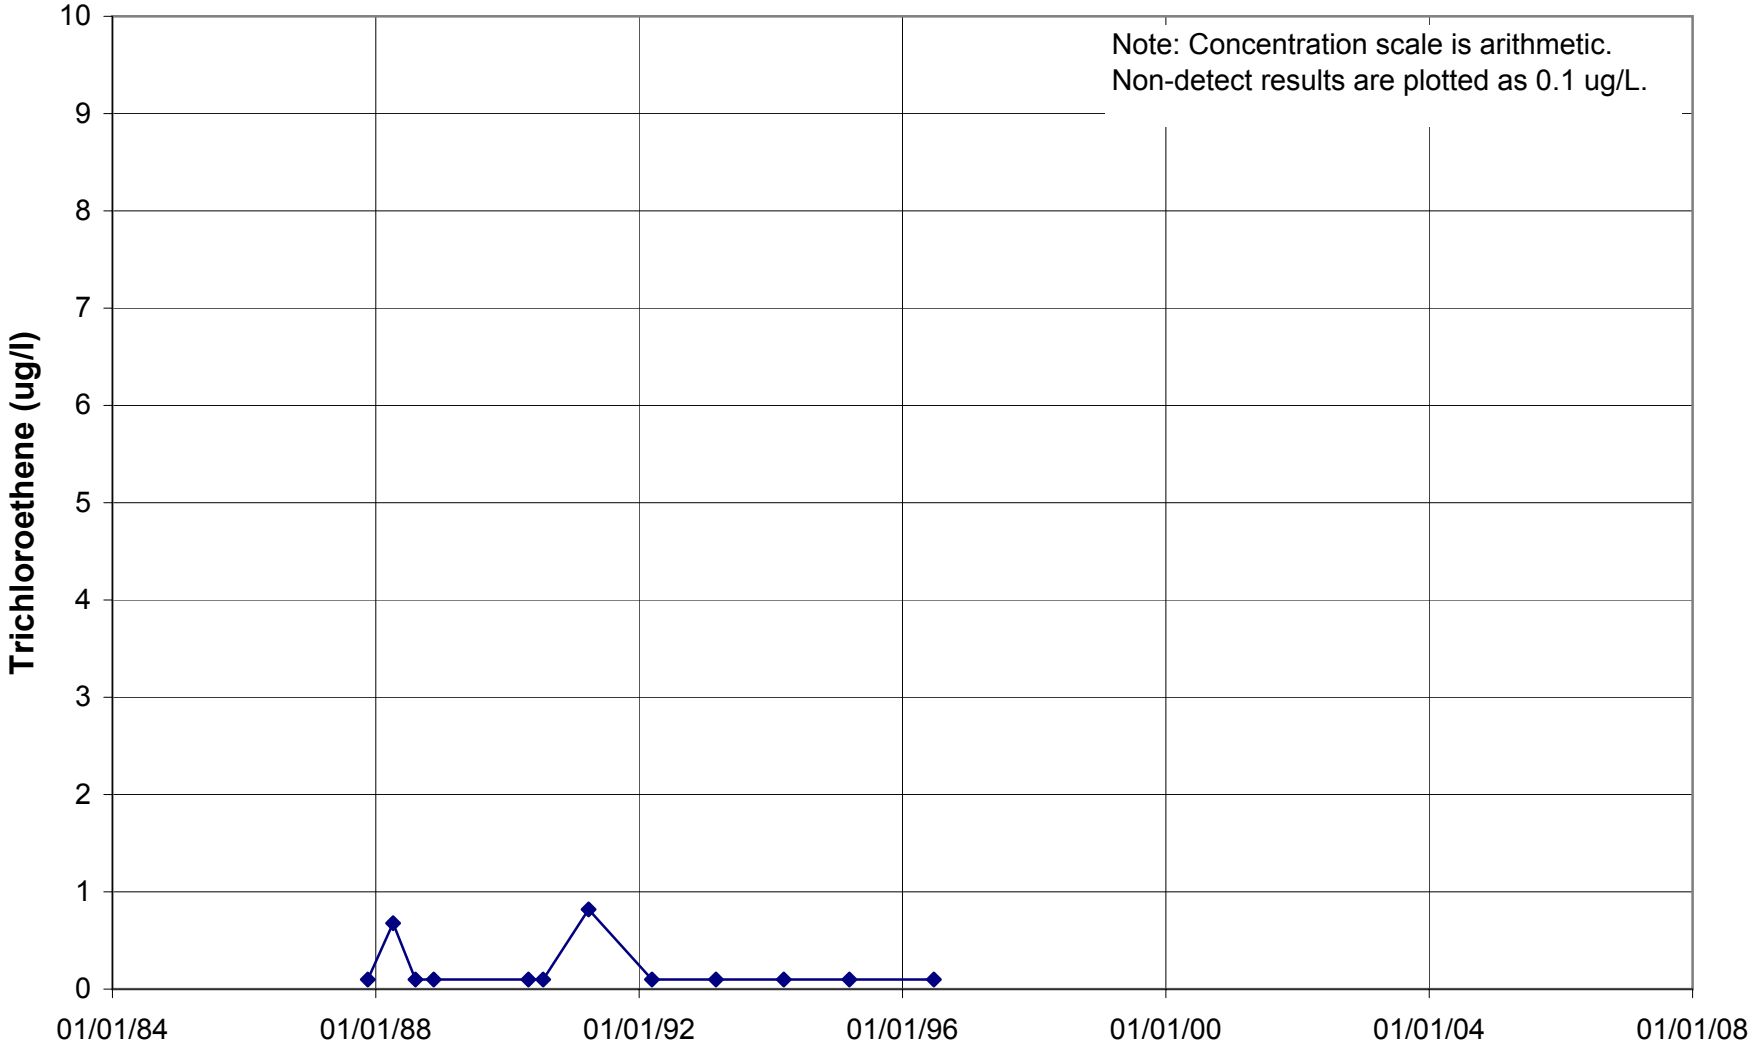

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U114

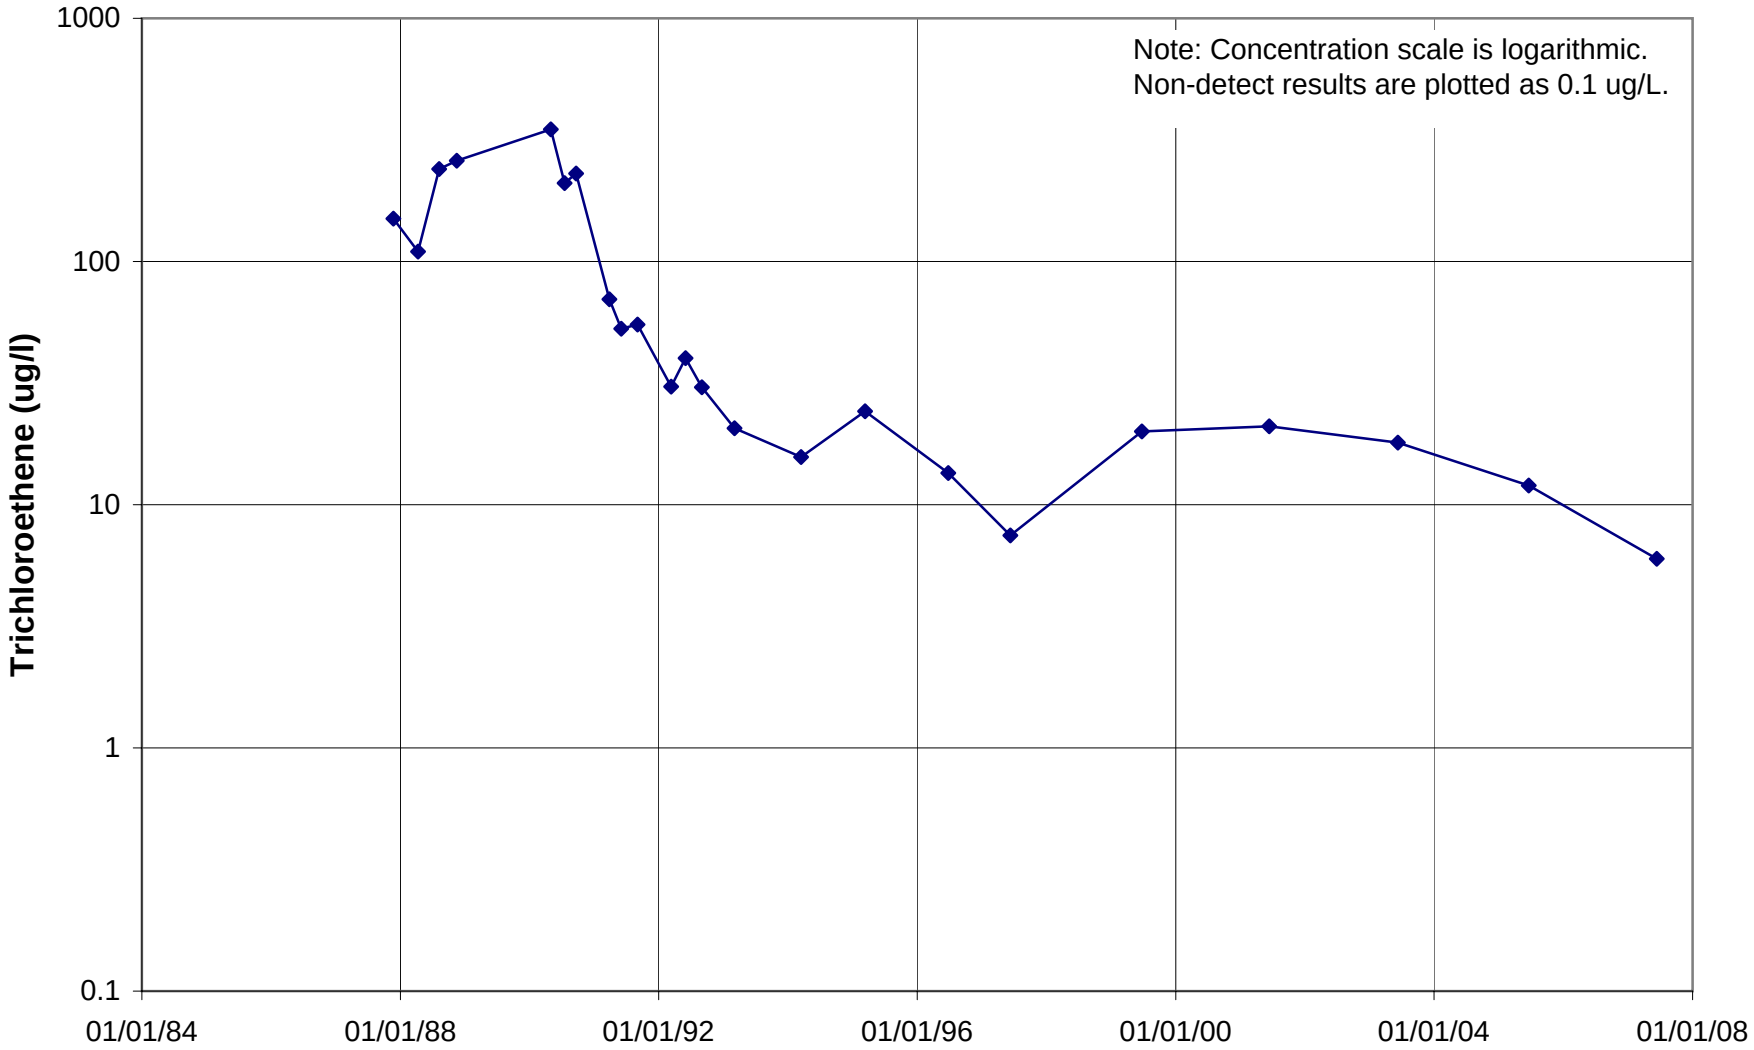

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U121

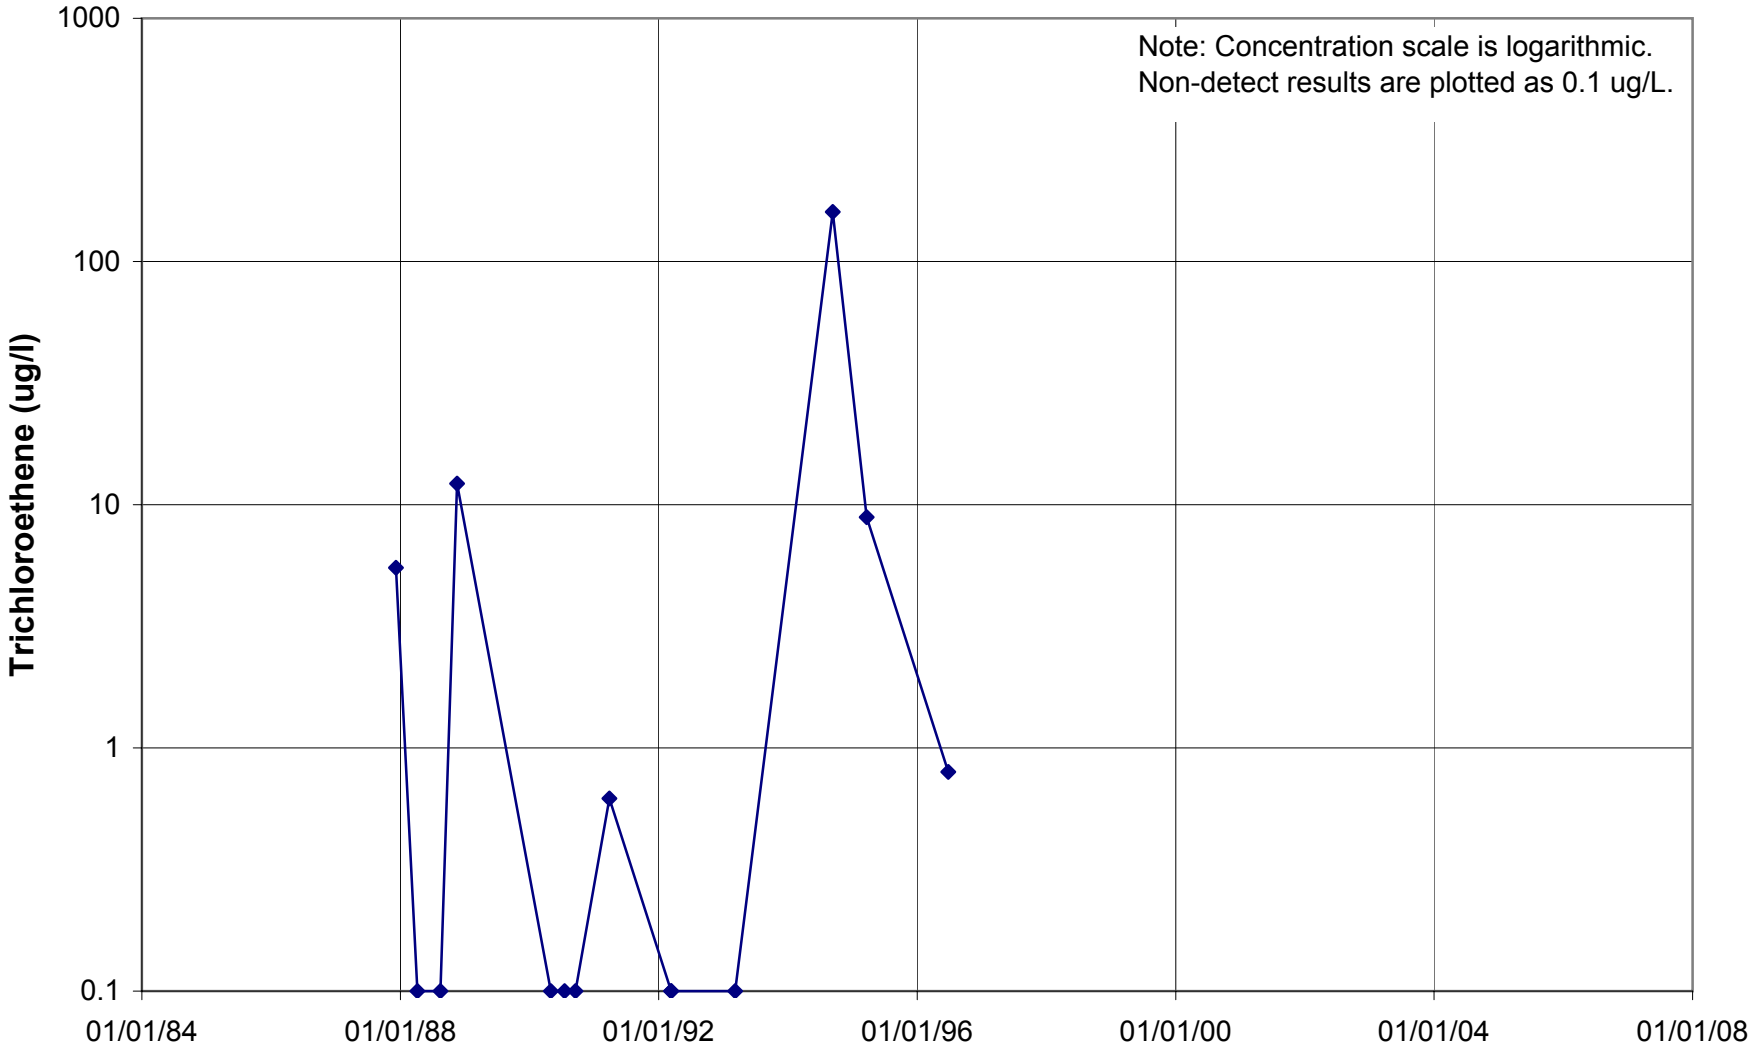

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U129

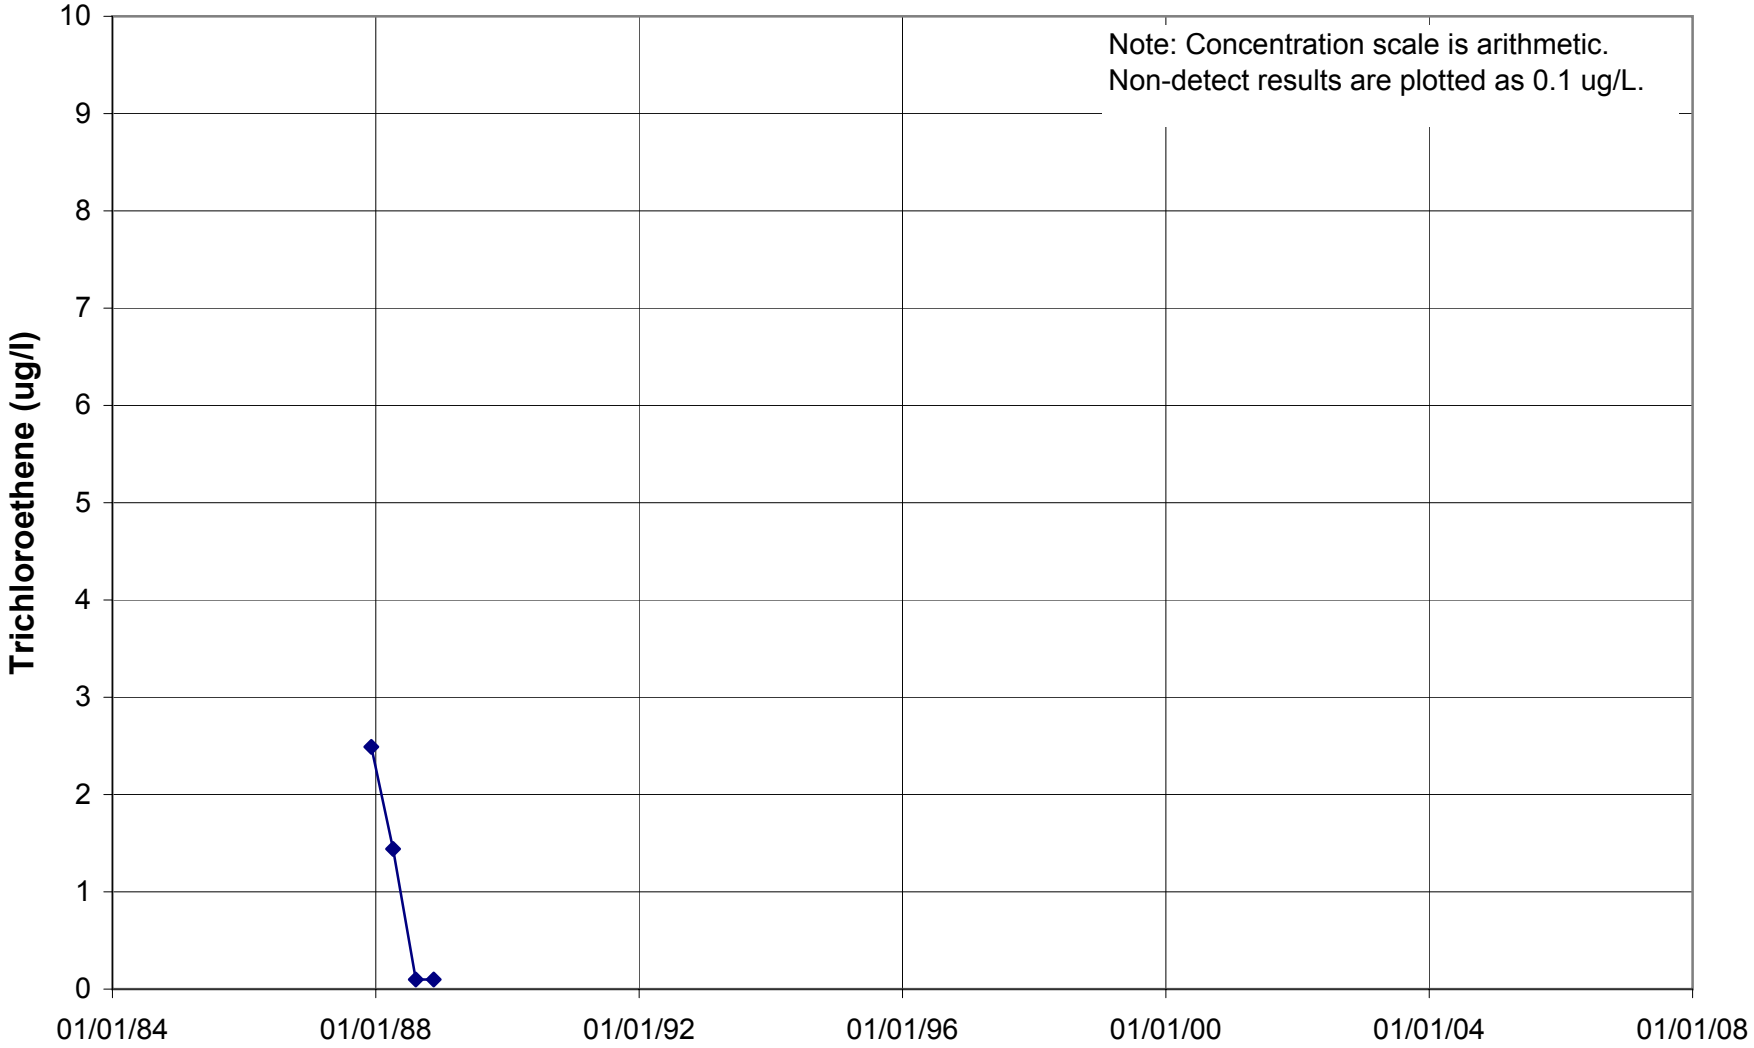

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U301 (SC1)

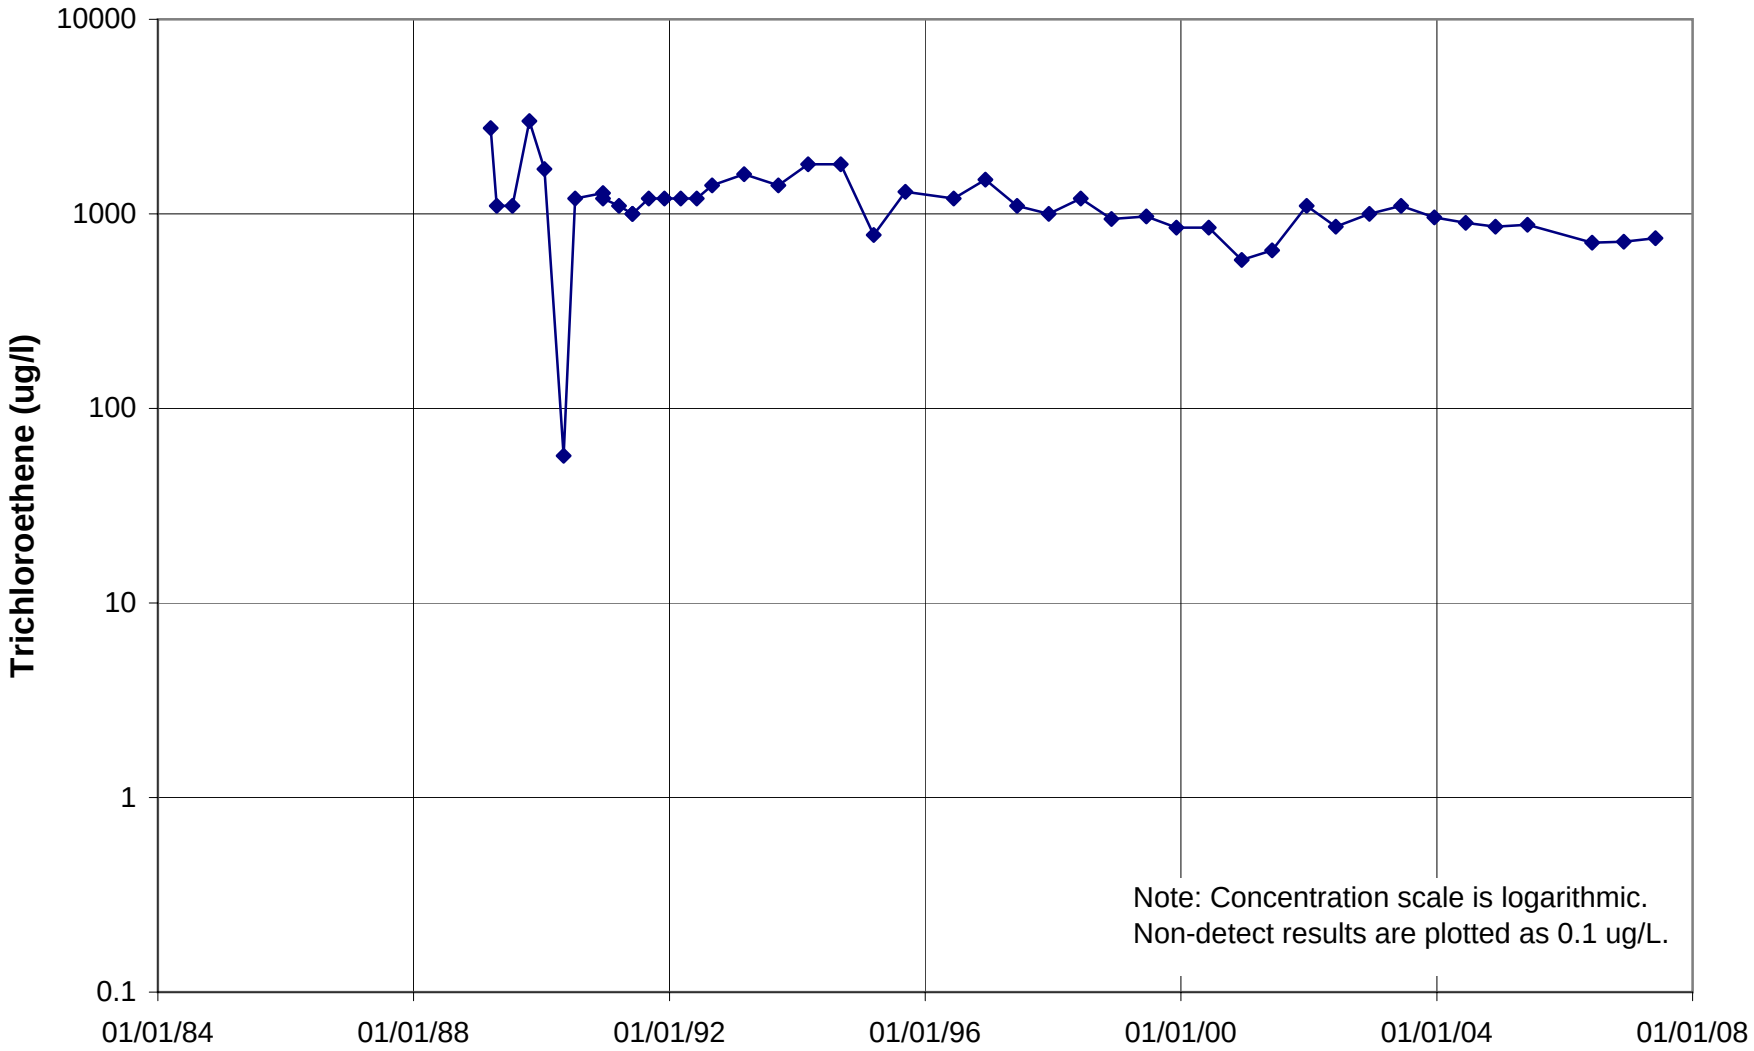

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U314 (SC2)

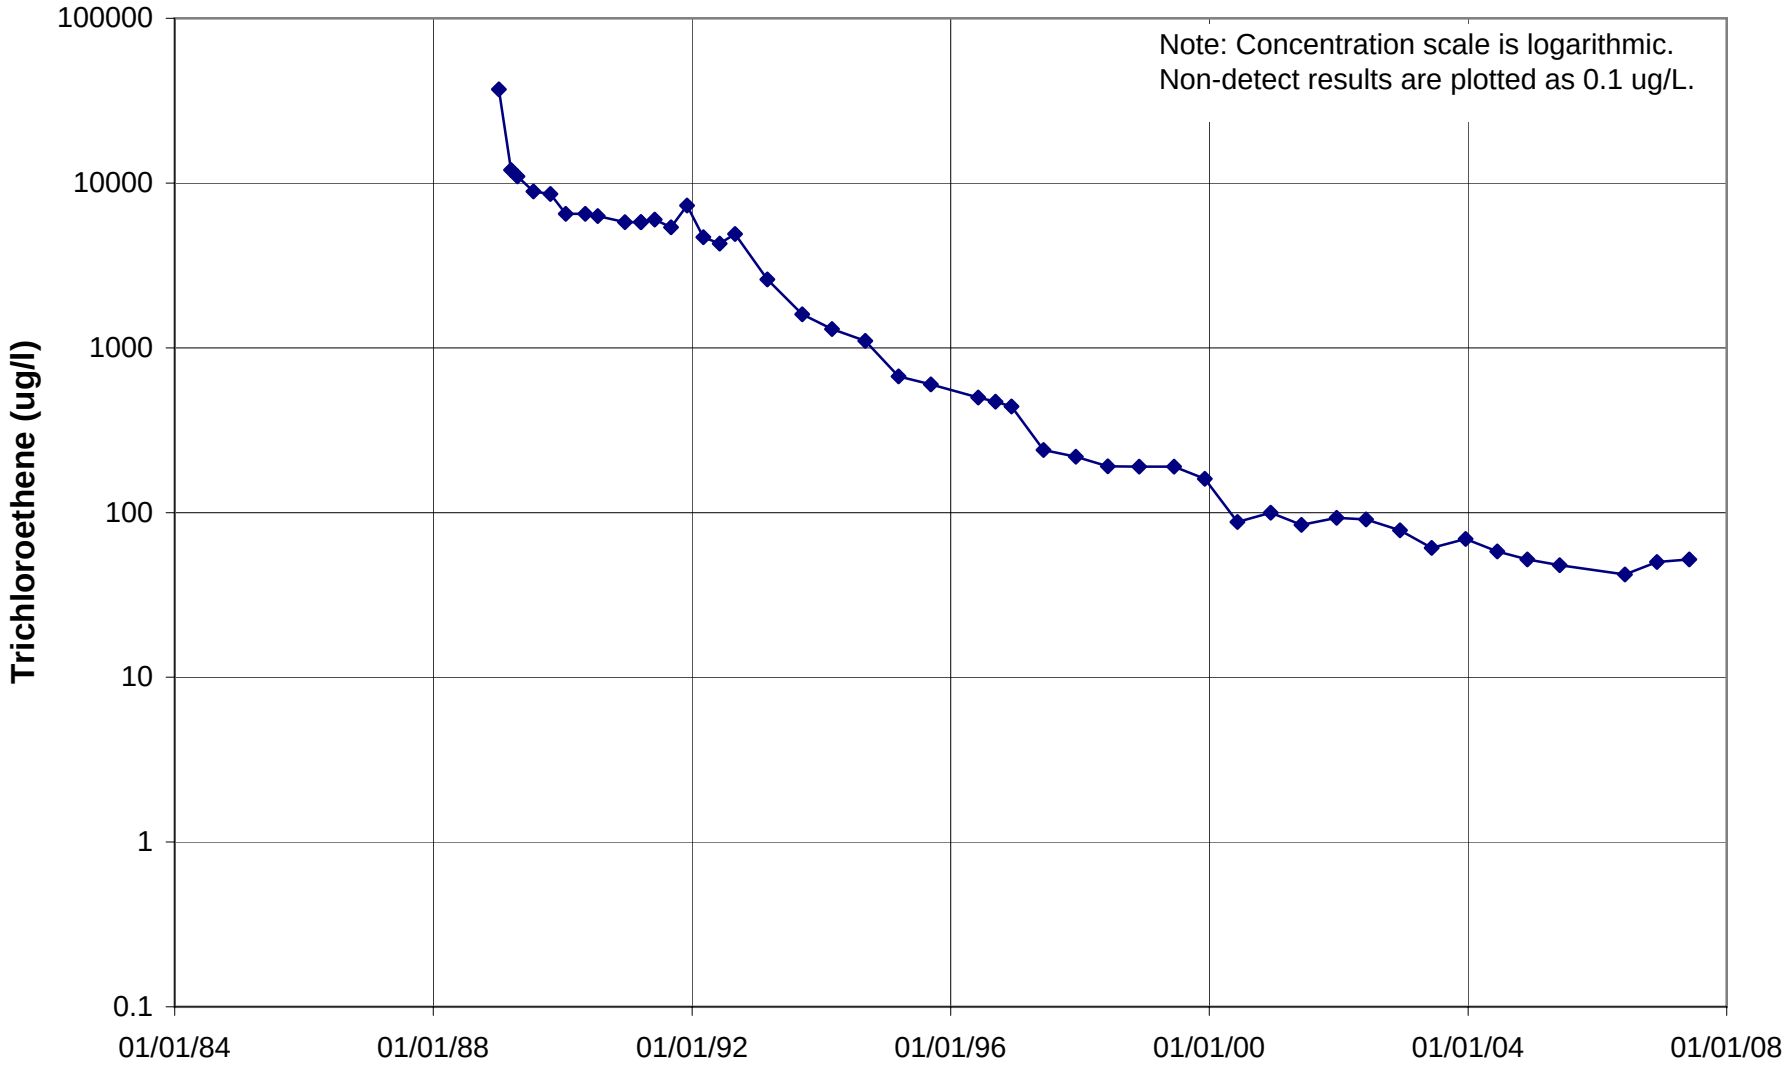

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U315 (SC3)

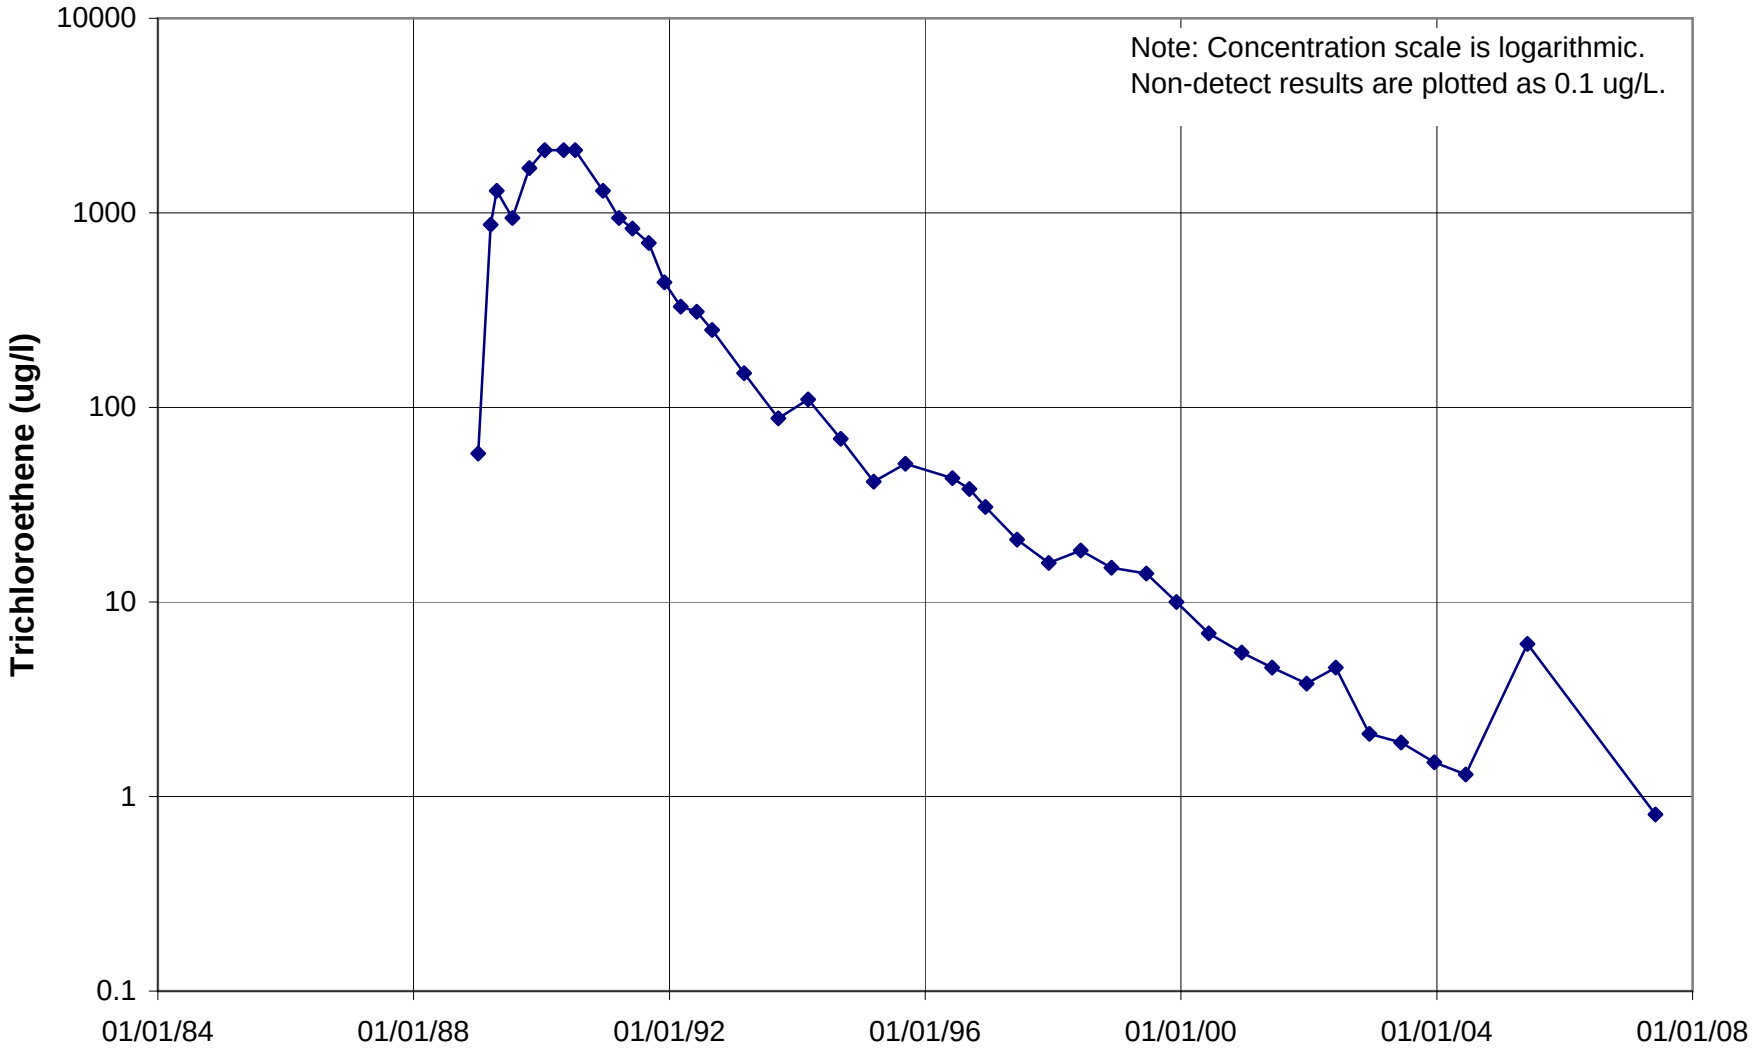

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U316 (SC4)

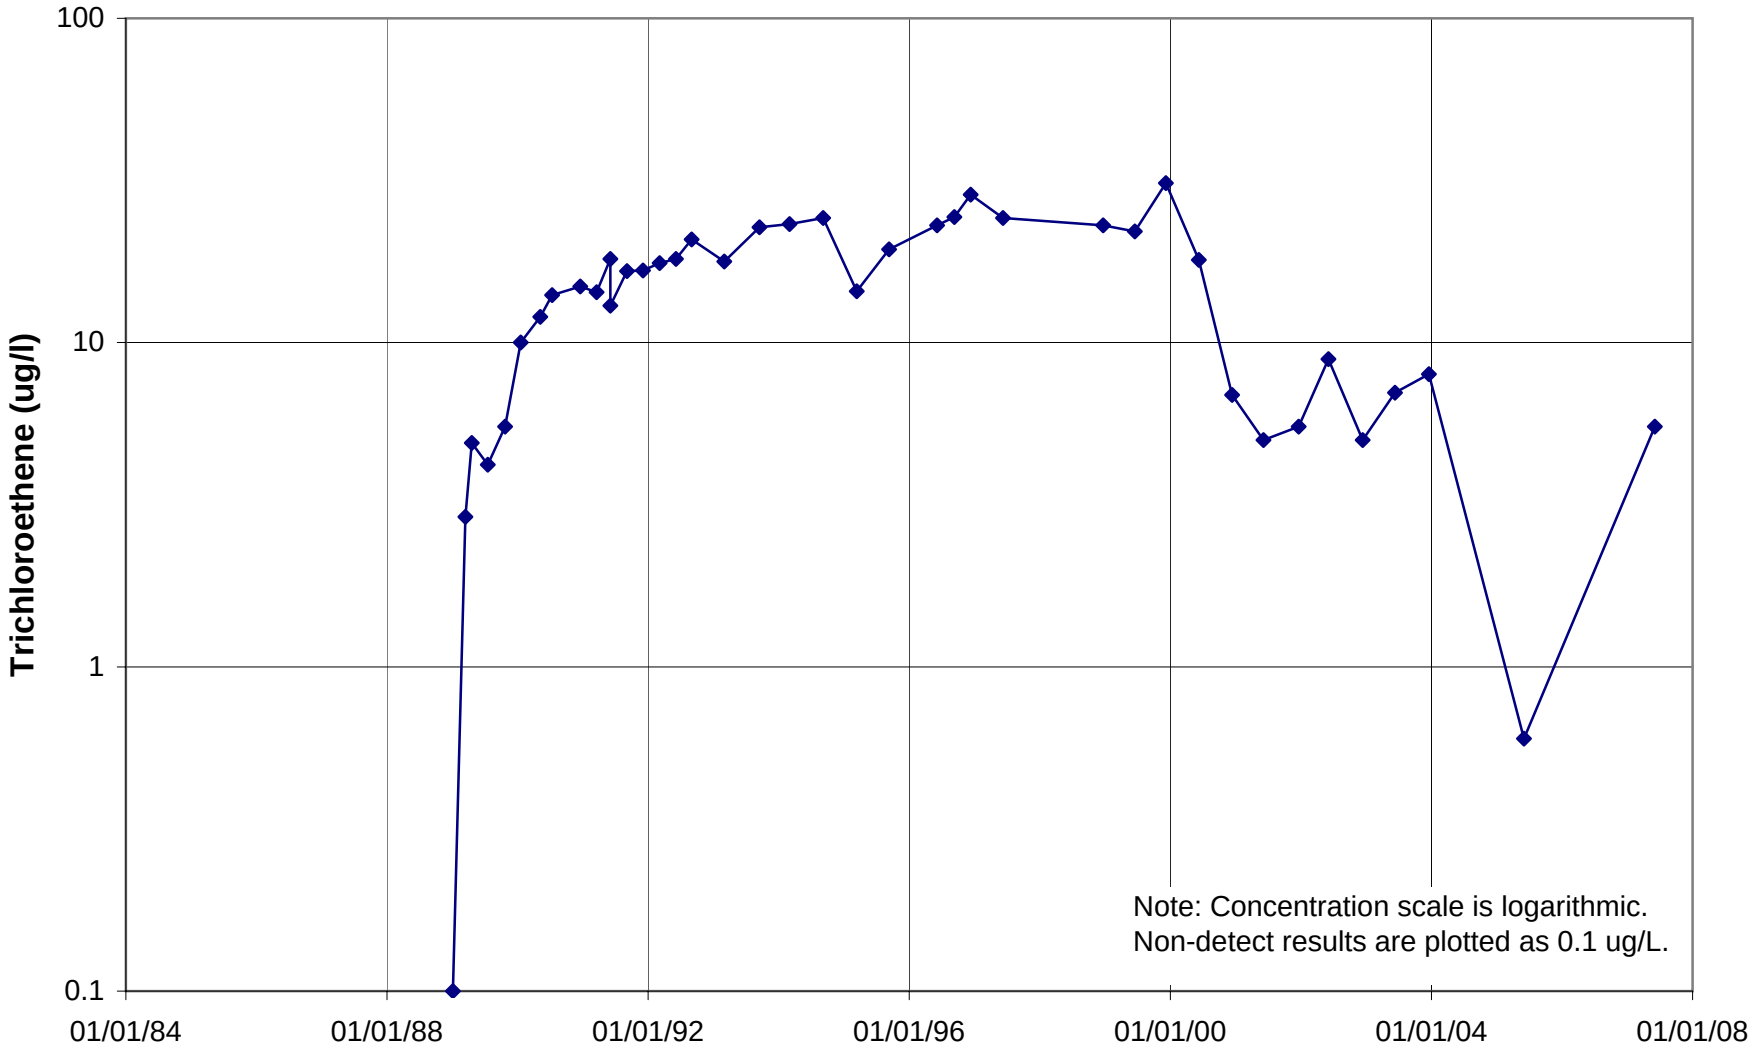

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U317 (SC5)

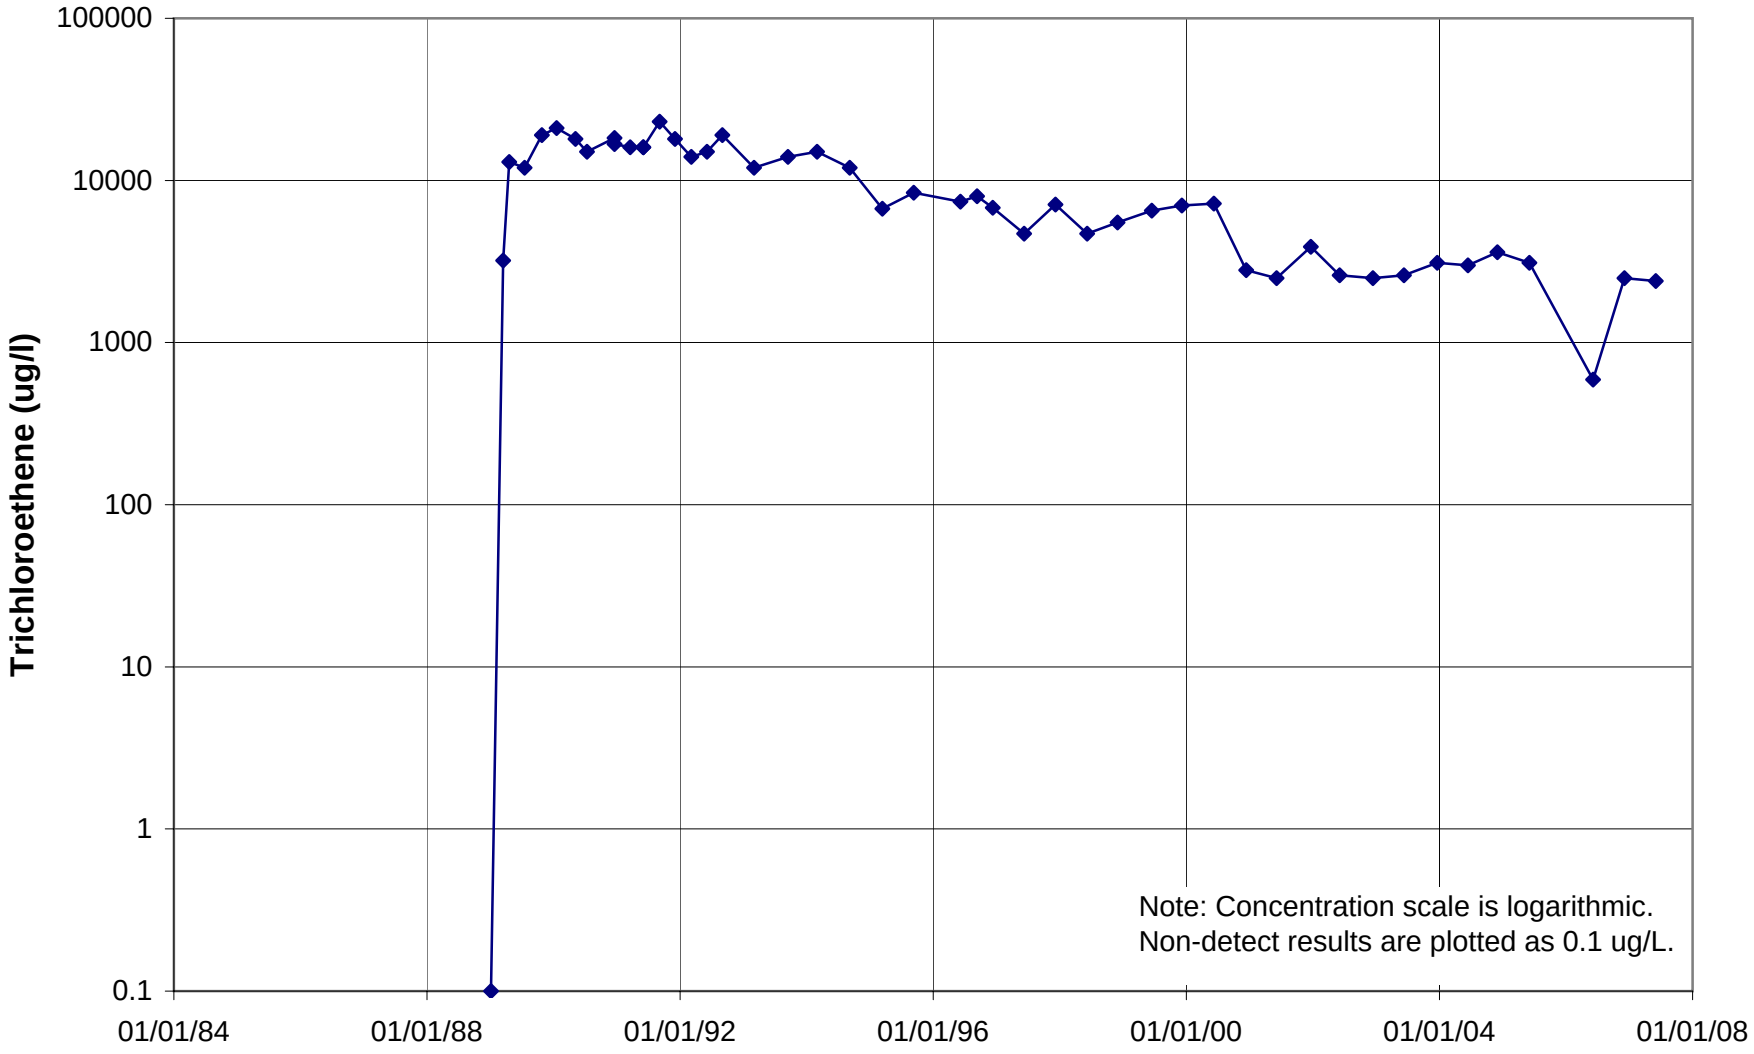

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U521

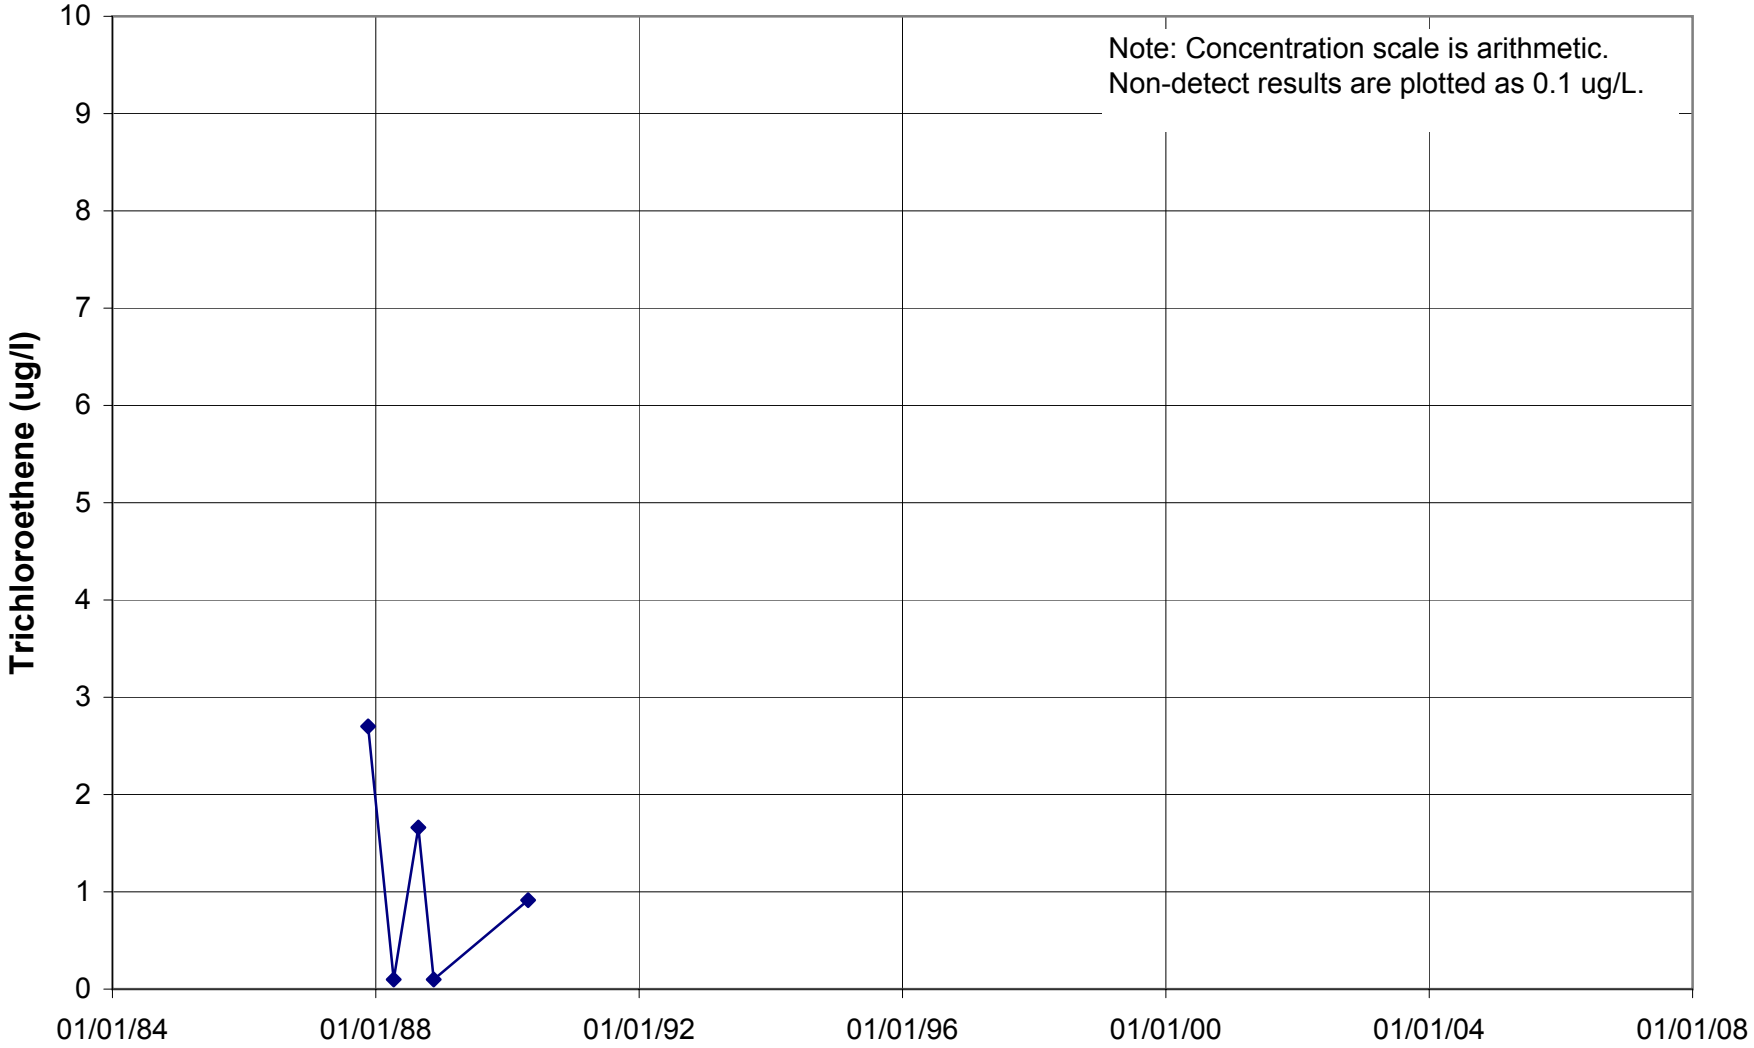

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U621

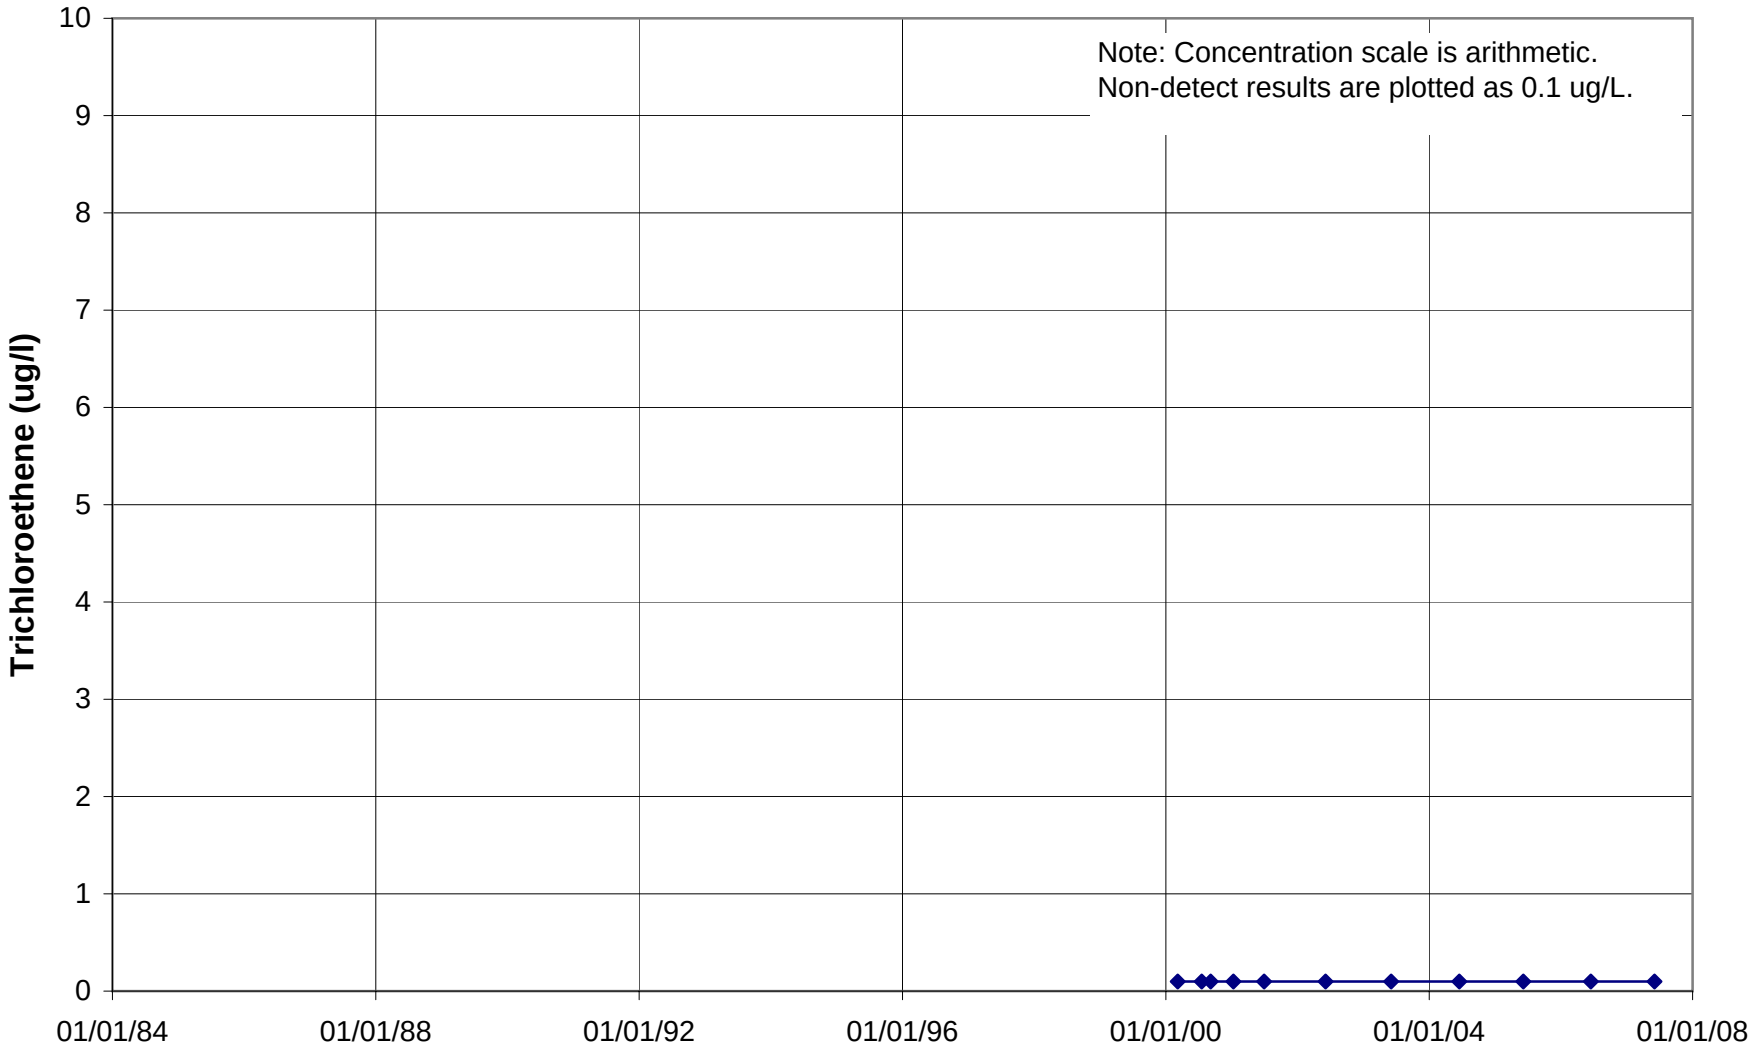

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U659

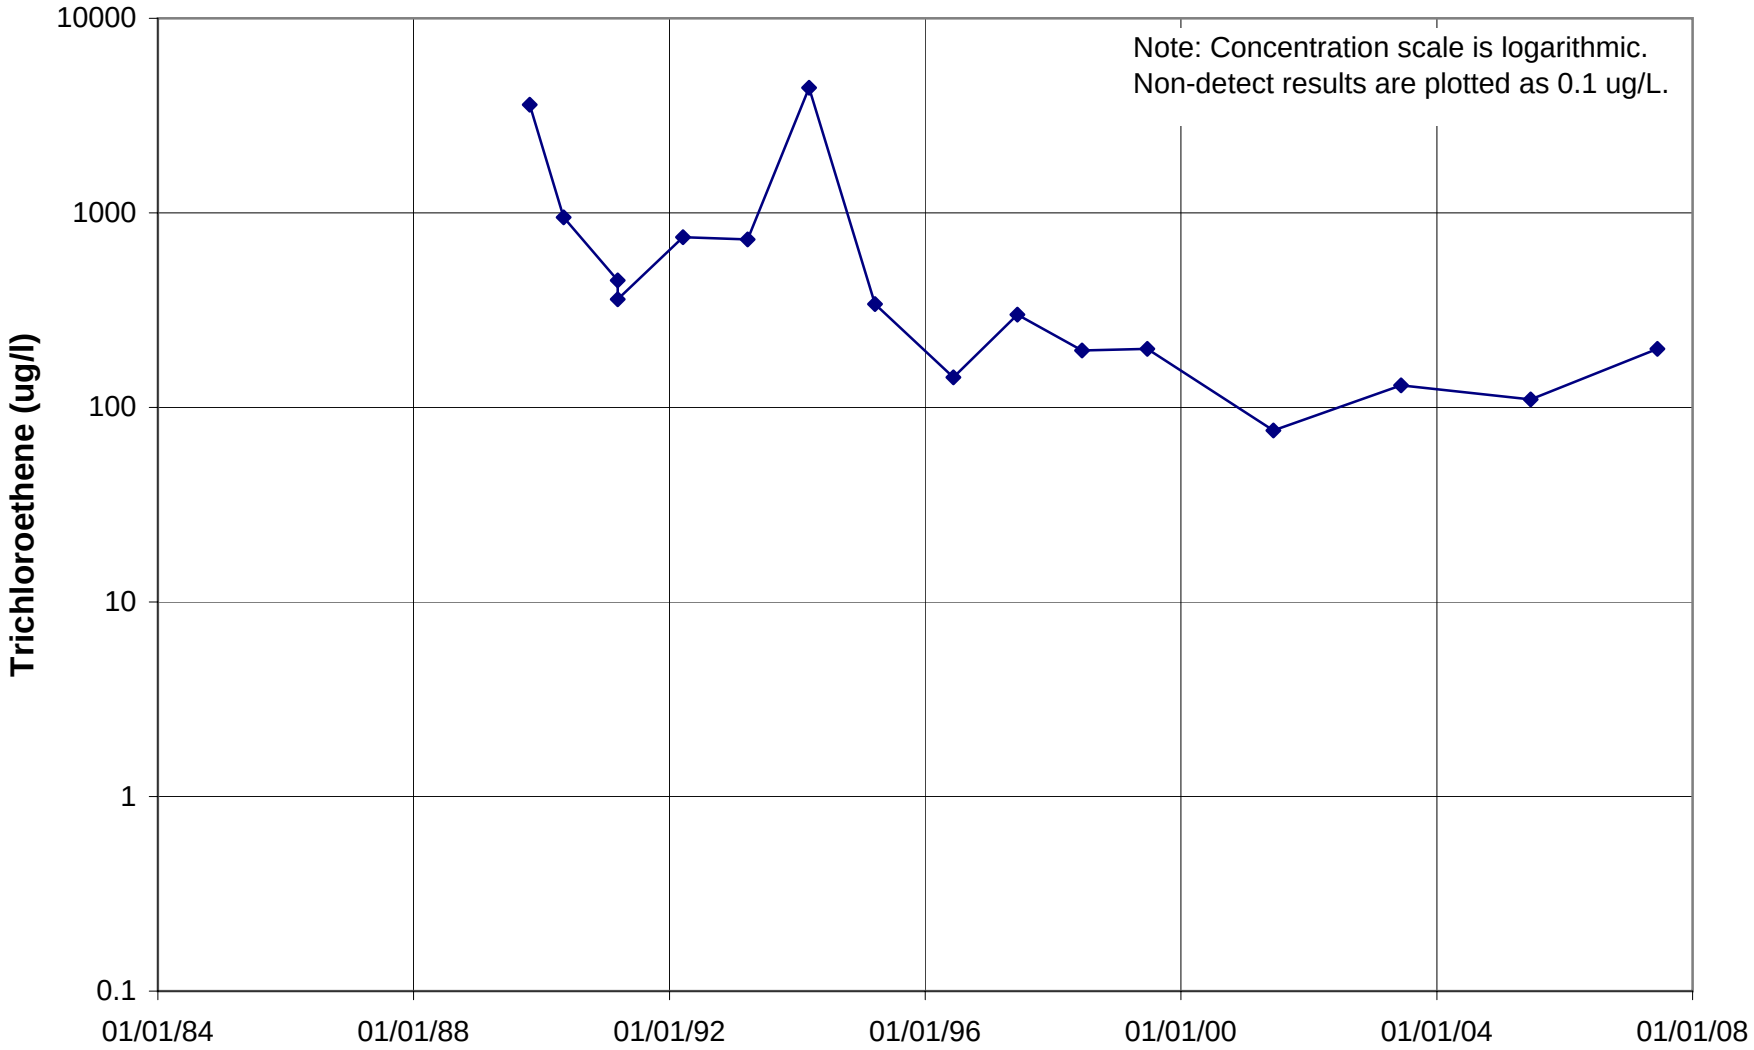

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U671

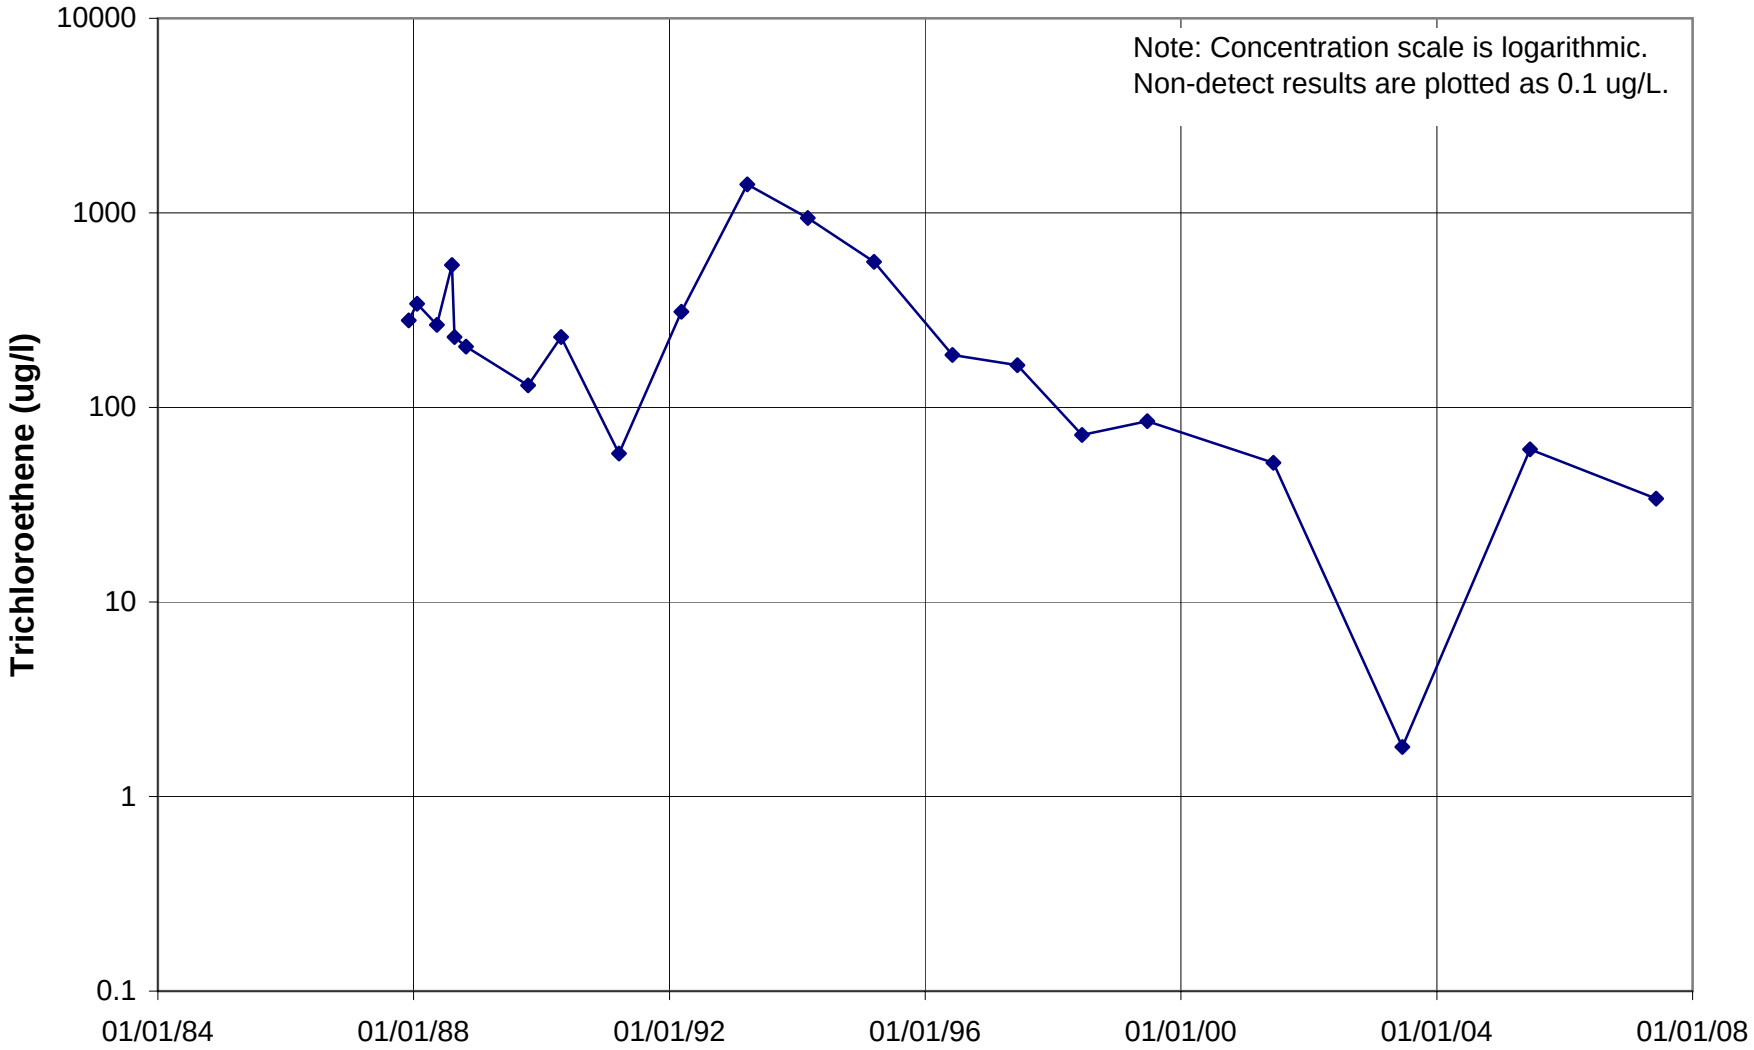

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U672

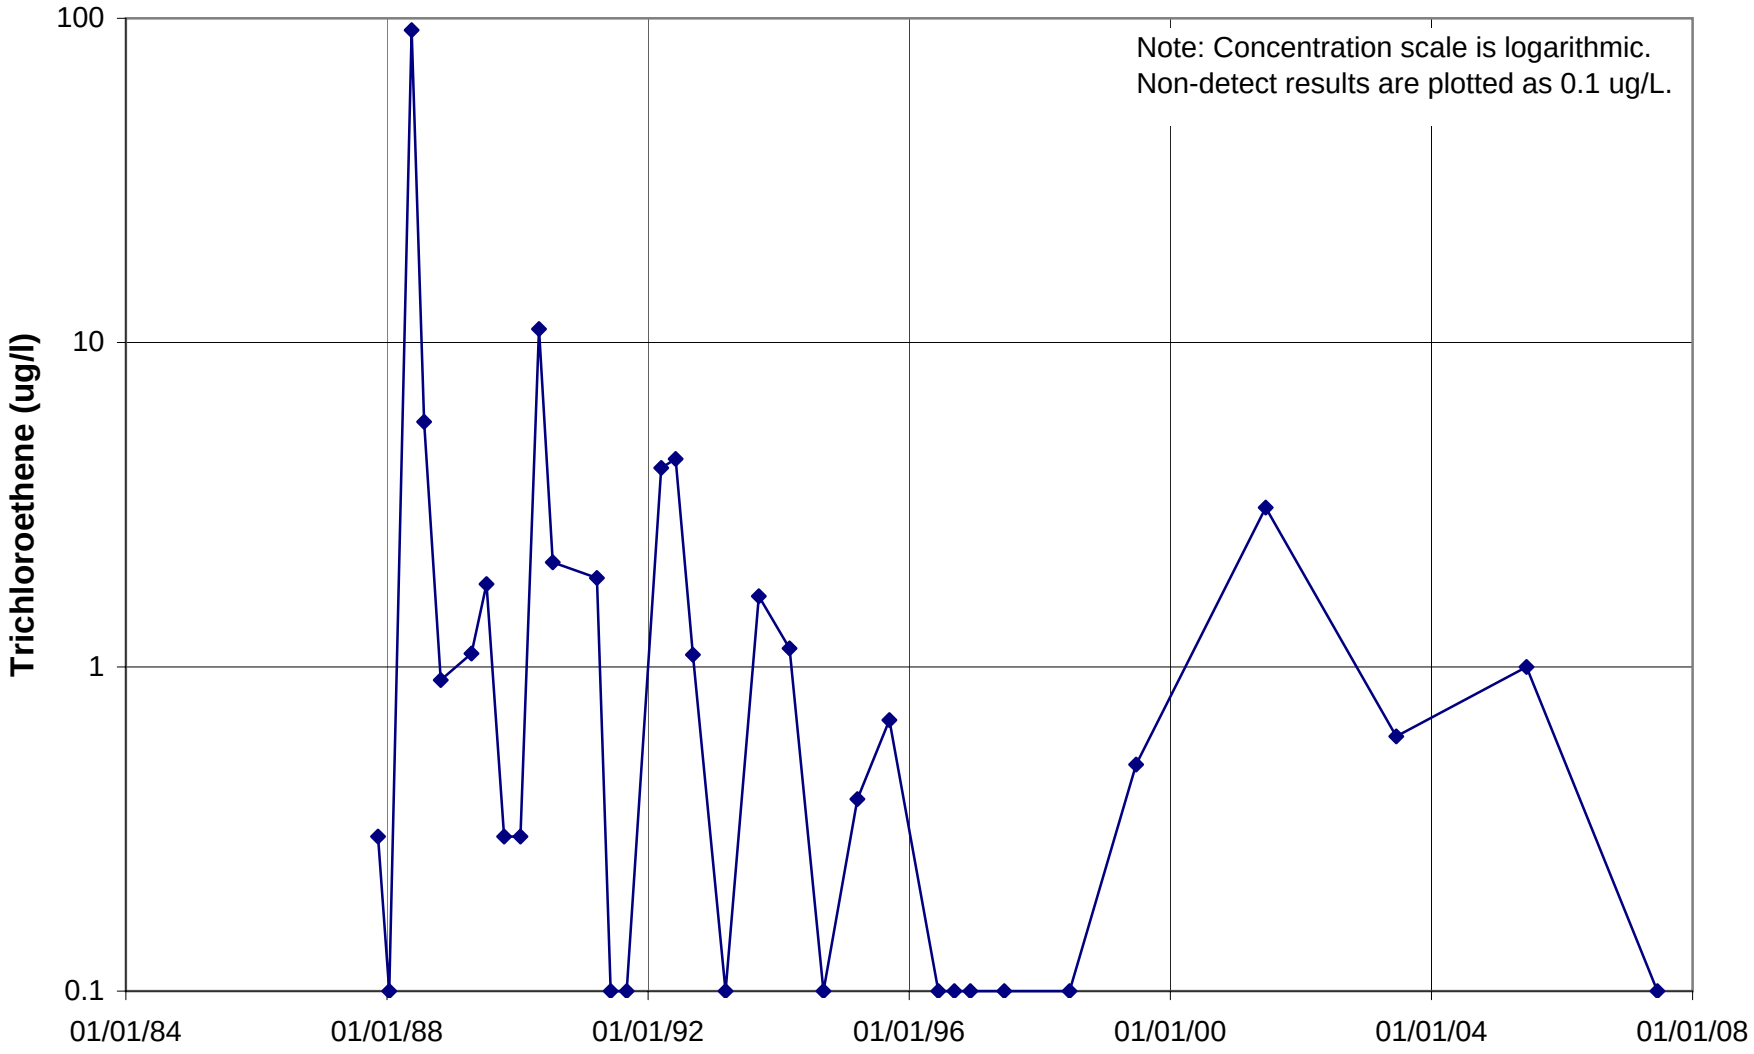

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U673

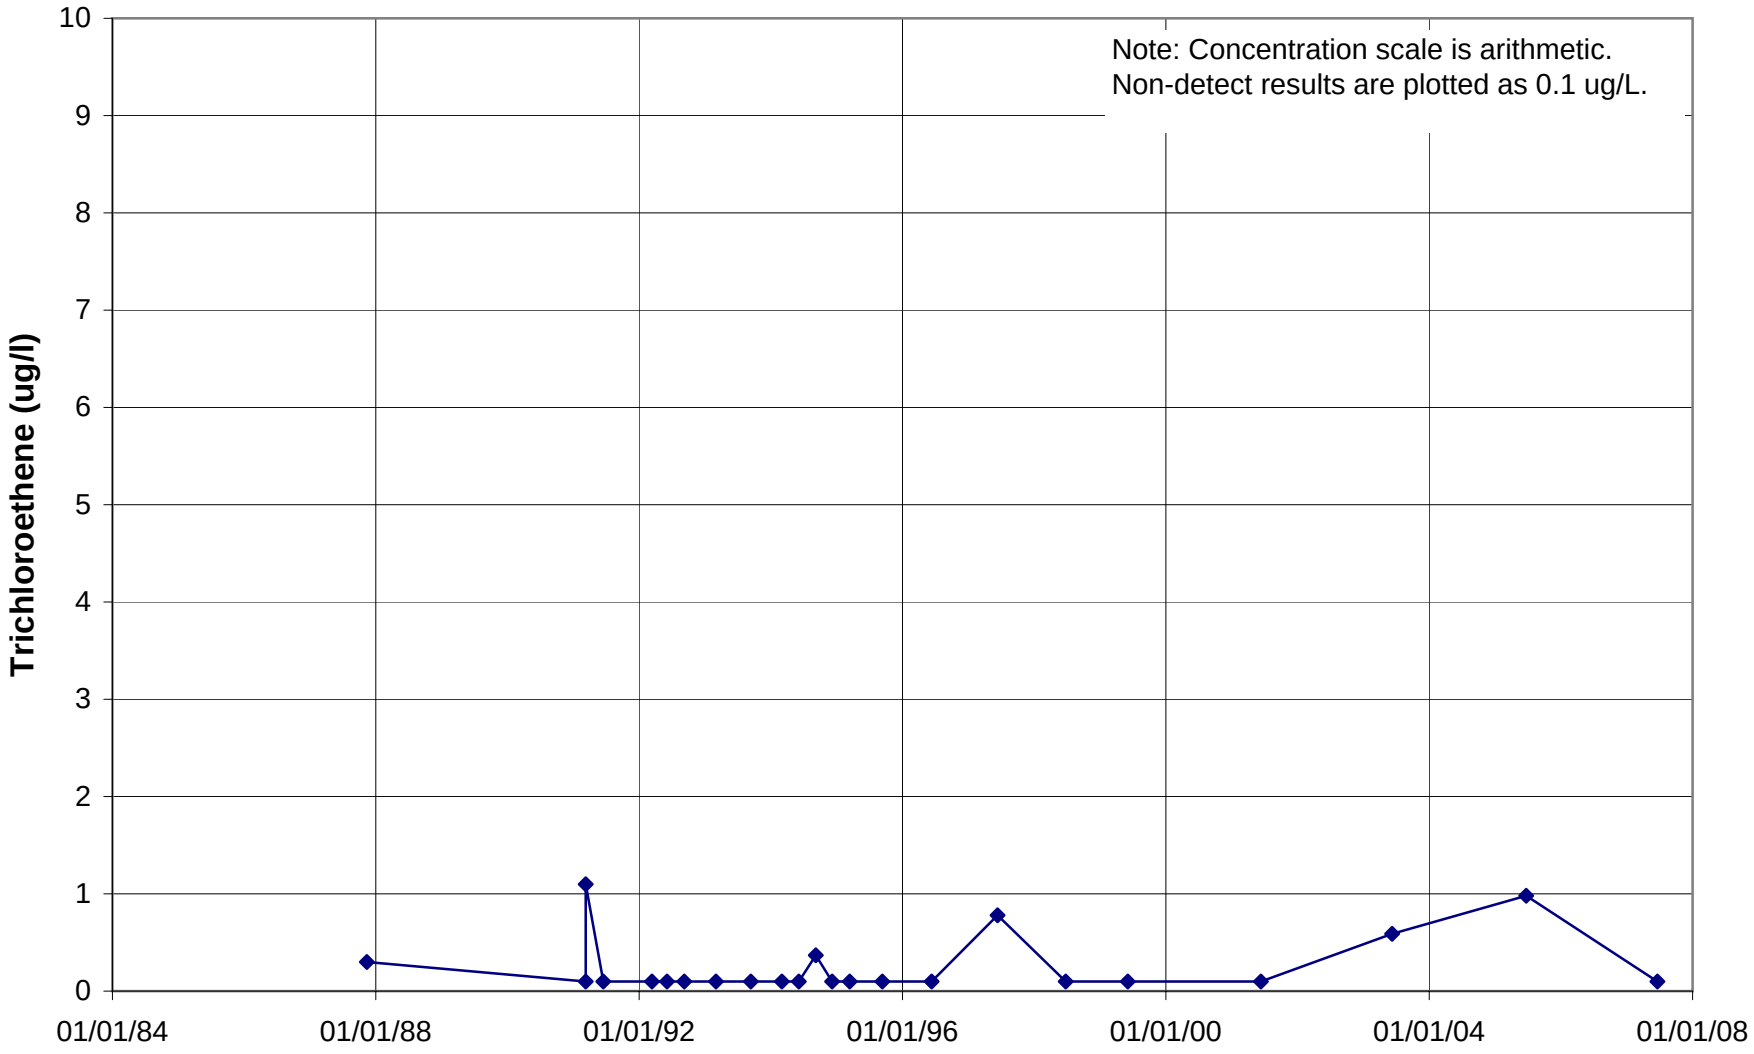

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U676

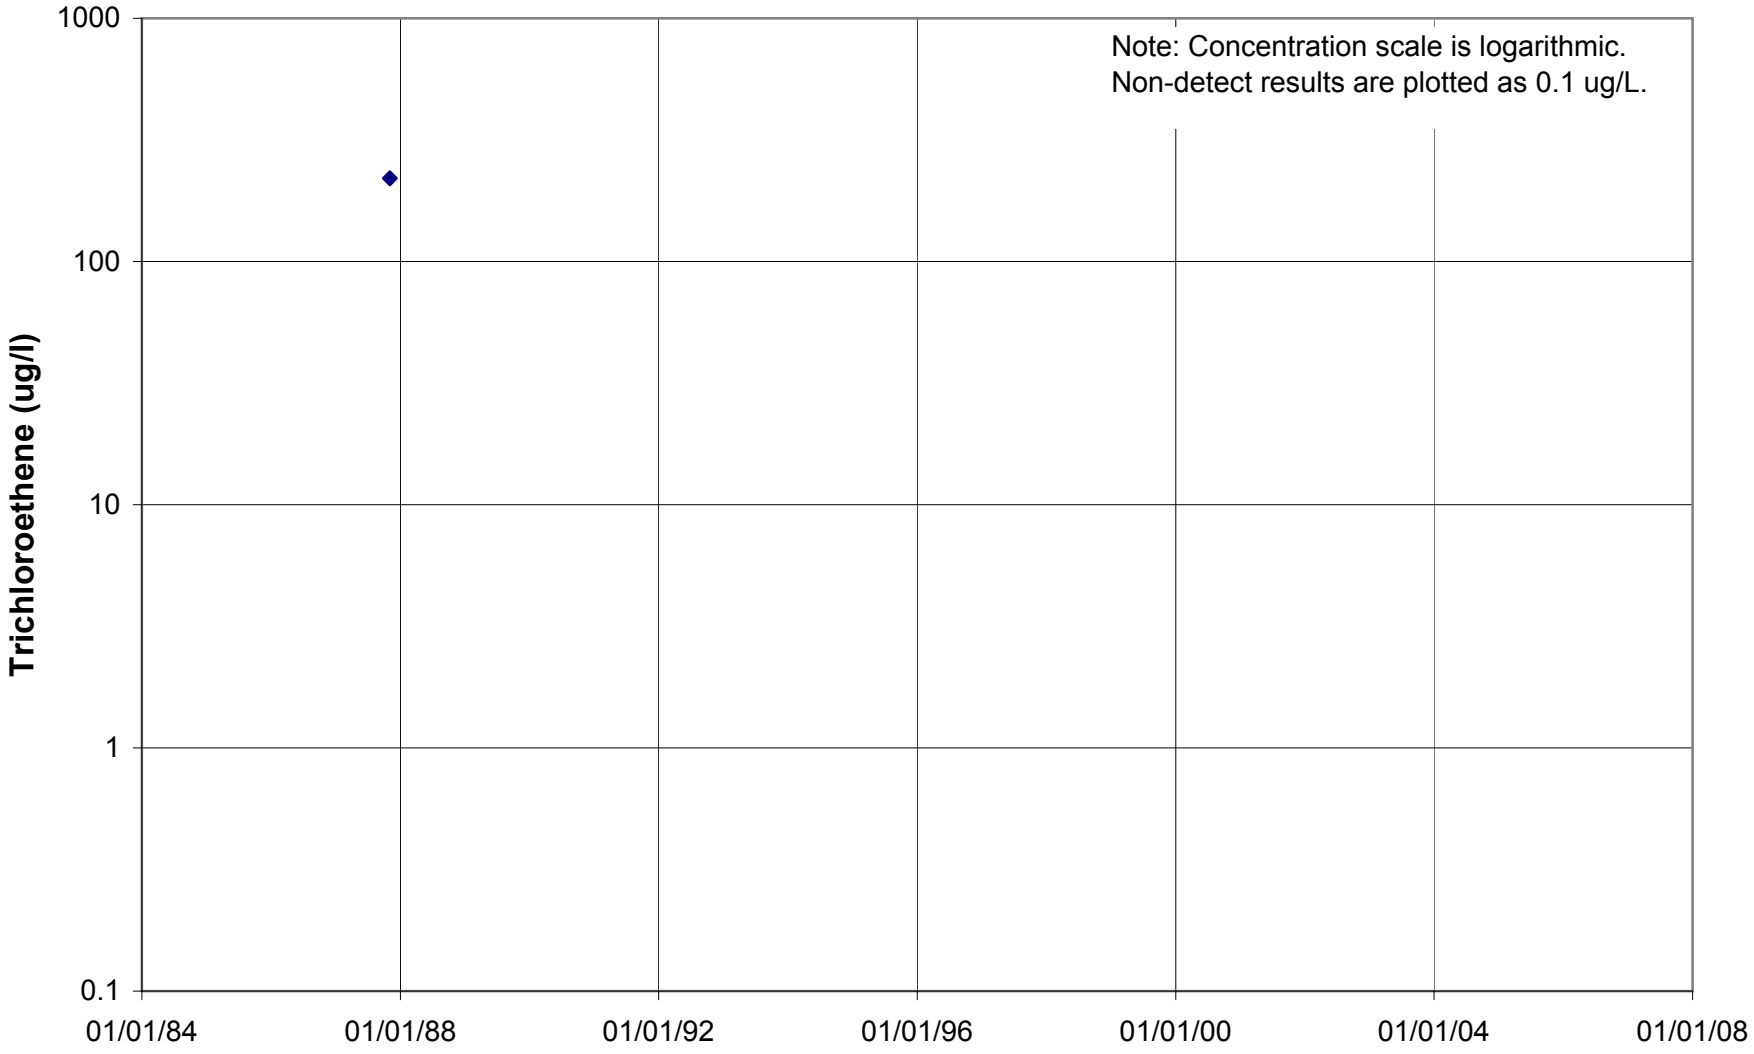

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U701

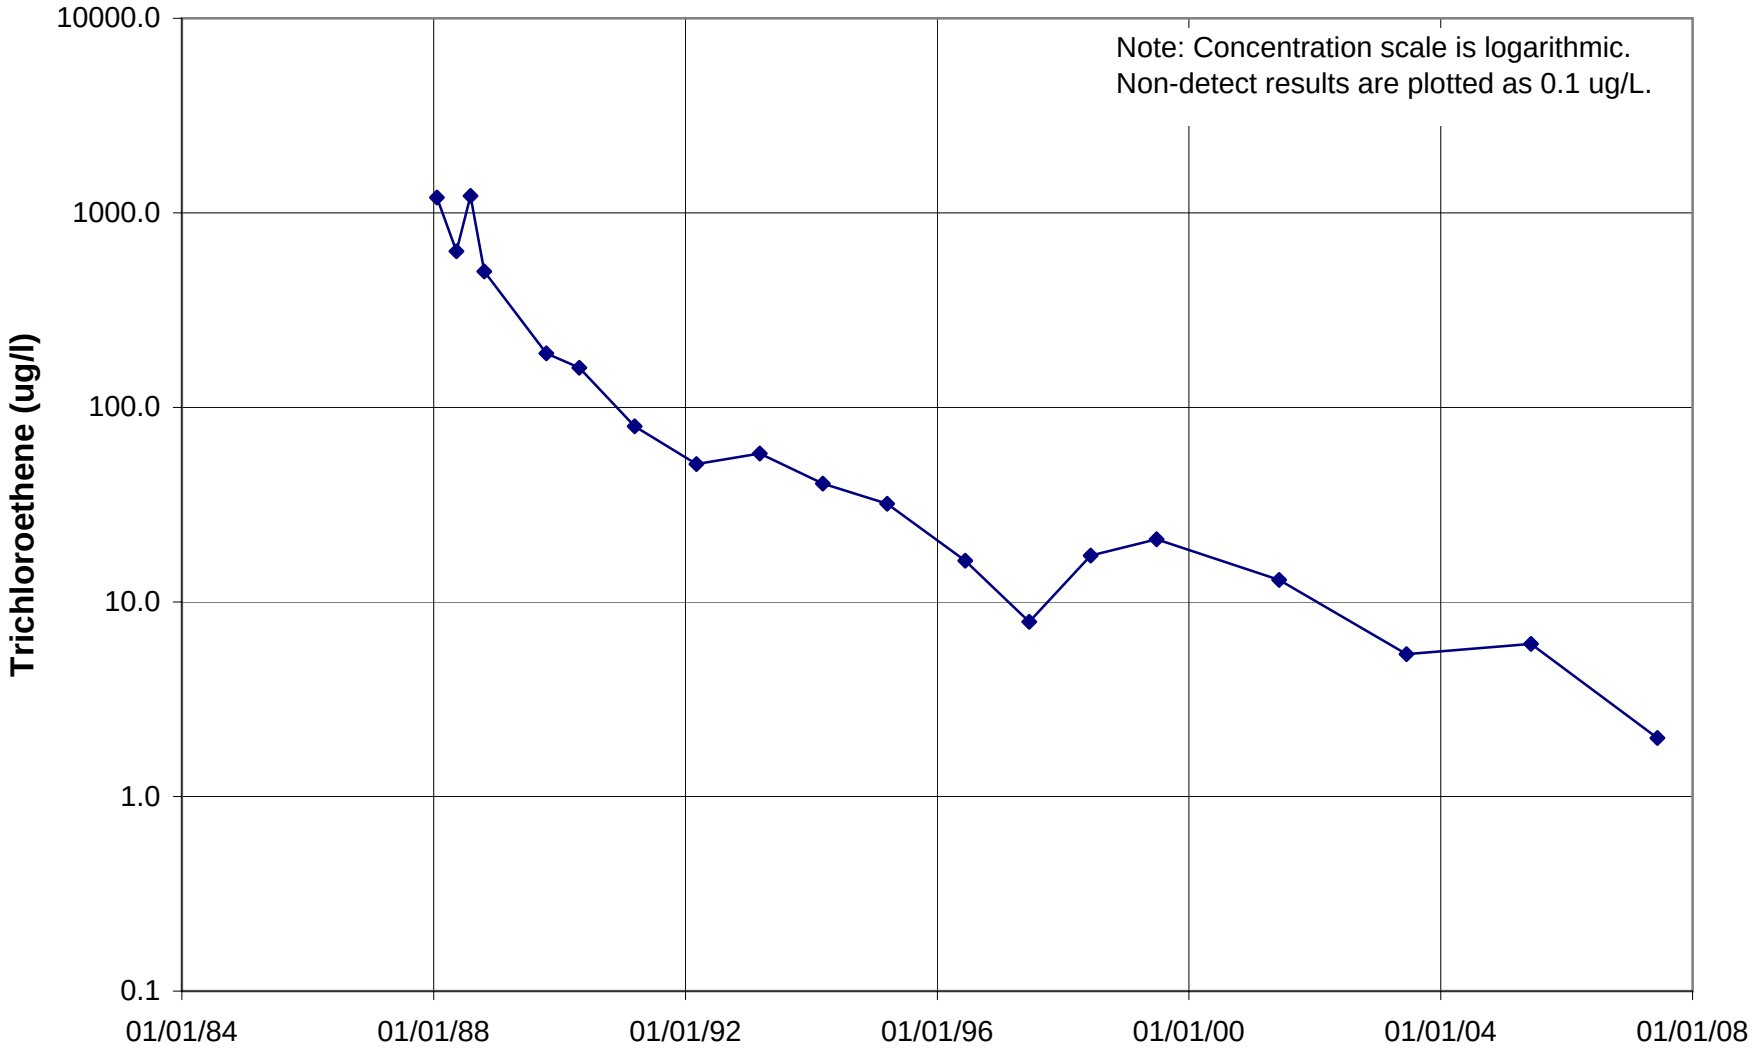

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U702

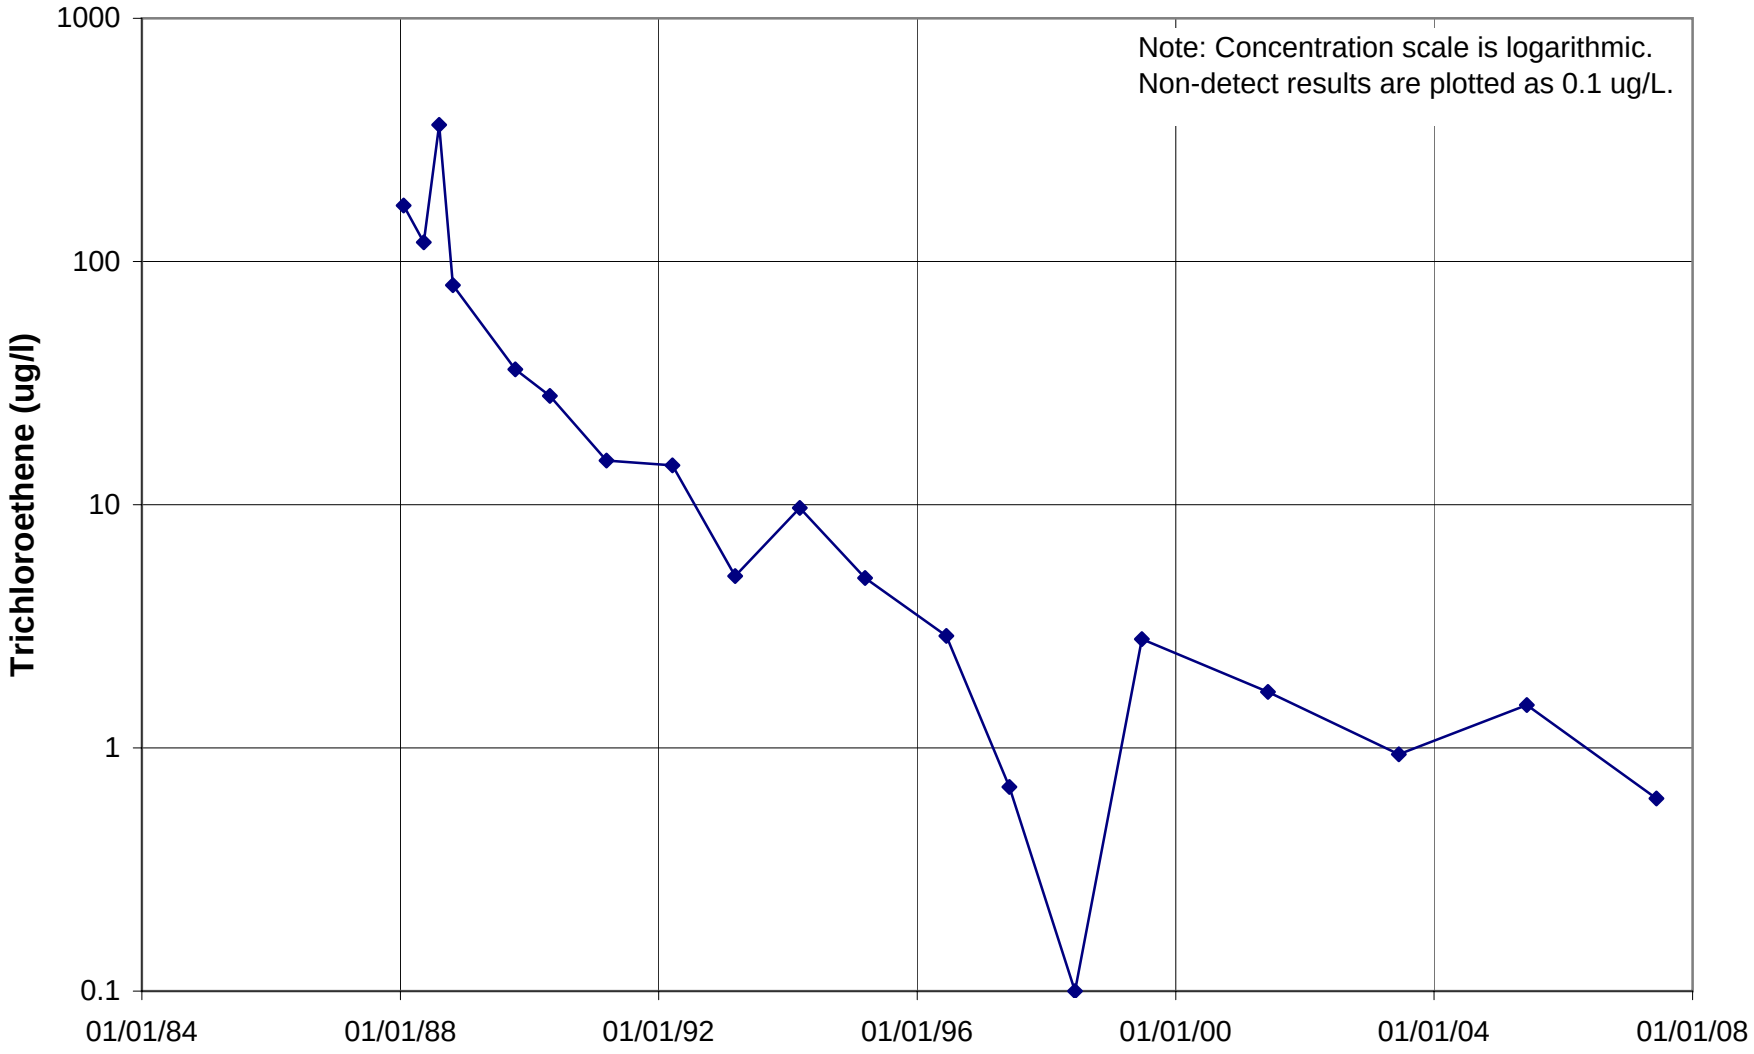

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U703

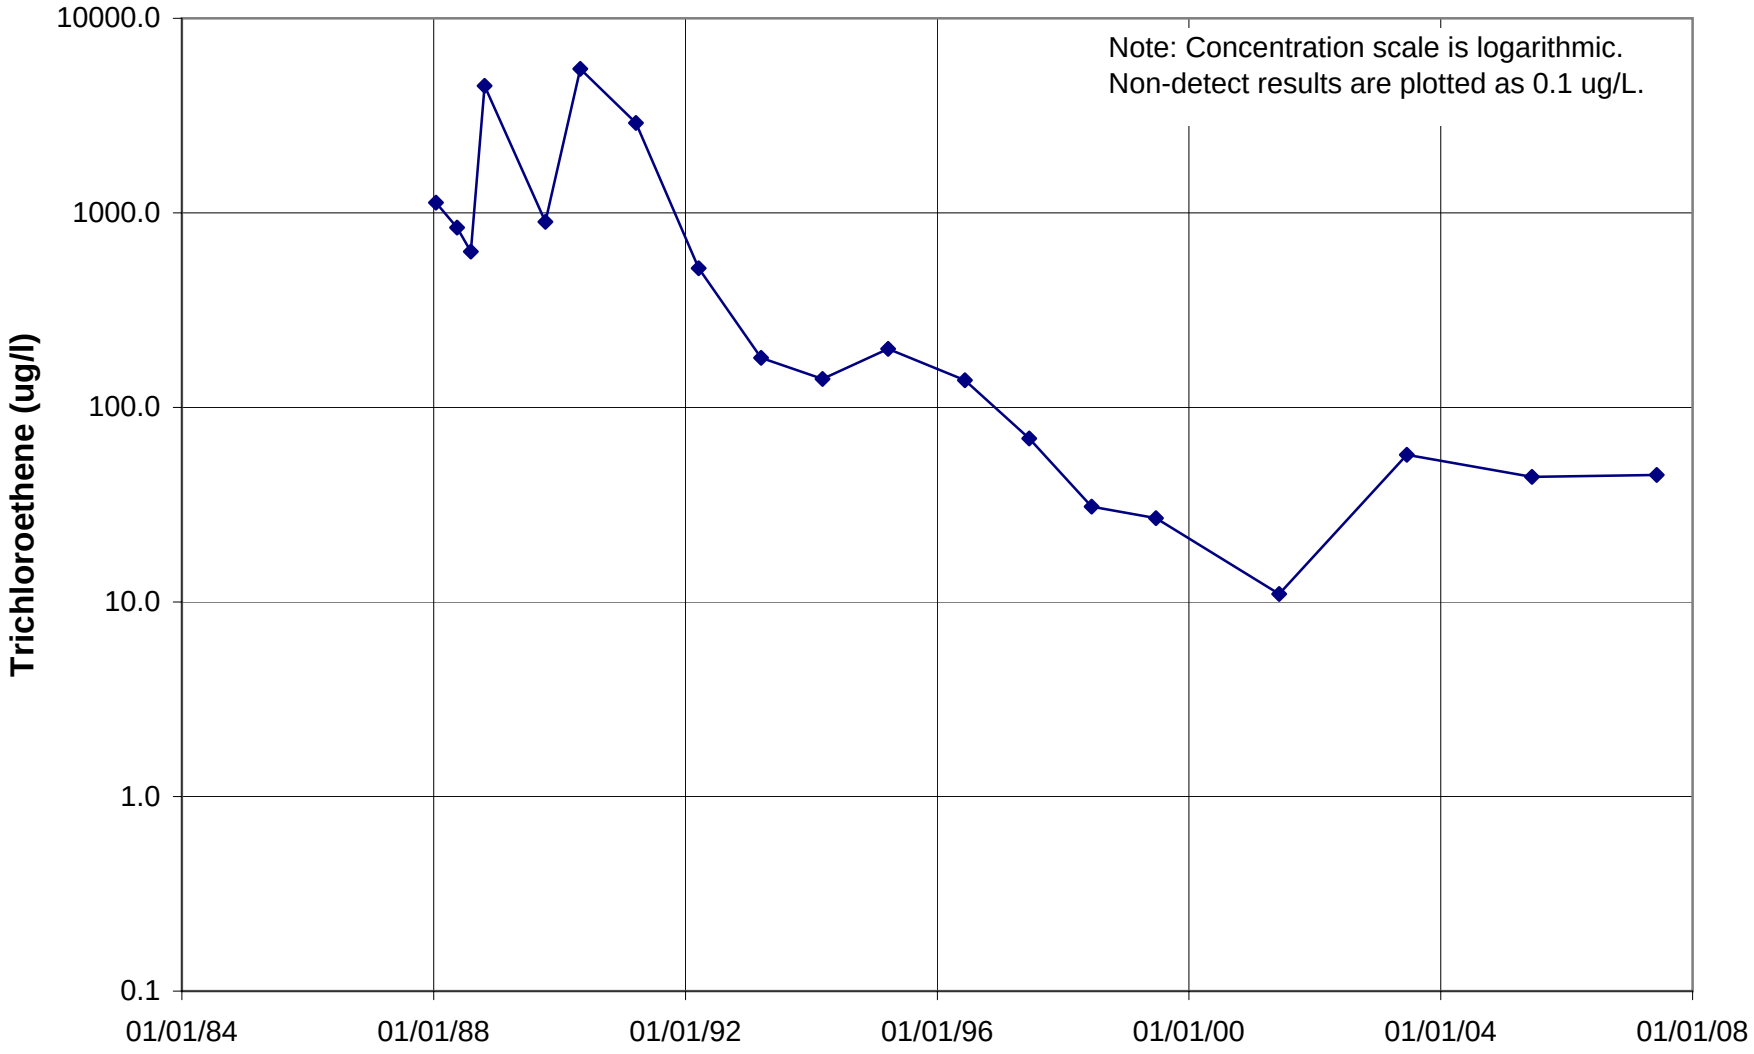

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U704

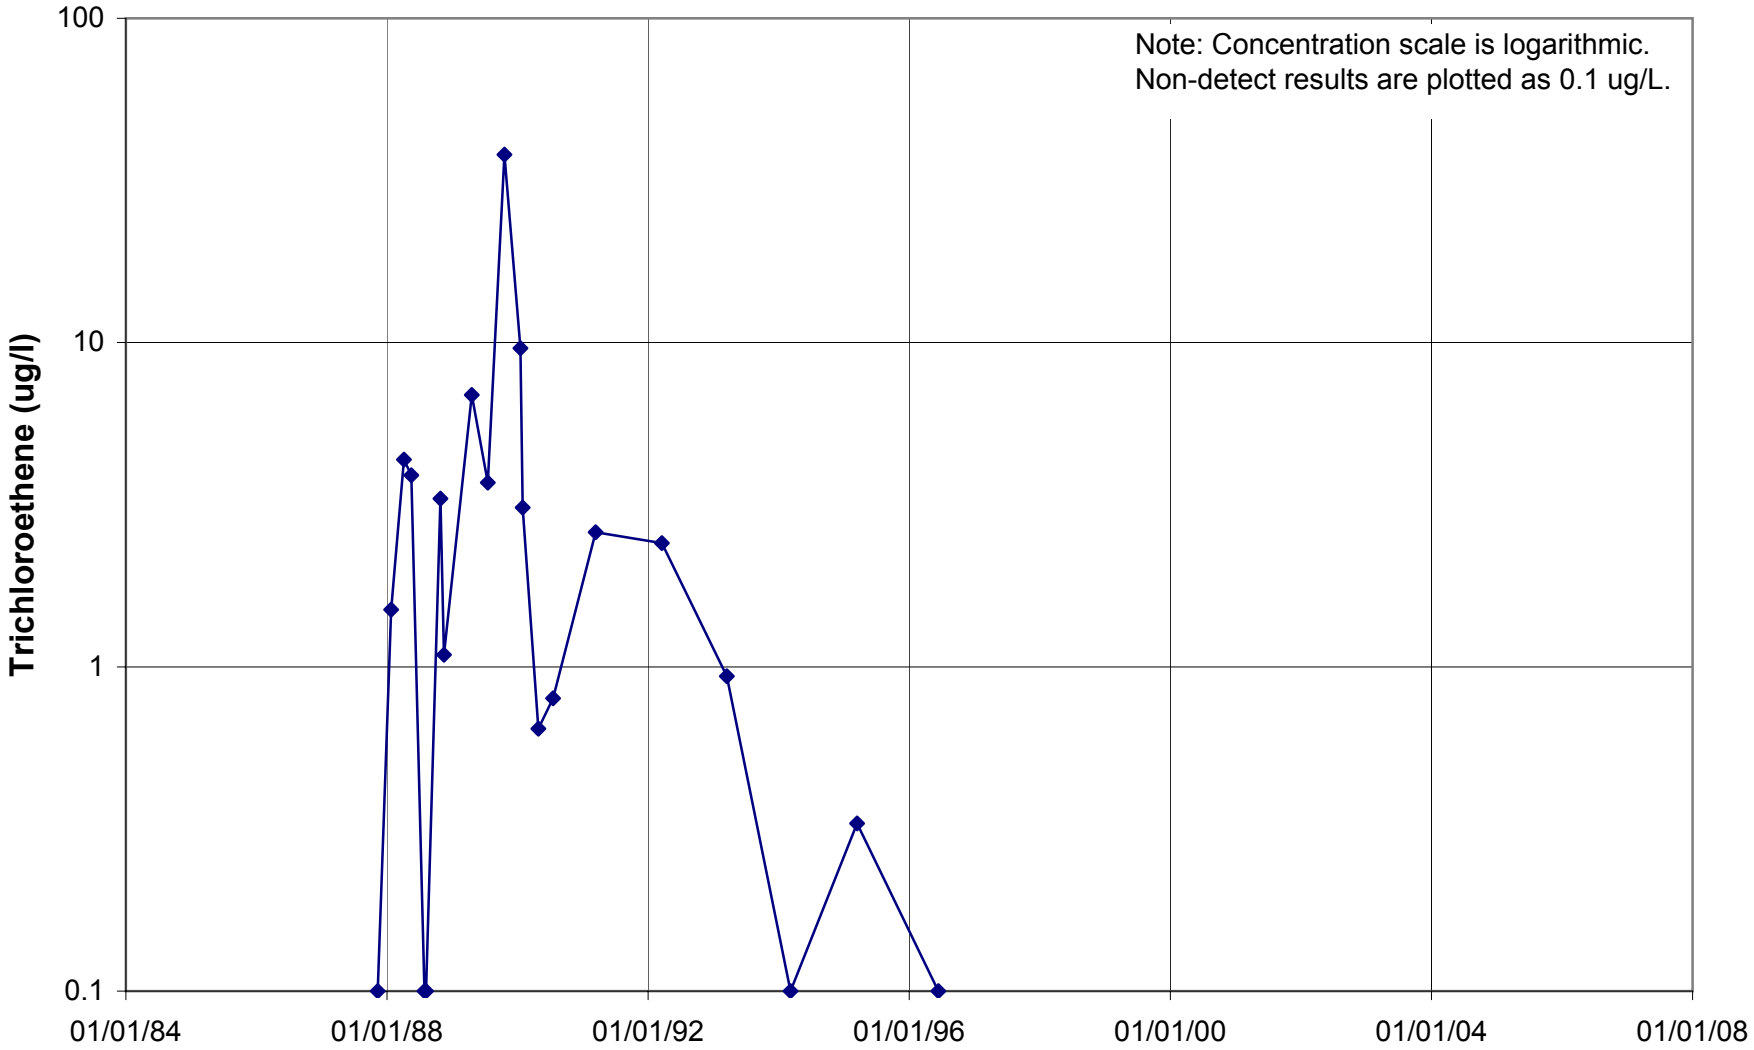

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U705

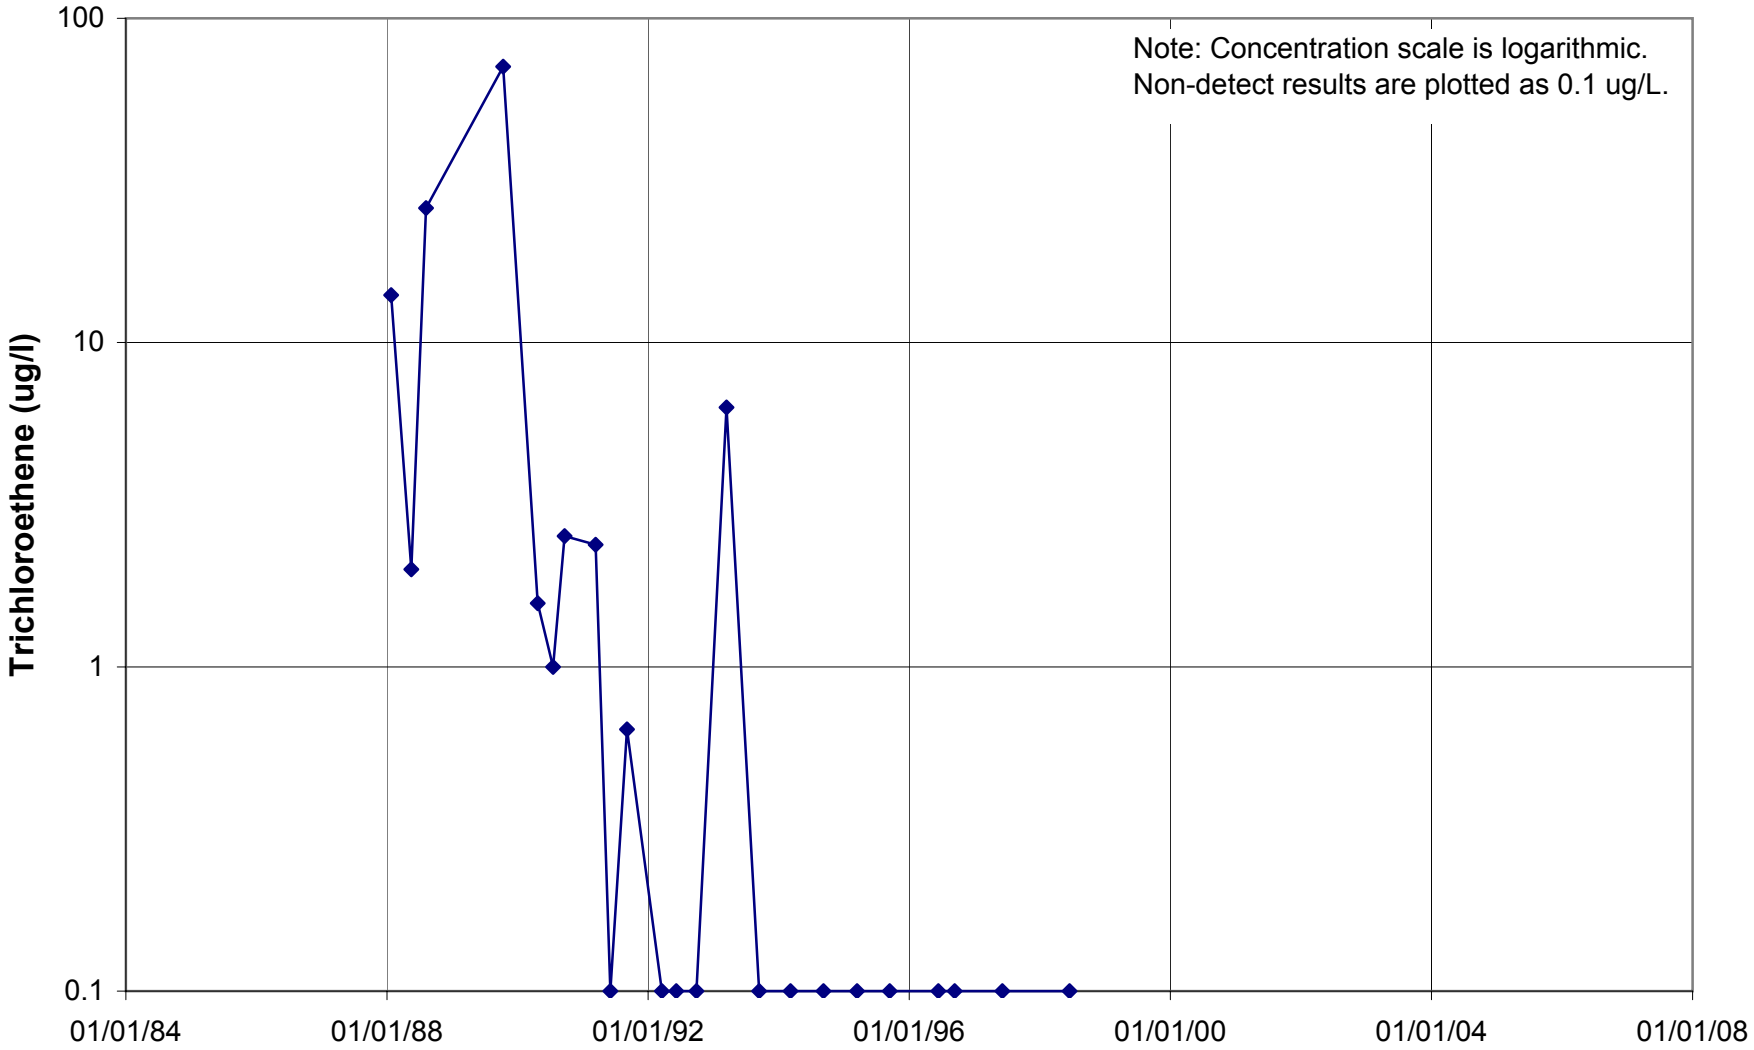

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U706

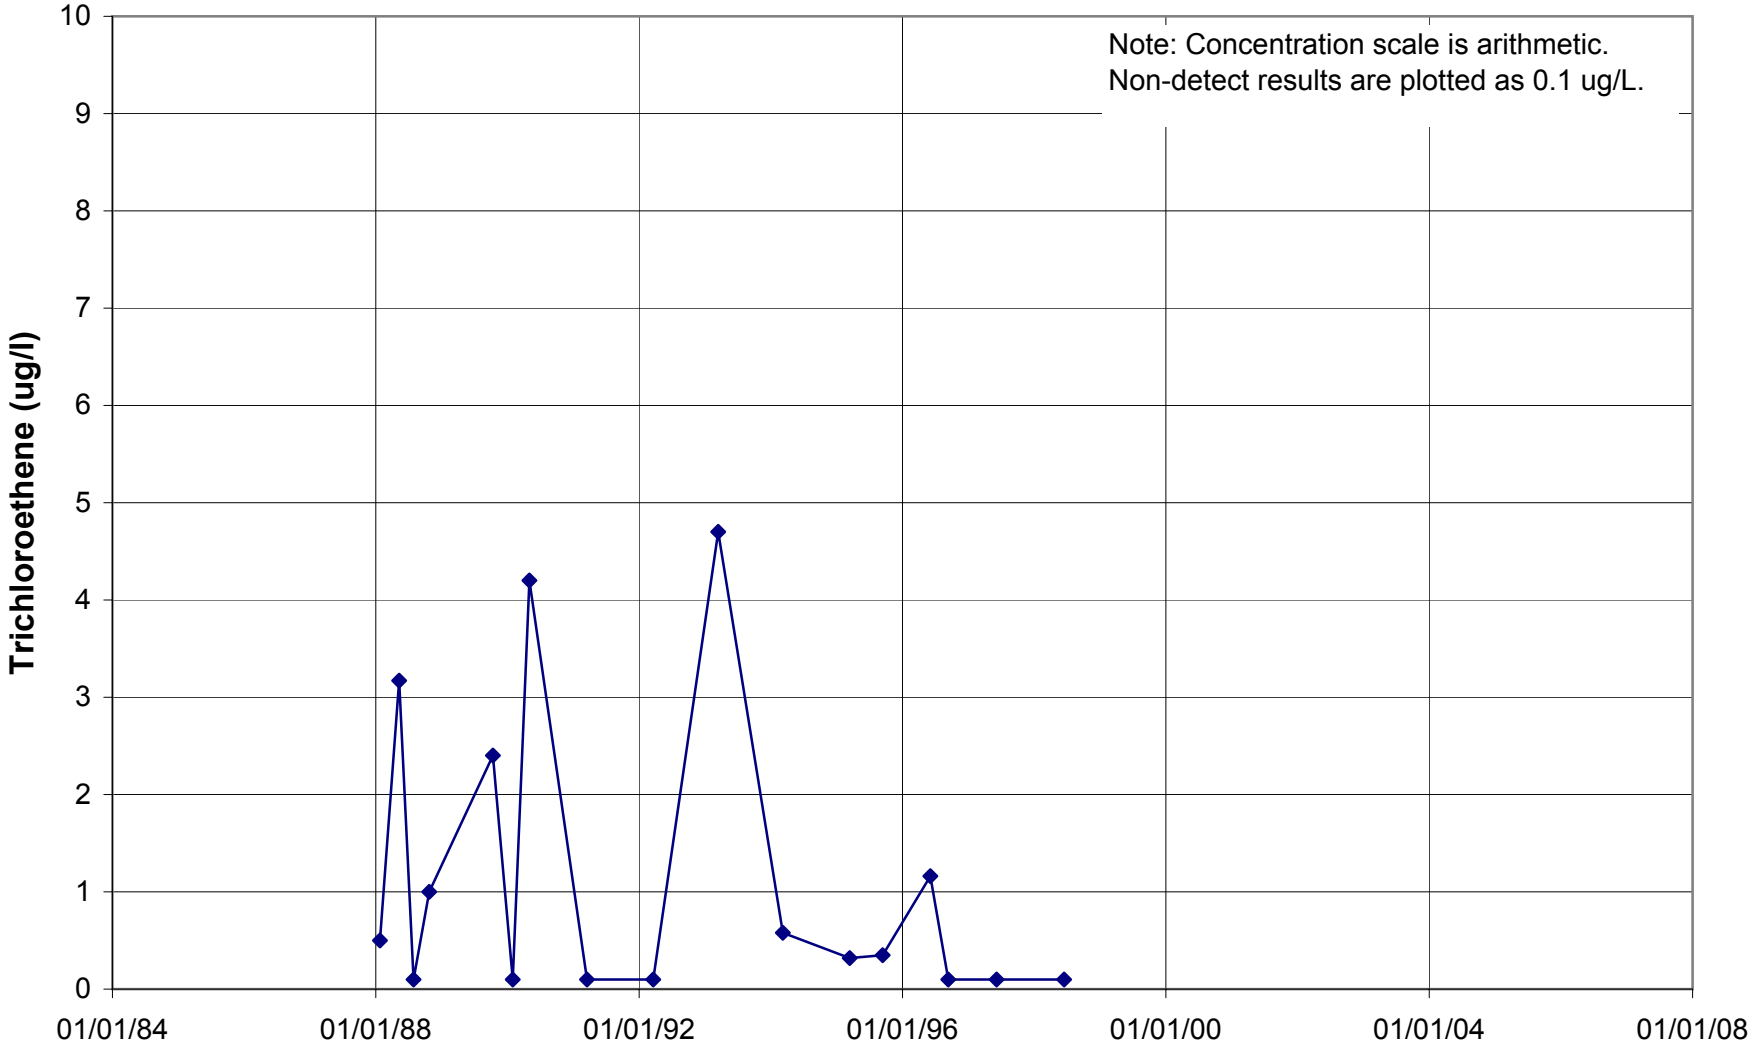

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U707

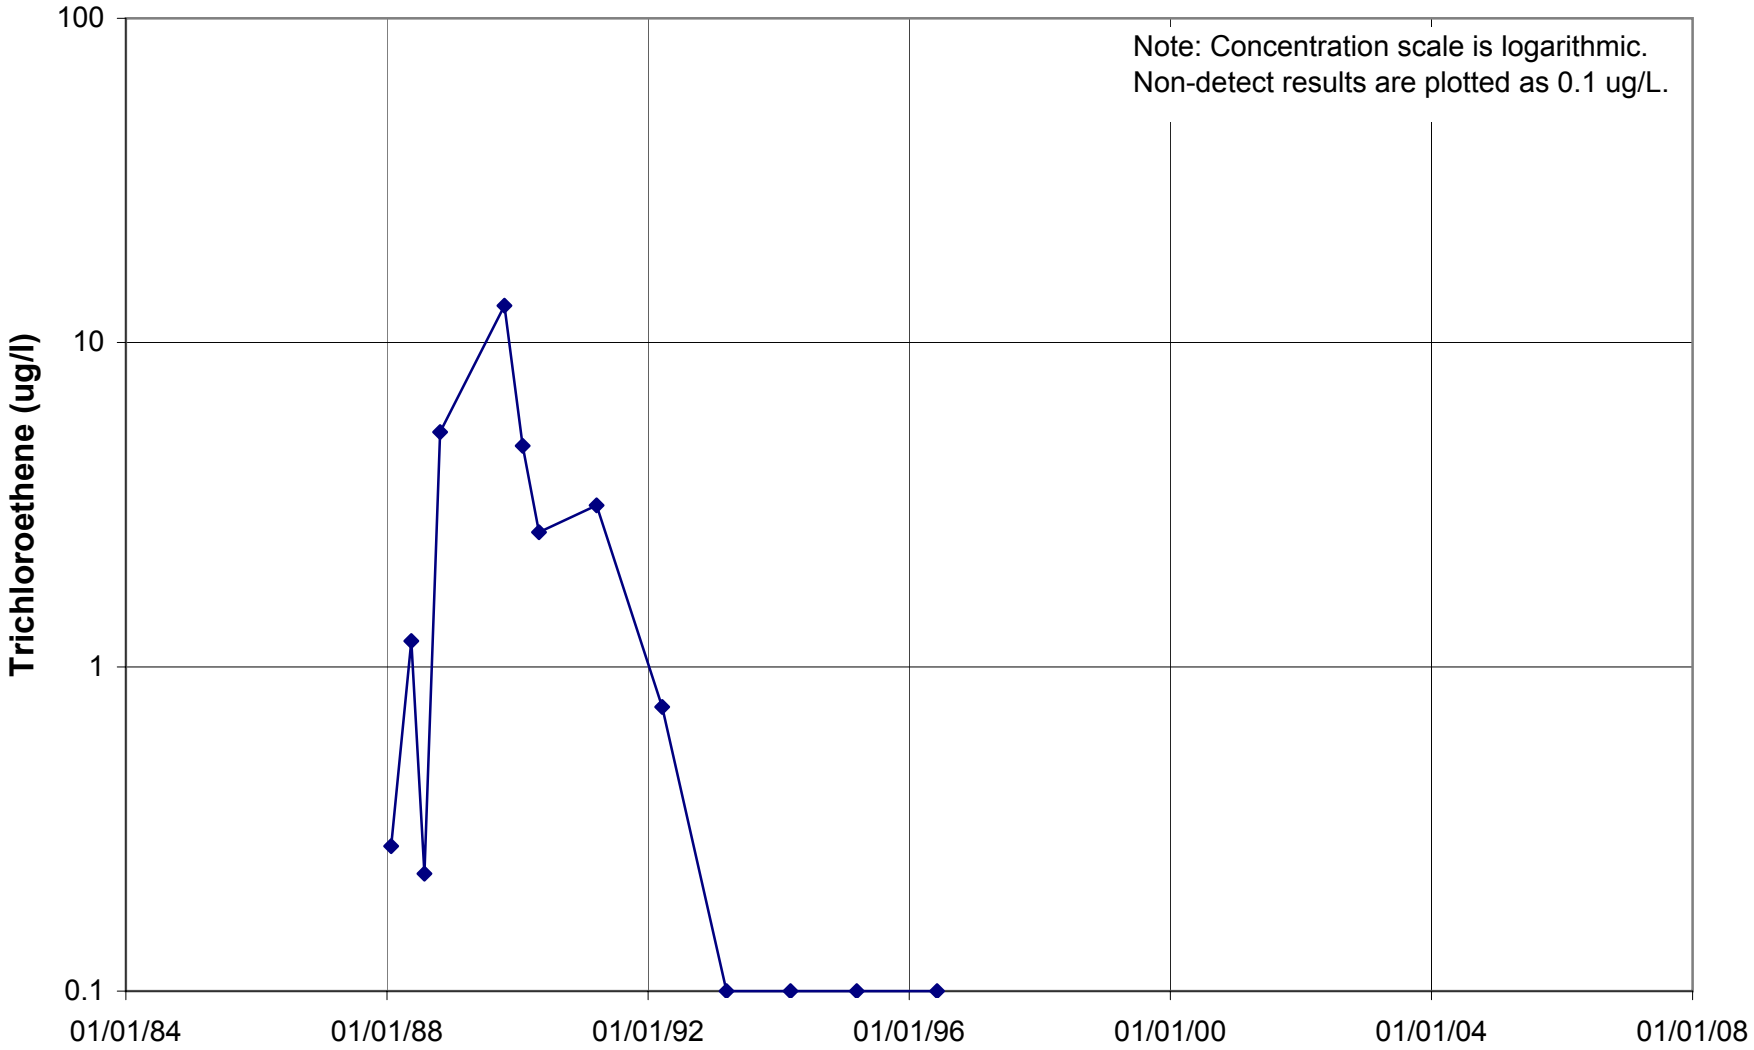

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

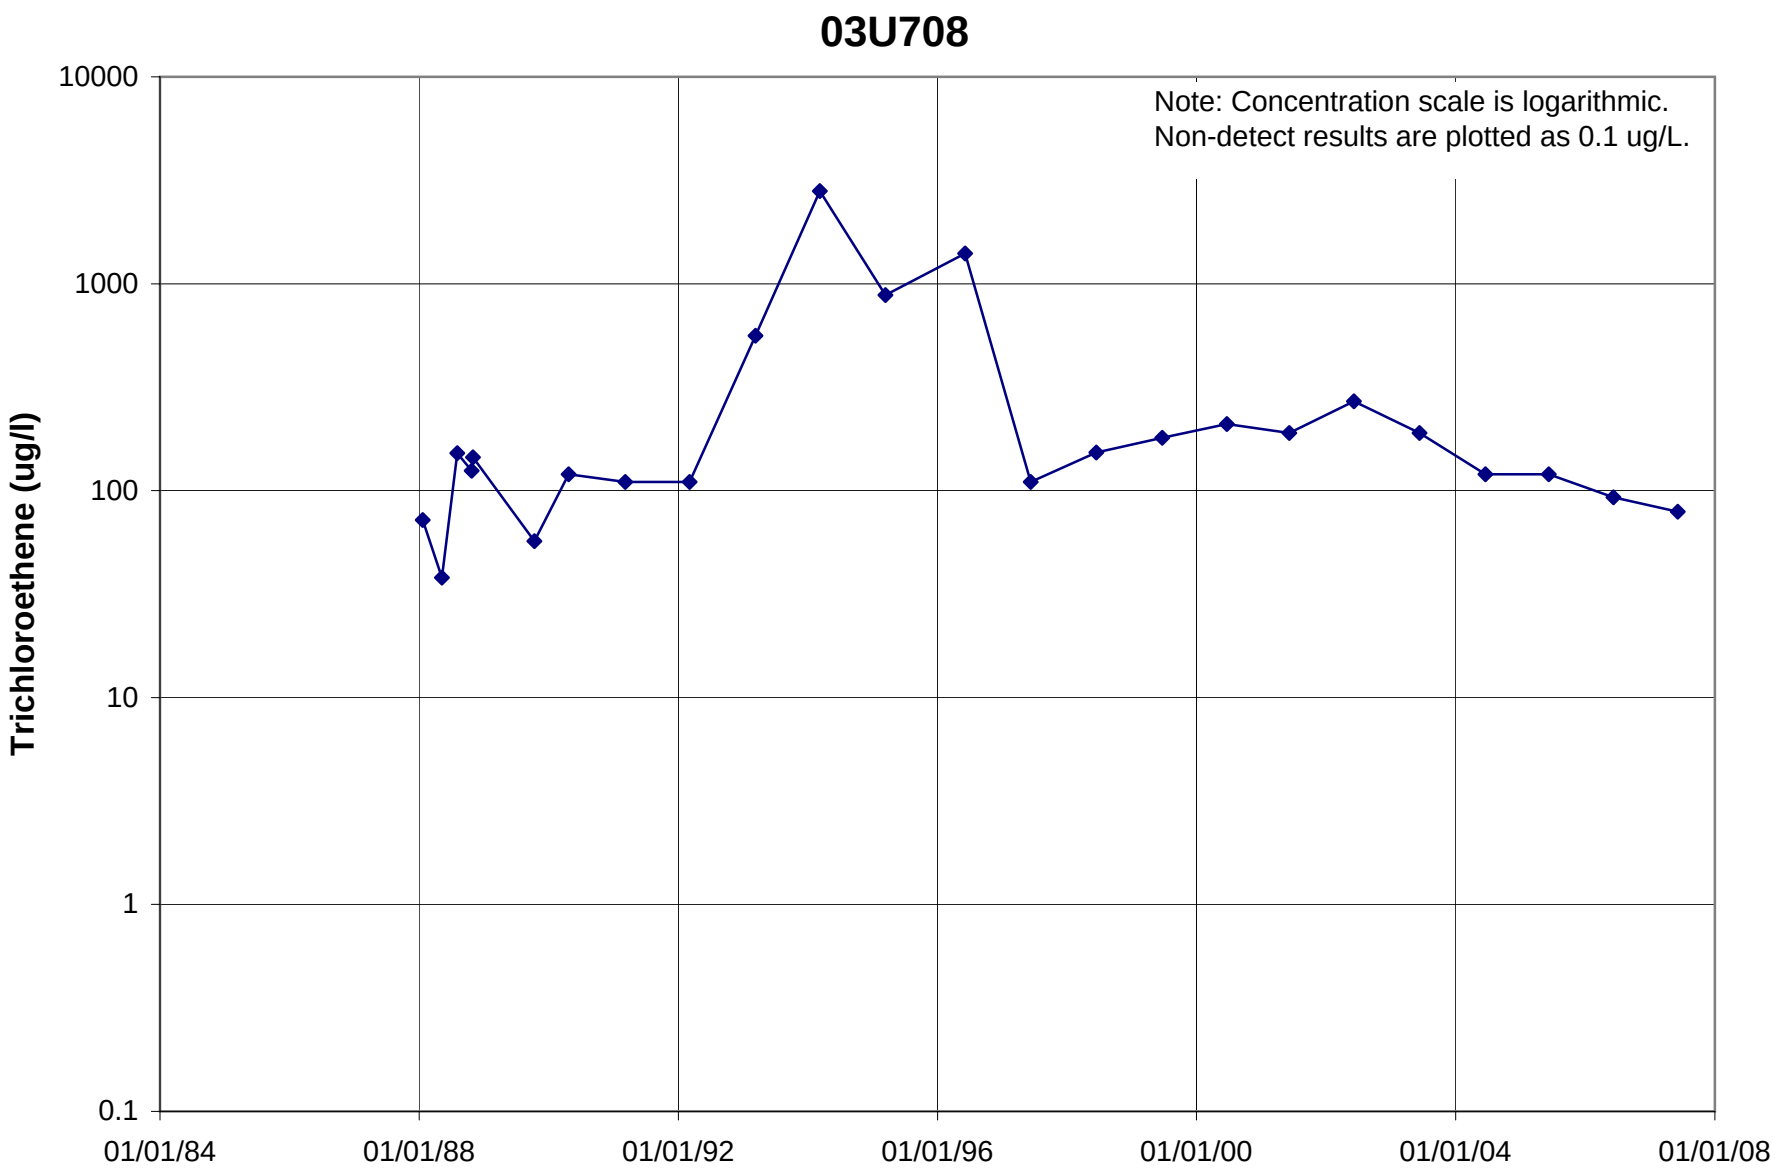

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U709

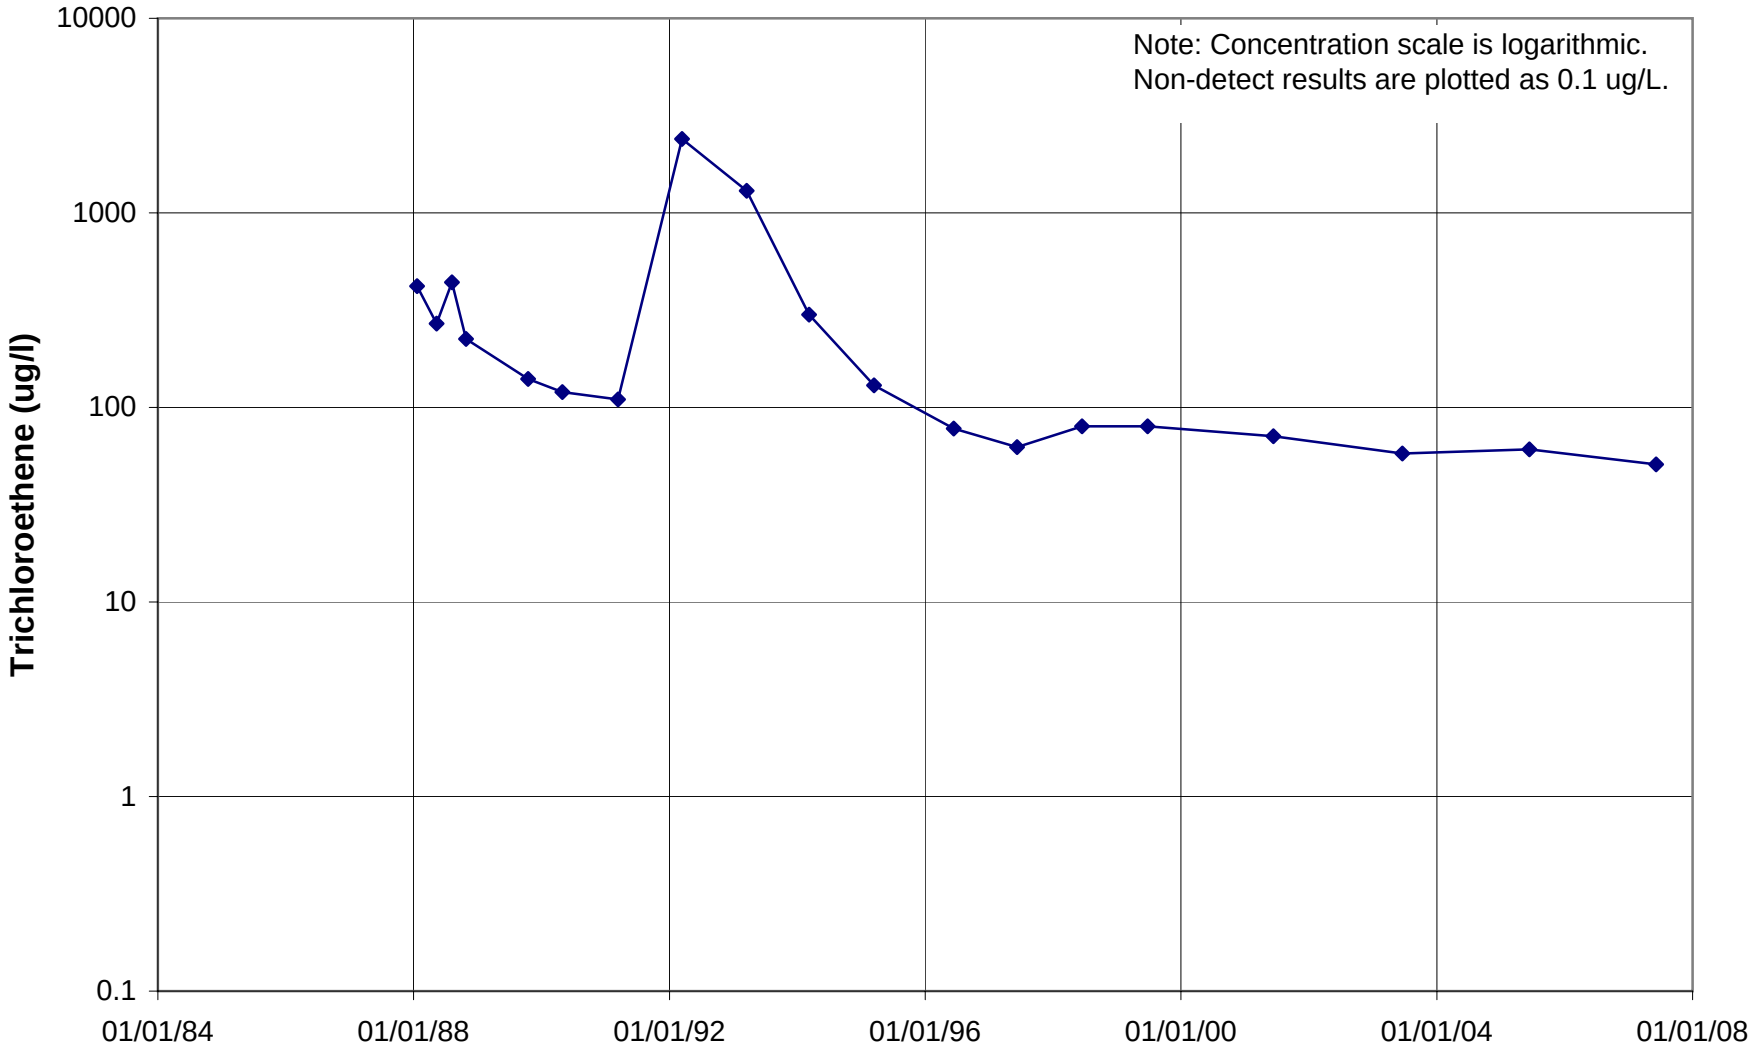

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U710

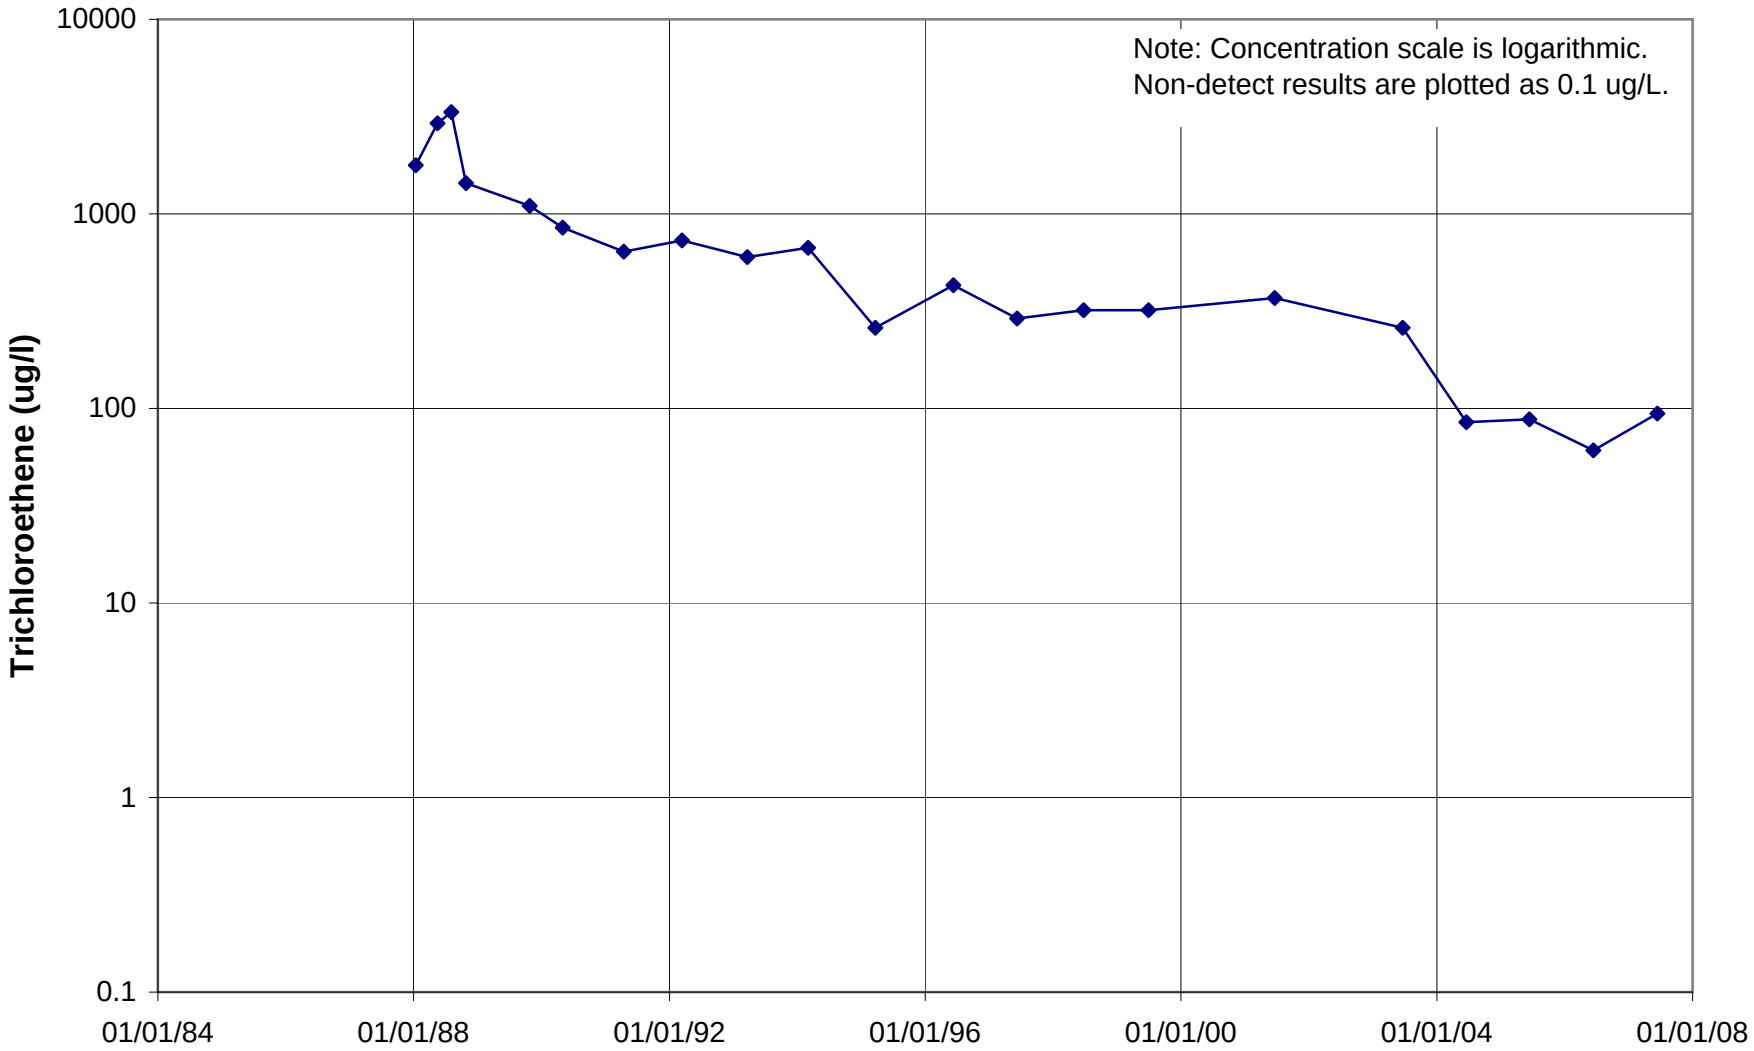

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U711

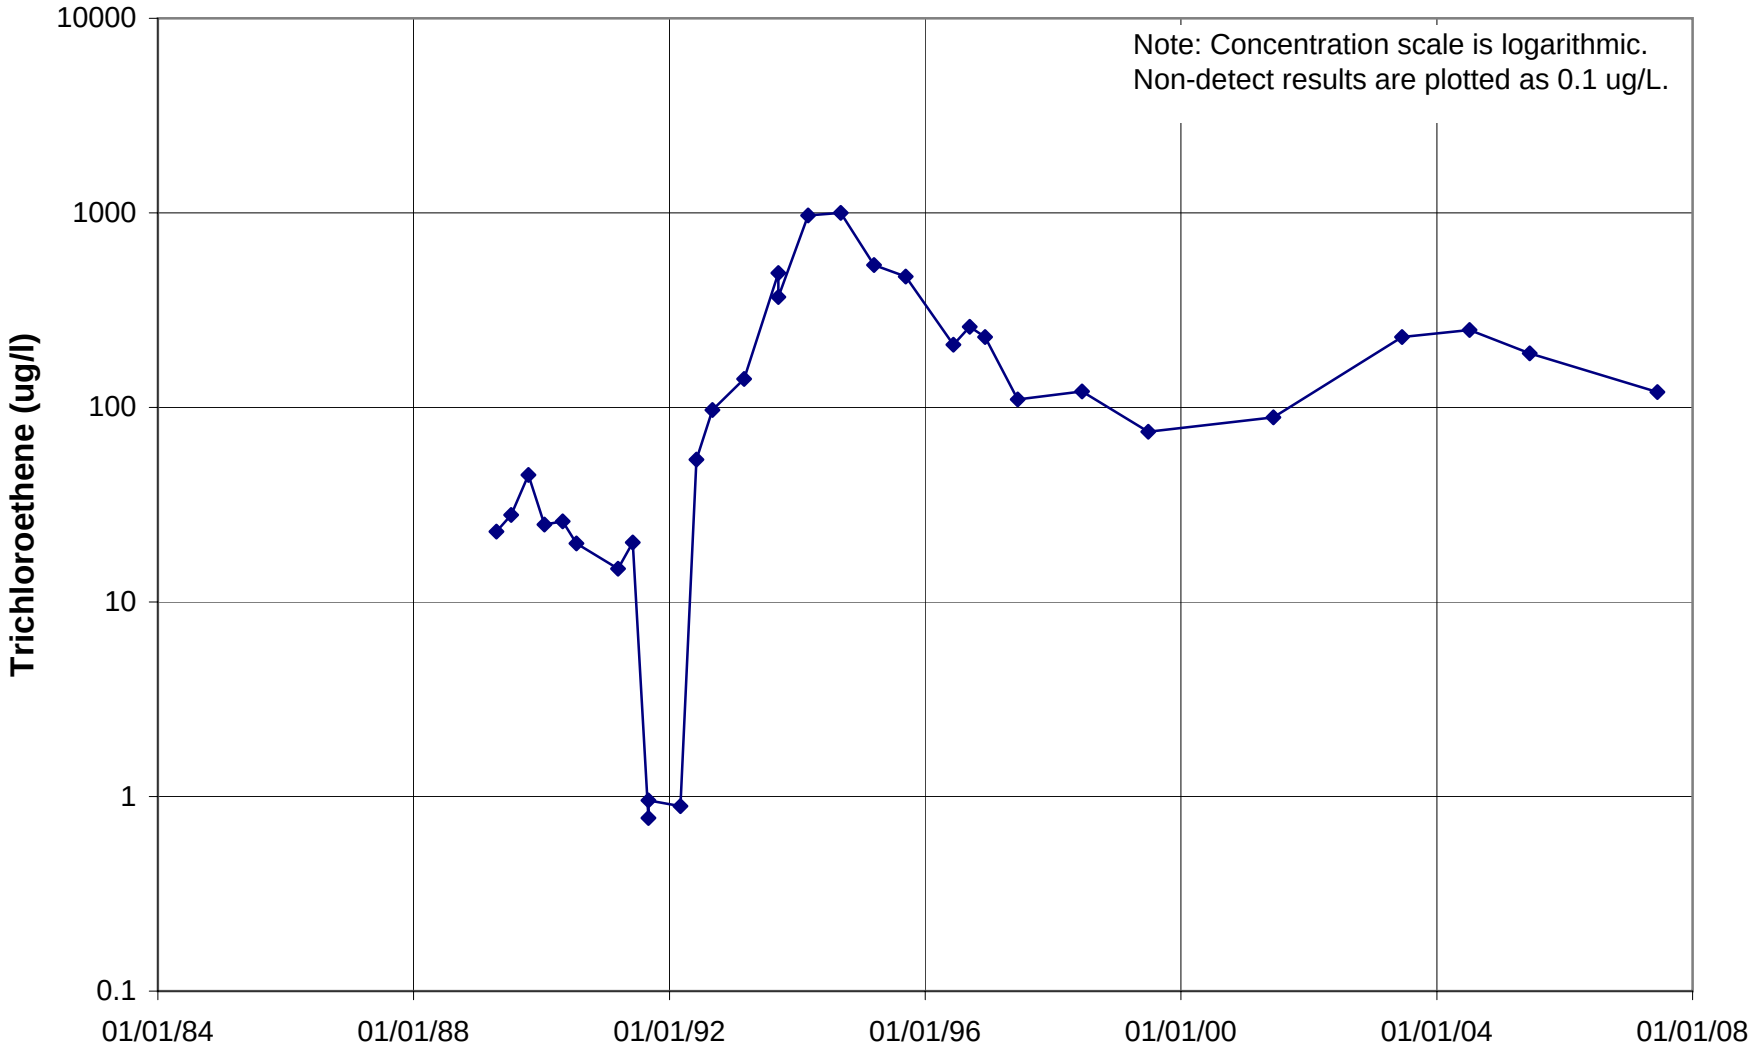

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U715

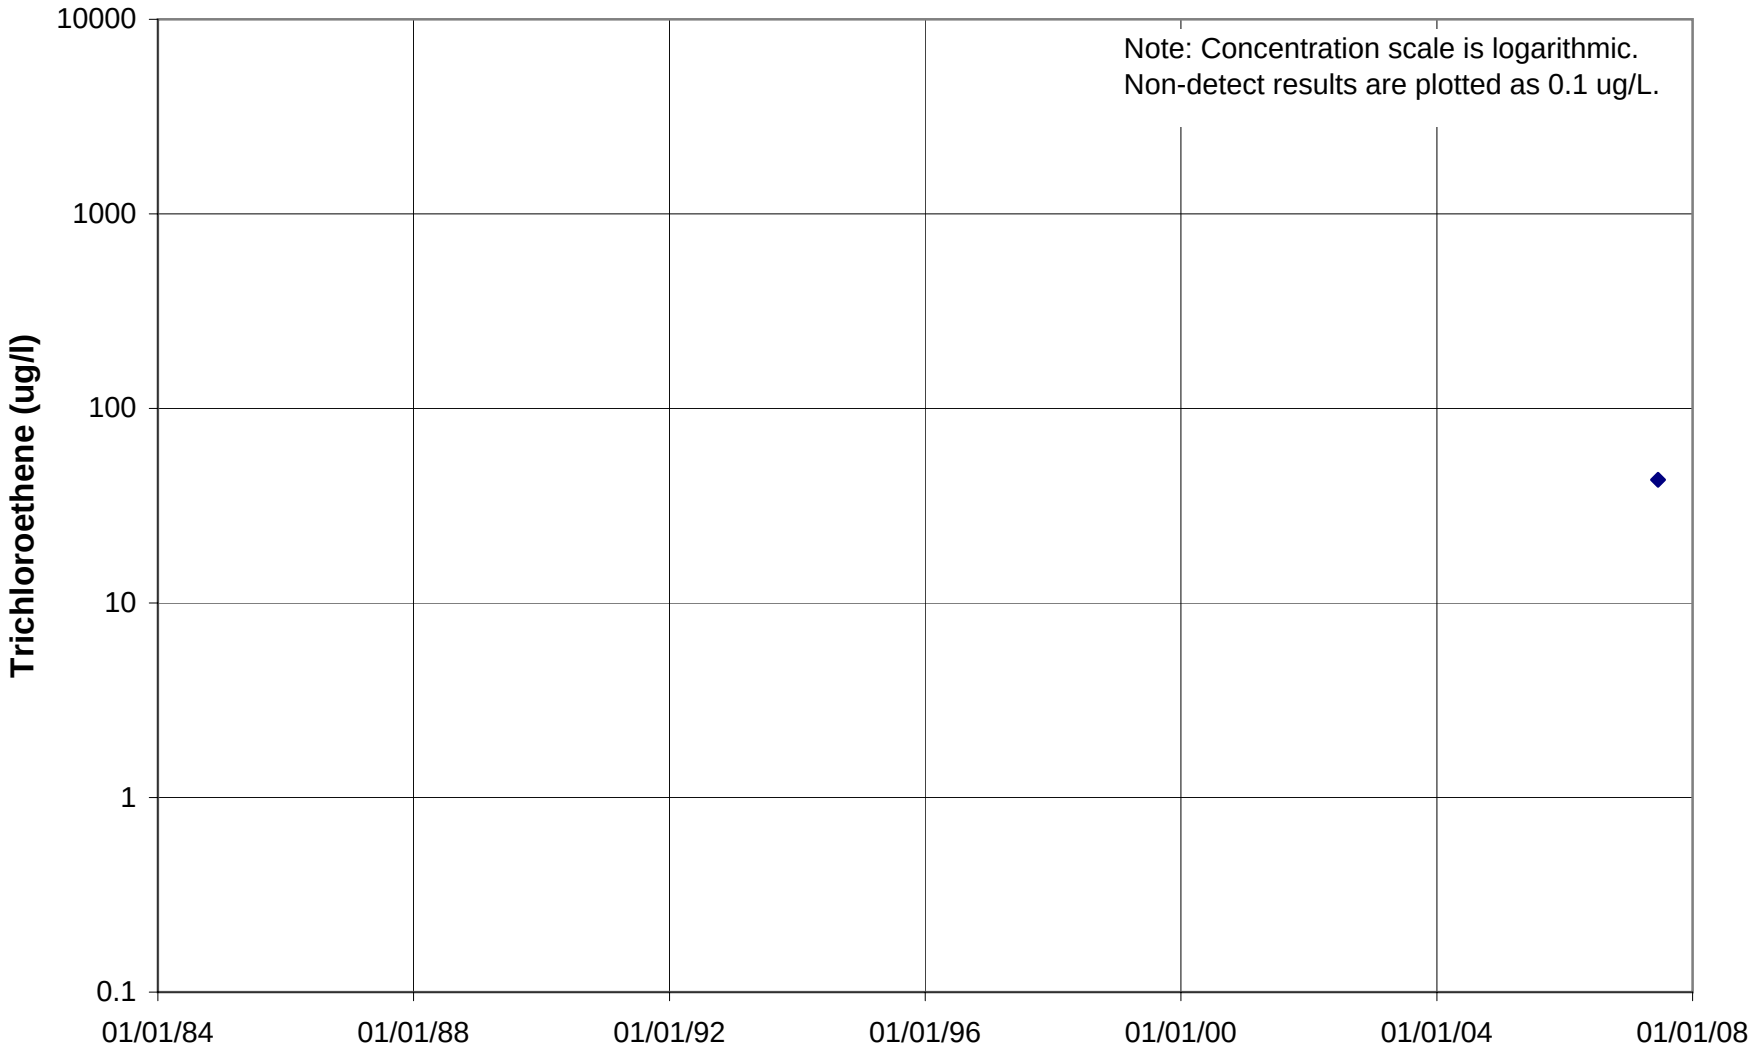

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U801

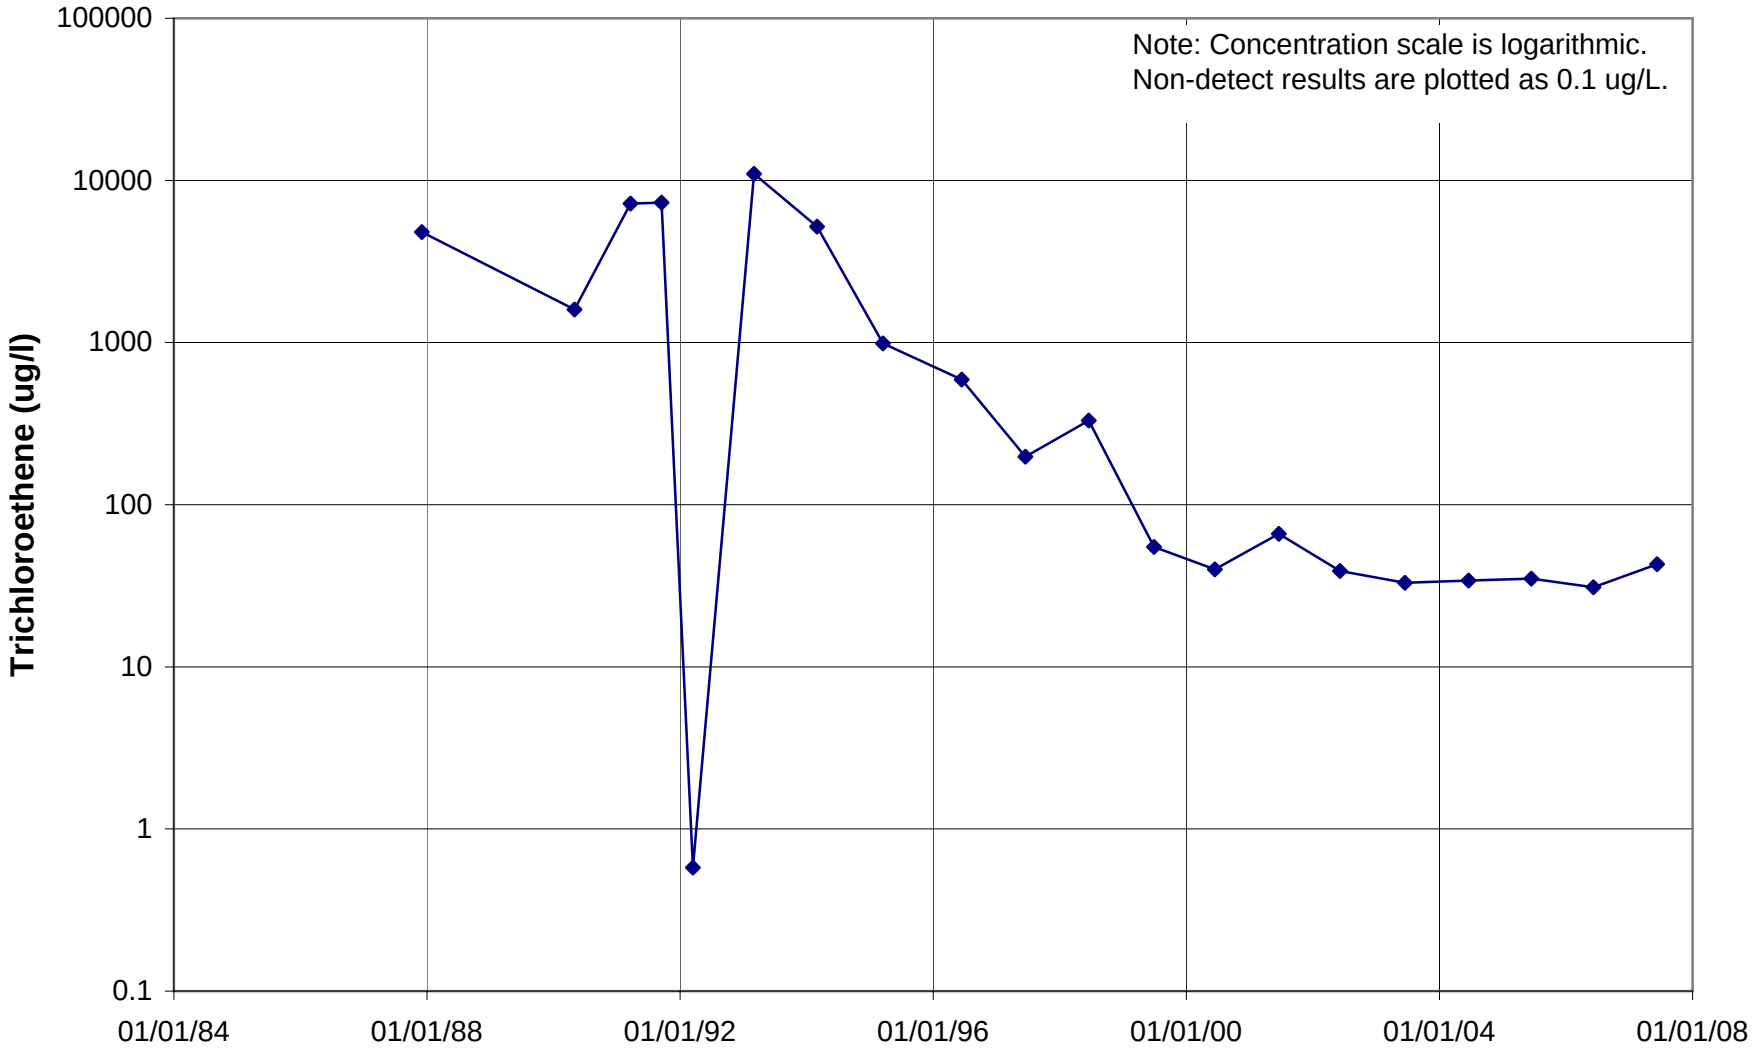

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U803

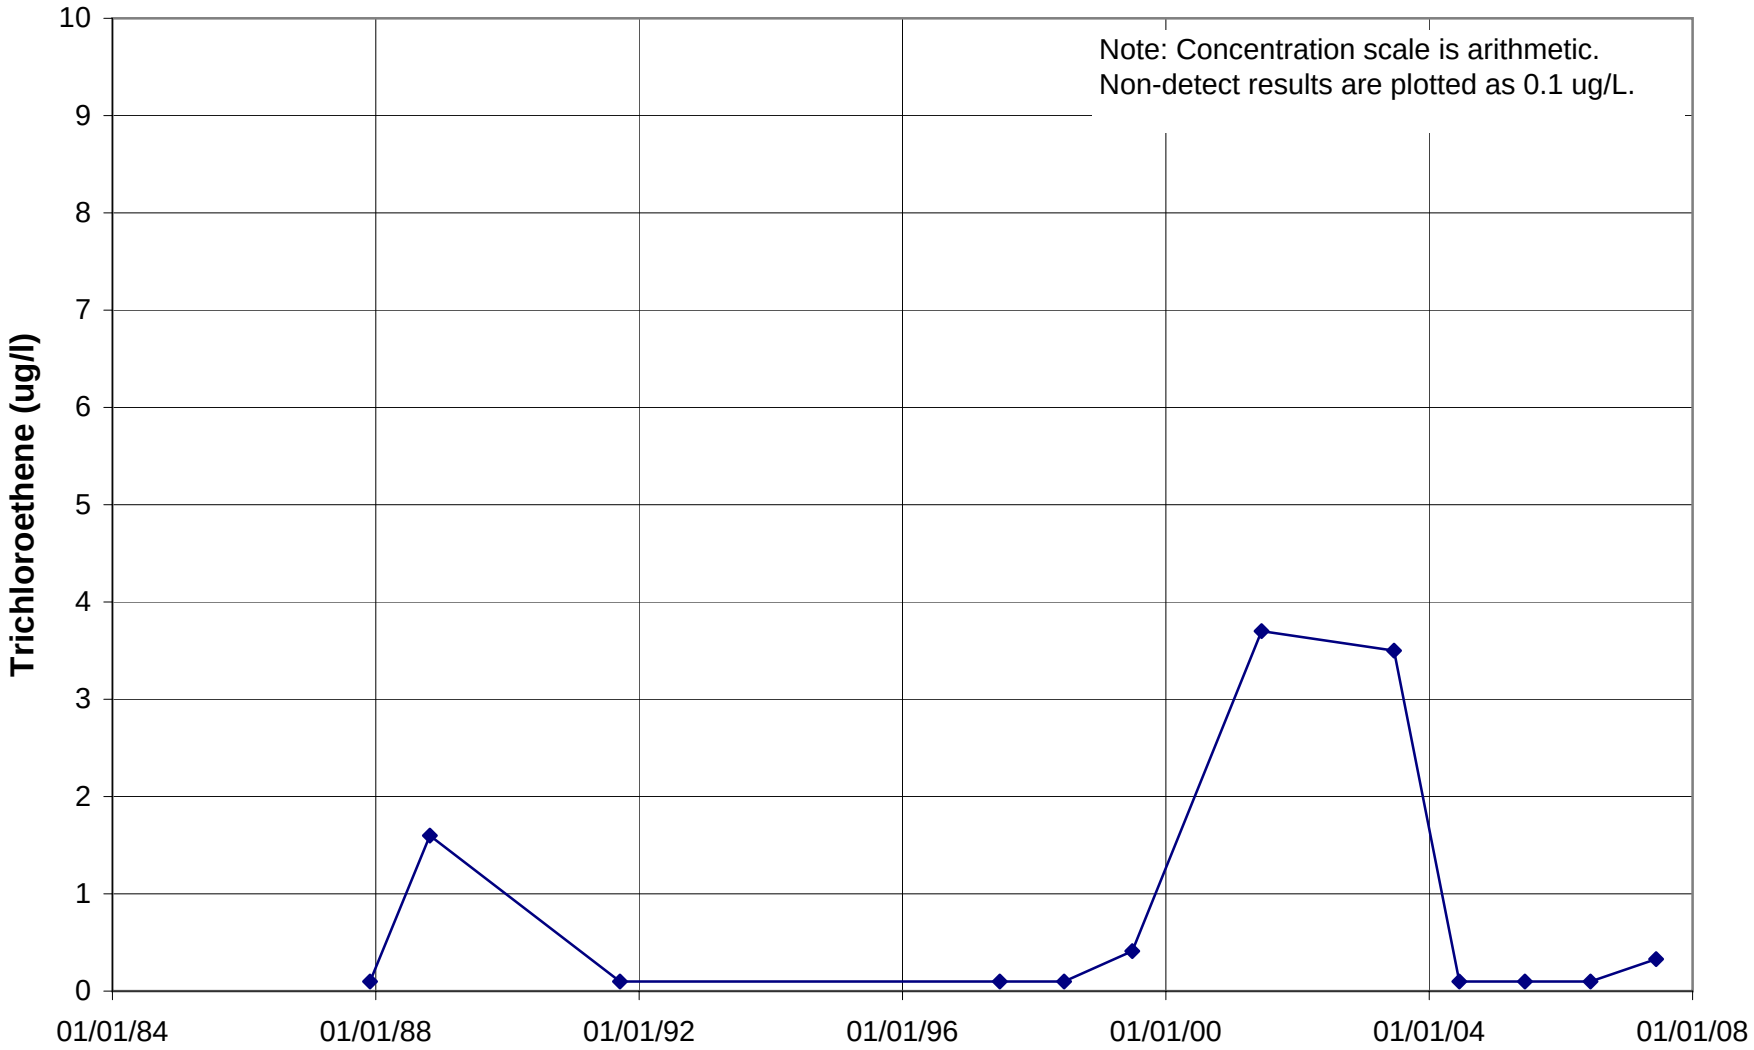

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U804

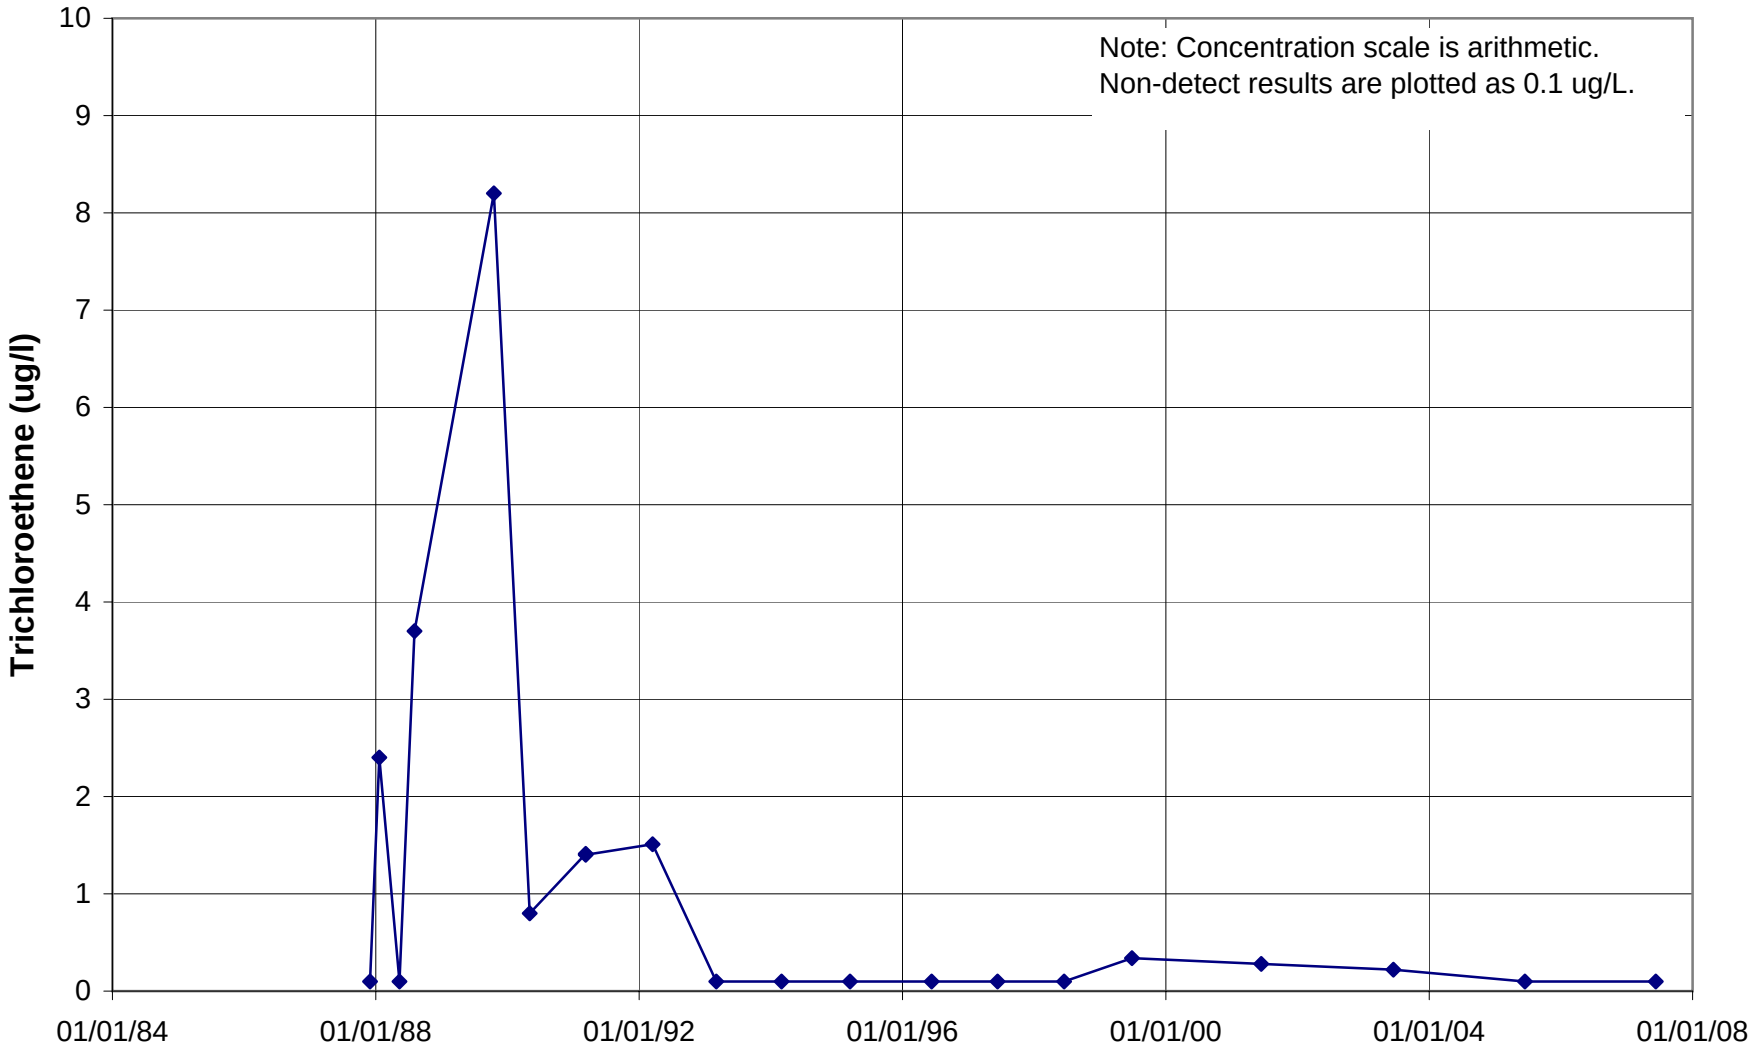

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U805

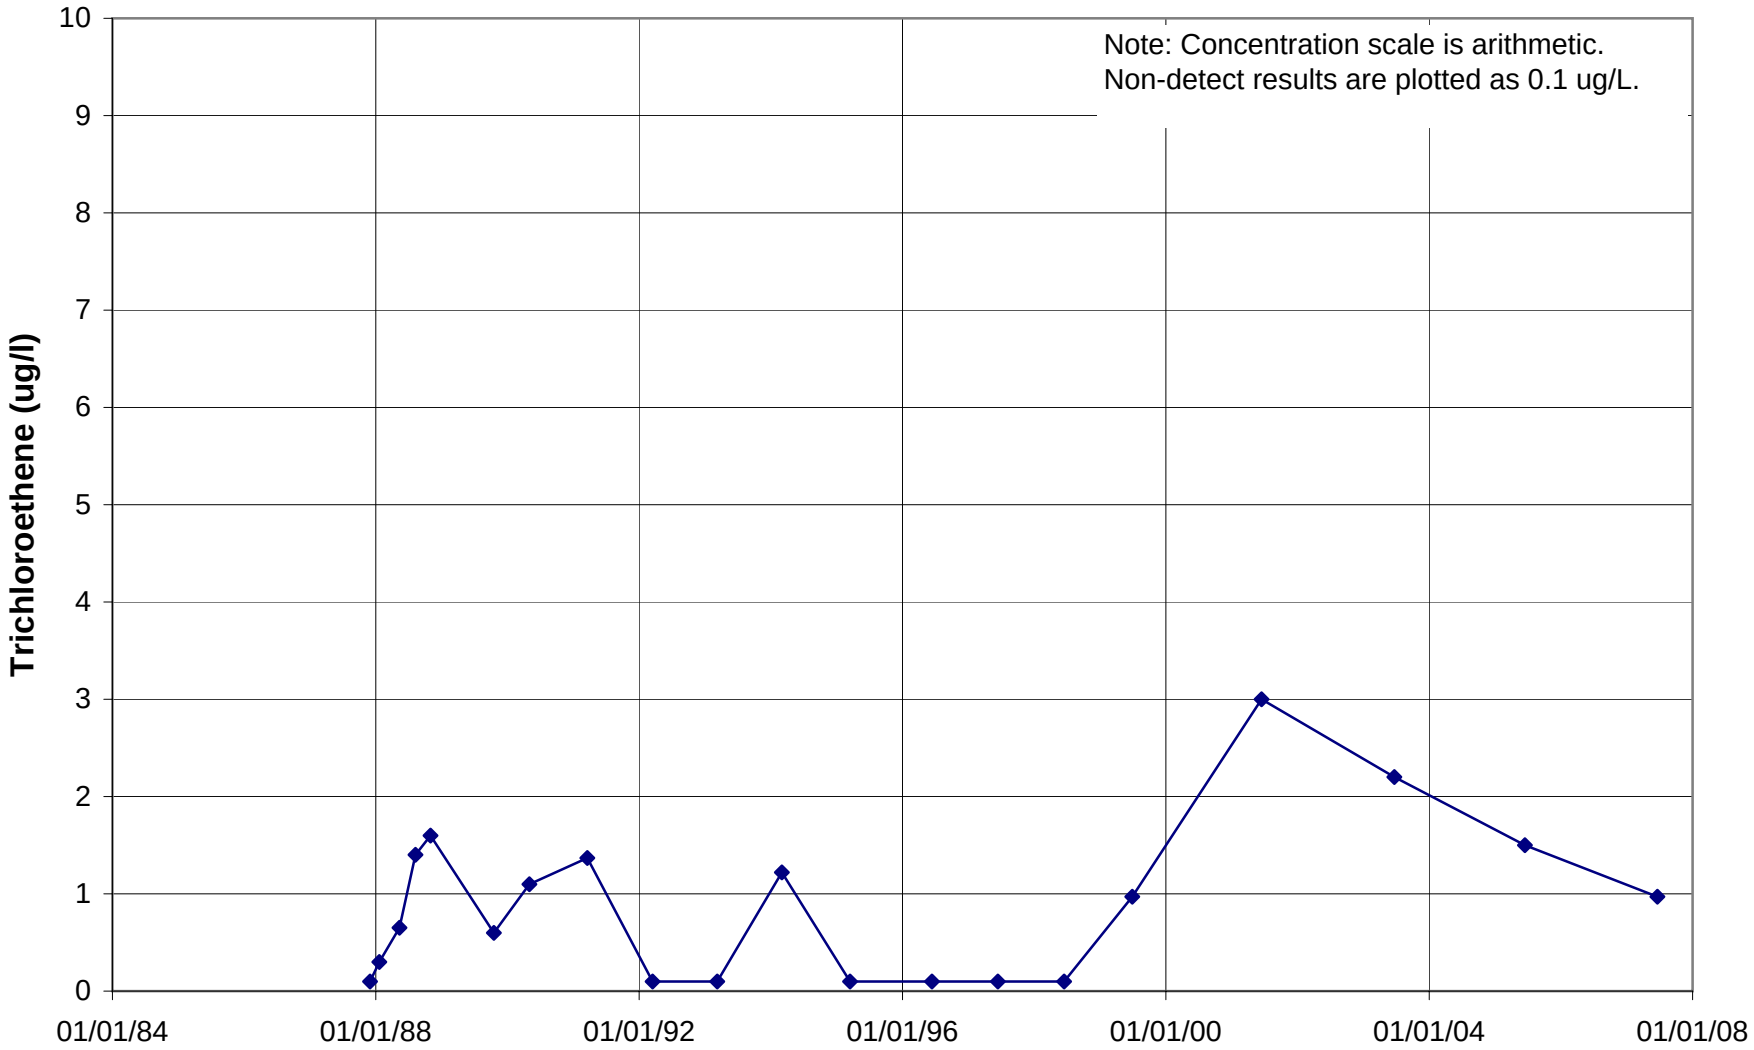

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U806

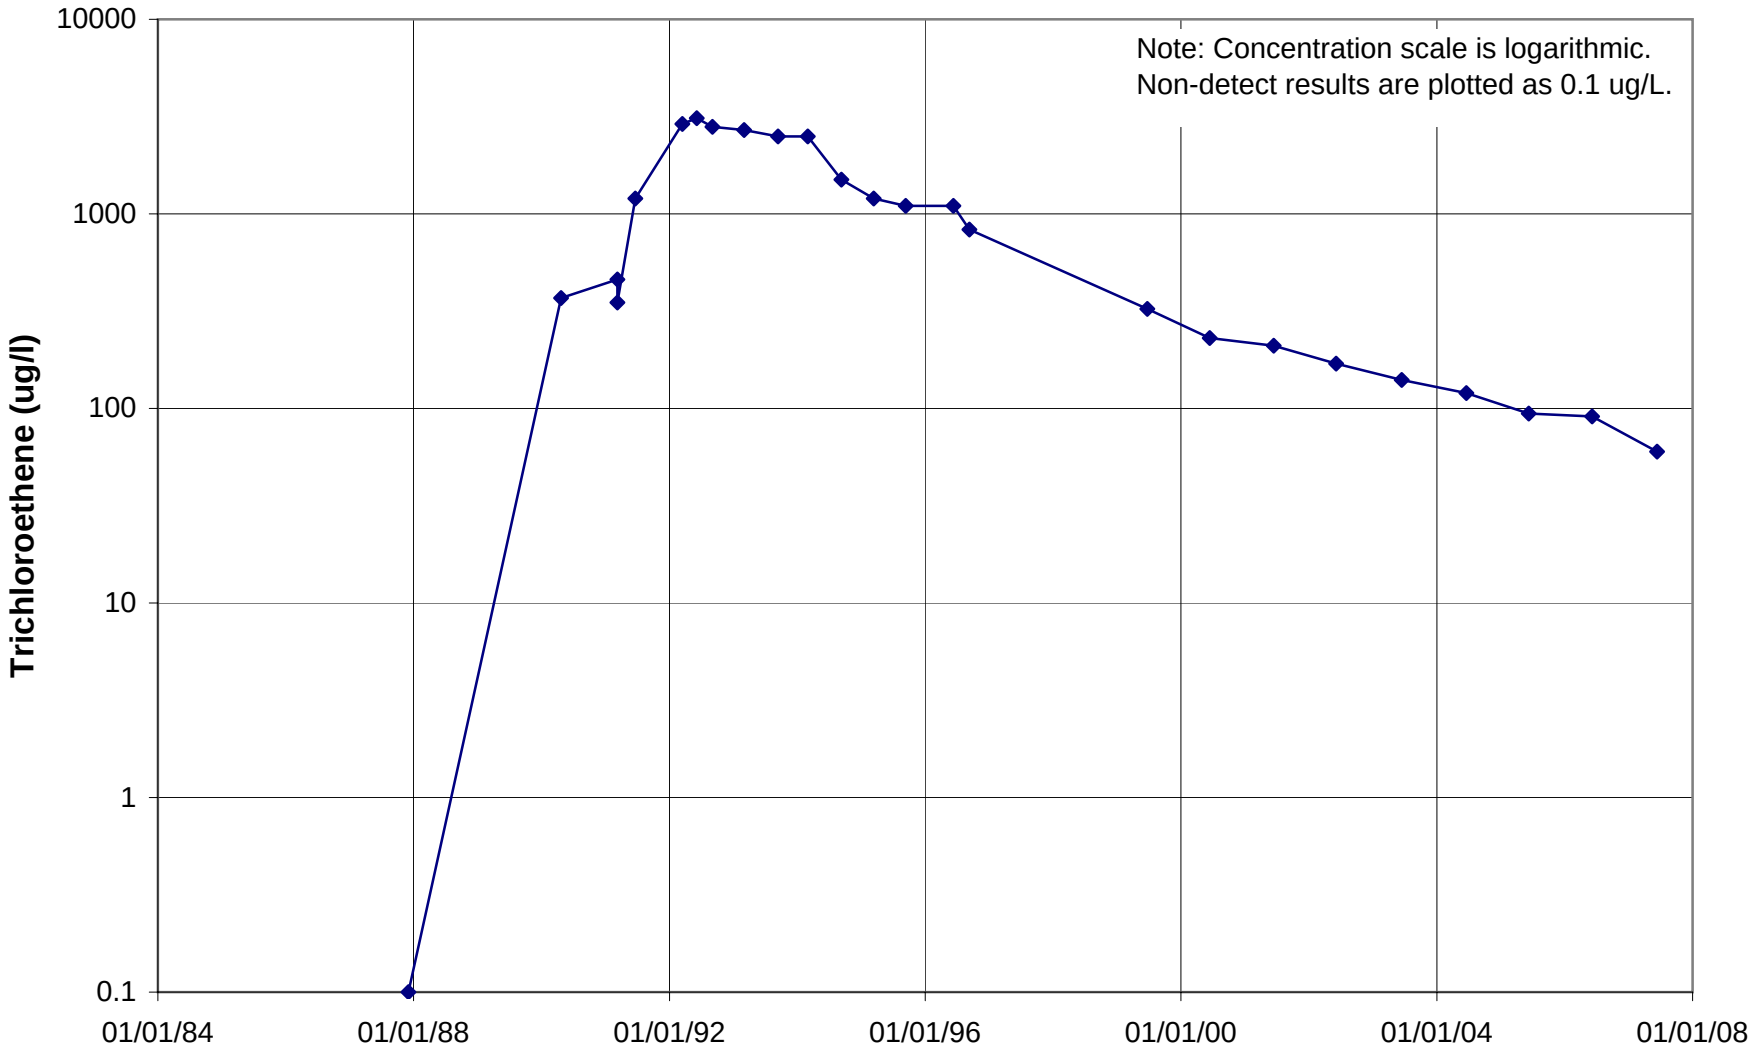

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U811

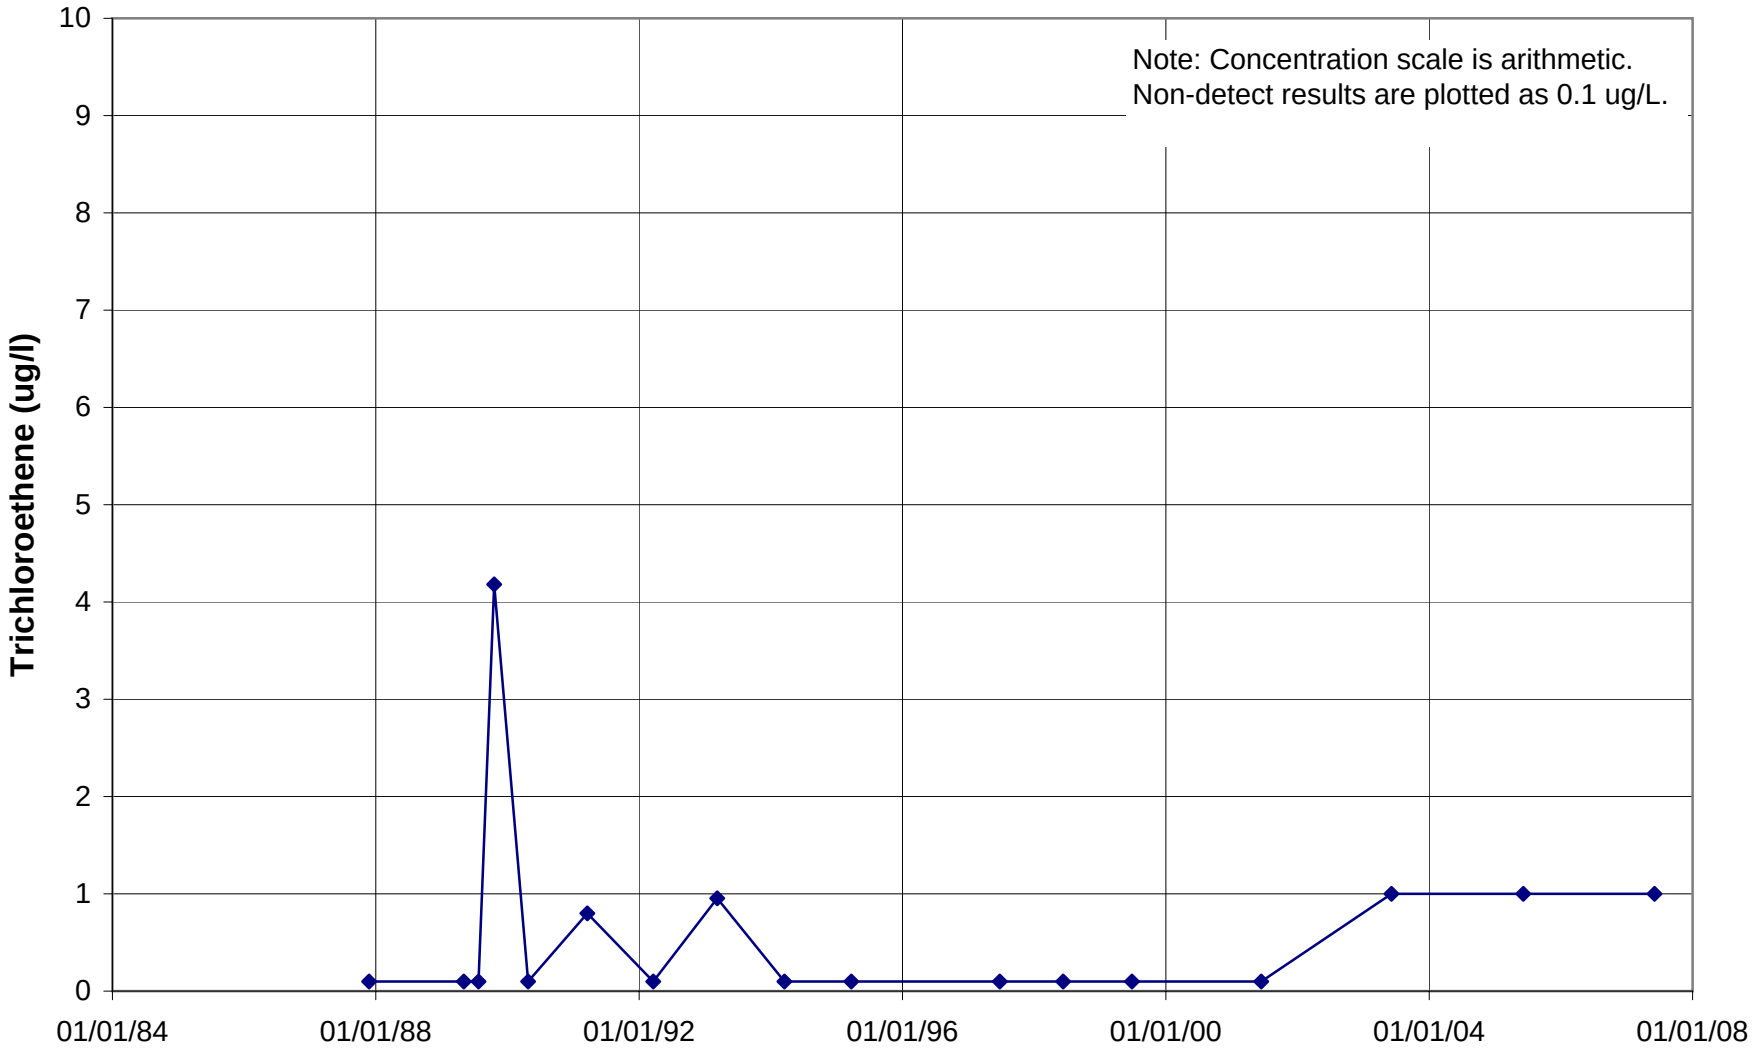

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U821

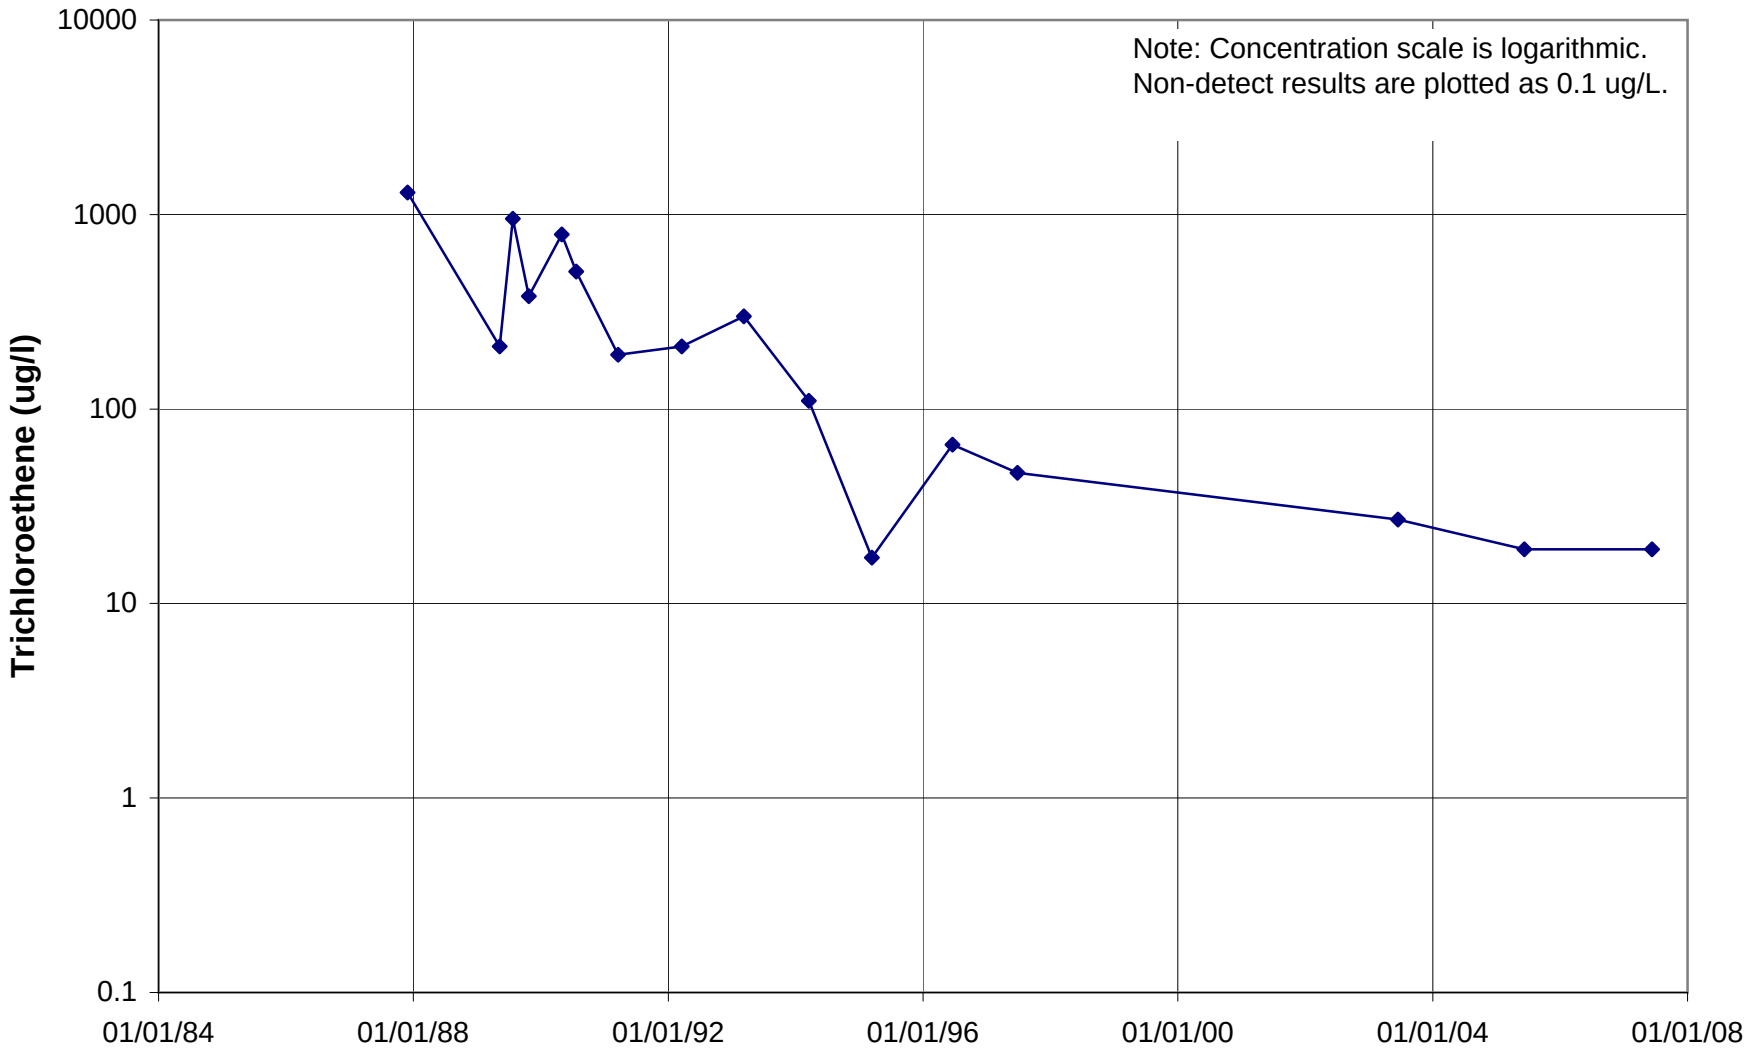

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U822

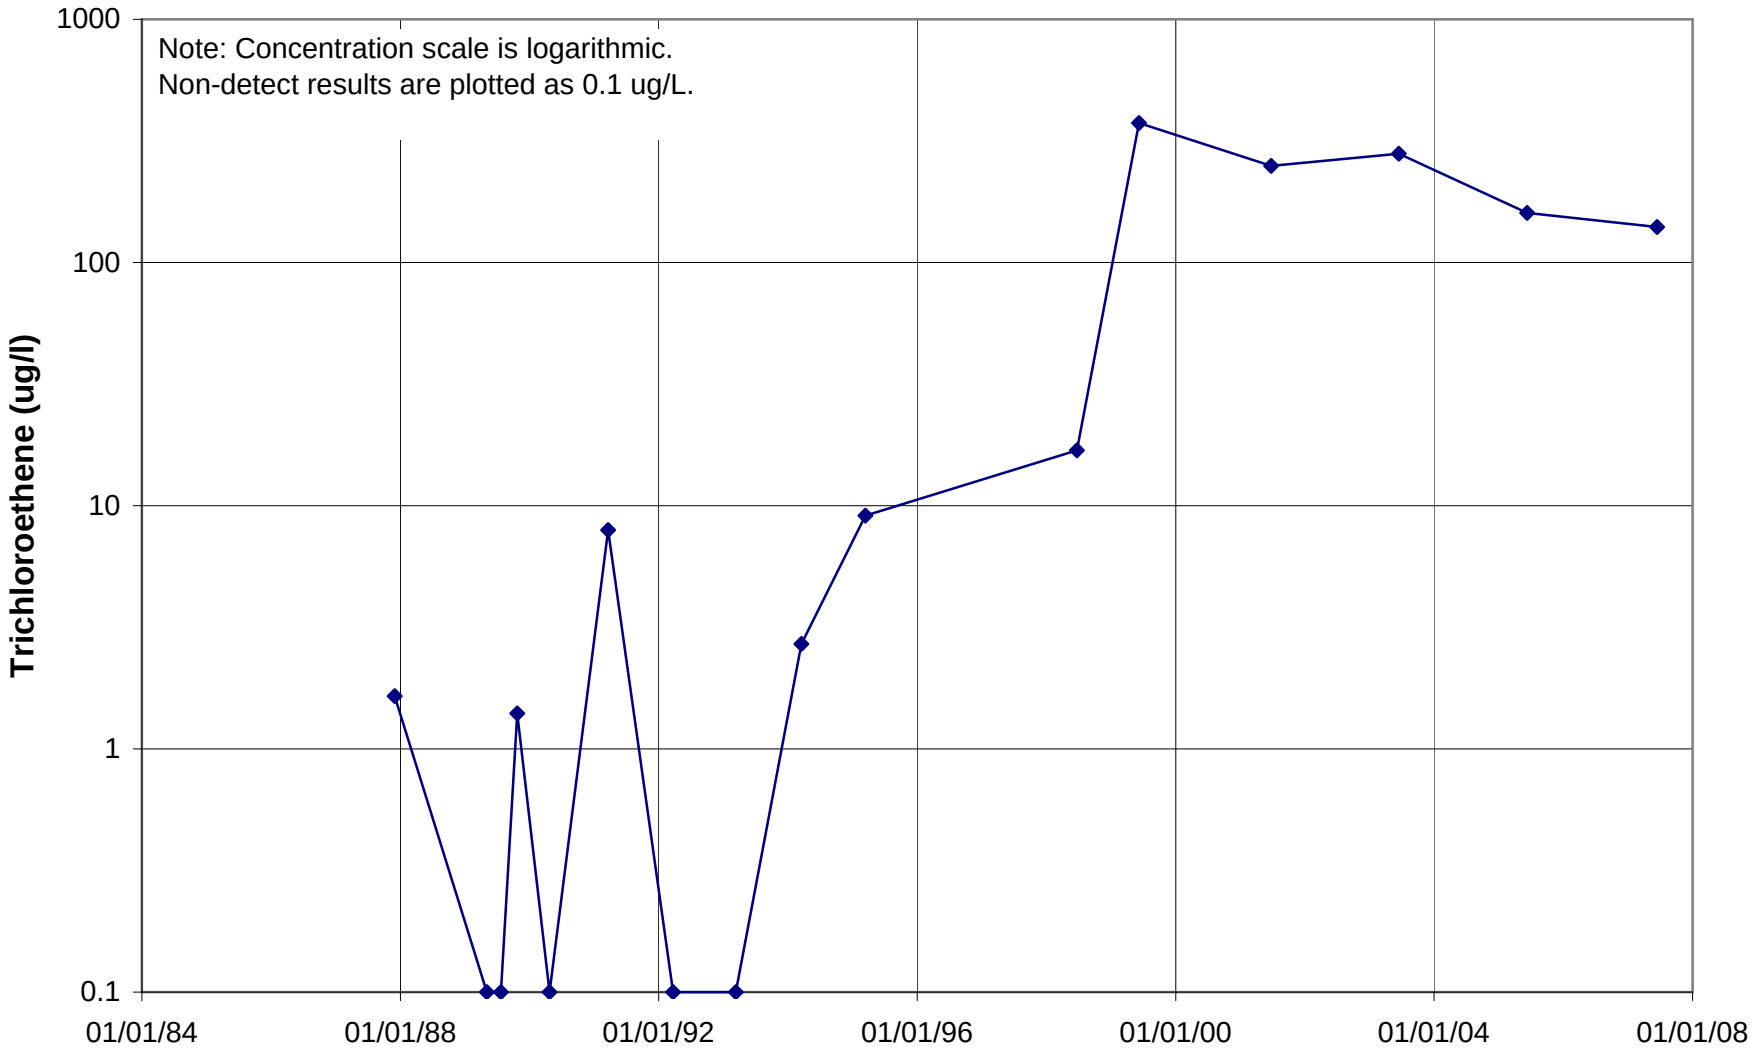

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

03U831

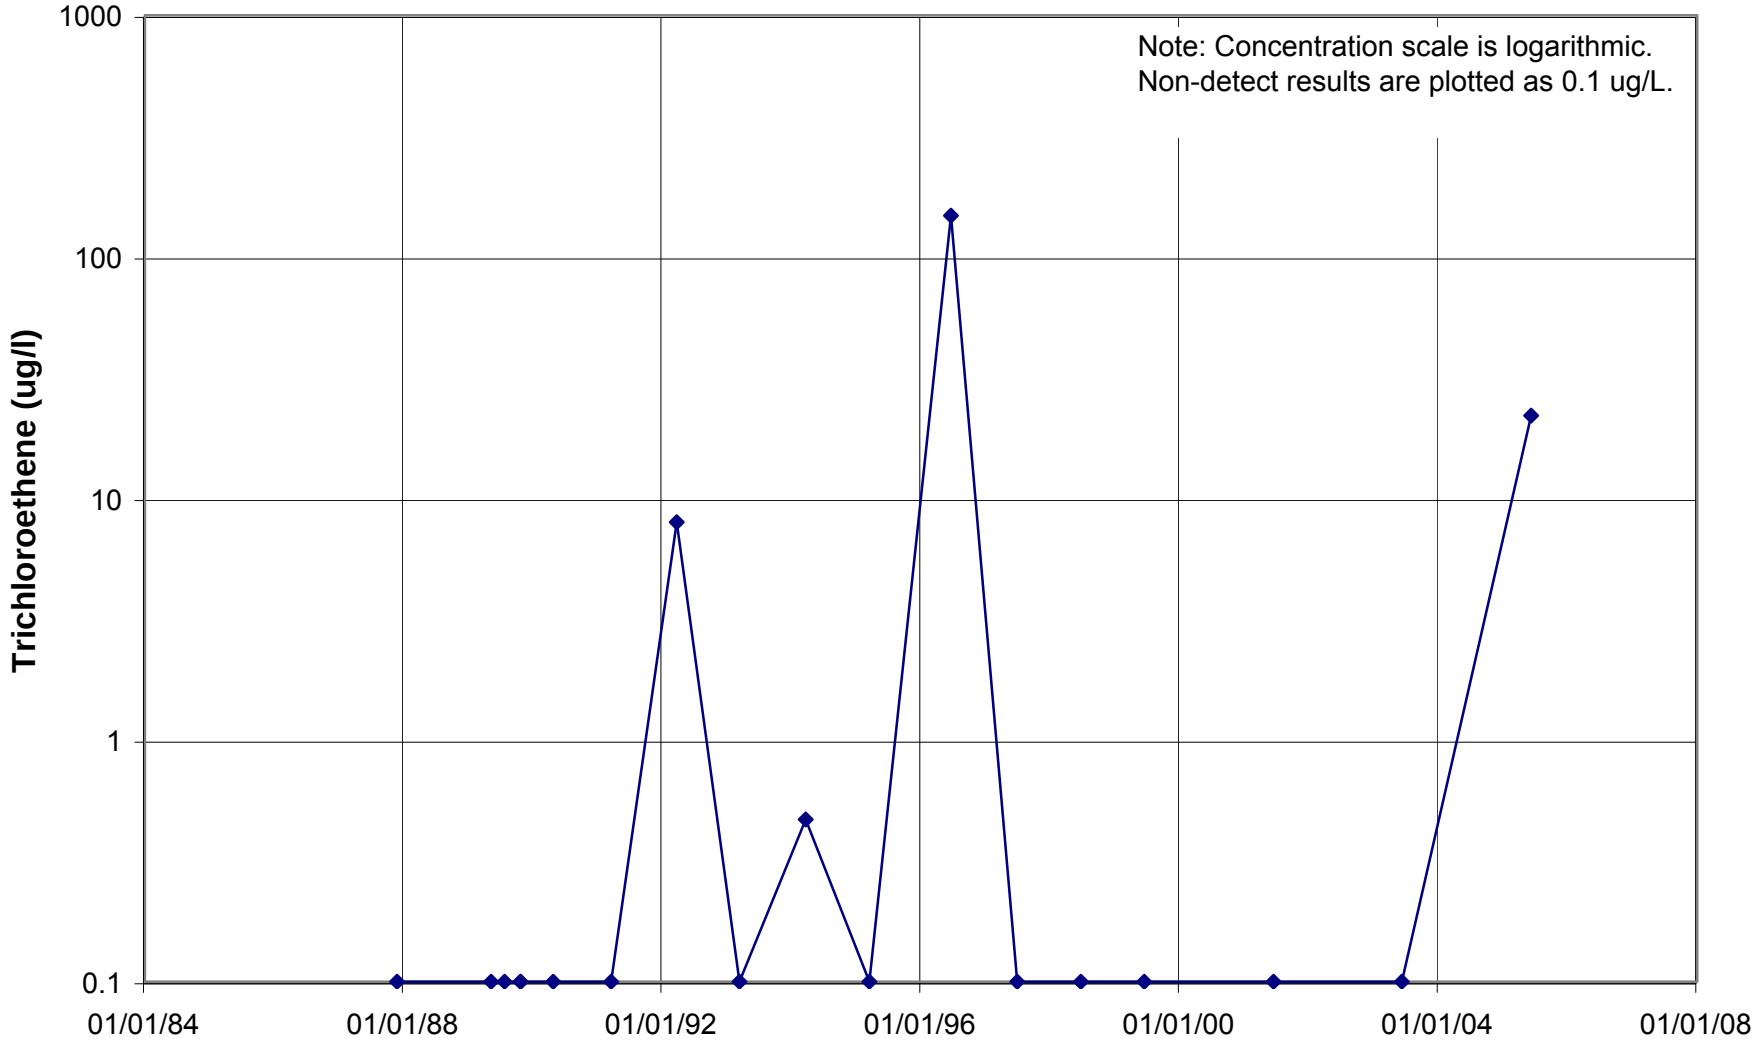

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J077

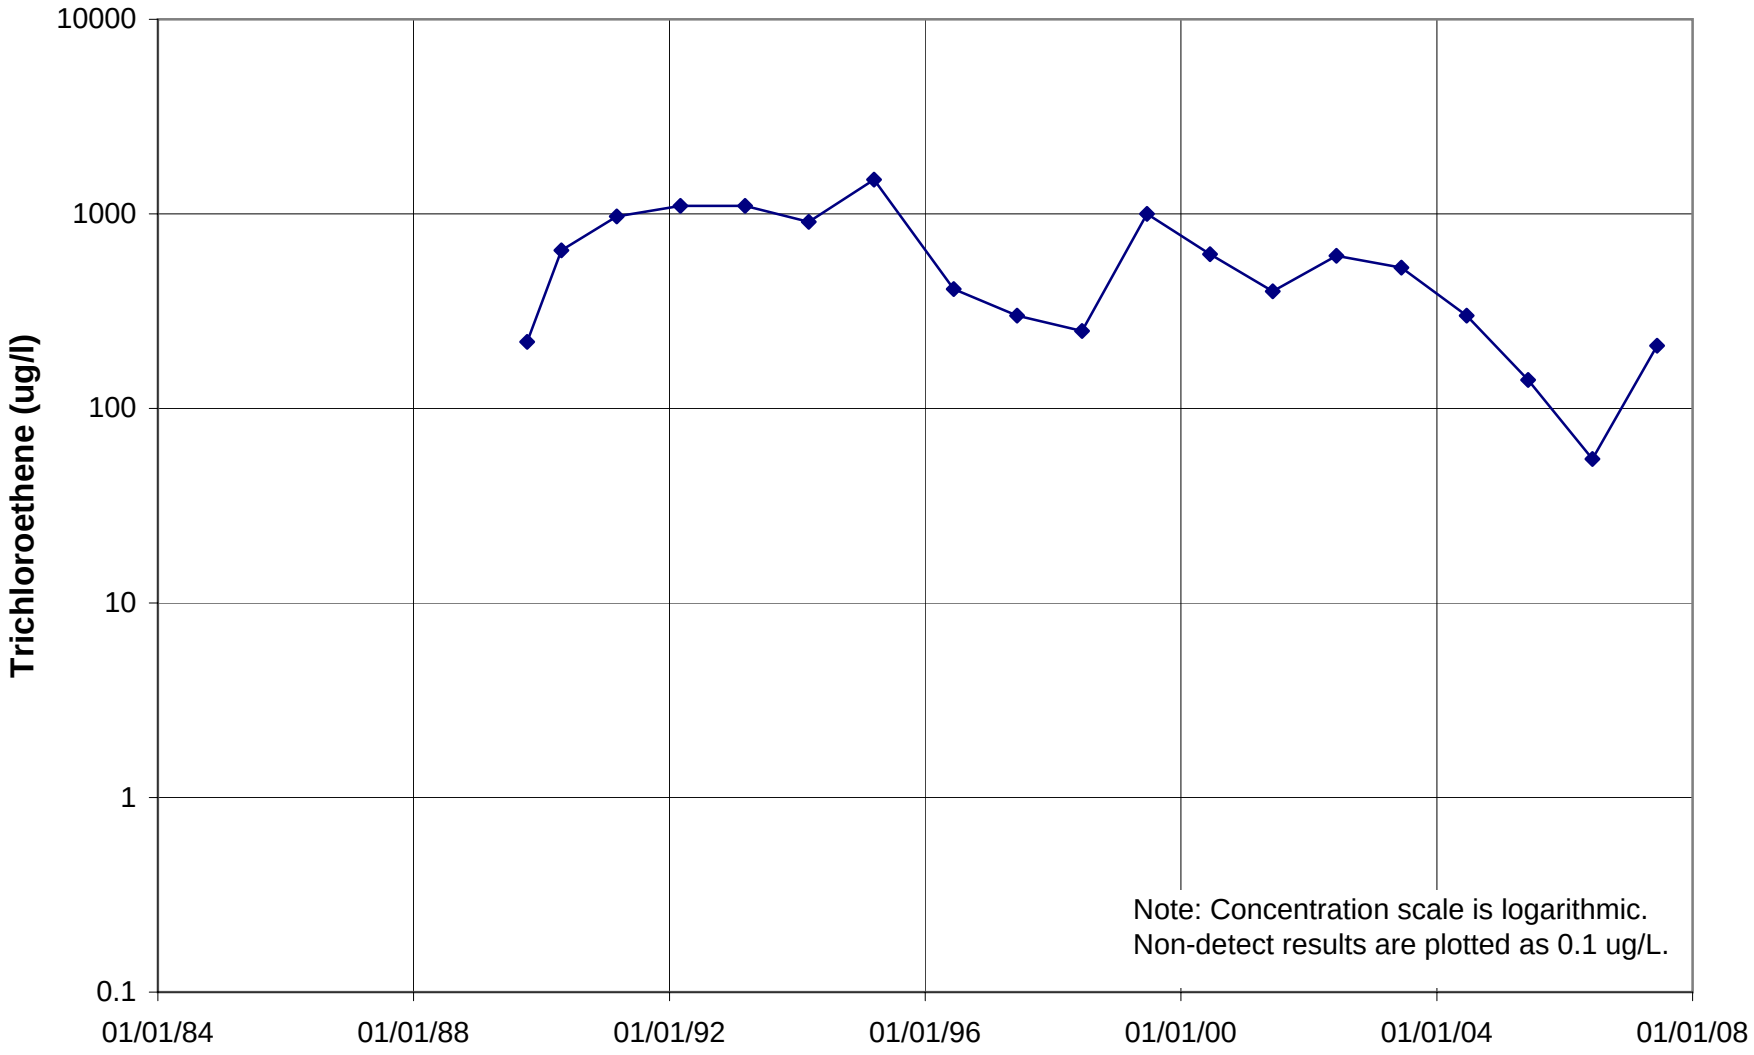

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J702

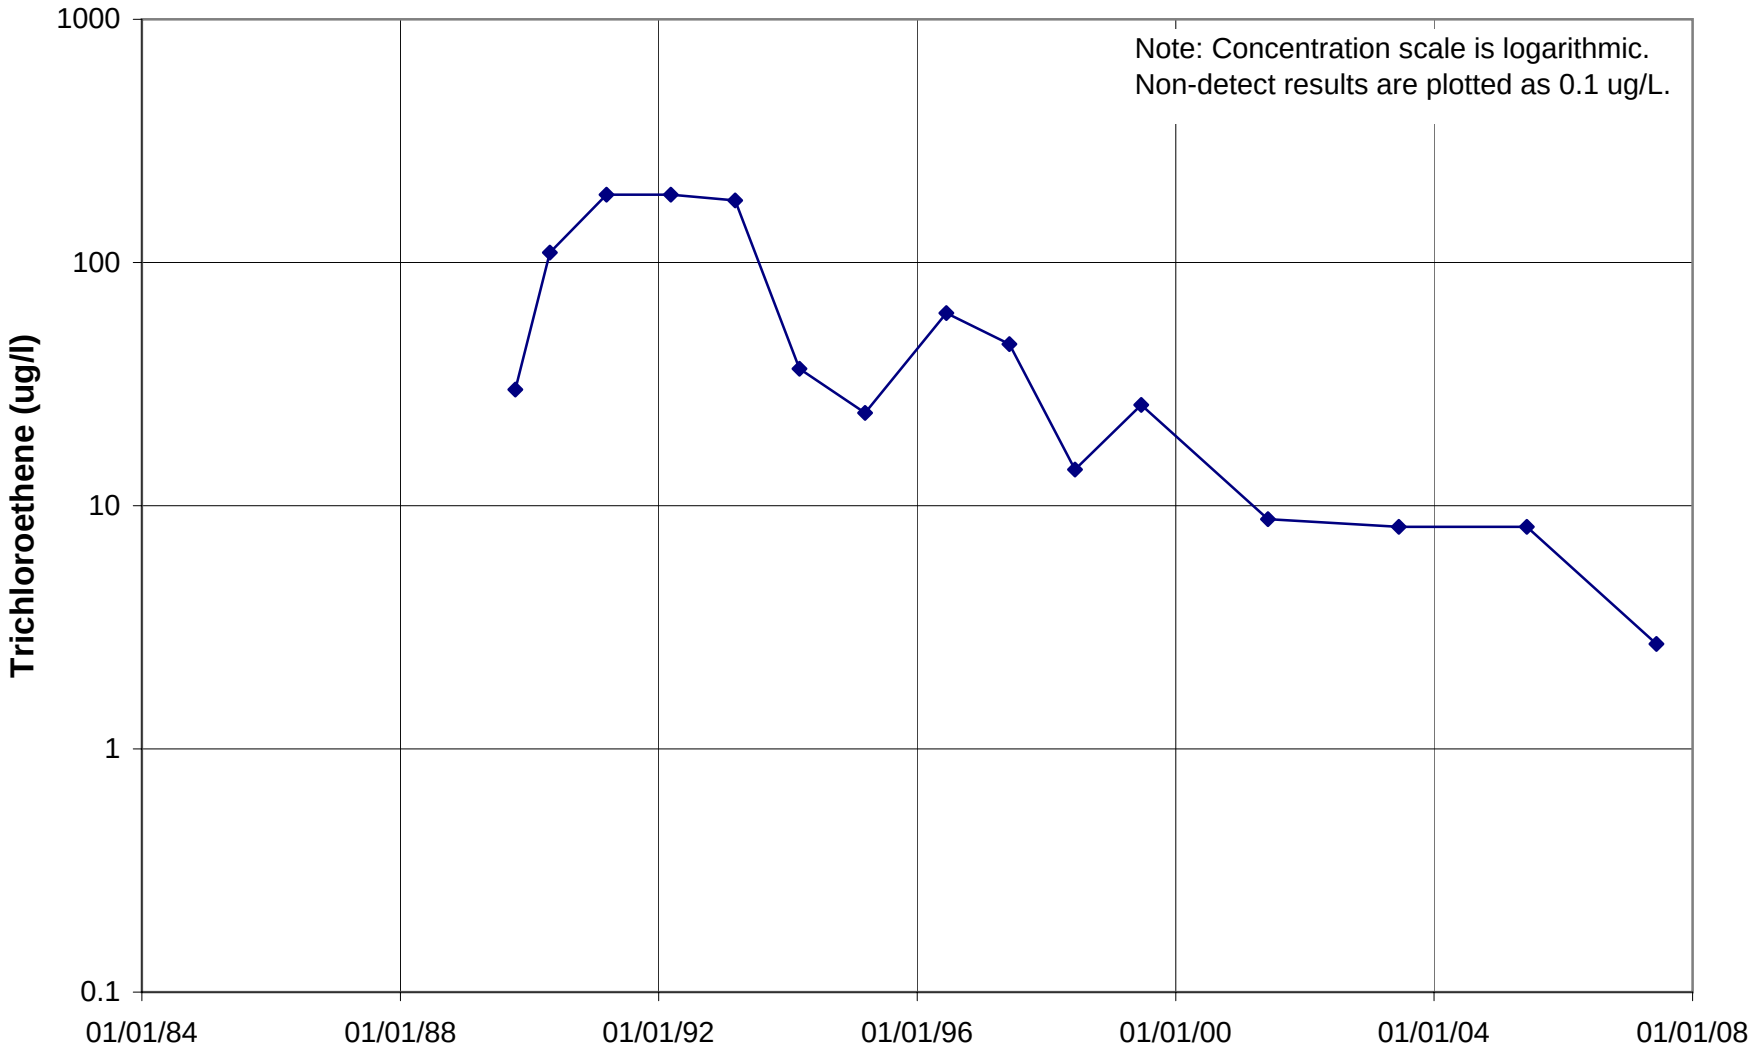

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J708

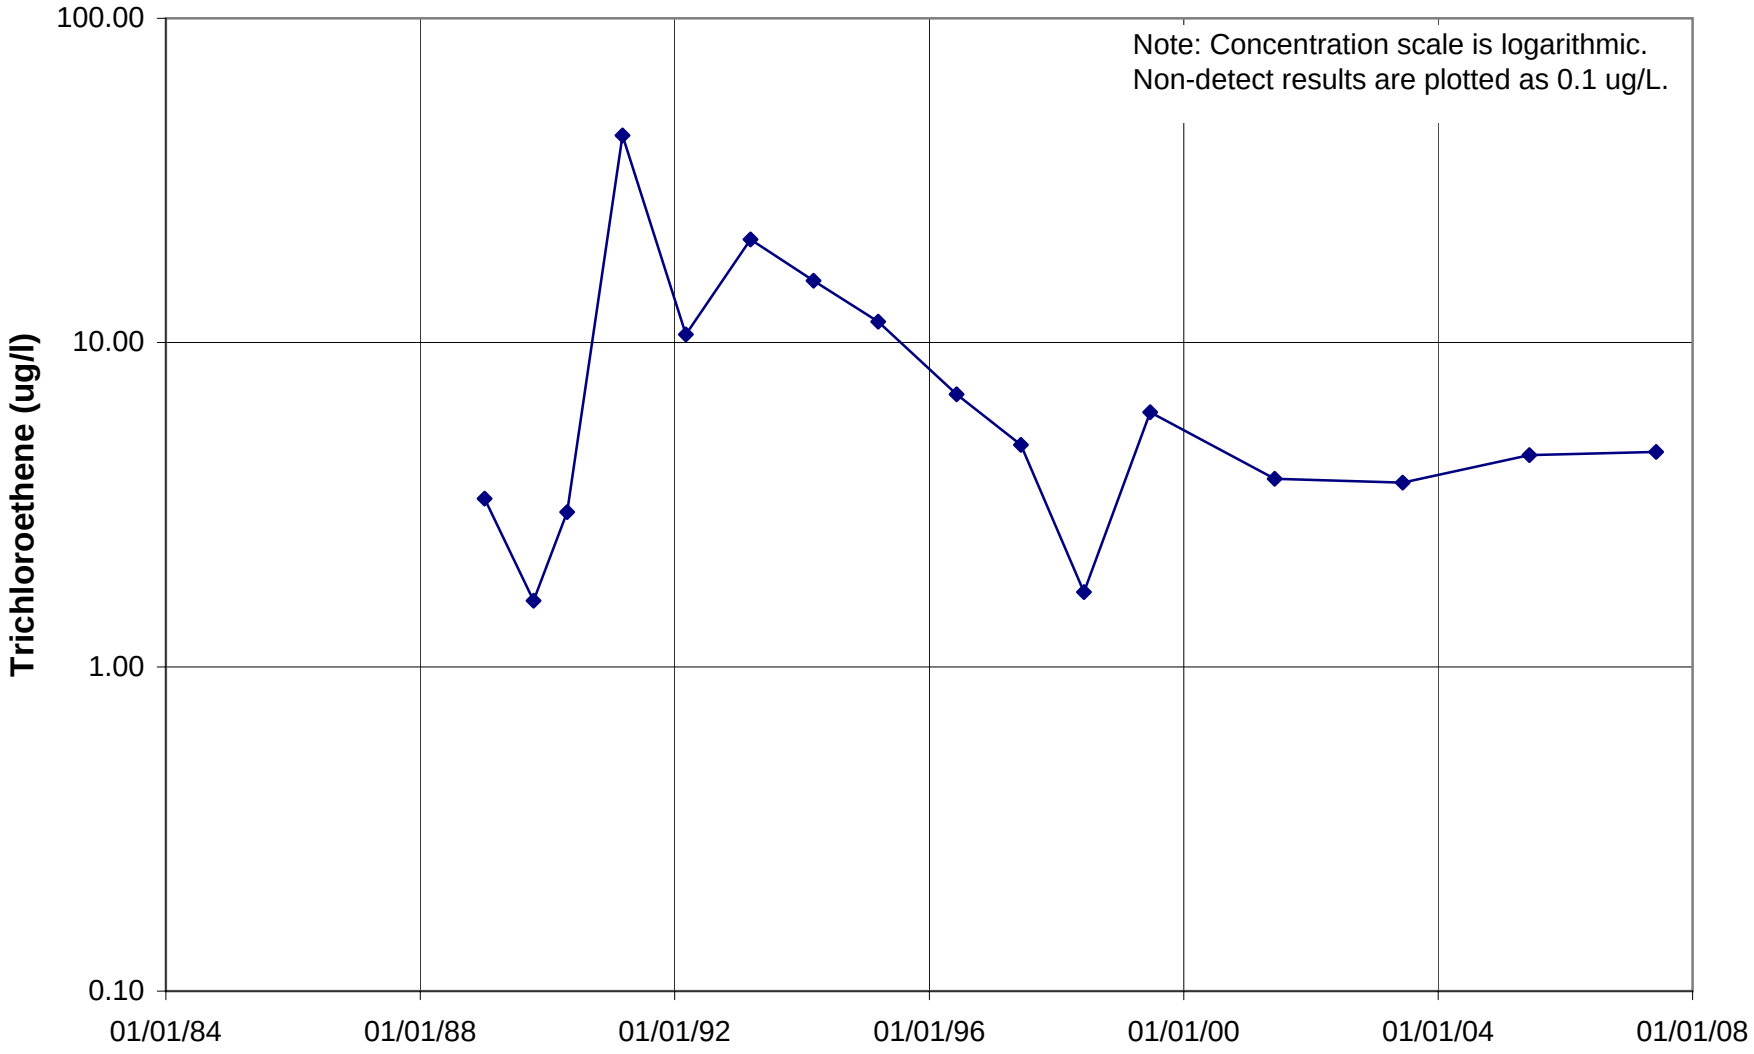

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J713

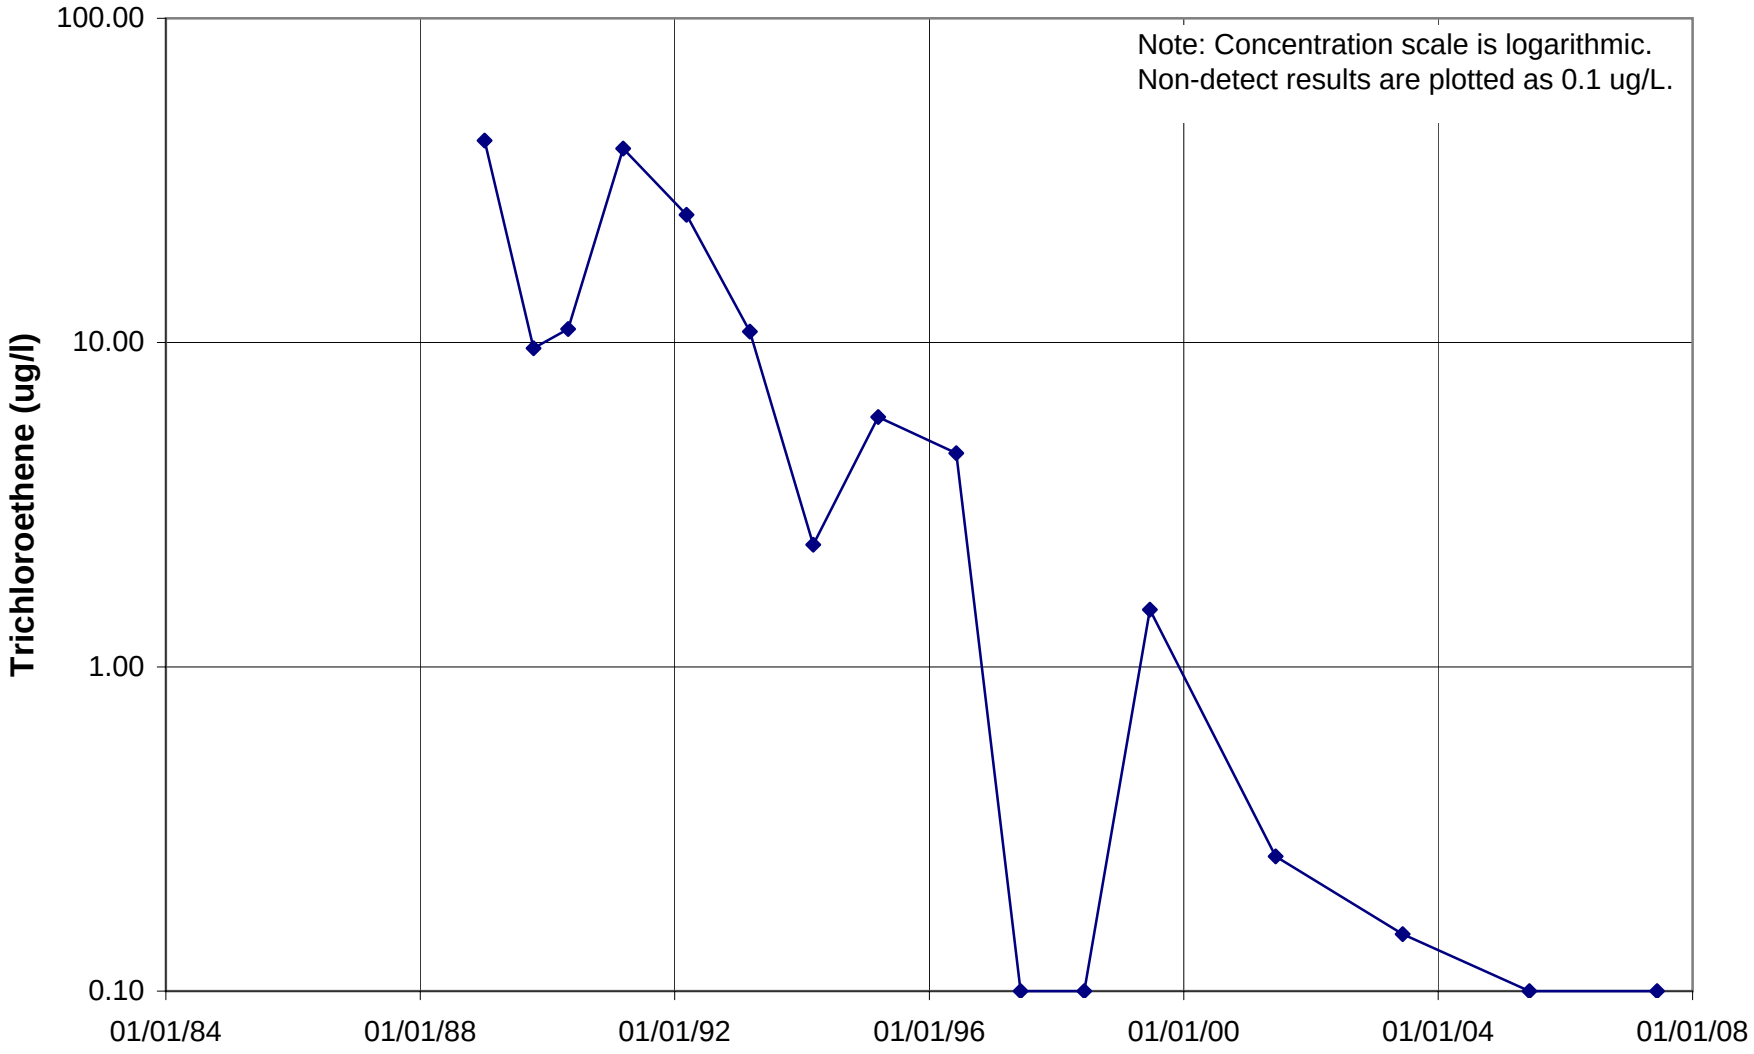

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J714

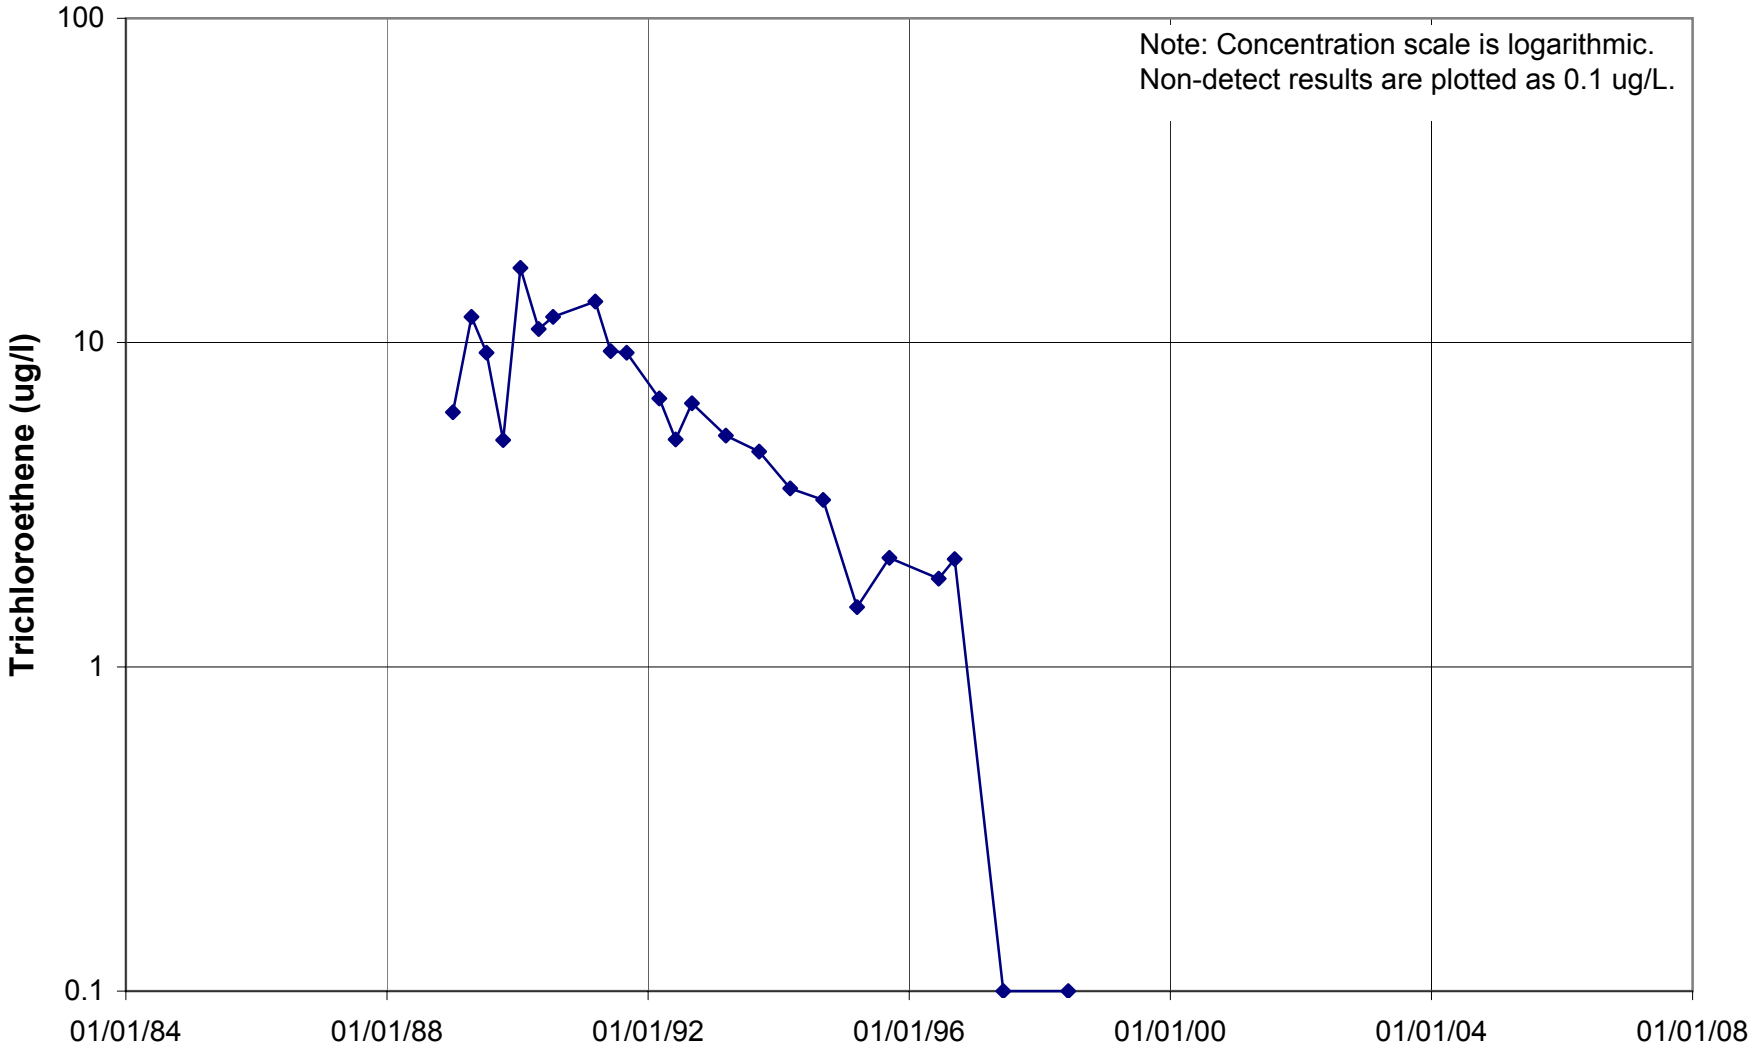

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J822

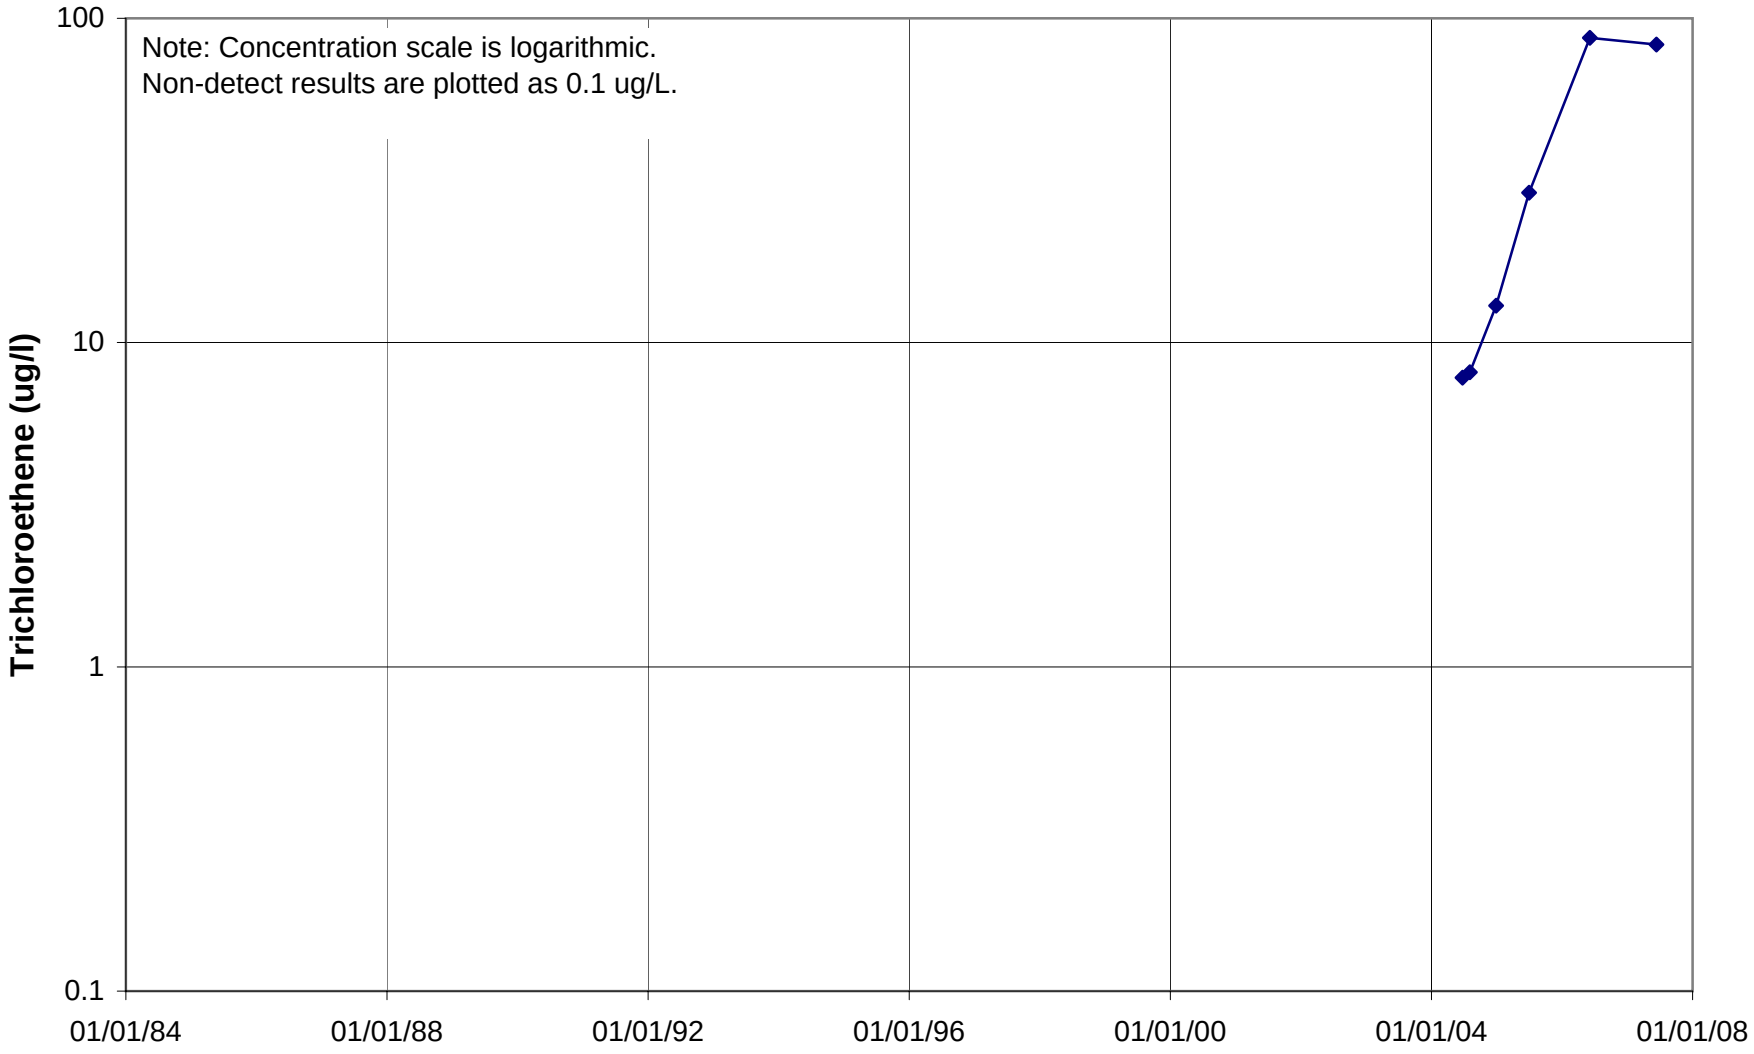

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J834

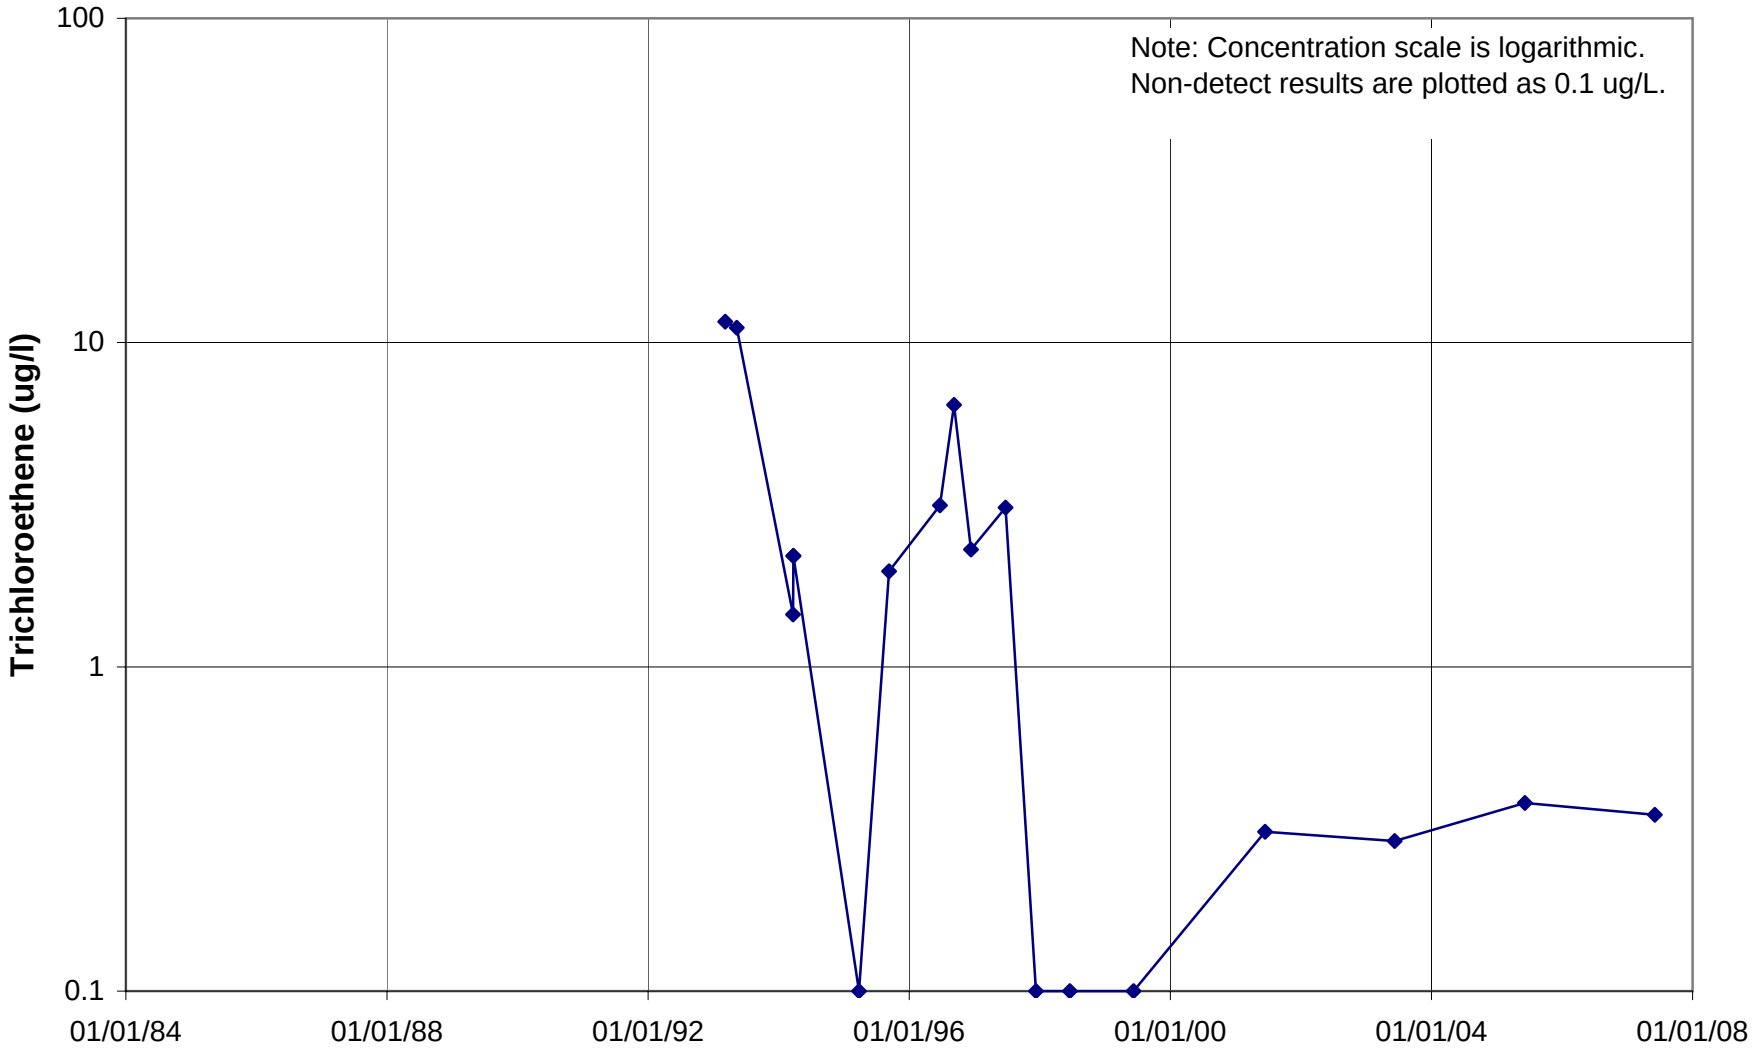

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J835

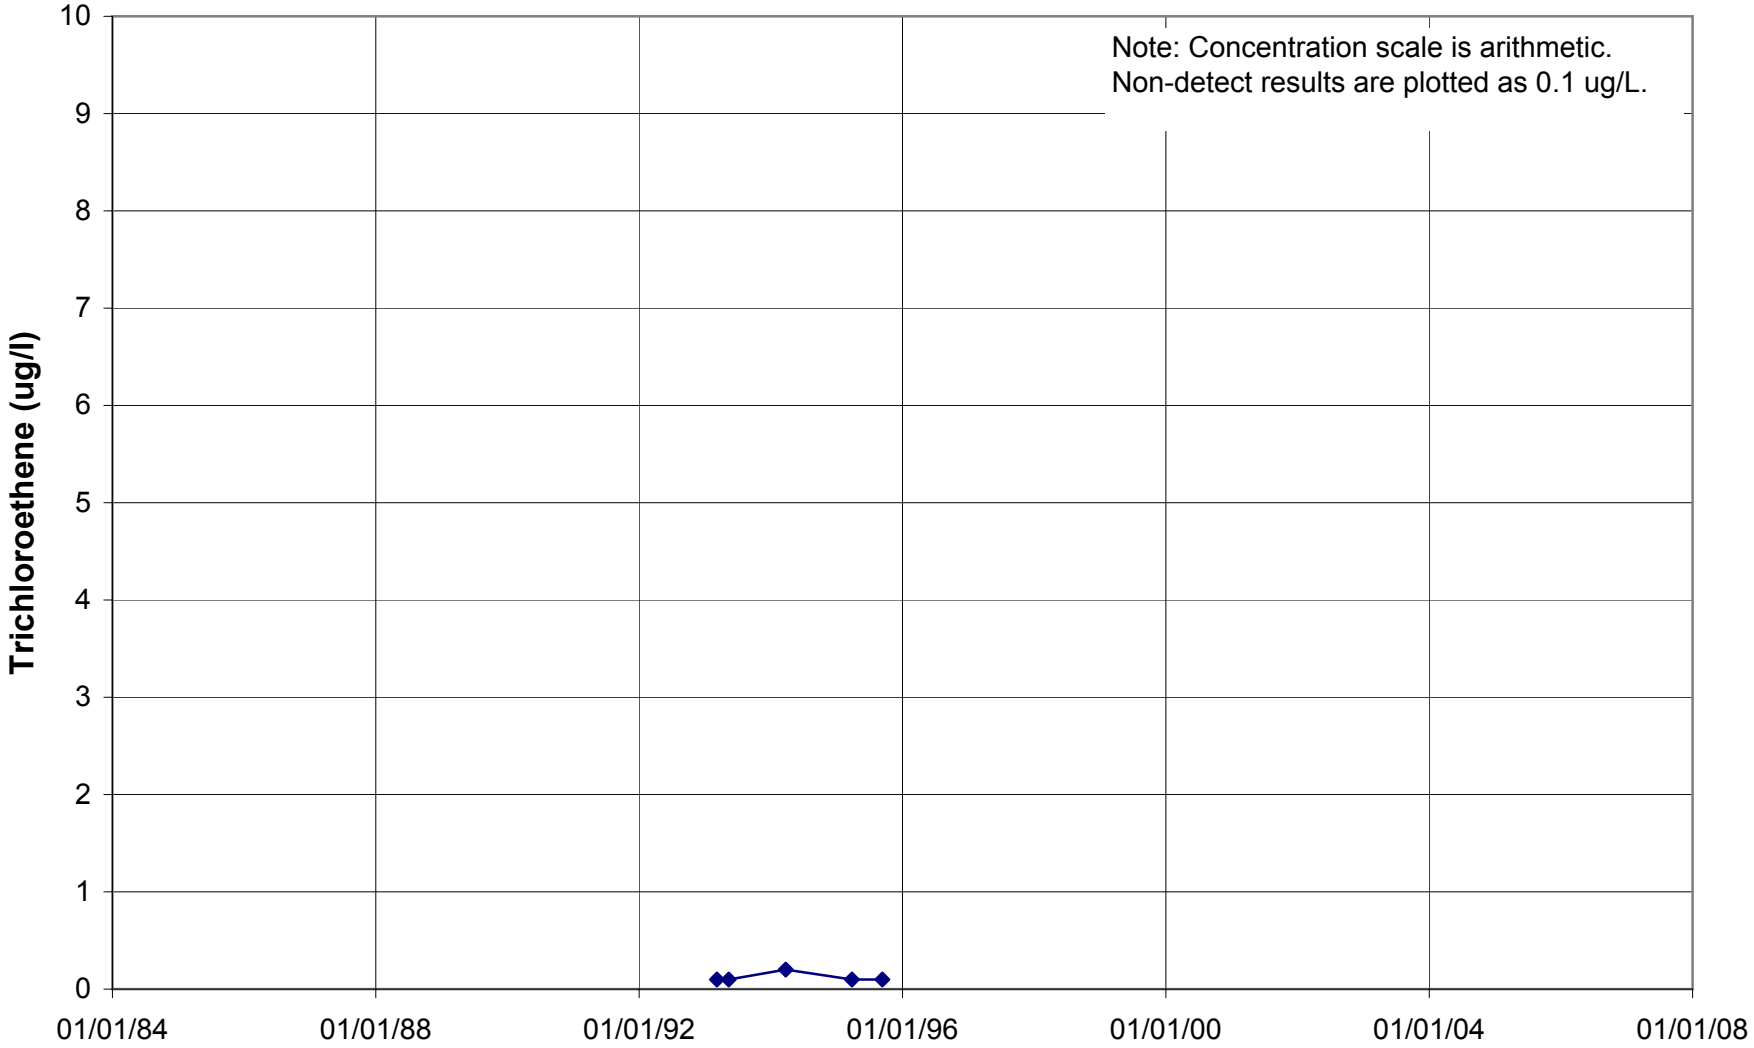

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J836

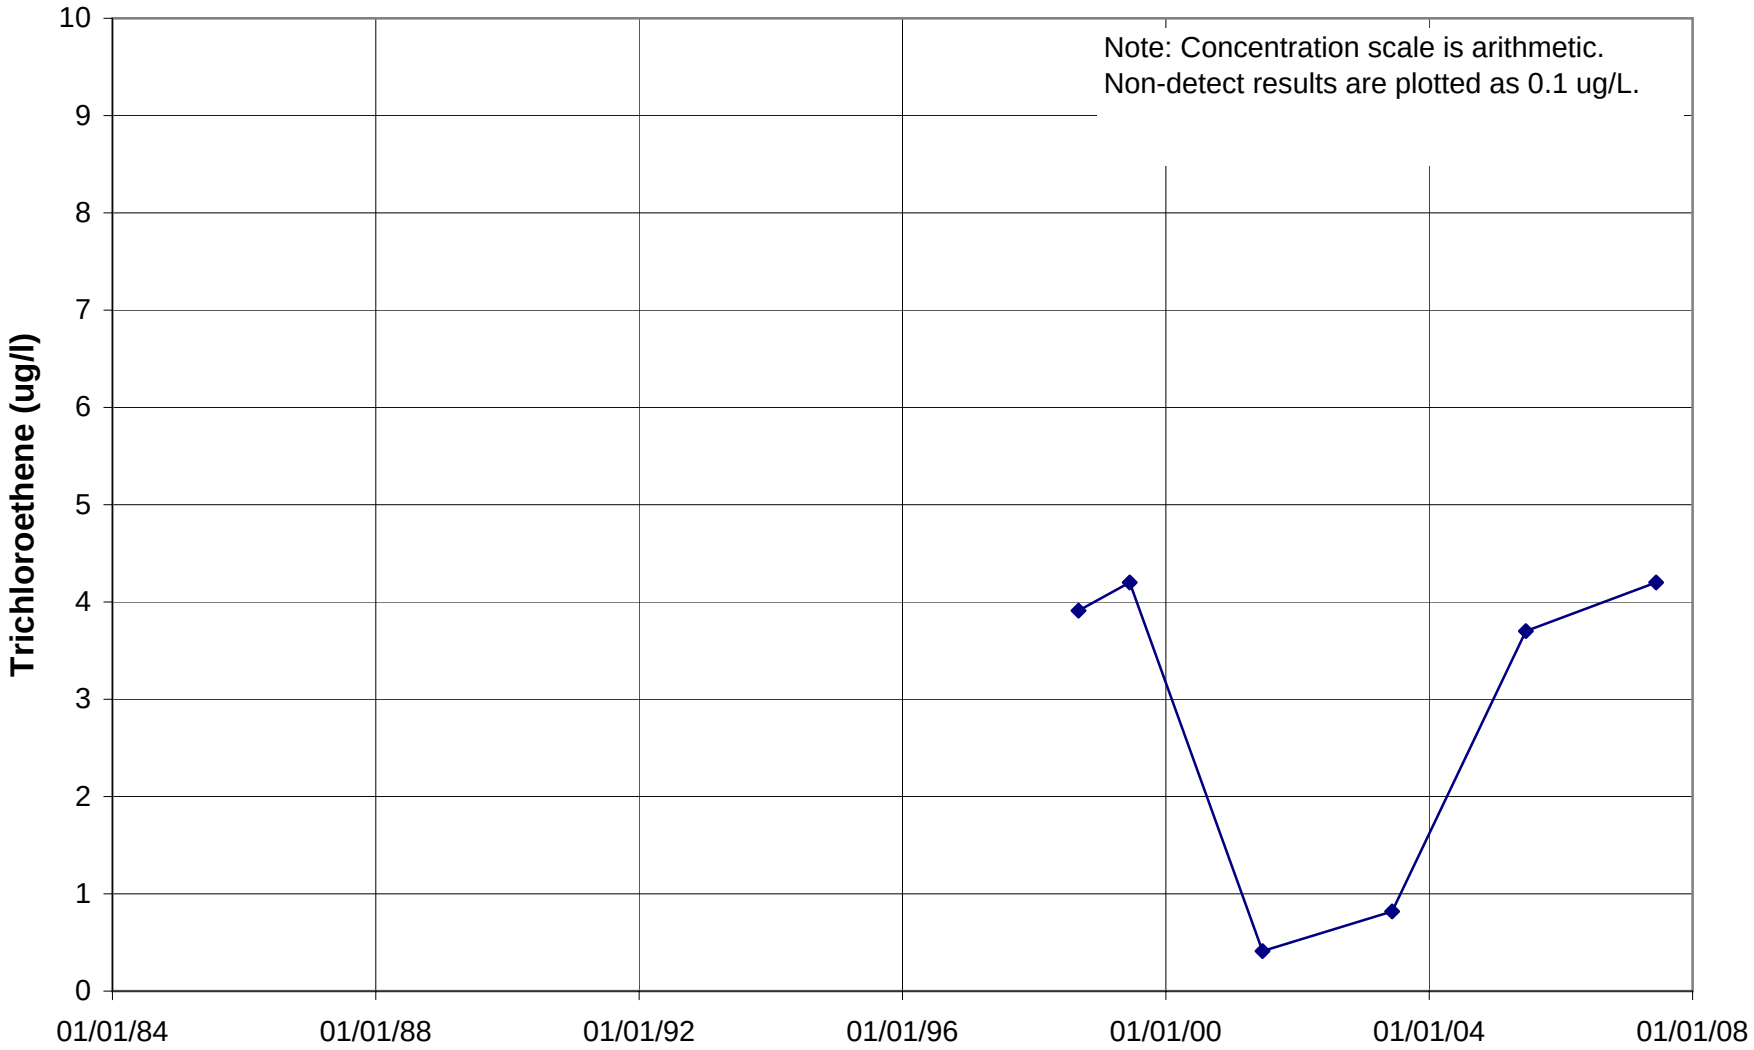

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J837

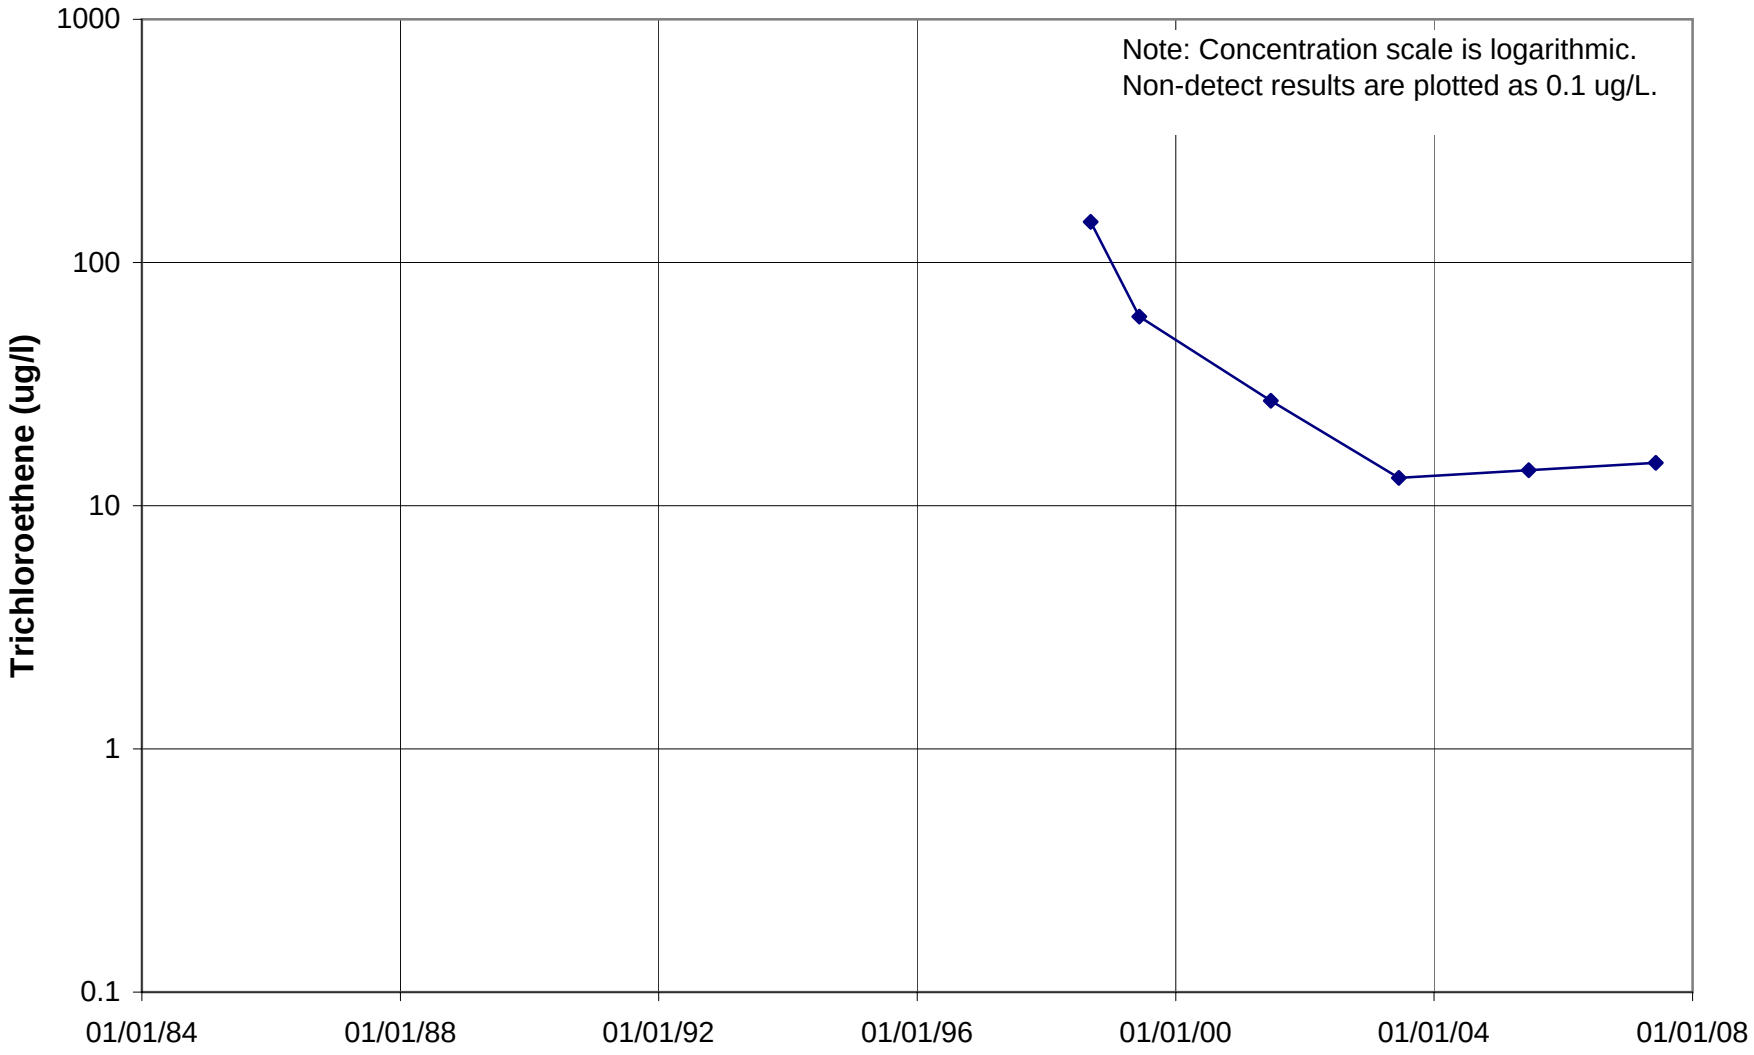

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J838

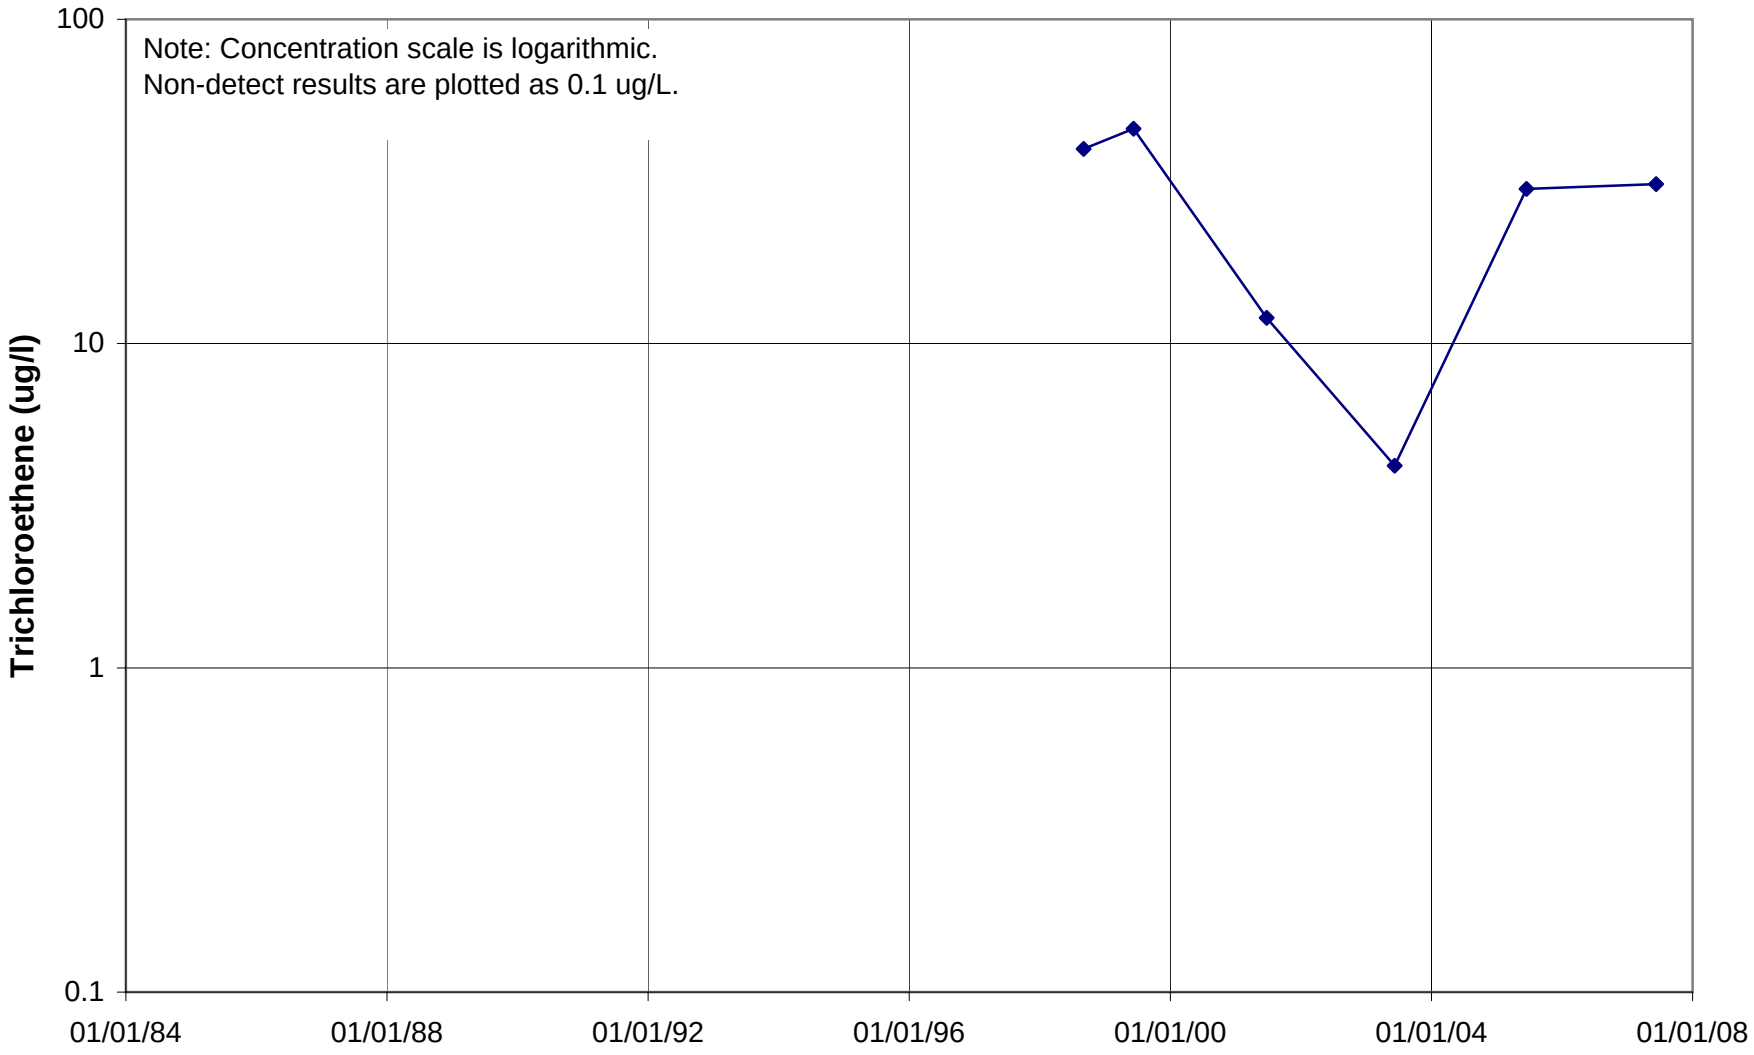

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J839

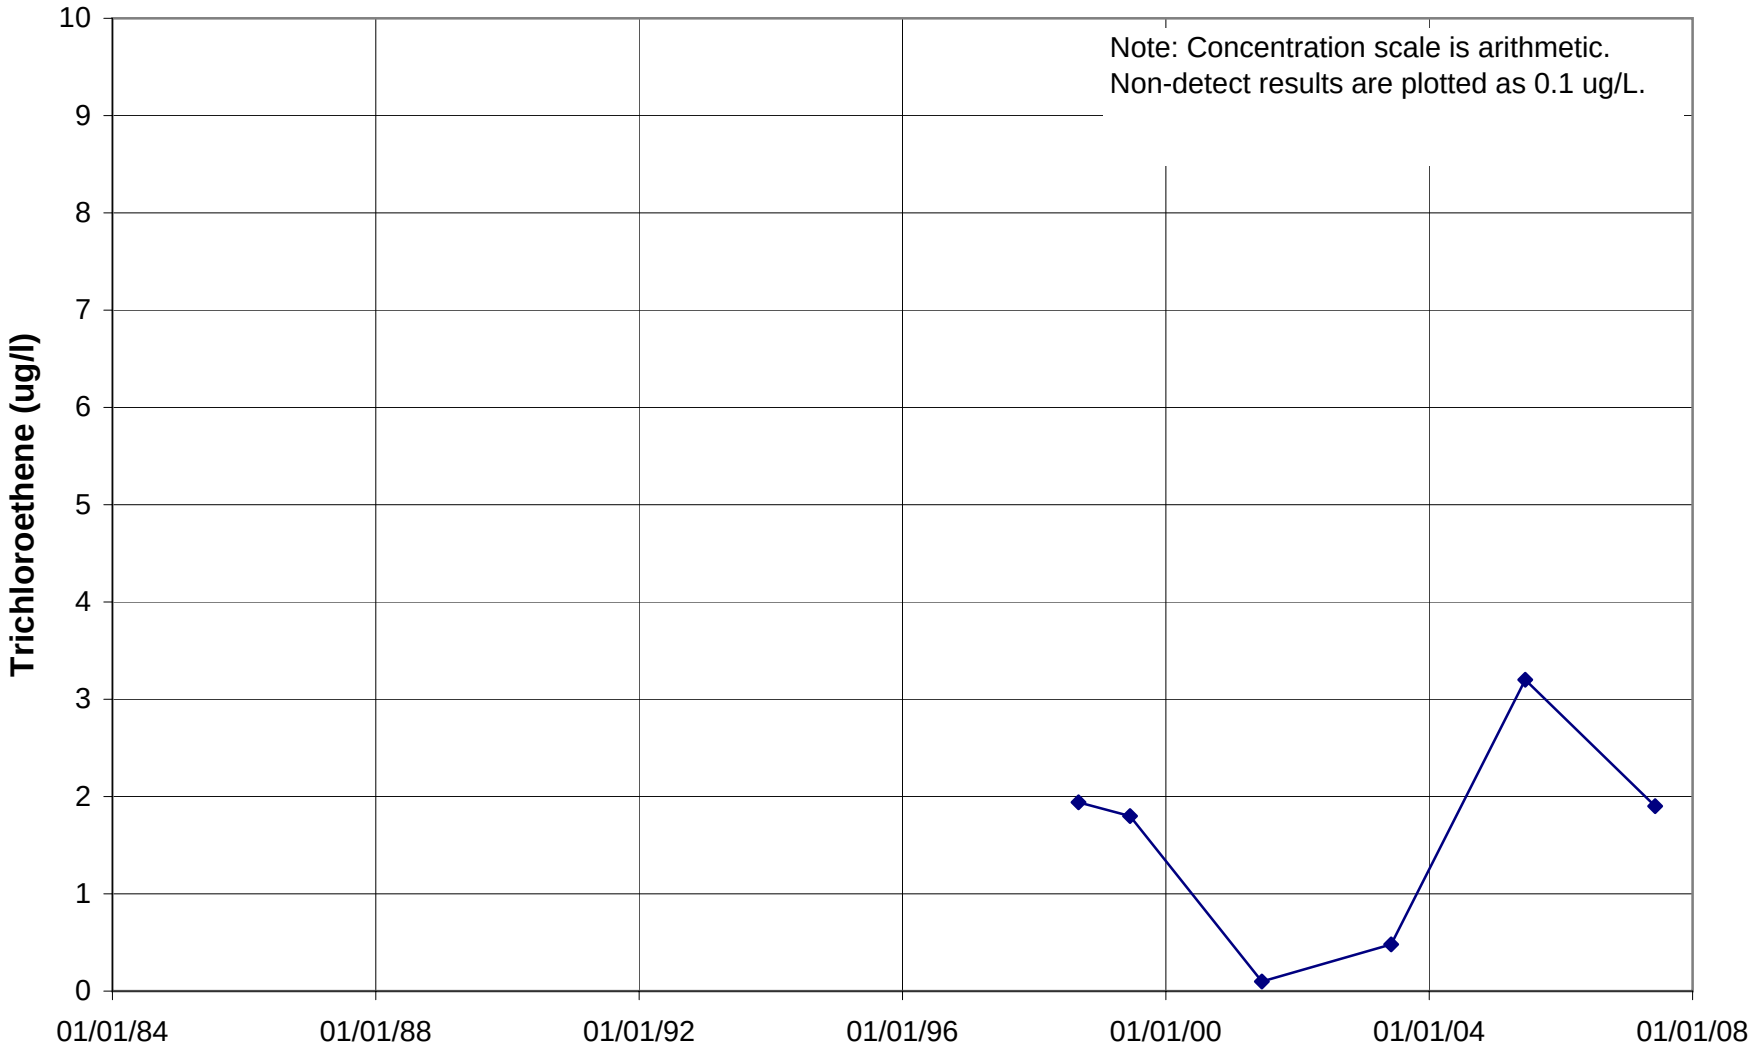

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J847

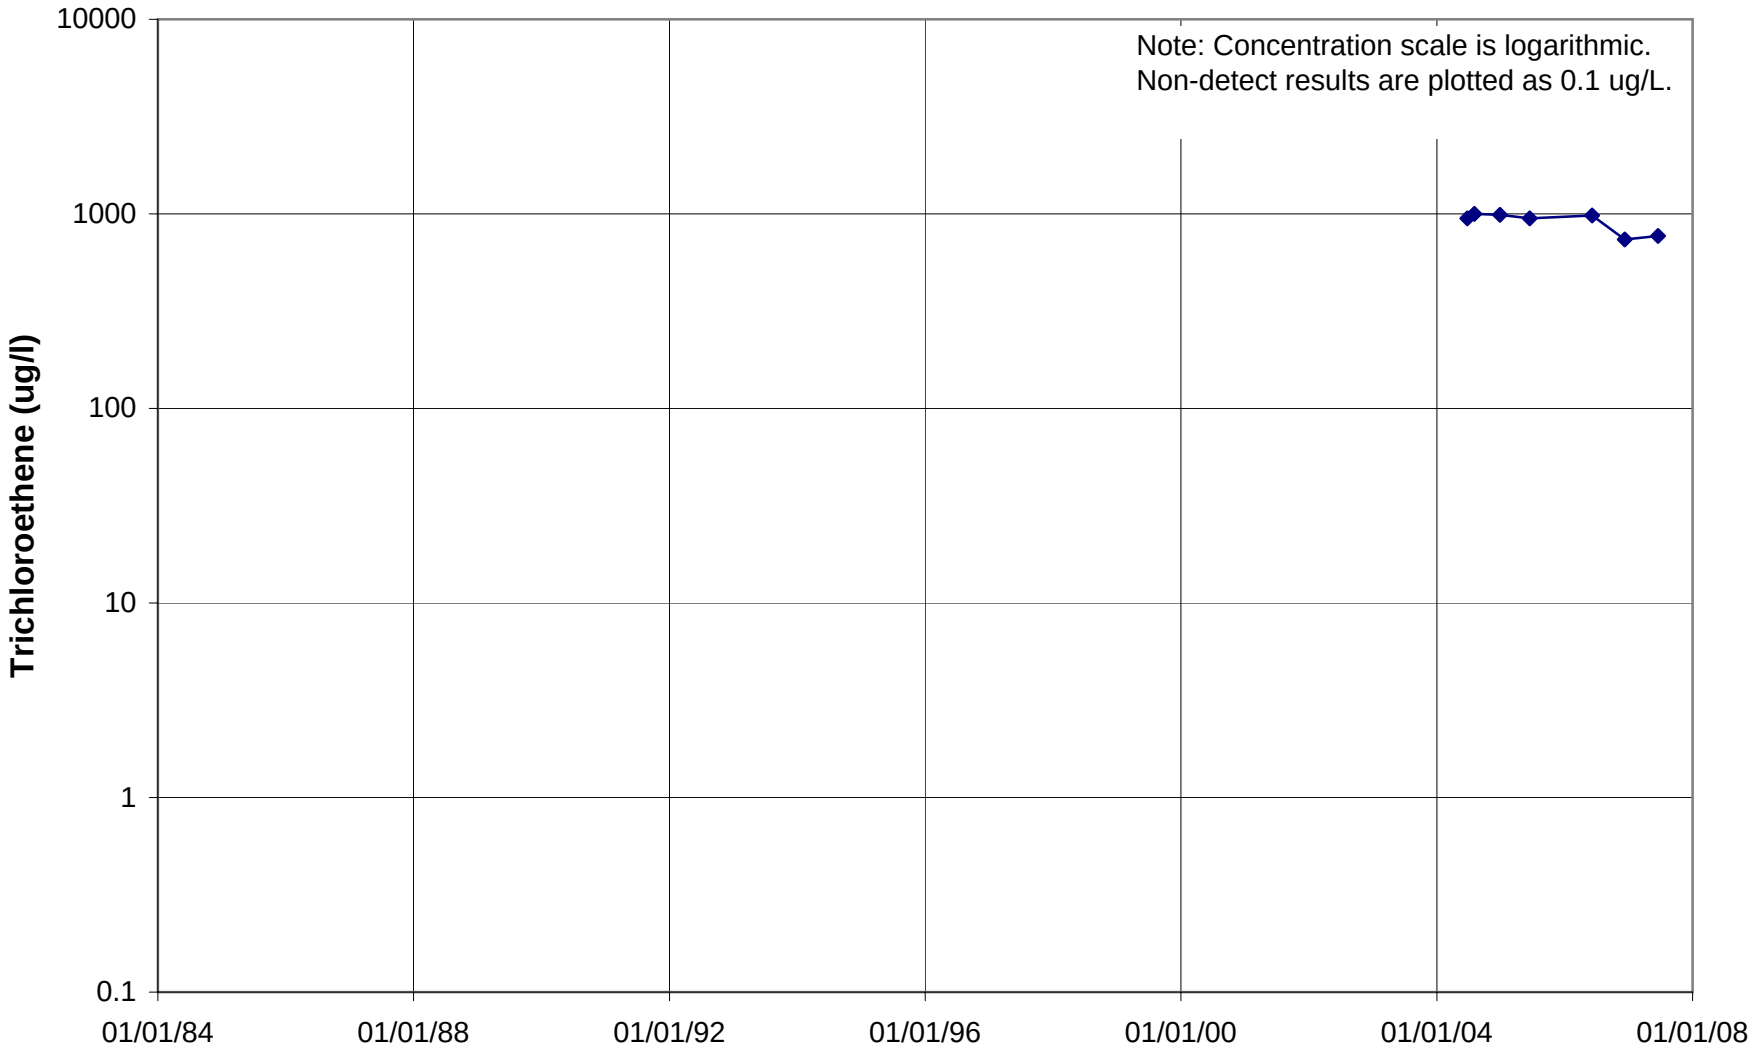

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J849

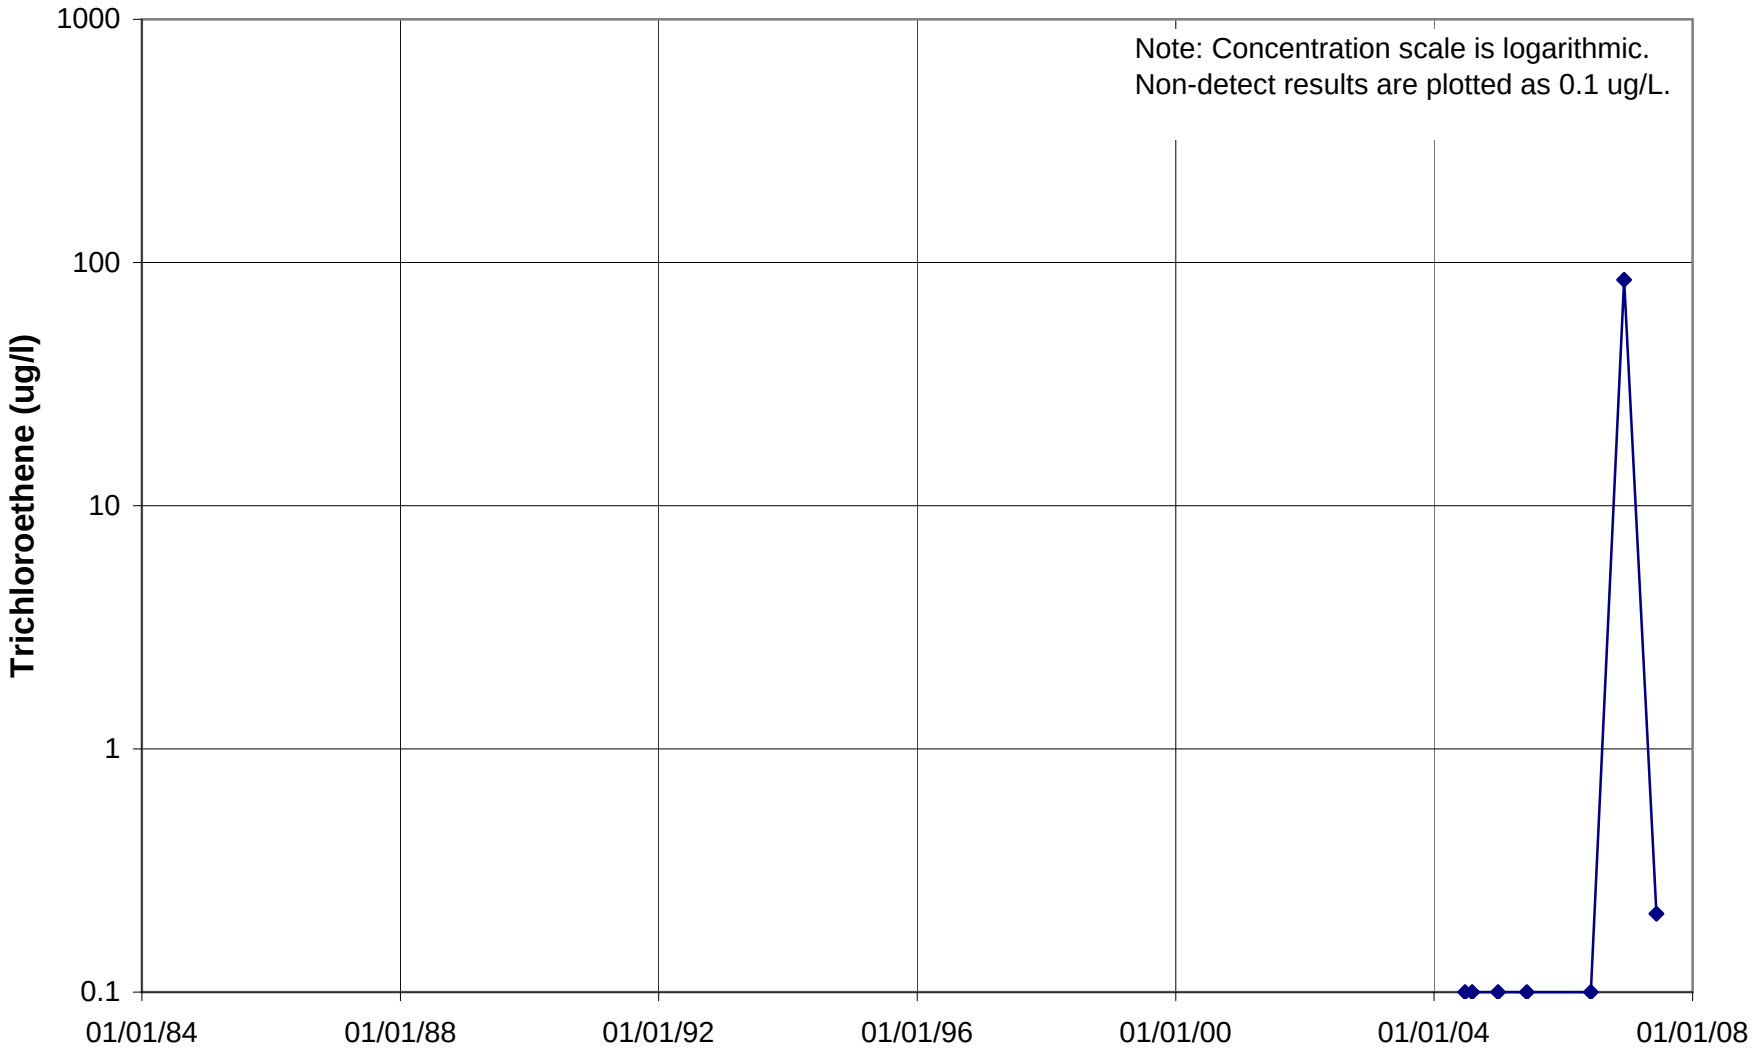

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J864

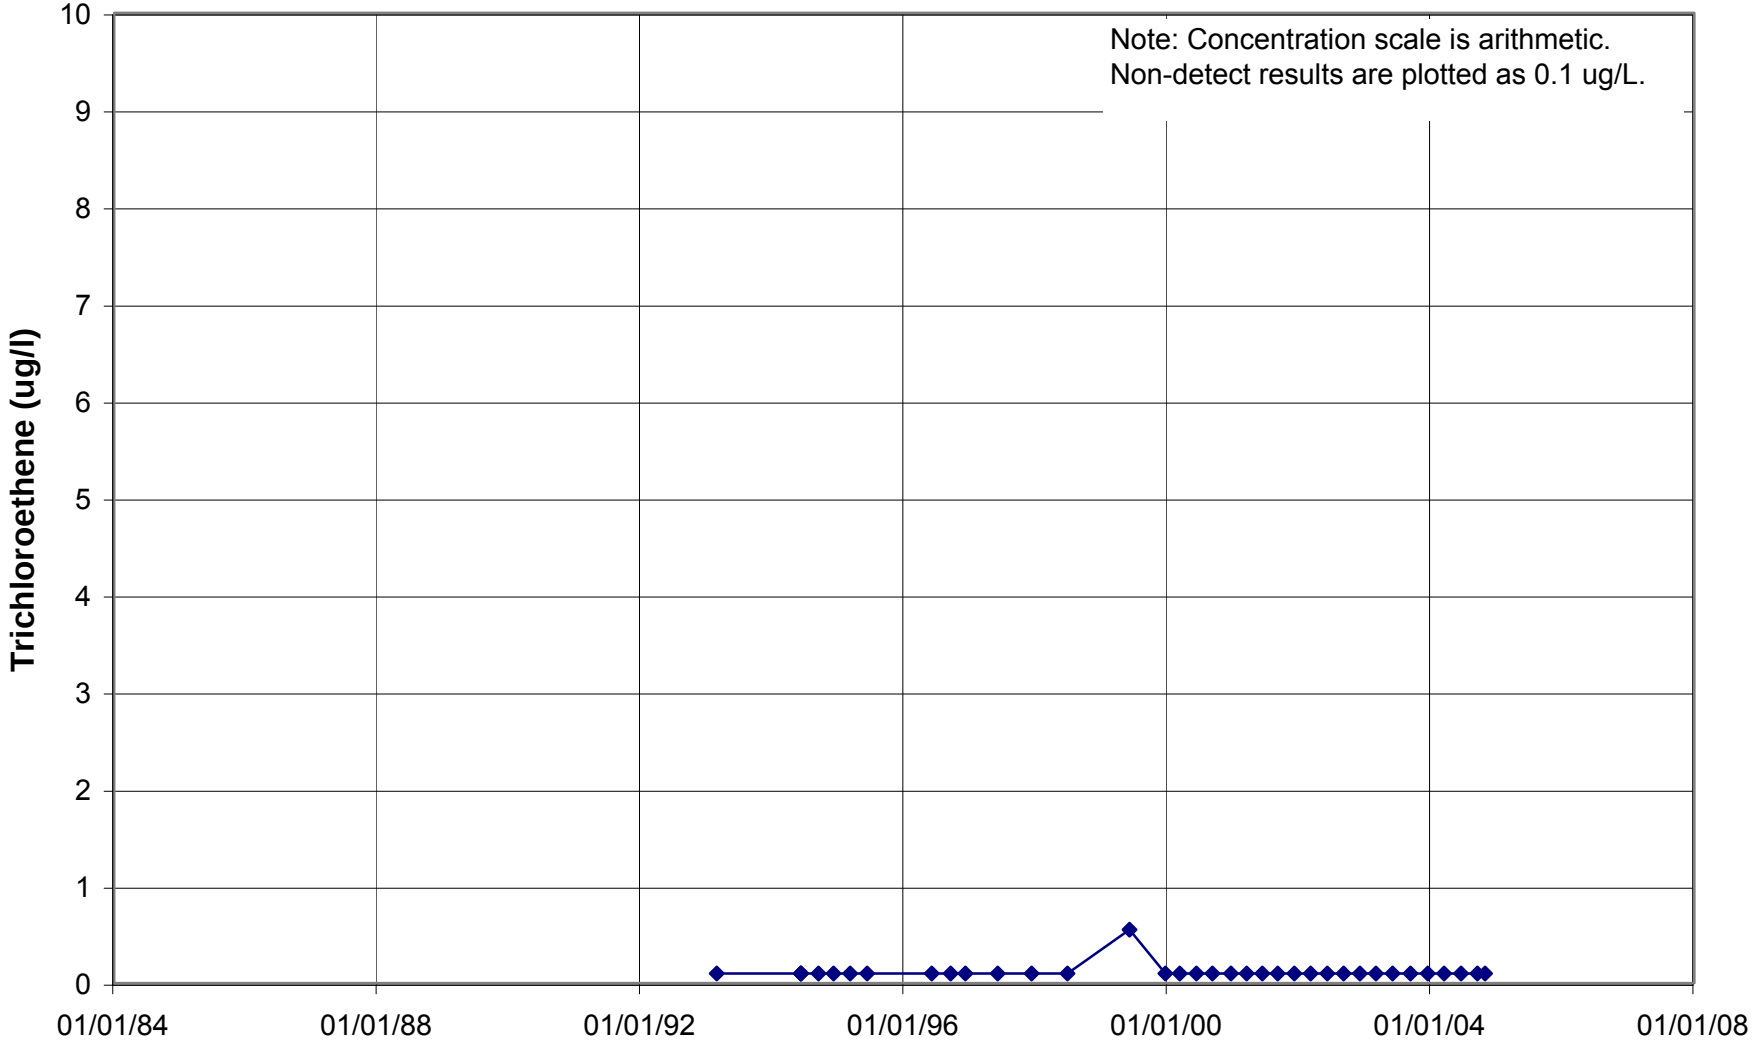

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J866

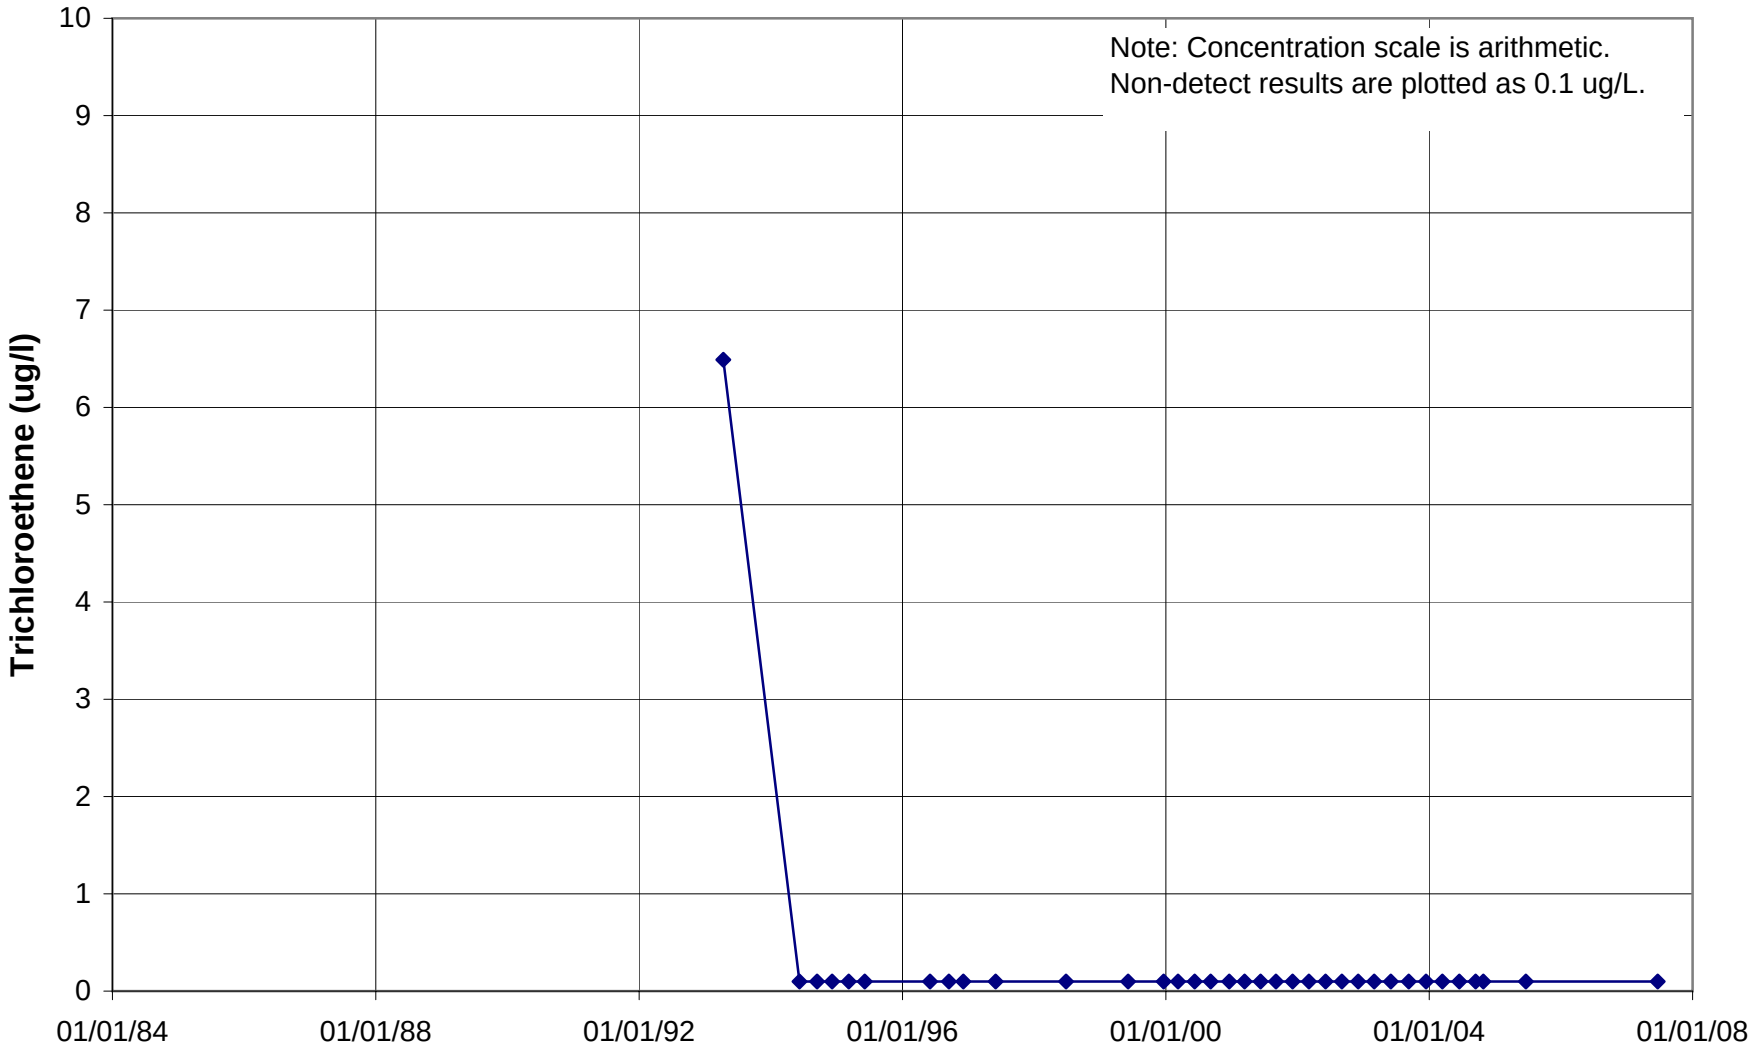

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04J882

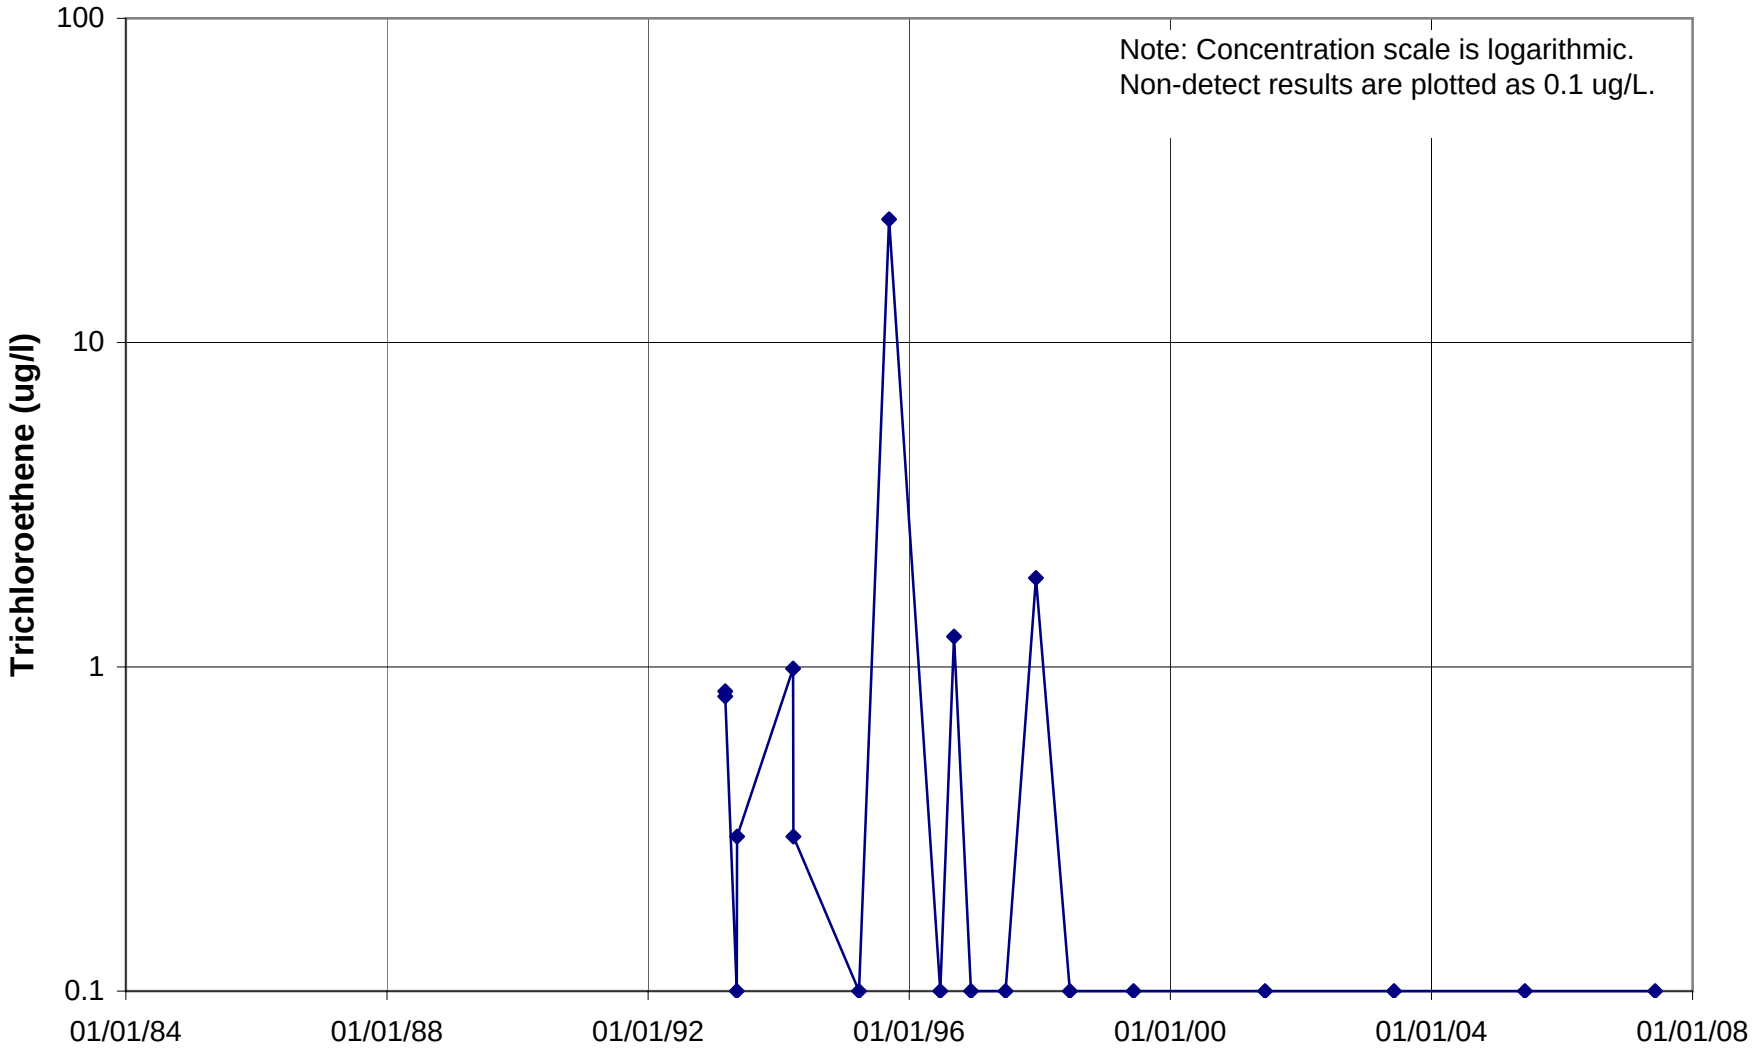

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U001

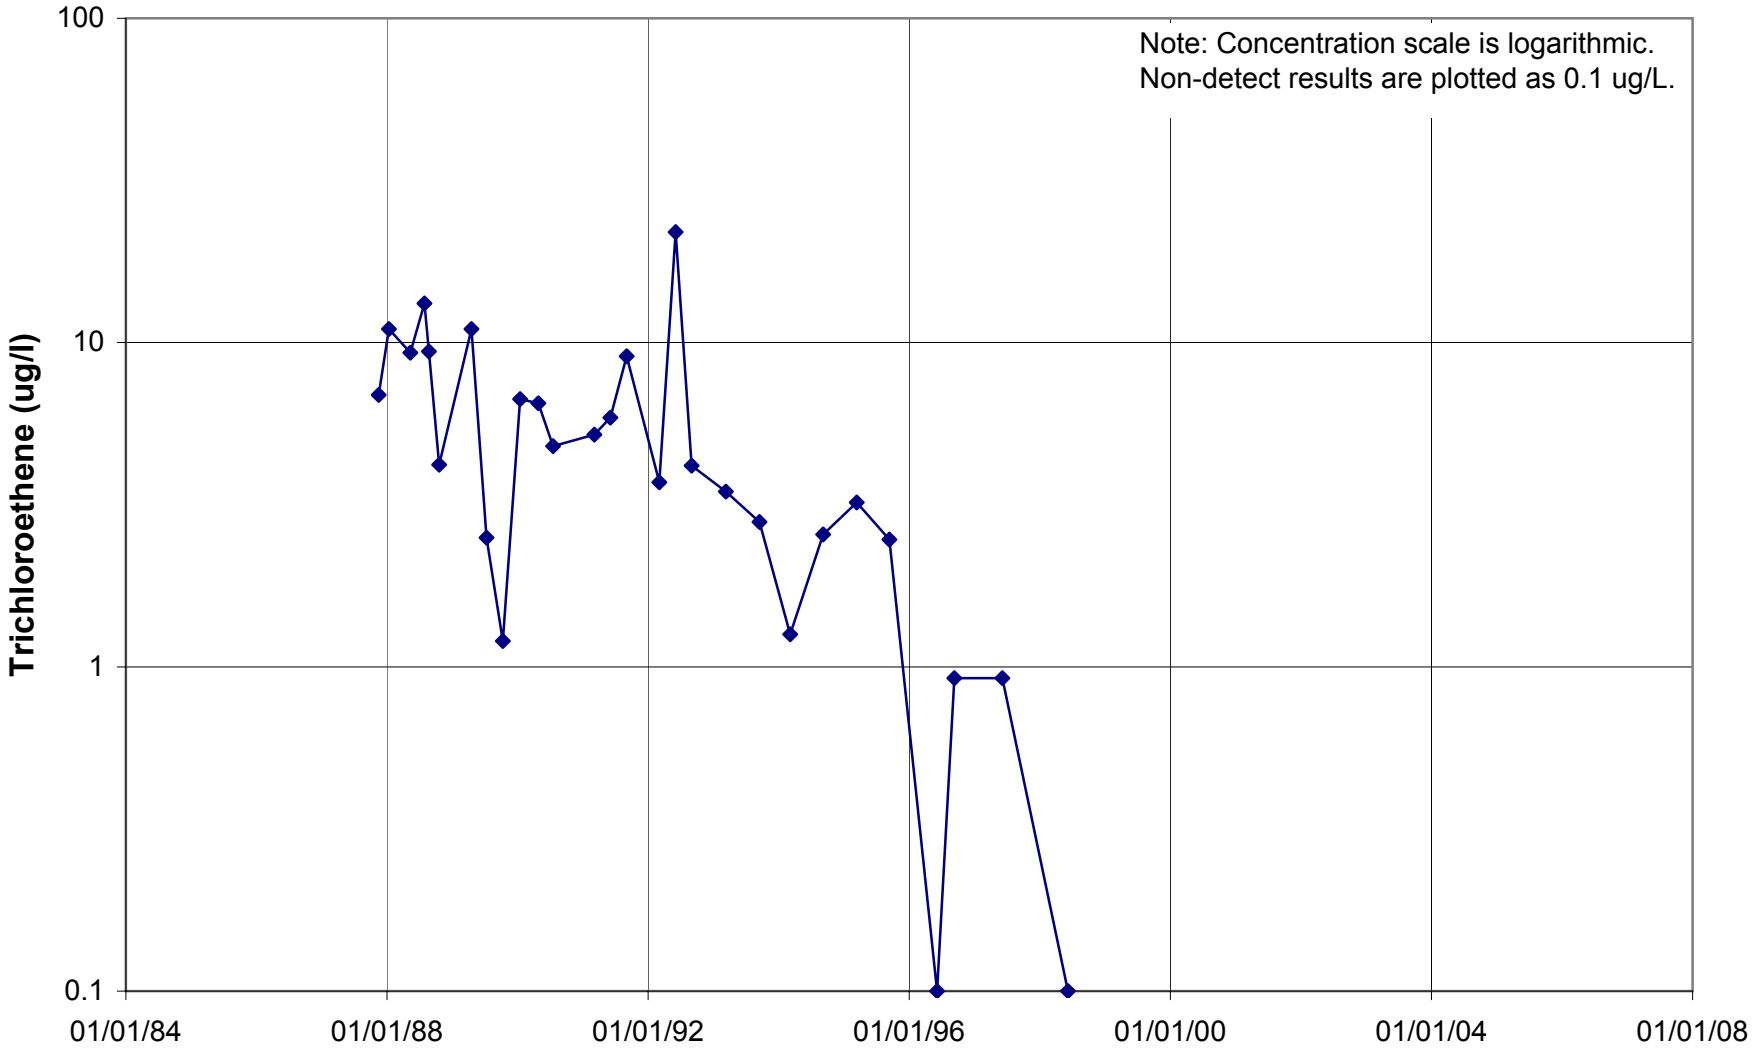

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U002

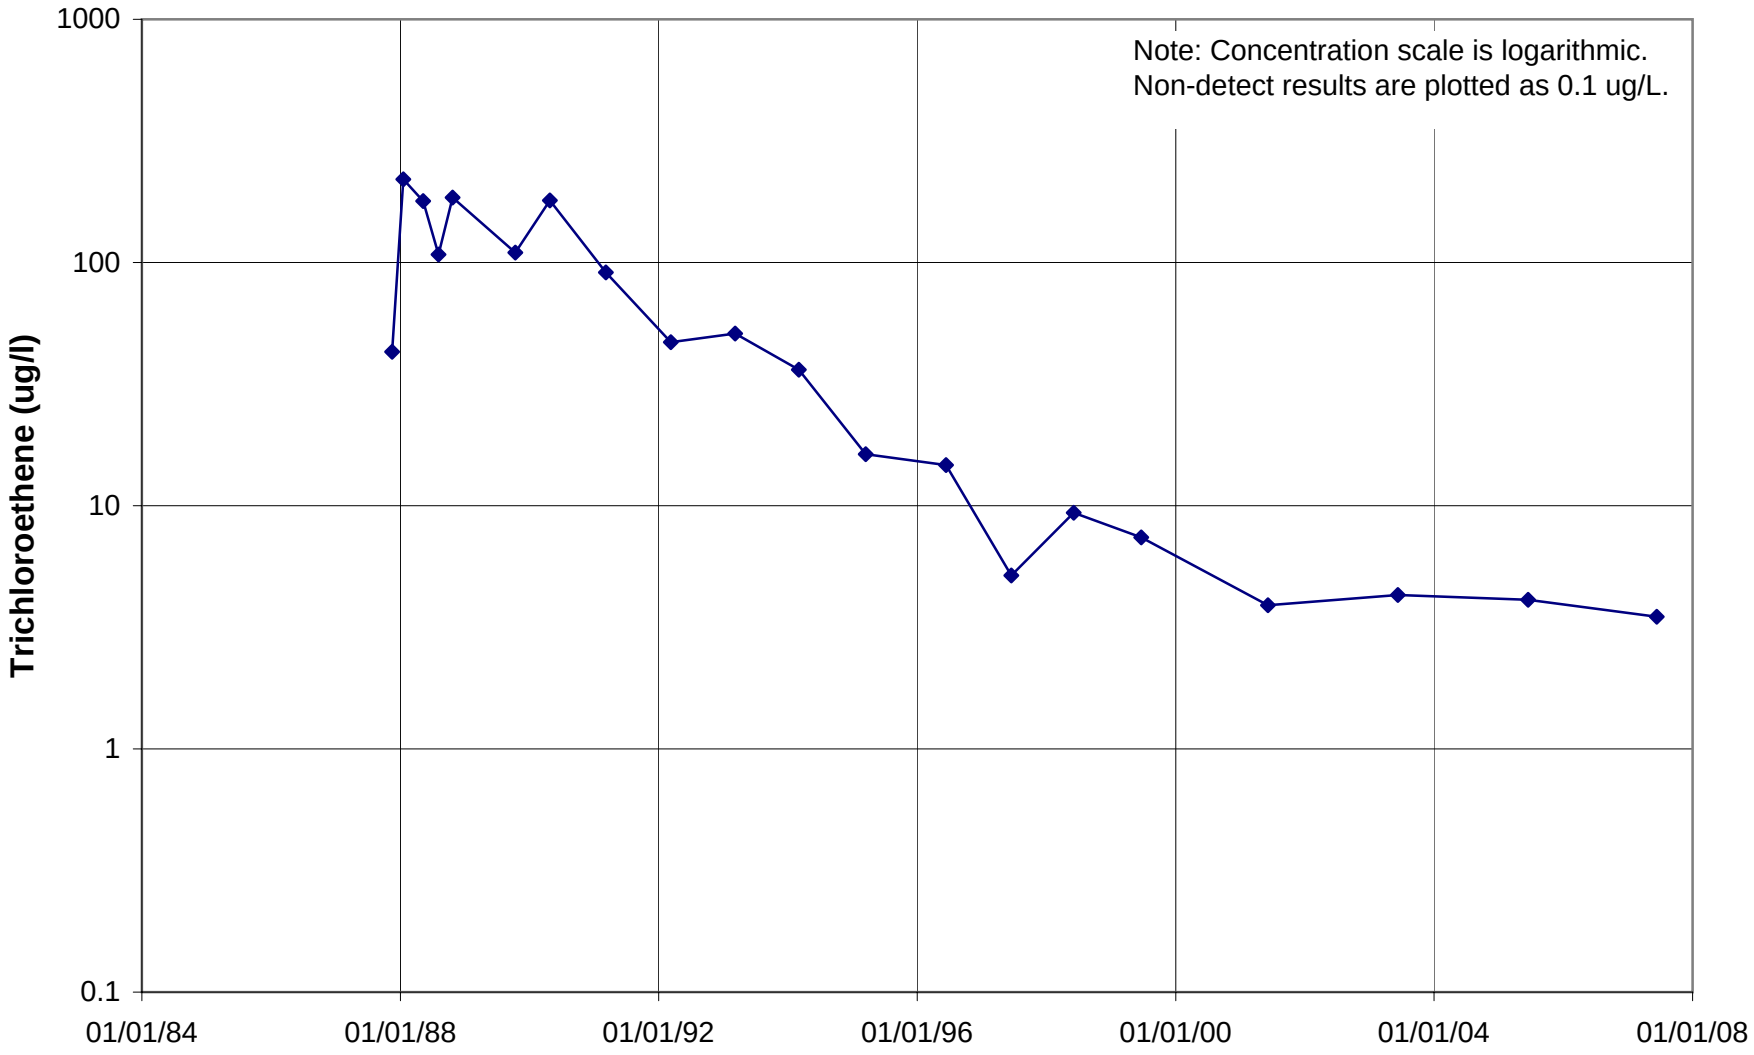

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U003

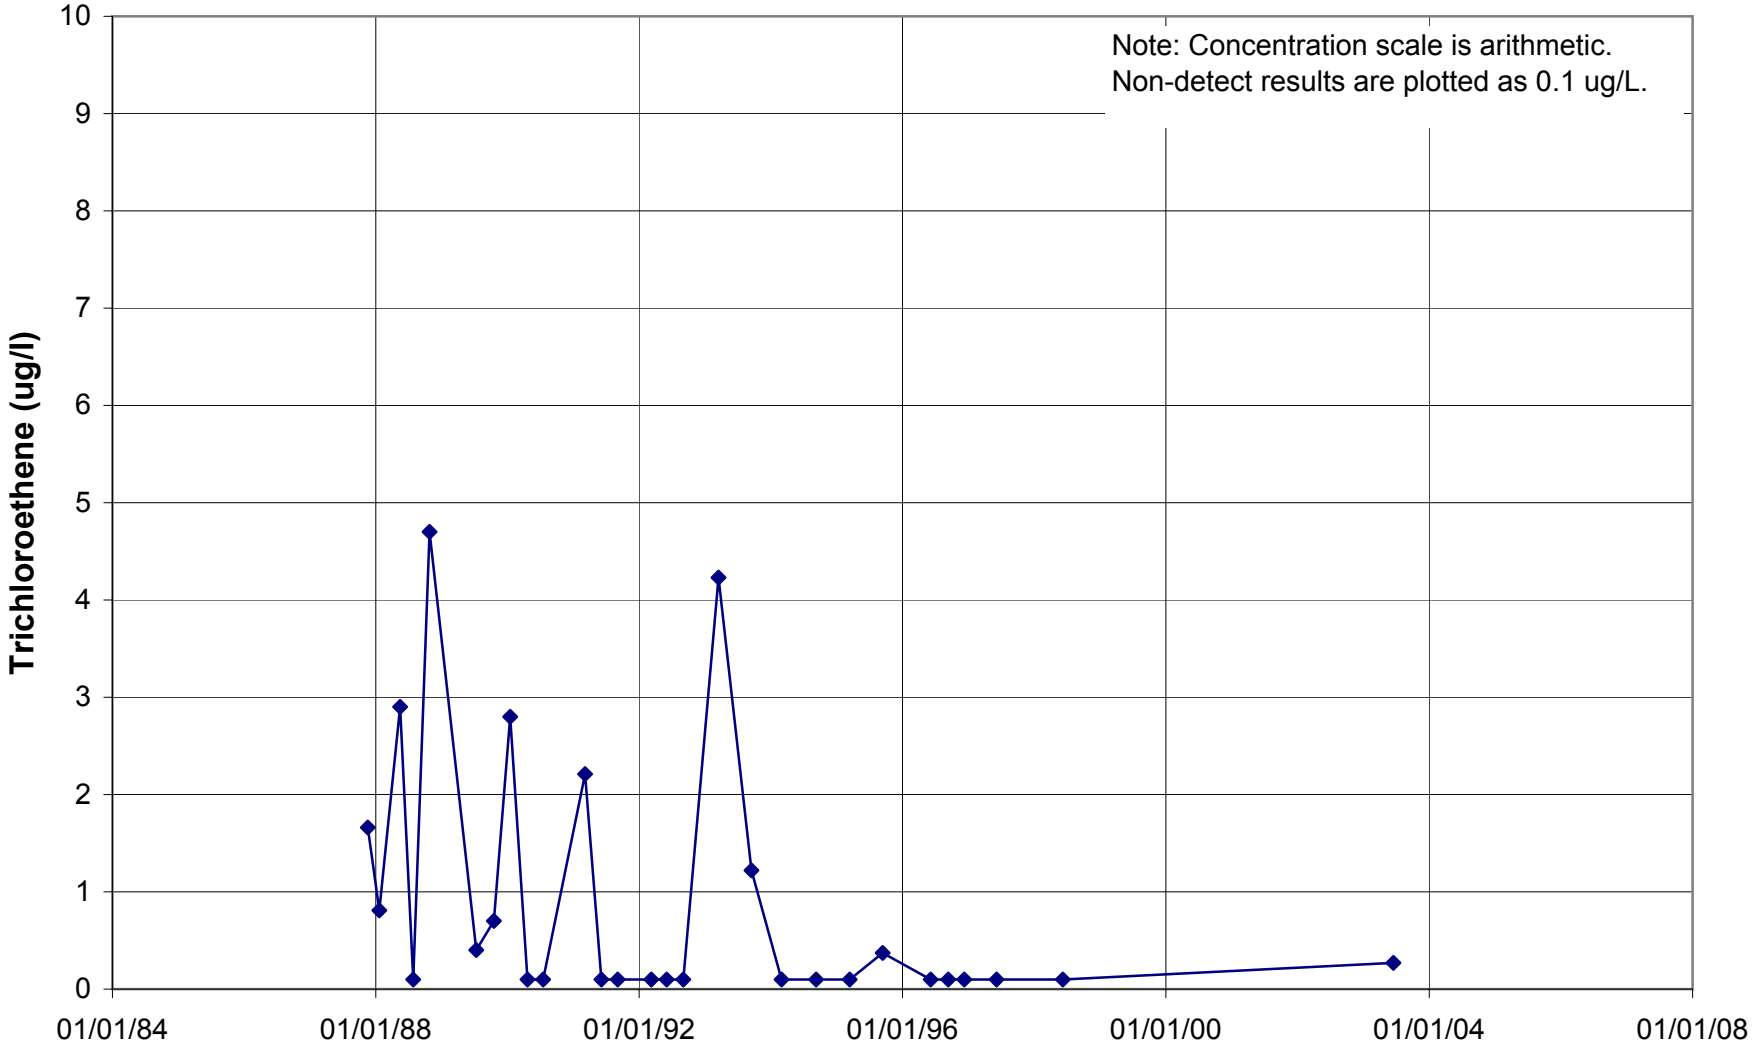

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U007

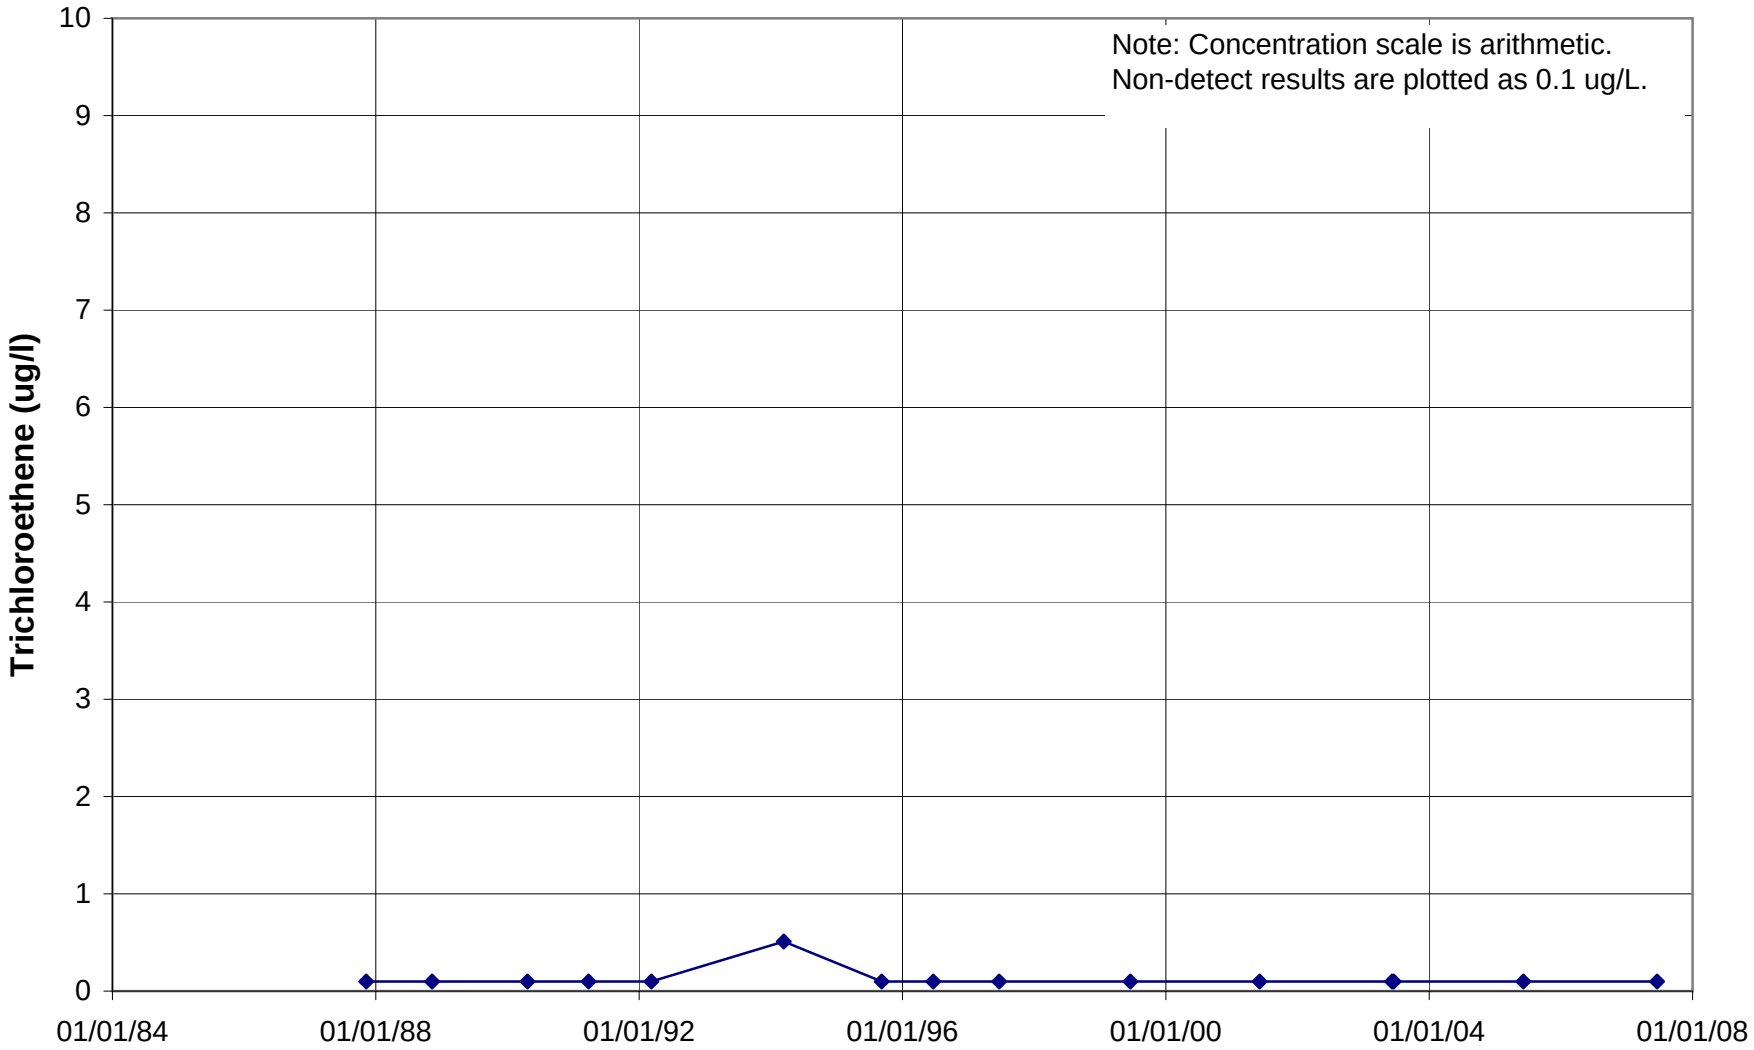

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U012

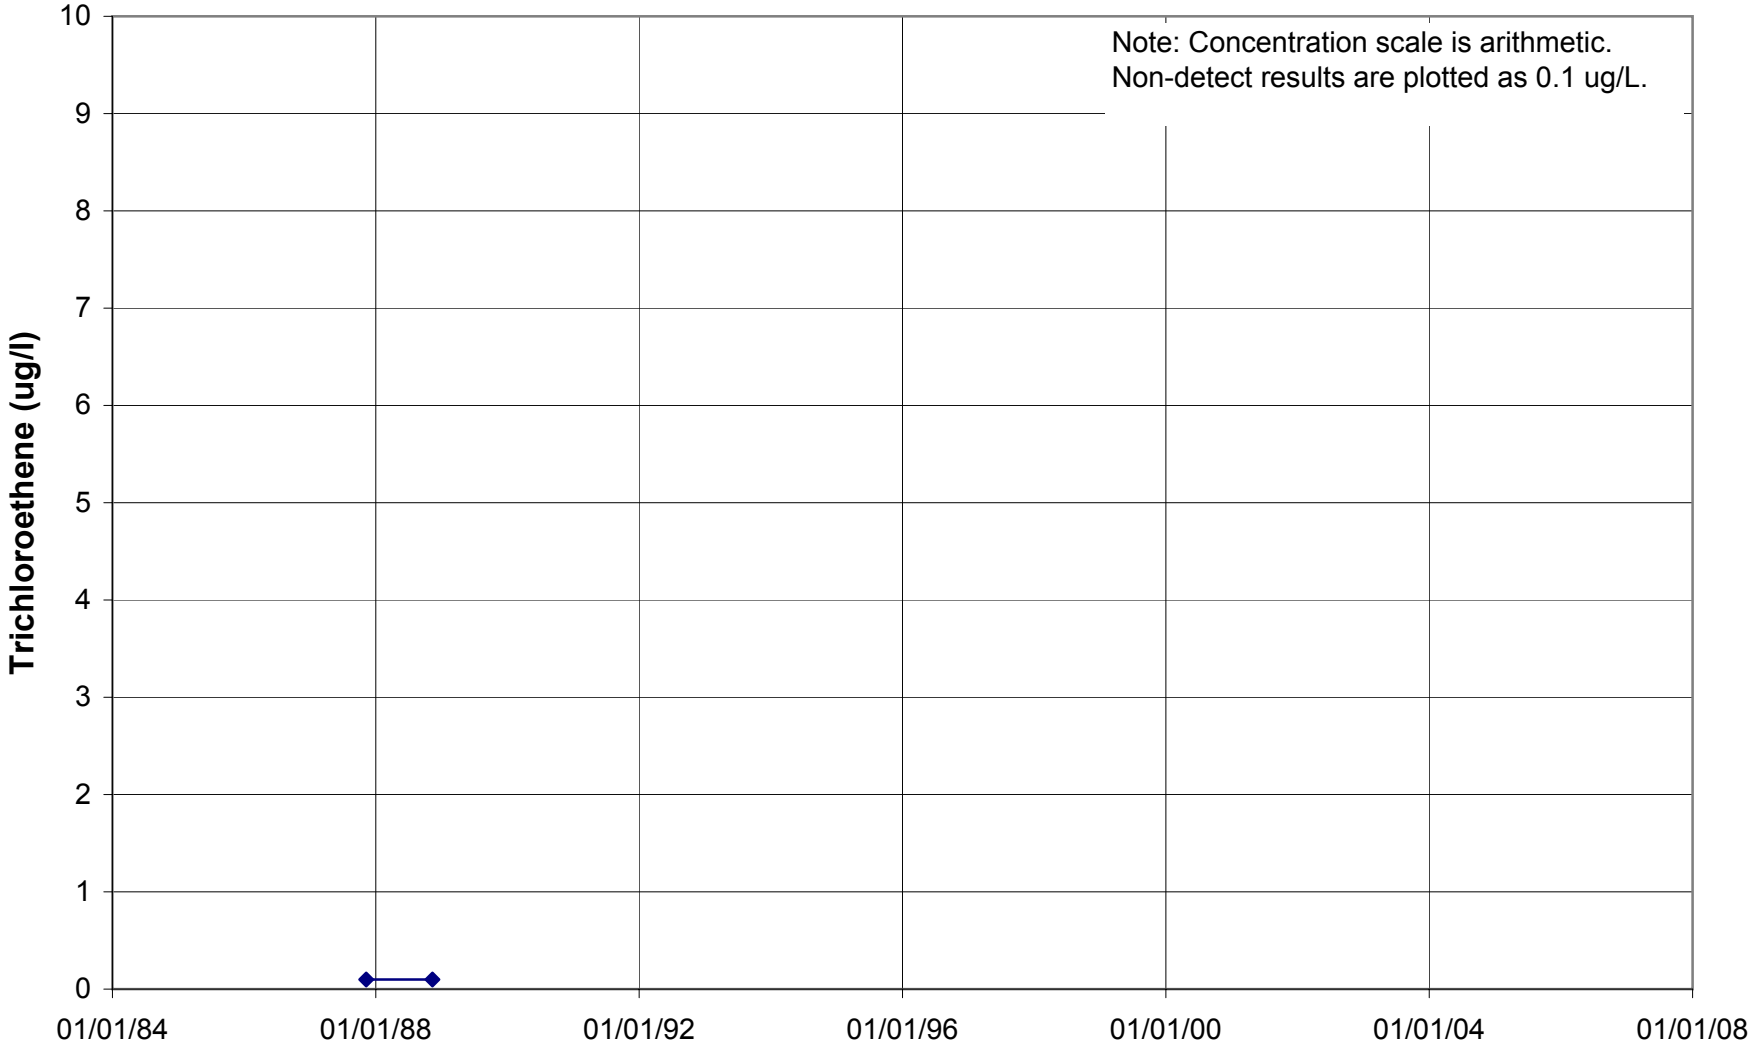

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U020

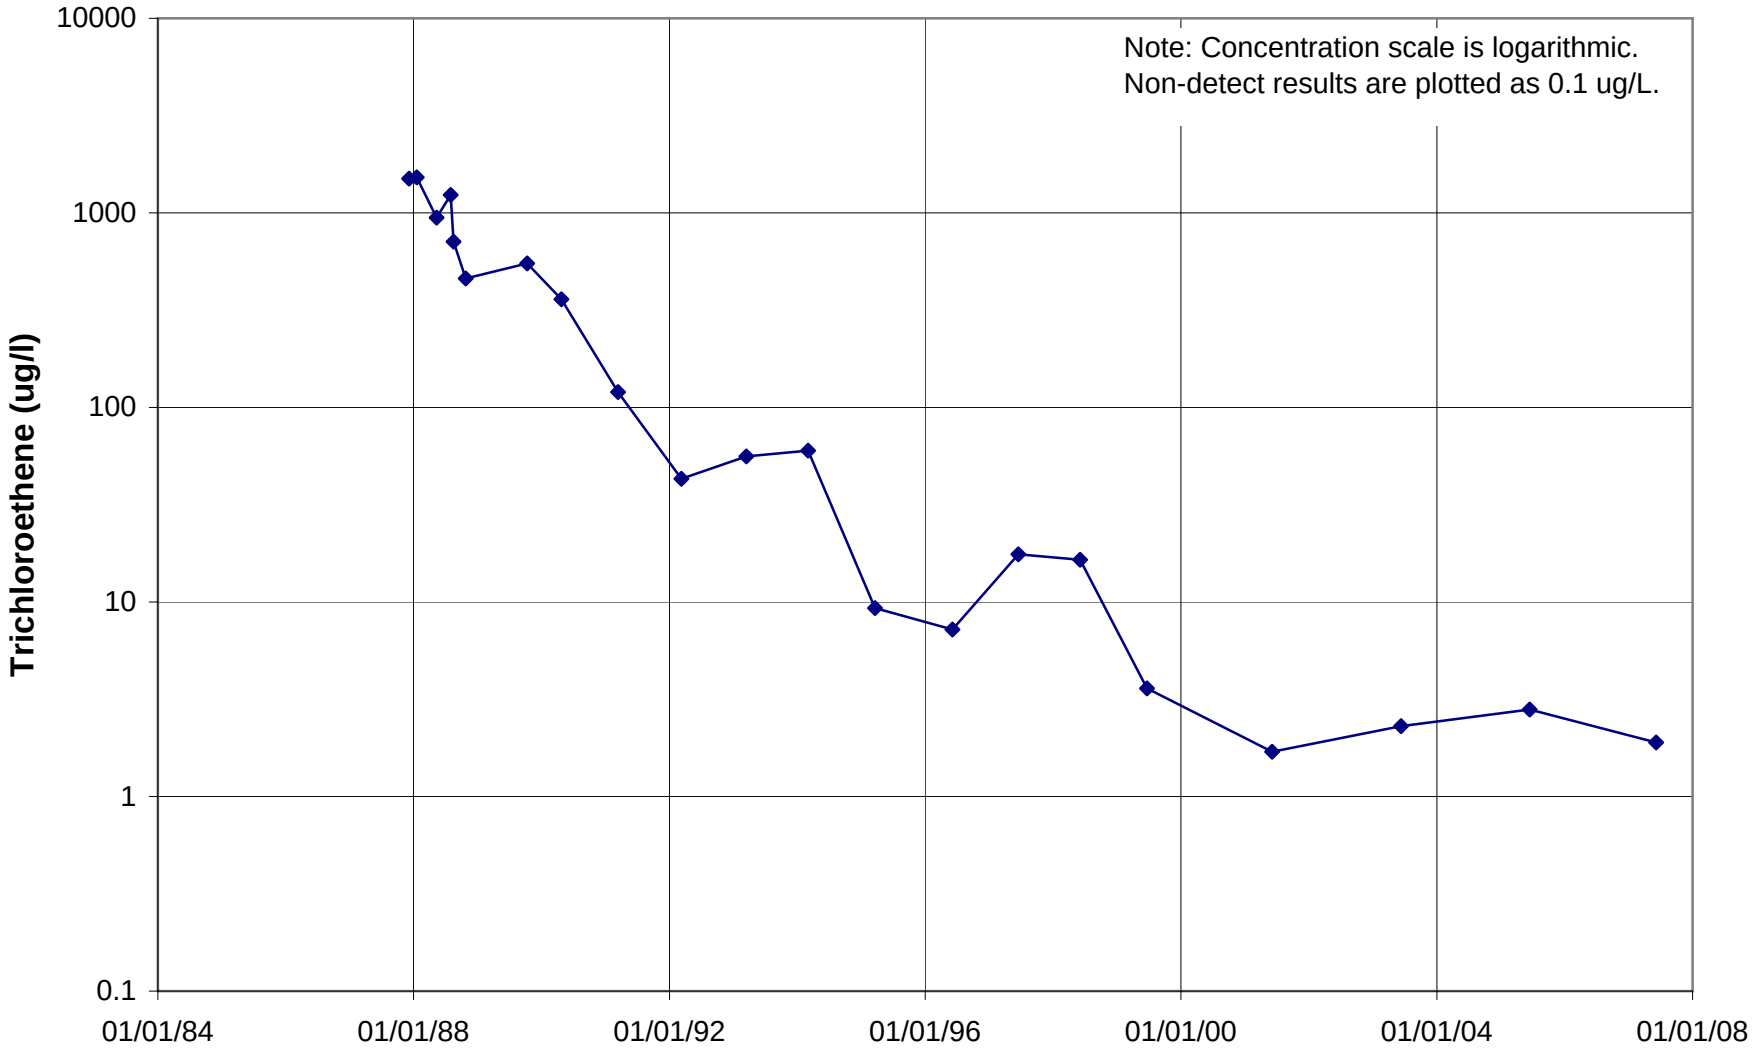

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U027

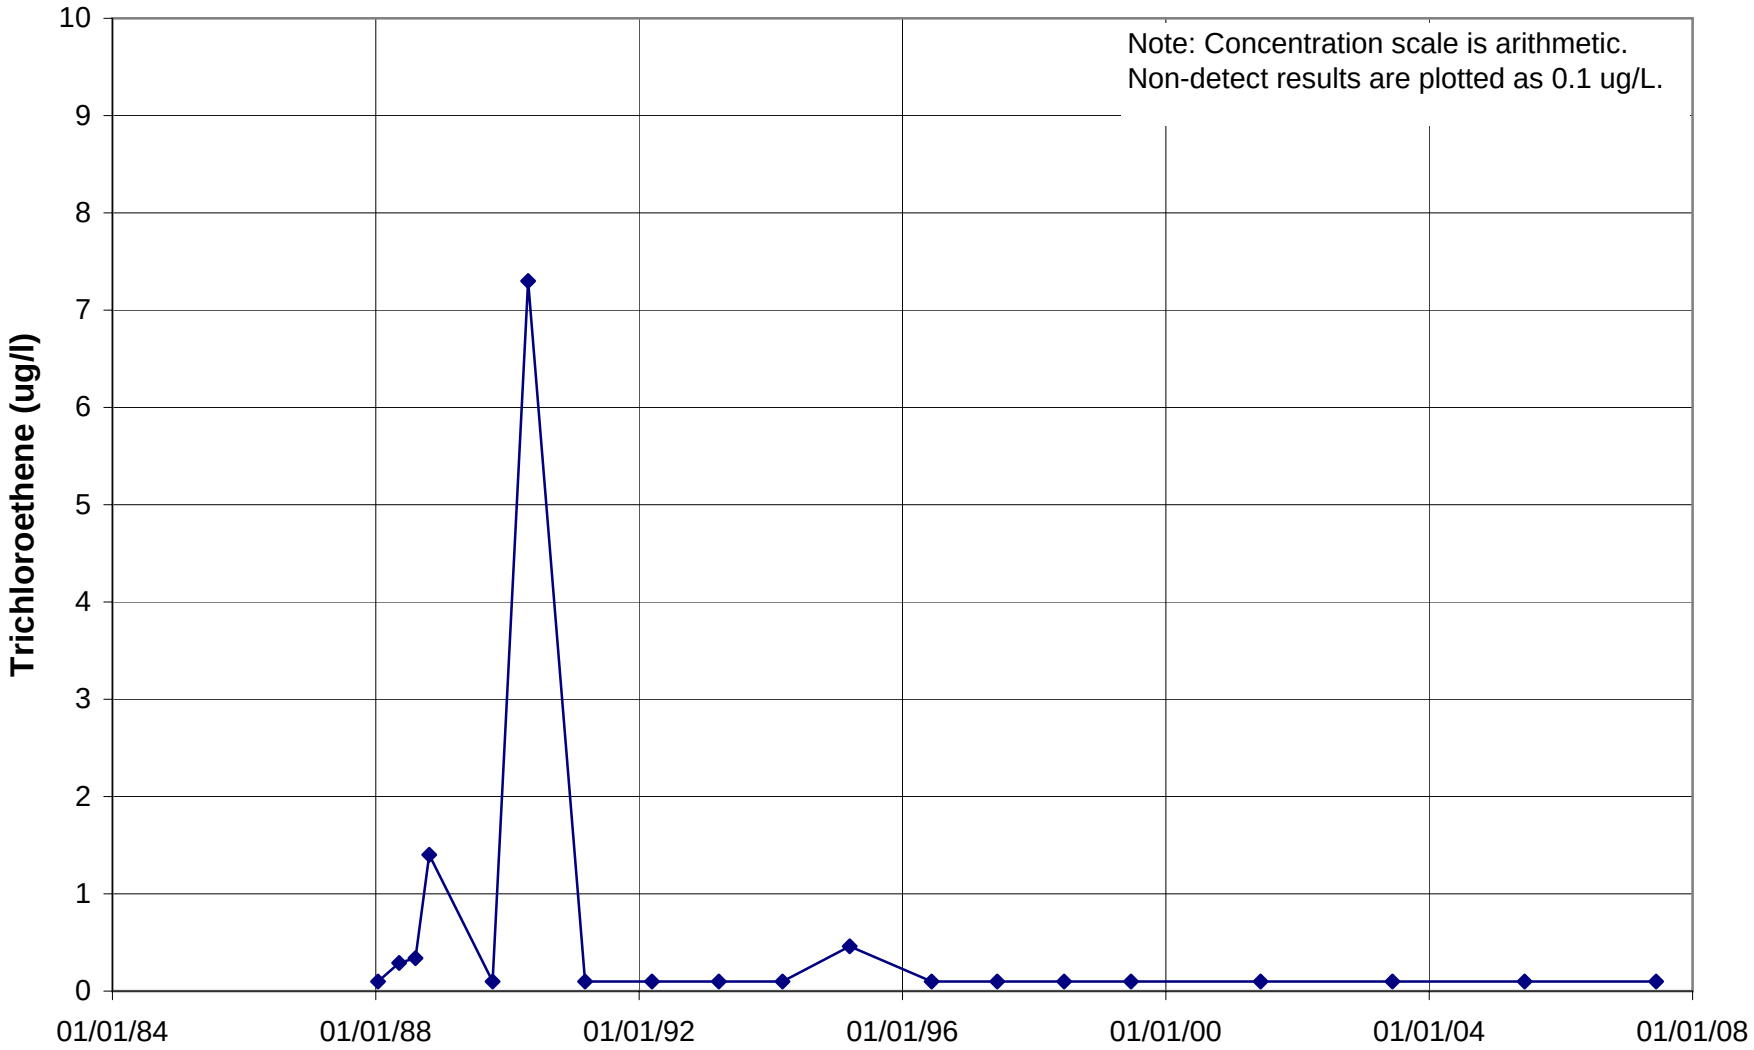

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U077

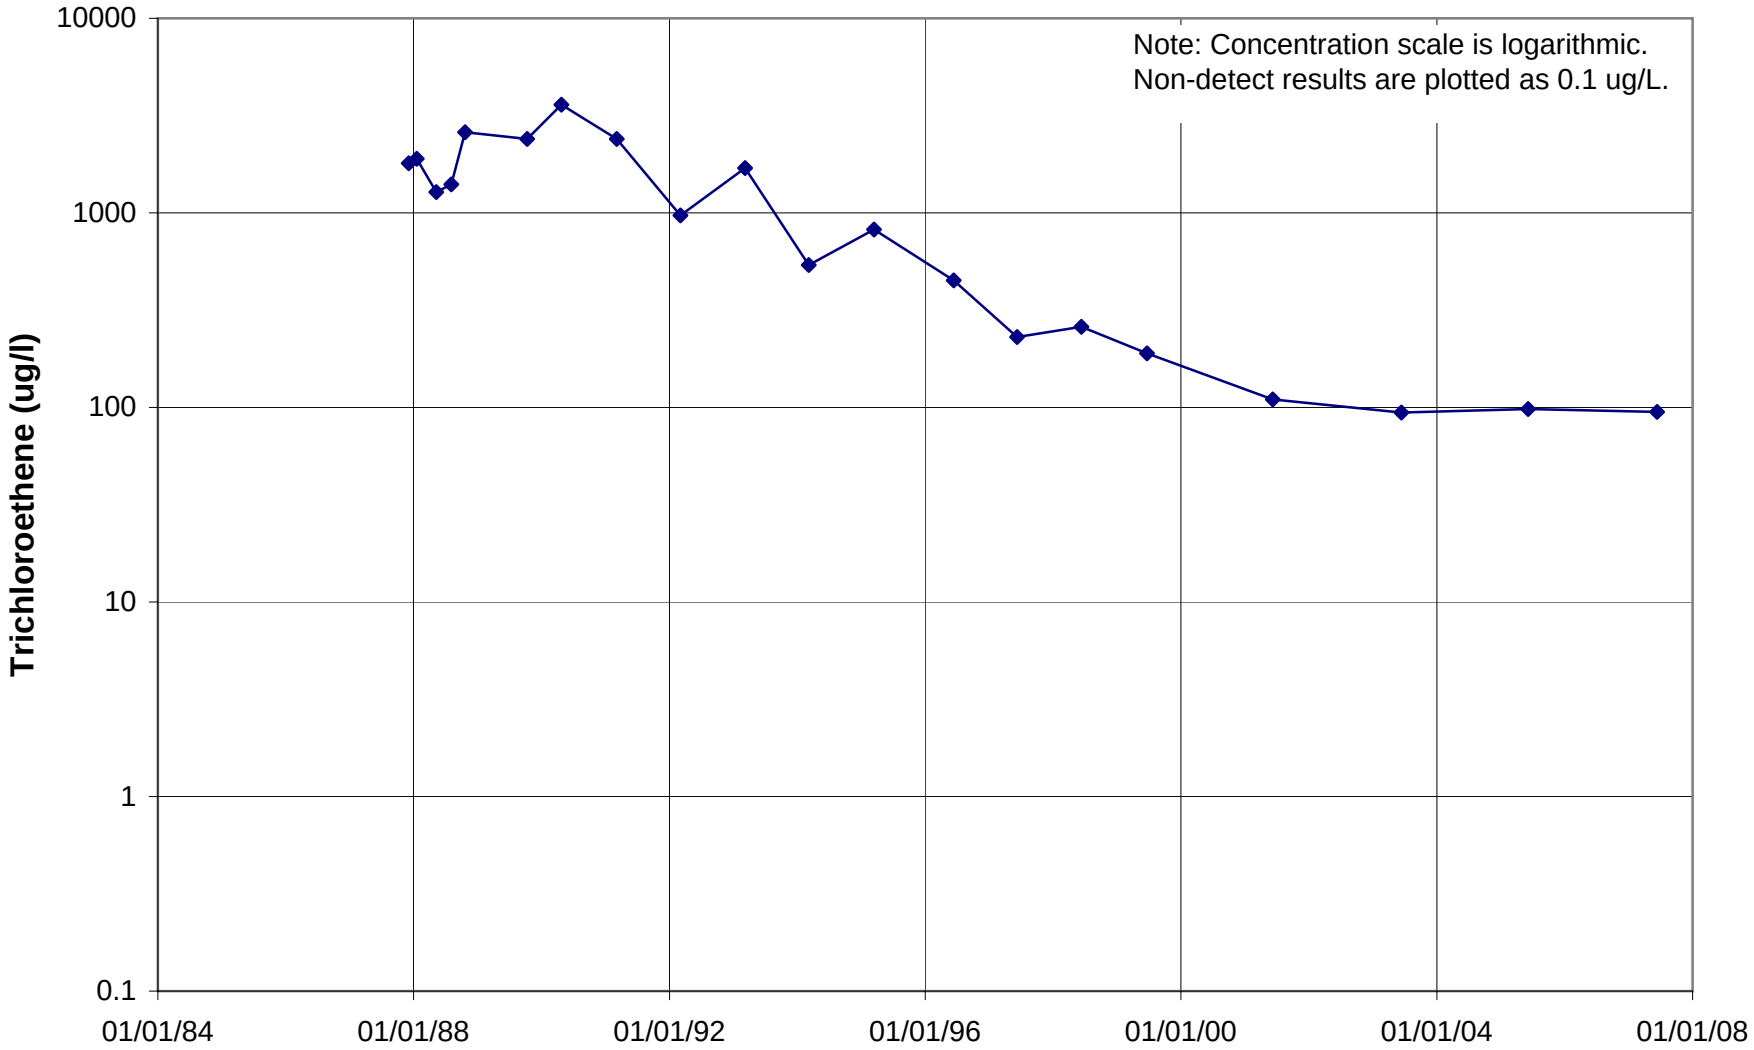

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U414 (414U4)

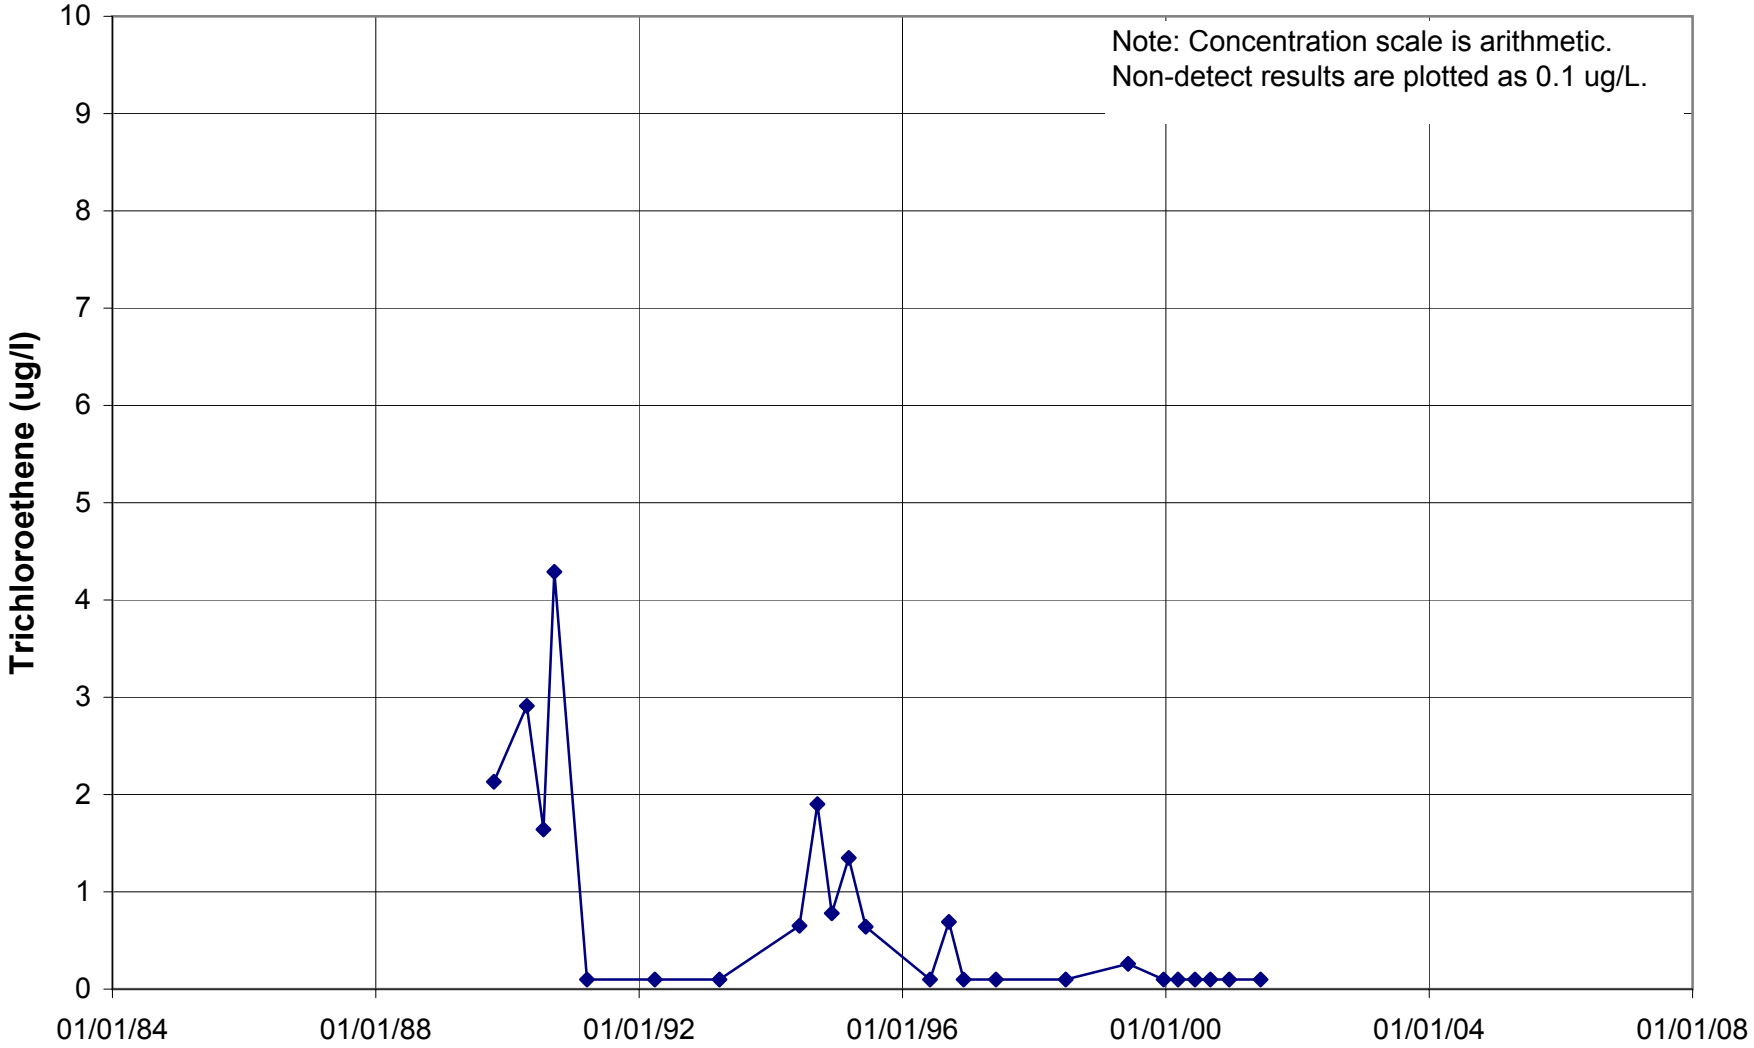

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U510

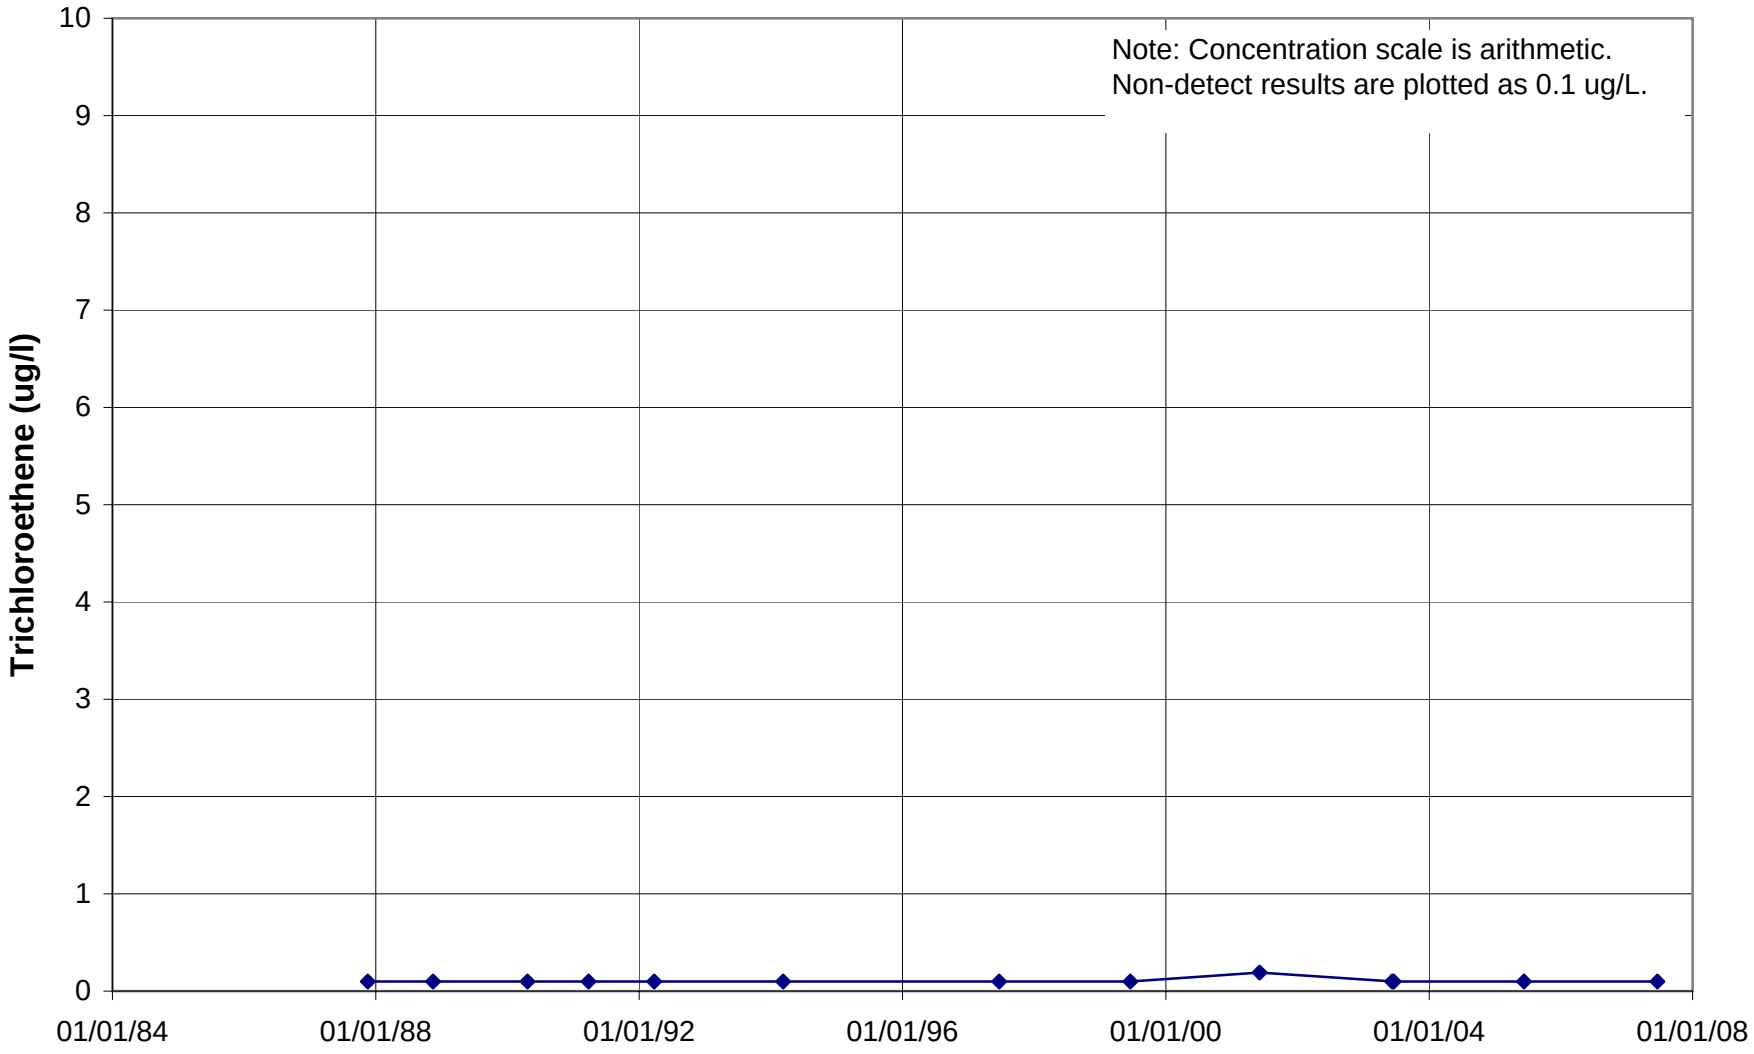

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U673

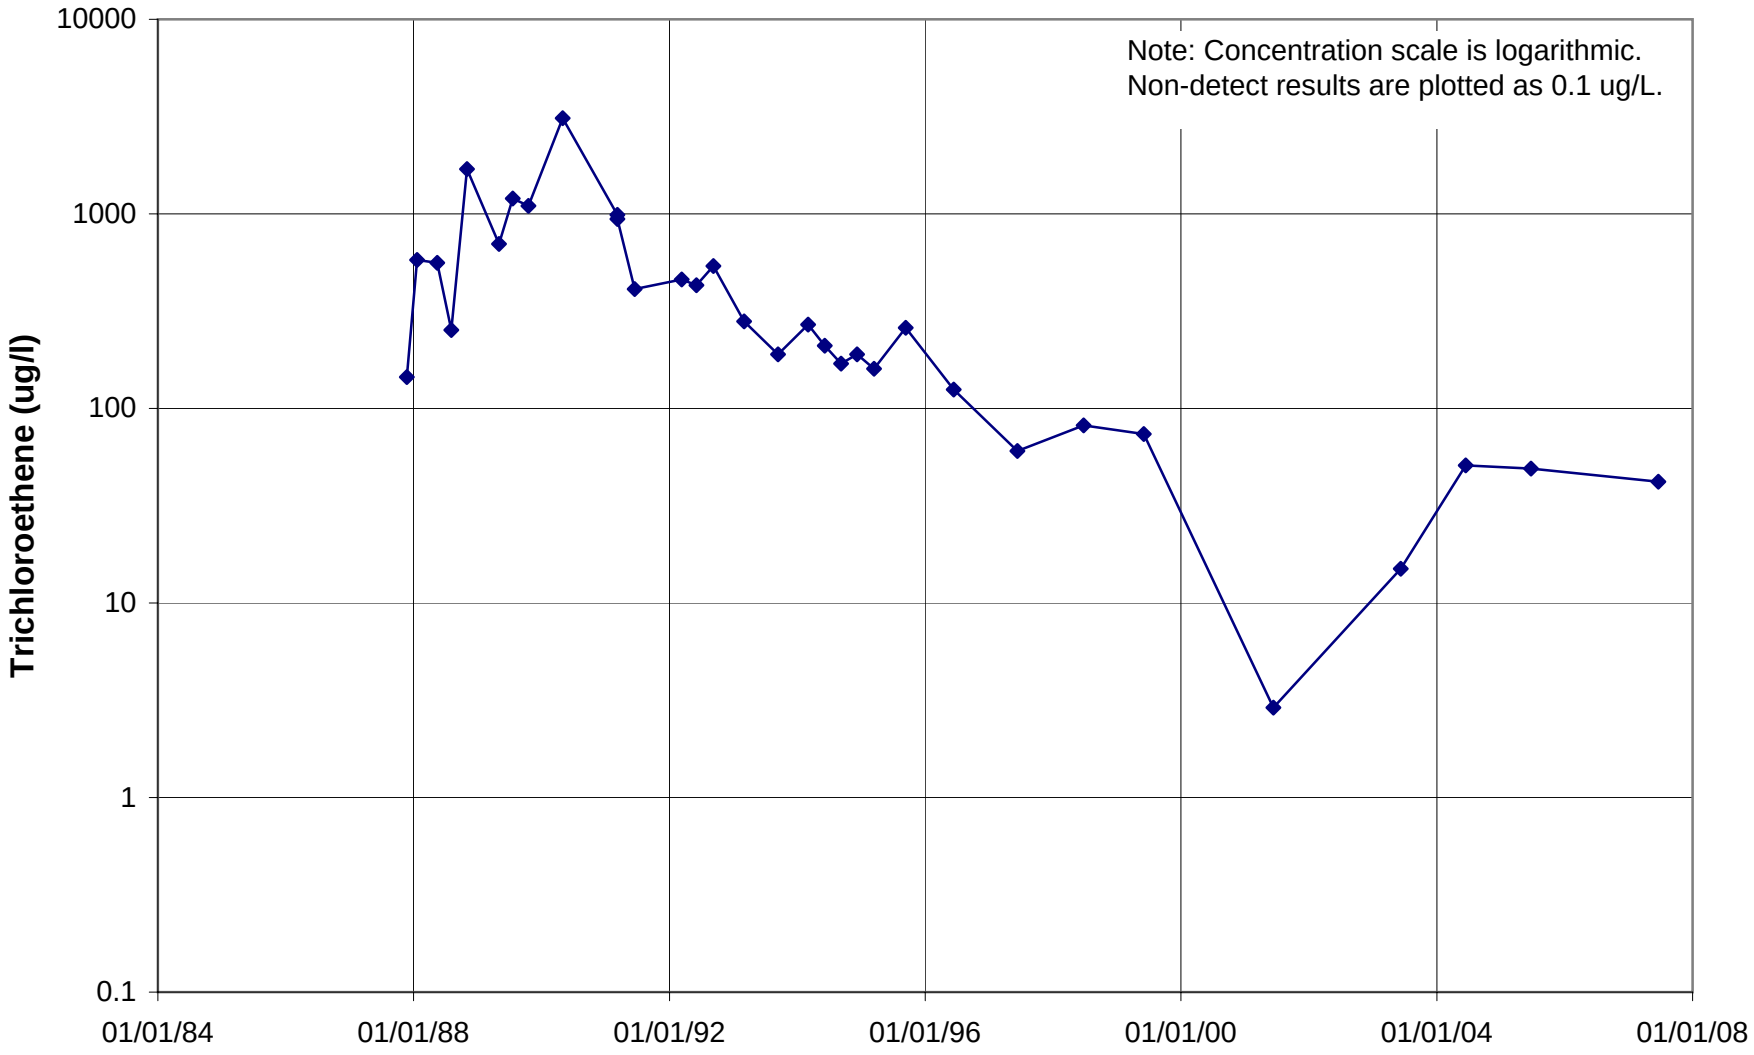

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U701

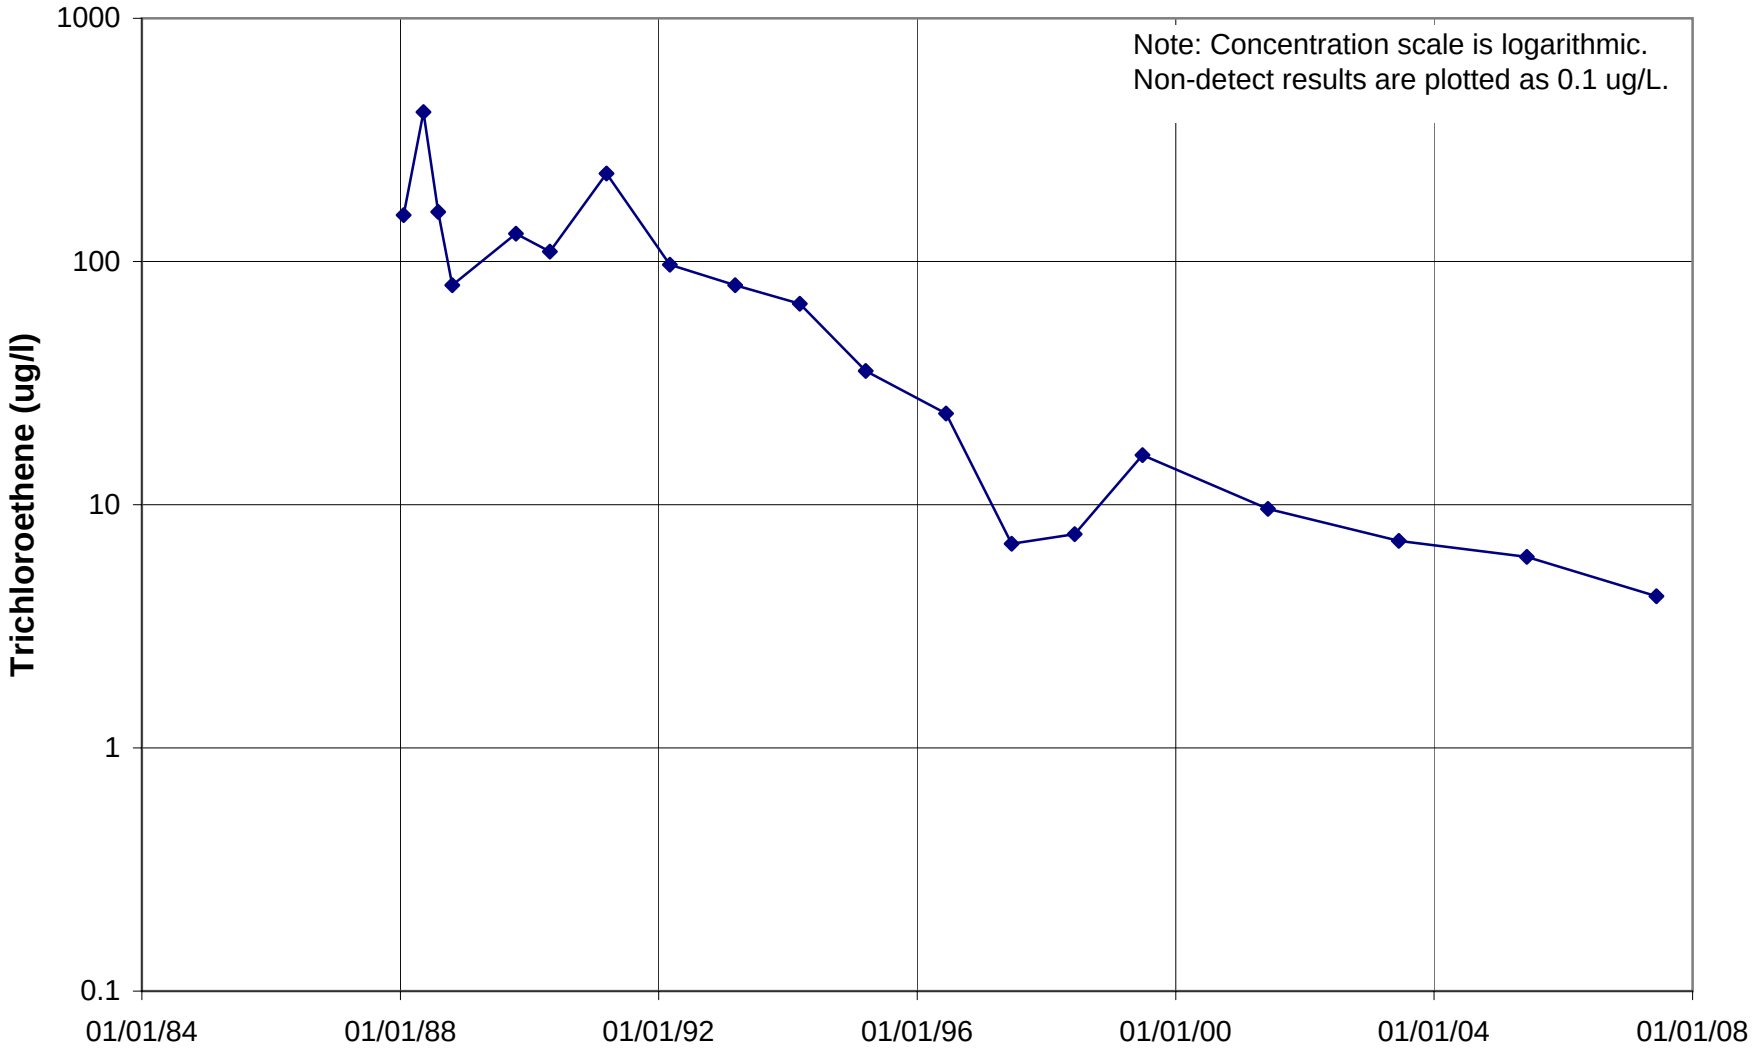

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U702

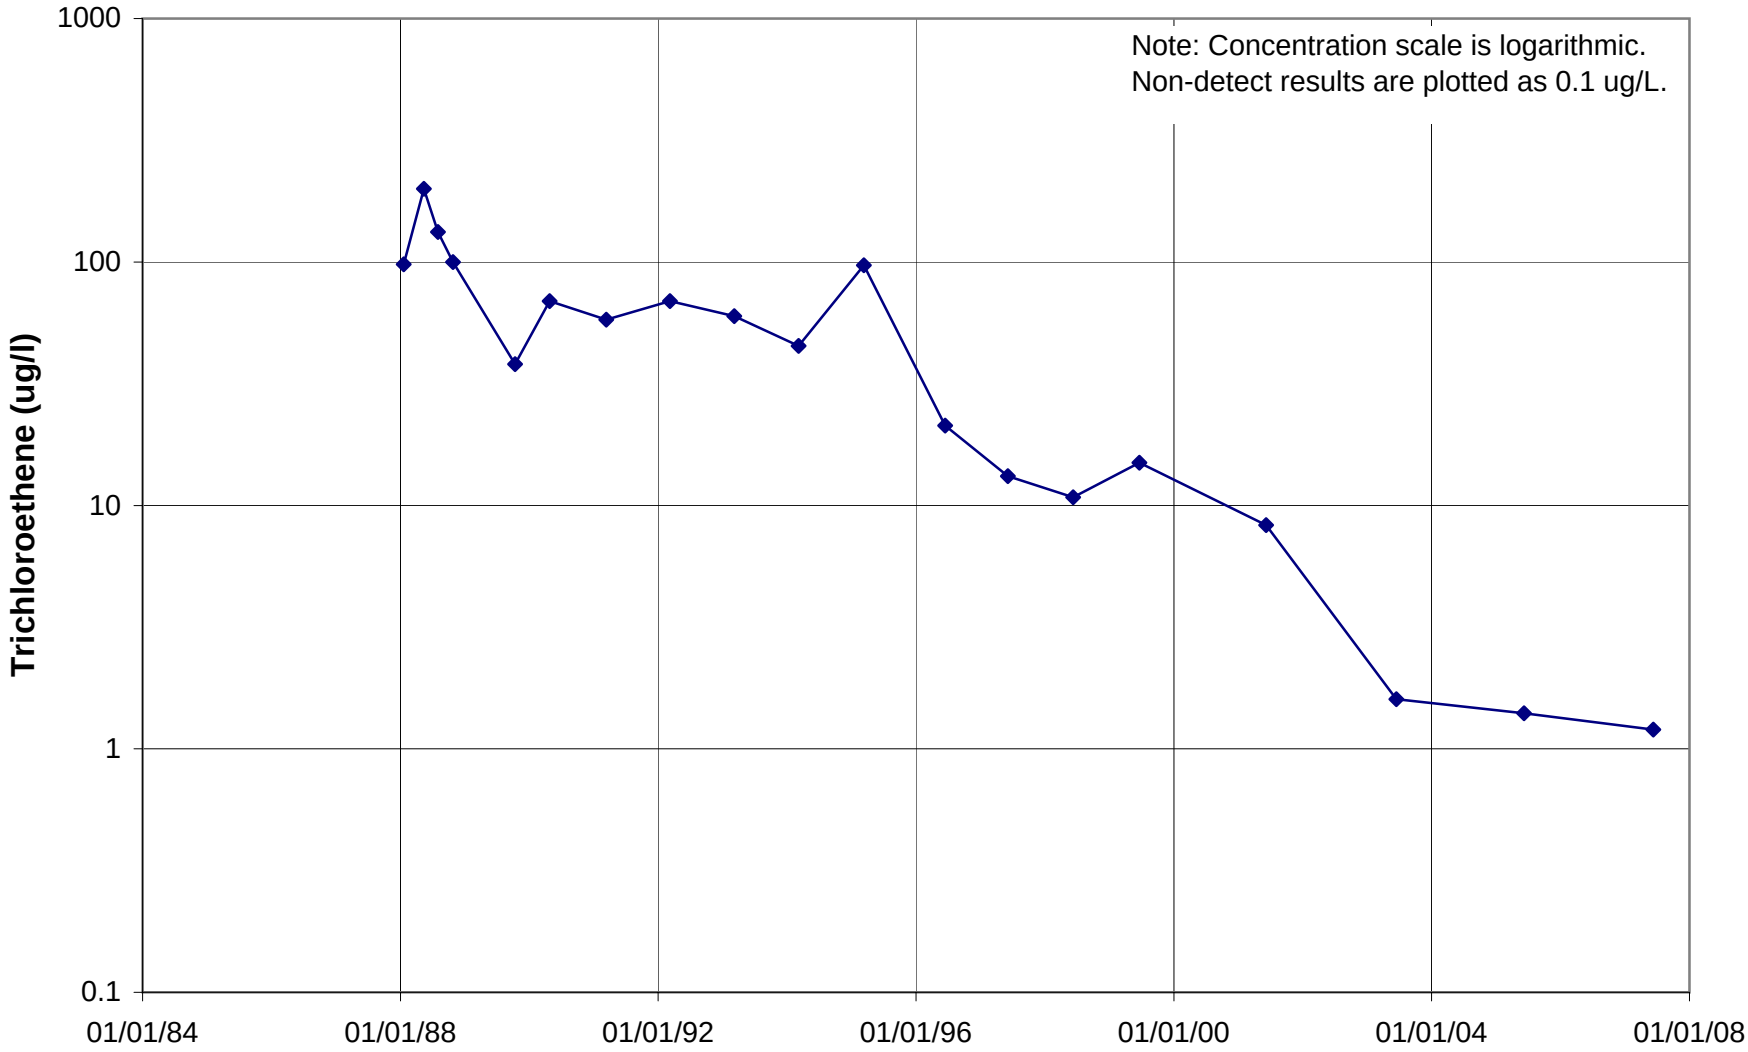

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U708

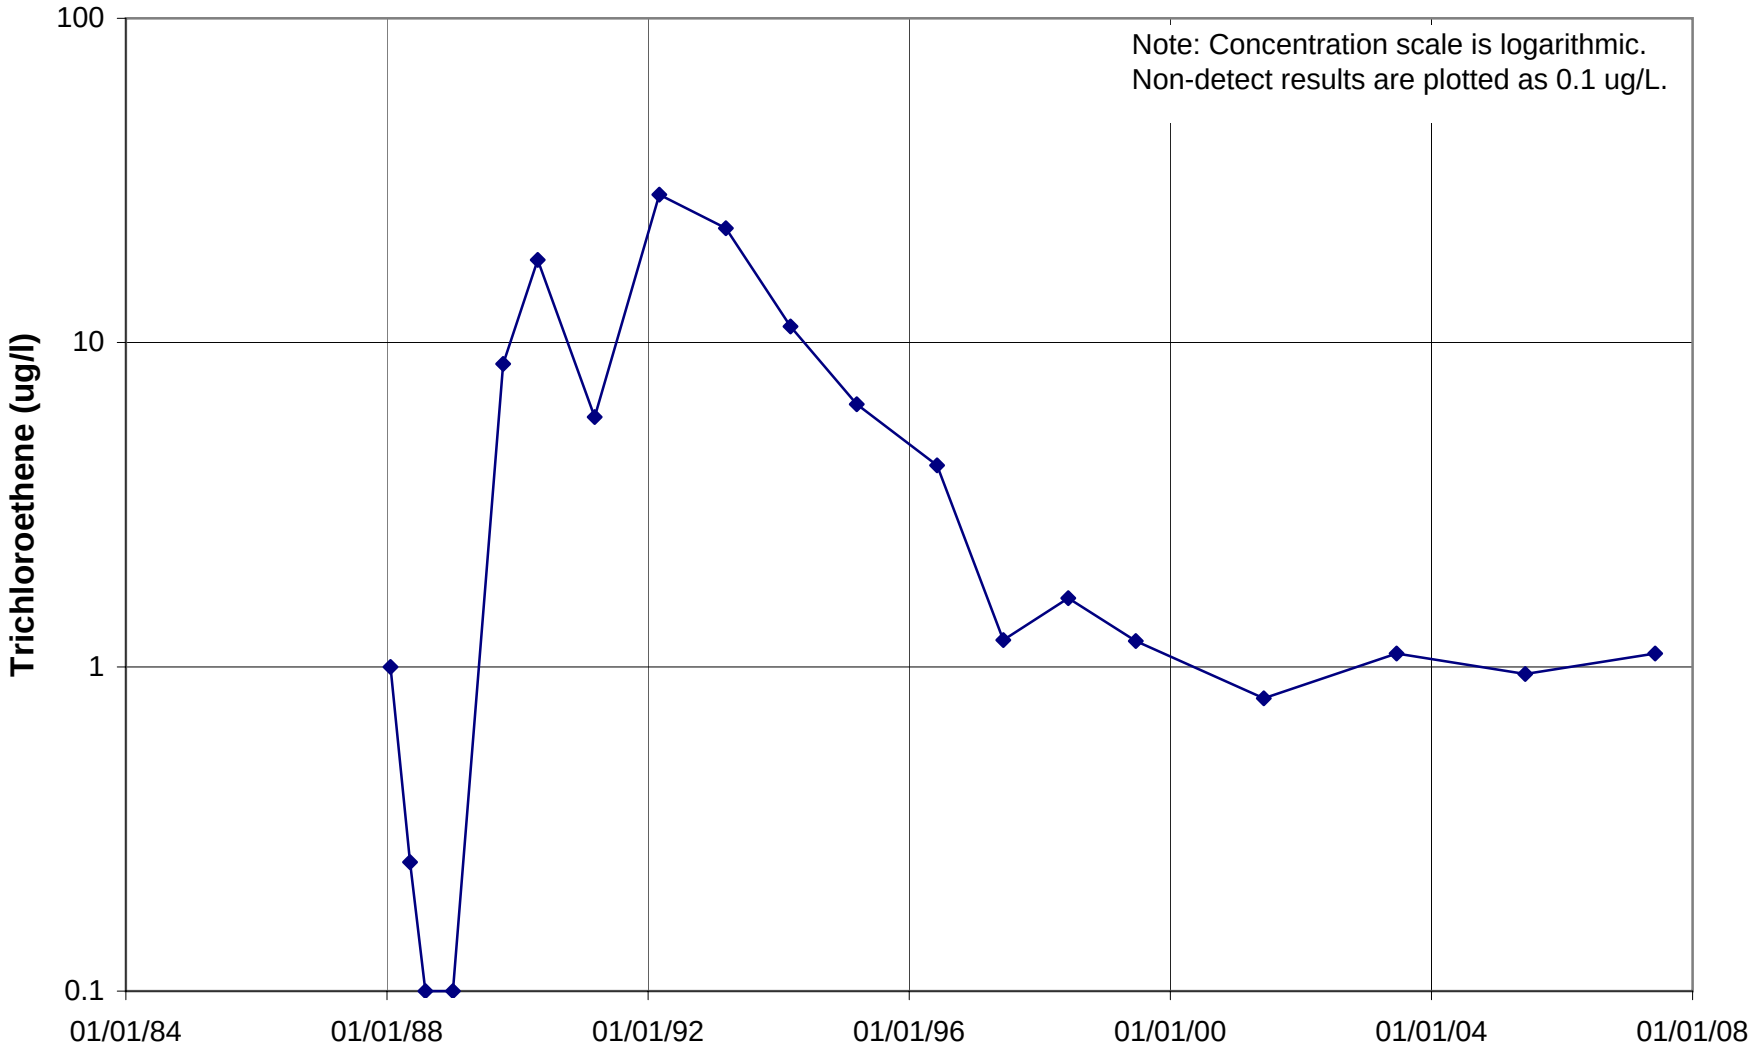

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U709

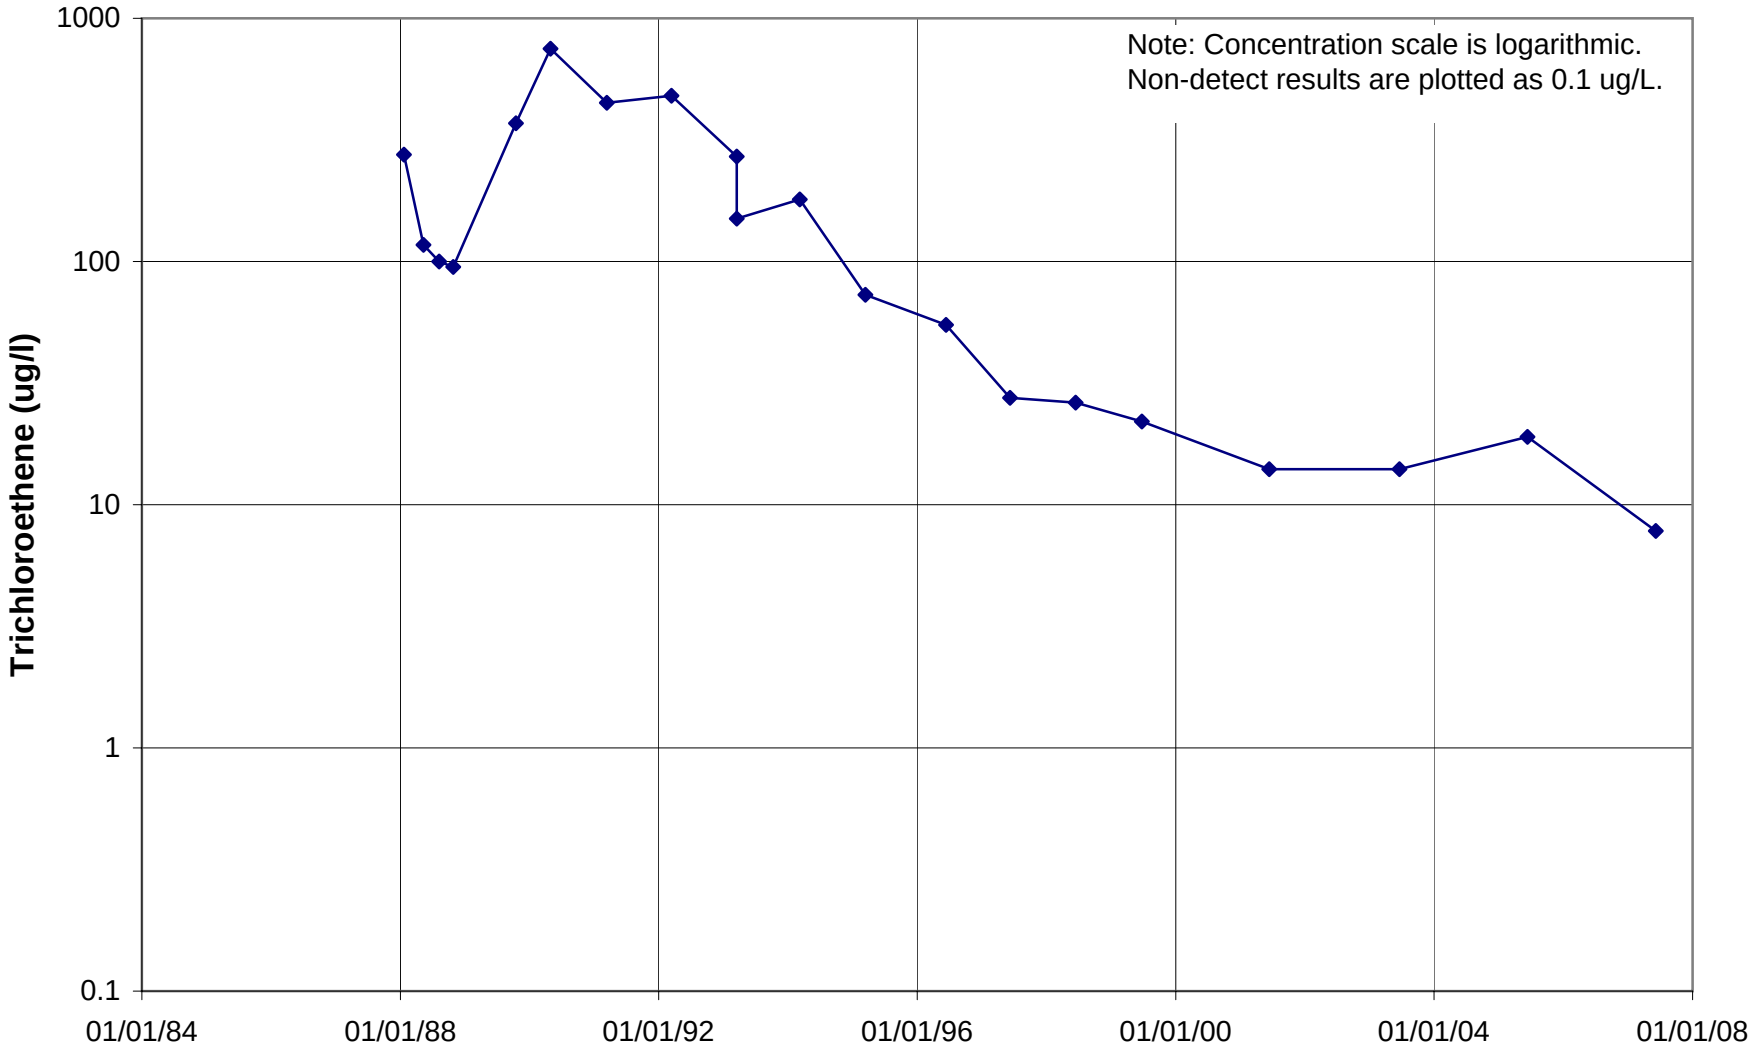

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U711

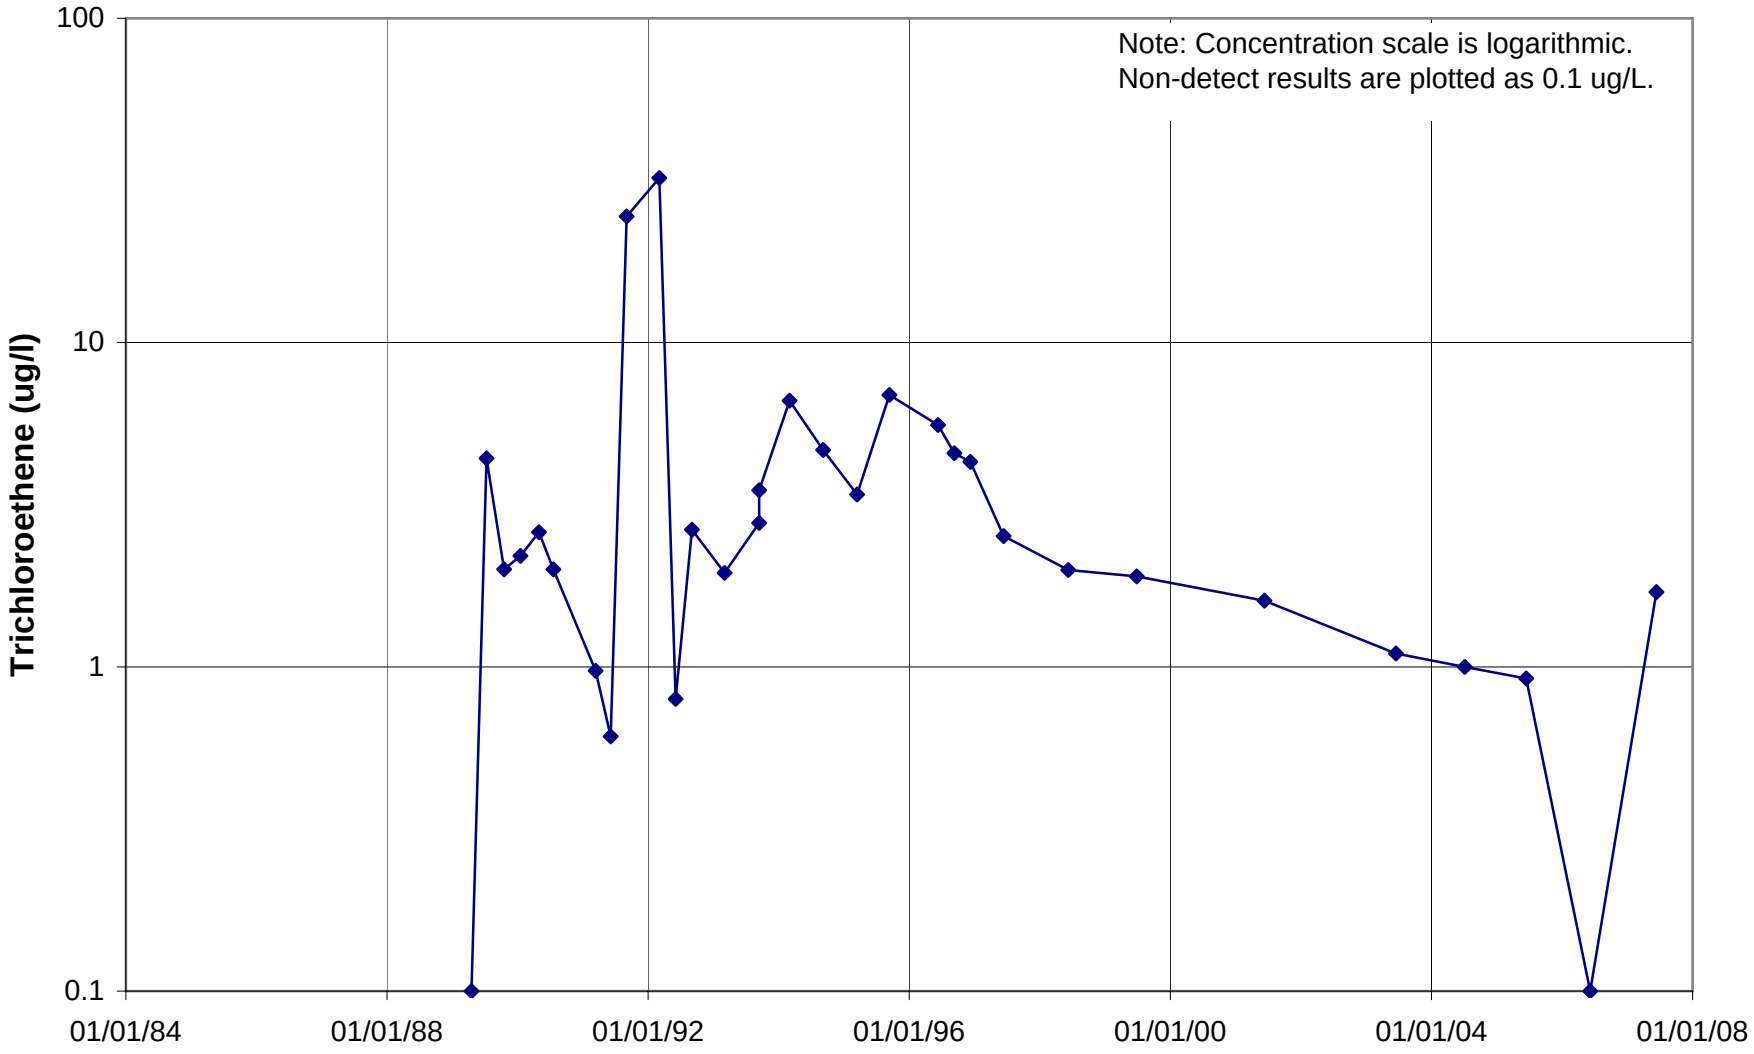

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U713

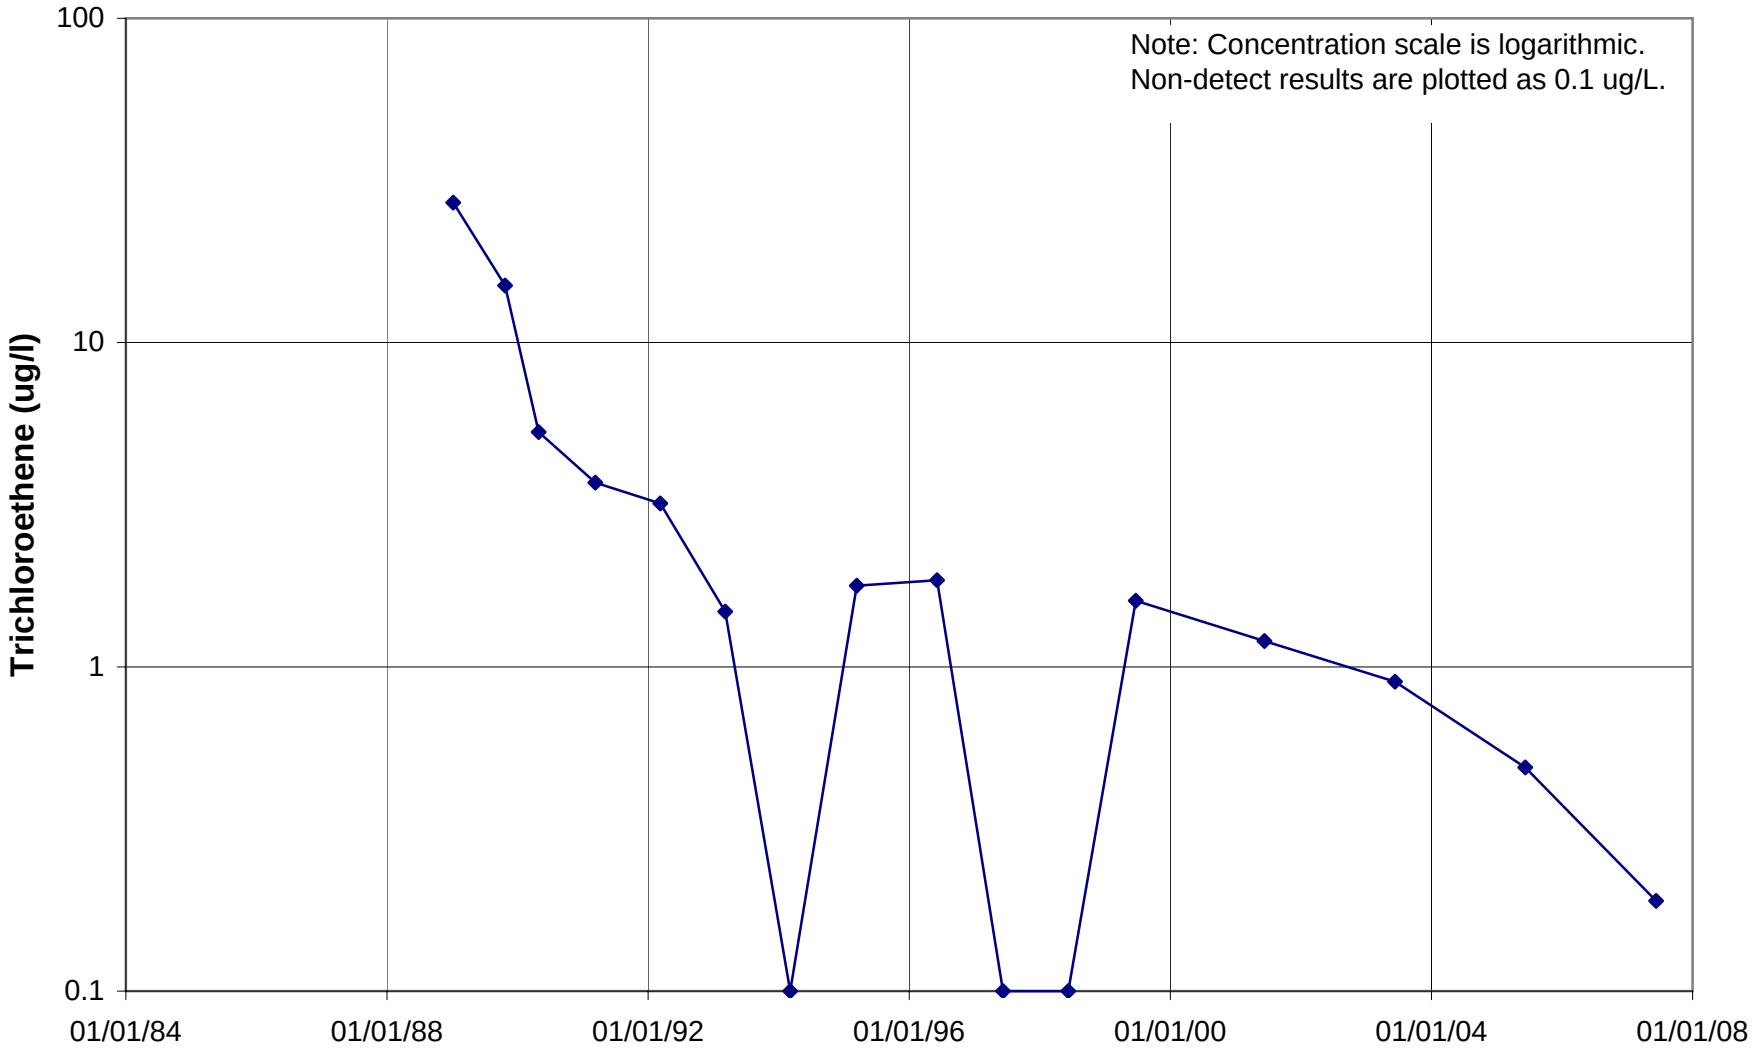

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U714

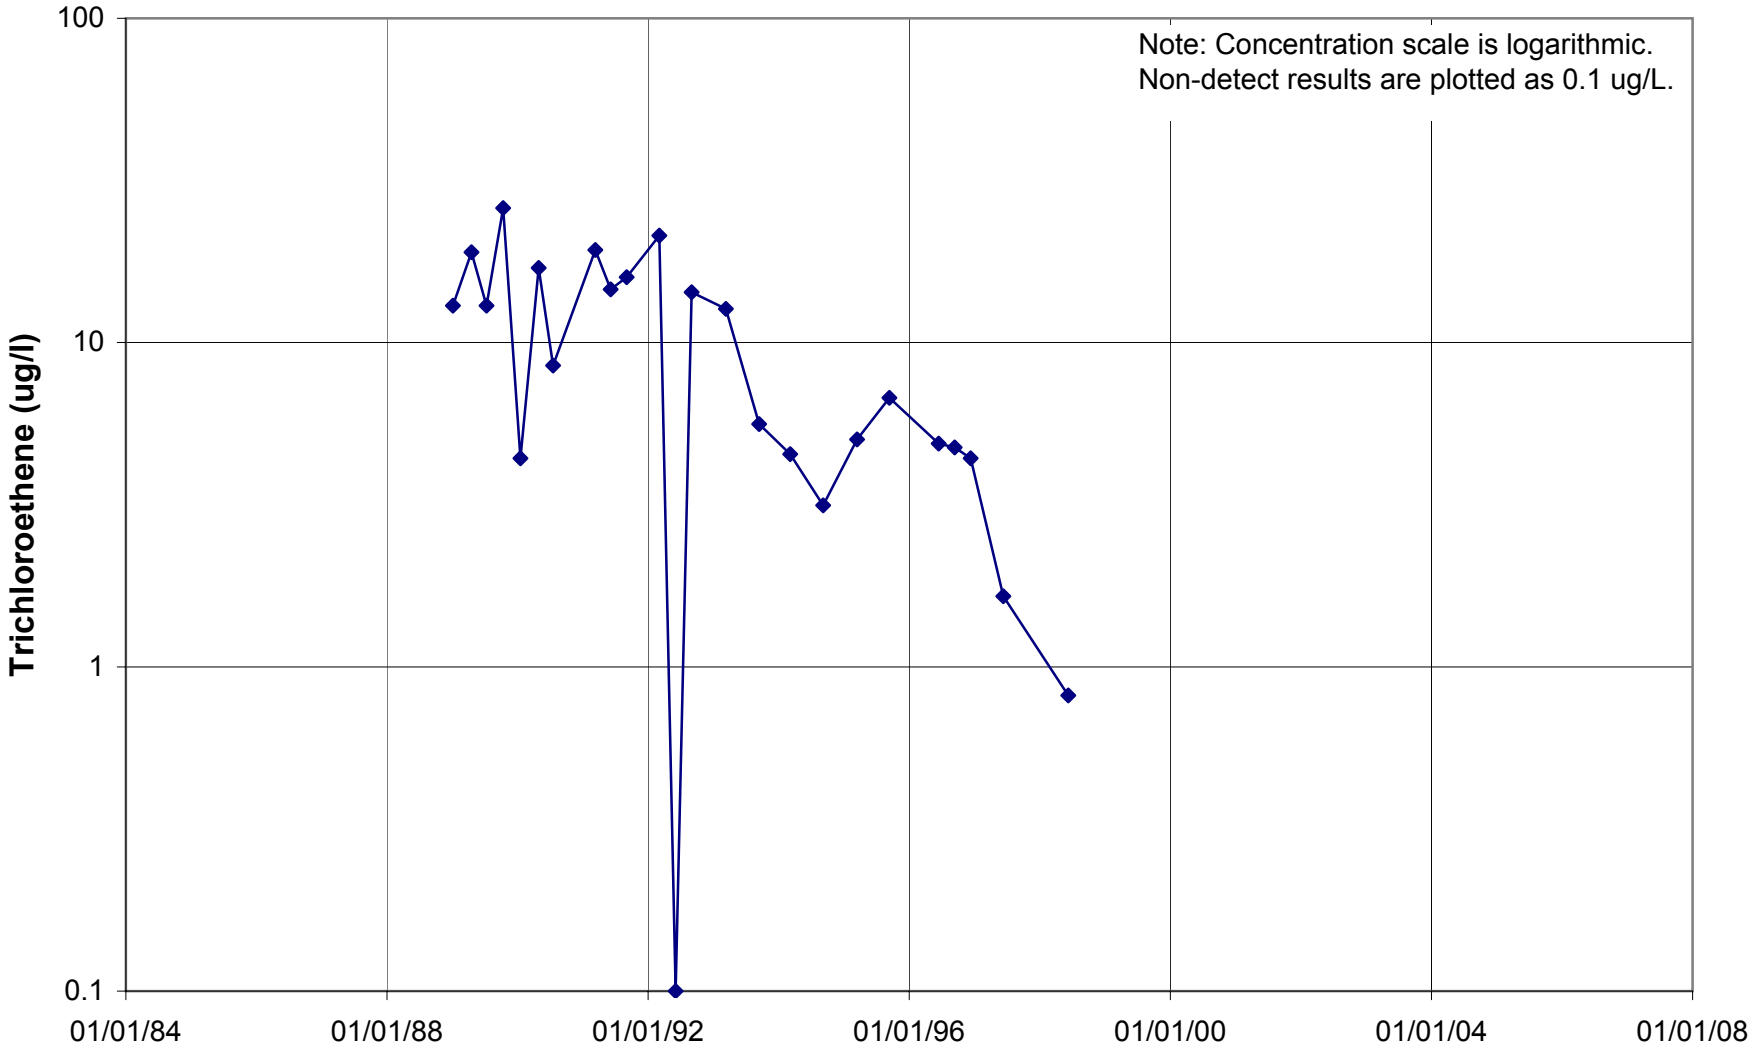

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U802

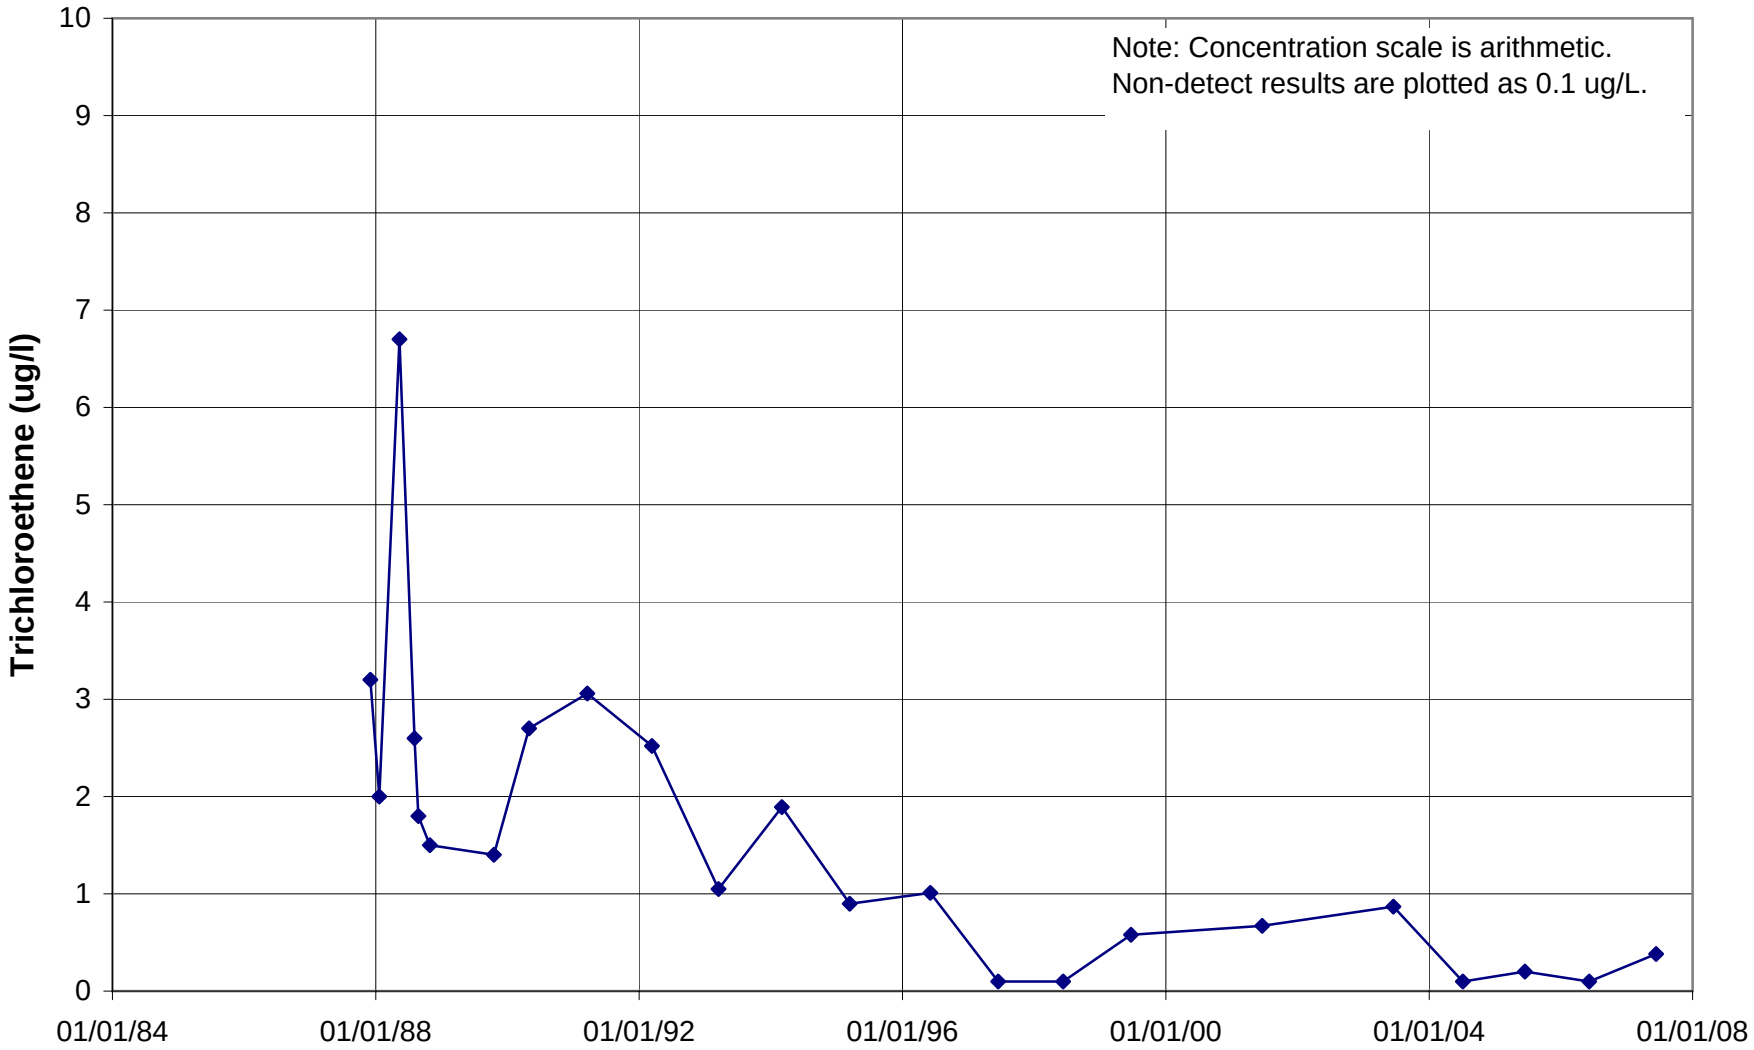

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U806

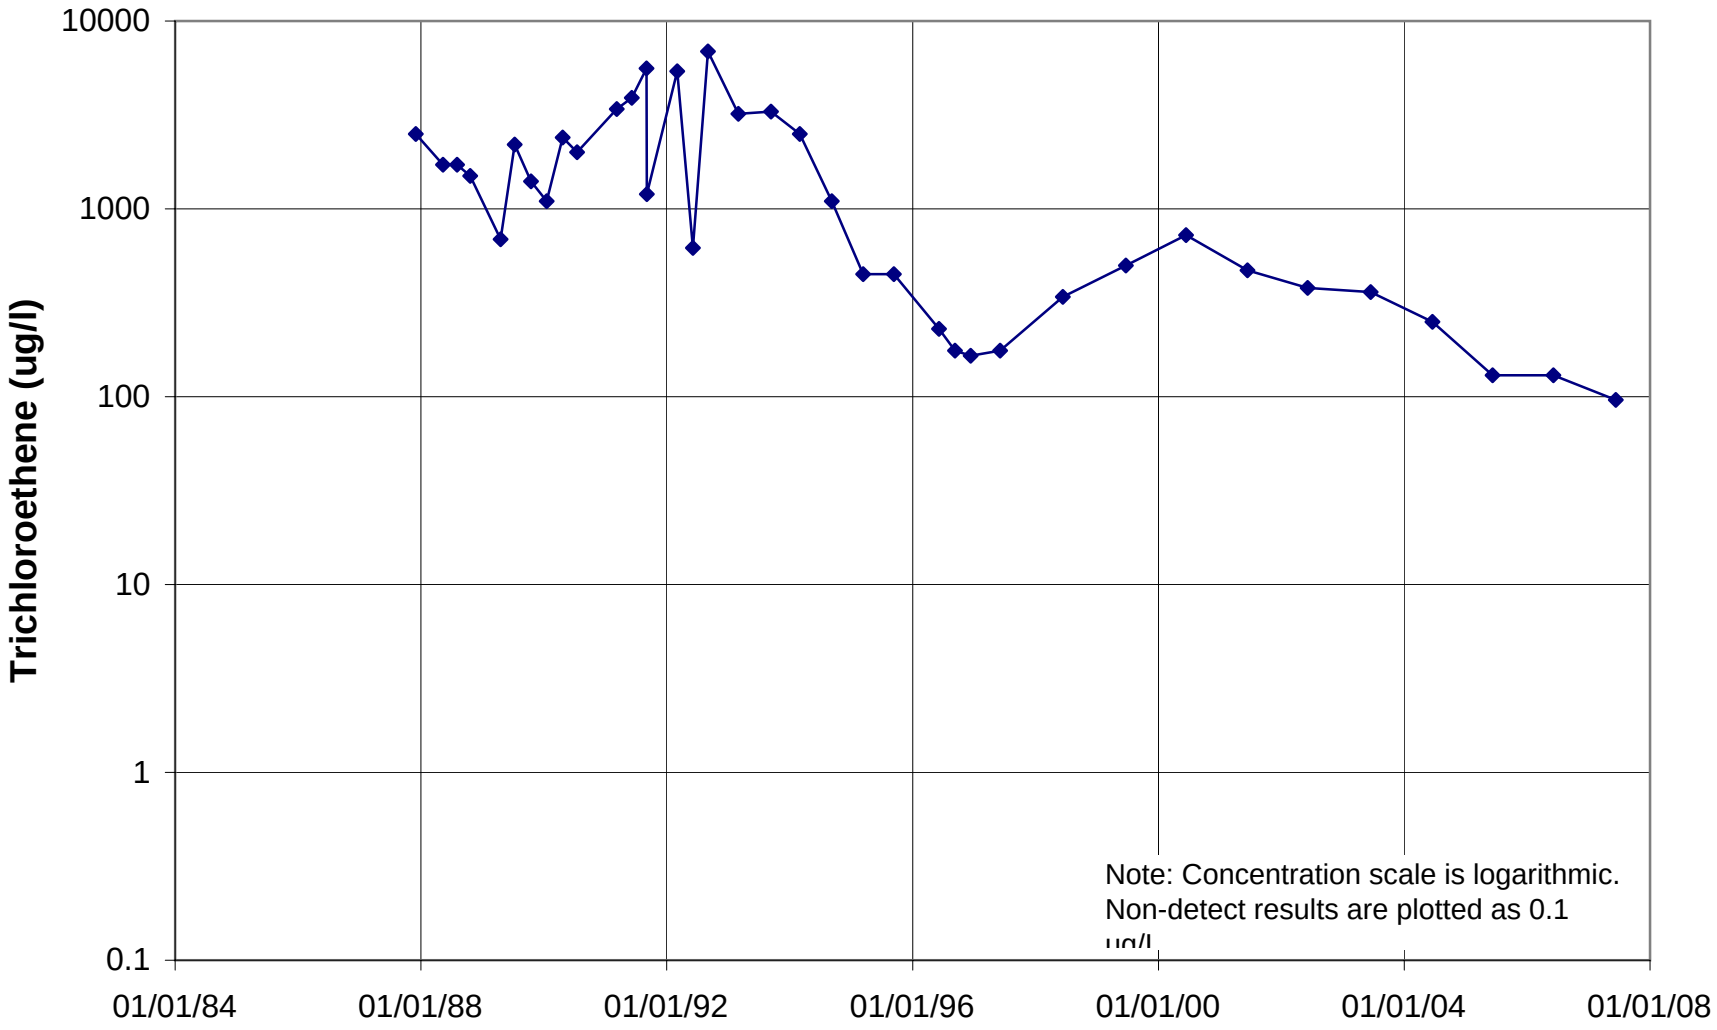

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U821

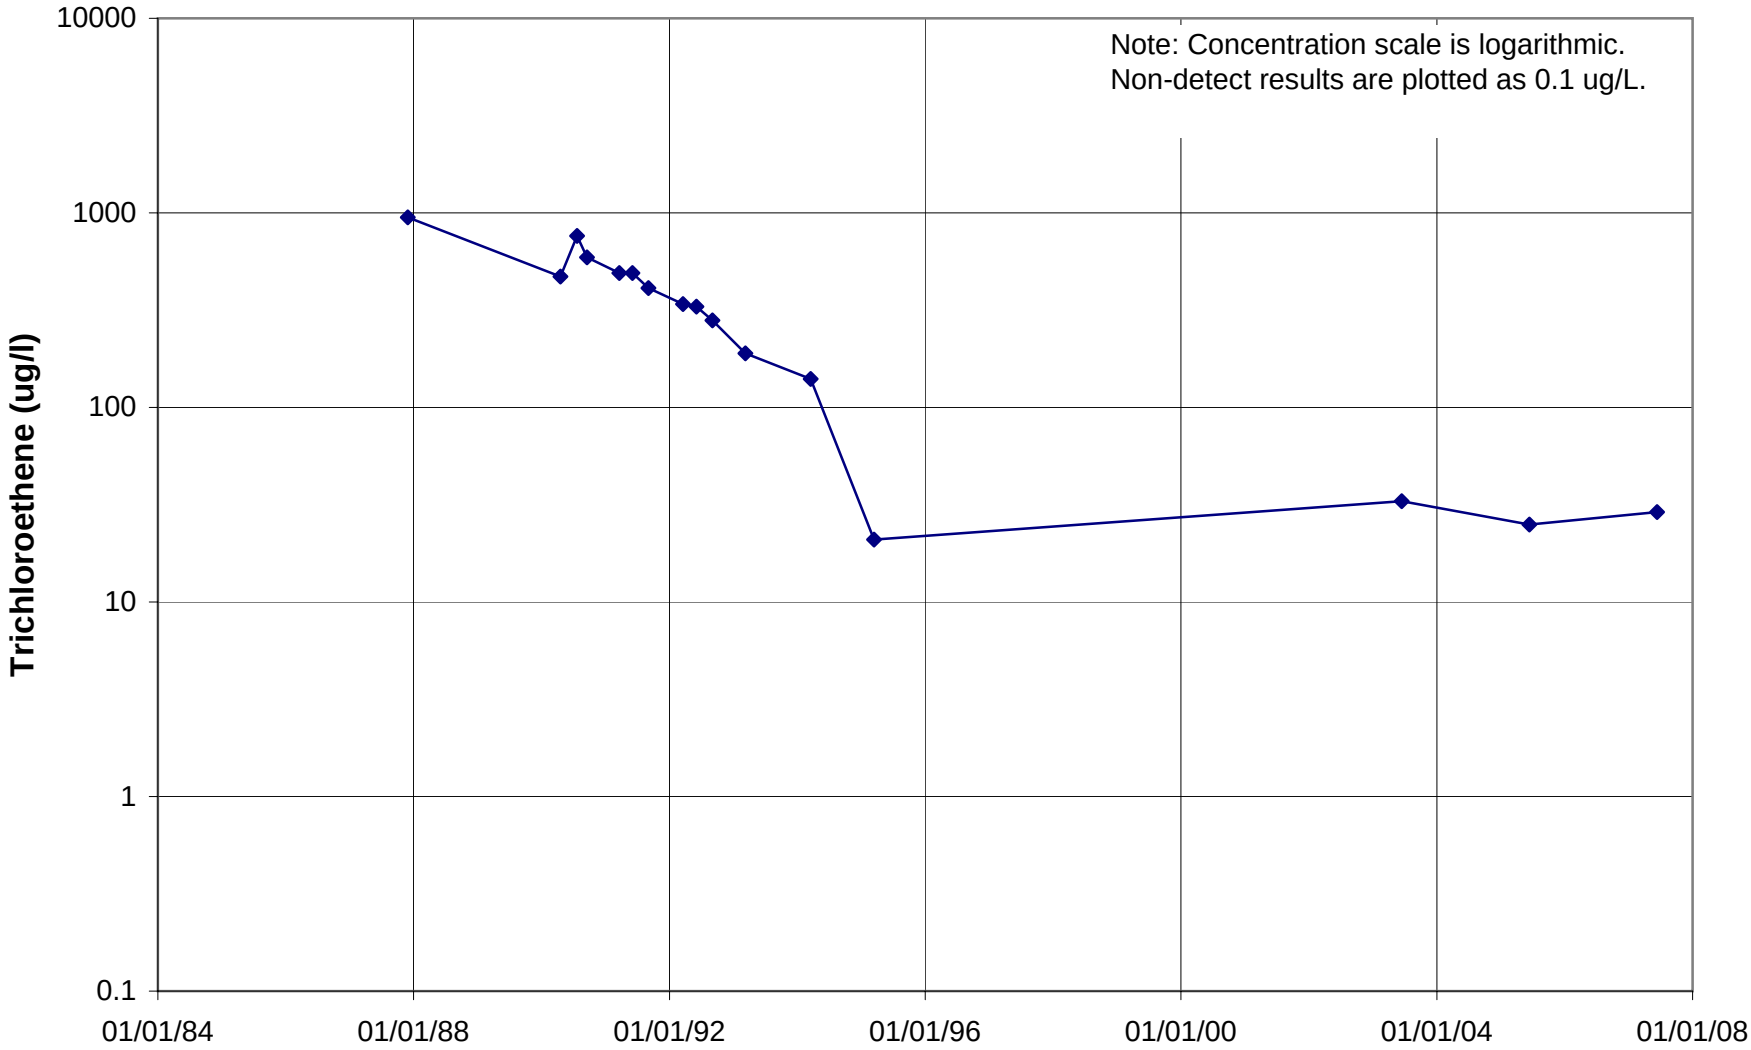

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U832

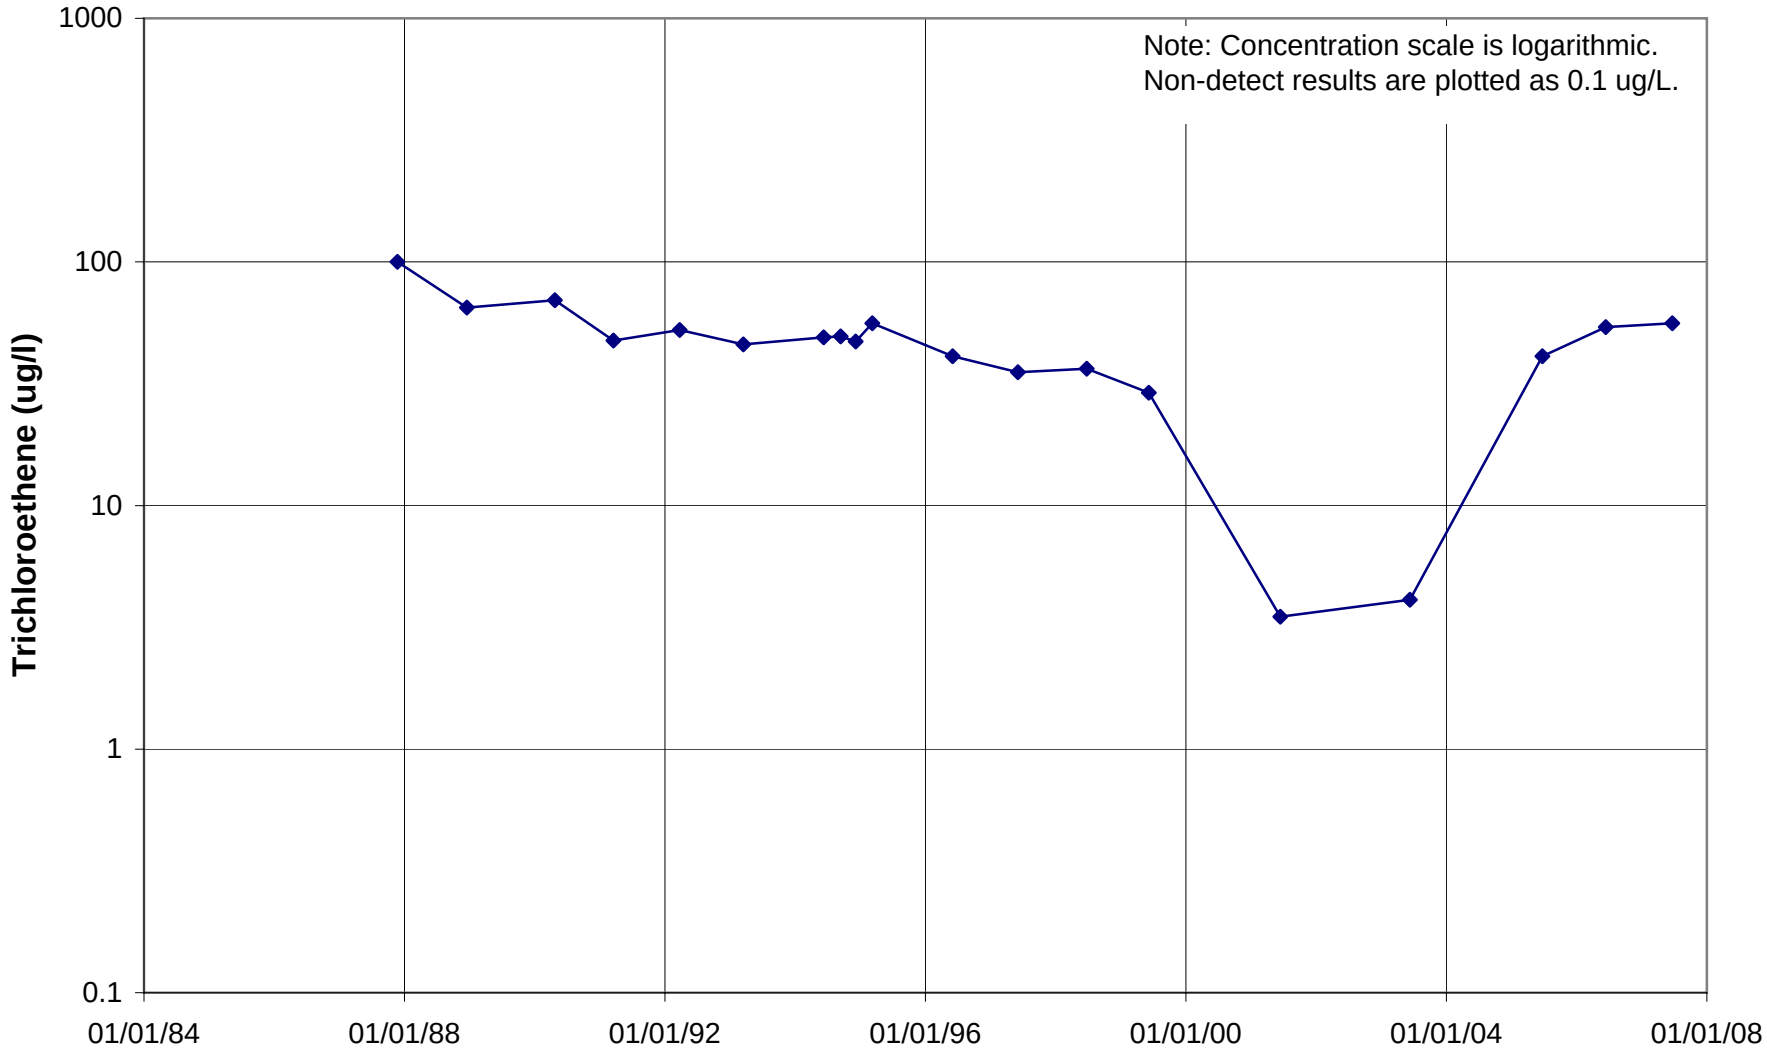

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U833

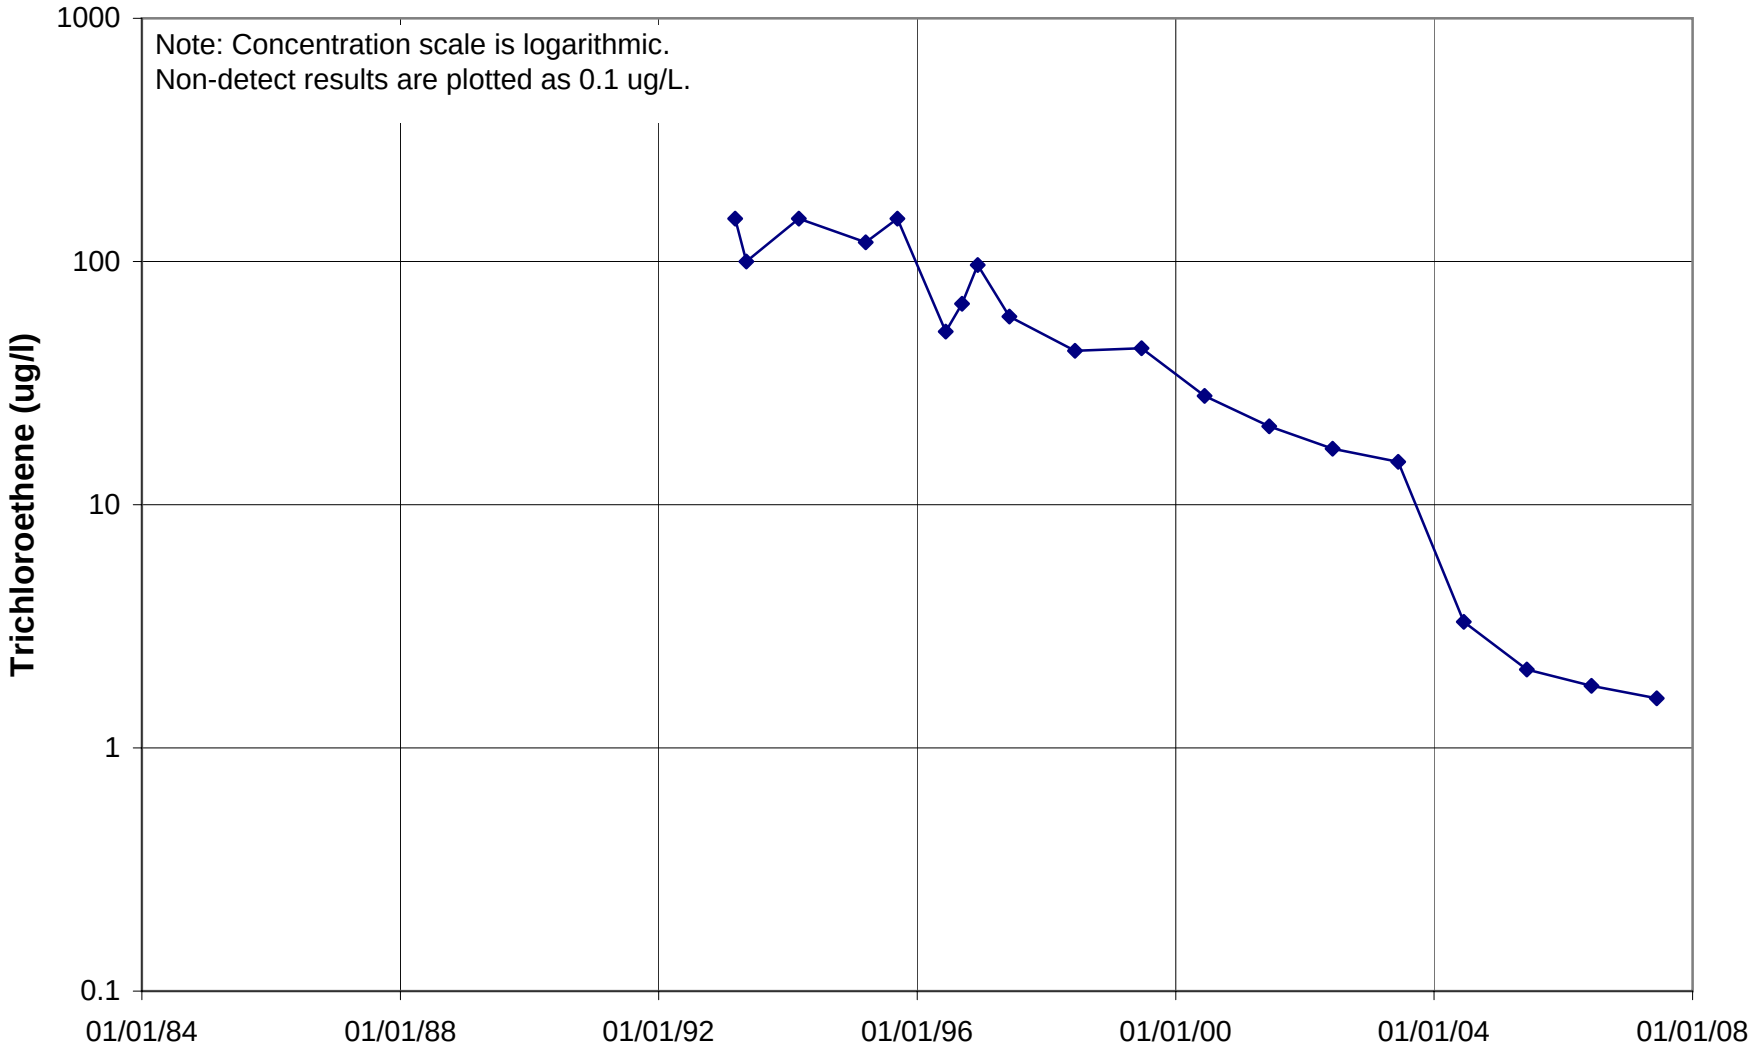

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U834

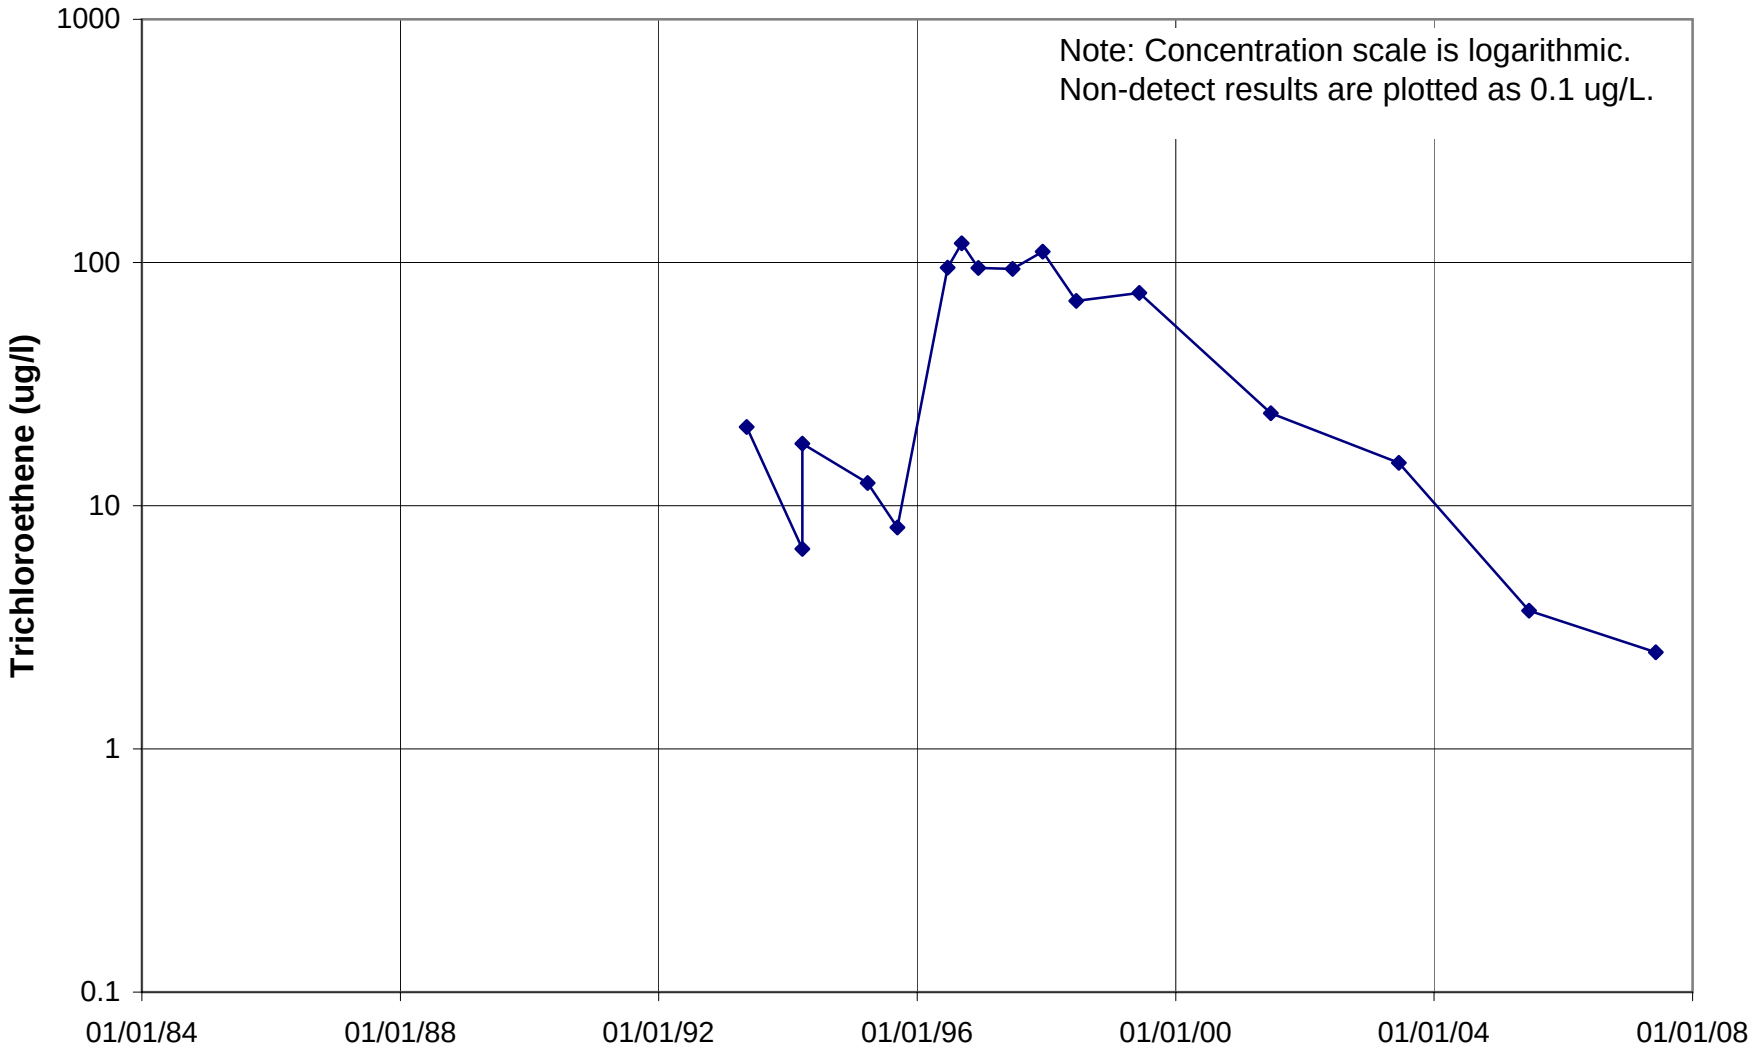

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U836

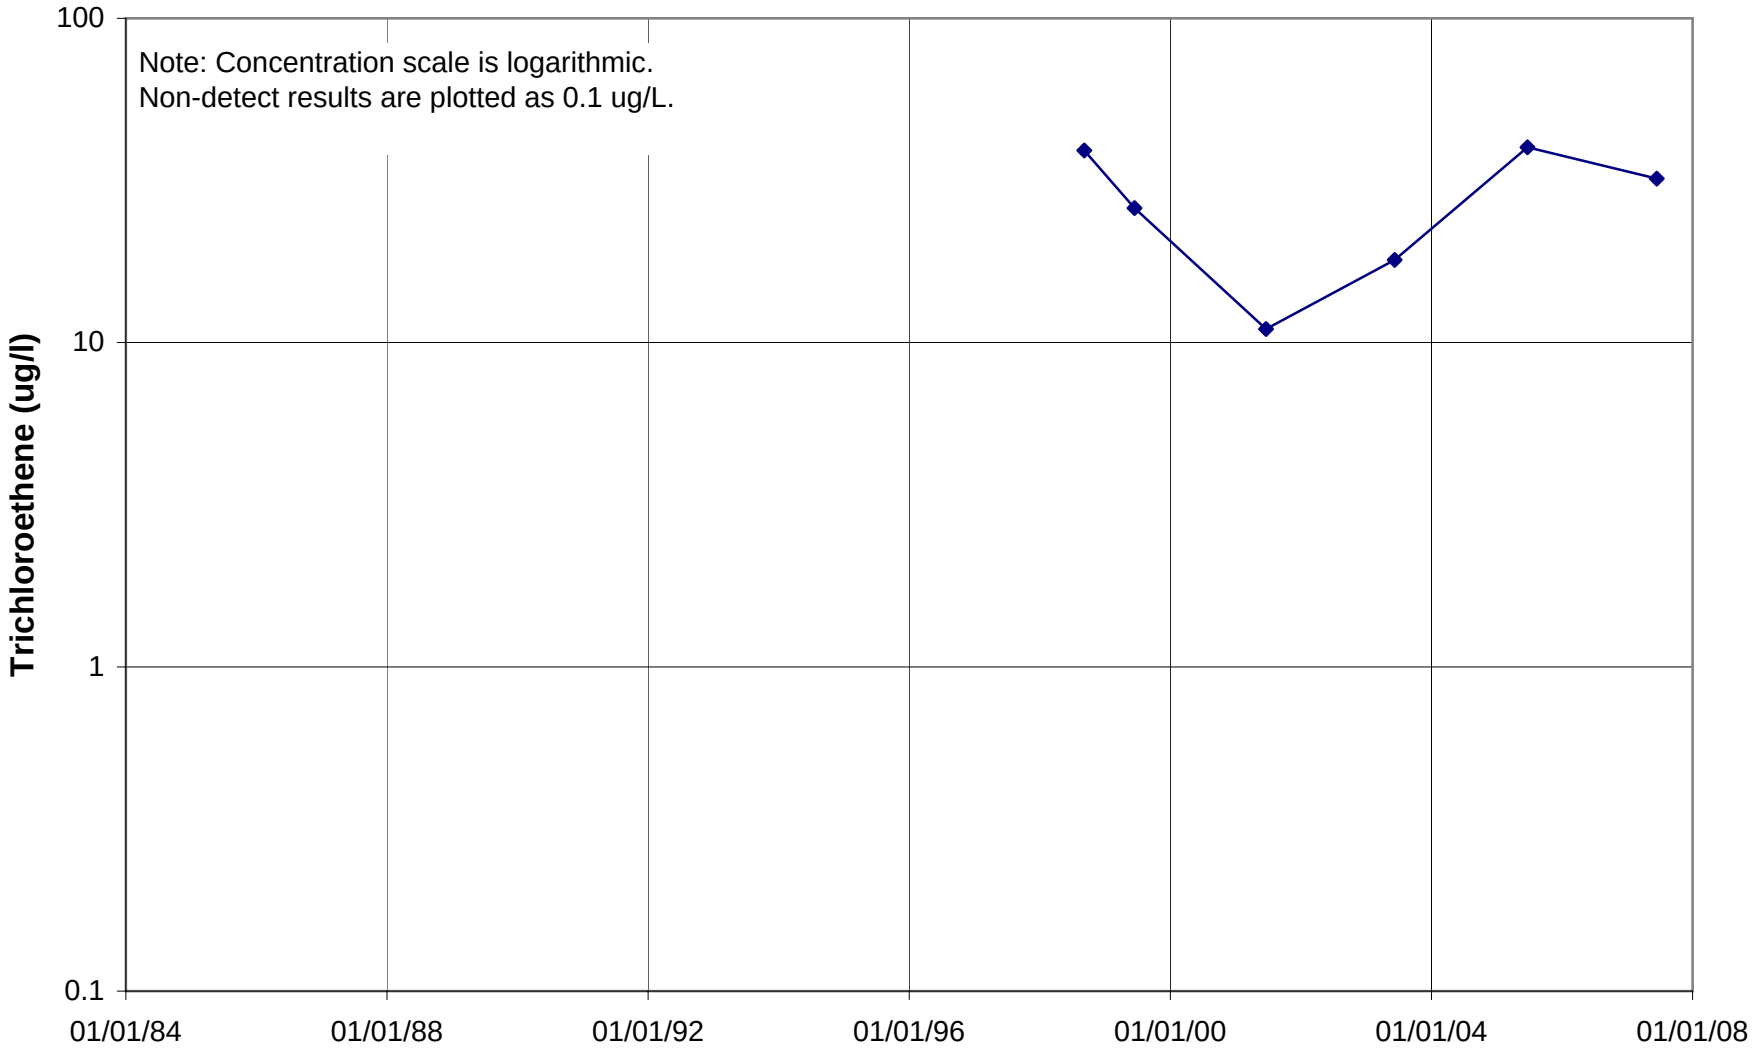

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U837

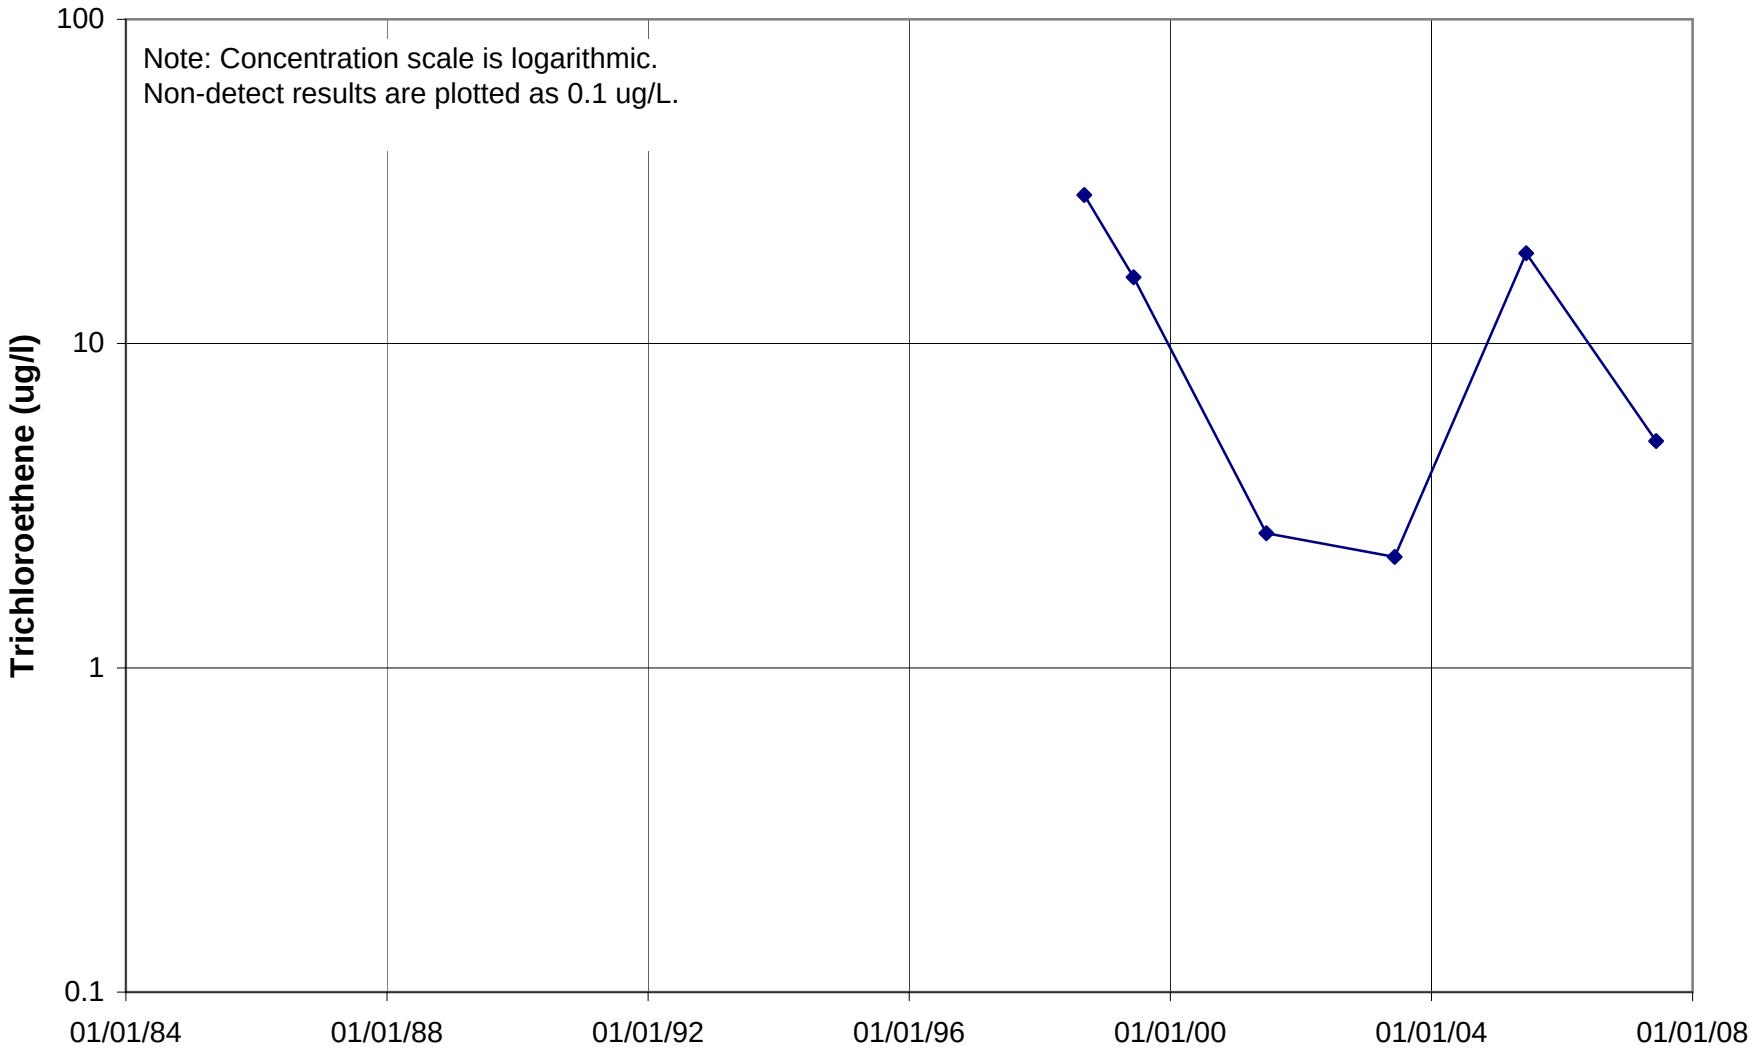

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U838

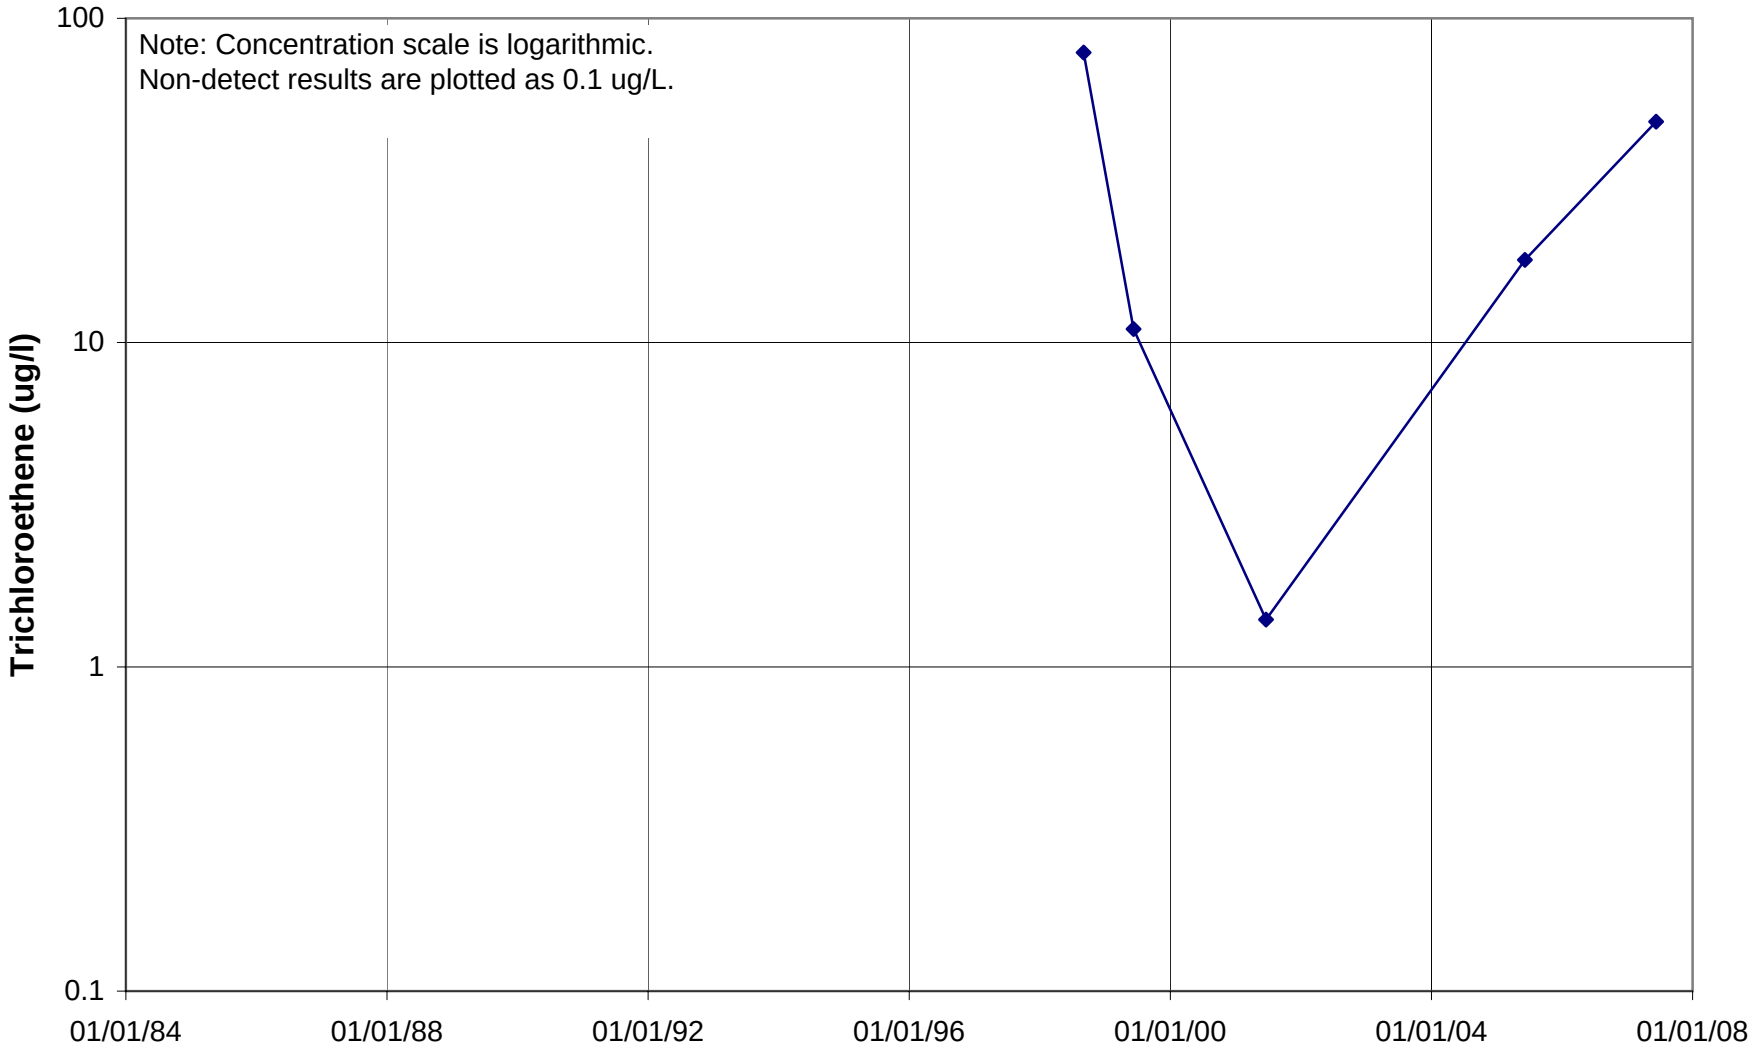

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U839

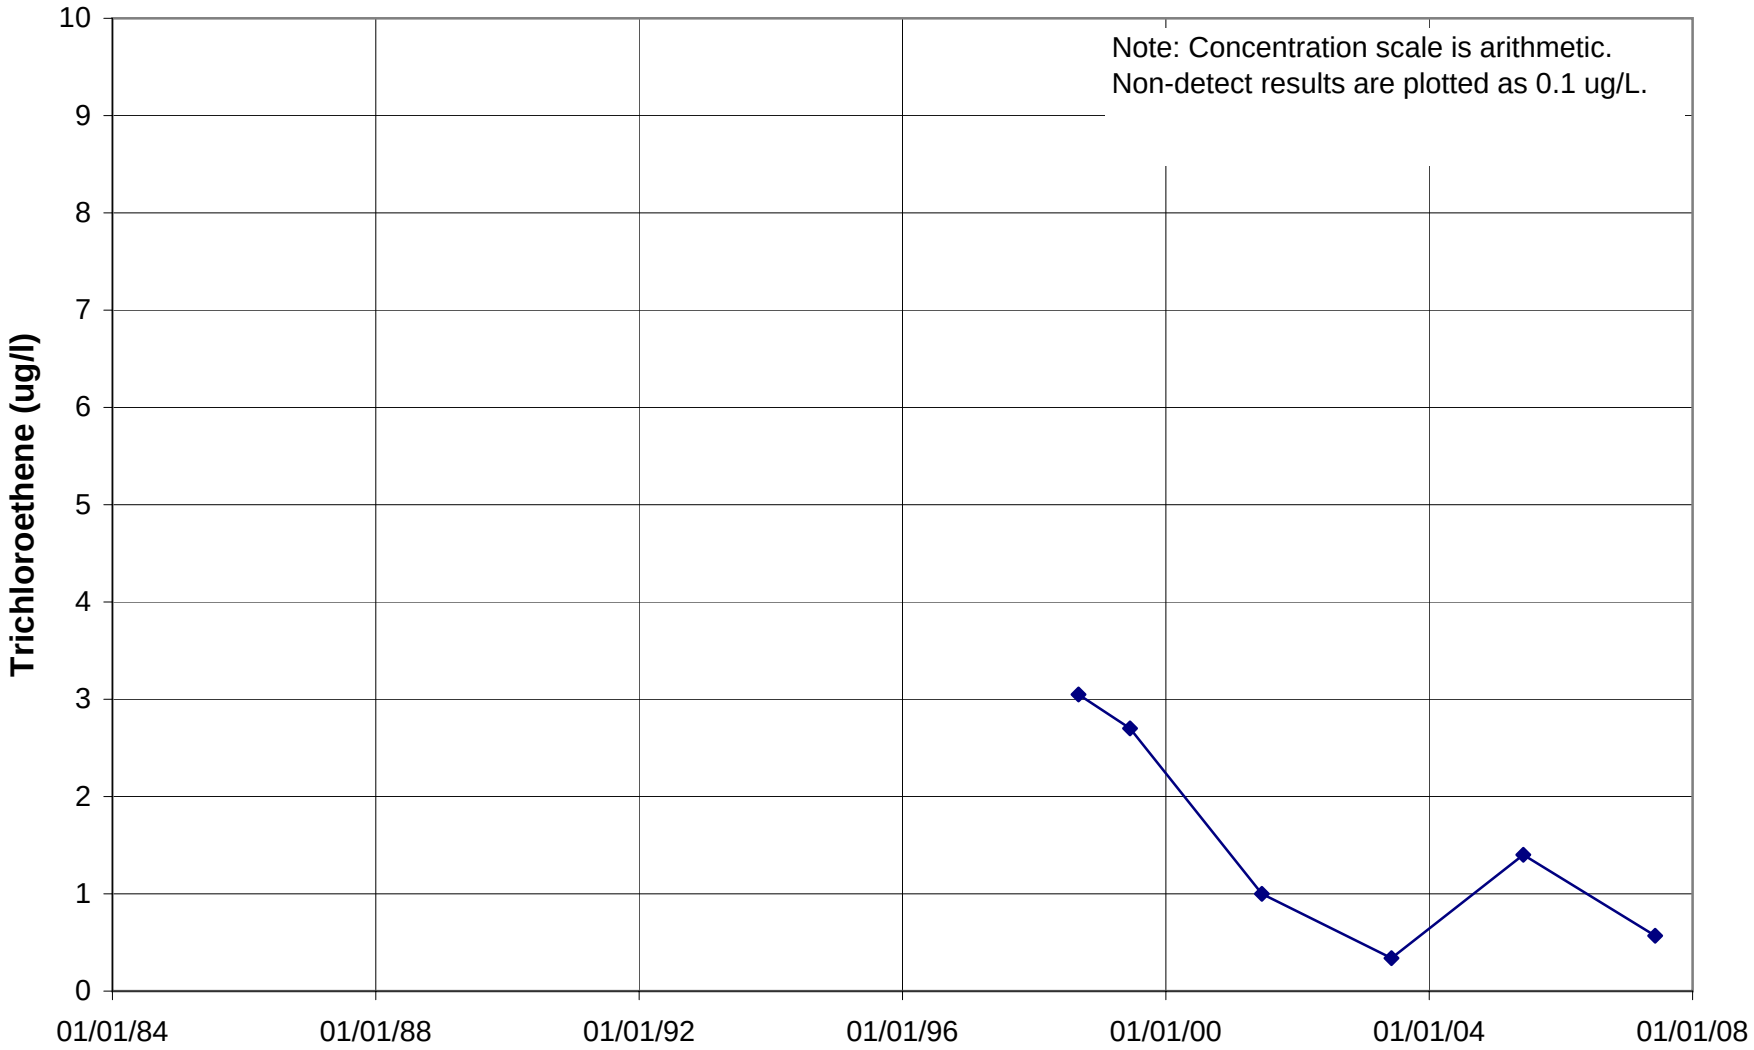

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U841

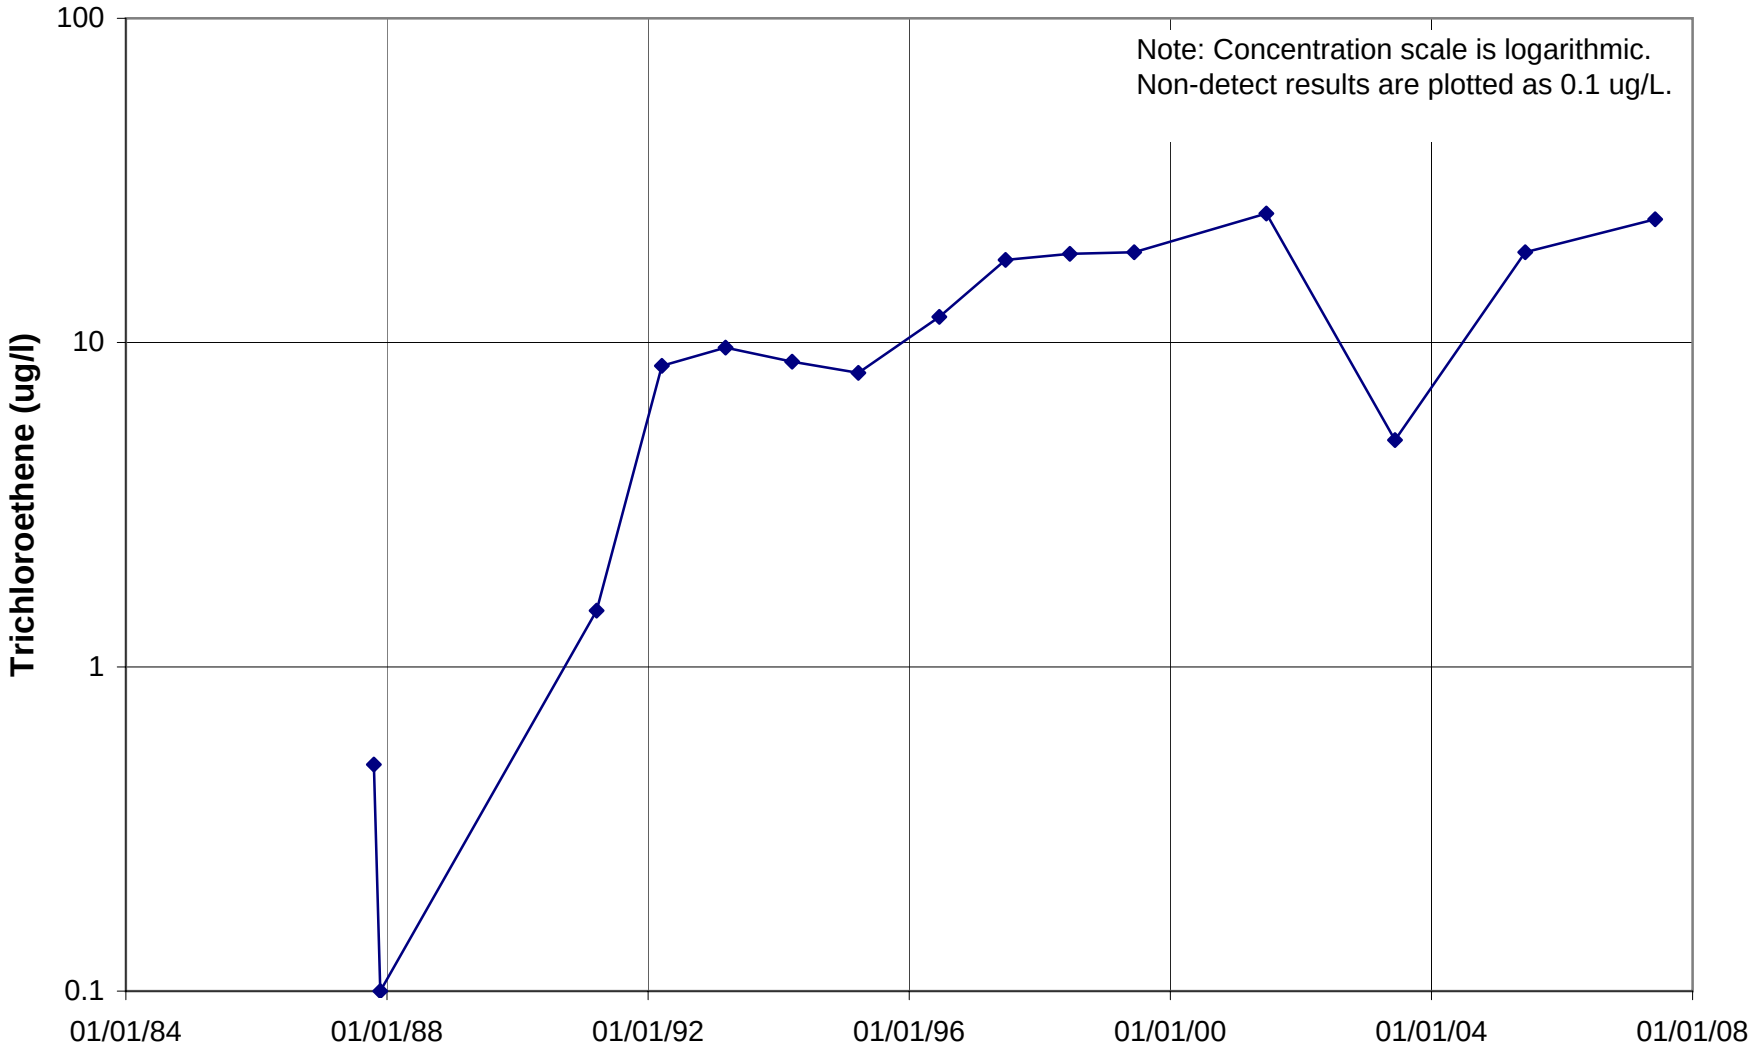

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U843

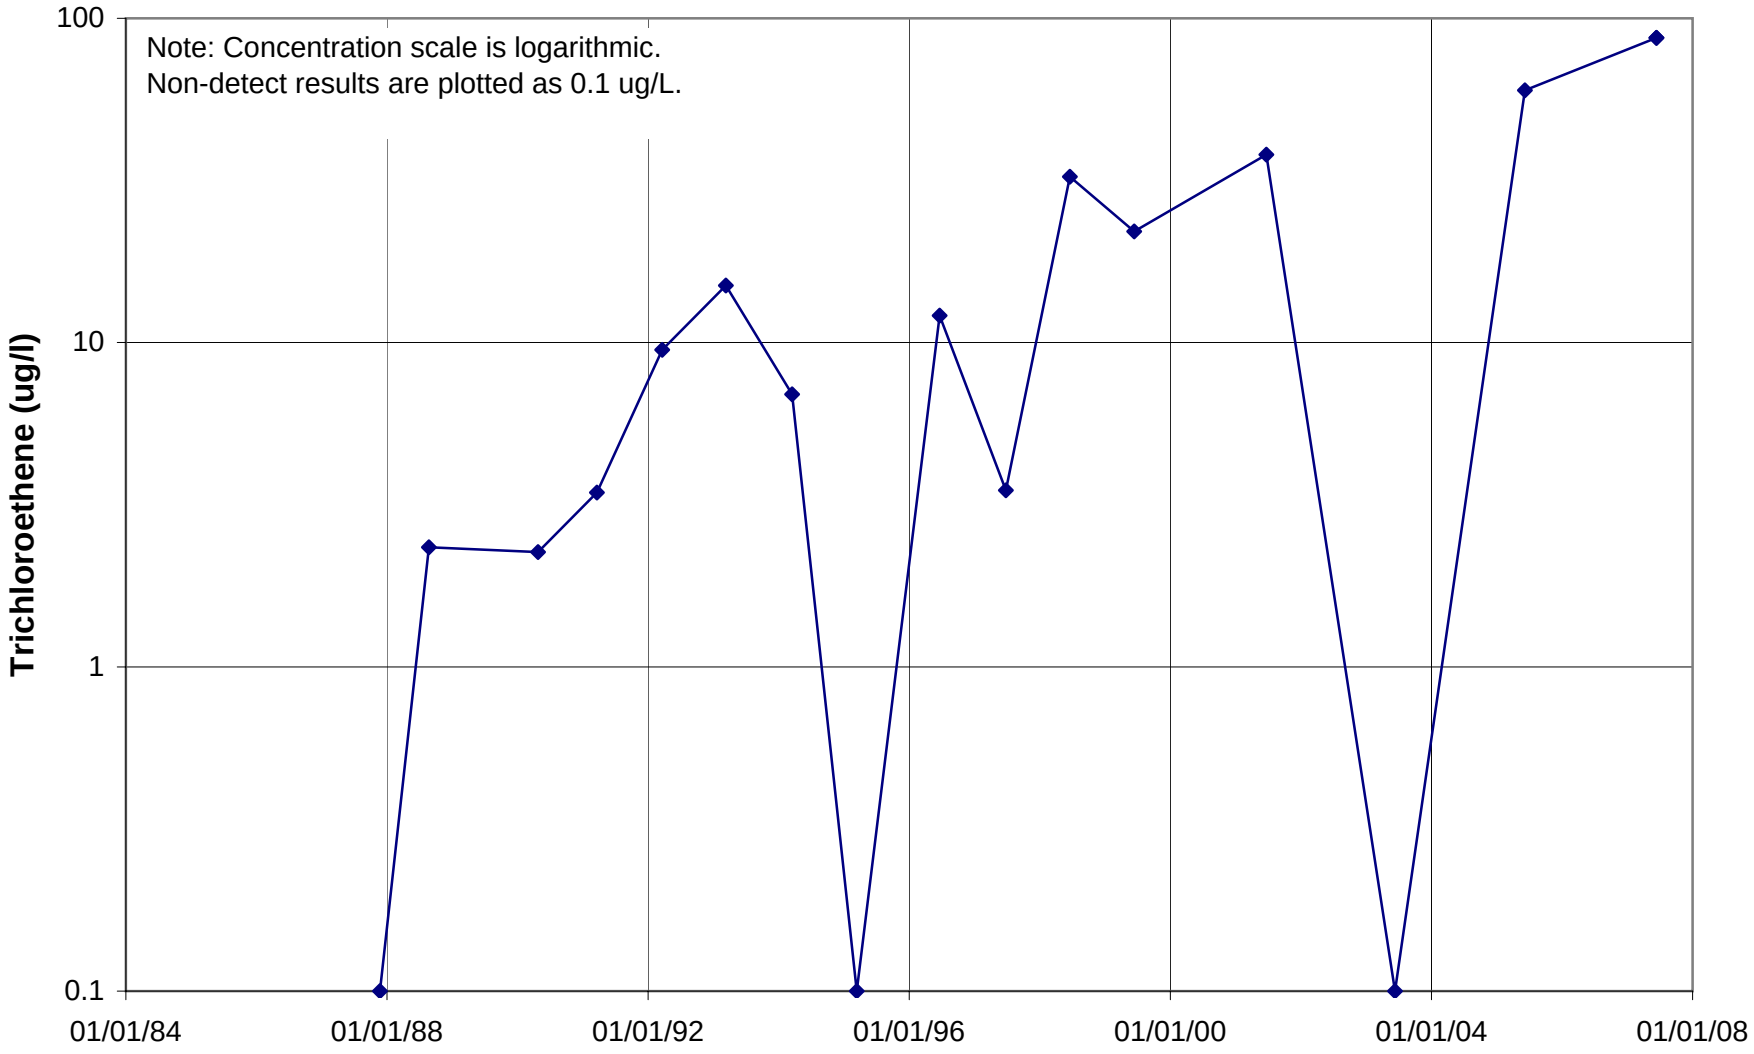

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U844

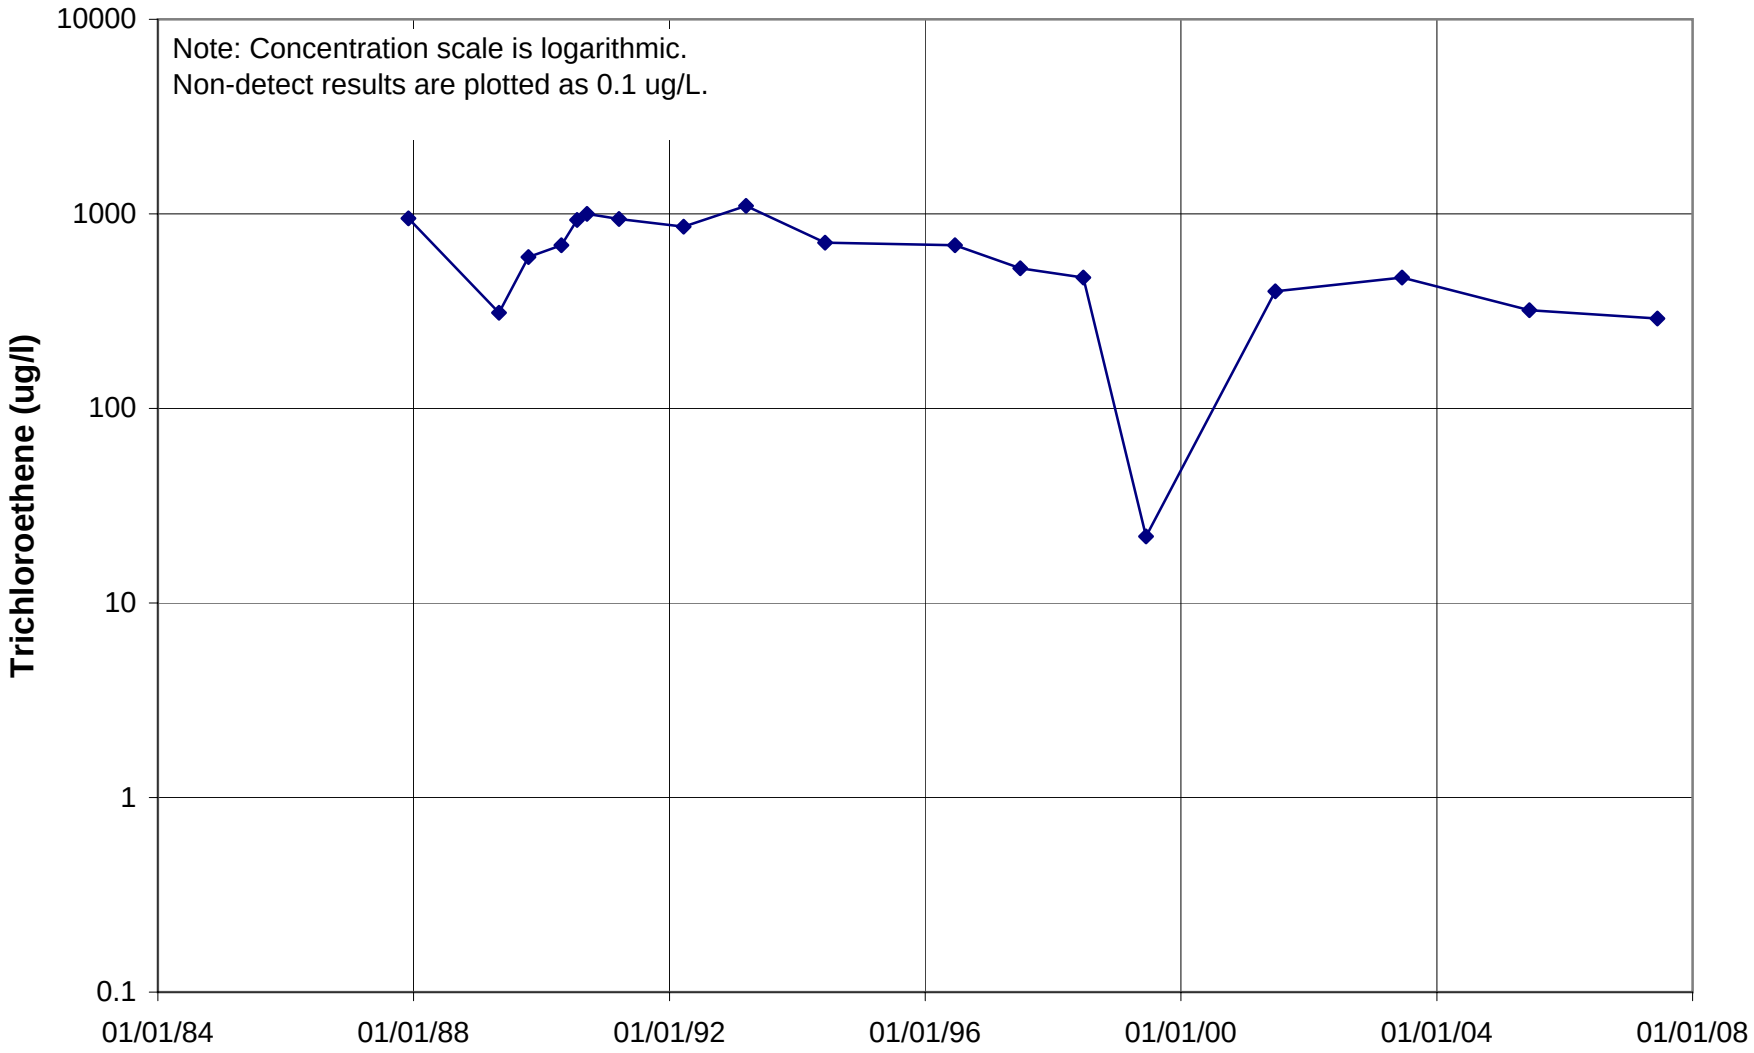

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U845

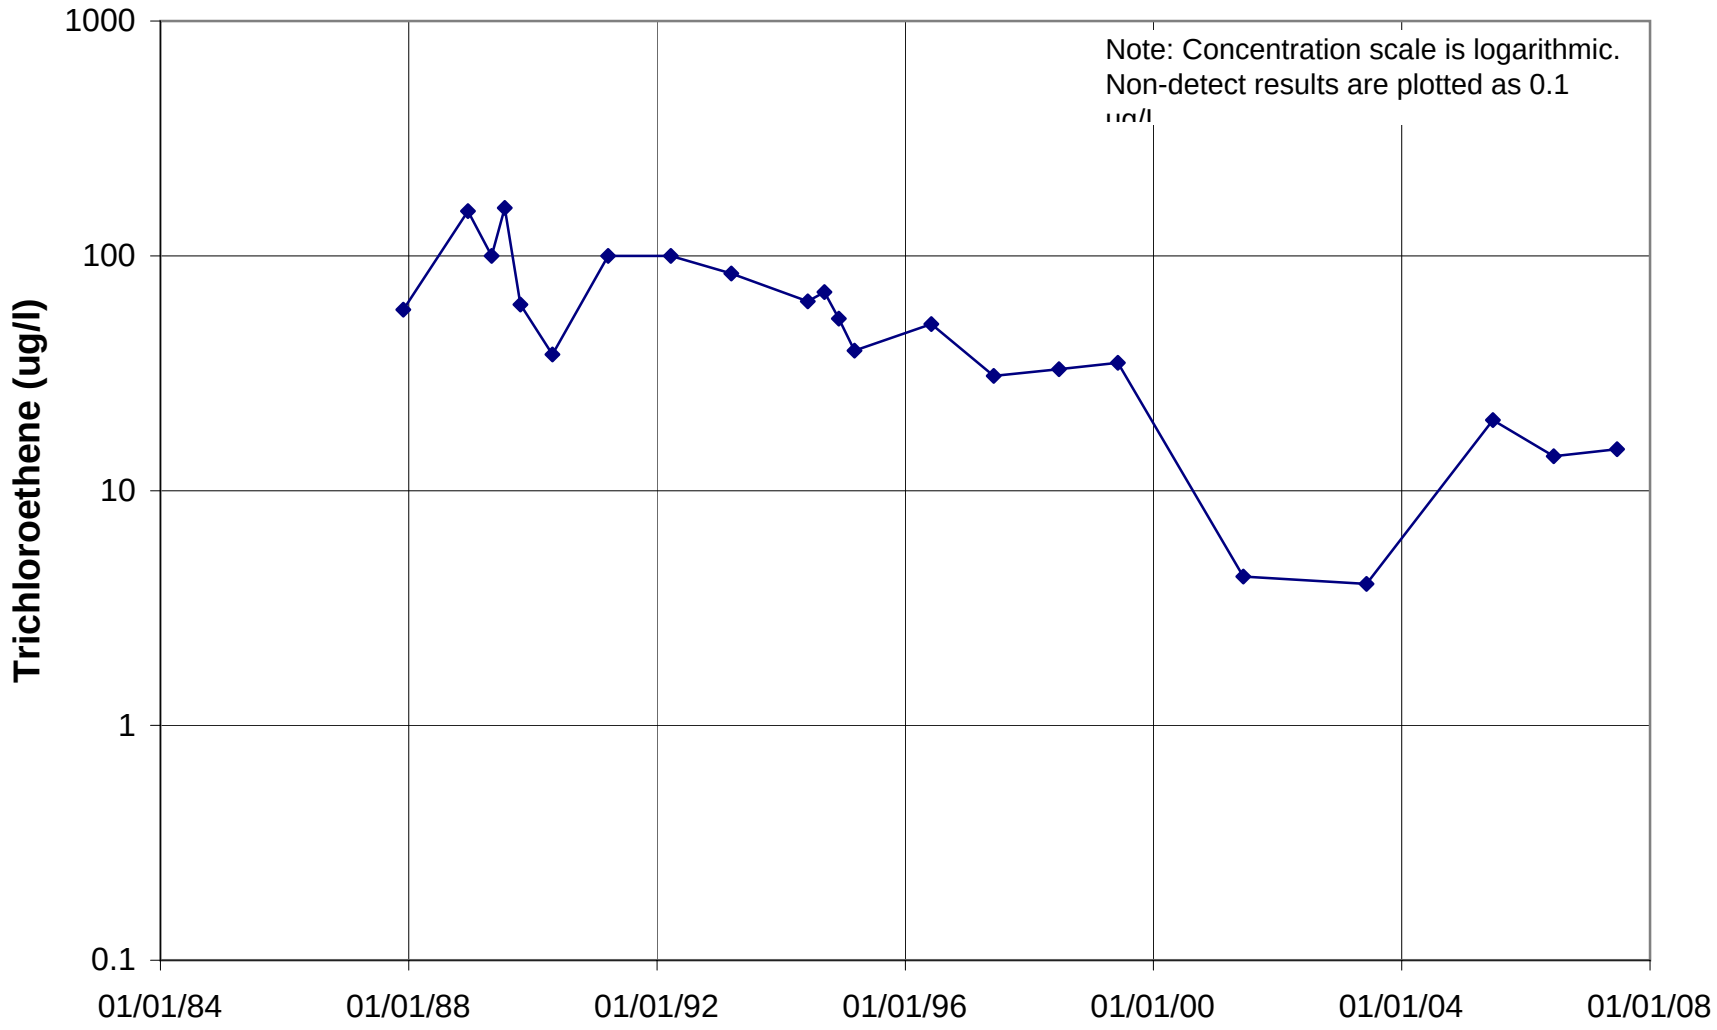

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U846

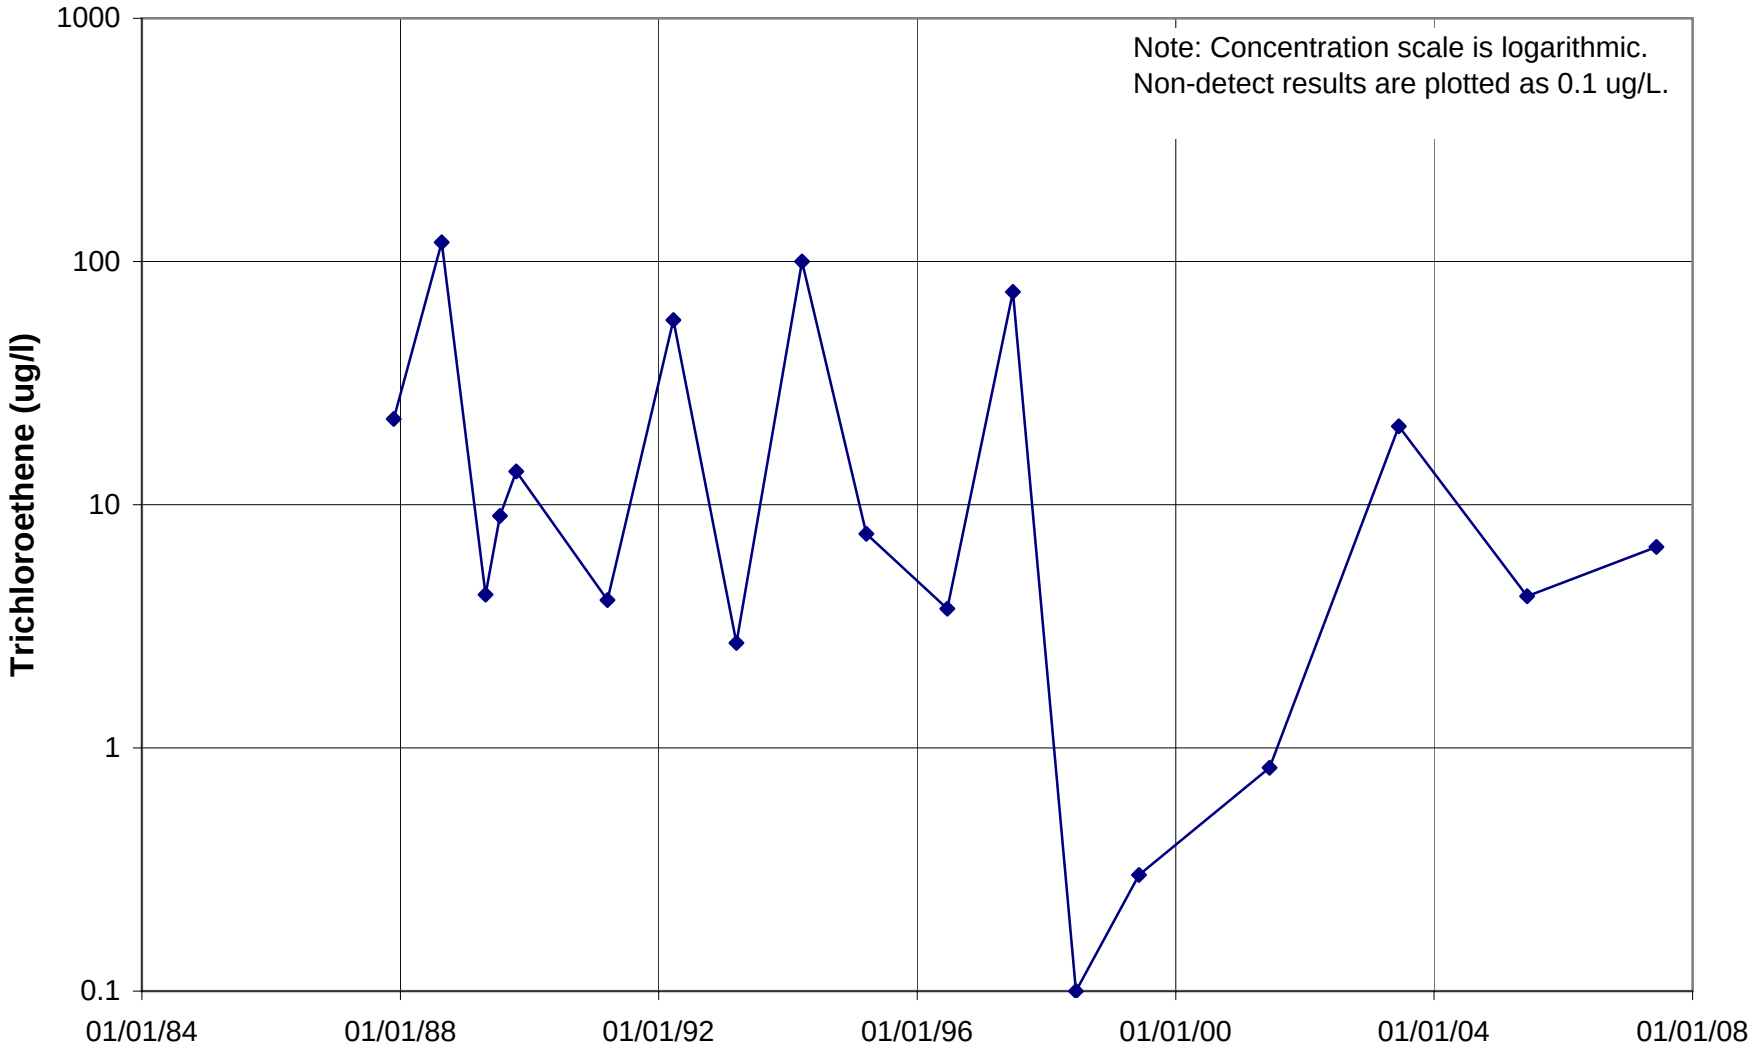

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U847

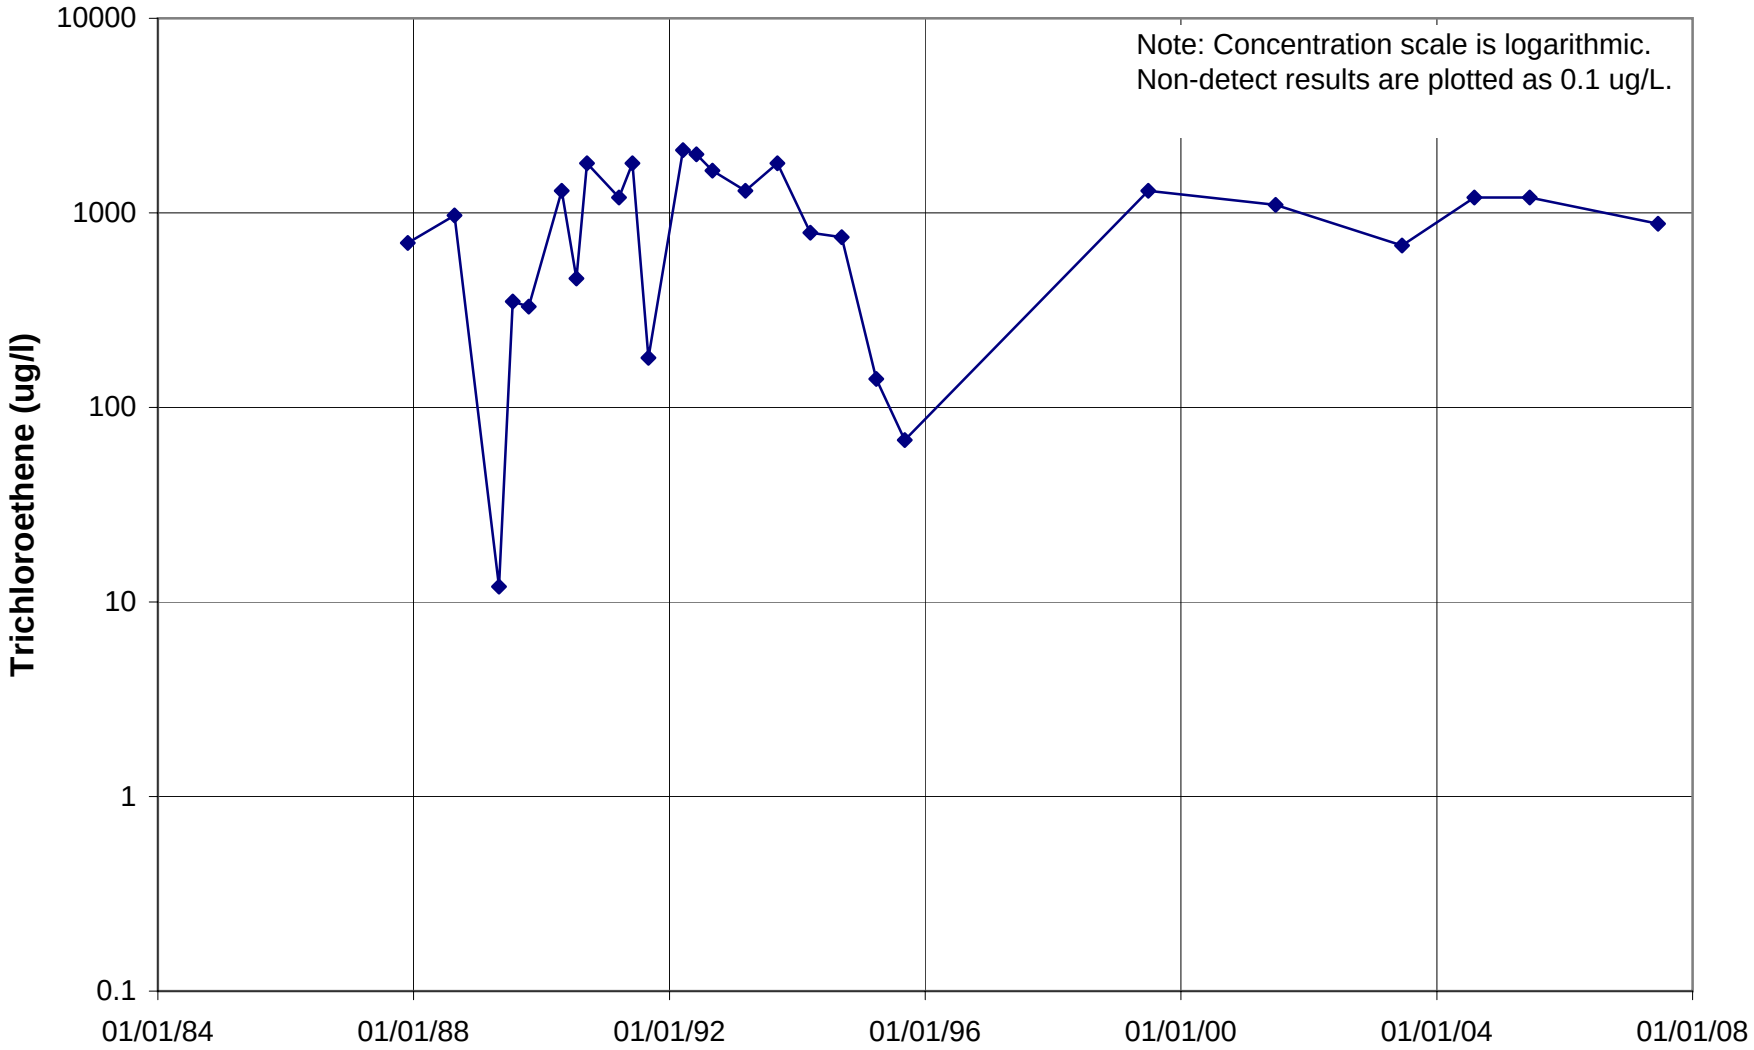

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U848

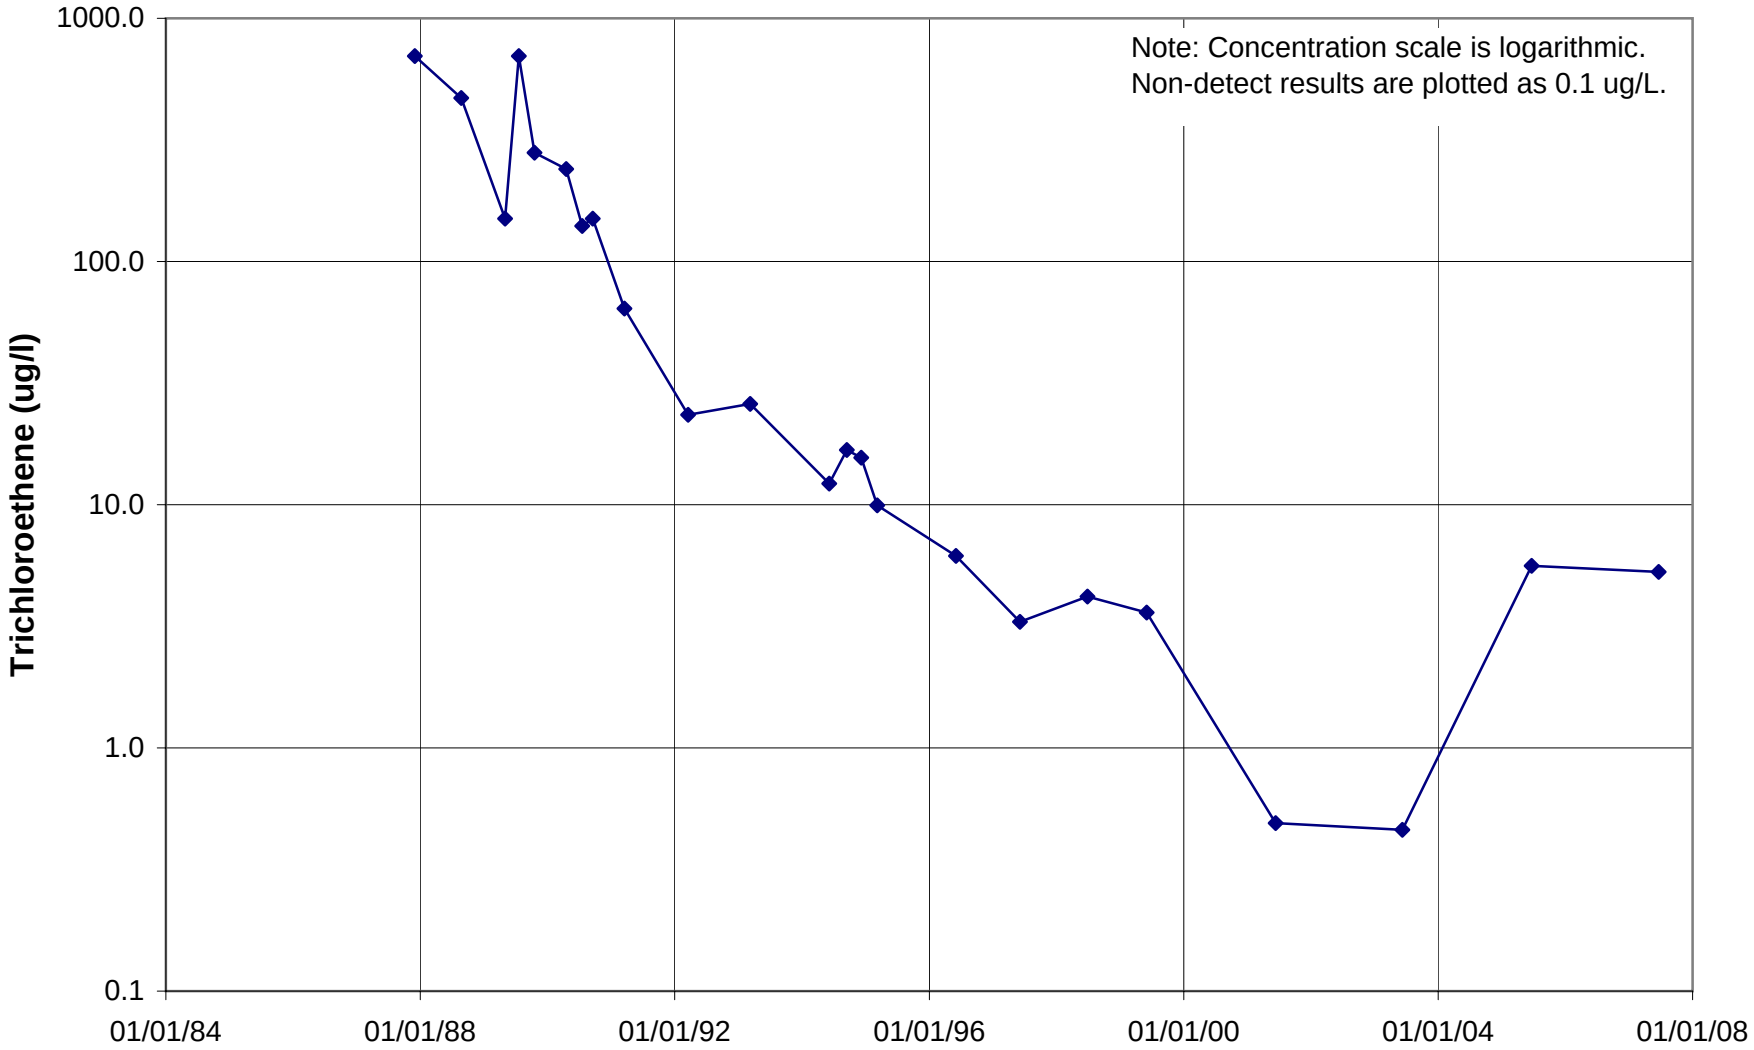

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U849

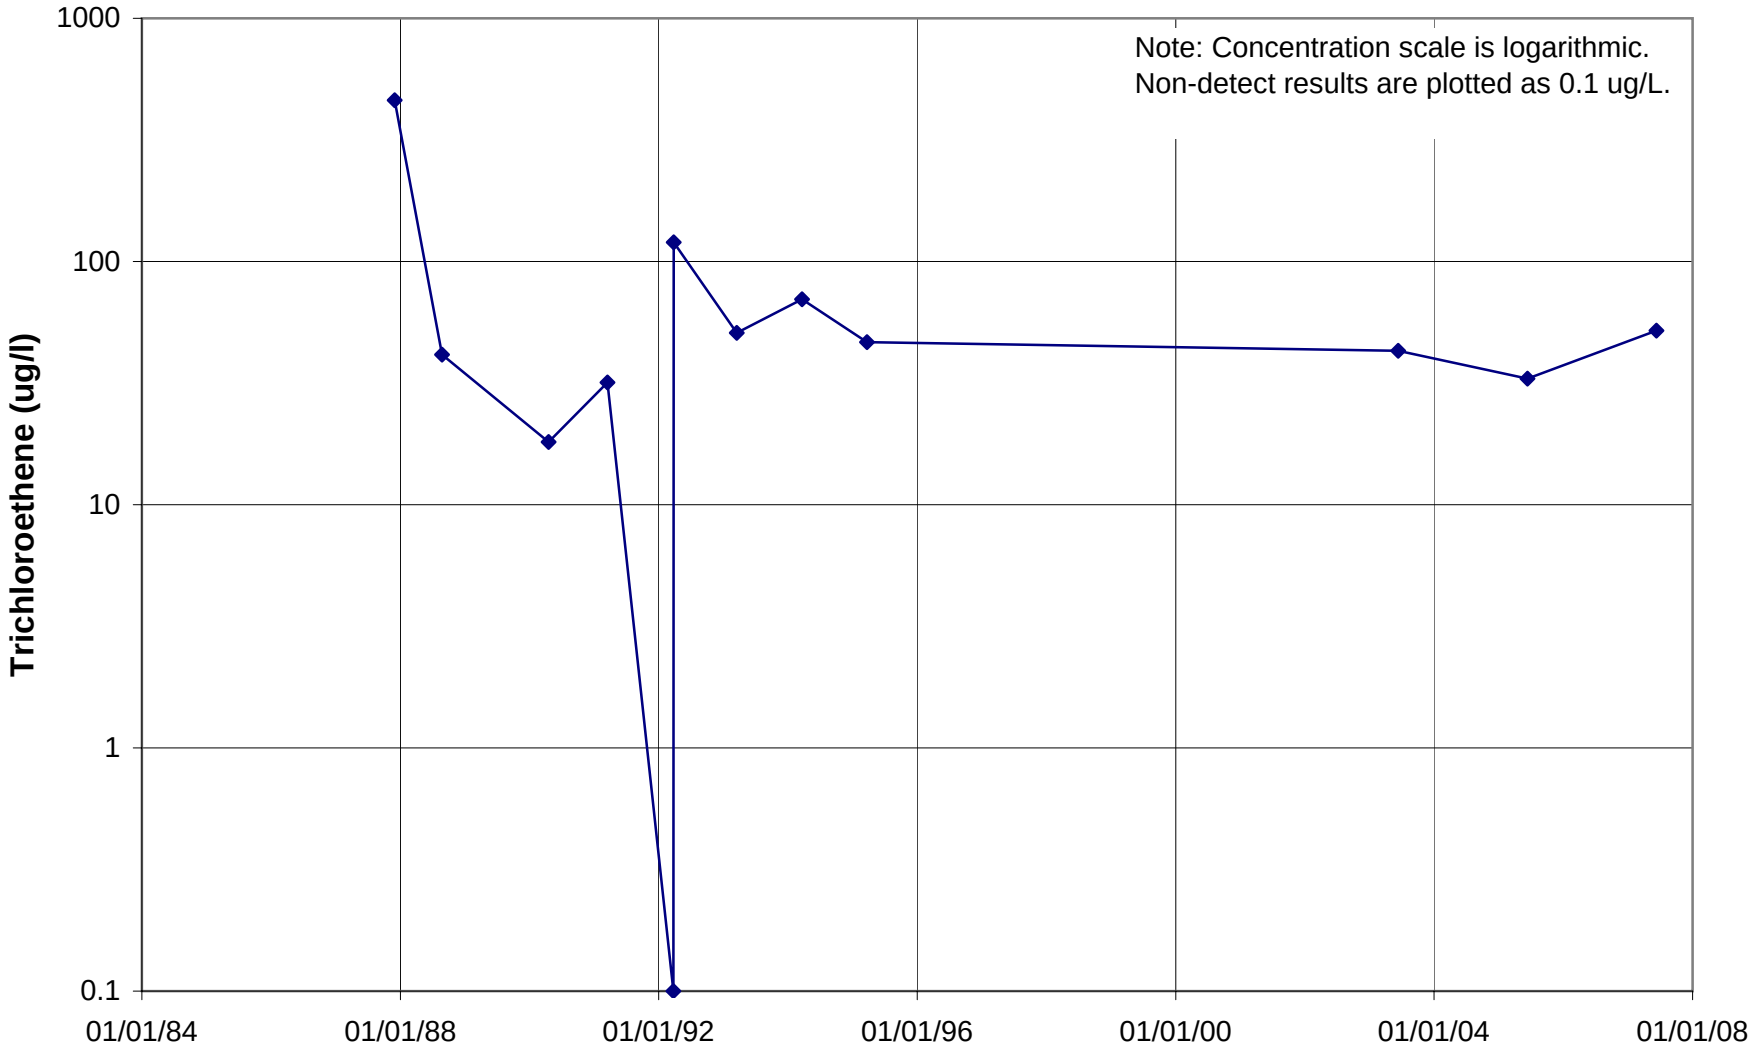

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U850

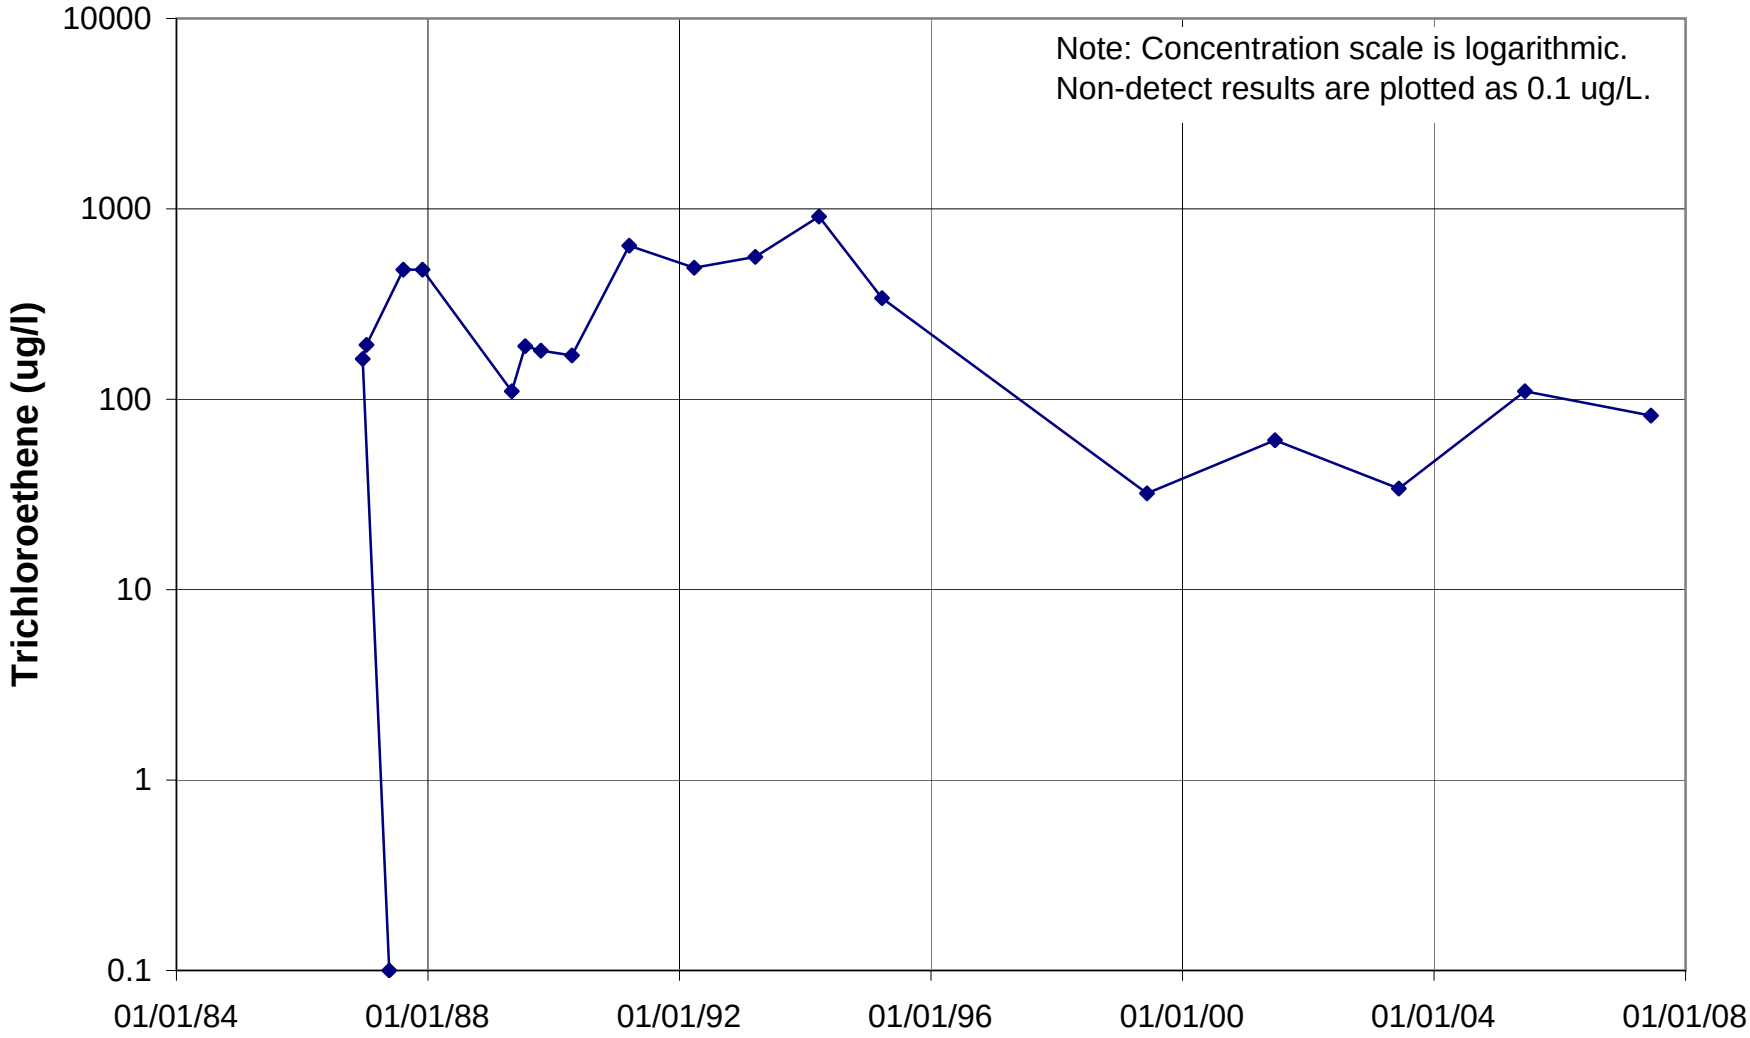

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U851

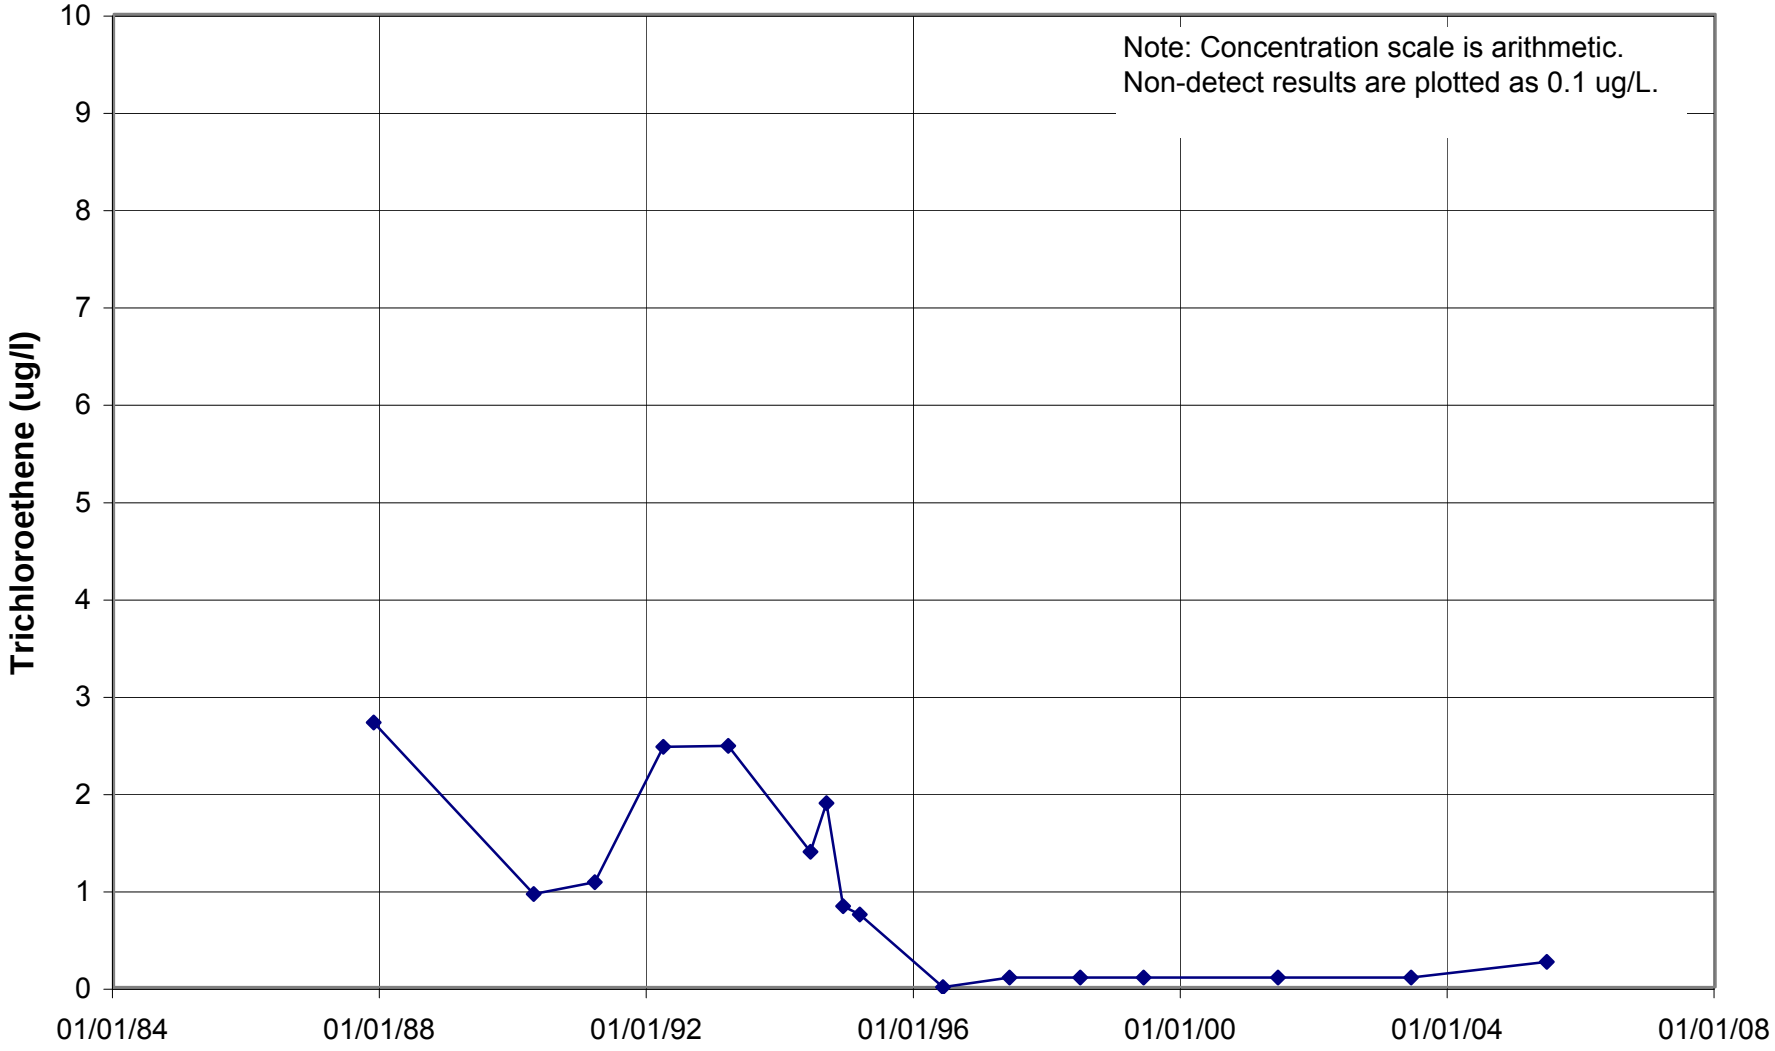

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U852

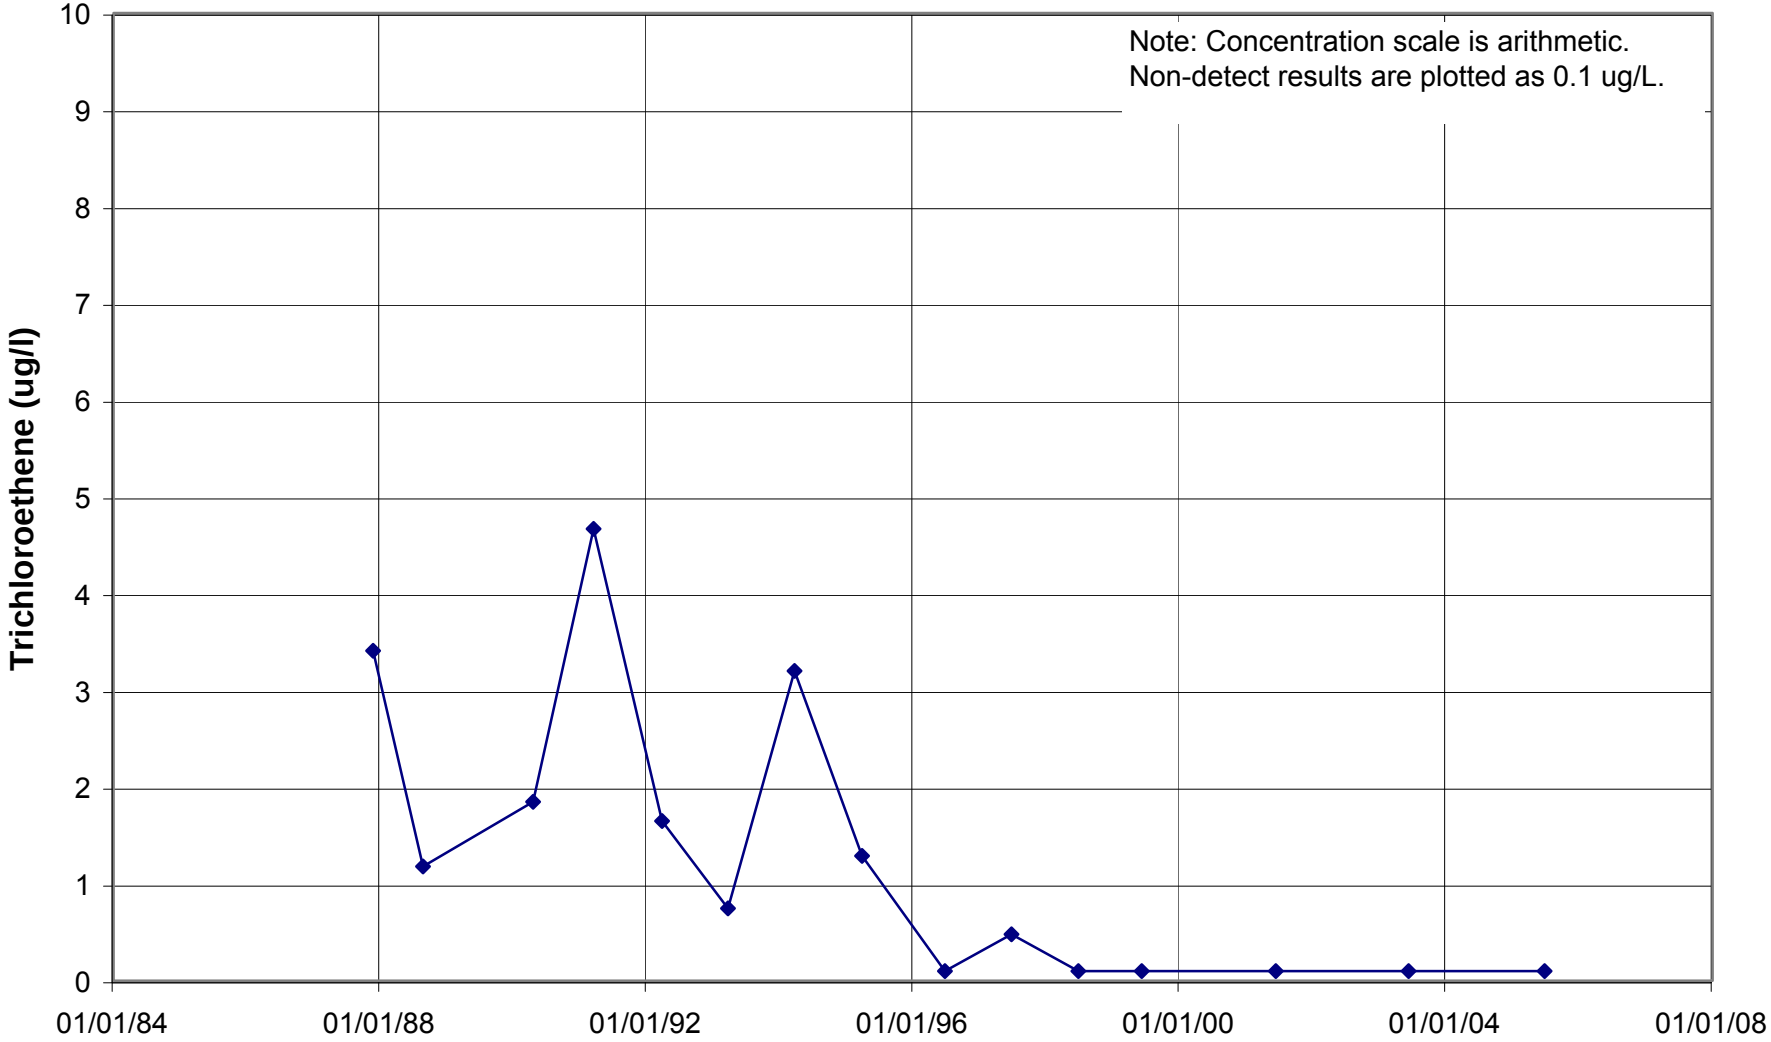

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U854

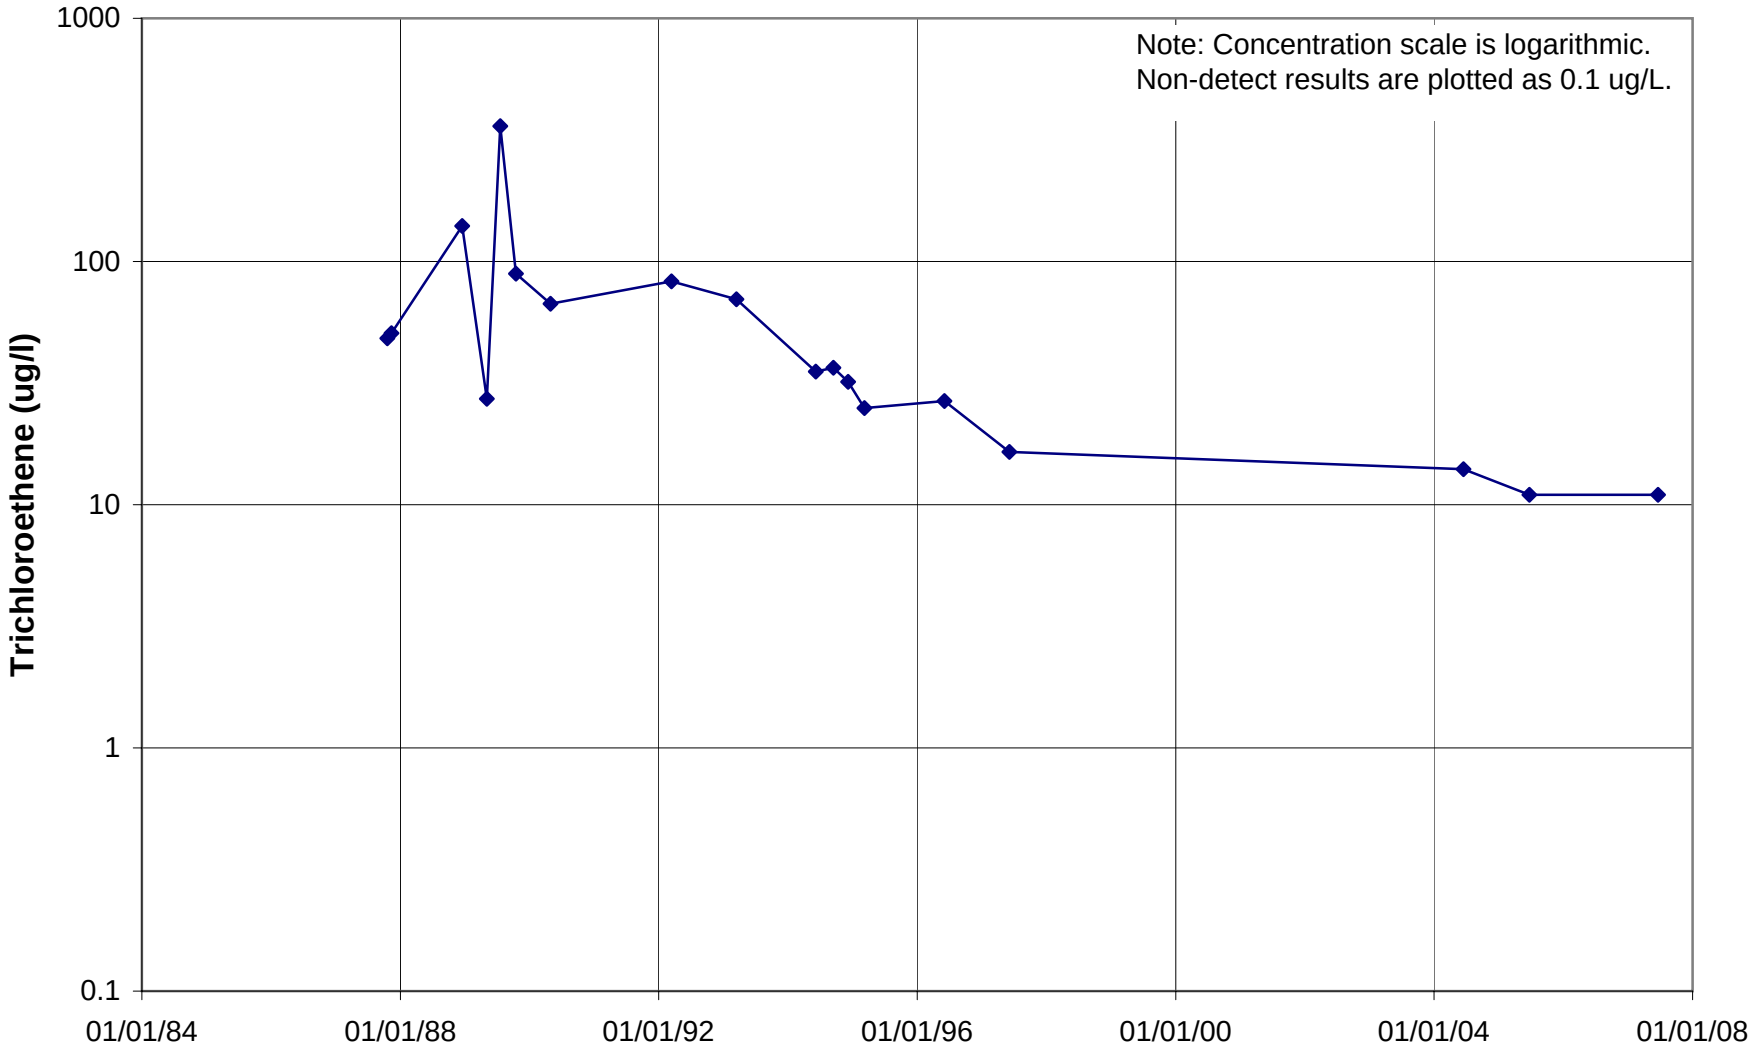

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U855

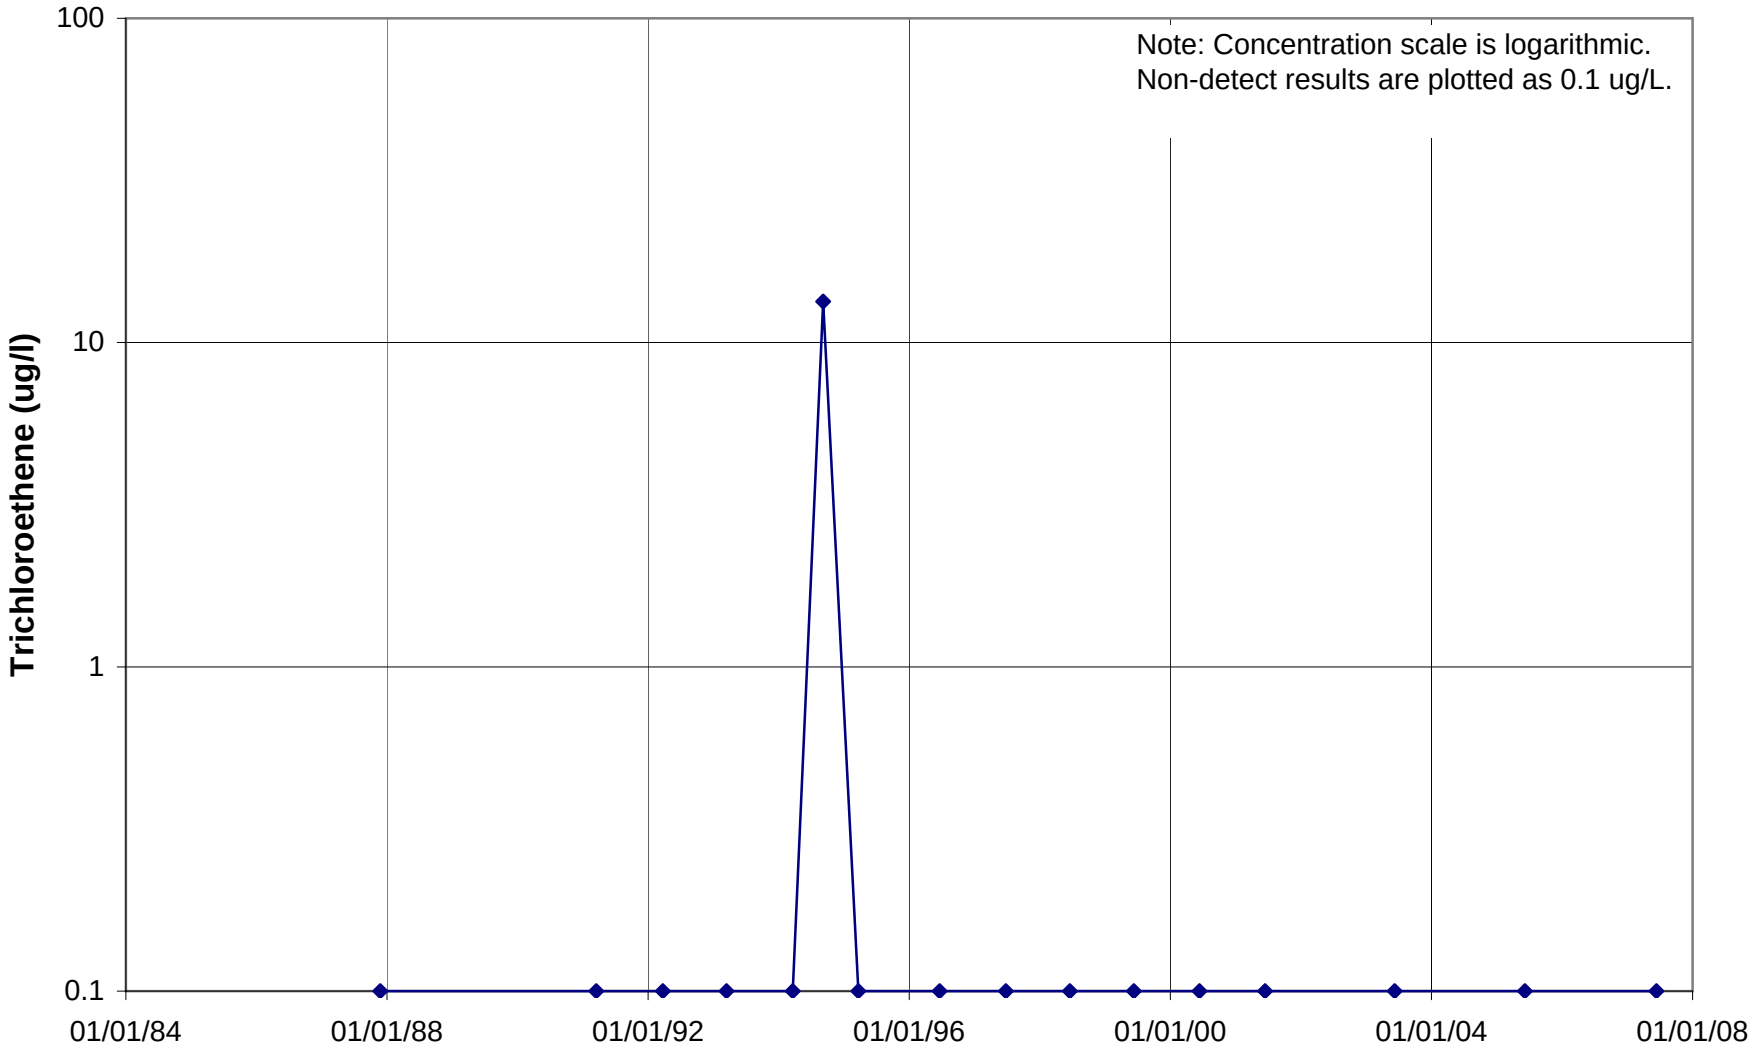

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U859

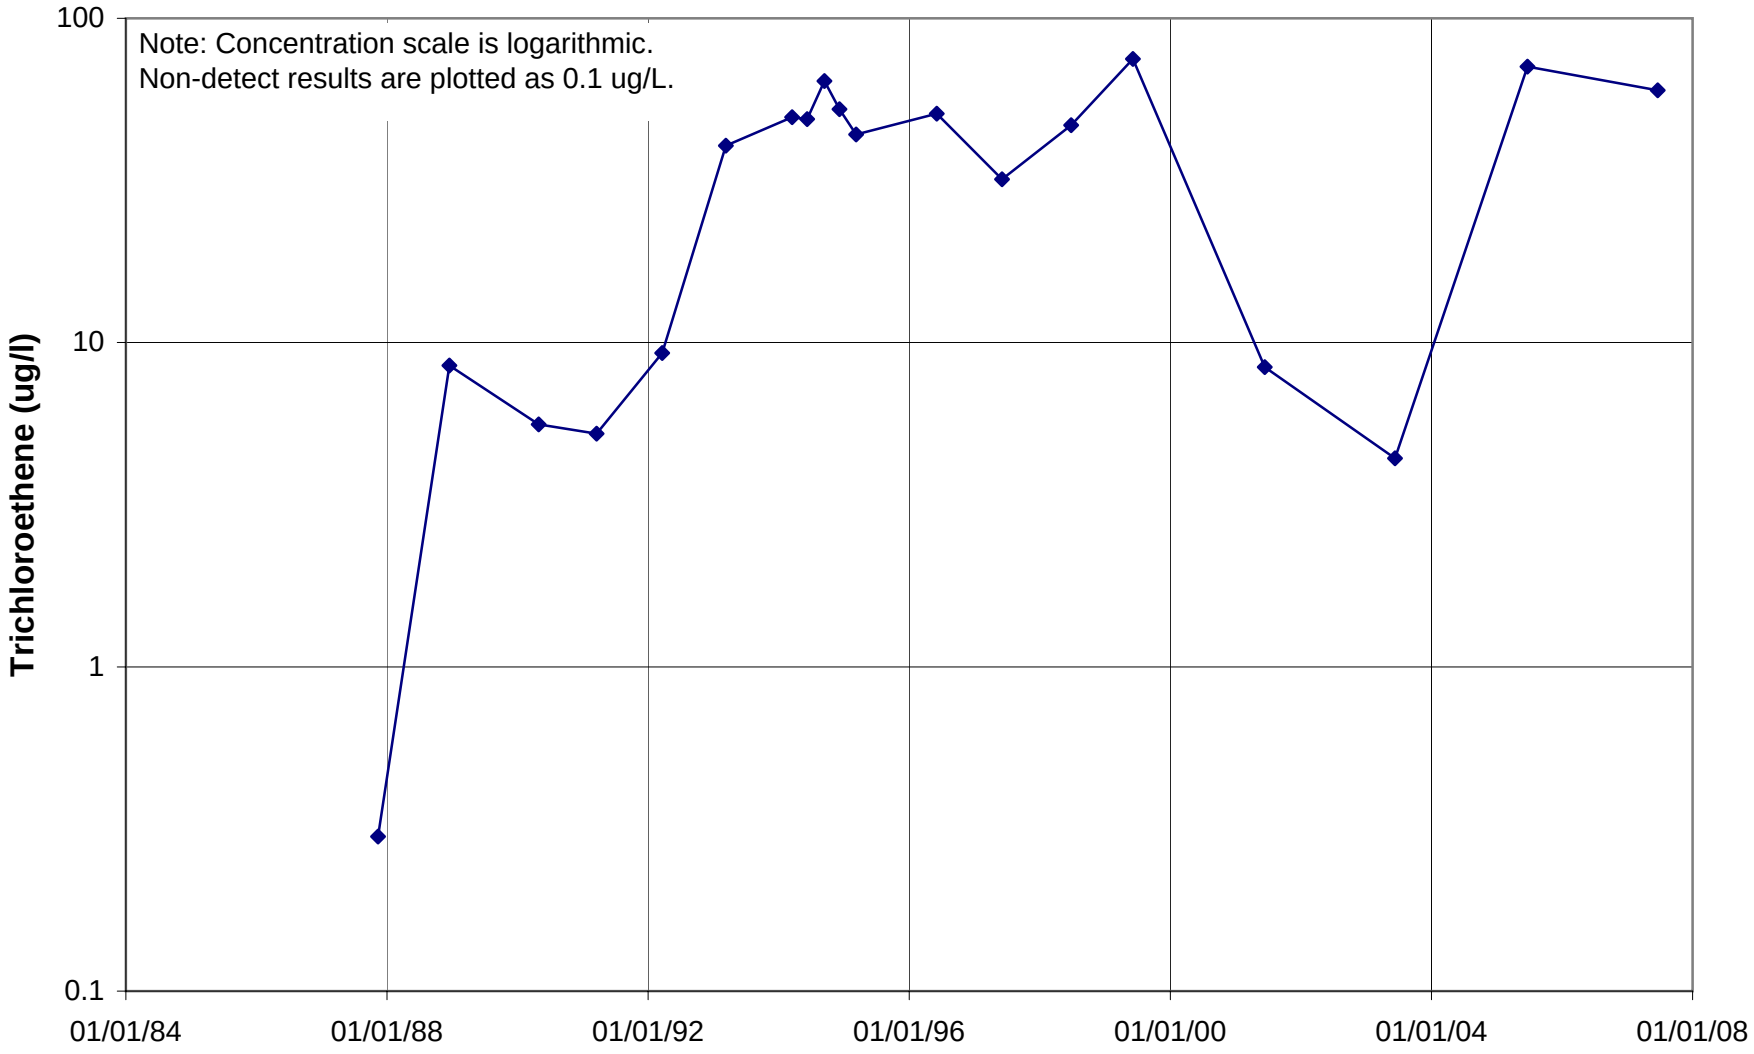

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U860

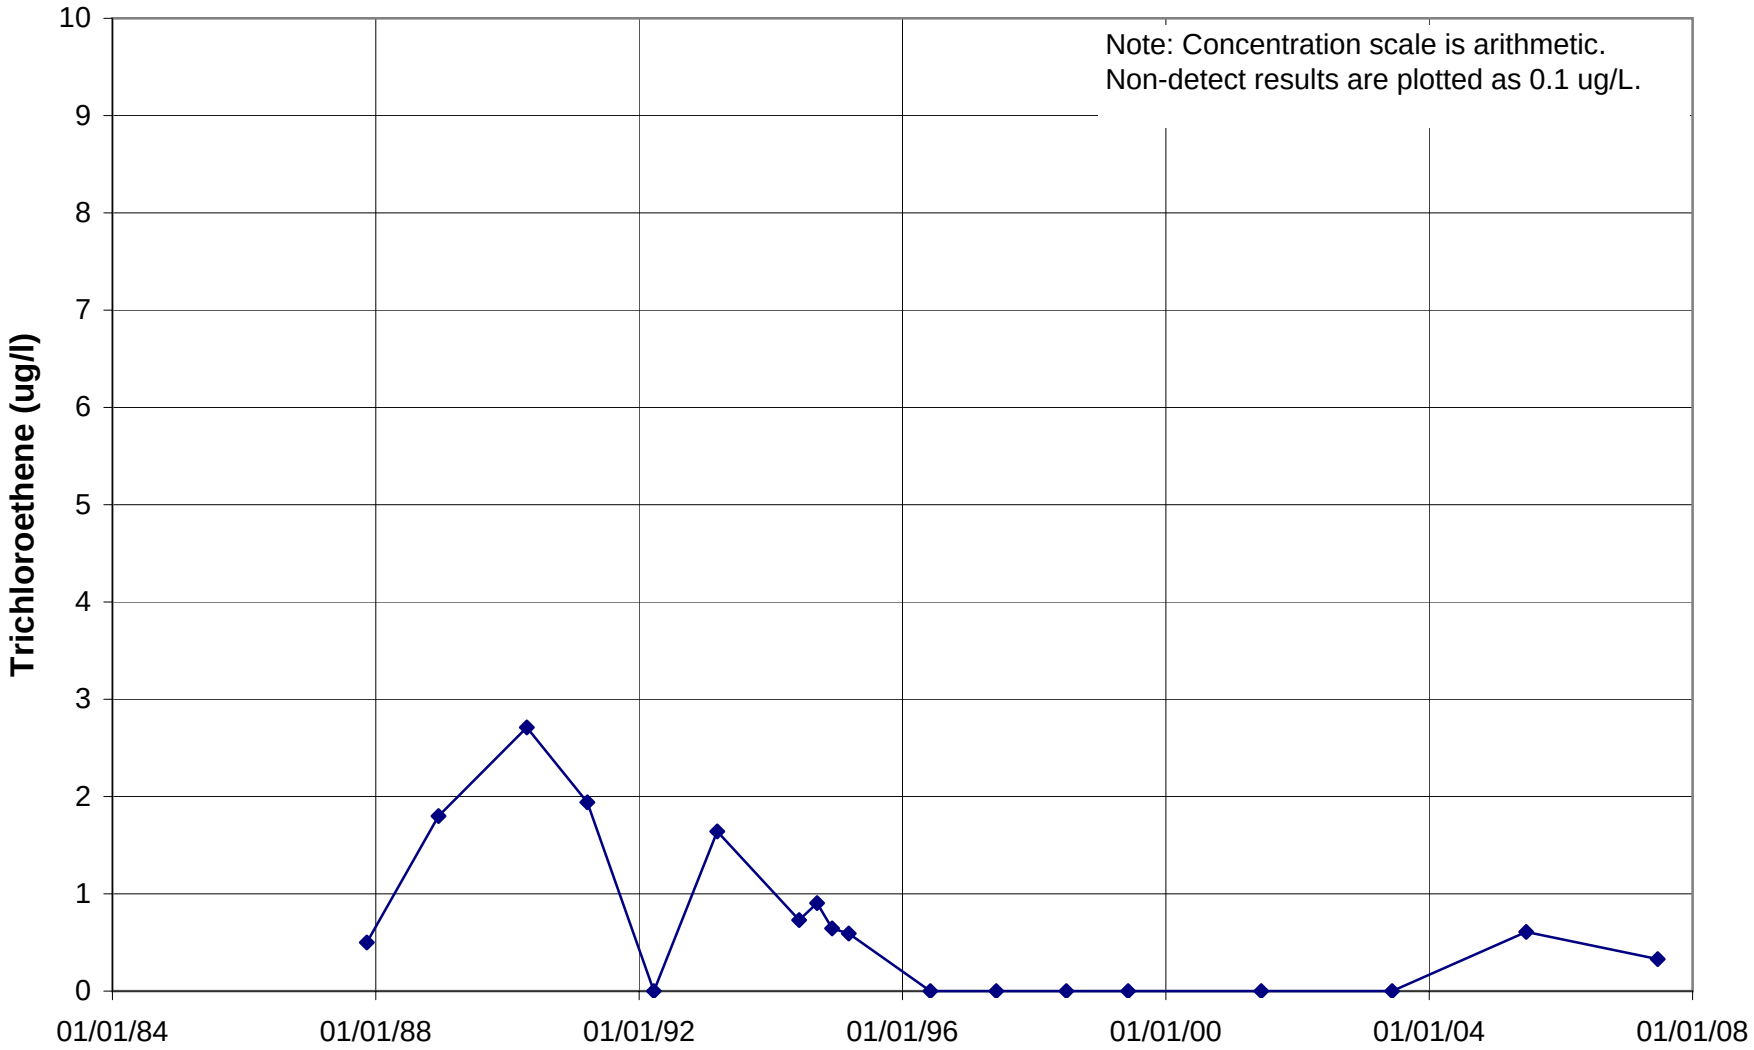

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U861

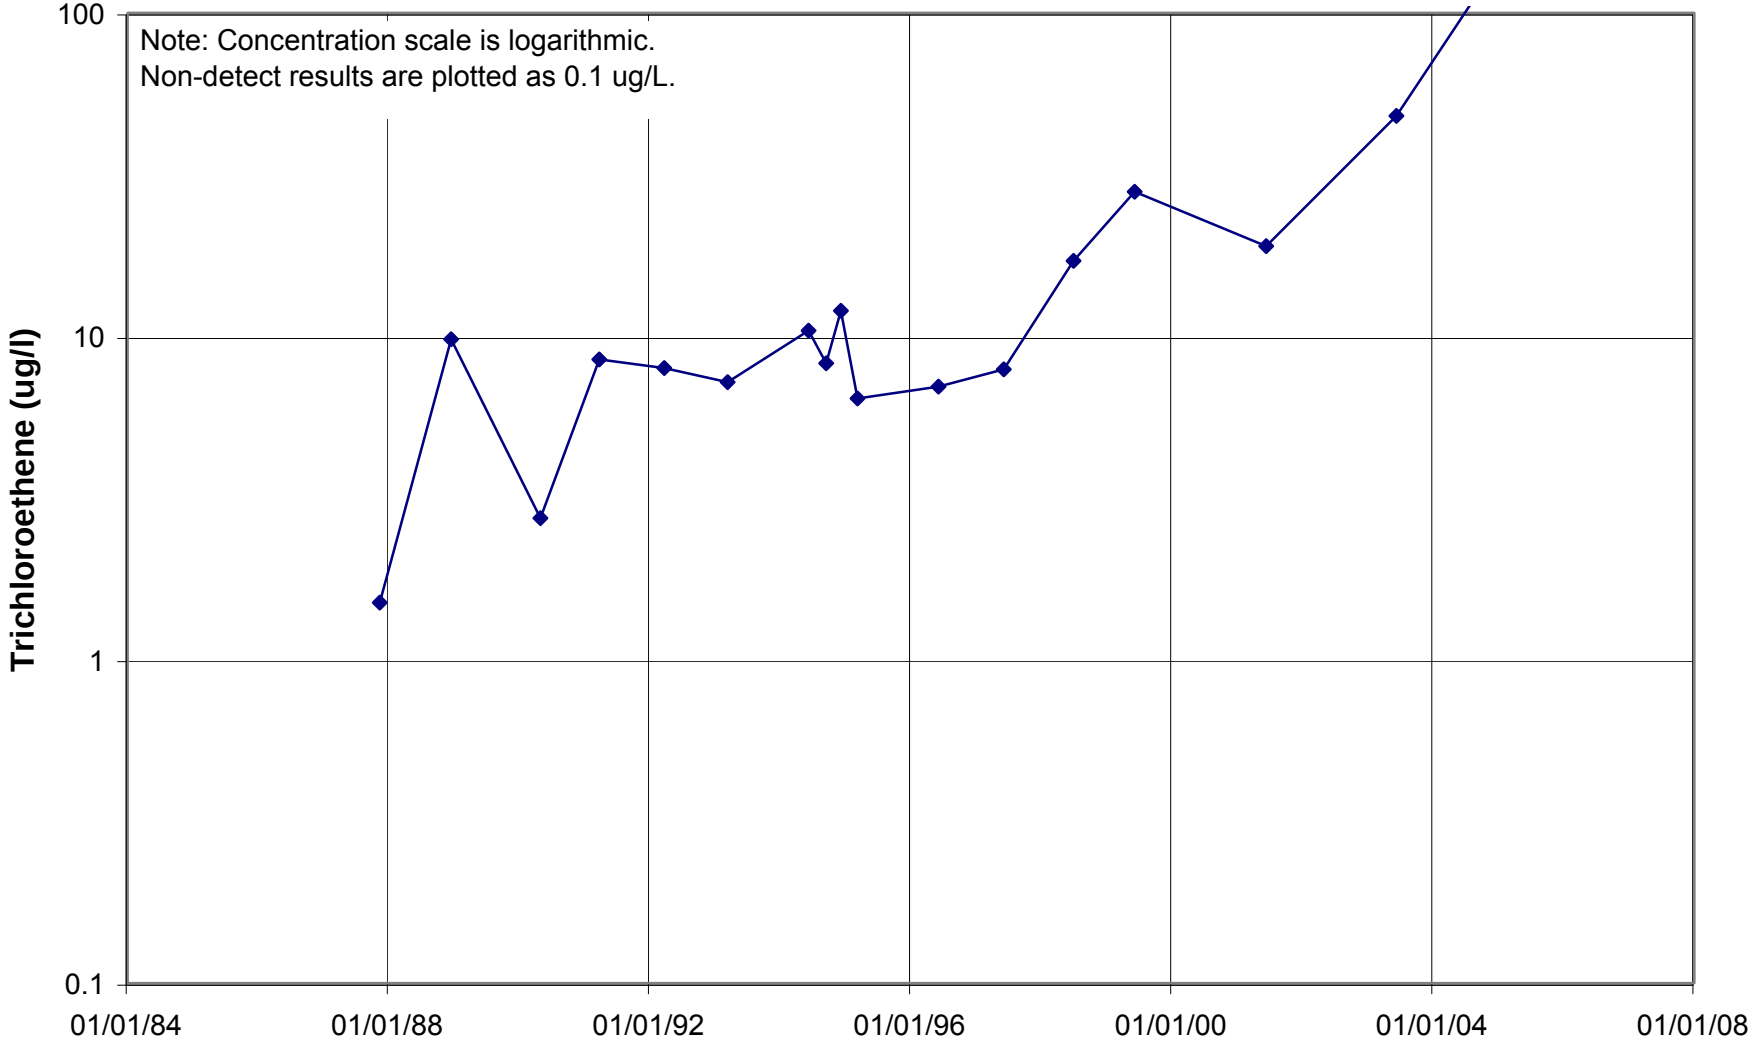

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U863

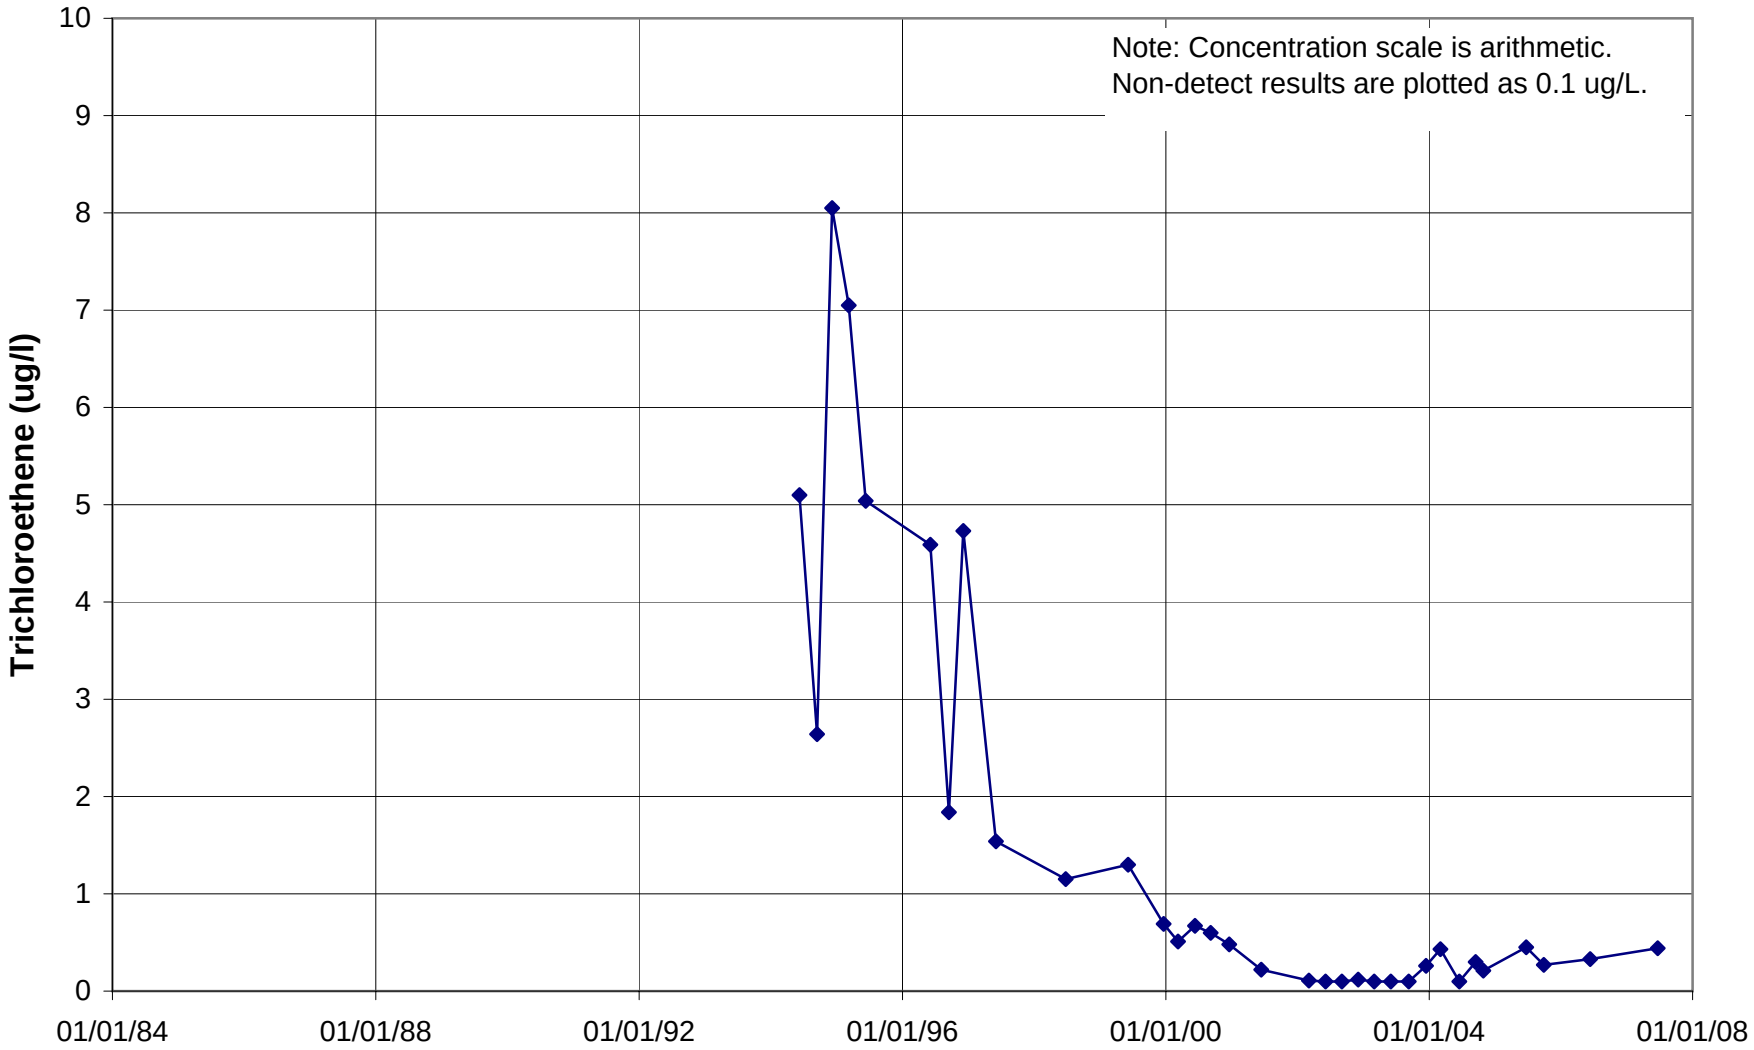

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U864

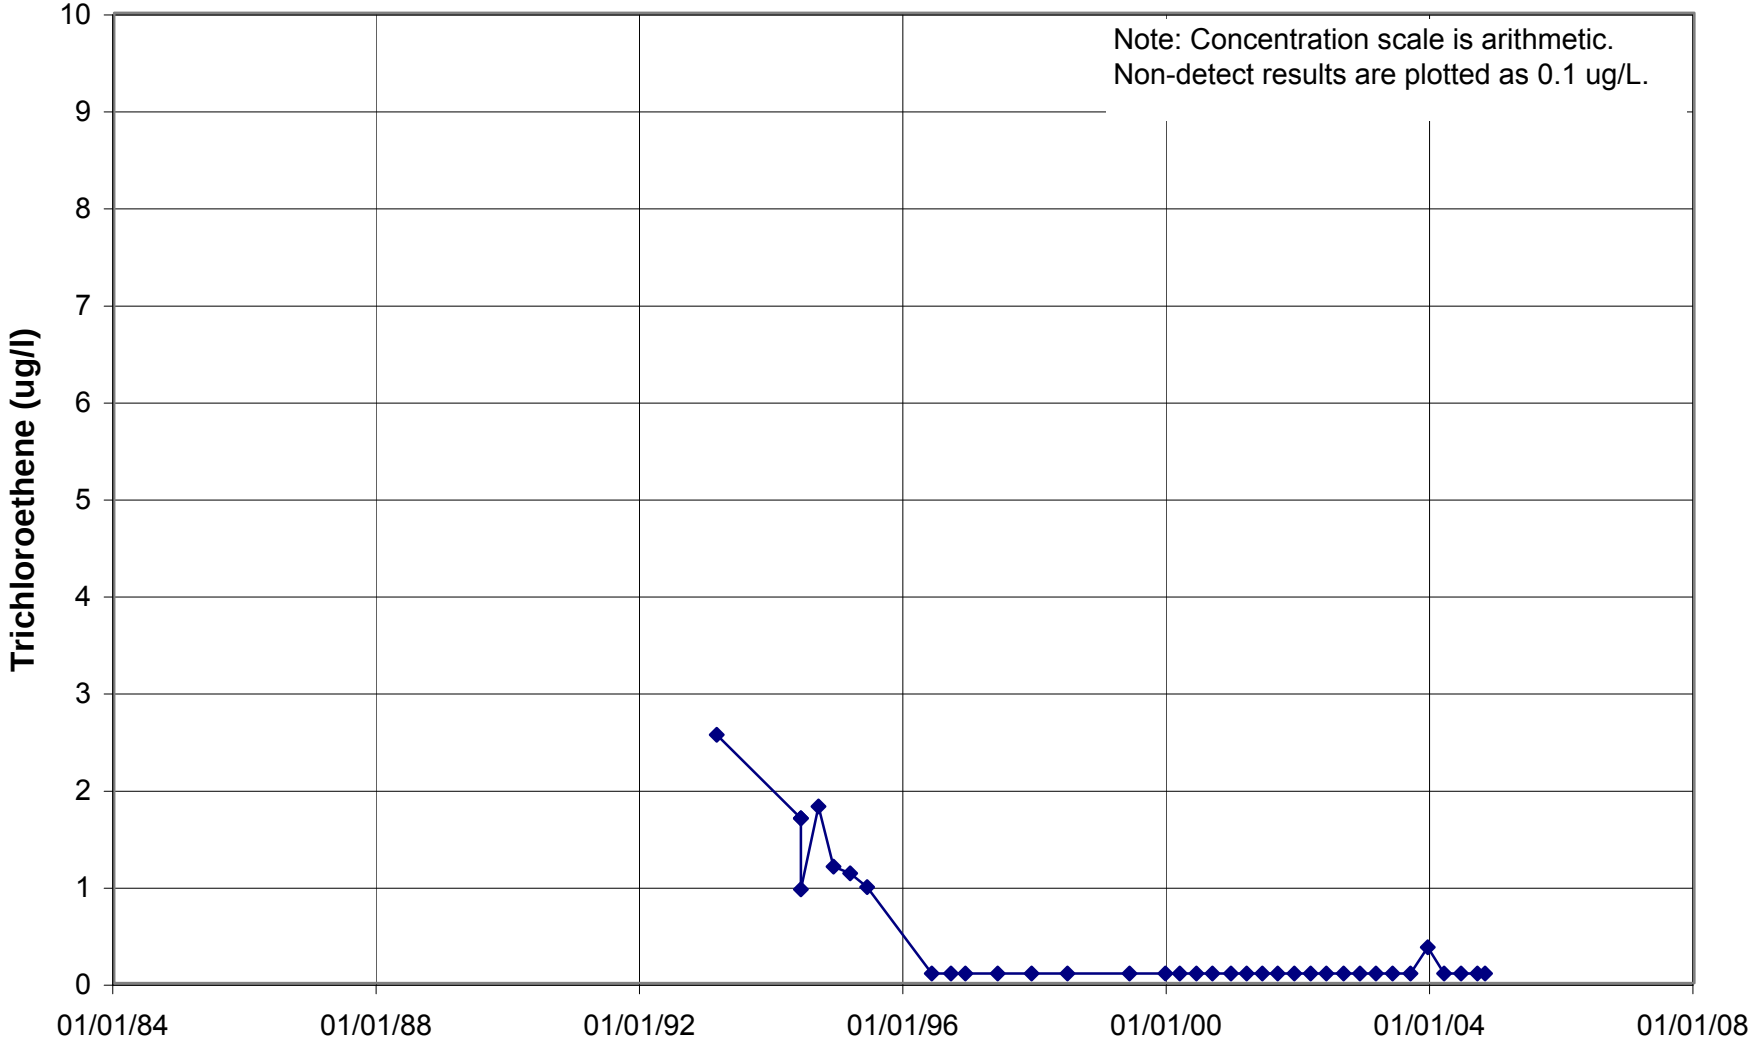

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U865

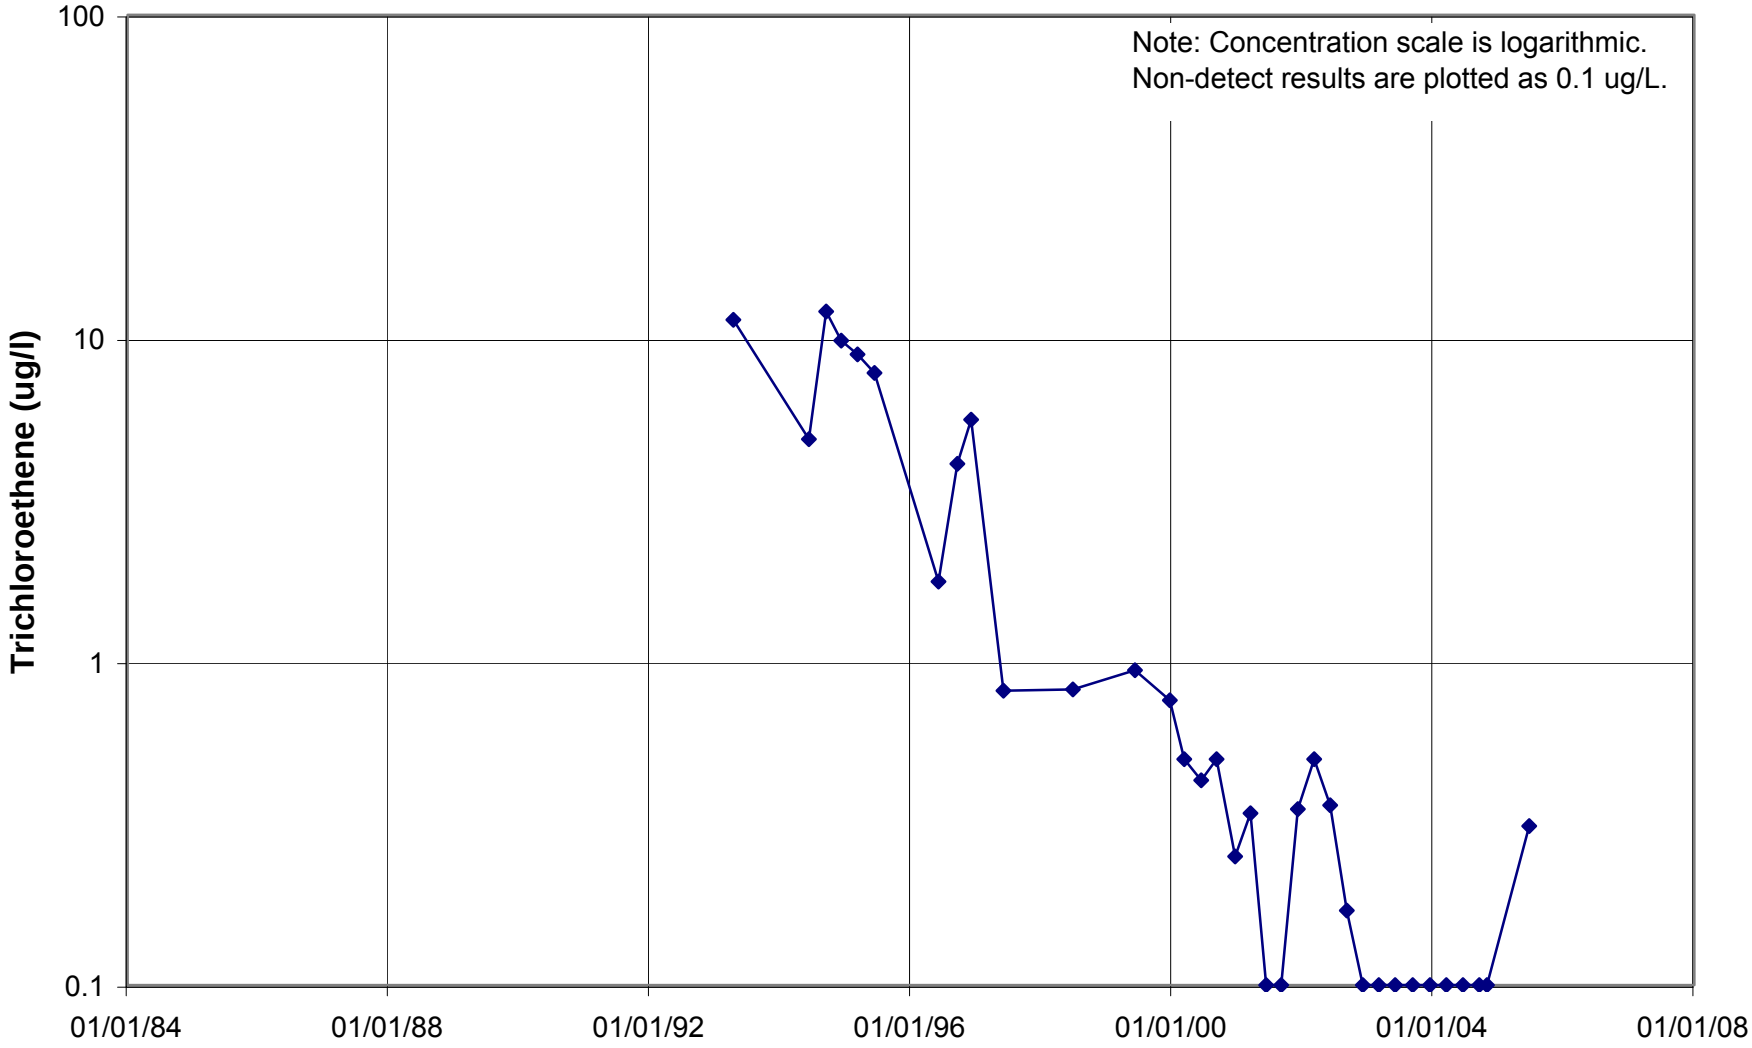

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U866

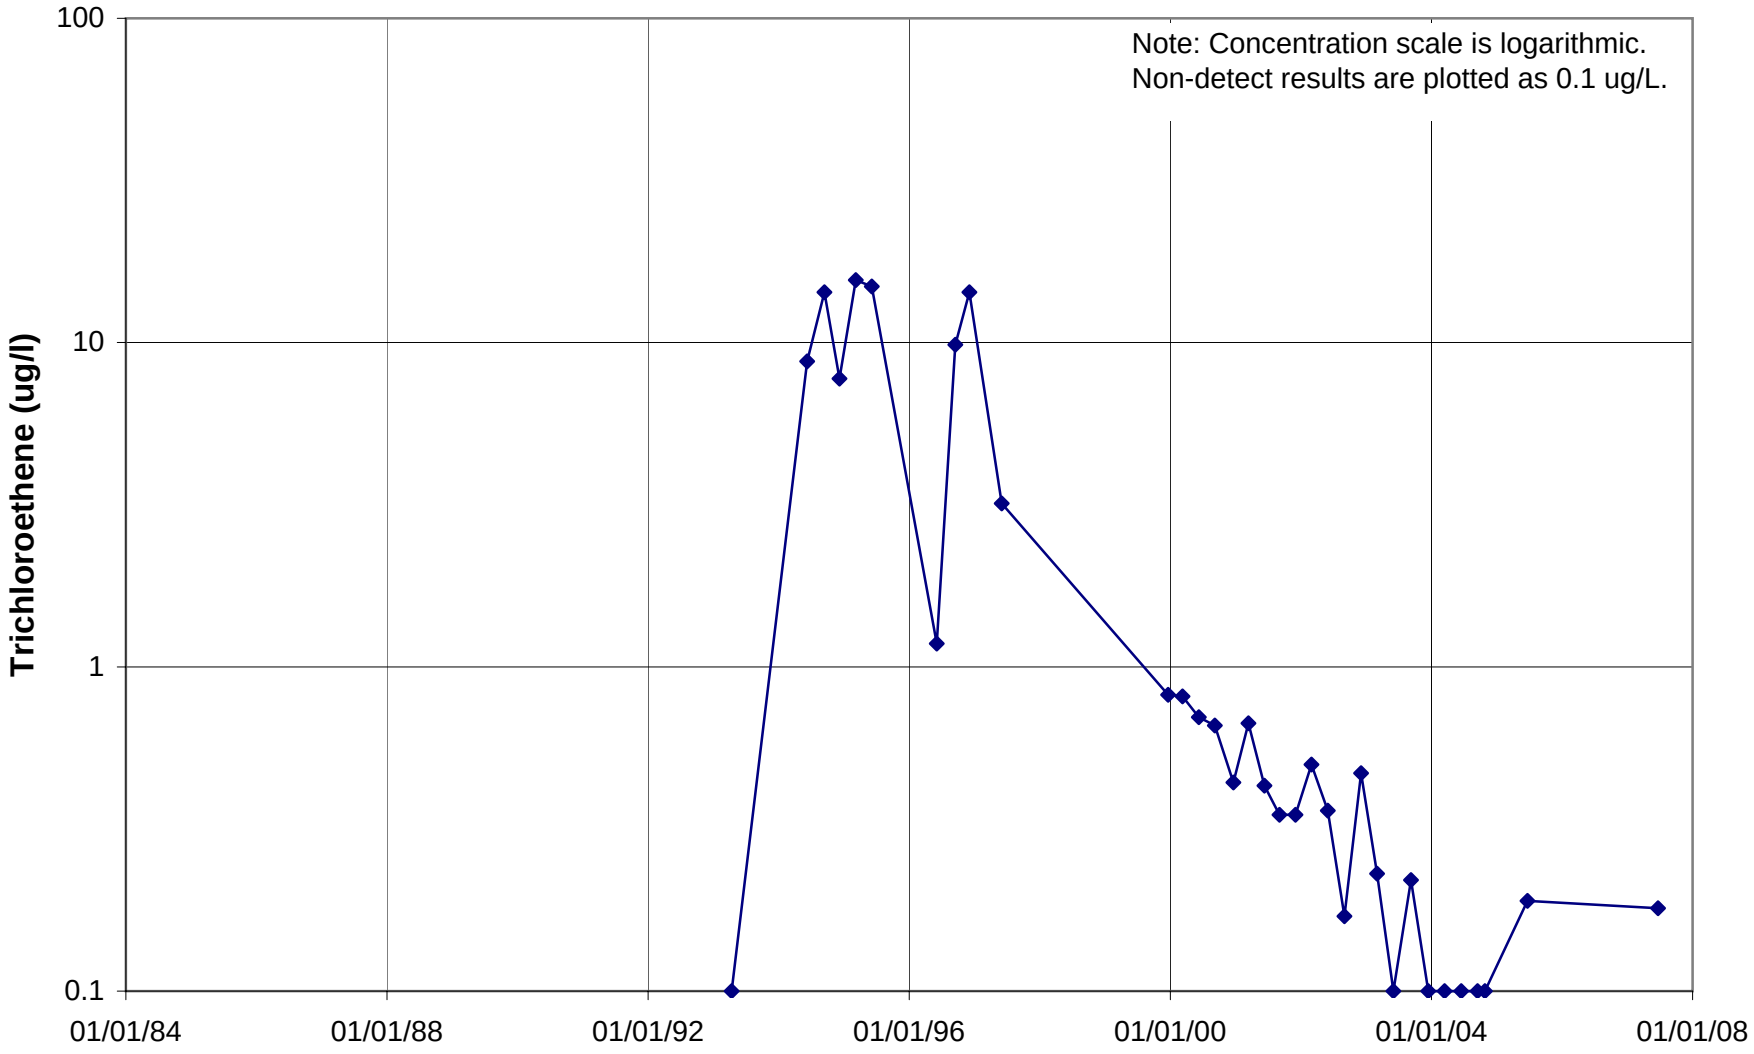

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U871

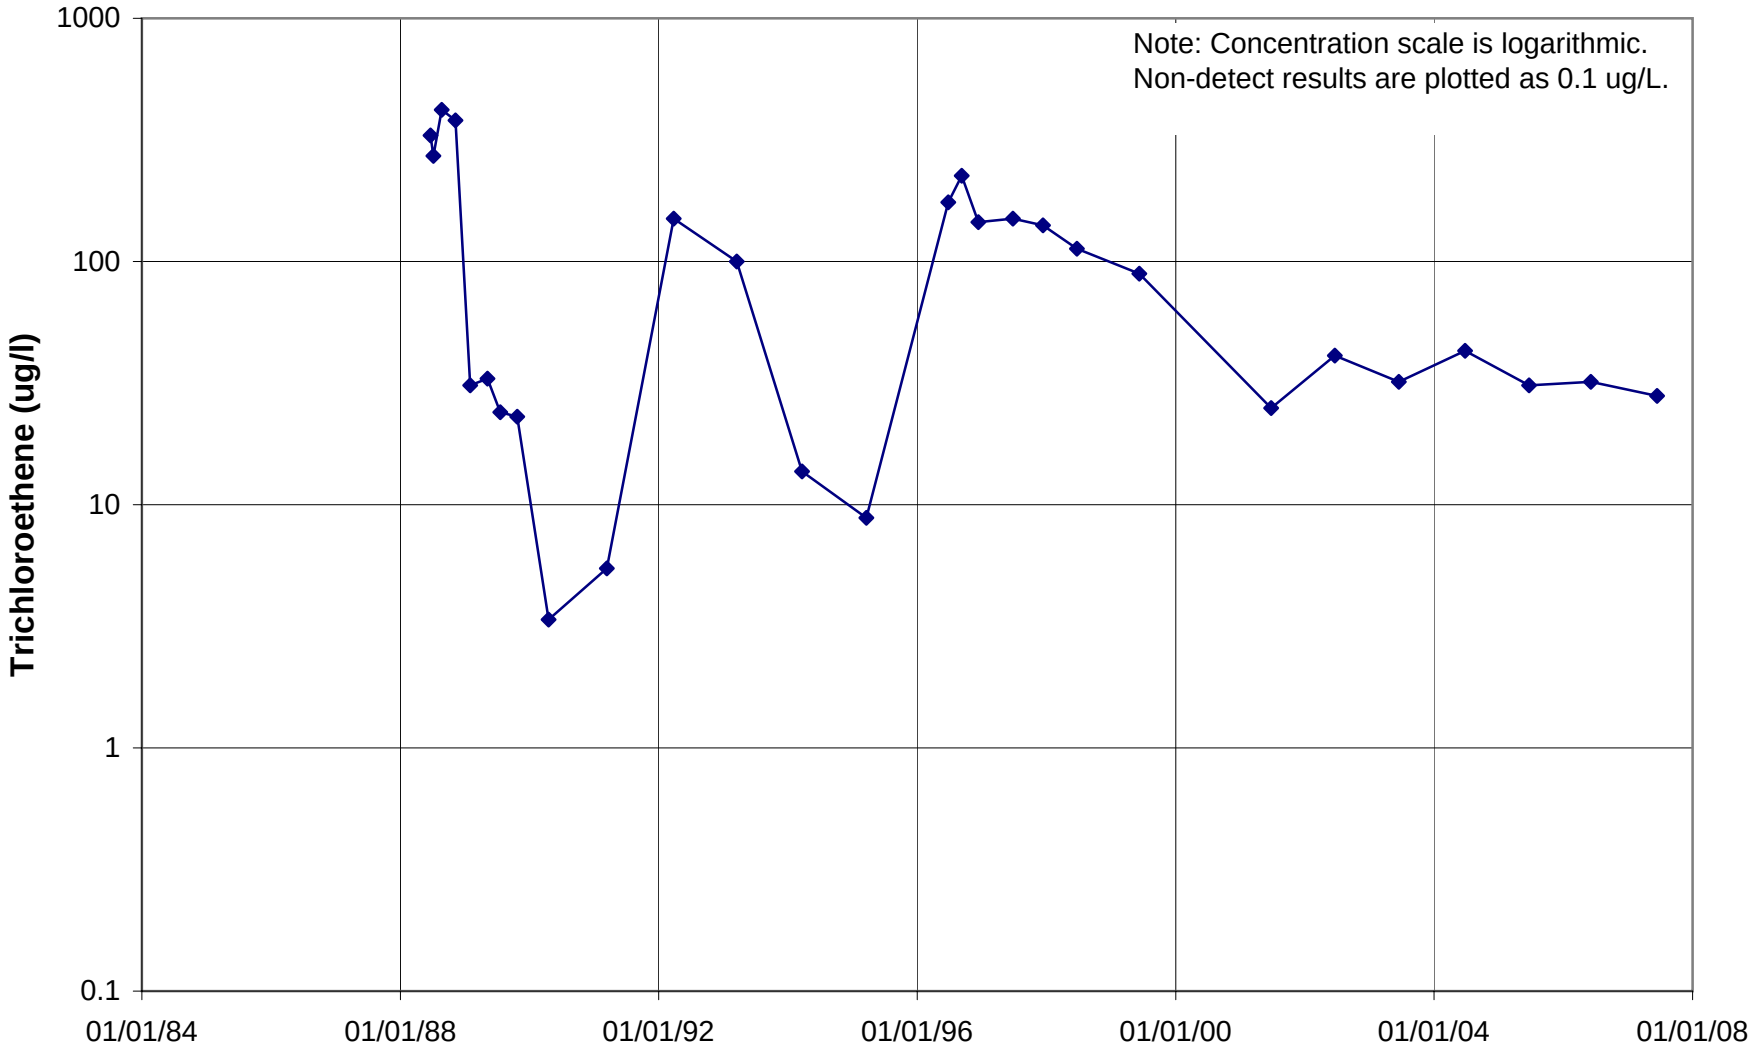

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U872

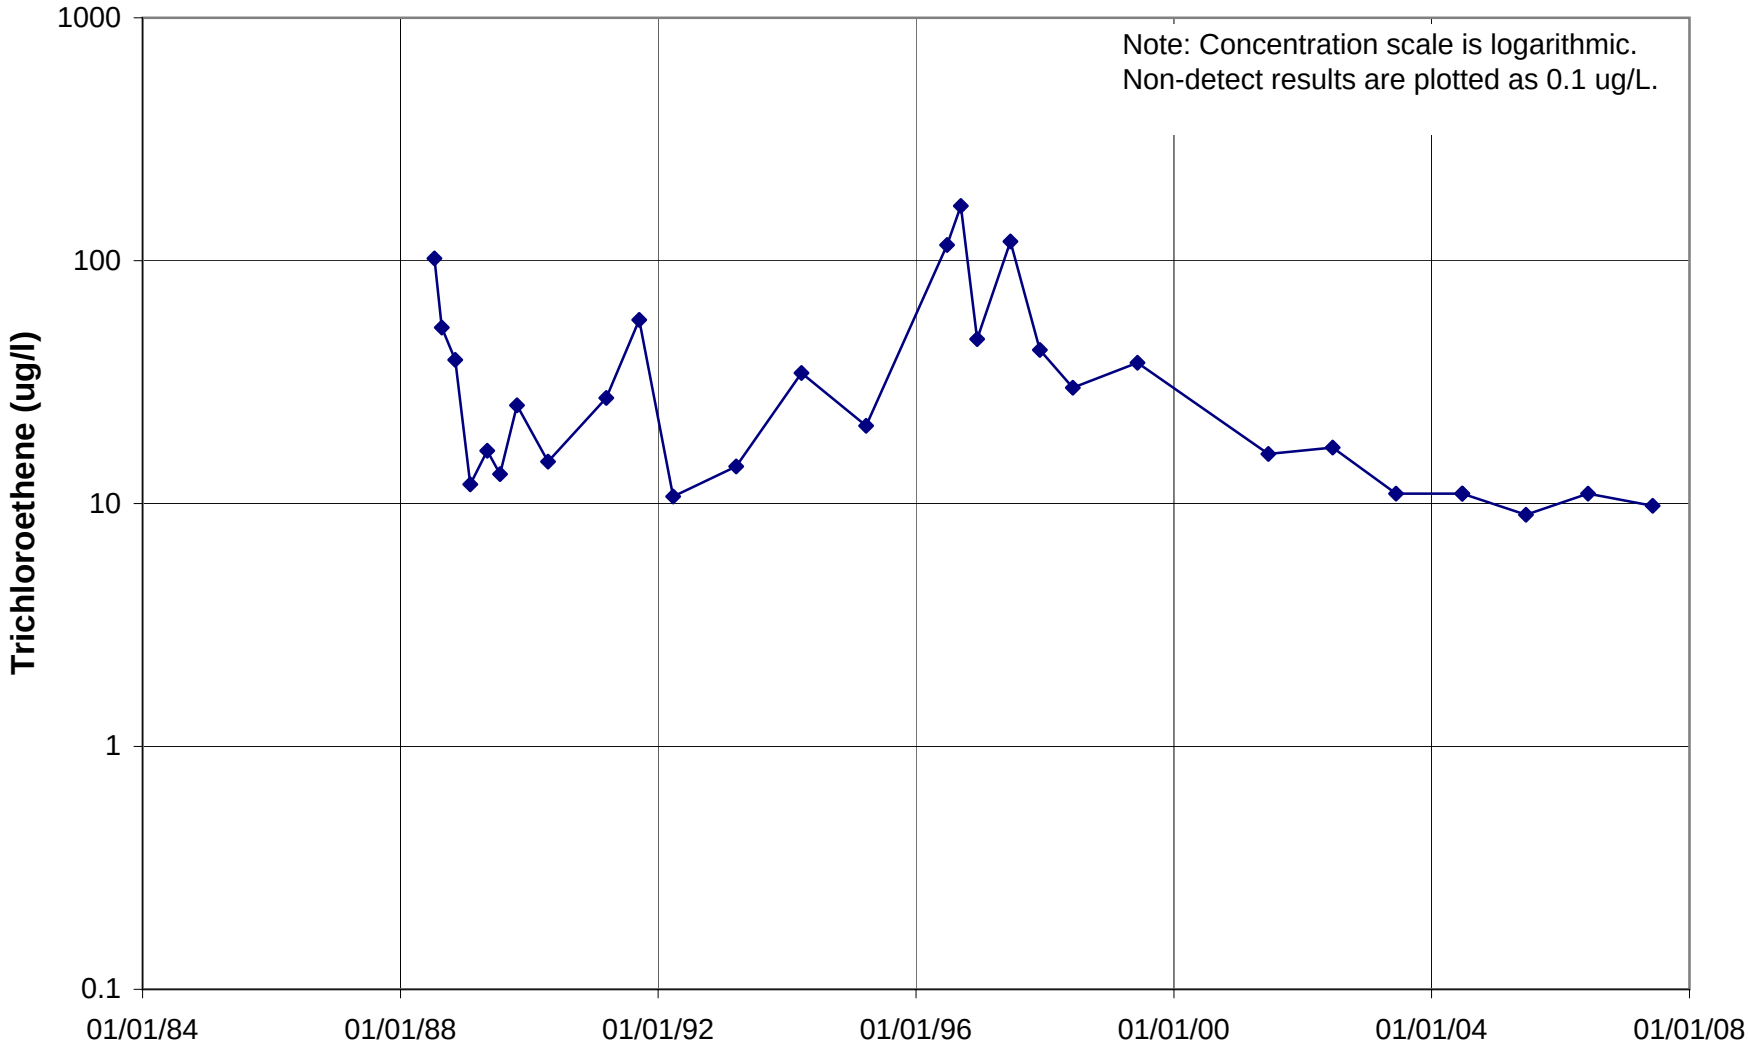

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U875

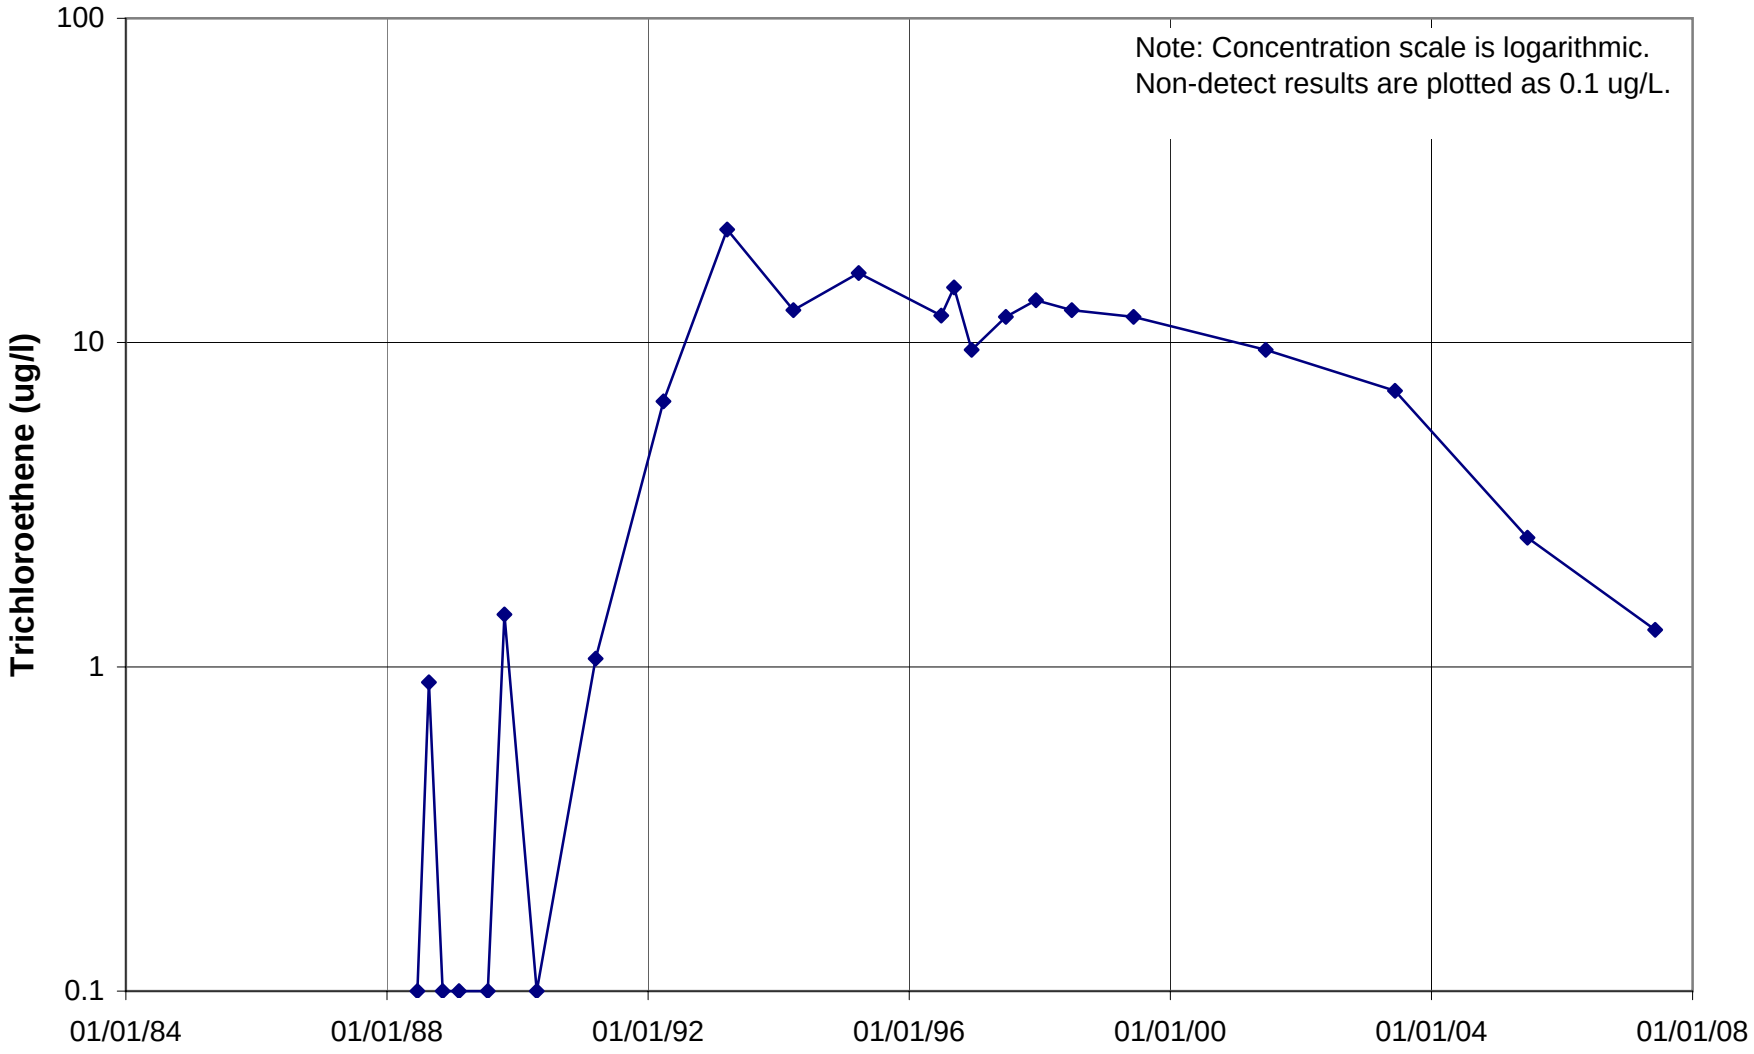

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U877

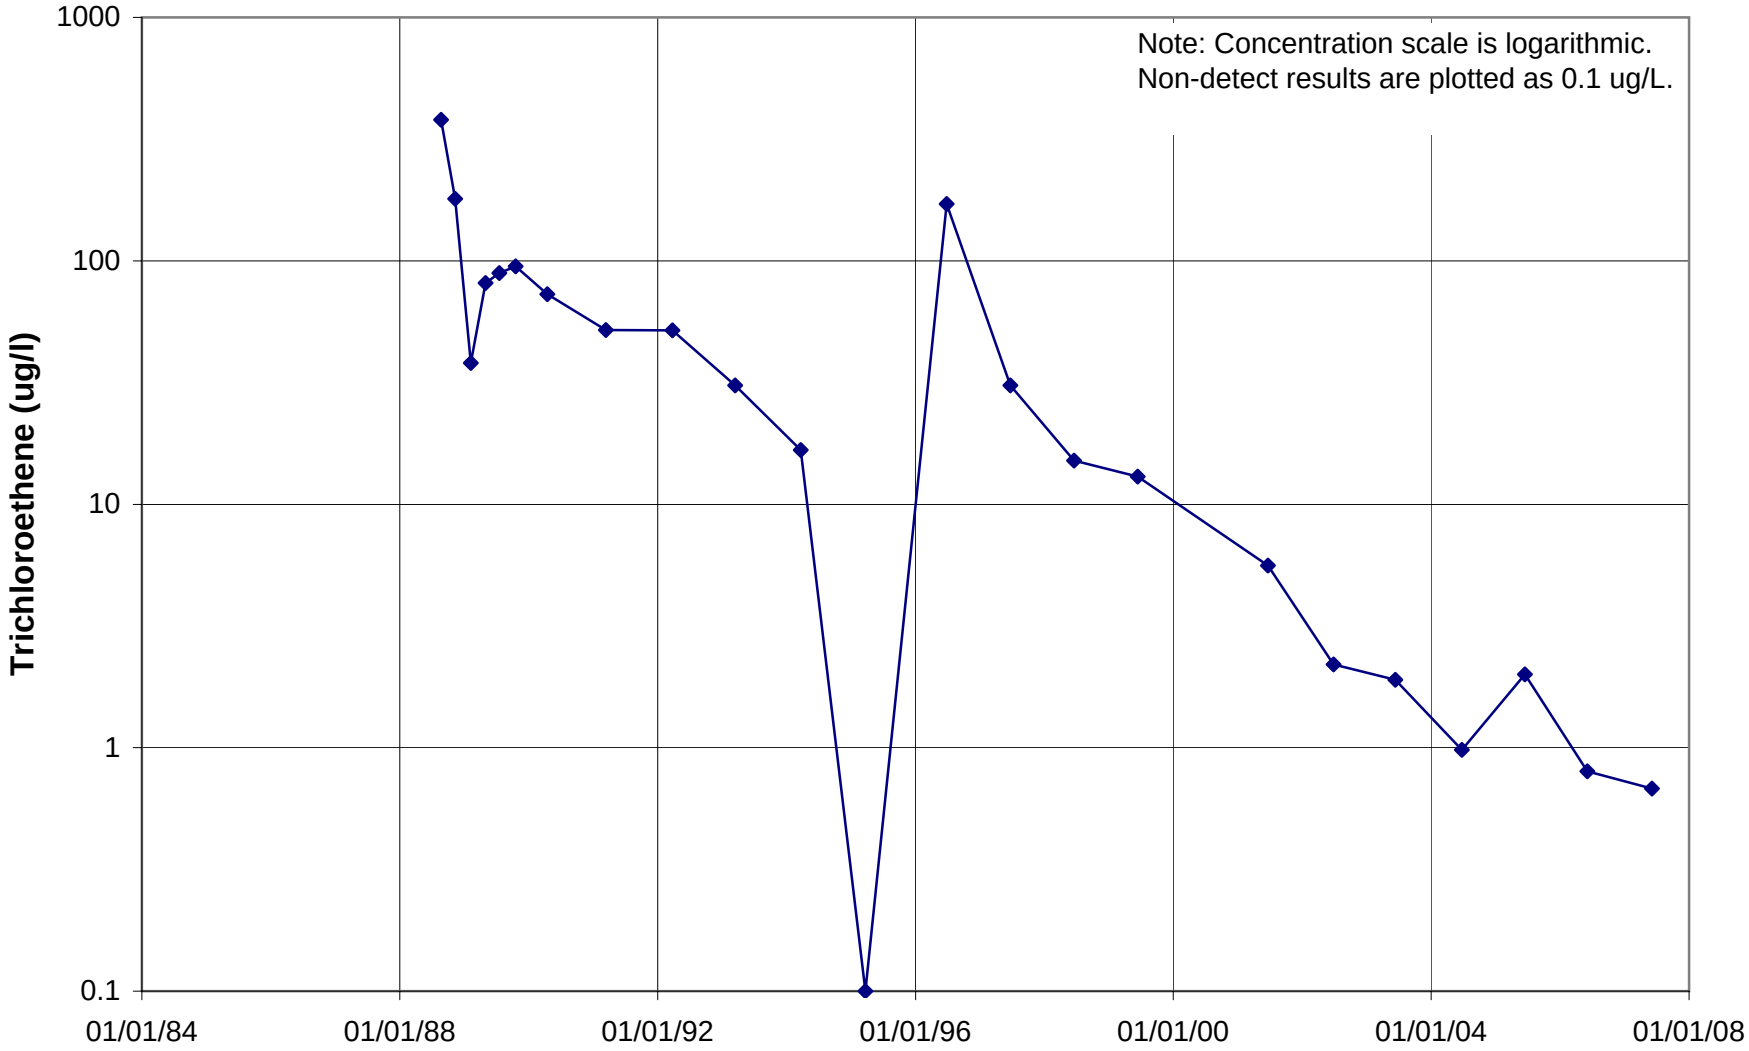

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U879

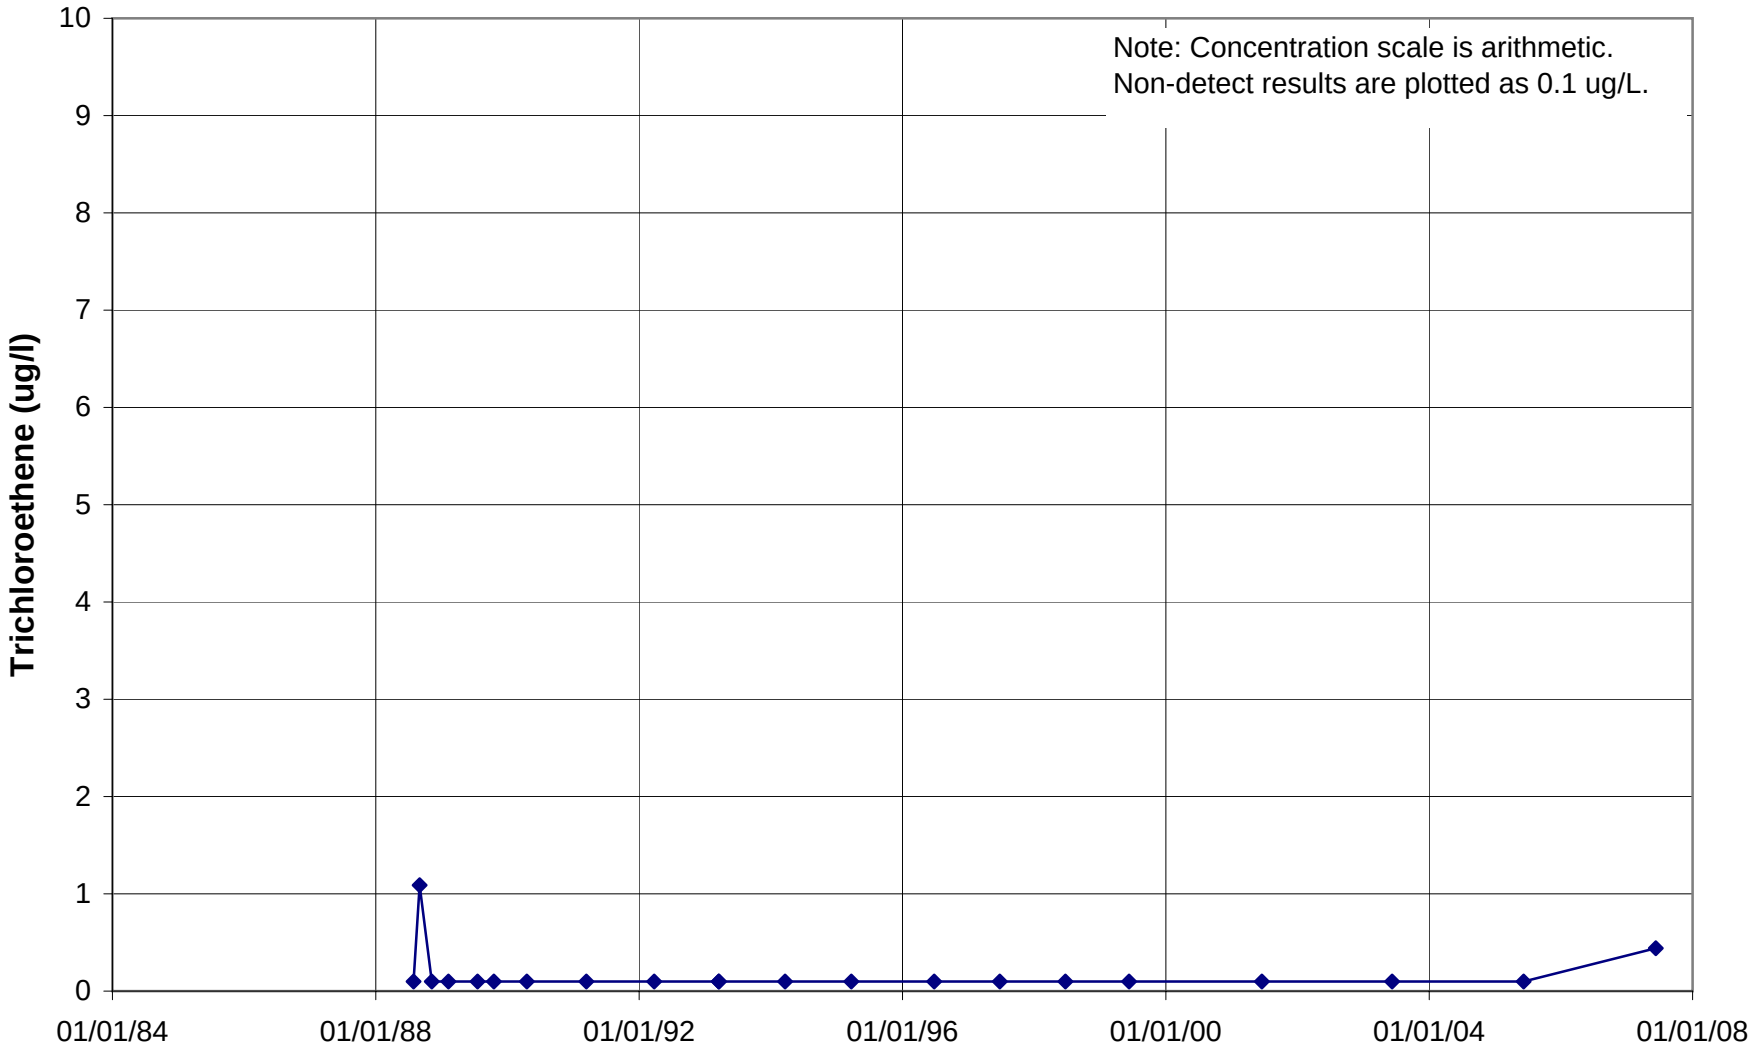

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U880

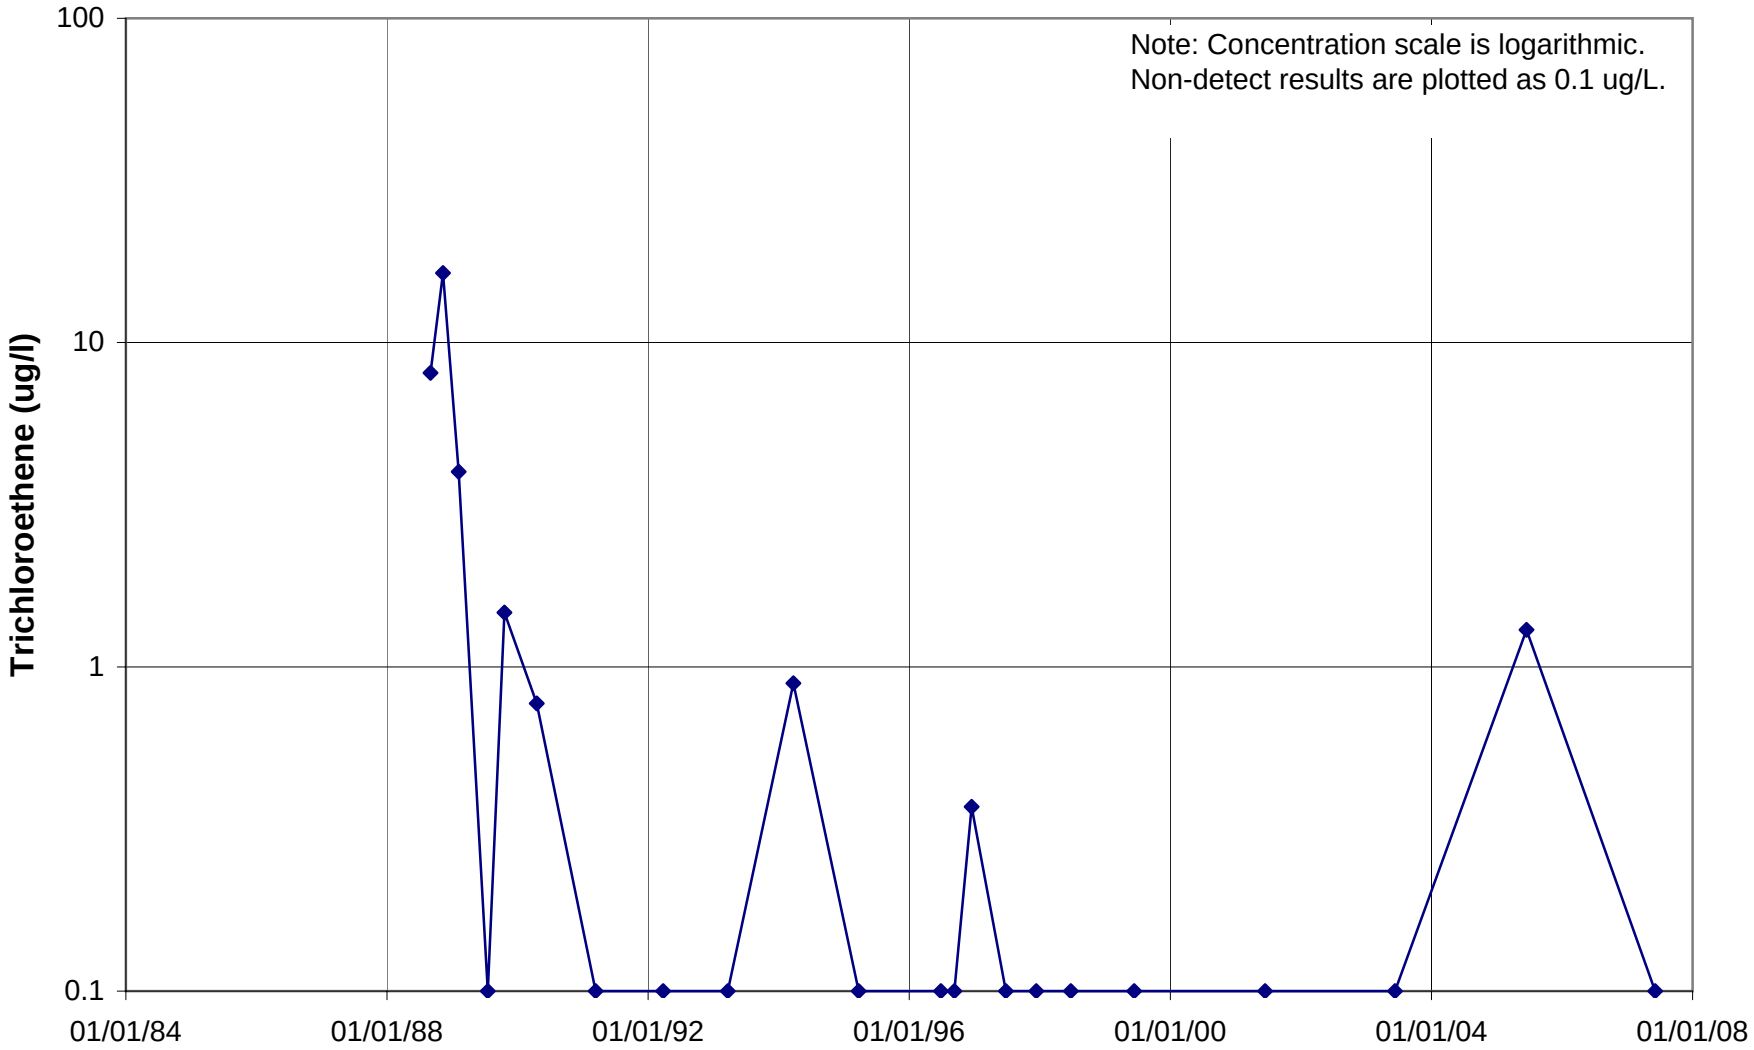

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U881

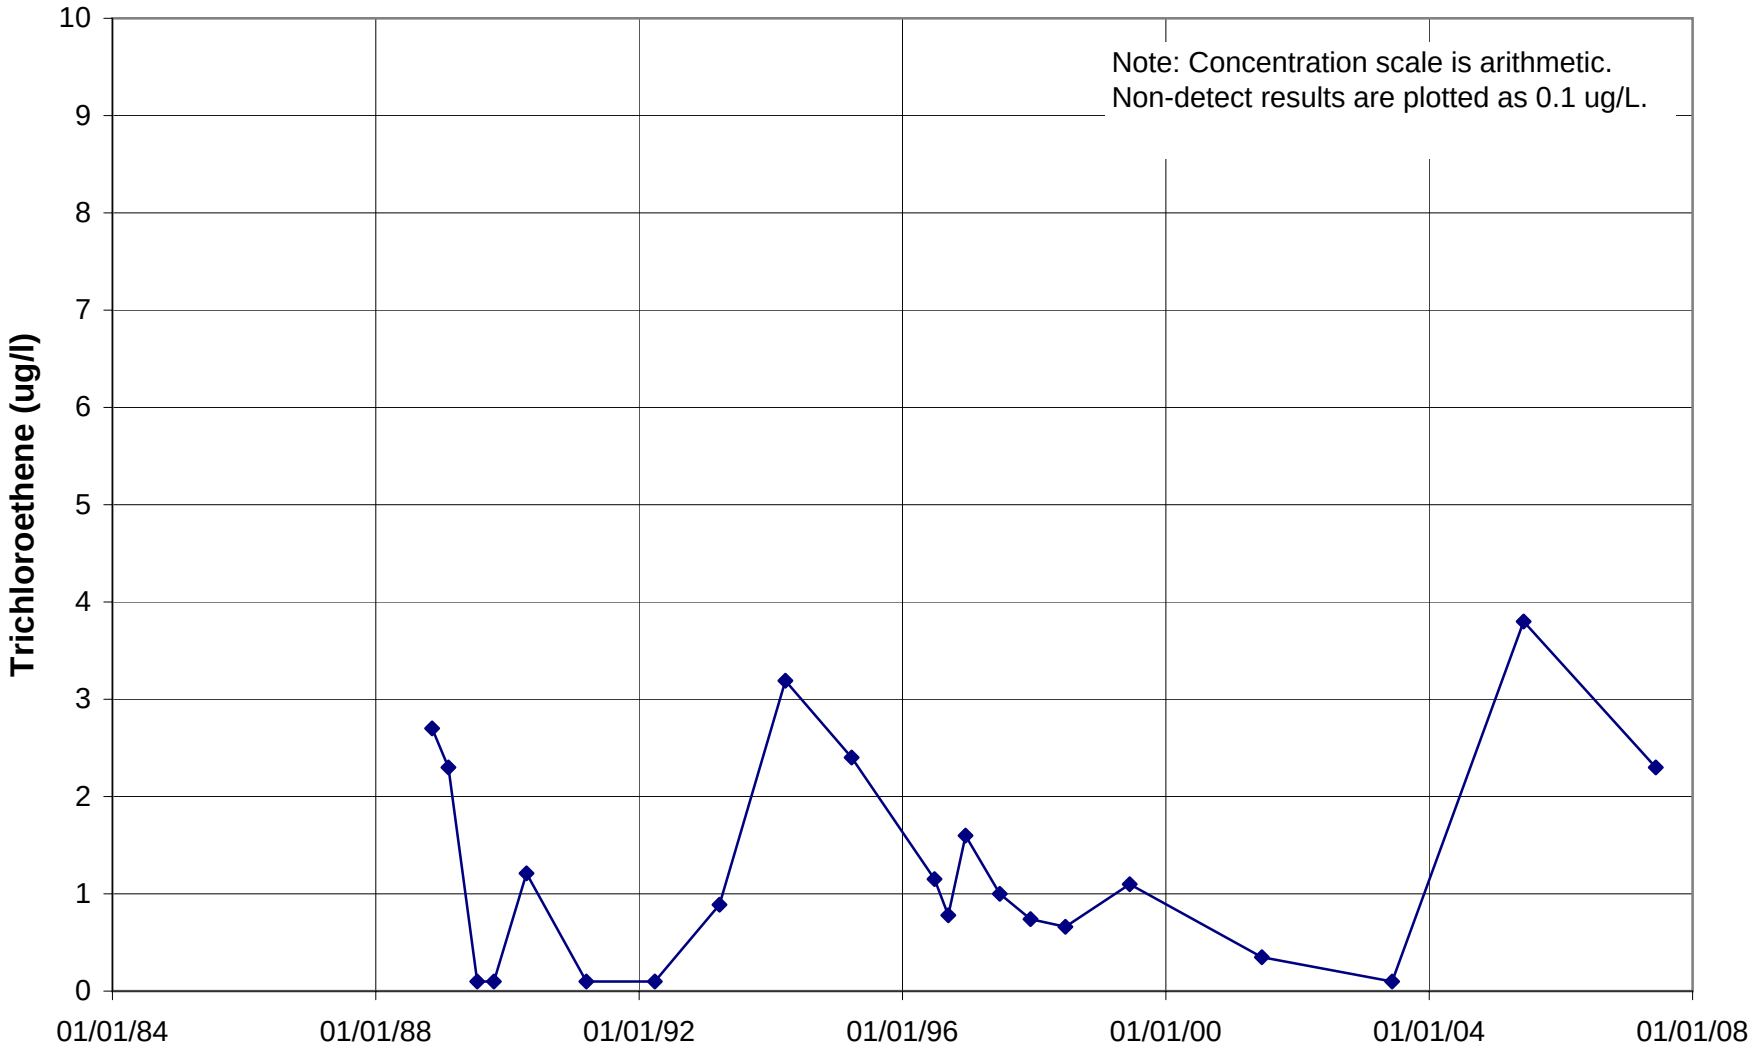

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U882

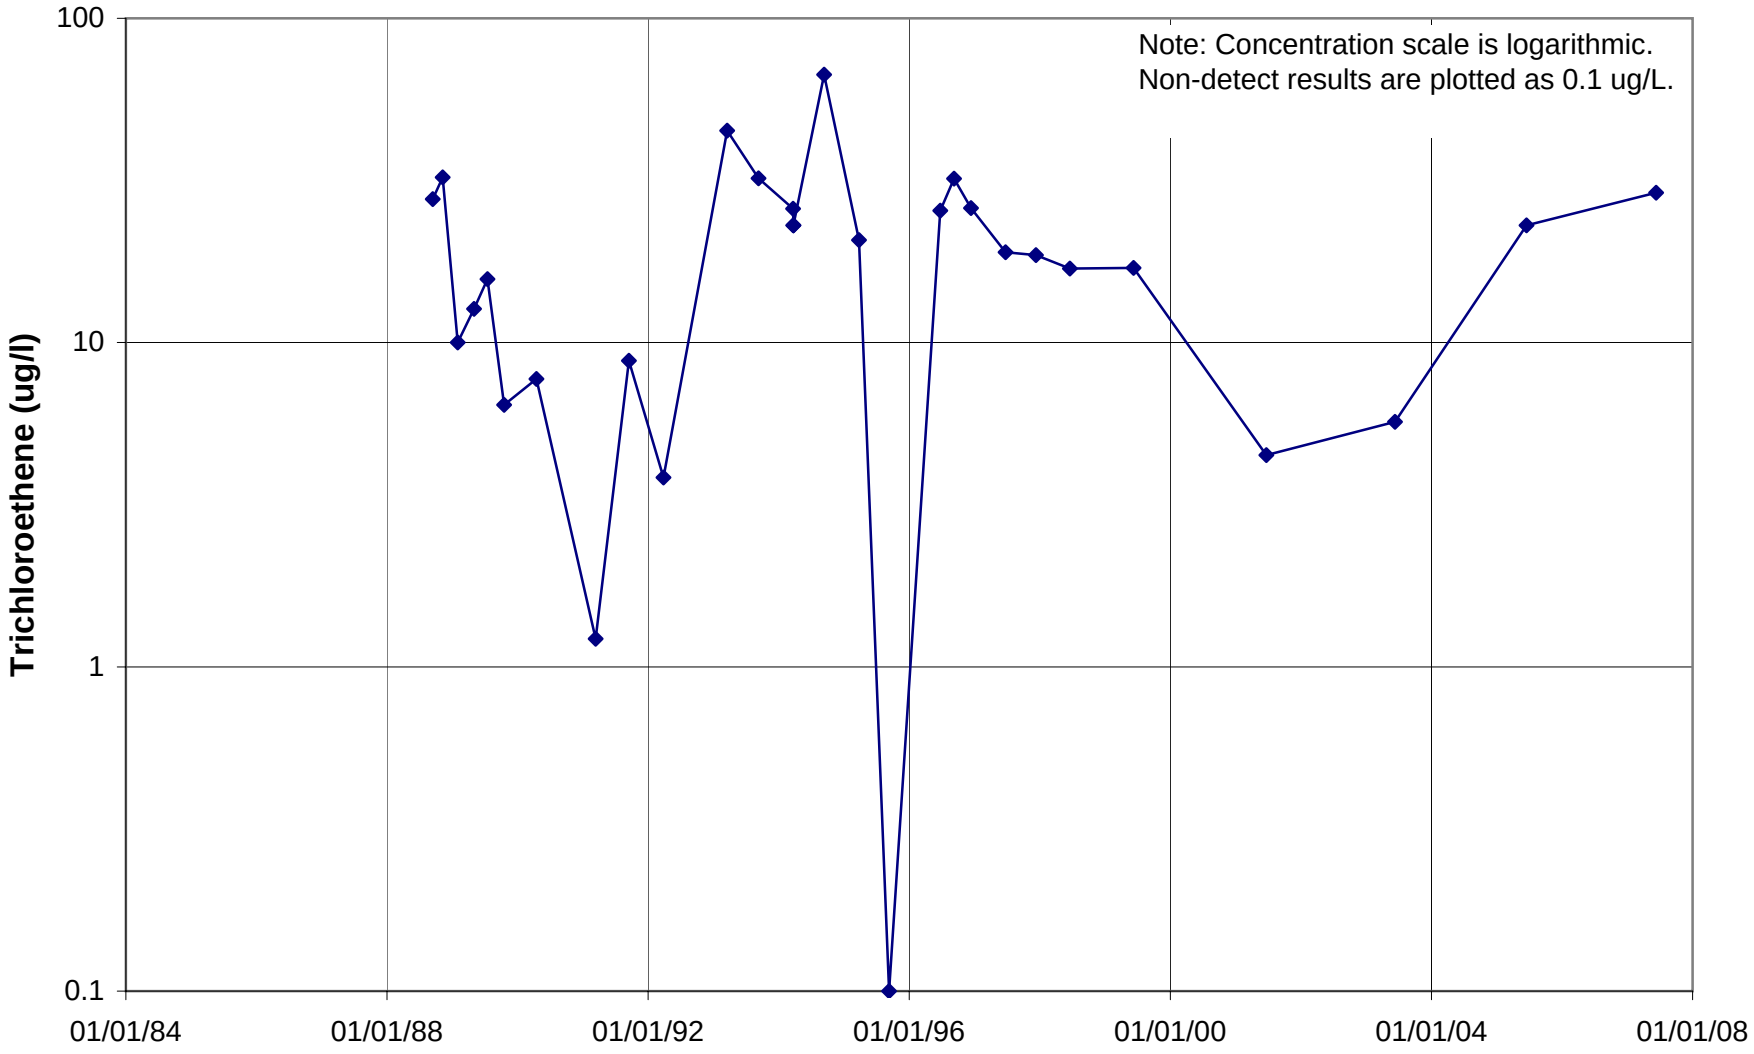

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

04U883

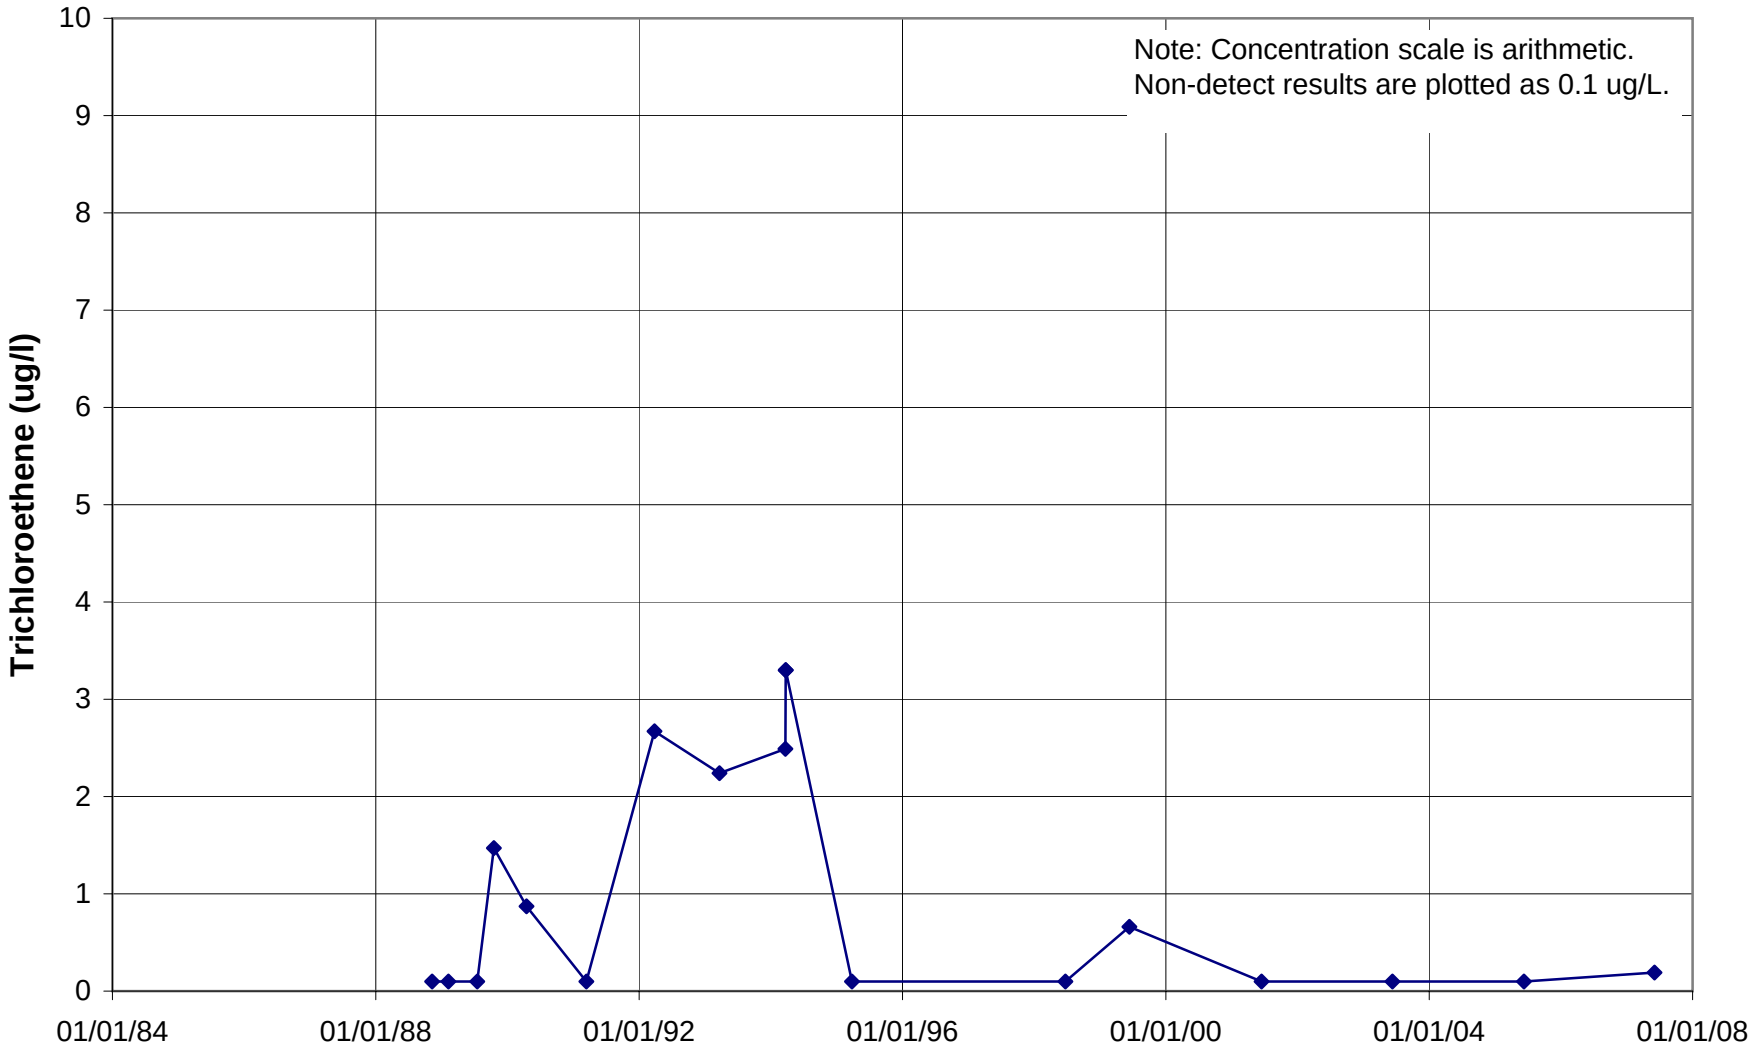

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

191942

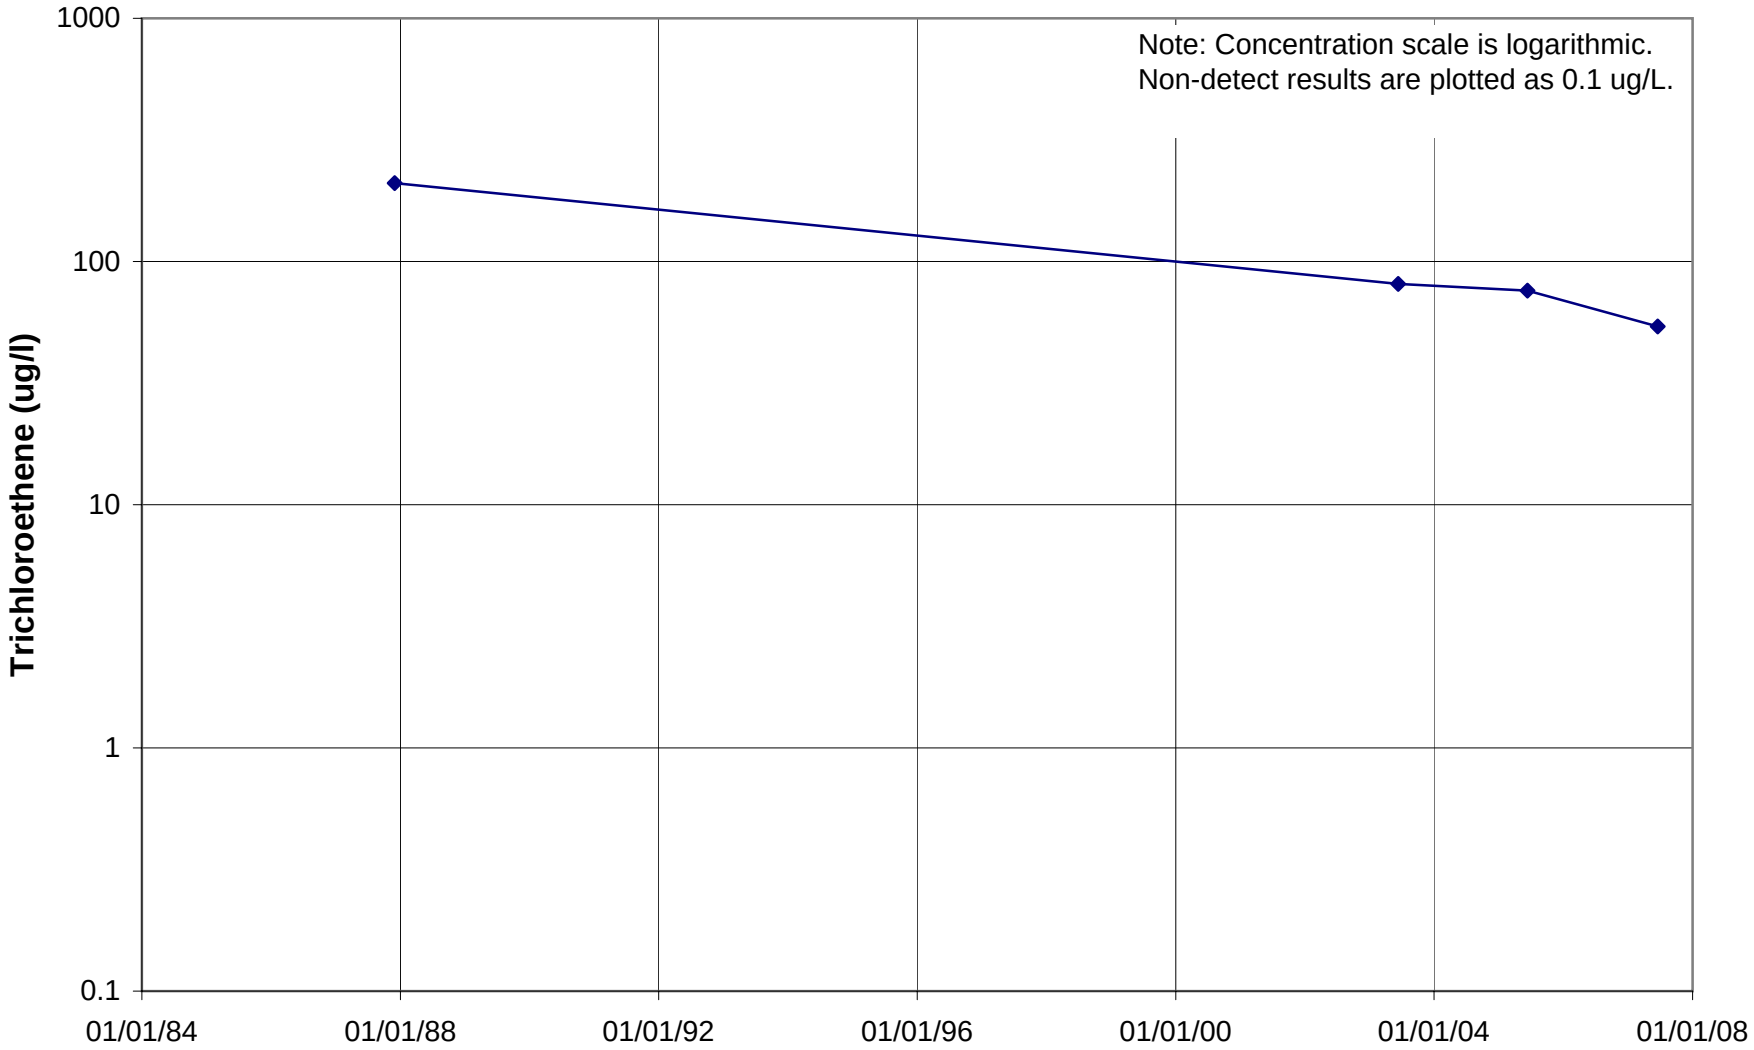

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

200154

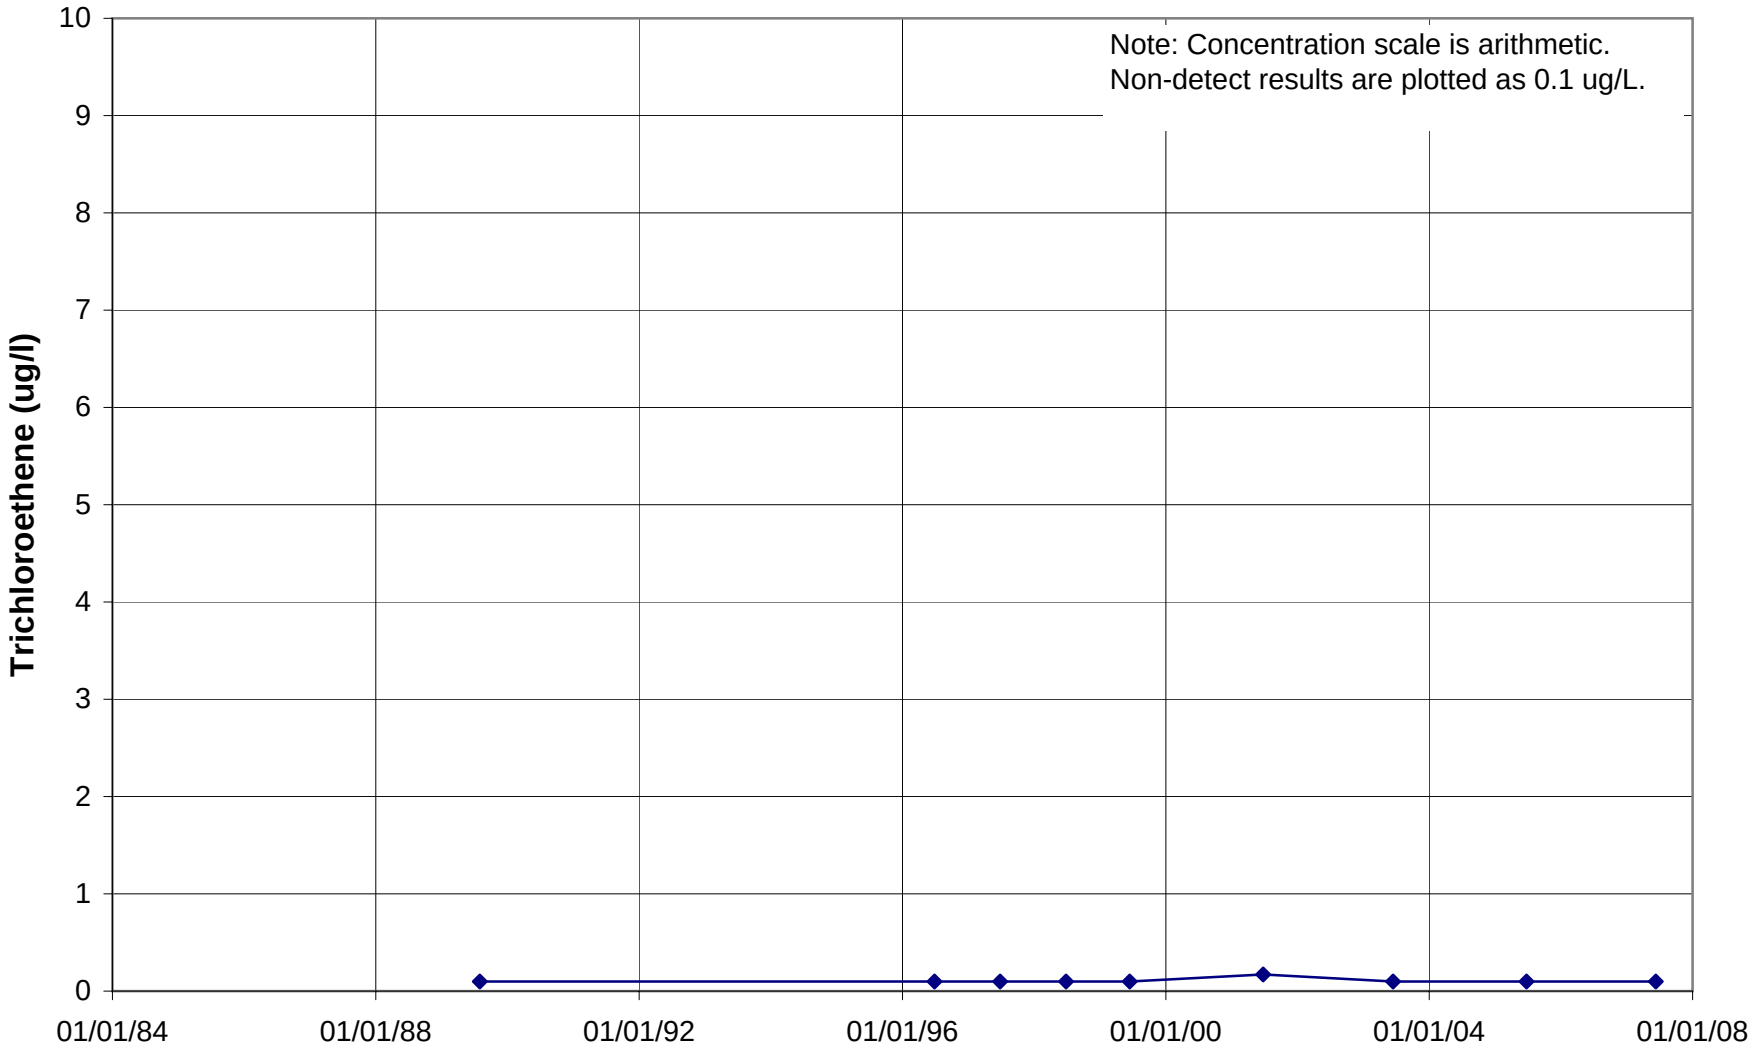

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

200524

Note: Concentration scale is arithmetic.
Non-detect results are plotted as 0.1 ug/L.

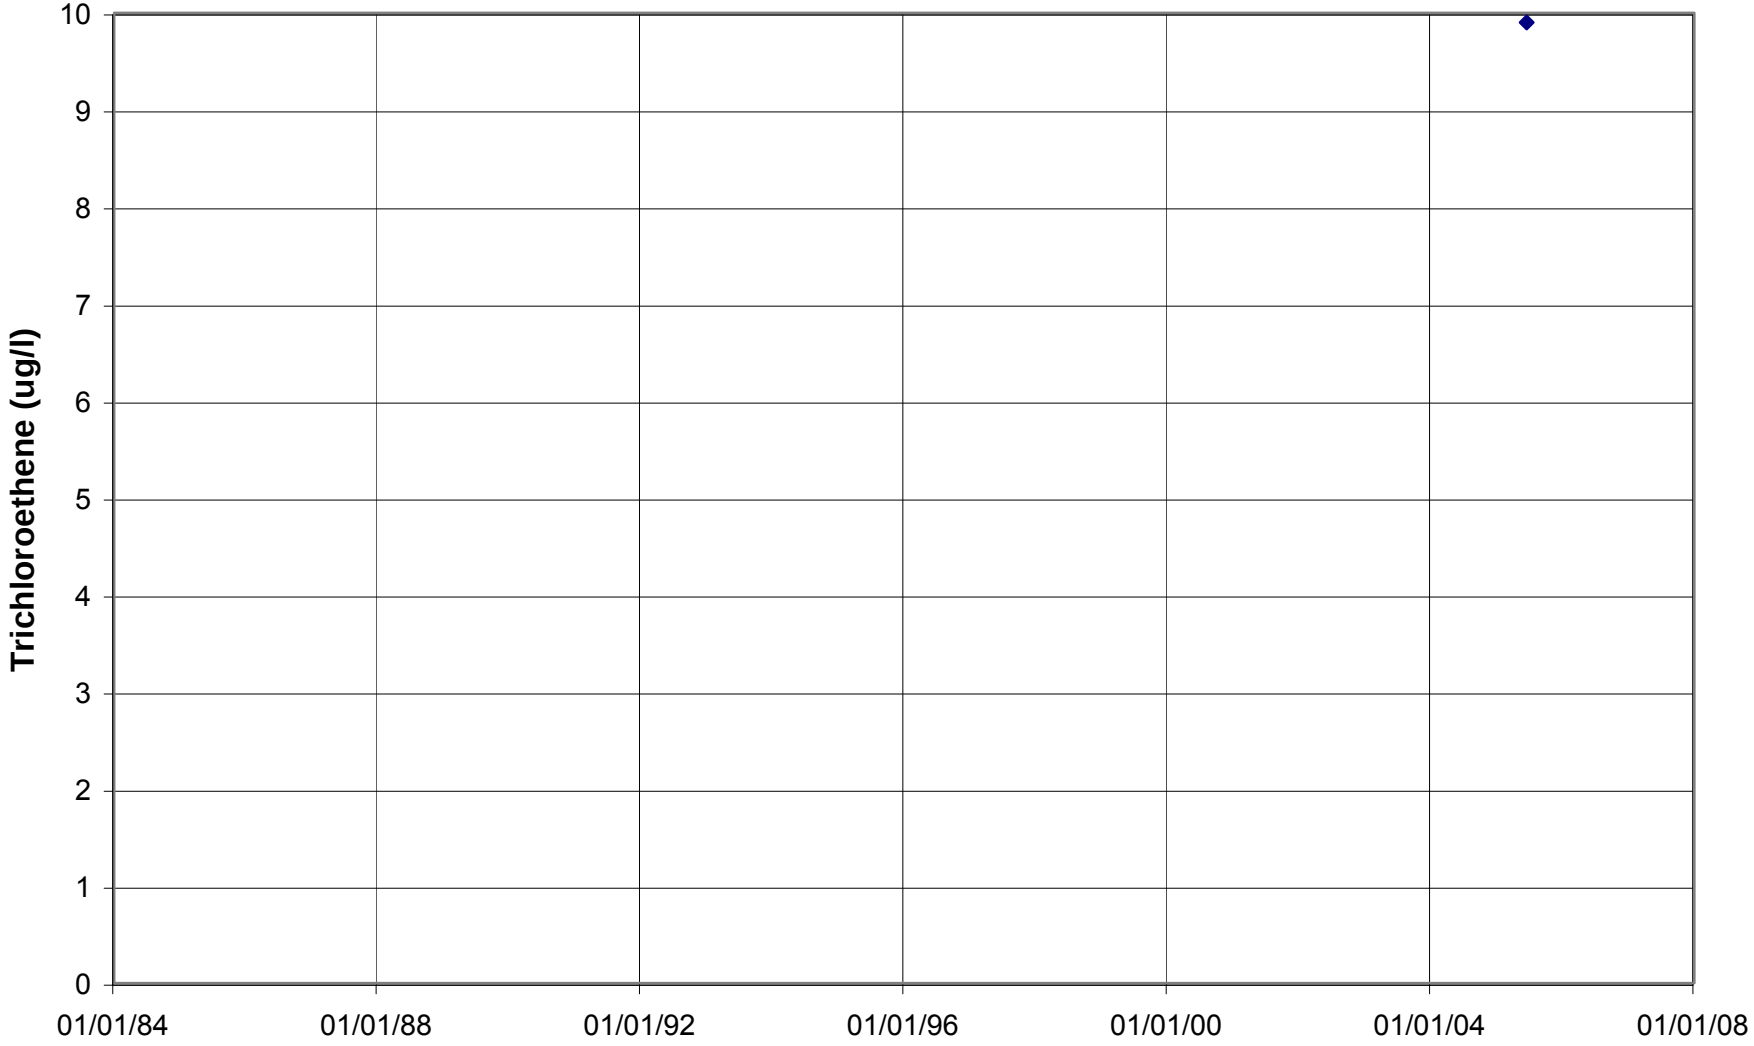

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

200803 (SAM#4)

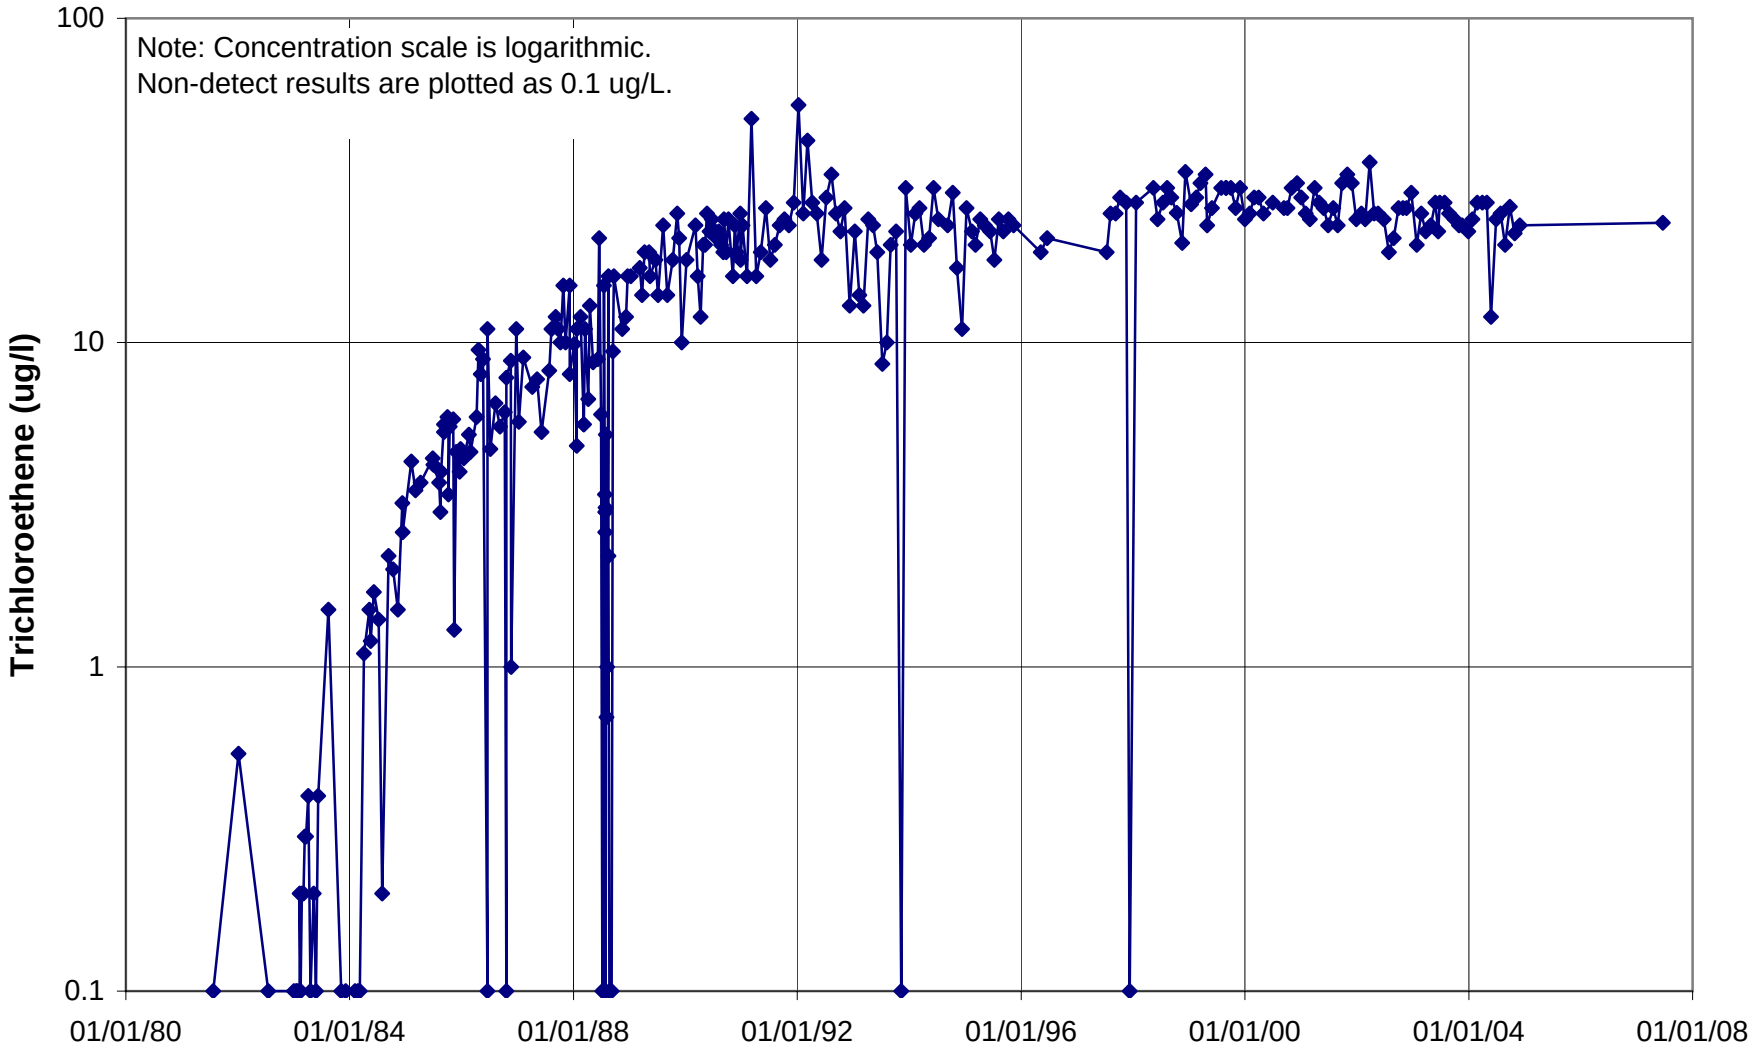

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

206688

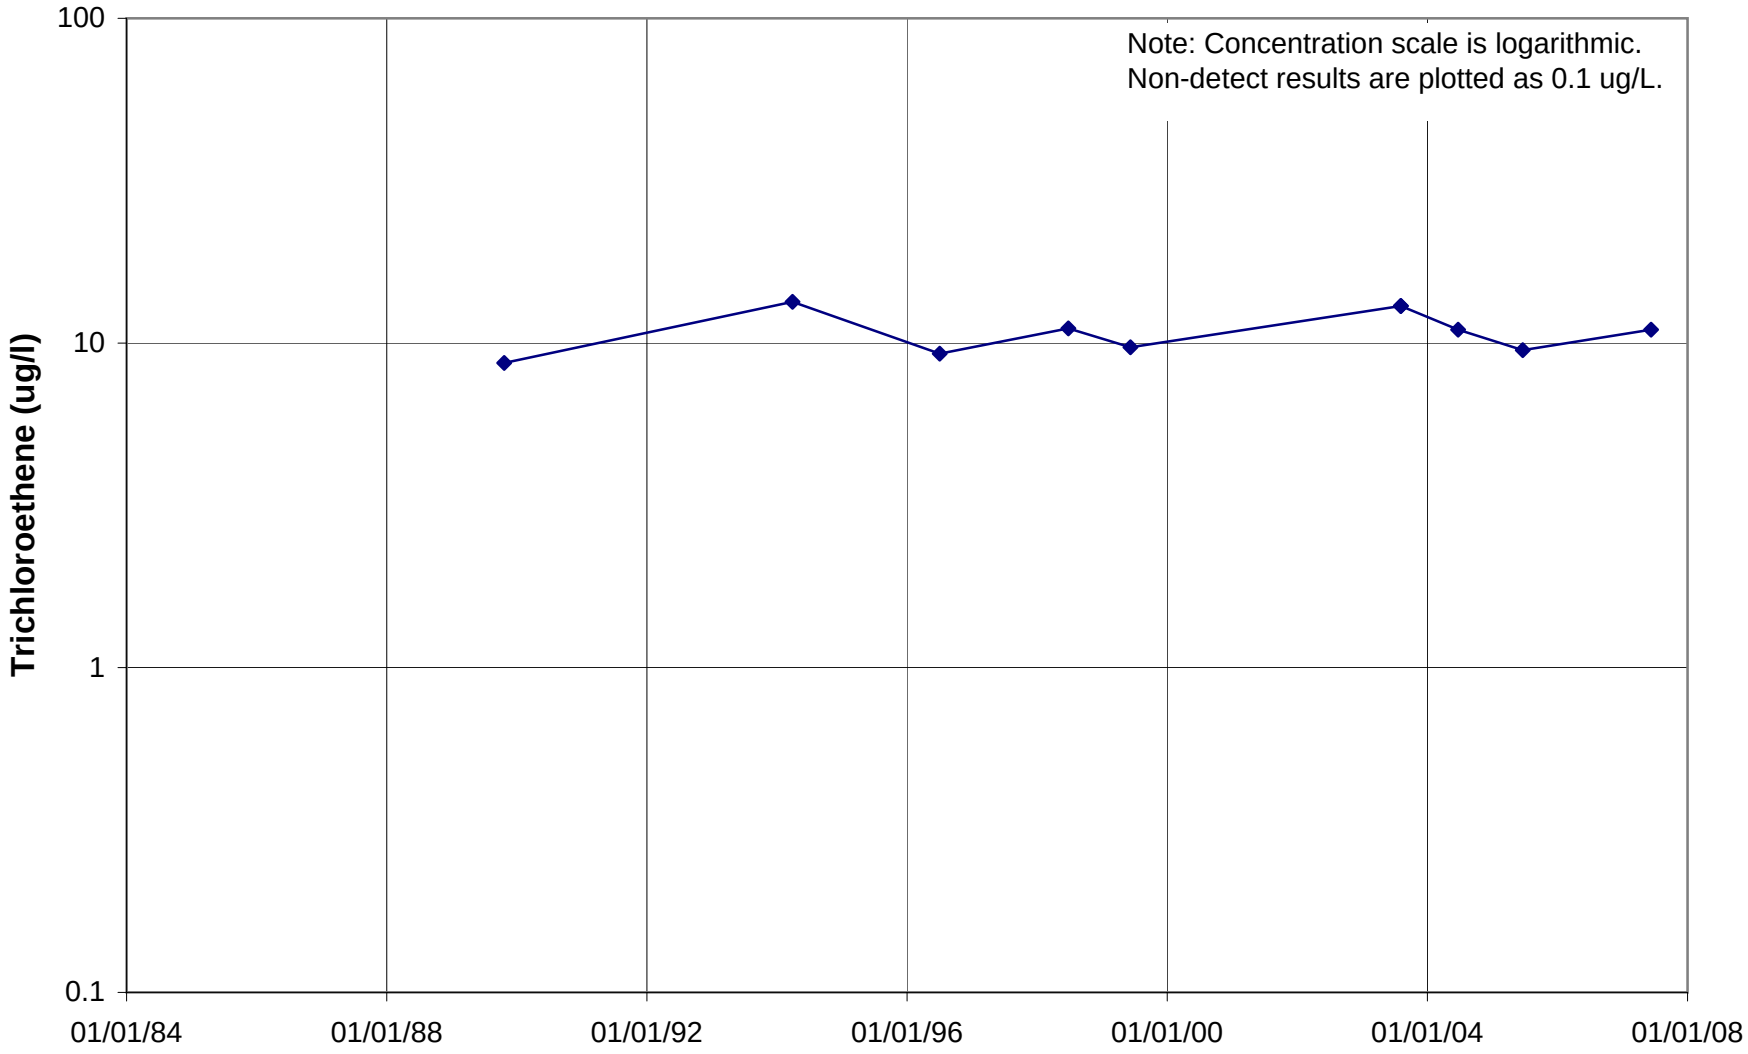

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

234546

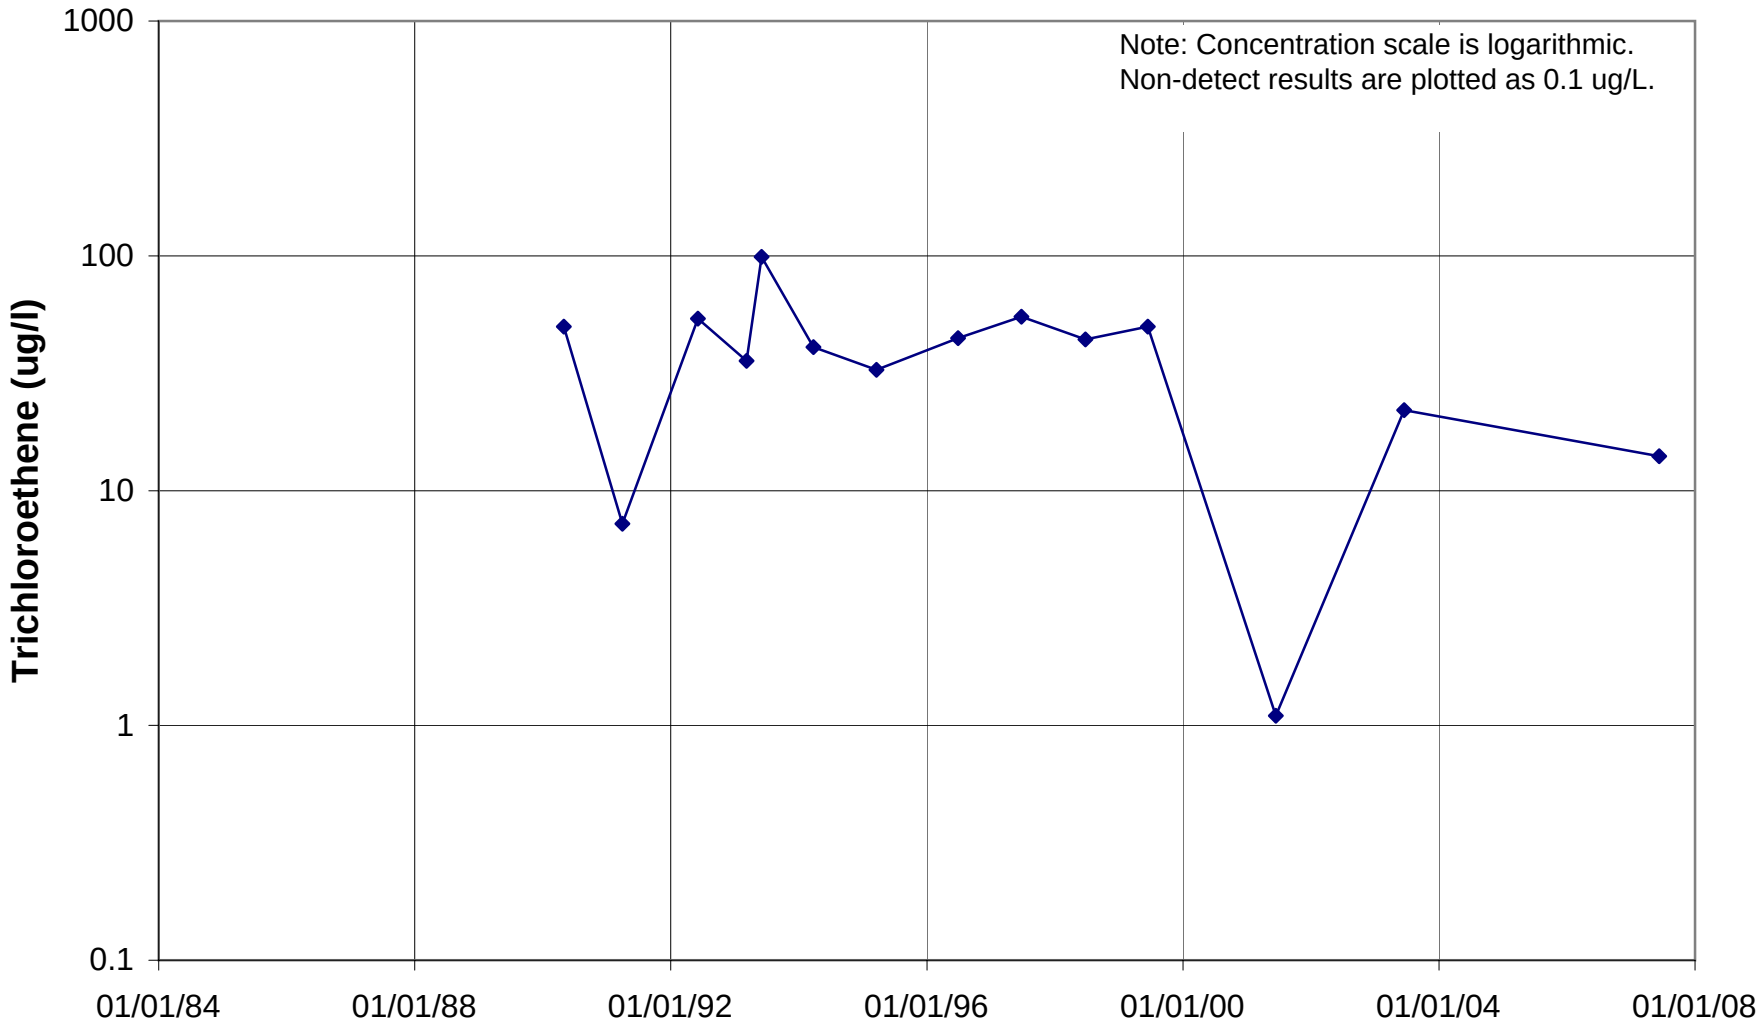

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

234549

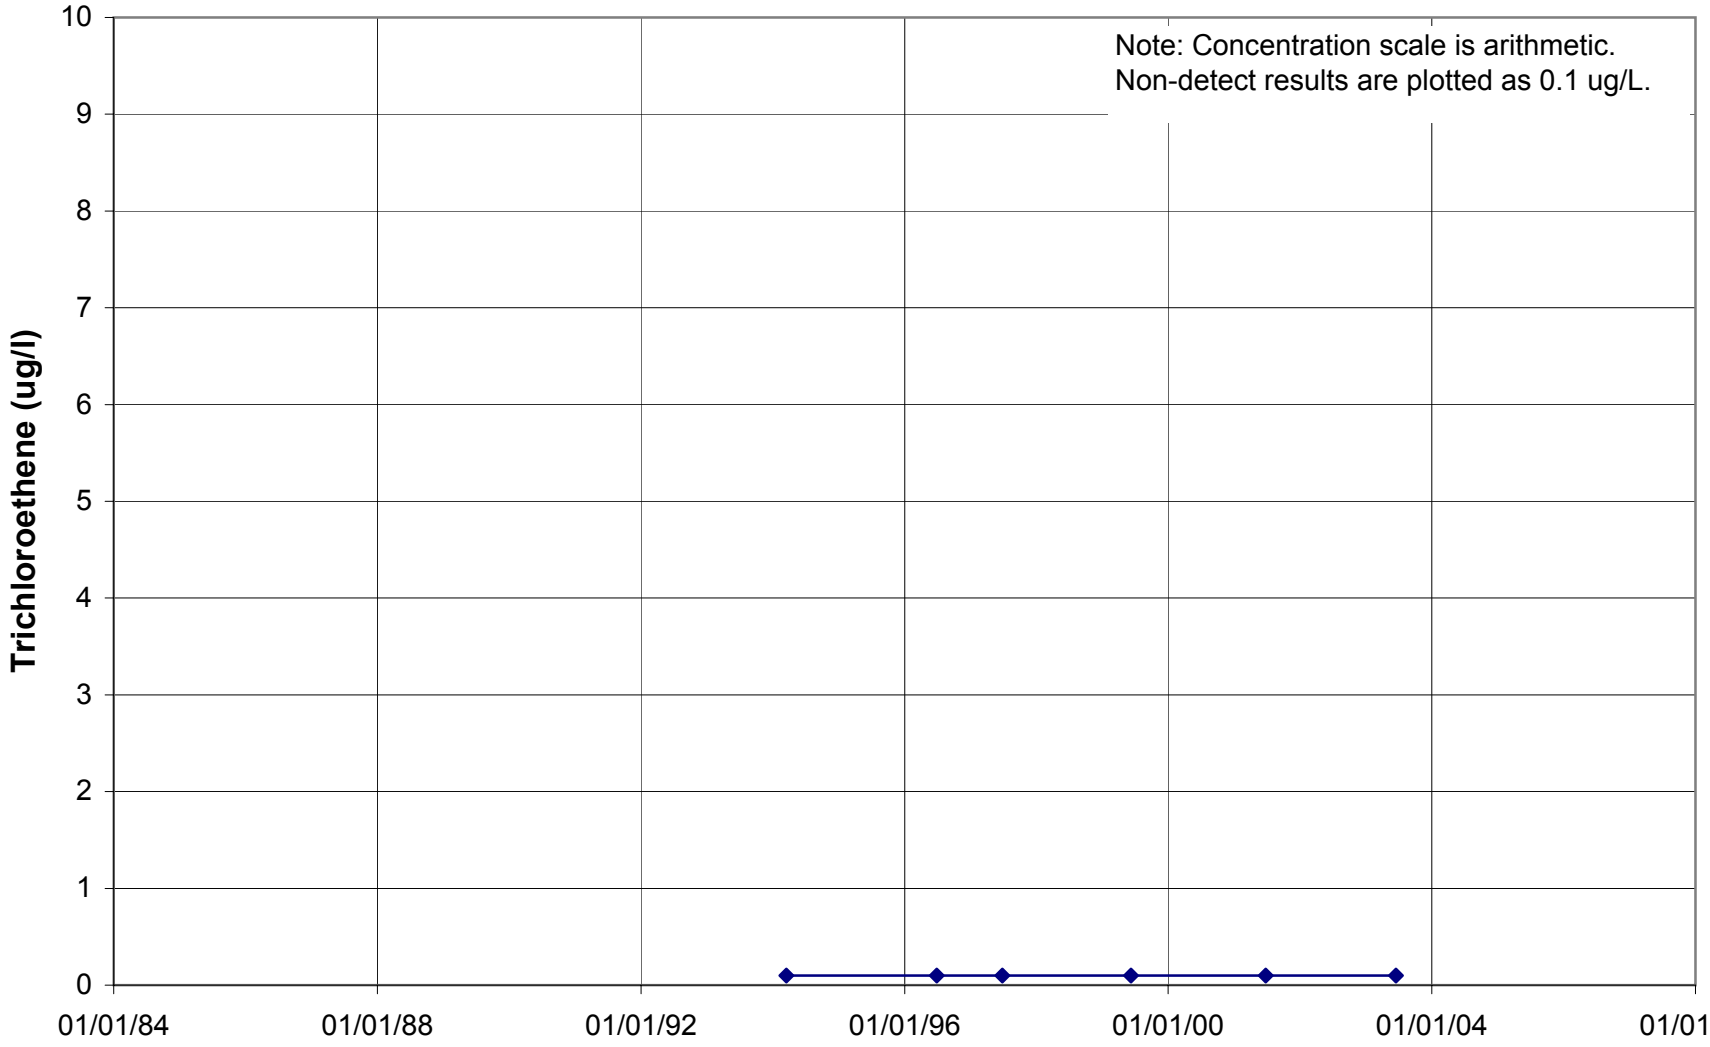

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

409547

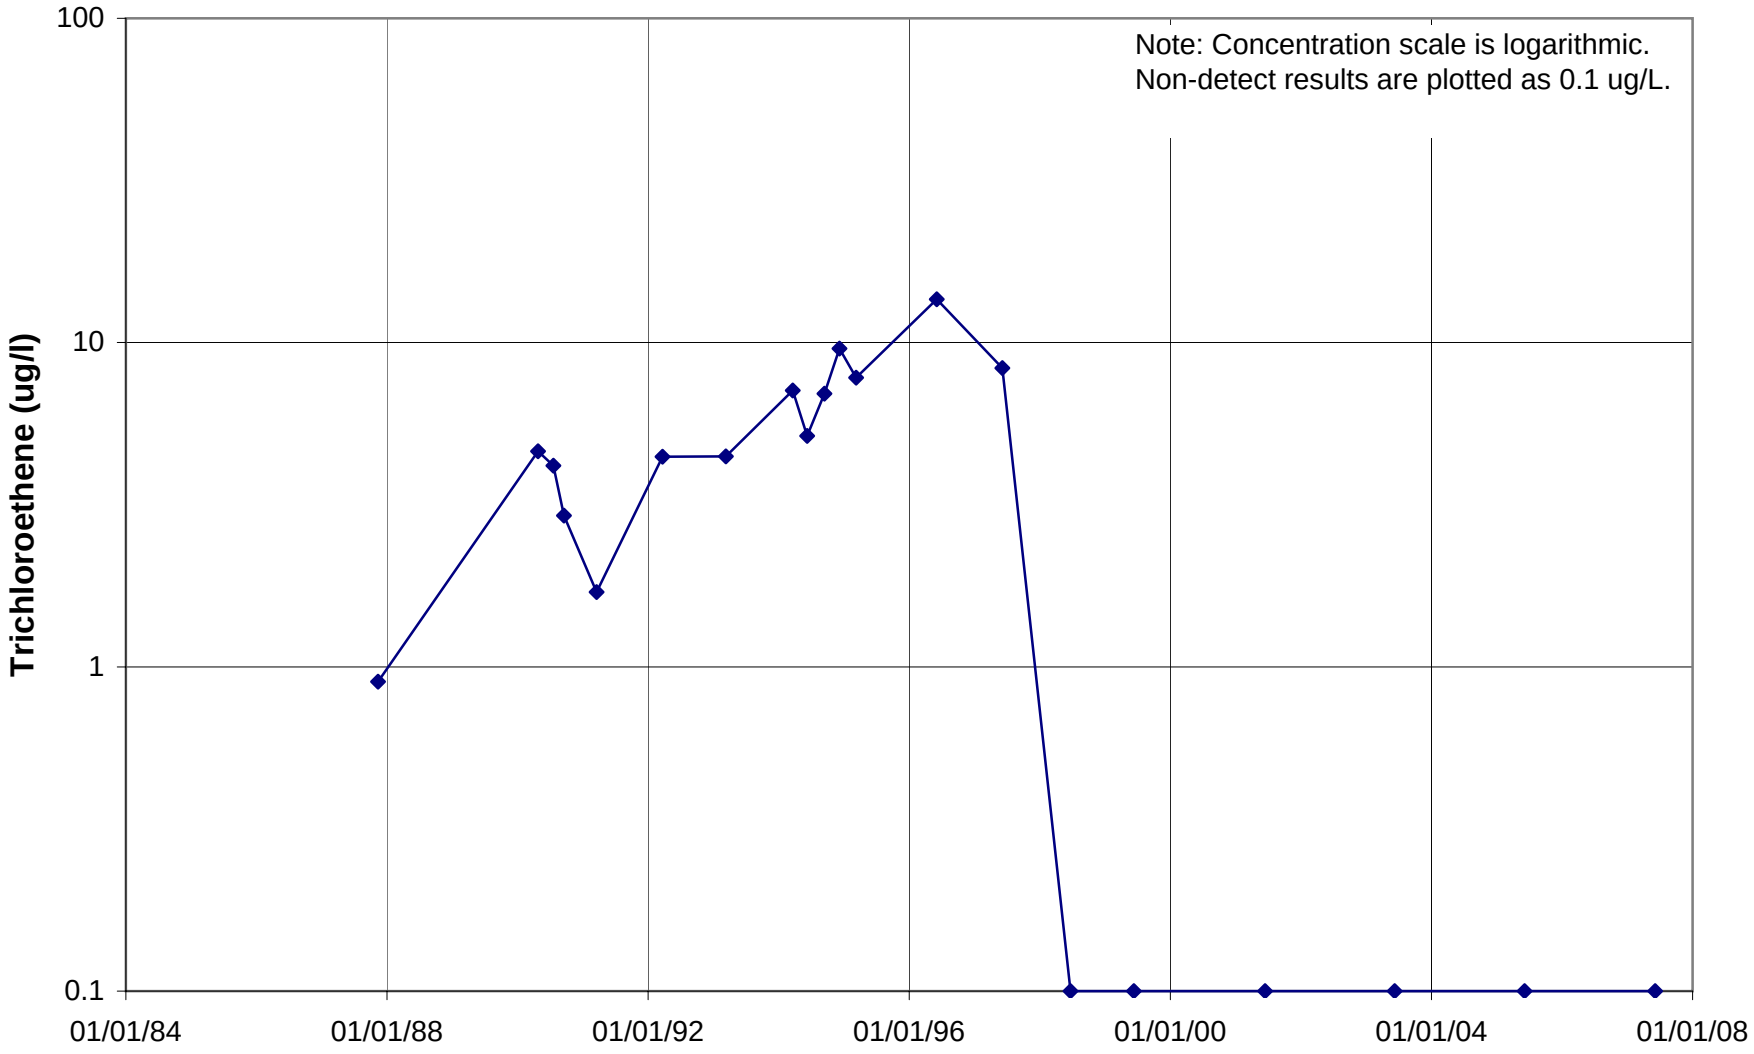

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

409548

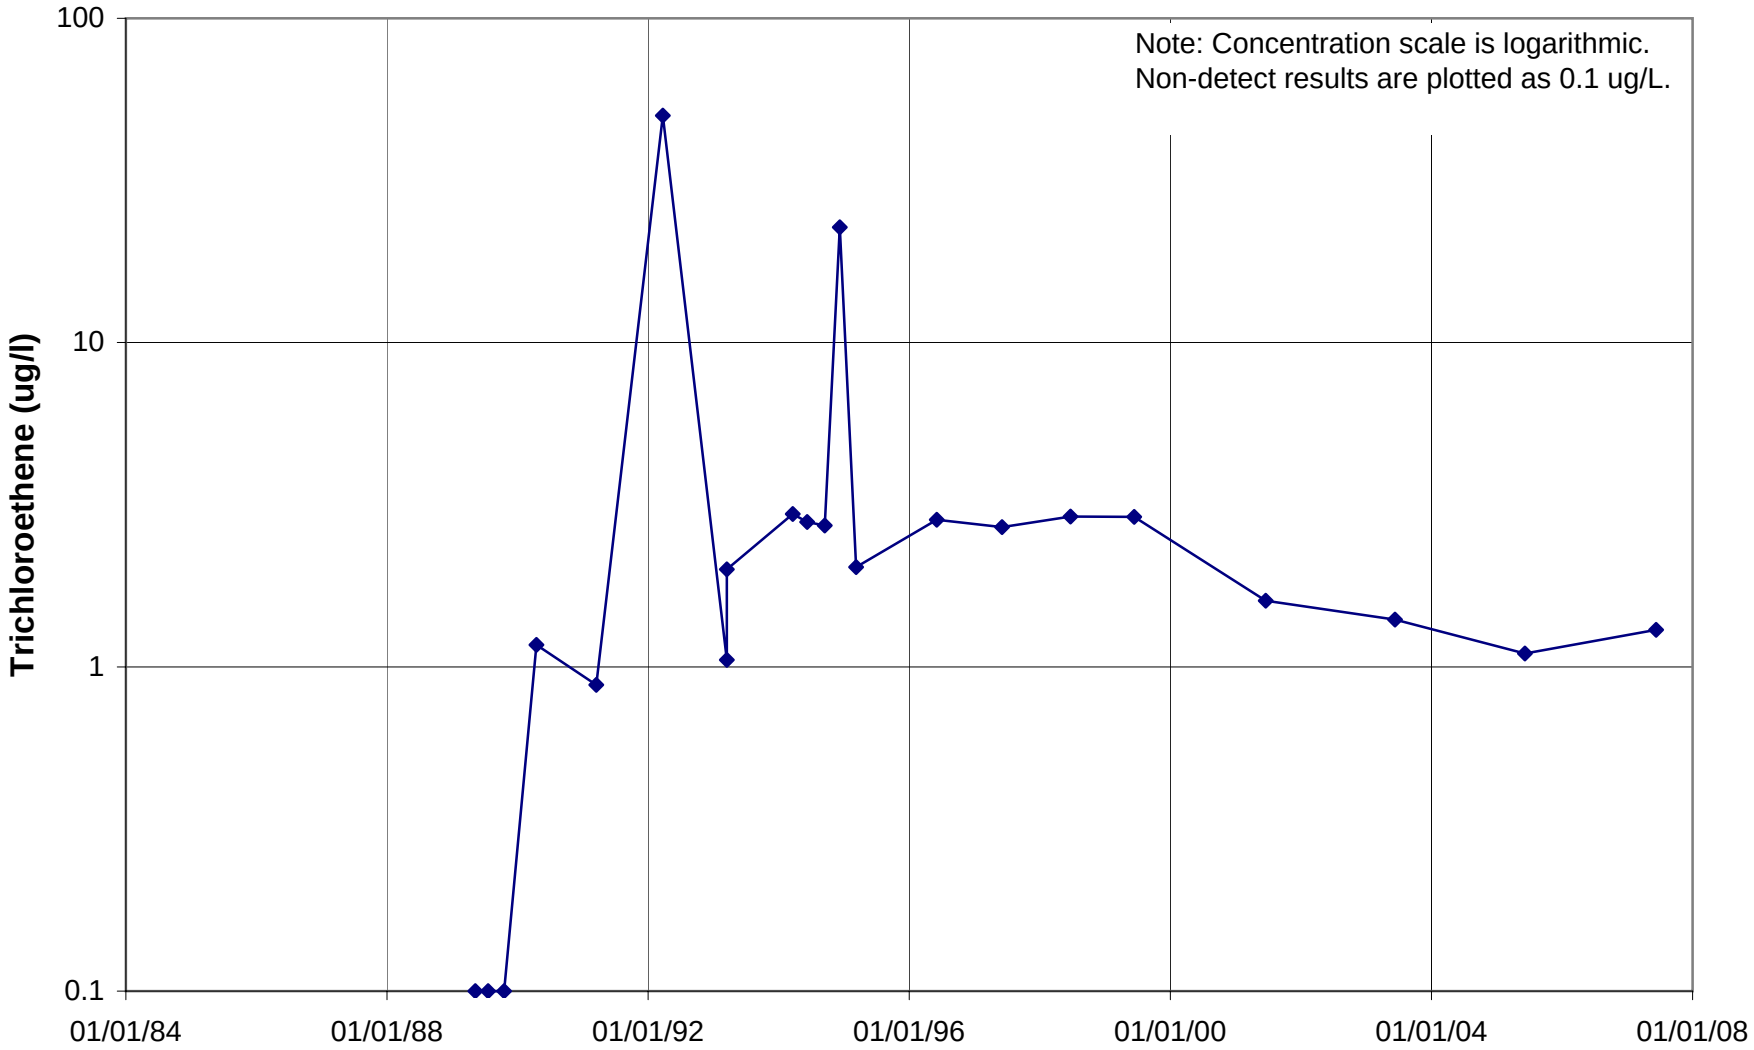

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

409549

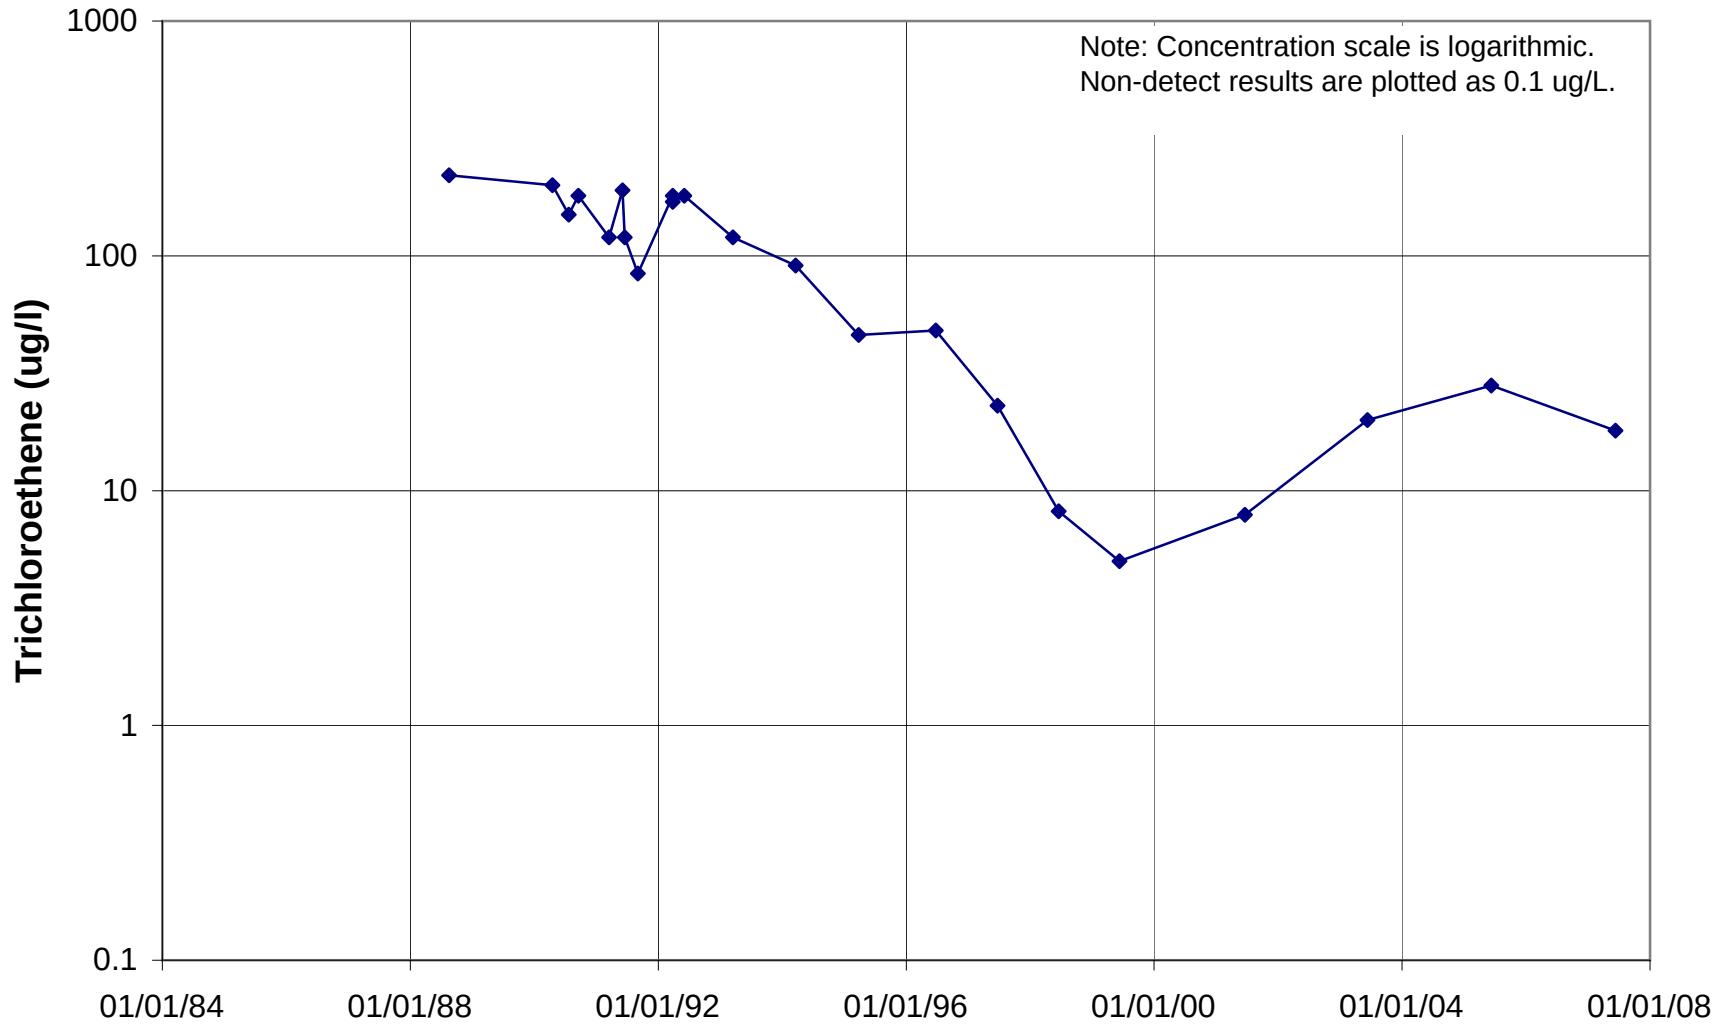

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

409550

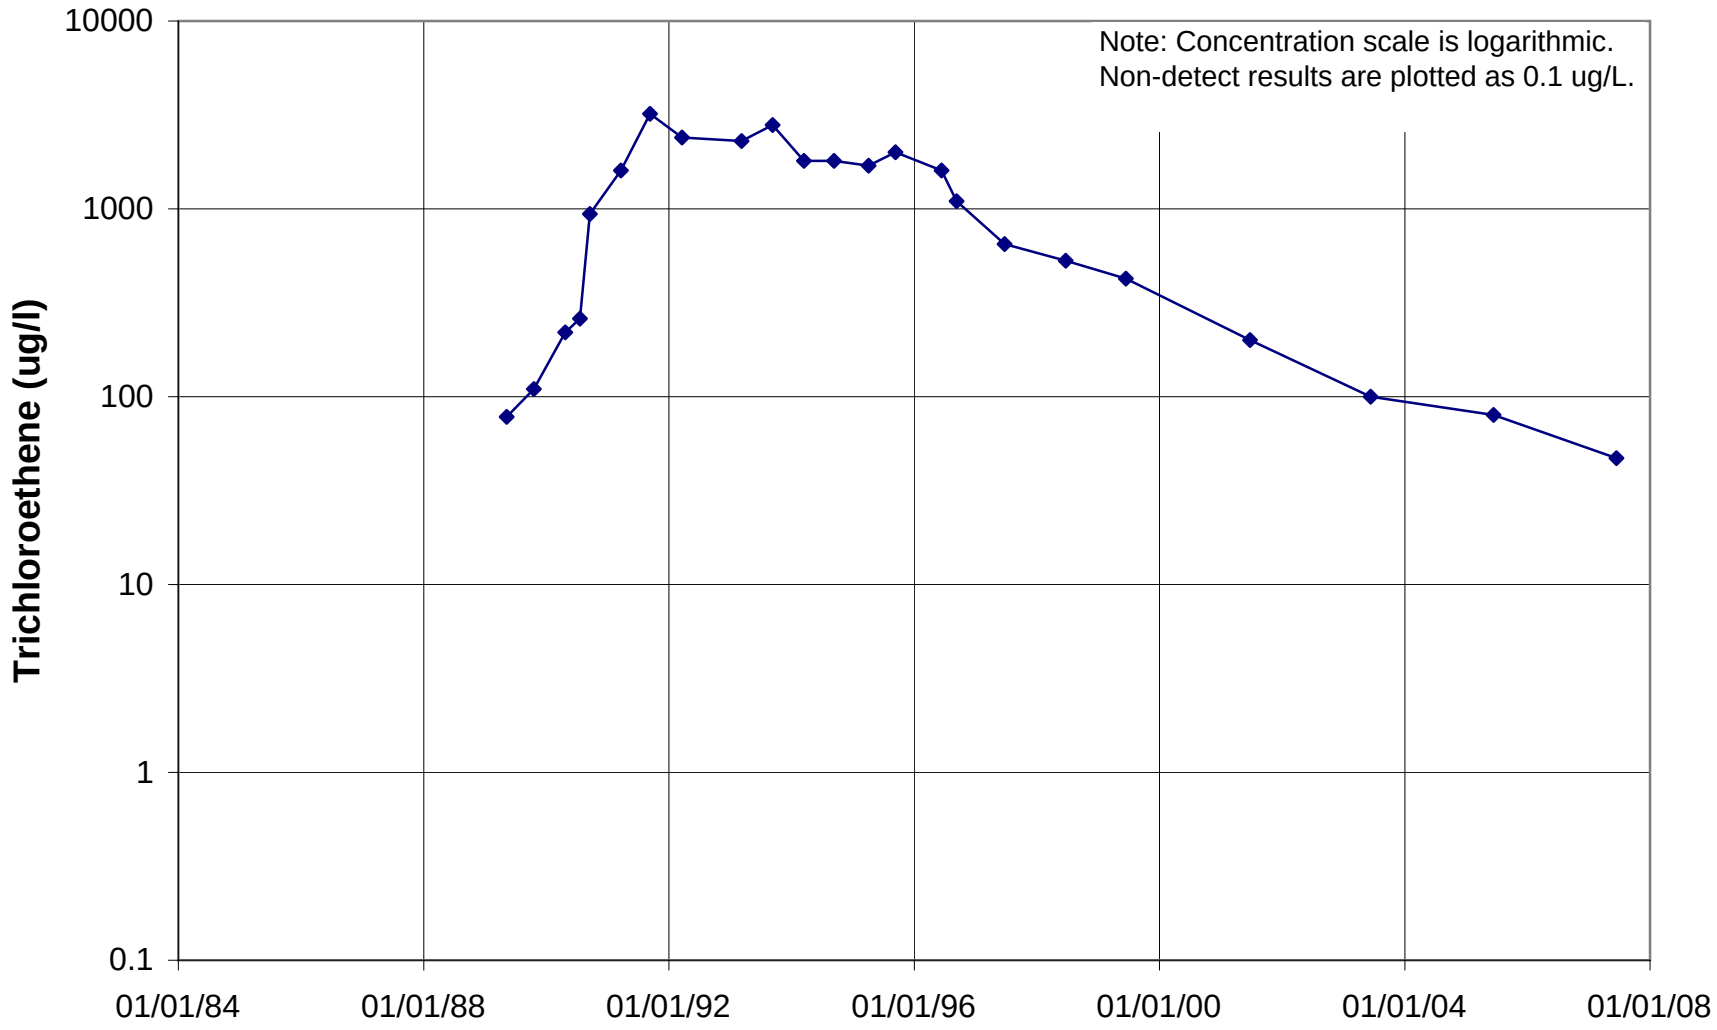

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

409555

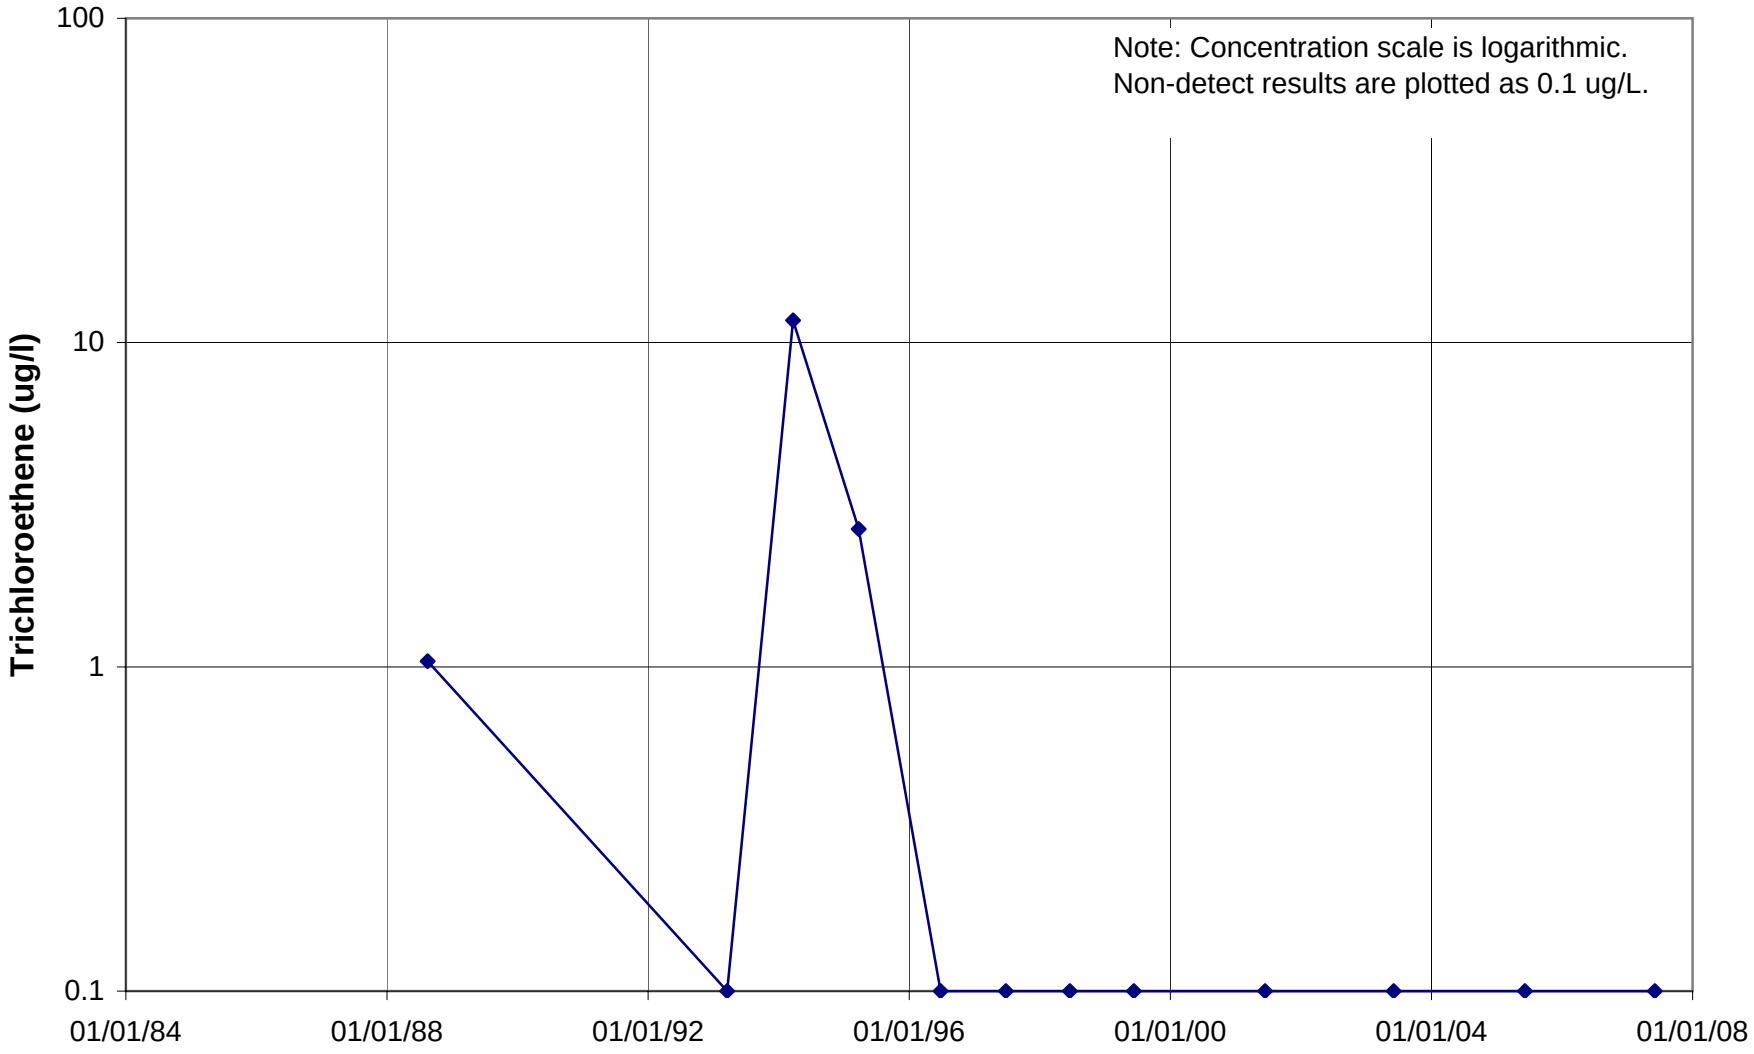

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

409556

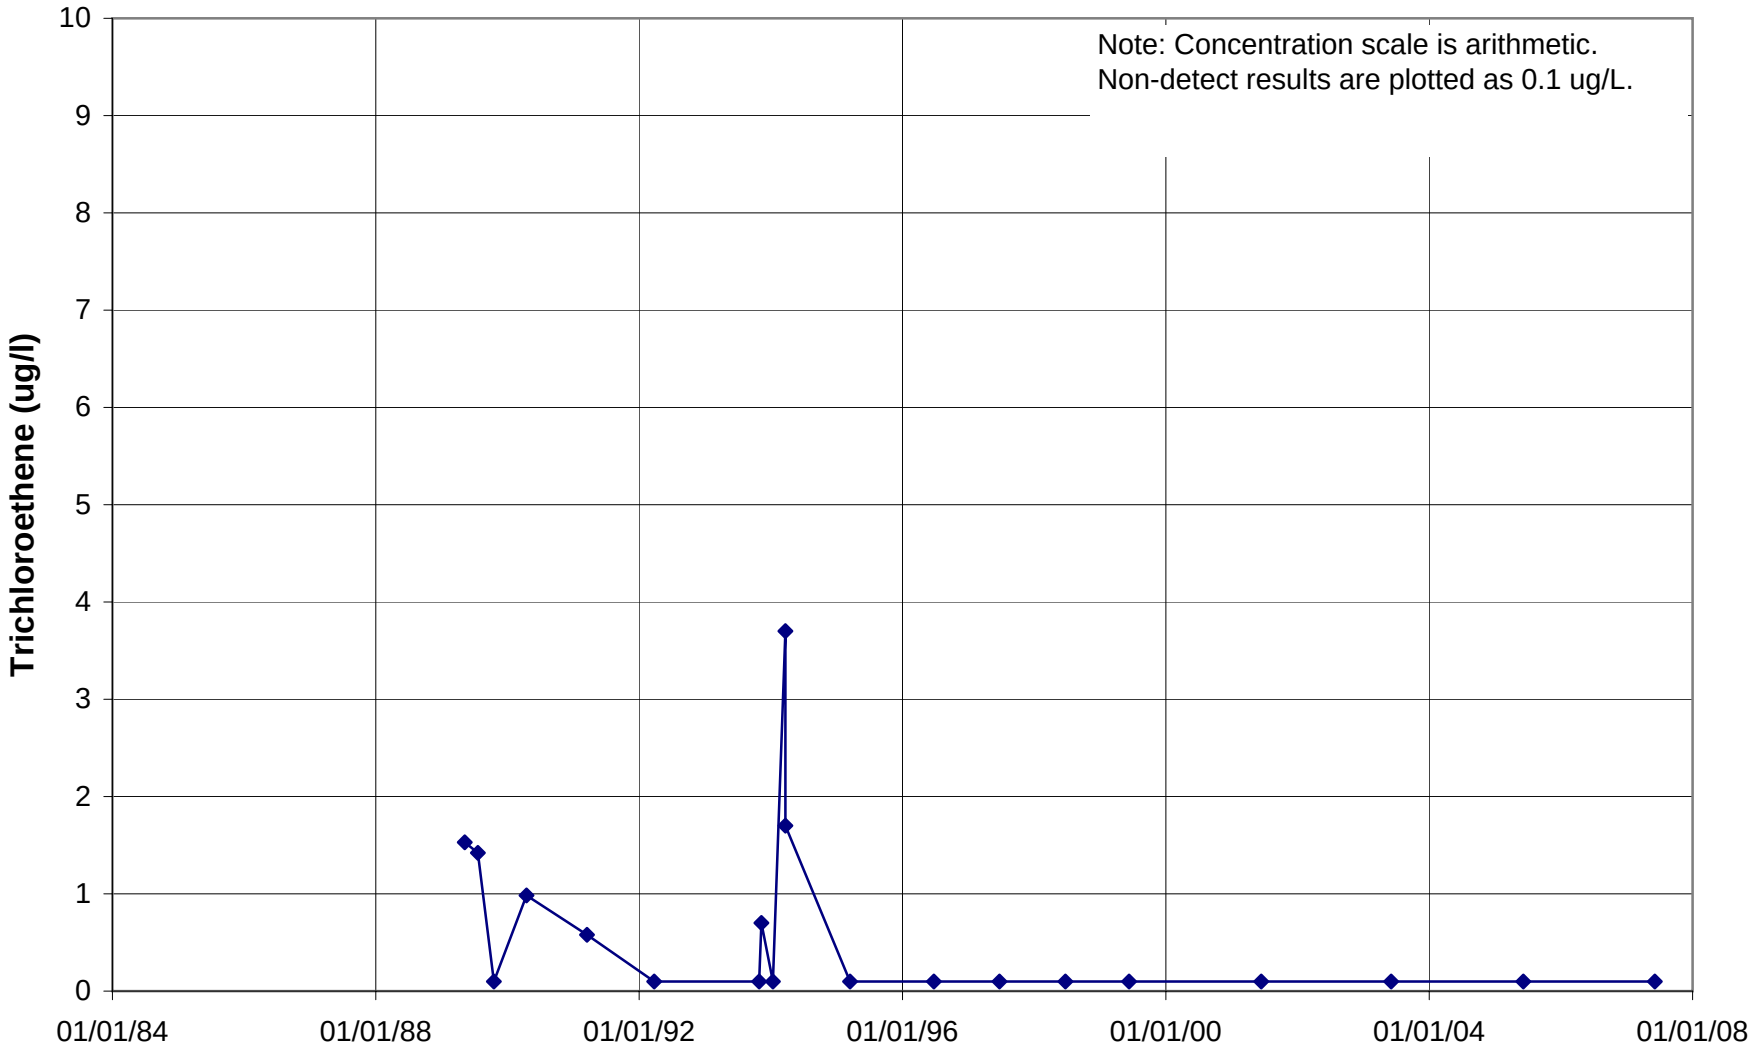

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

409557

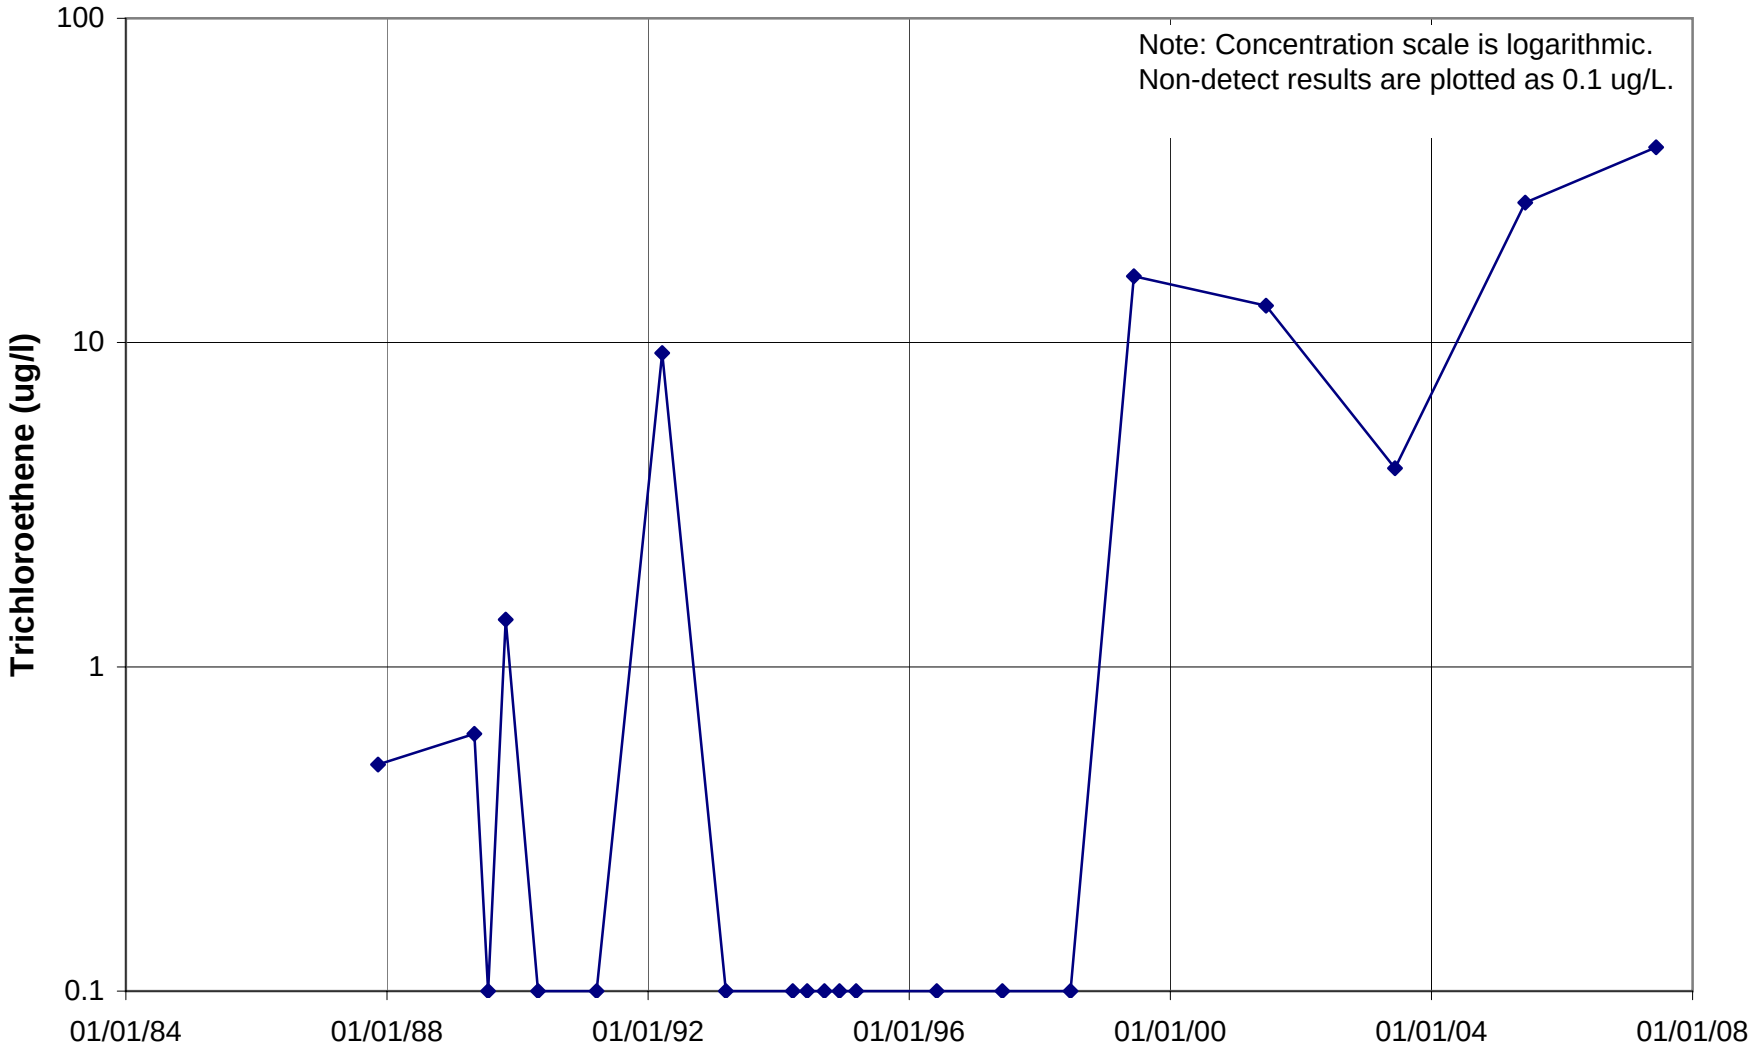

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

409596

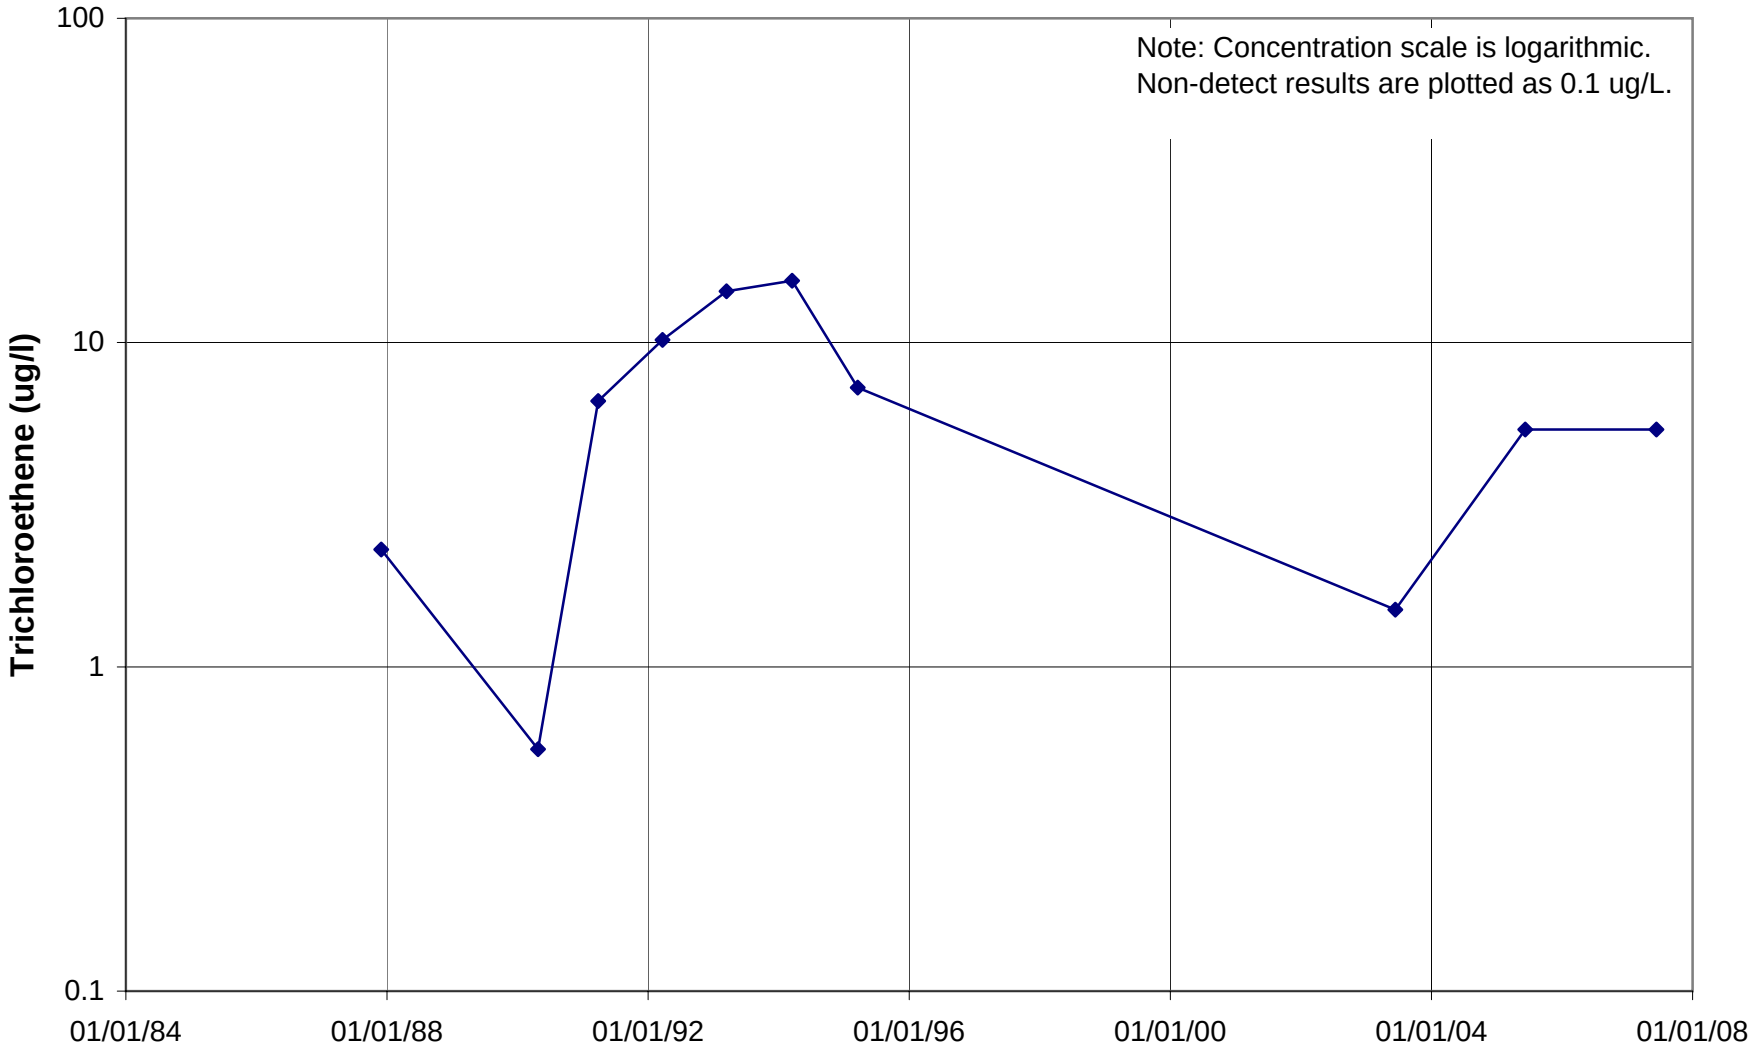

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

409597

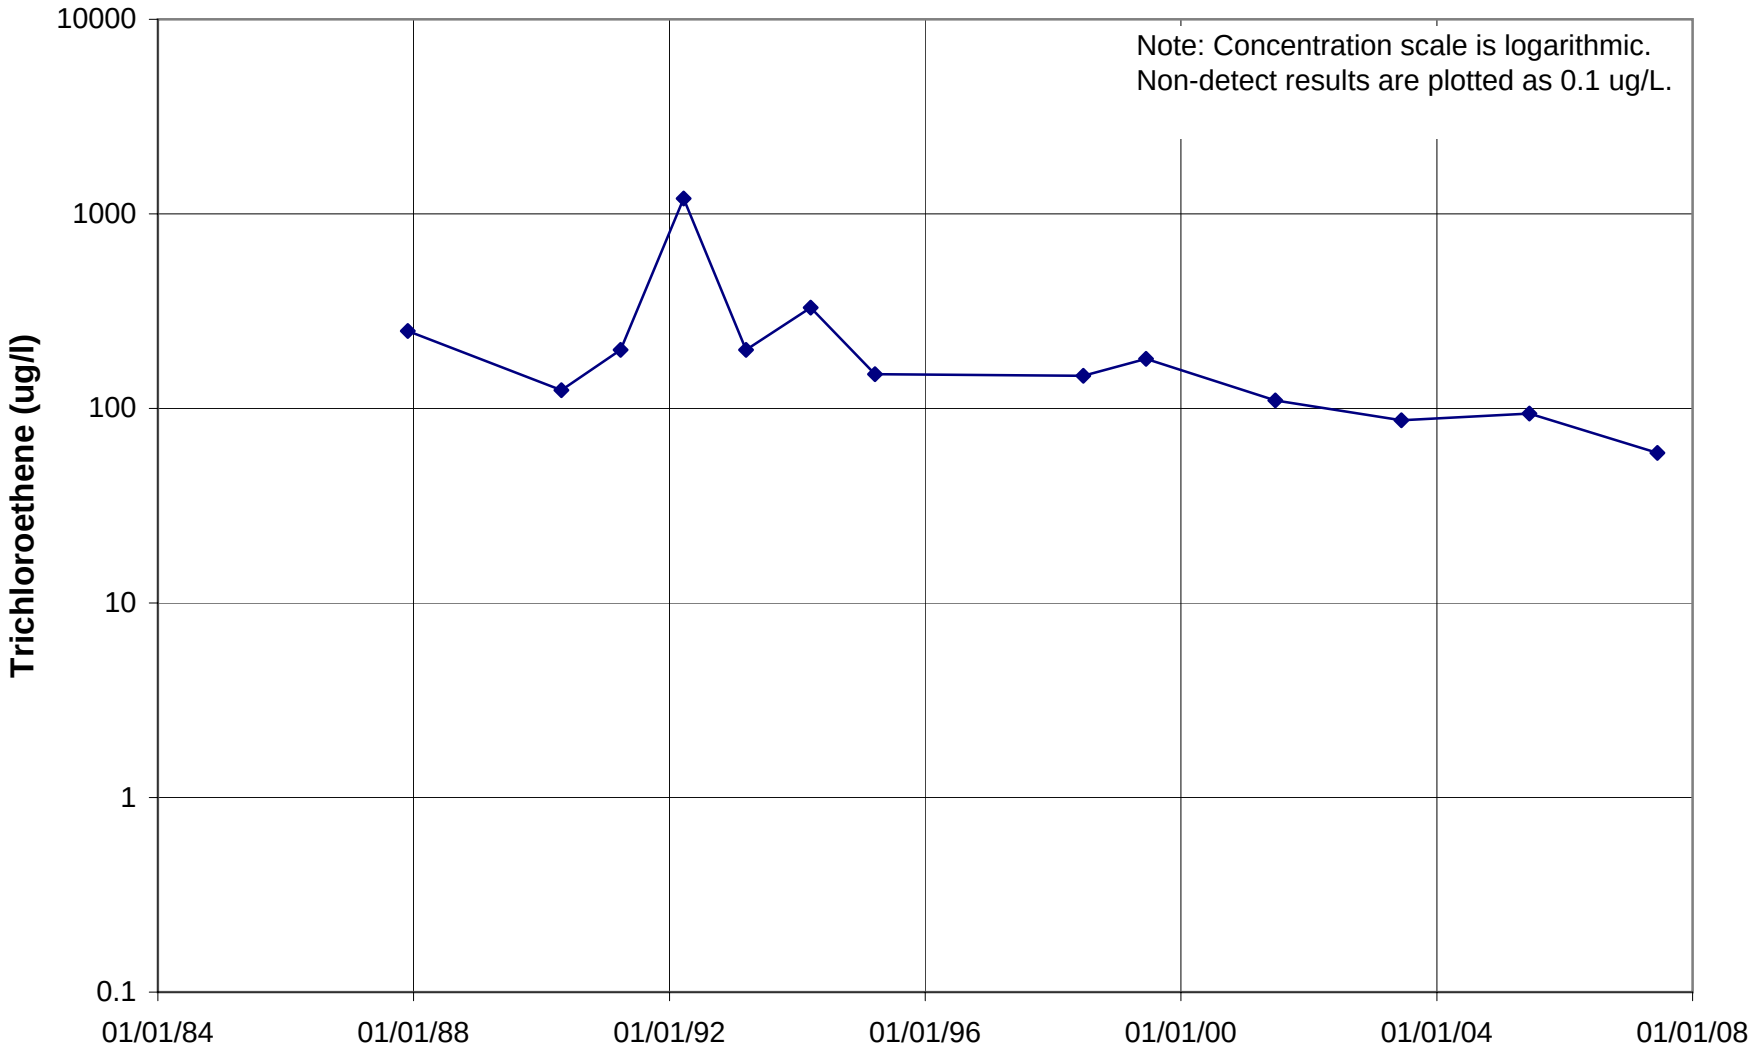

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

447894

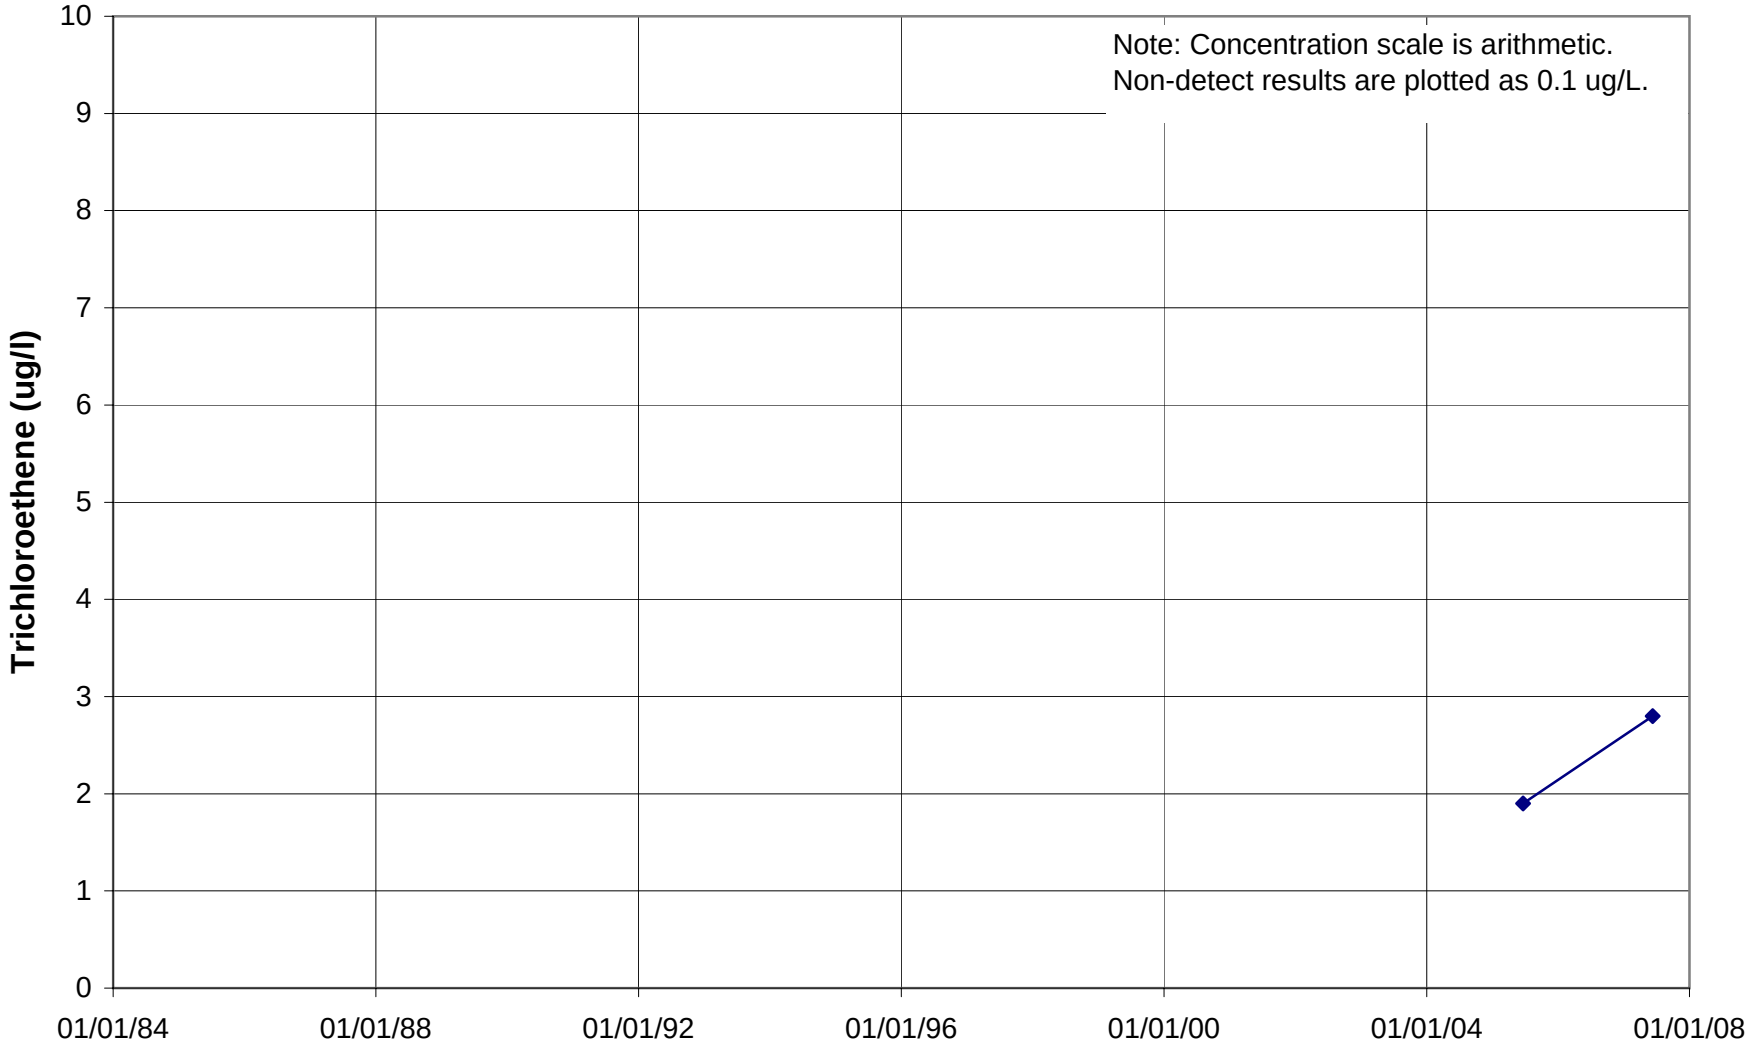

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

476837 (MW15H)

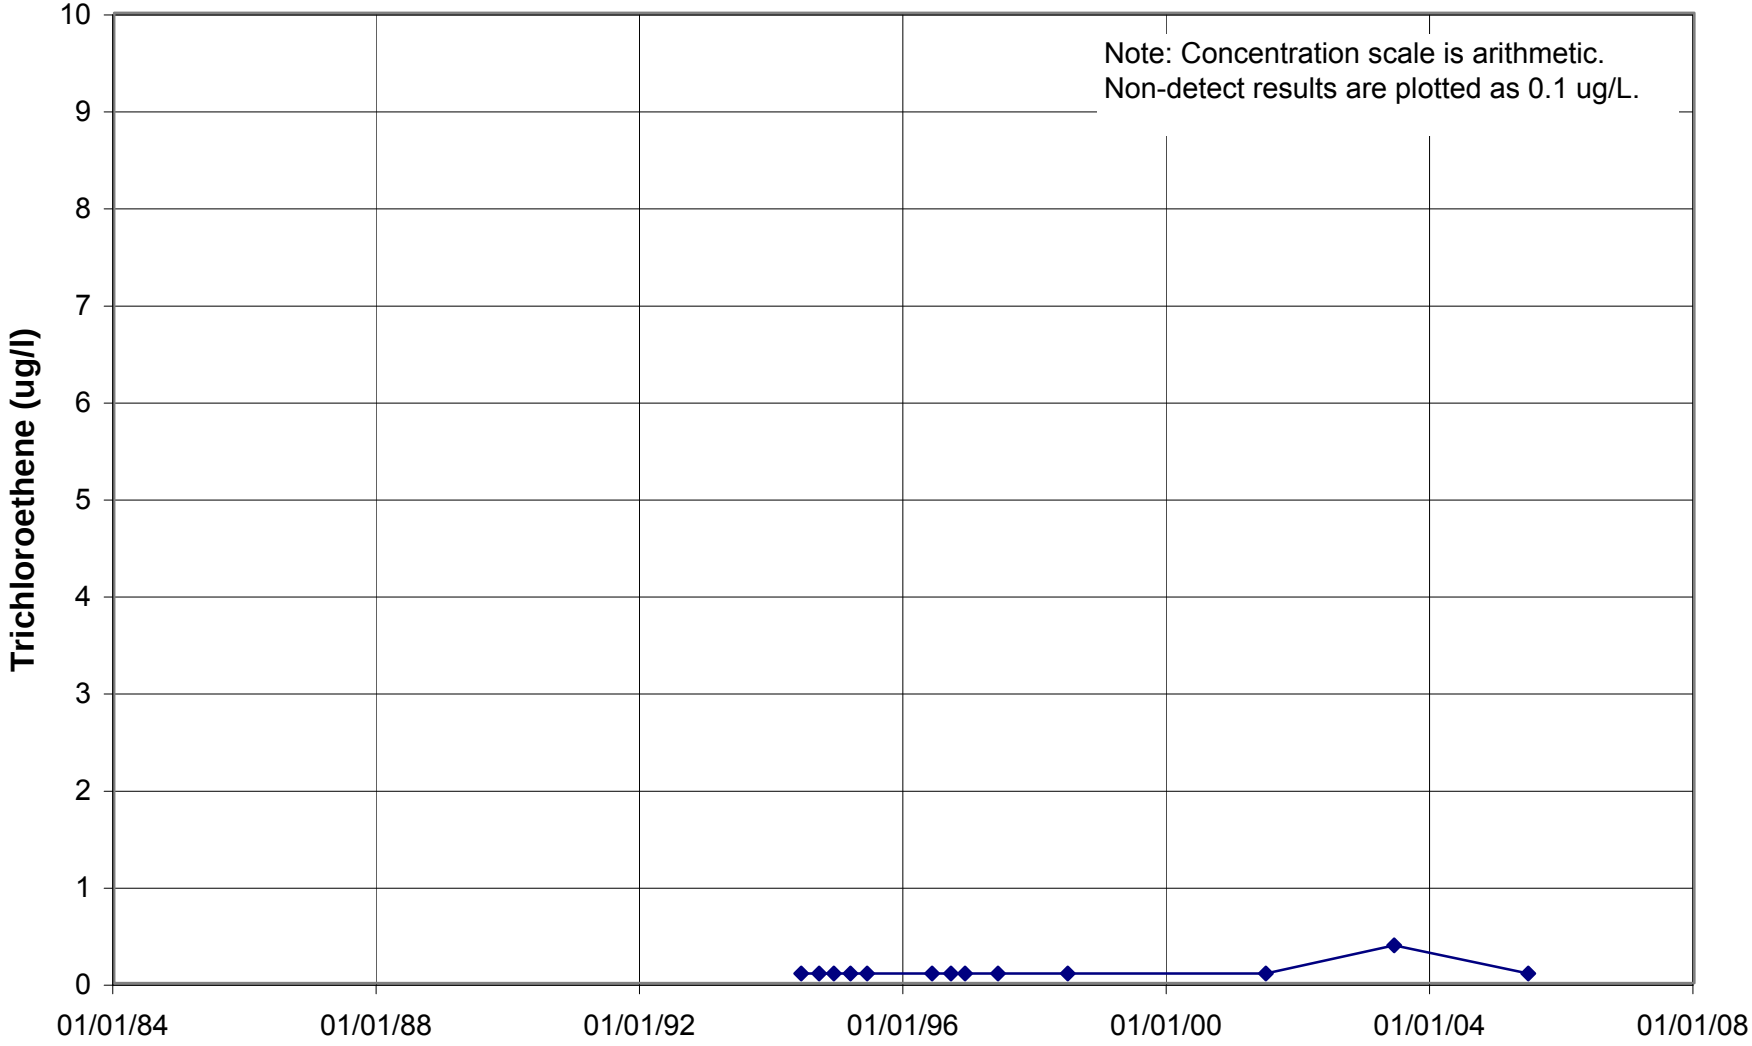

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

482083 (K04MW)

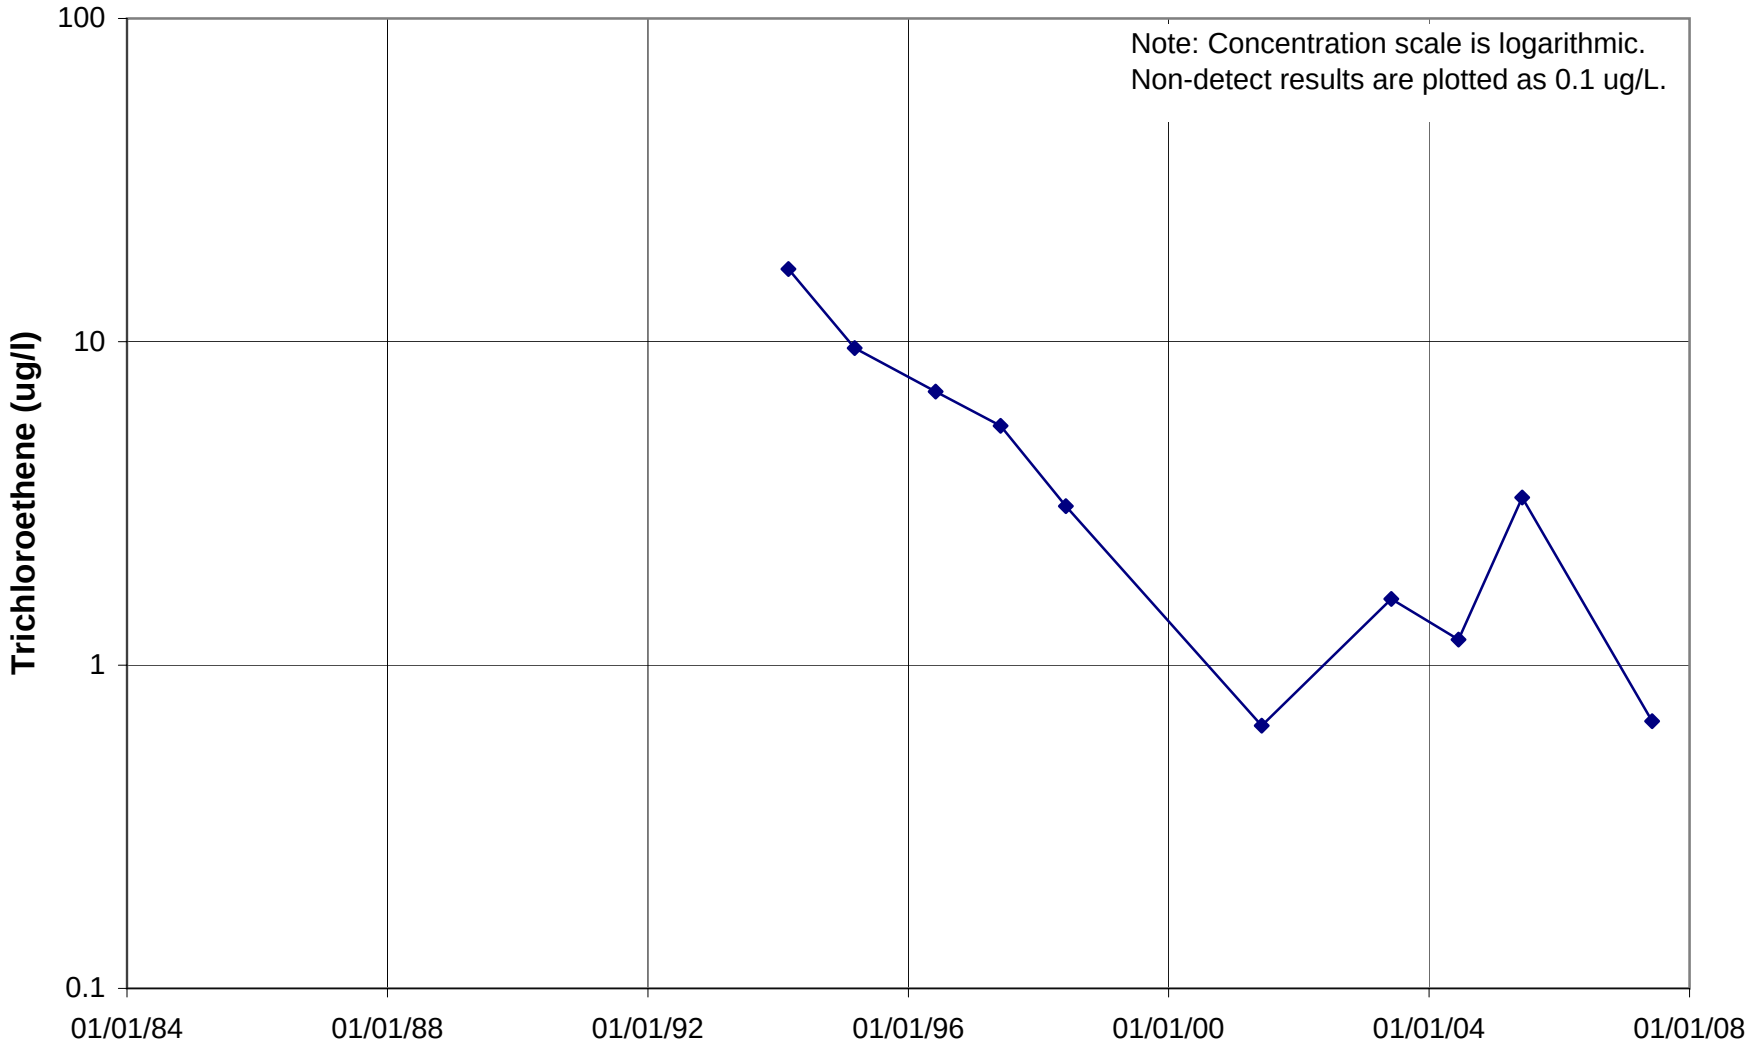

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

482084 (K02MW)

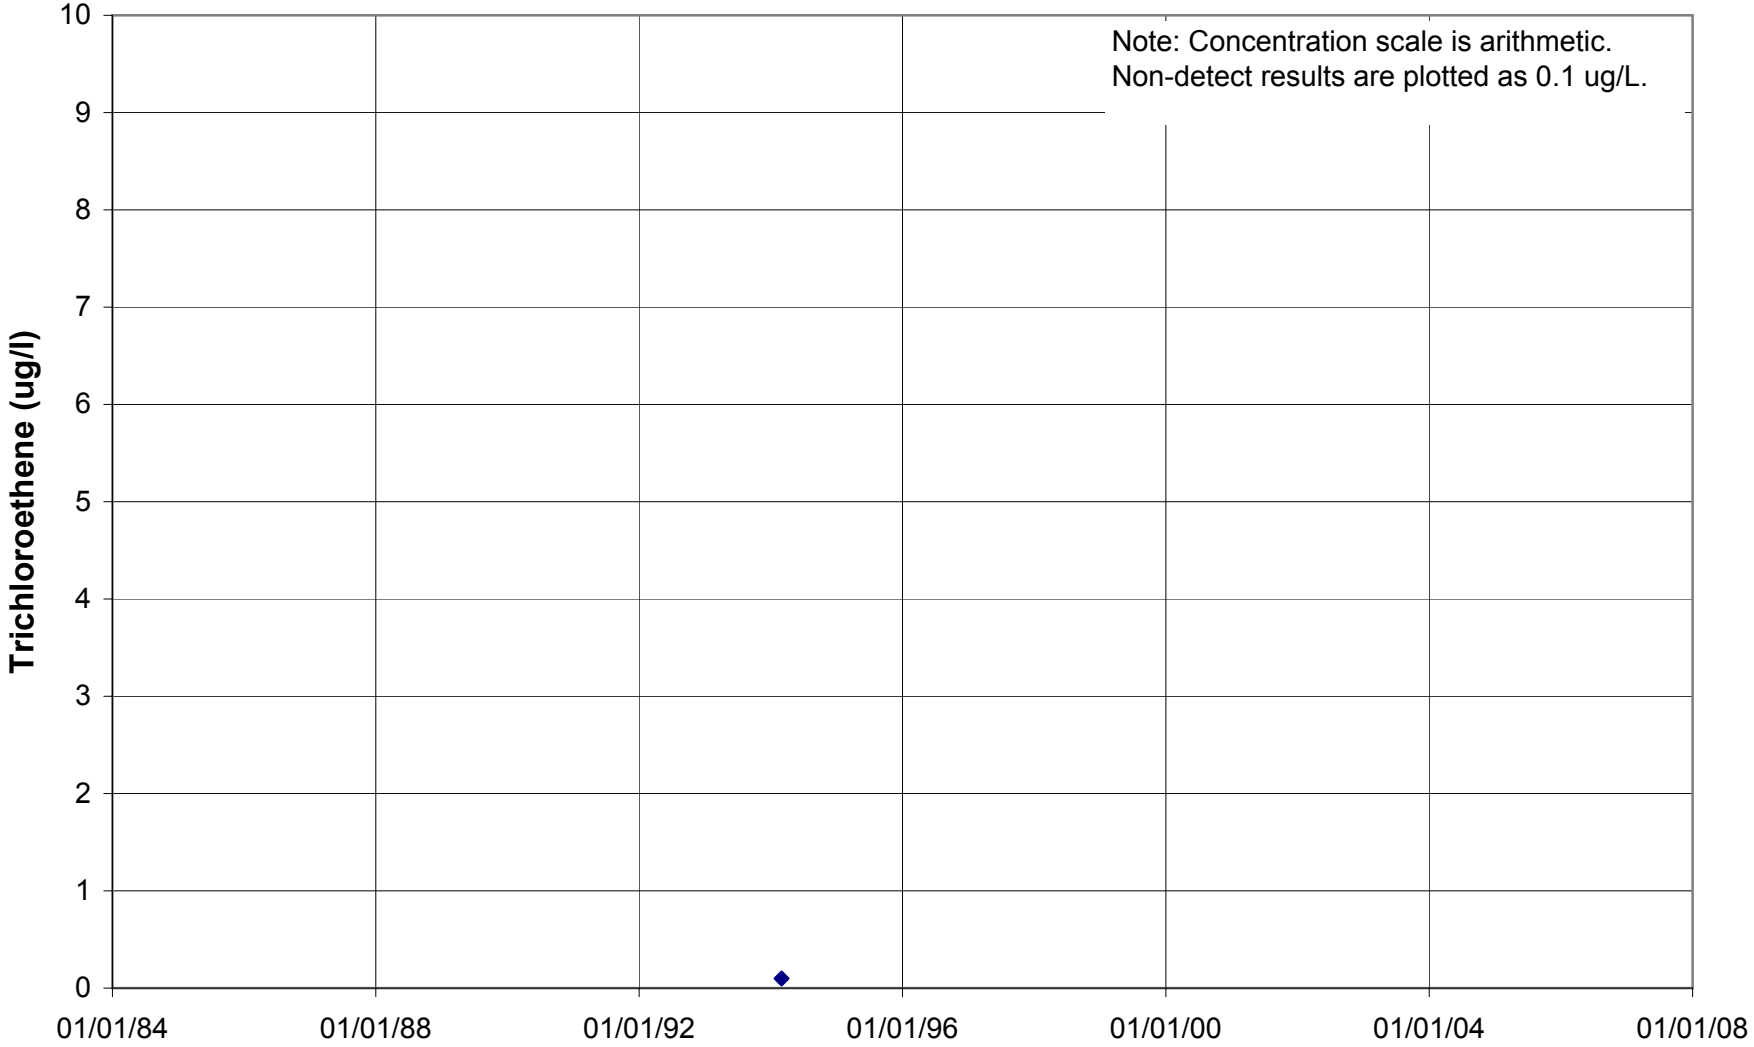

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

482085 (K01MW)

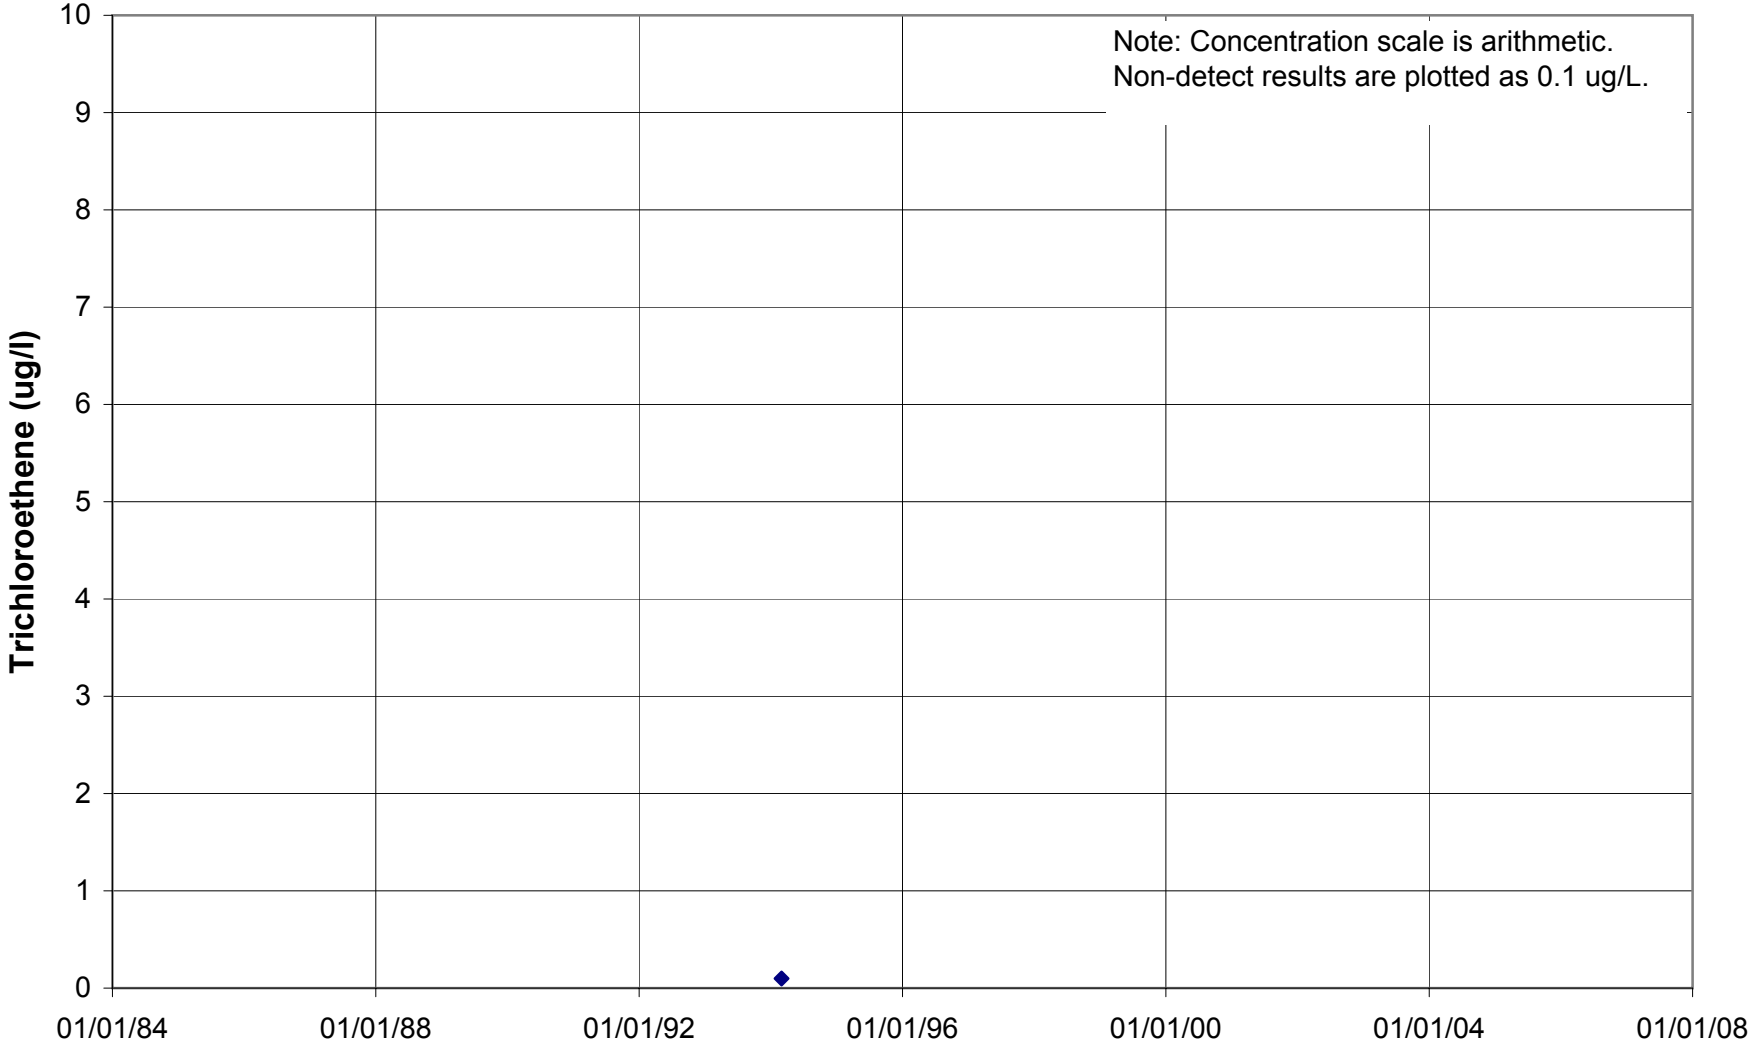

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

482086 (I01MW)

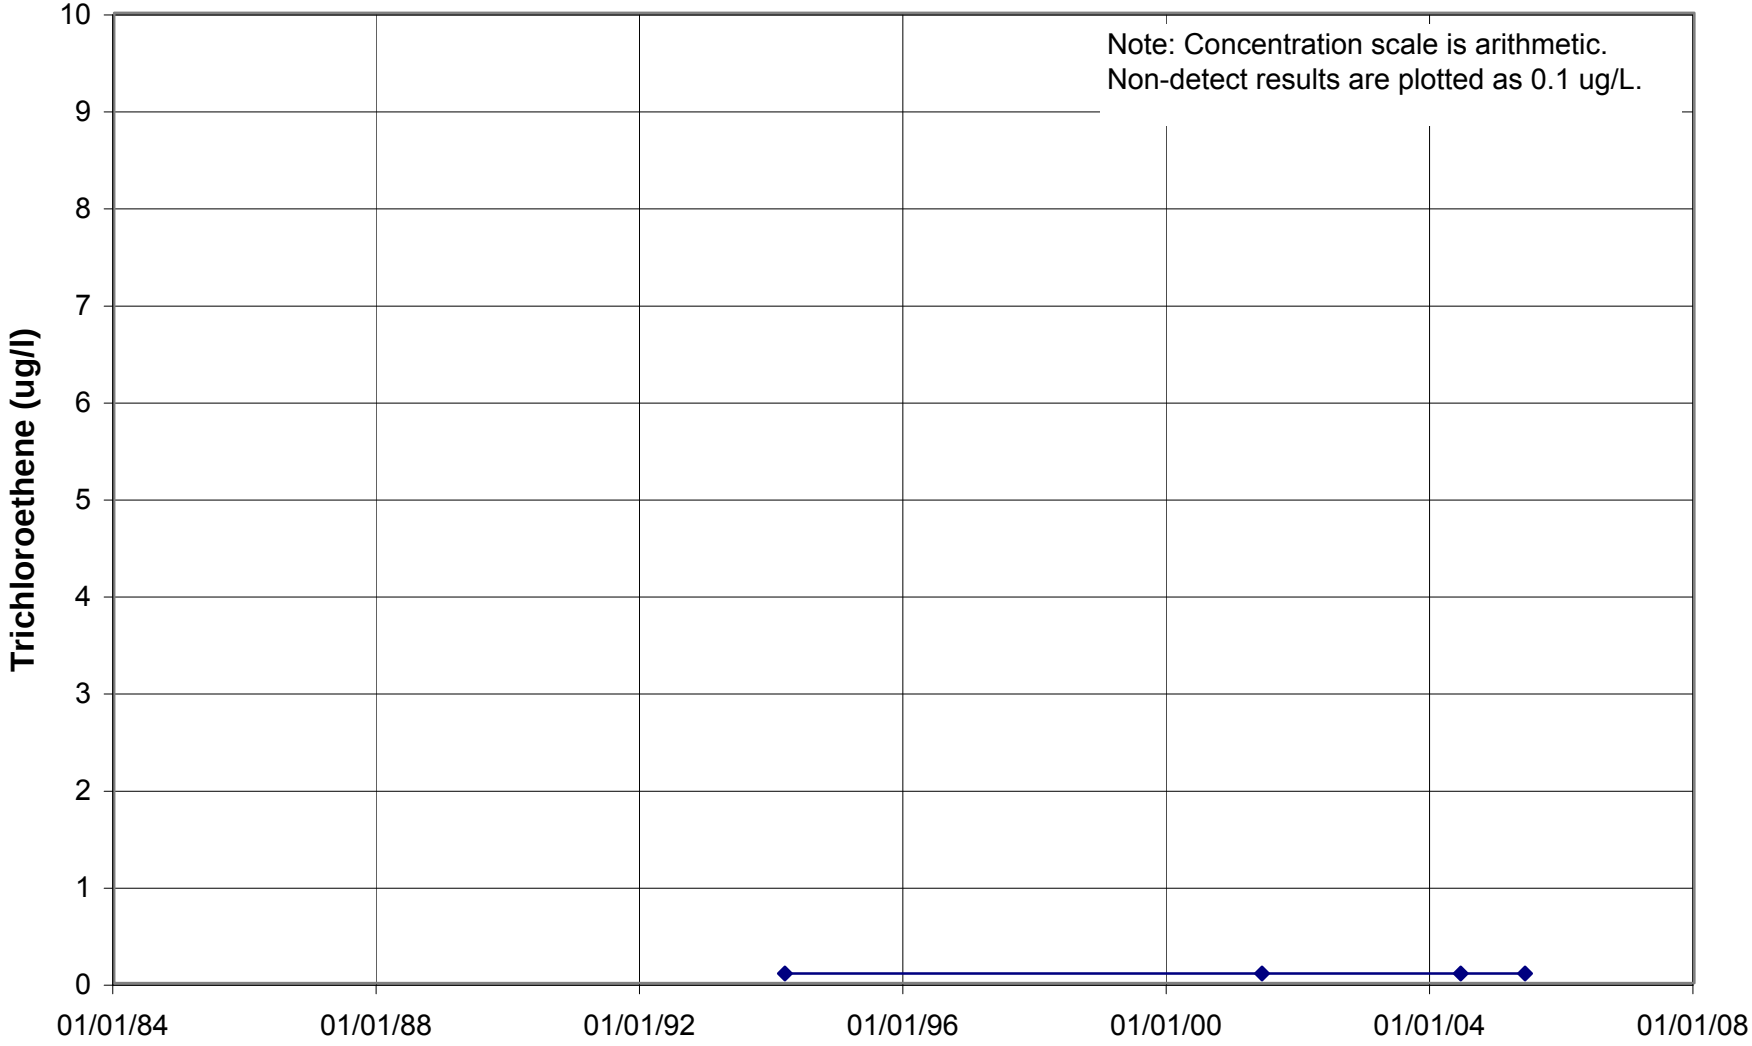

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

482087 (I05MW)

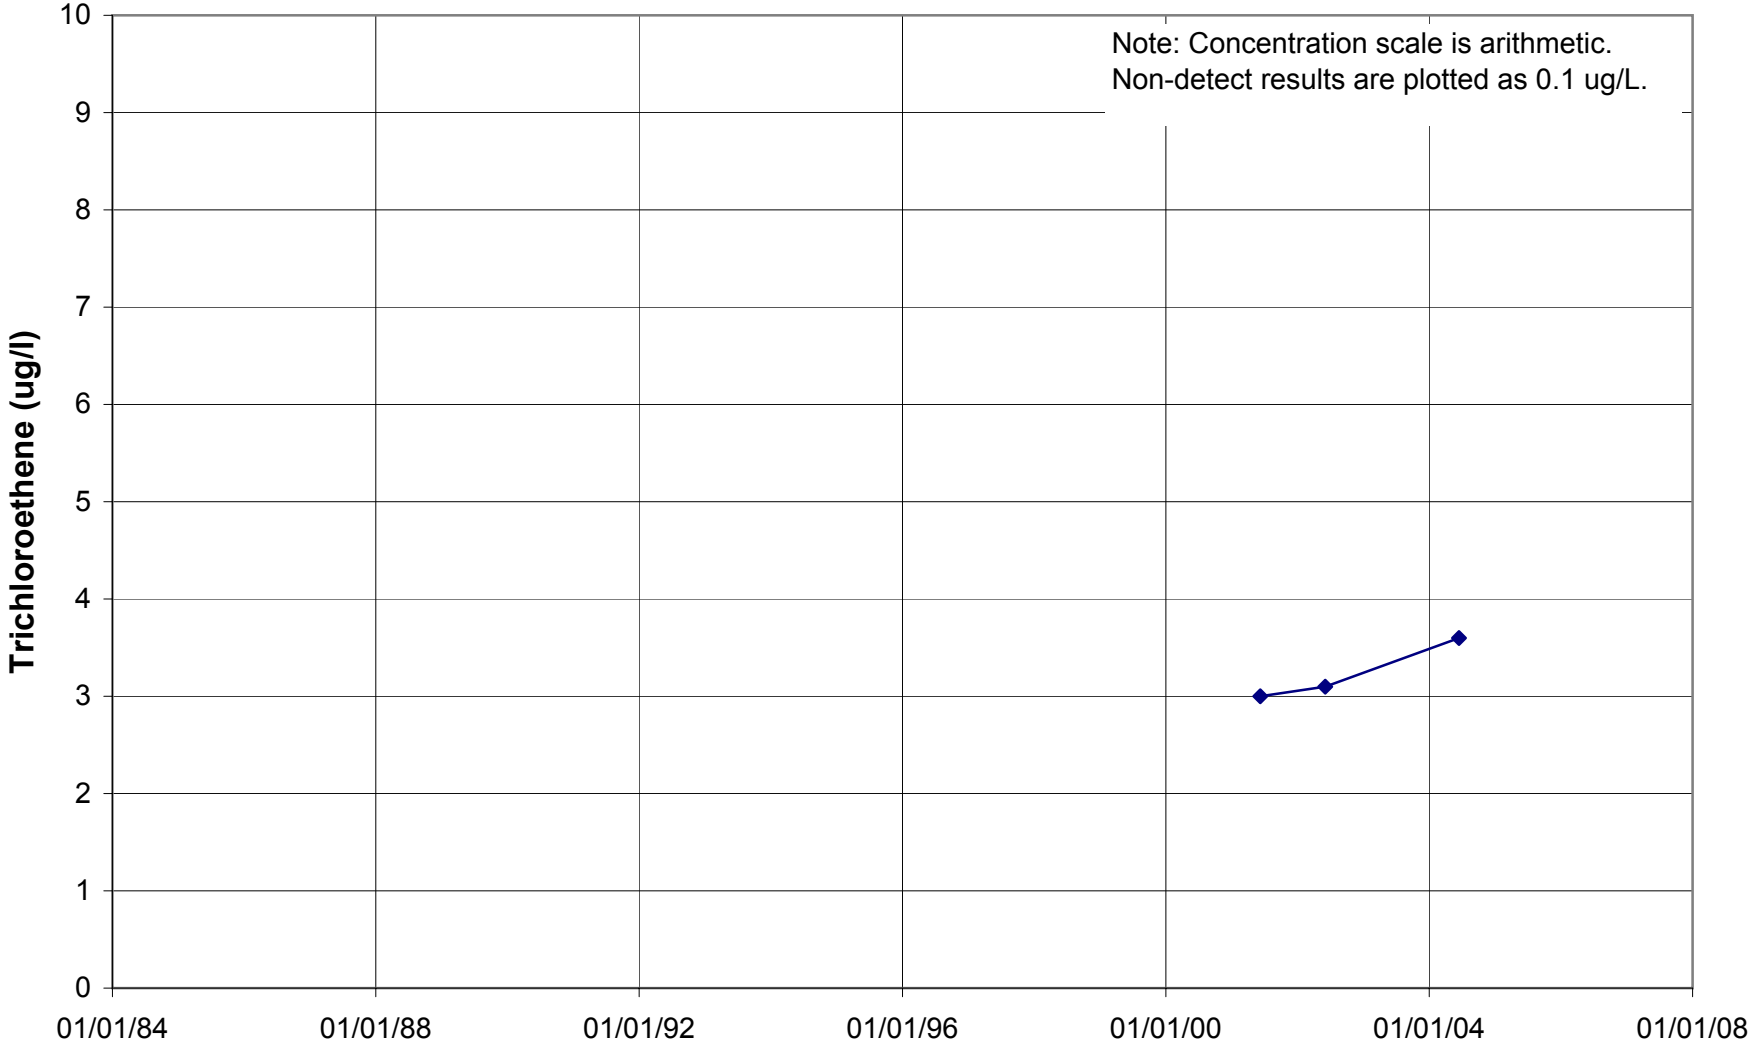

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

482089 (I04MW)

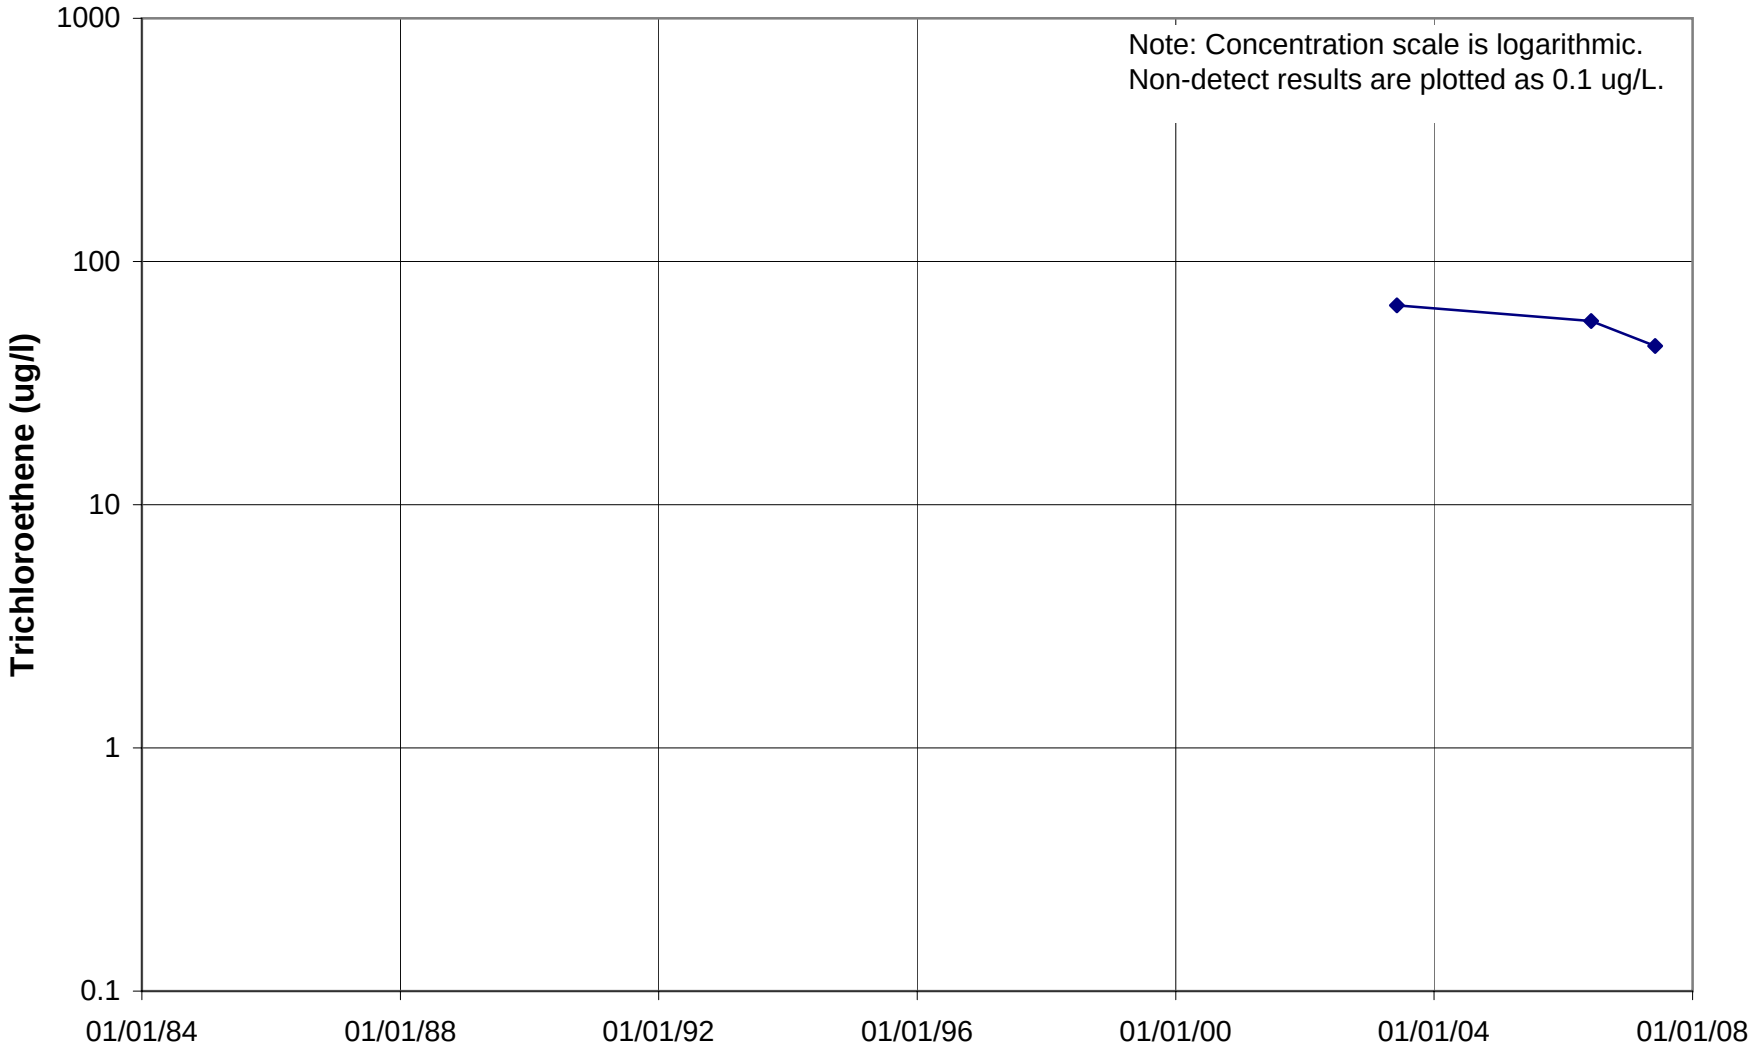

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

512761

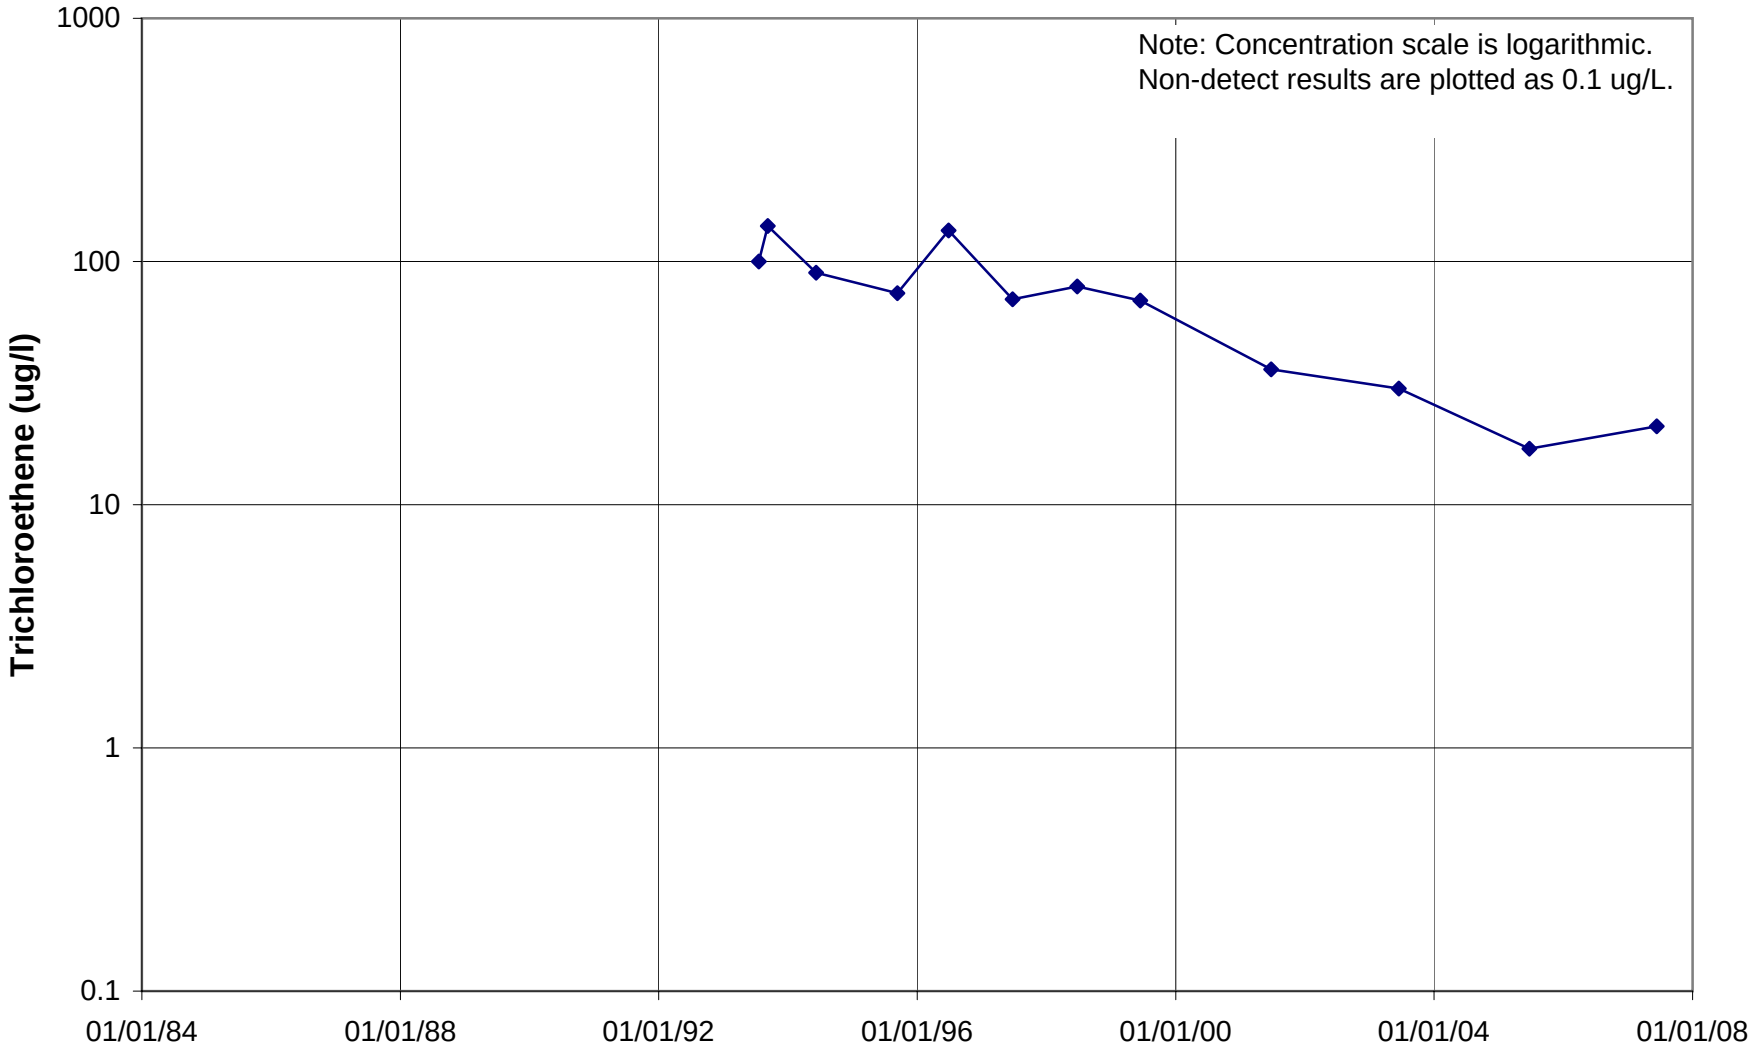

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

519288

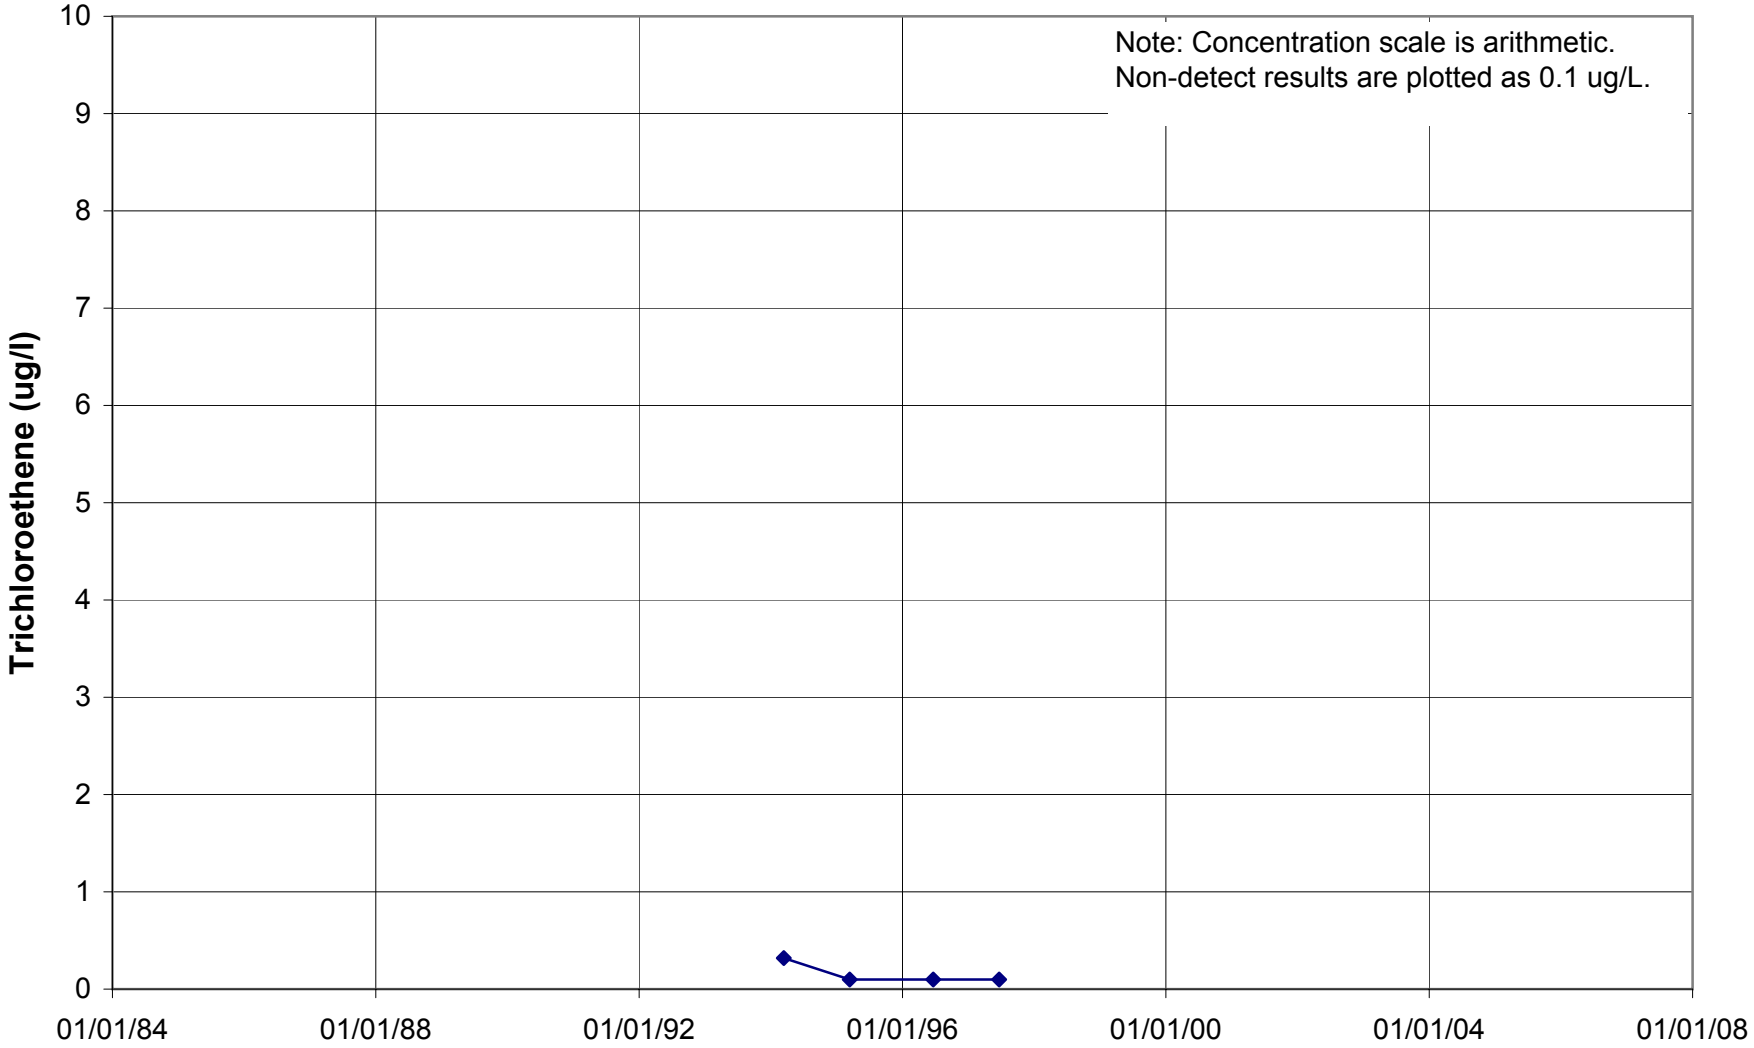

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

519289

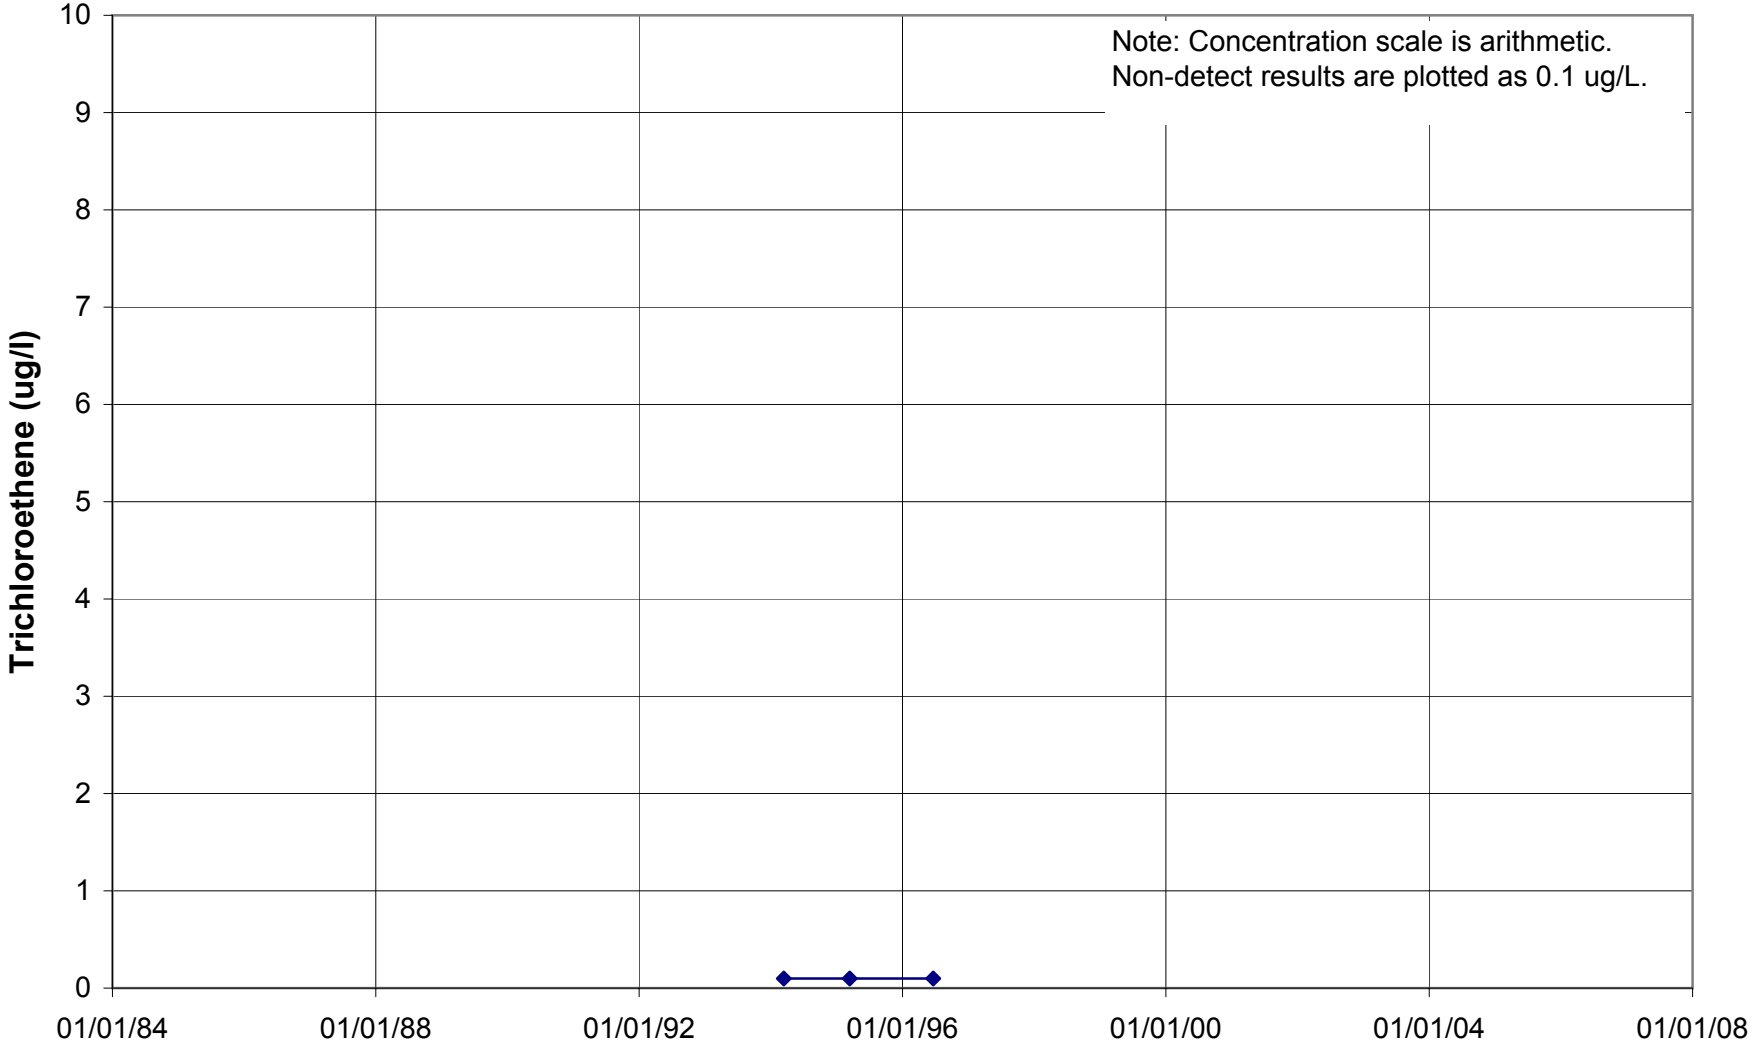

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

519290

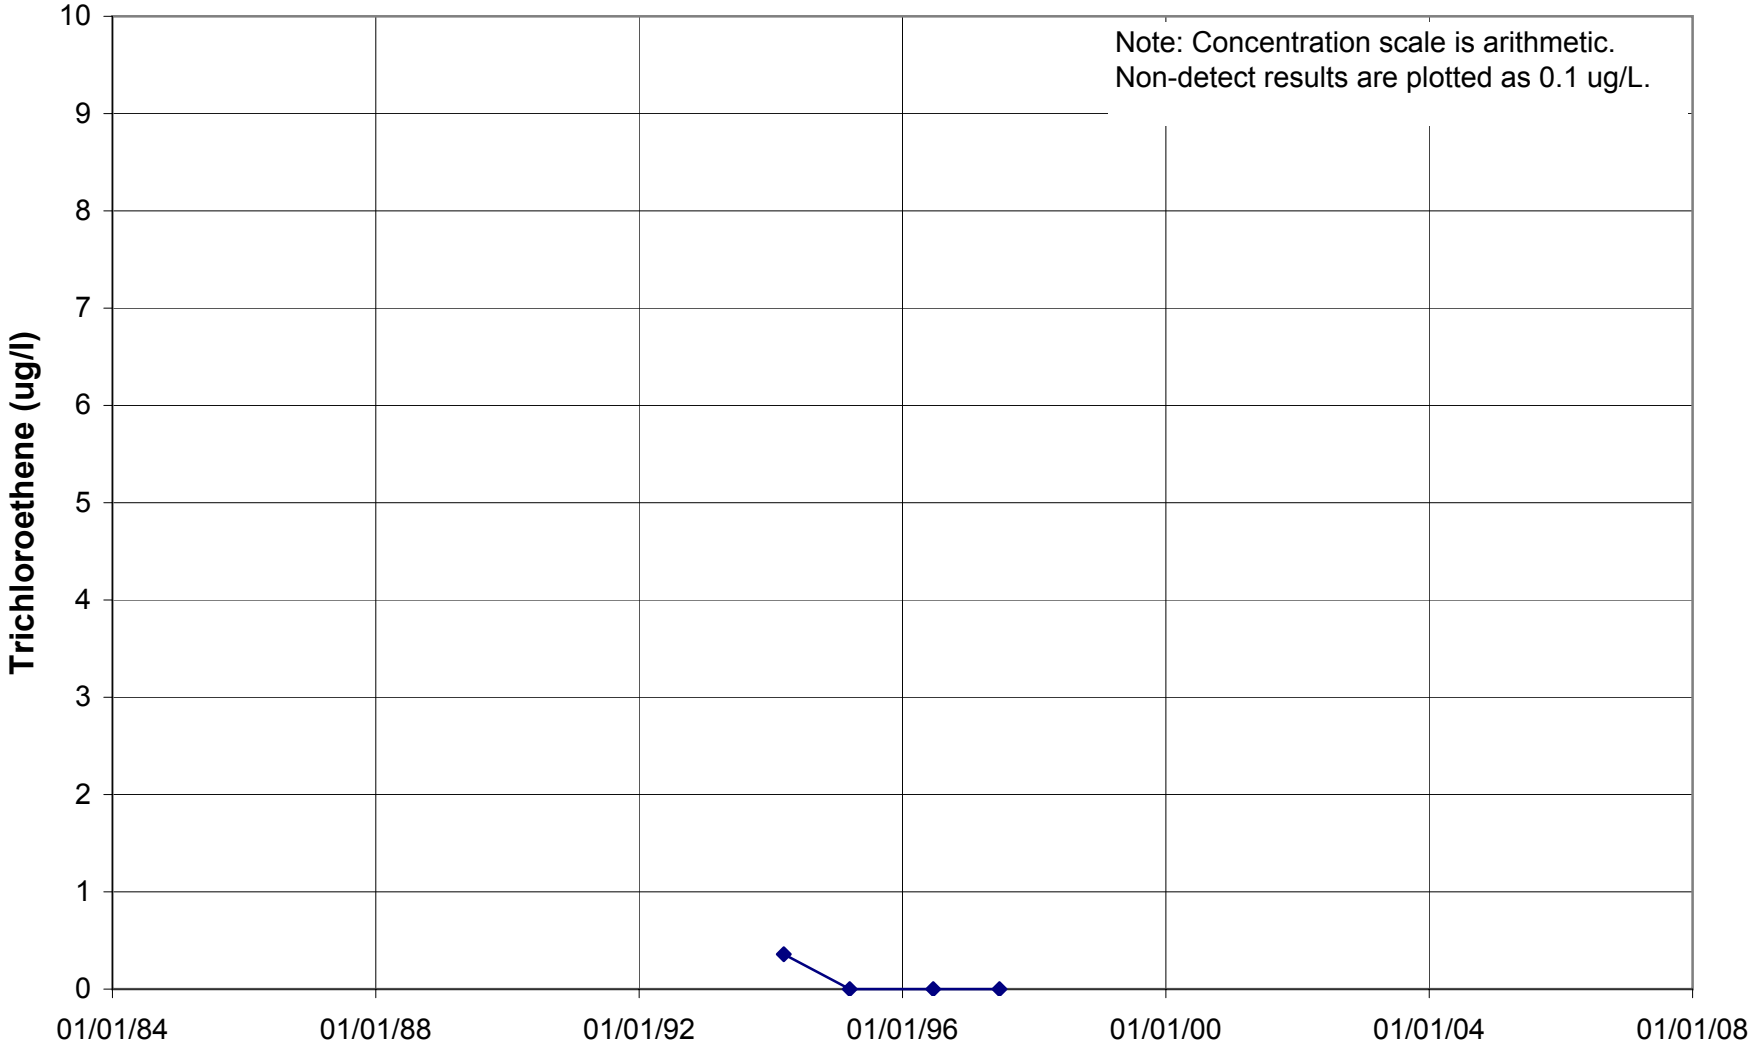

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

520931

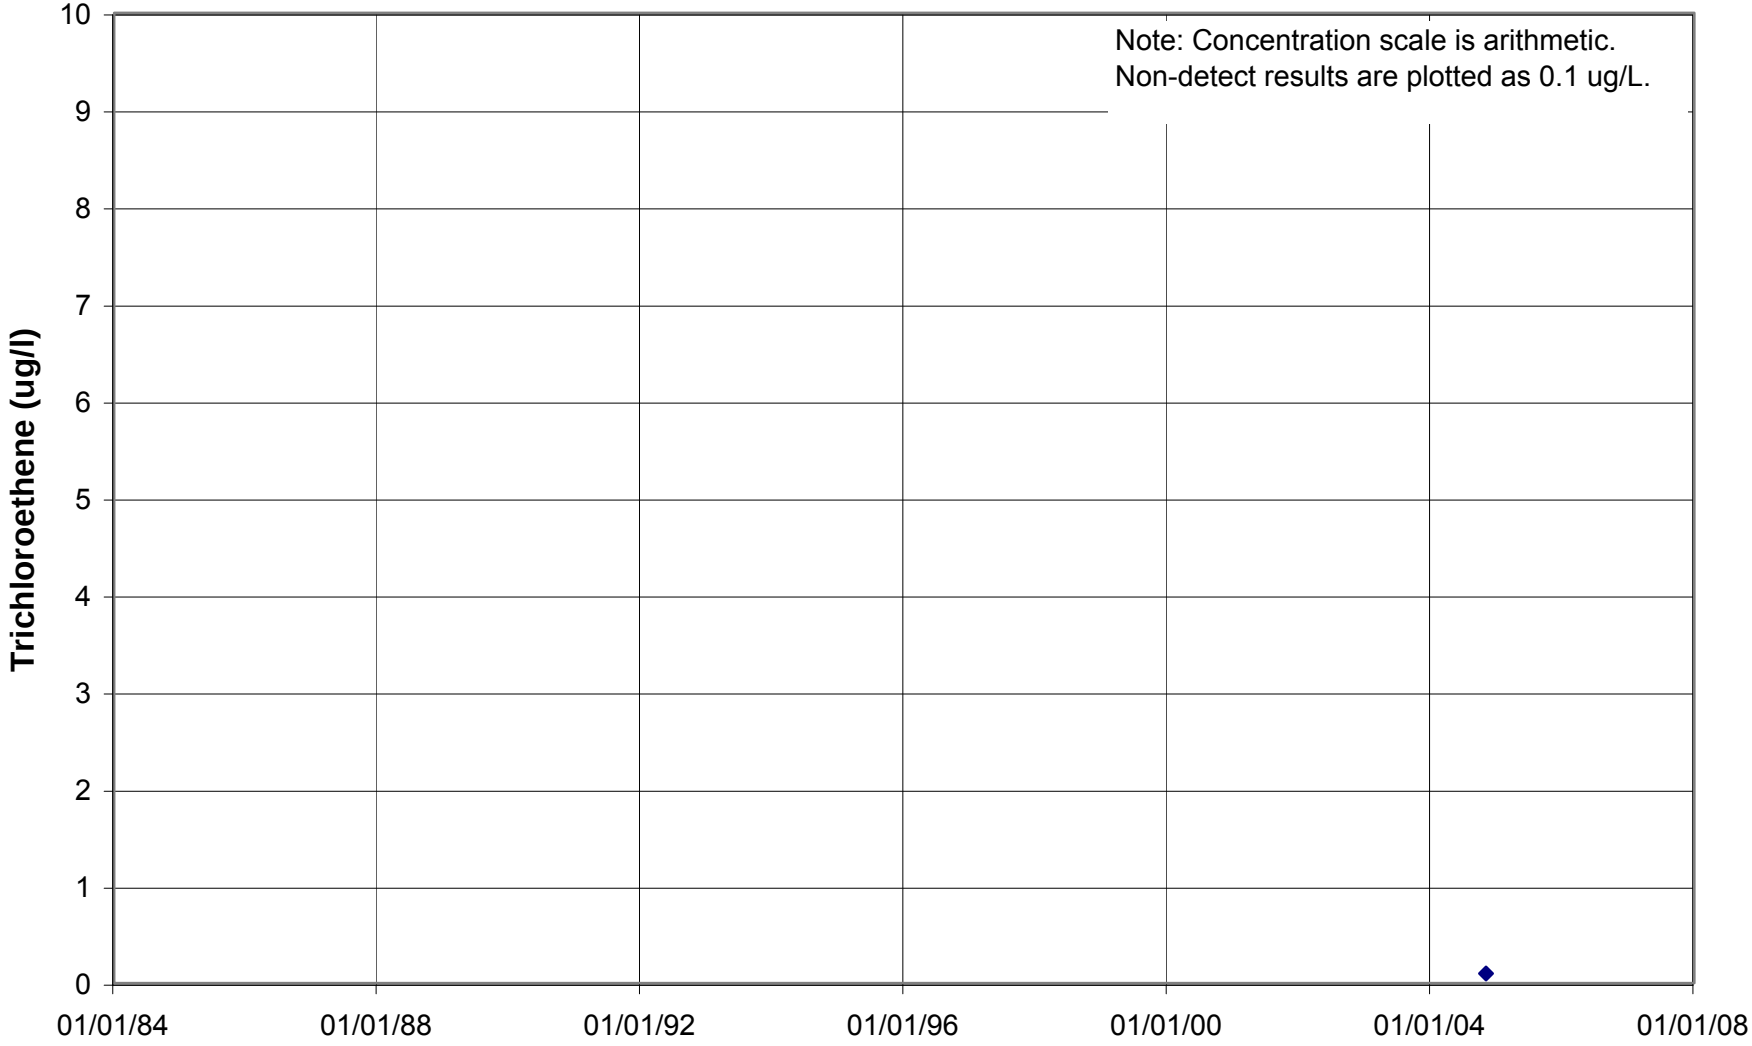

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

PJ#003

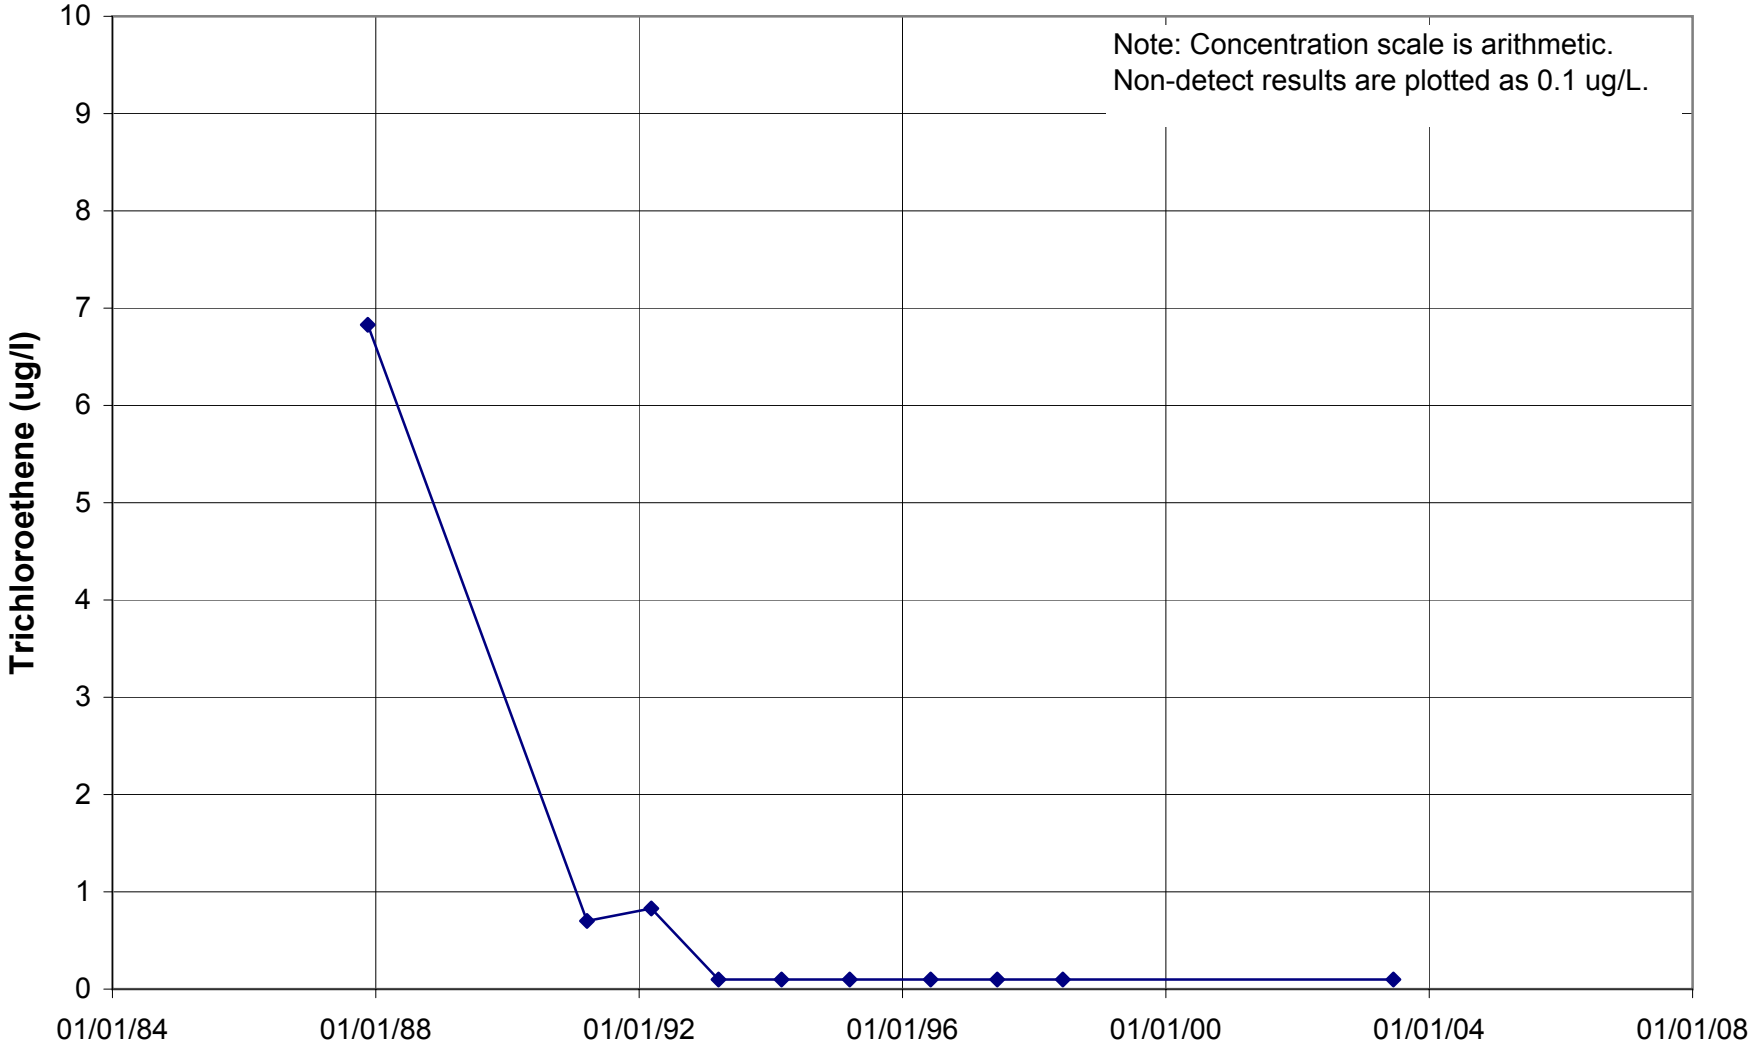

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

PJ#027

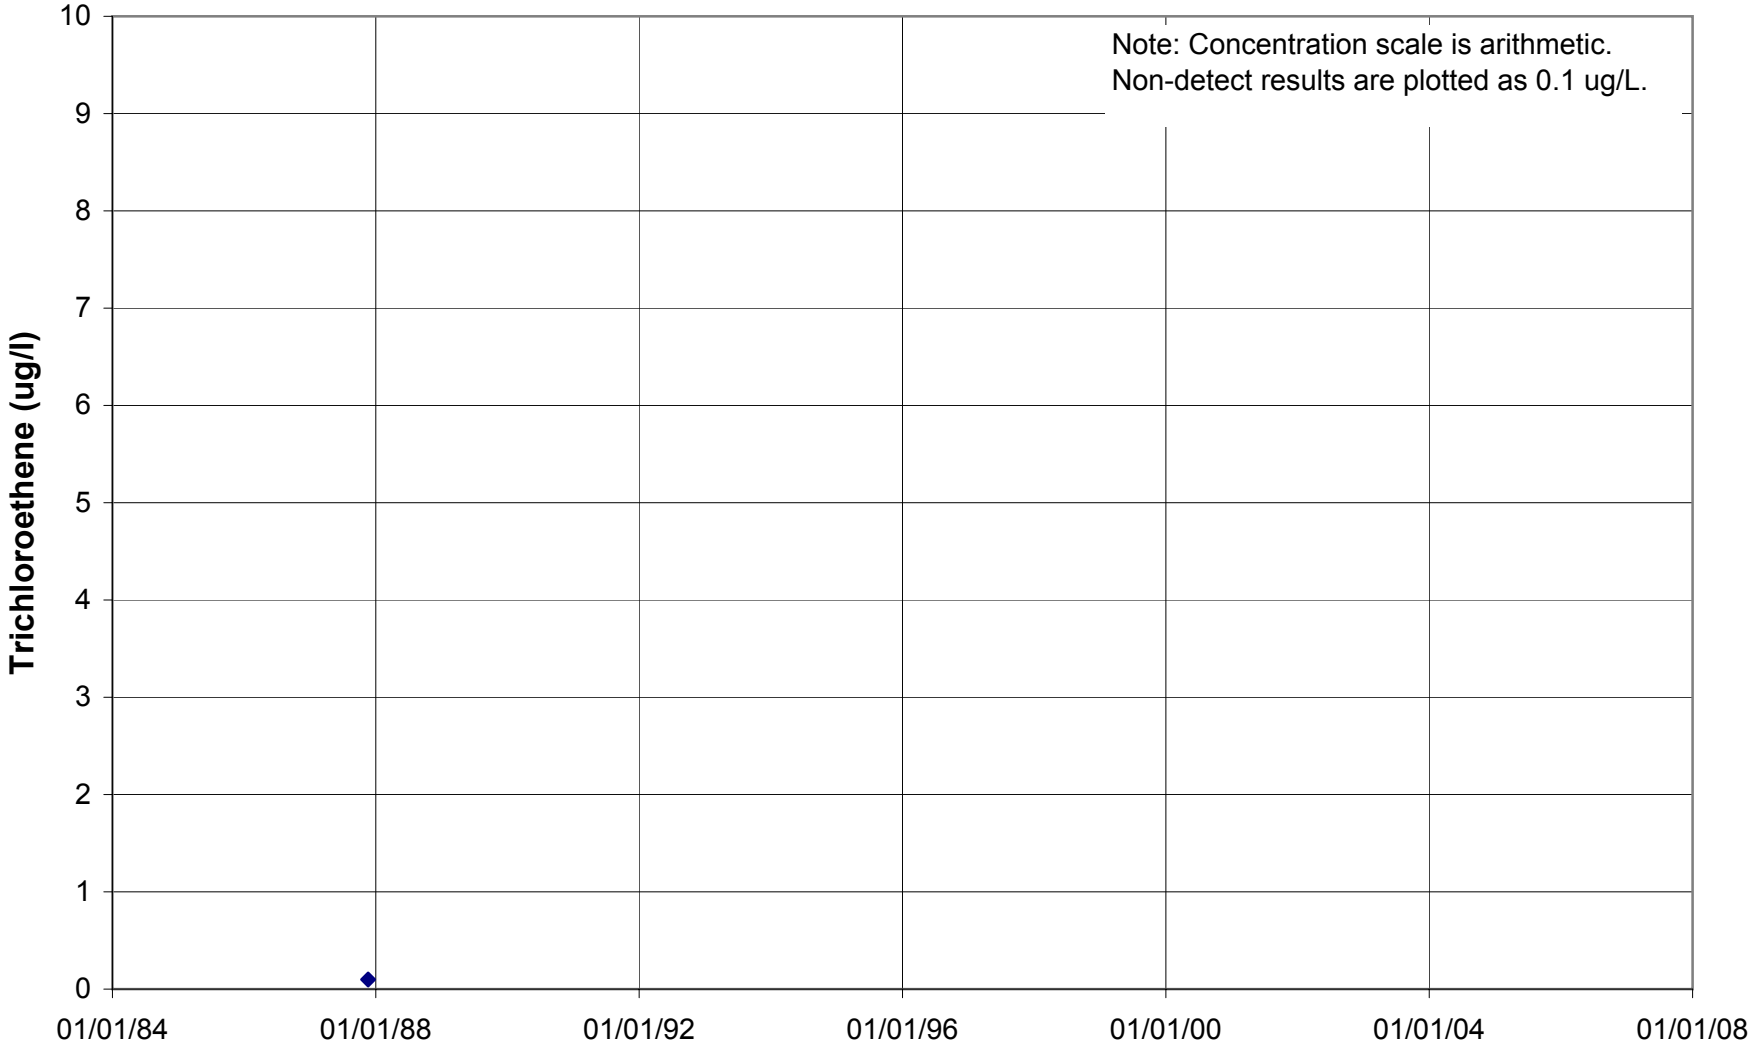

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

PJ#309 (B8)

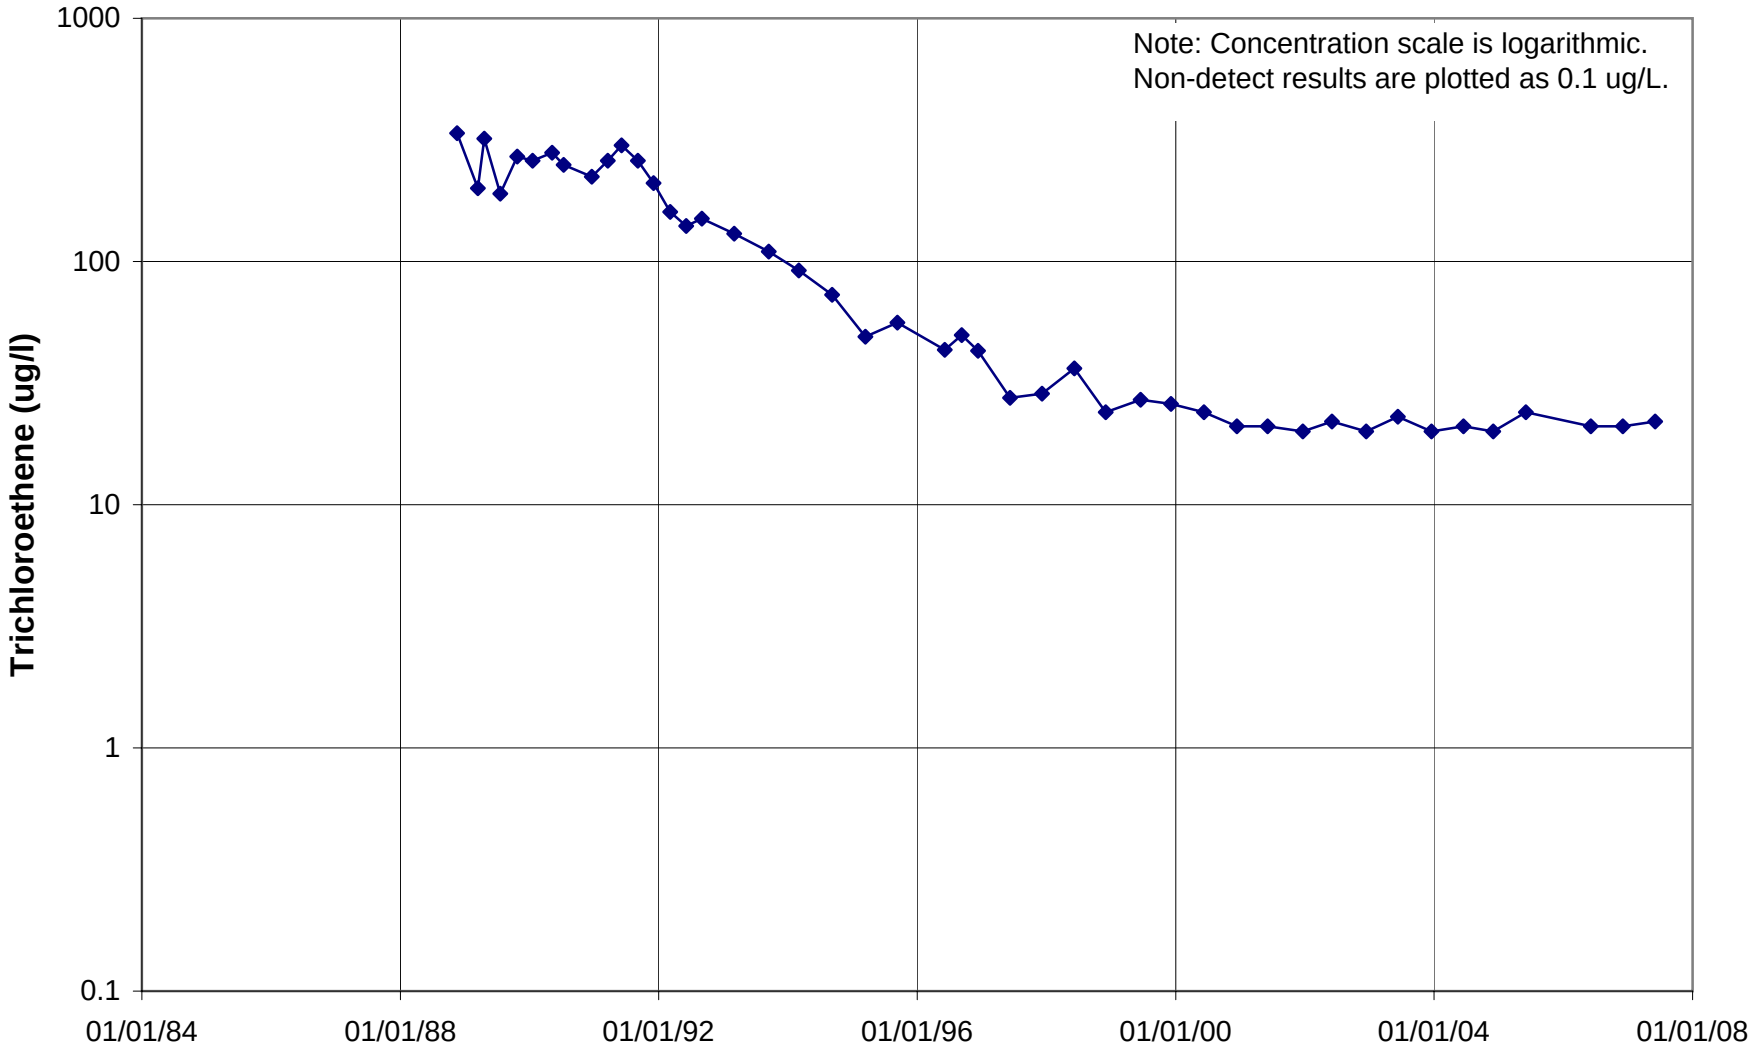

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

PJ#310 (B9)

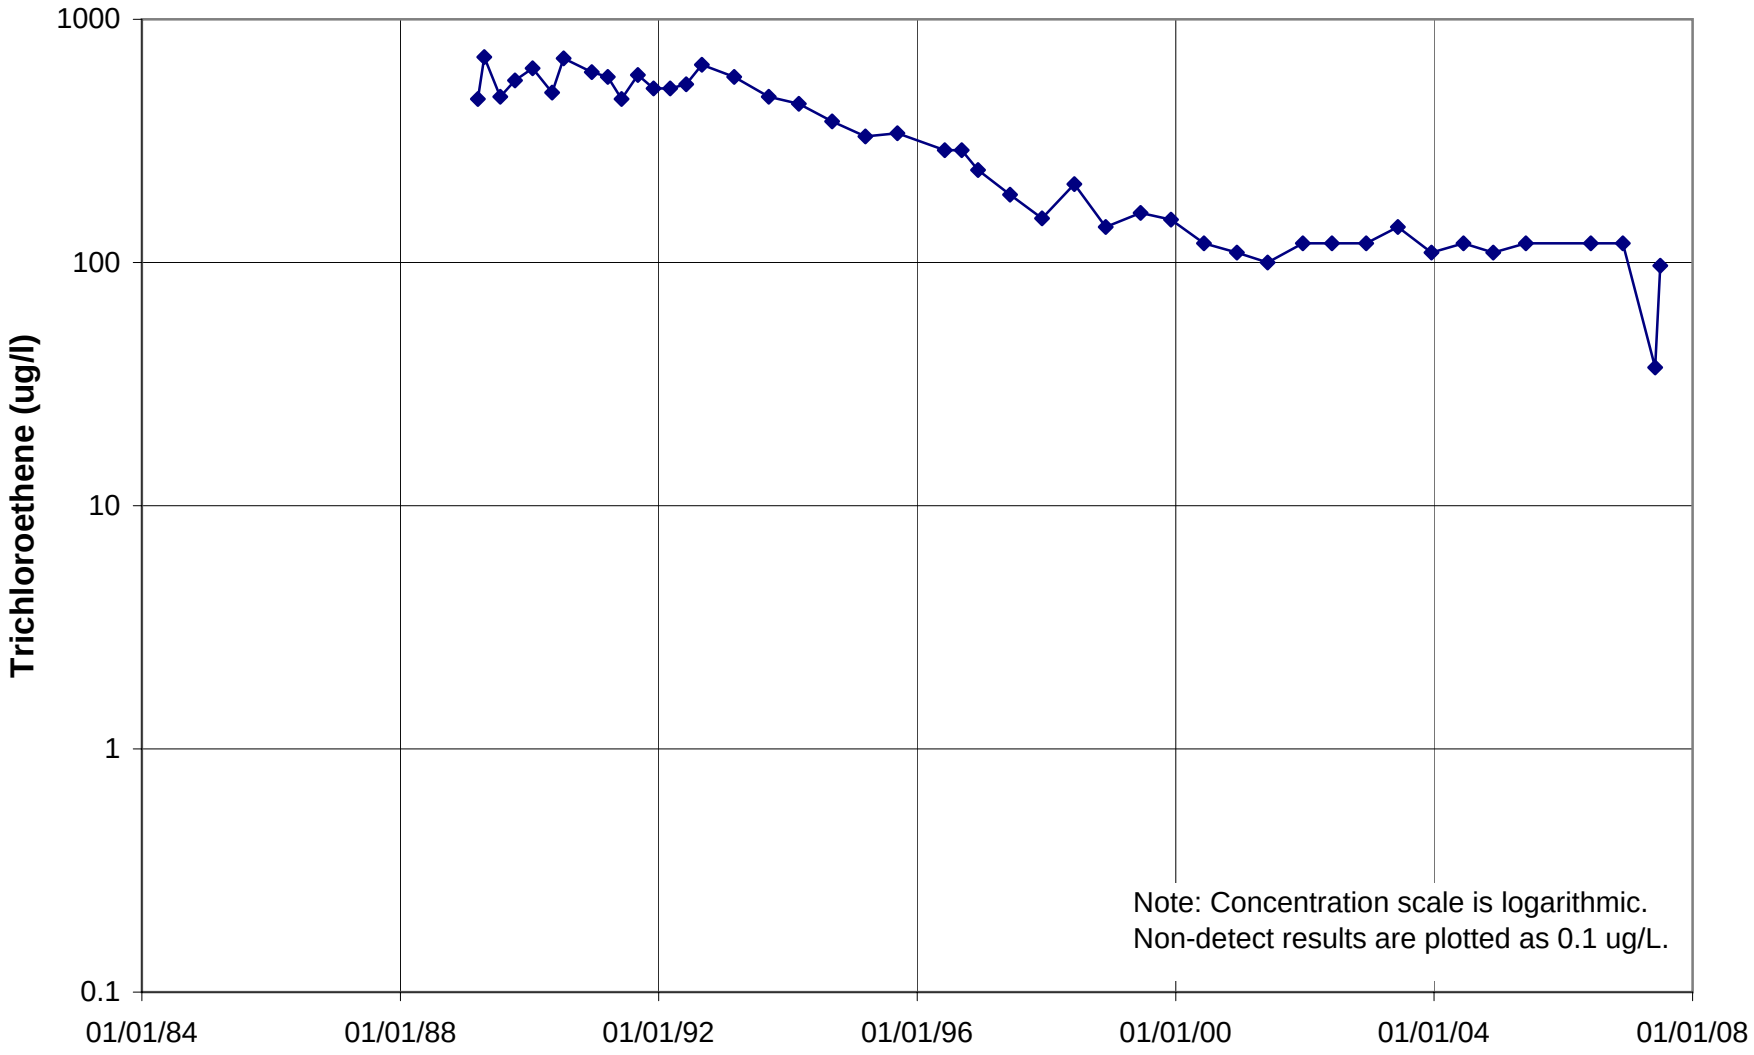

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

PJ#311 (B10)

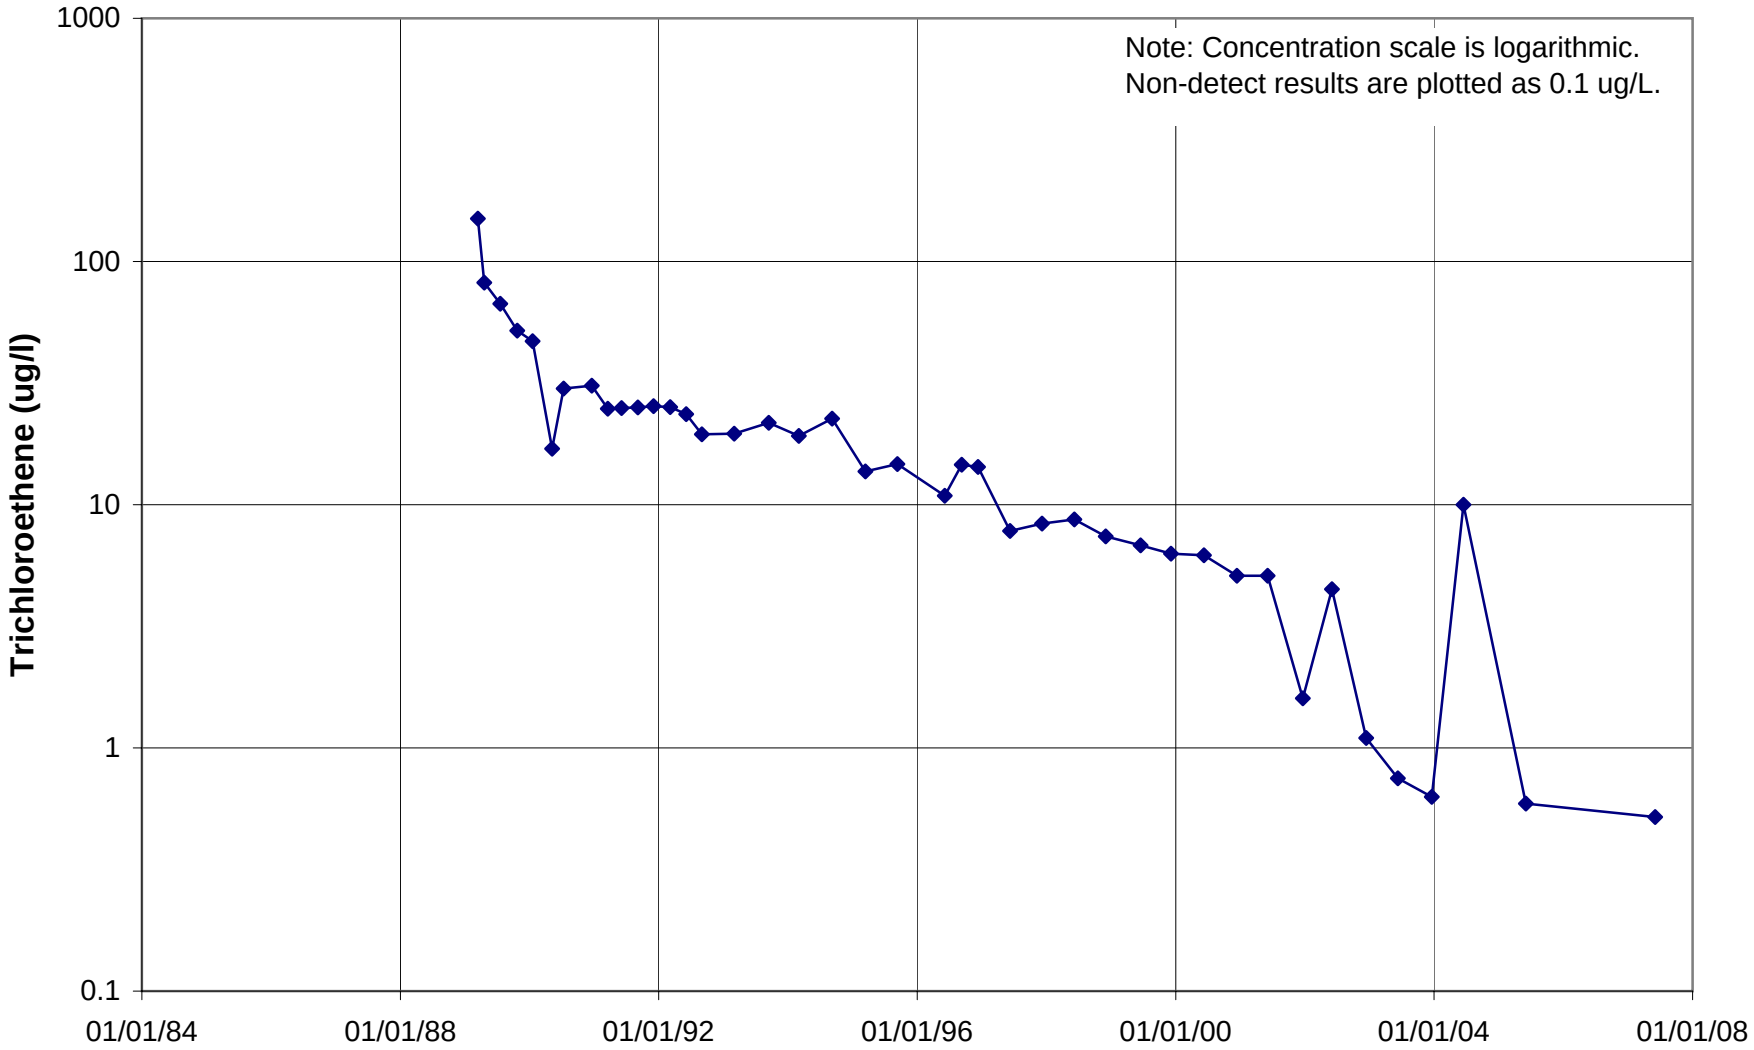

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

PJ#313 (B12)

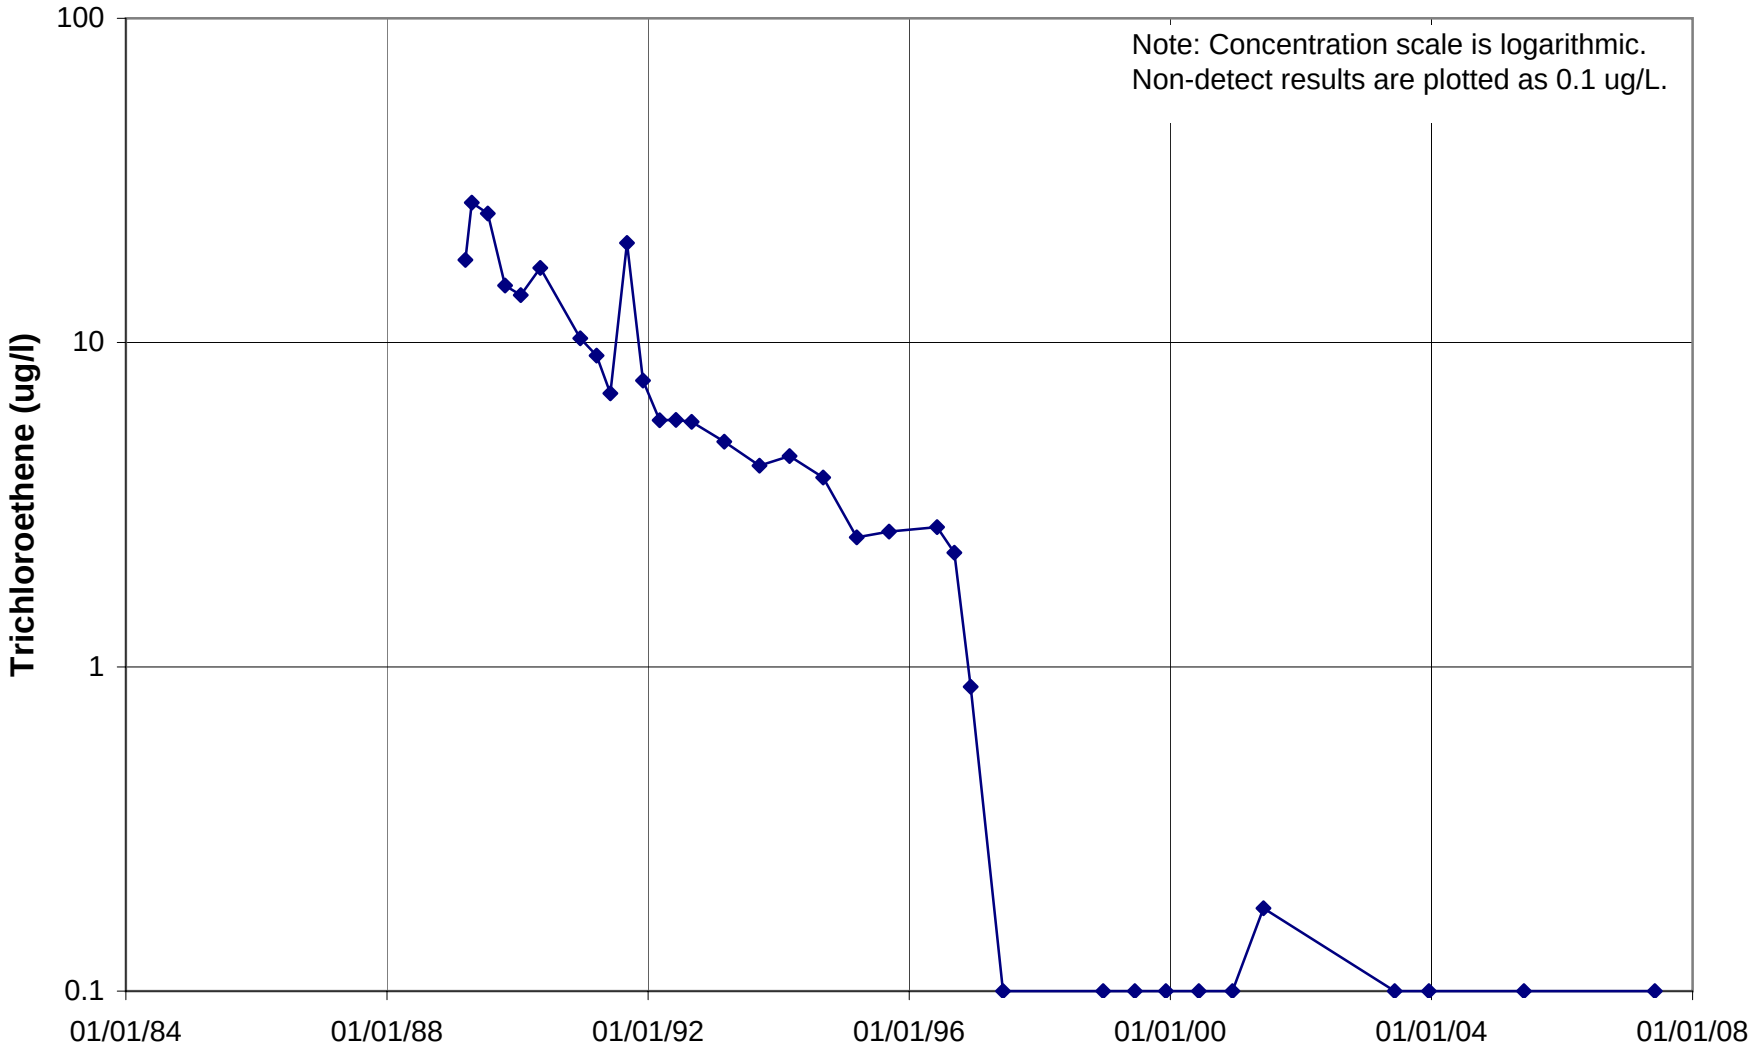

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

PJ#318

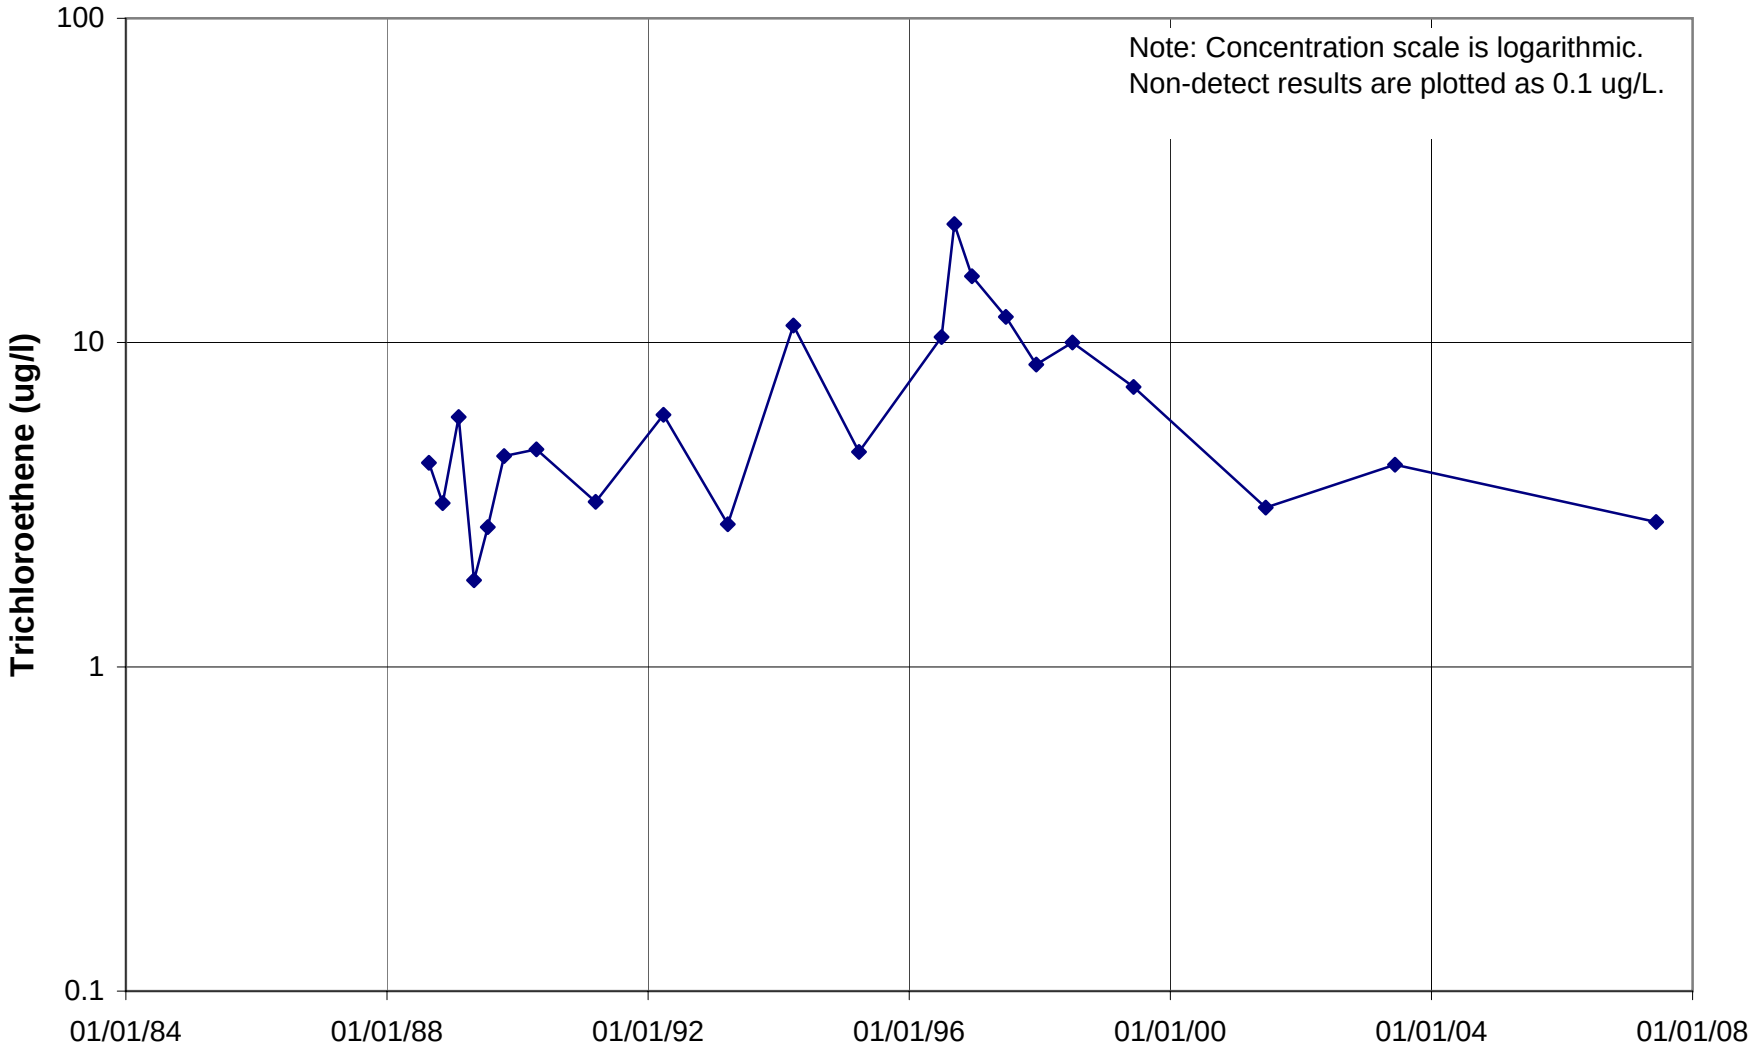

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

PJ#802

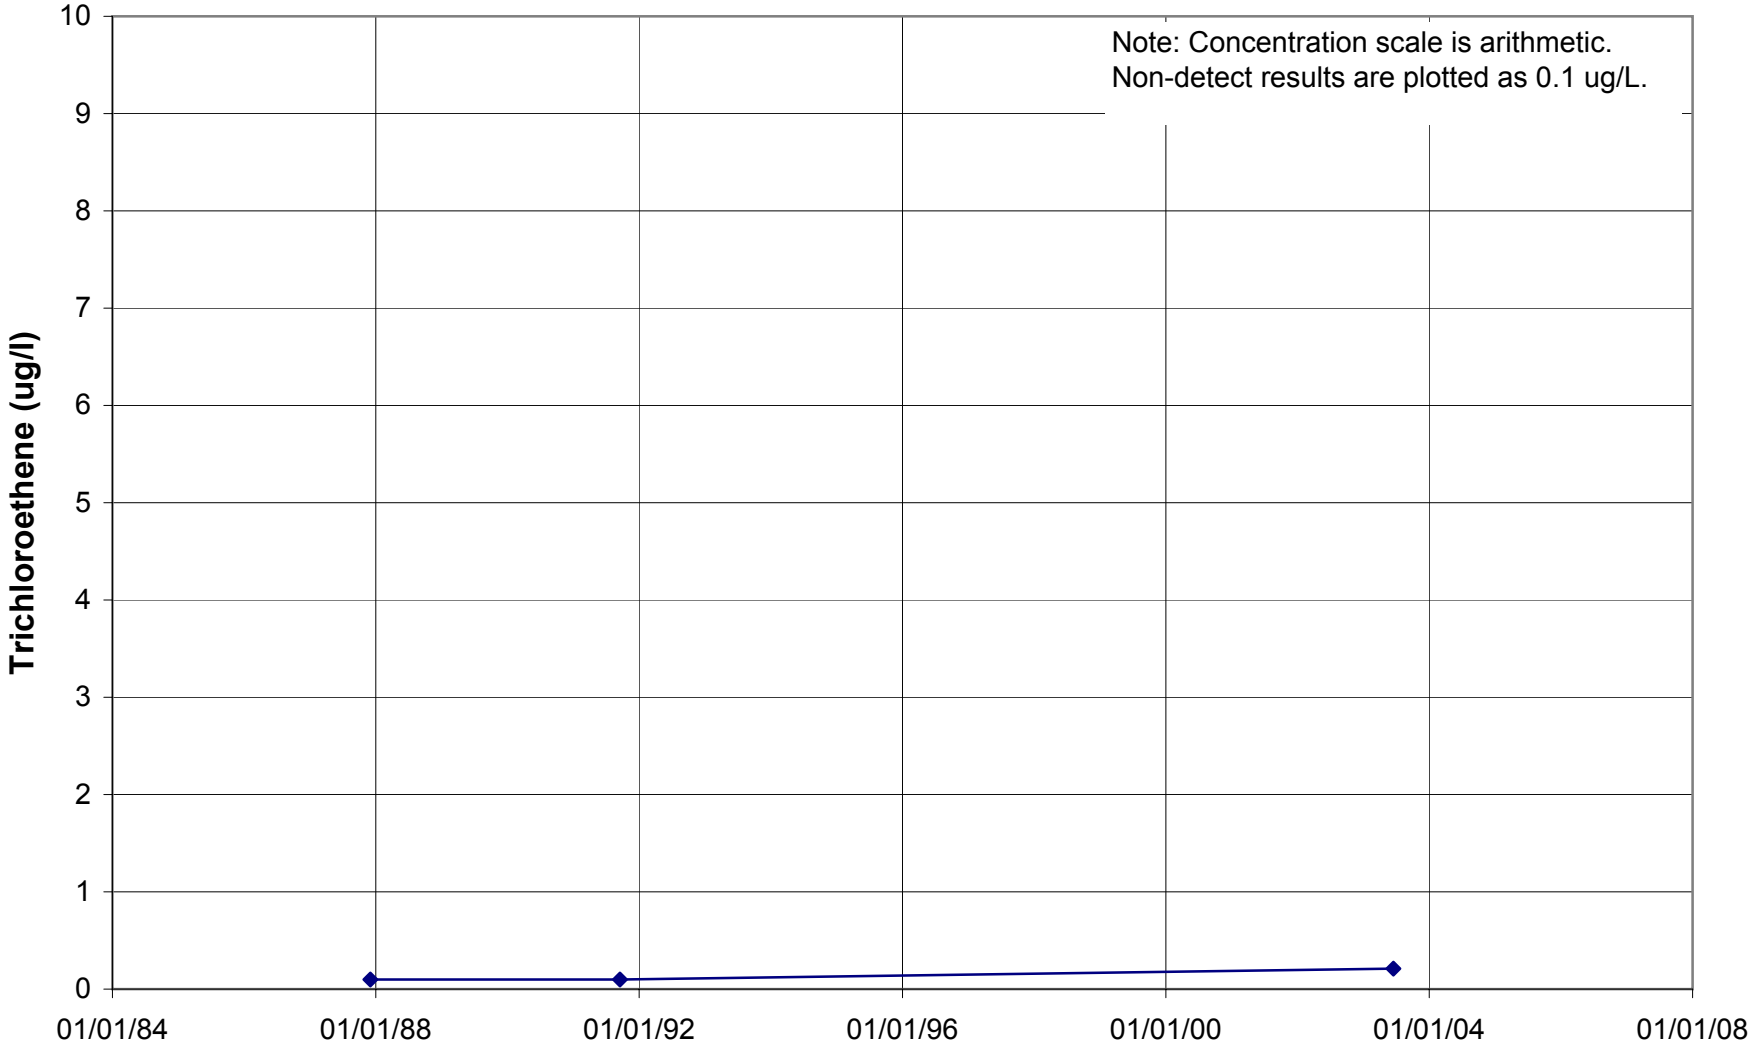

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

PJ#806

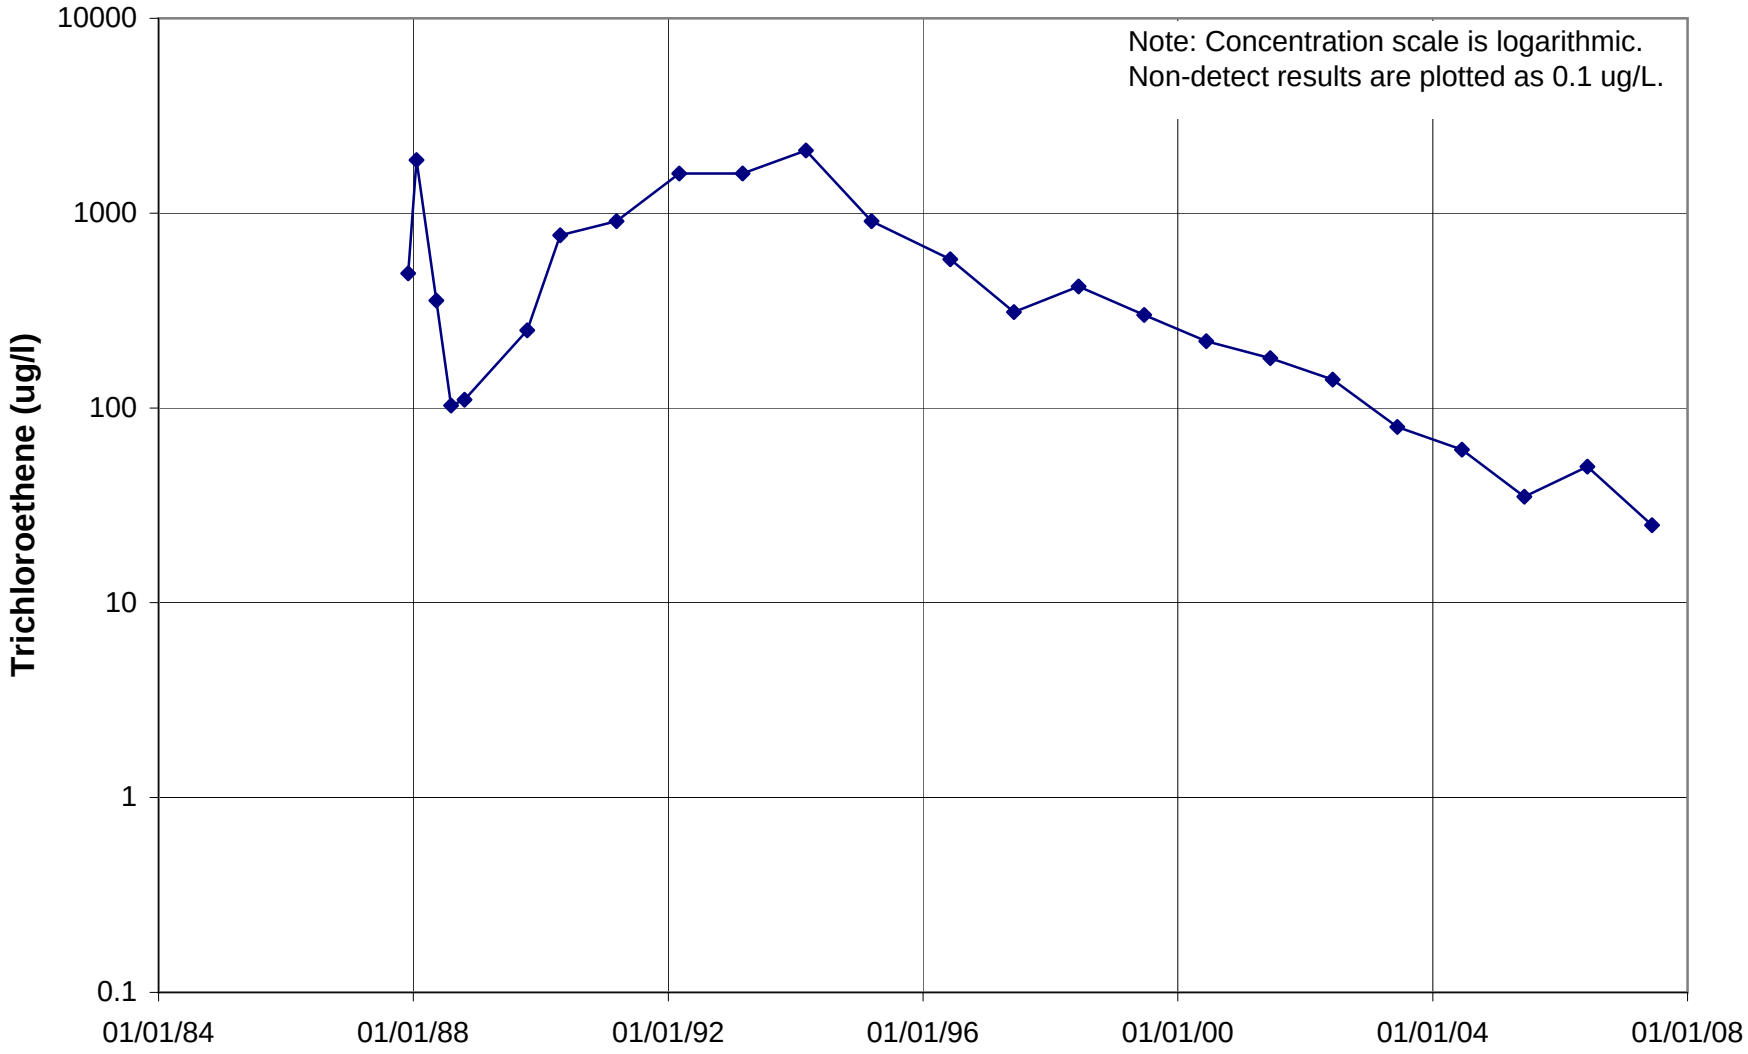

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

206792 (NBM#4)

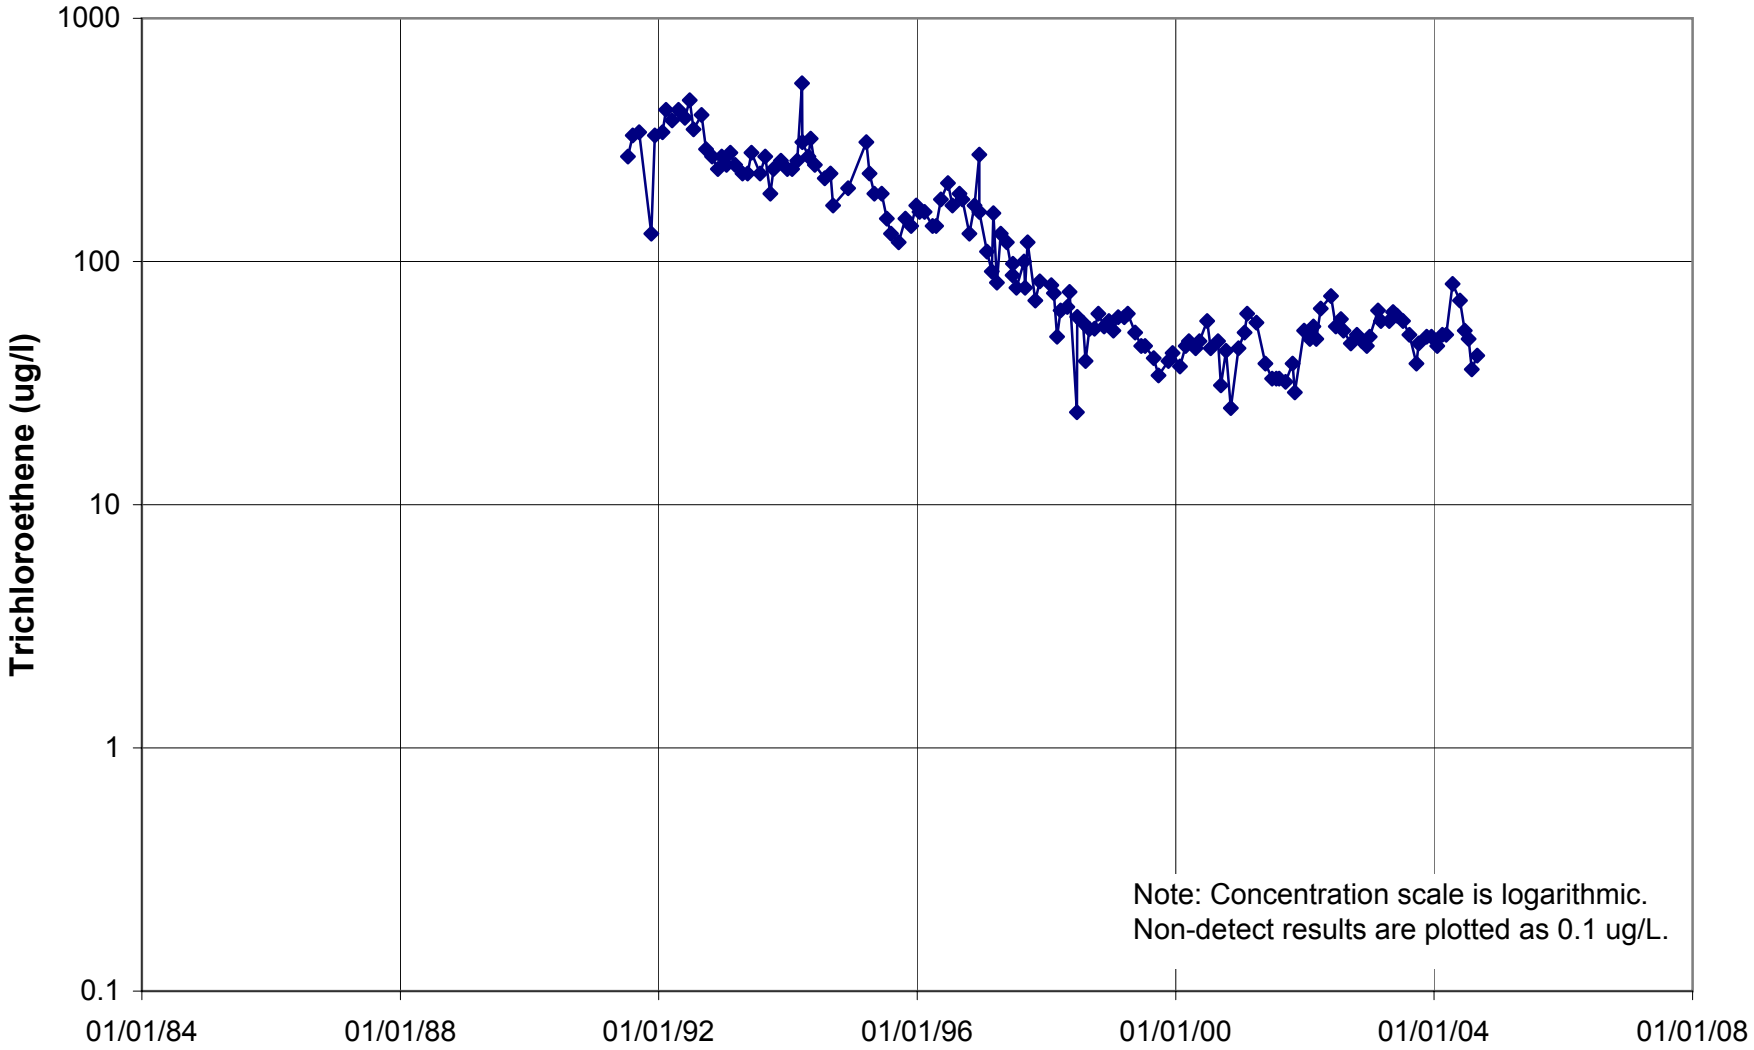

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

206793 (NBM#3)

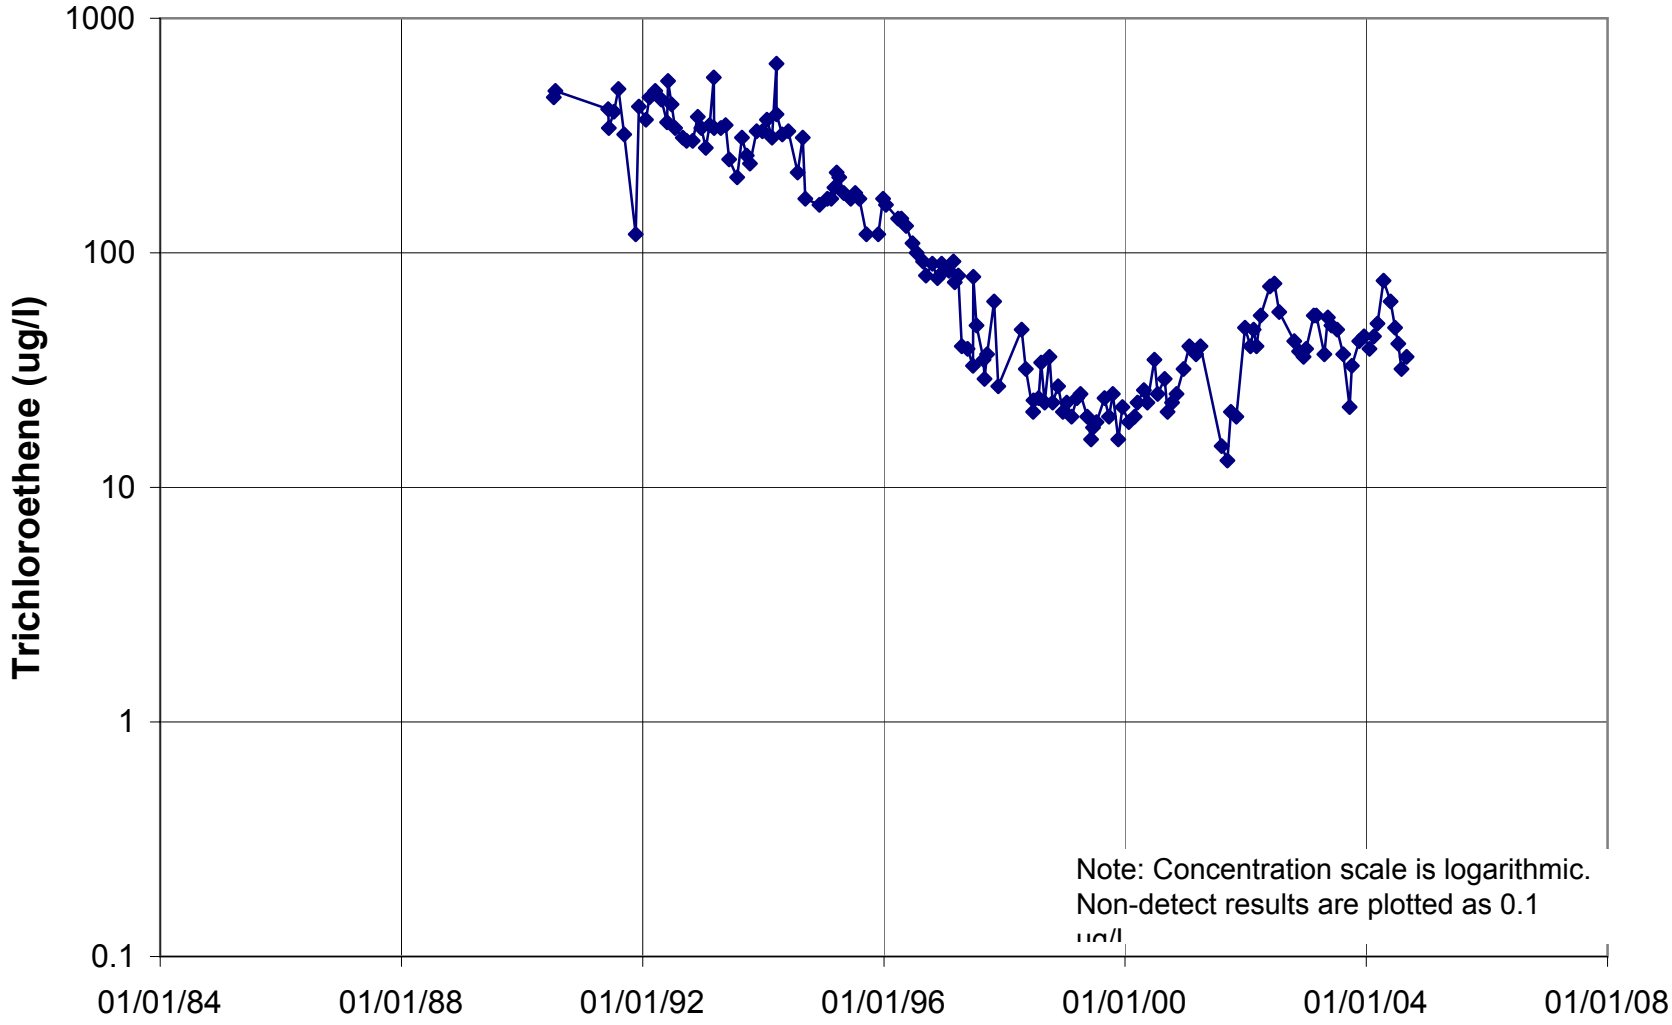

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

206796 (NBM#5)

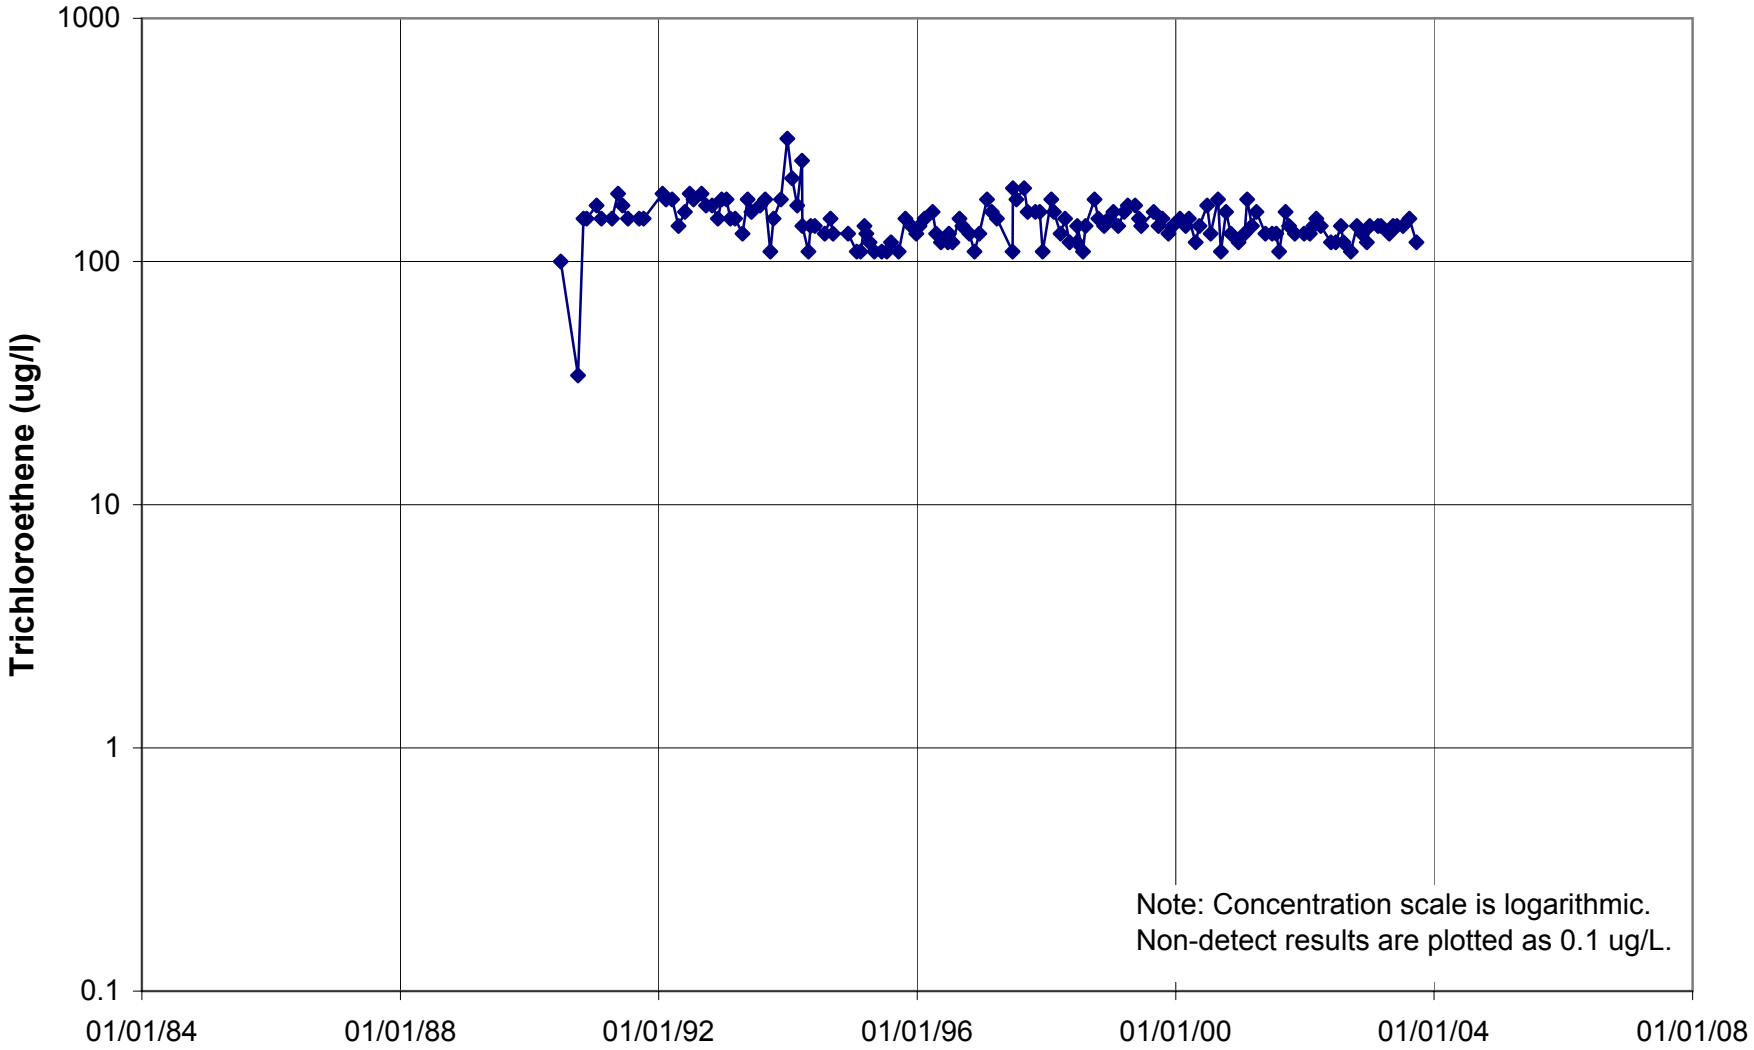

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

206797 (NBM#6)

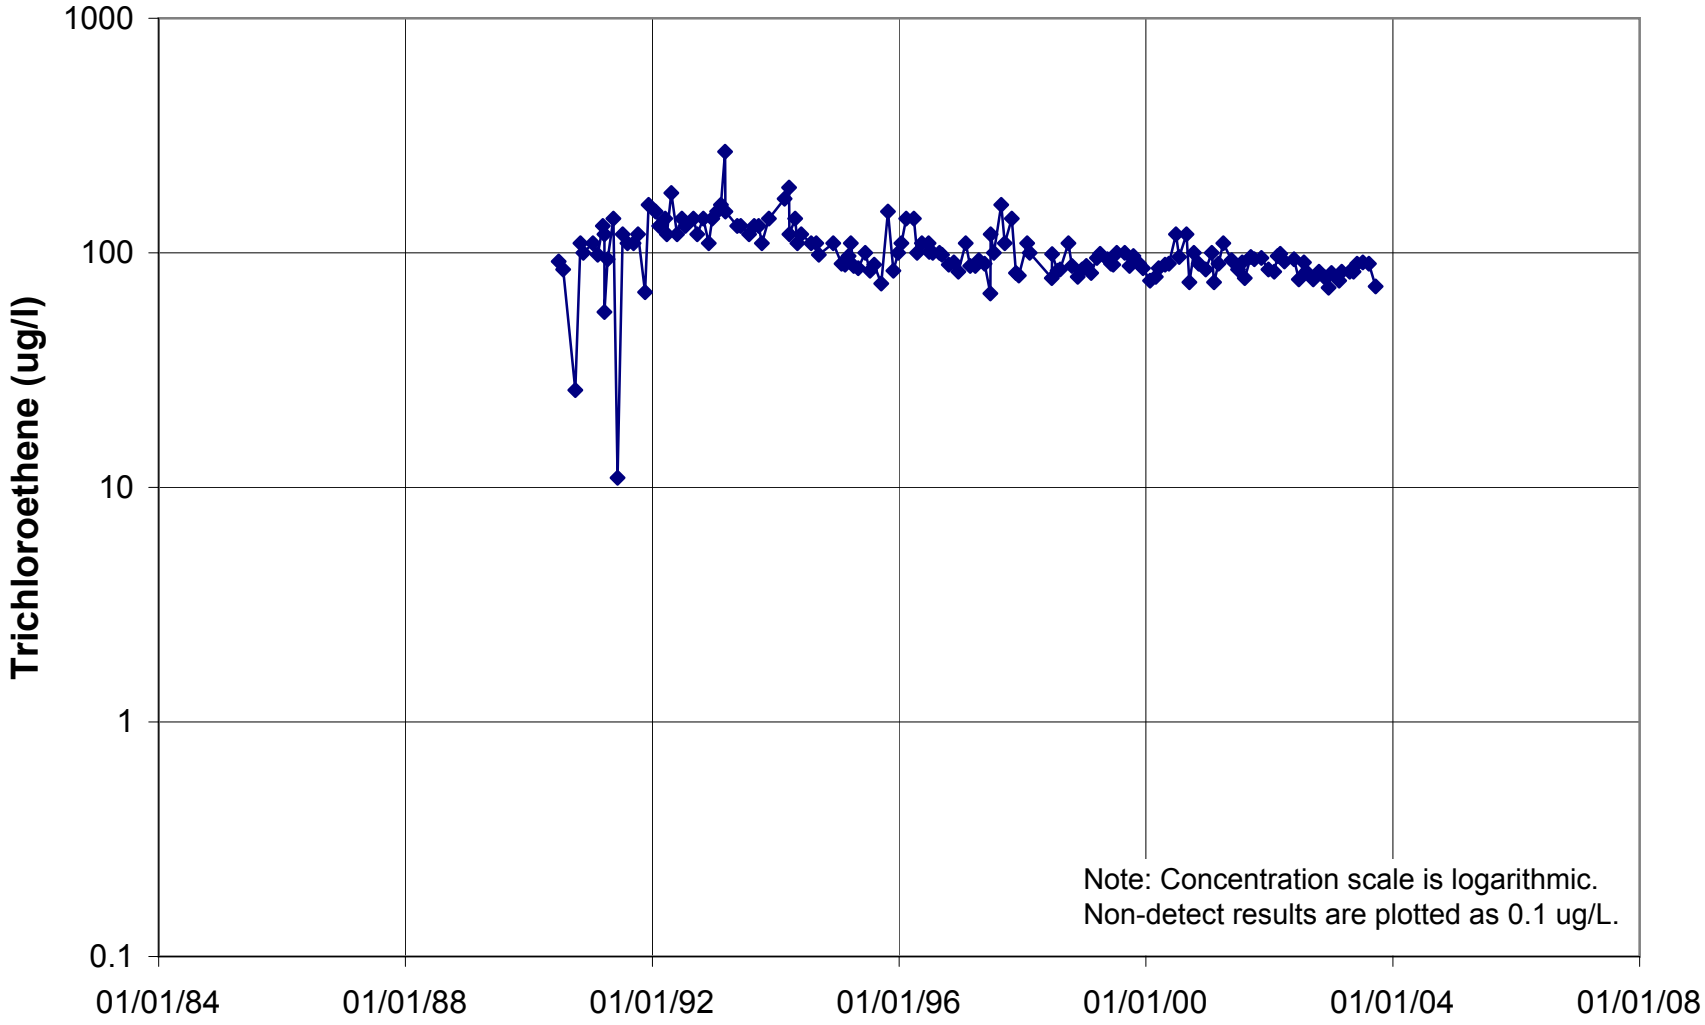

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

520931 (NBM#13)

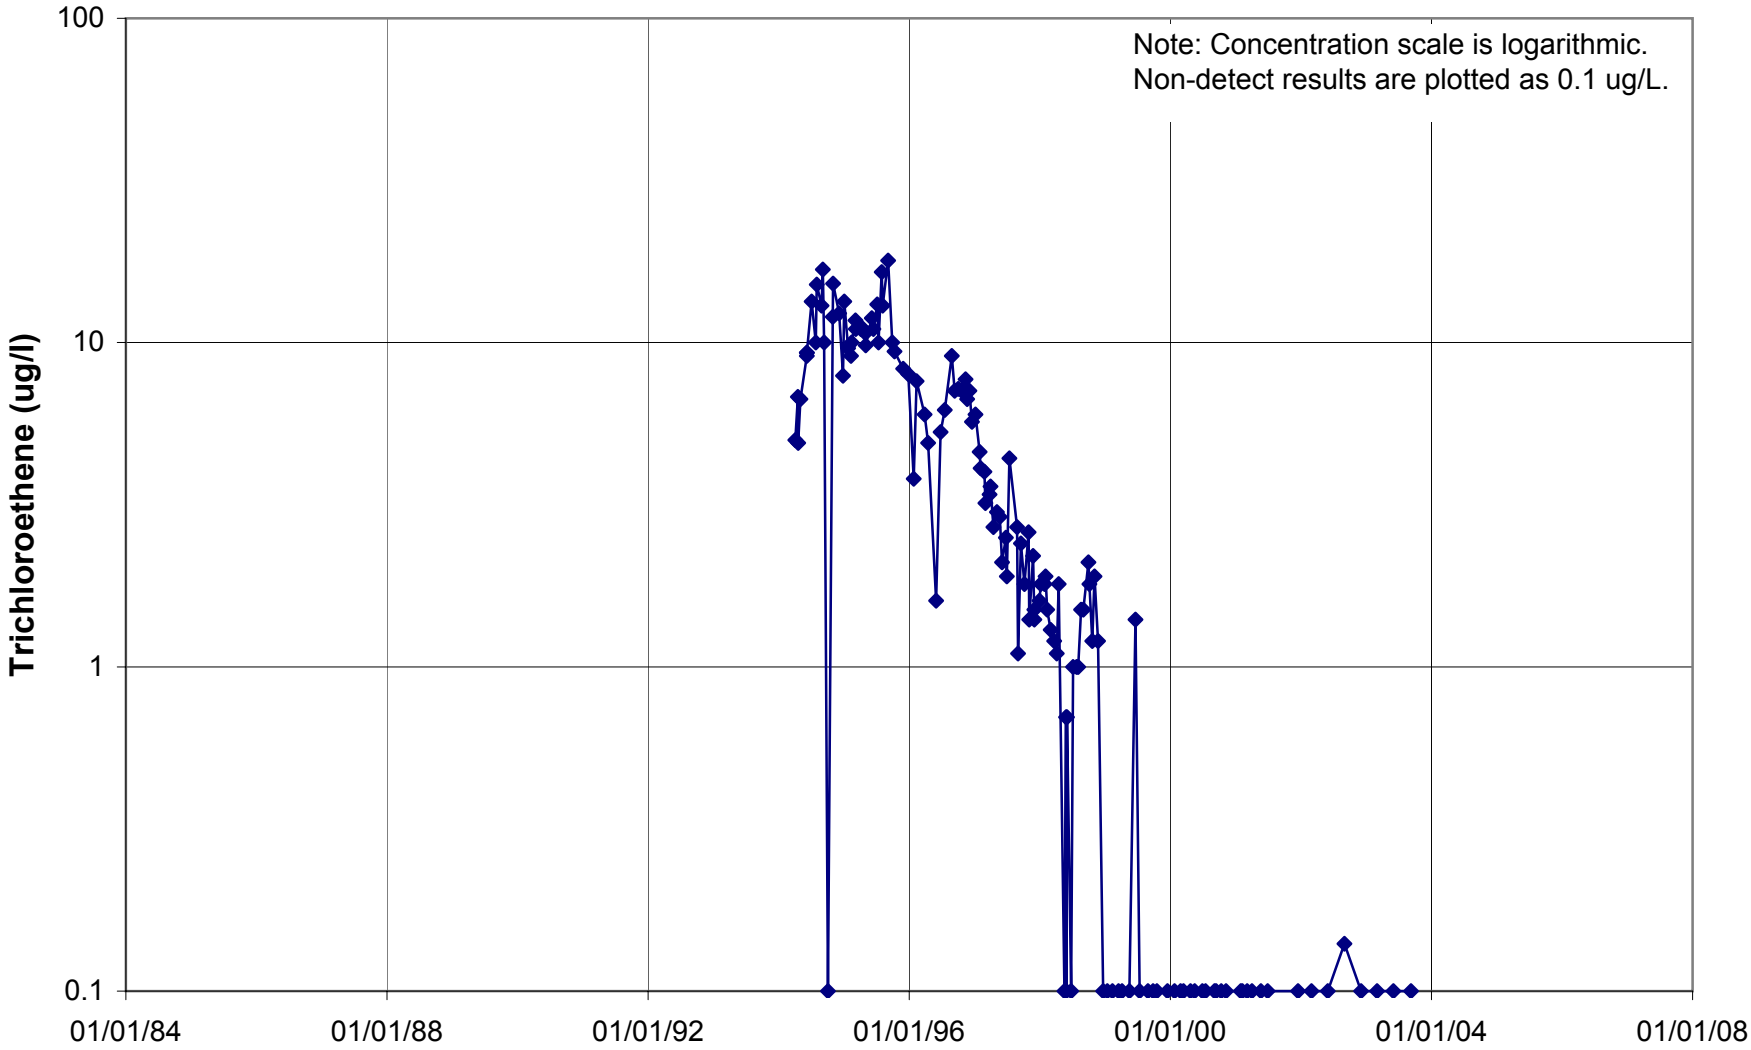

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

554216 (NBM#14)

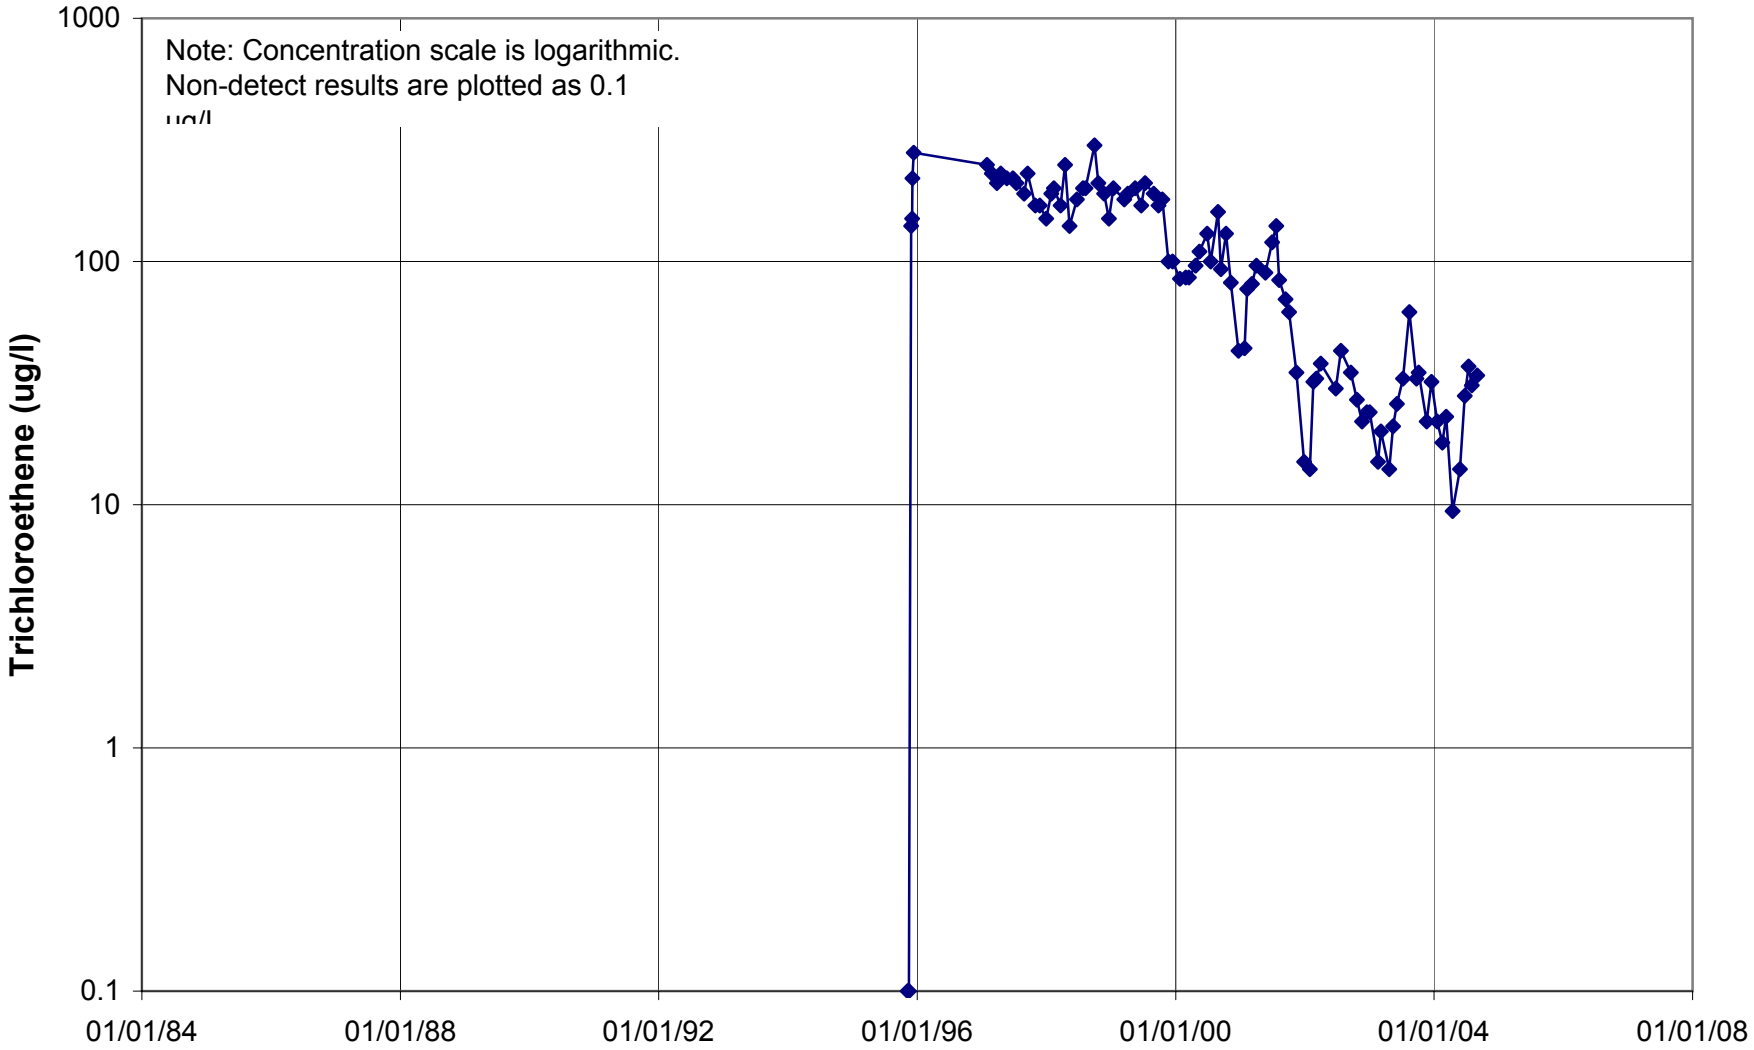

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

582628 (NBM#15)

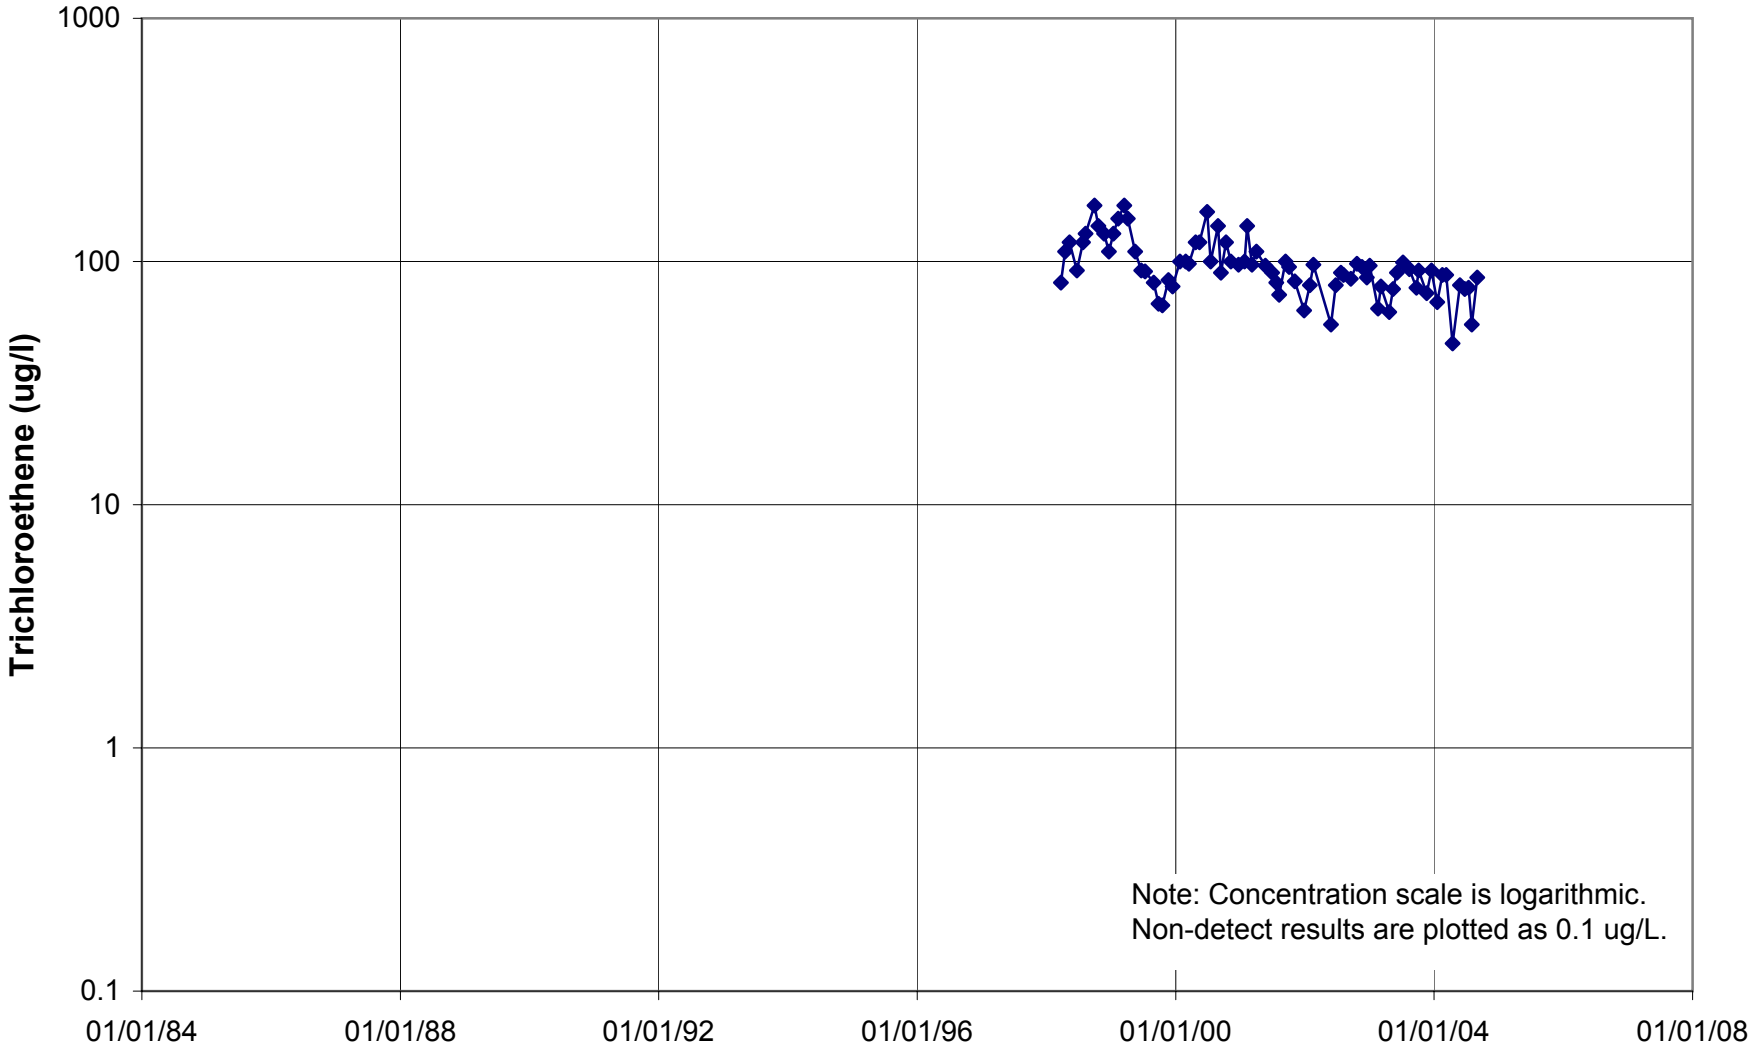

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

200524 (SAM#5)

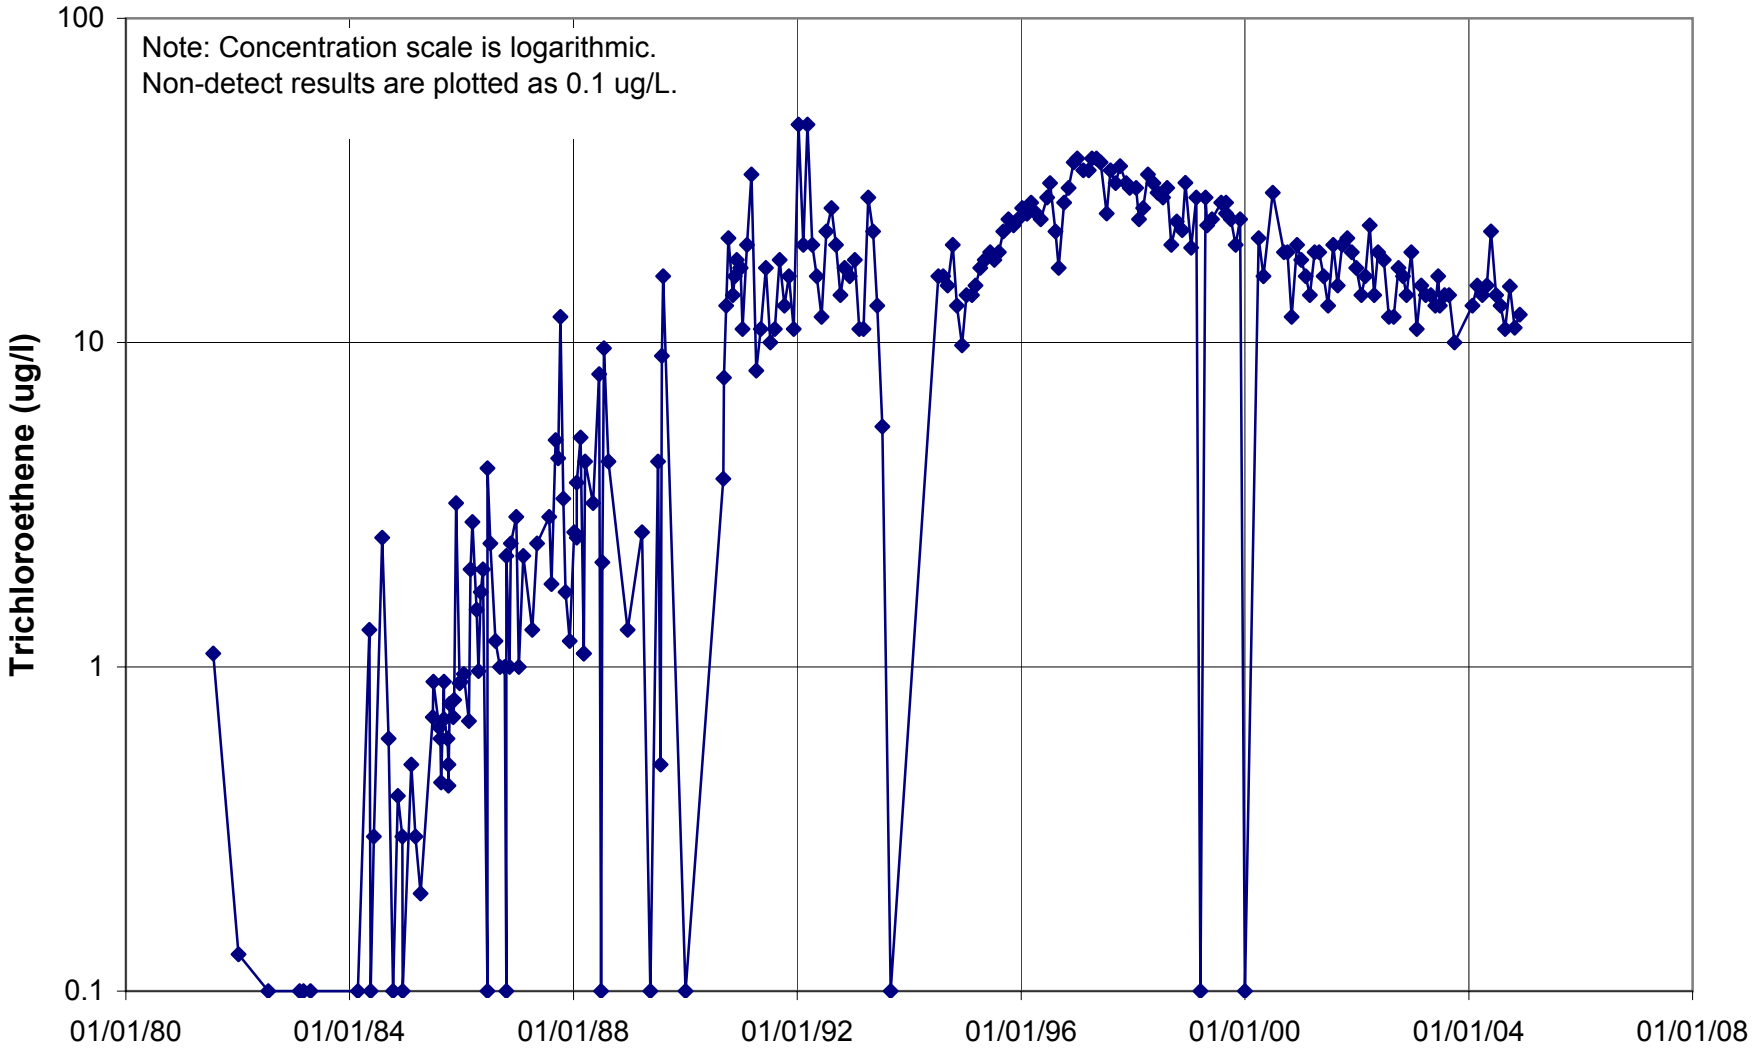

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

200803 (SAM#4)

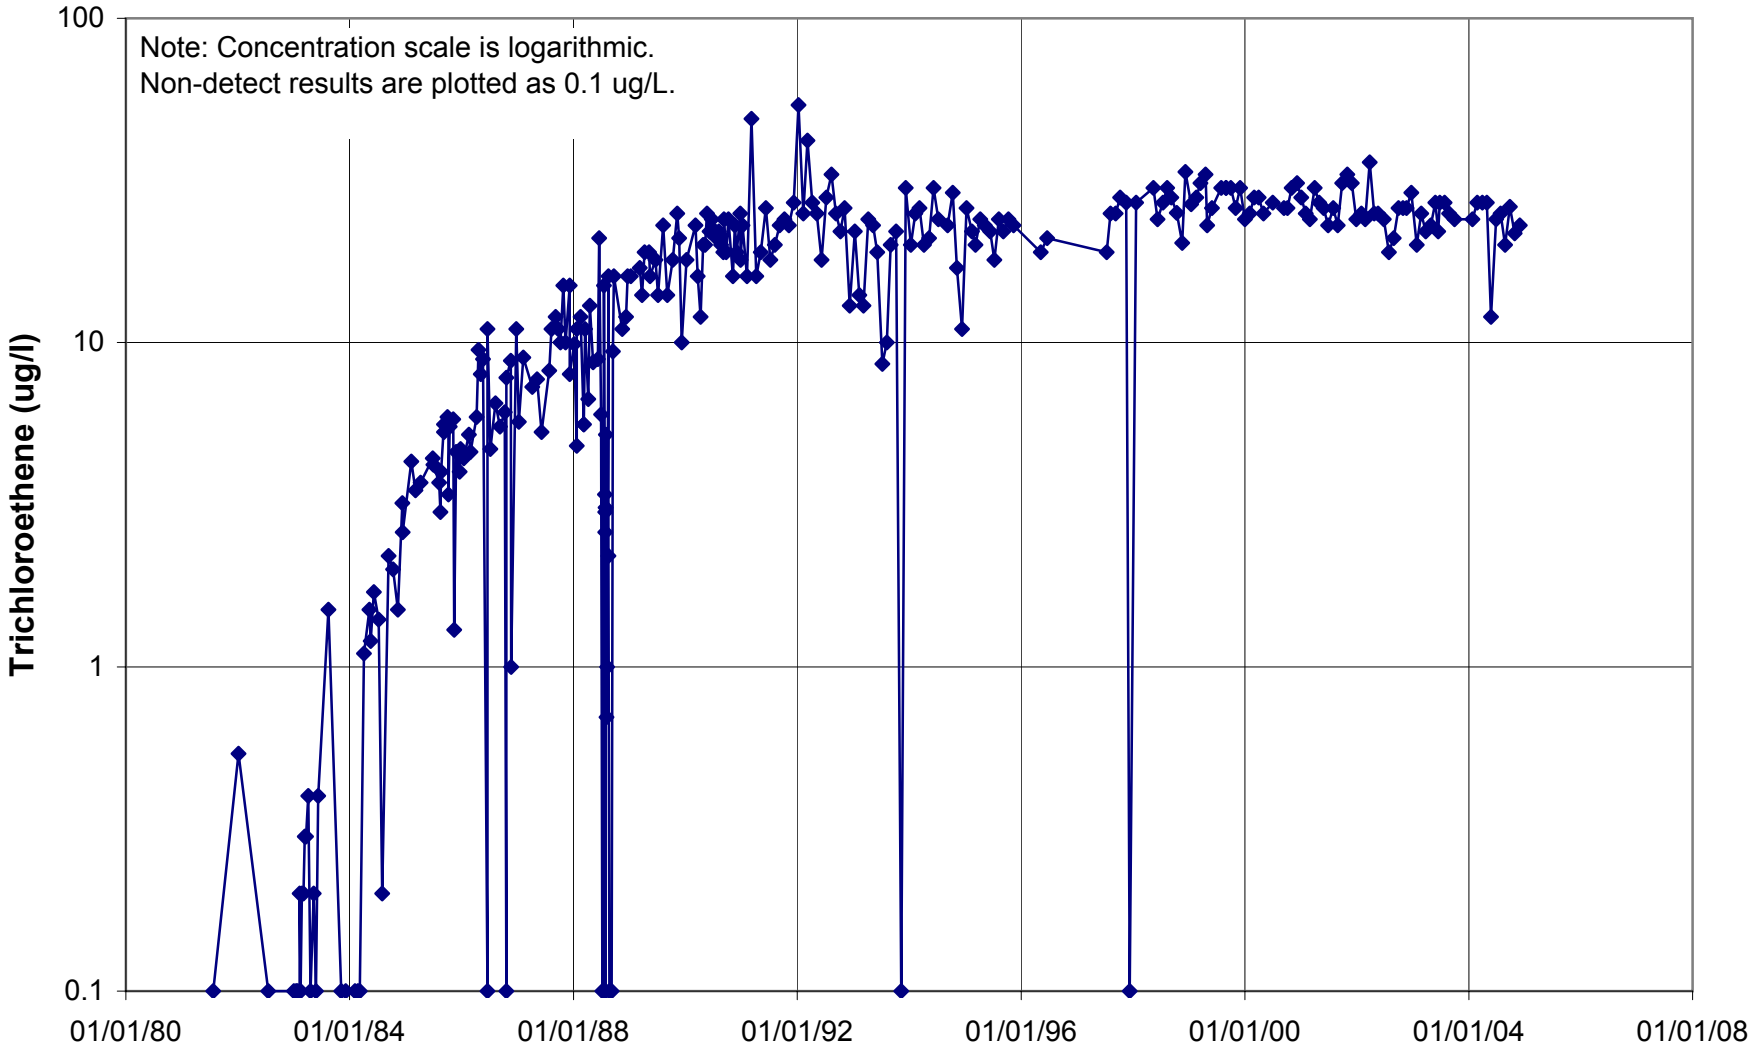

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

200804 (SAM#3)

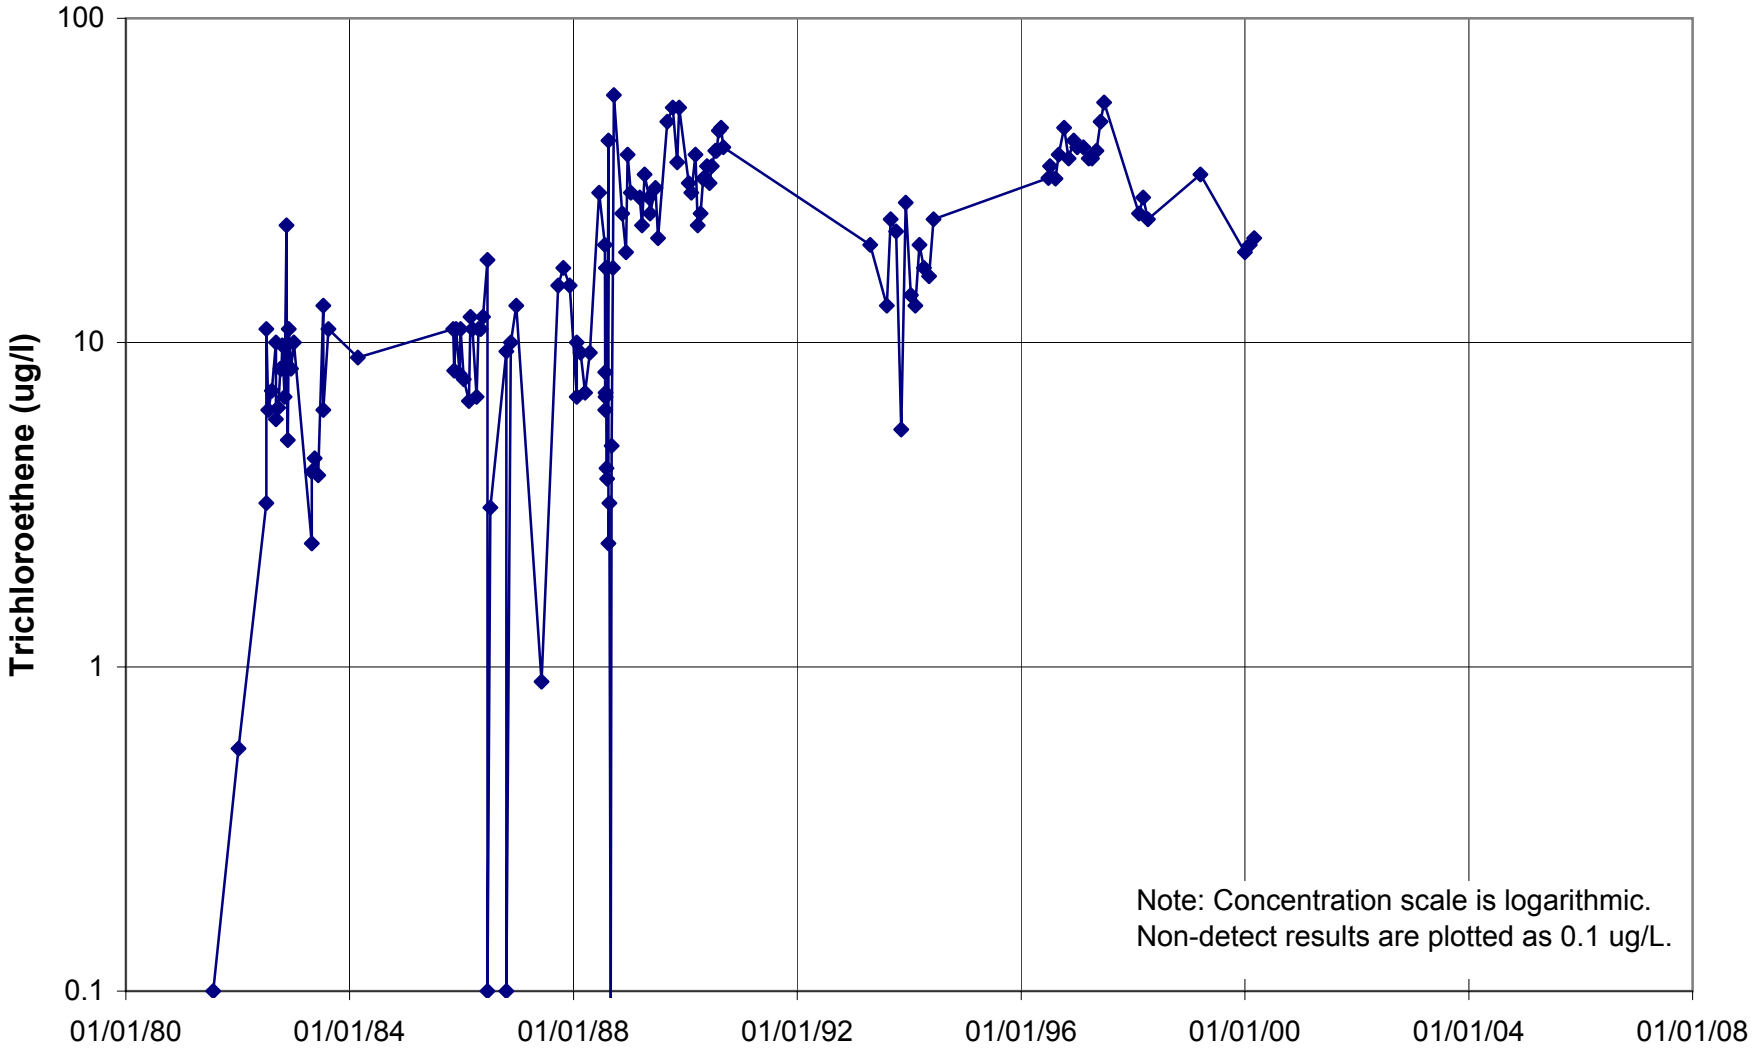

TO RETURN TO MAP: Click on "Go To Previous View" Button in the Tool Bar

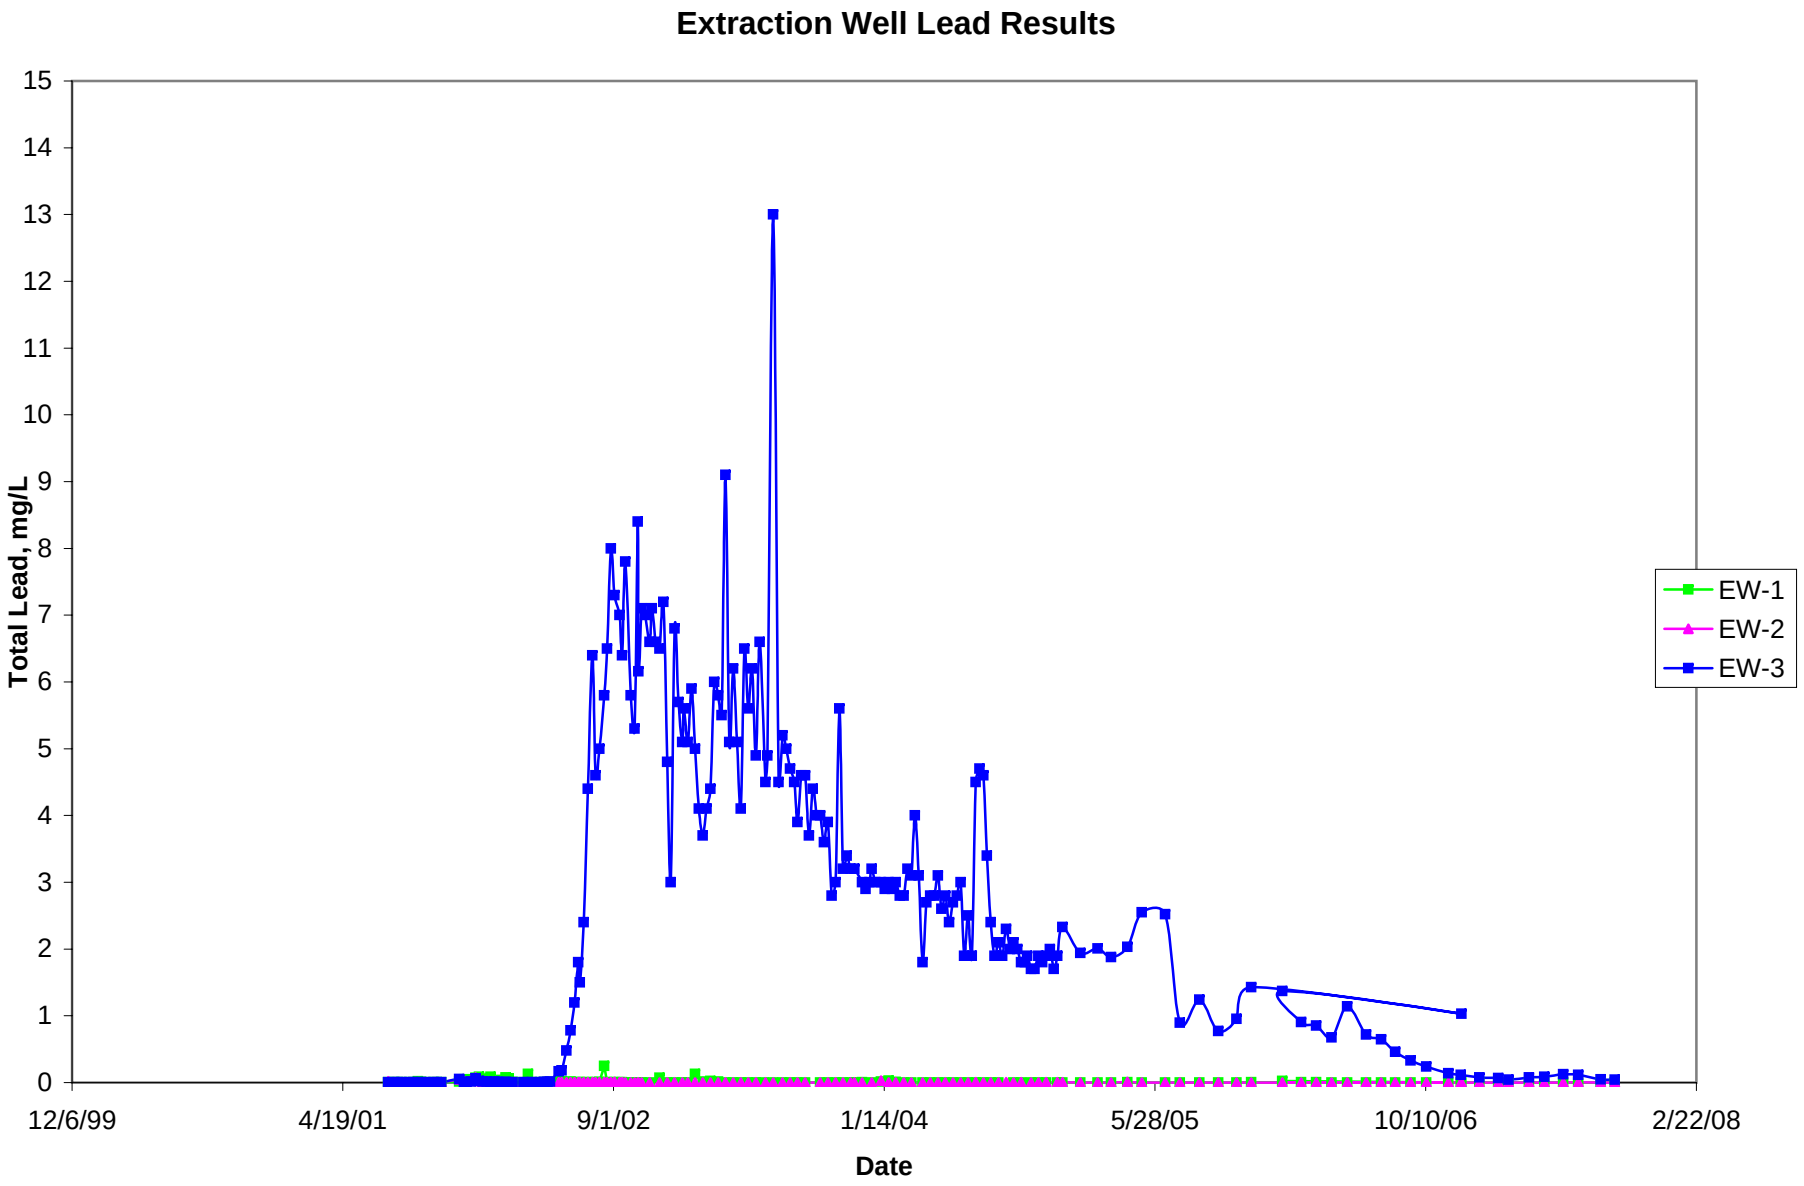
Extraction Well Lead Results
Total Lead, mg/L
15
14
13
12
11
10
9
8
7
6
5
4
3
2
1
0
12/6/99
4/19/01
9/1/02
1/14/04
5/28/05
10/10/06
2/22/08
Date
EW-1
EW-2
EW-3

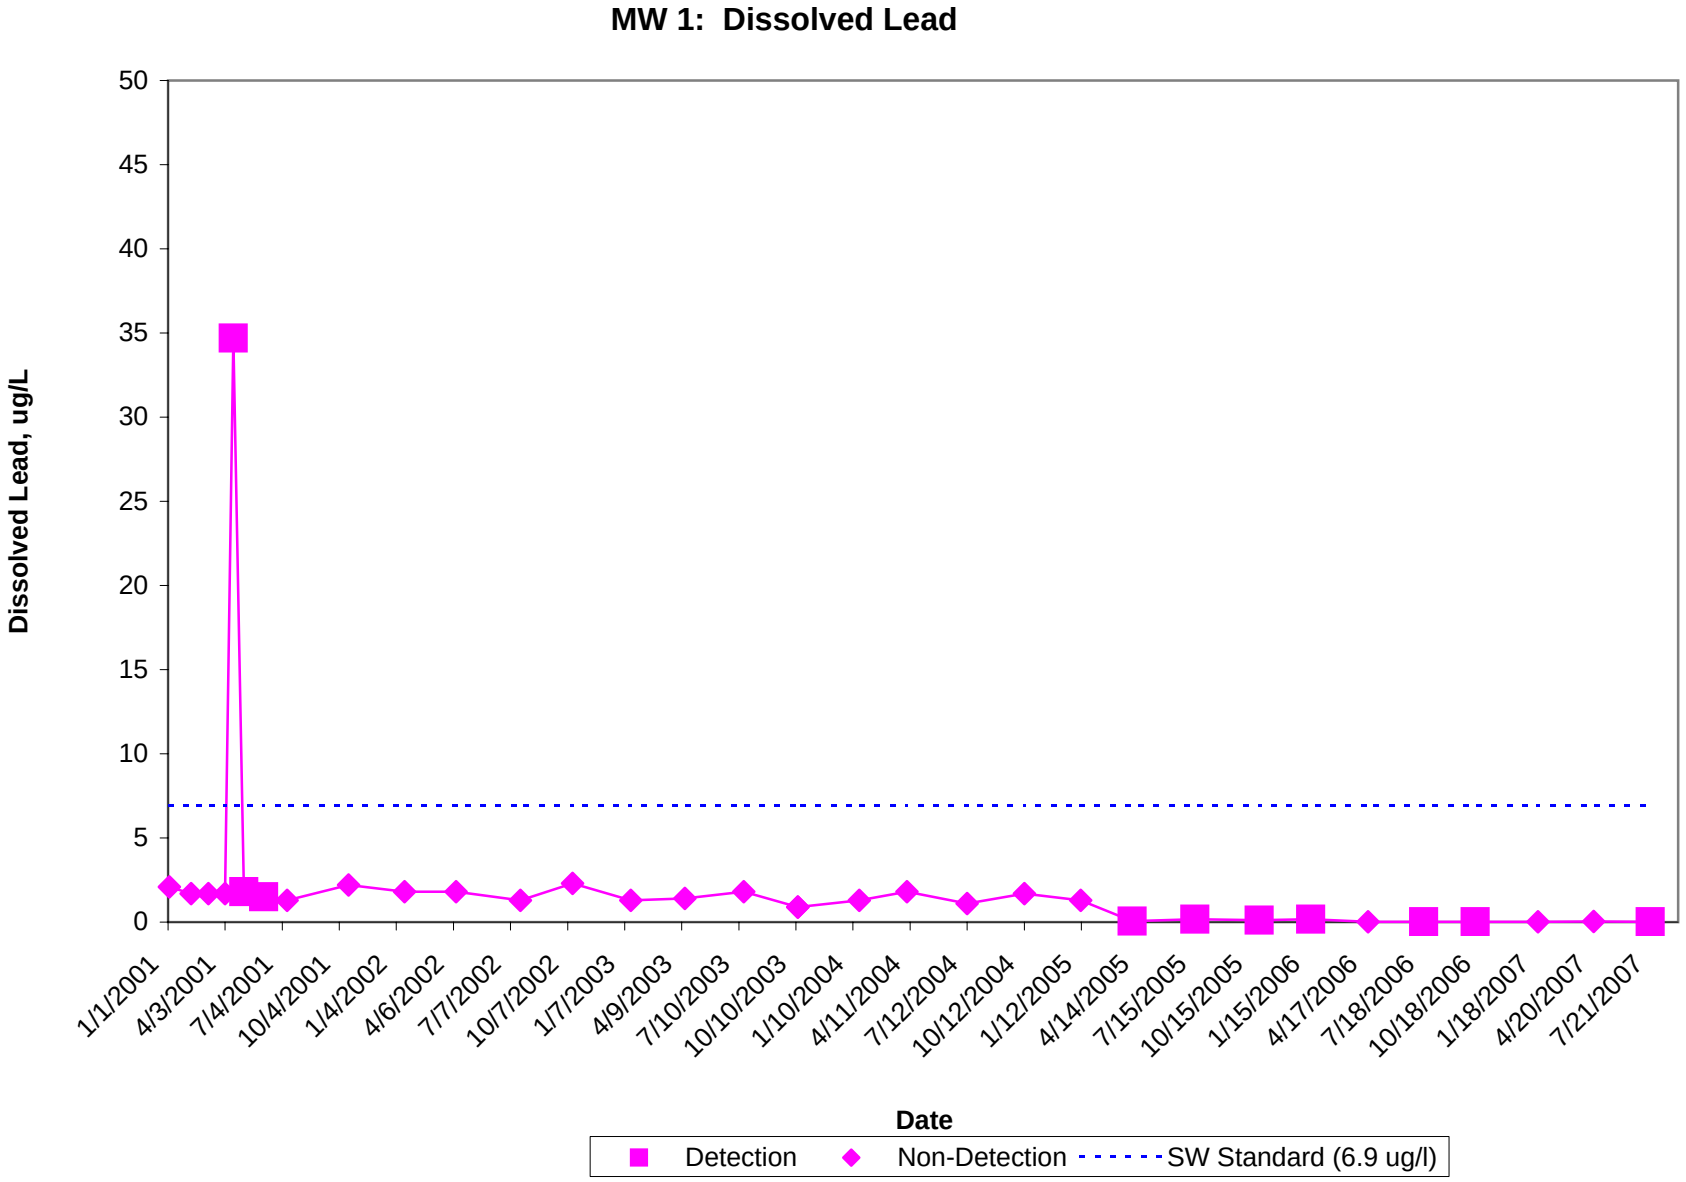
MW 1: Dissolved Lead
Dissolved Lead, ug/L
50
45
40
35
30
25
20
15
10
5
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

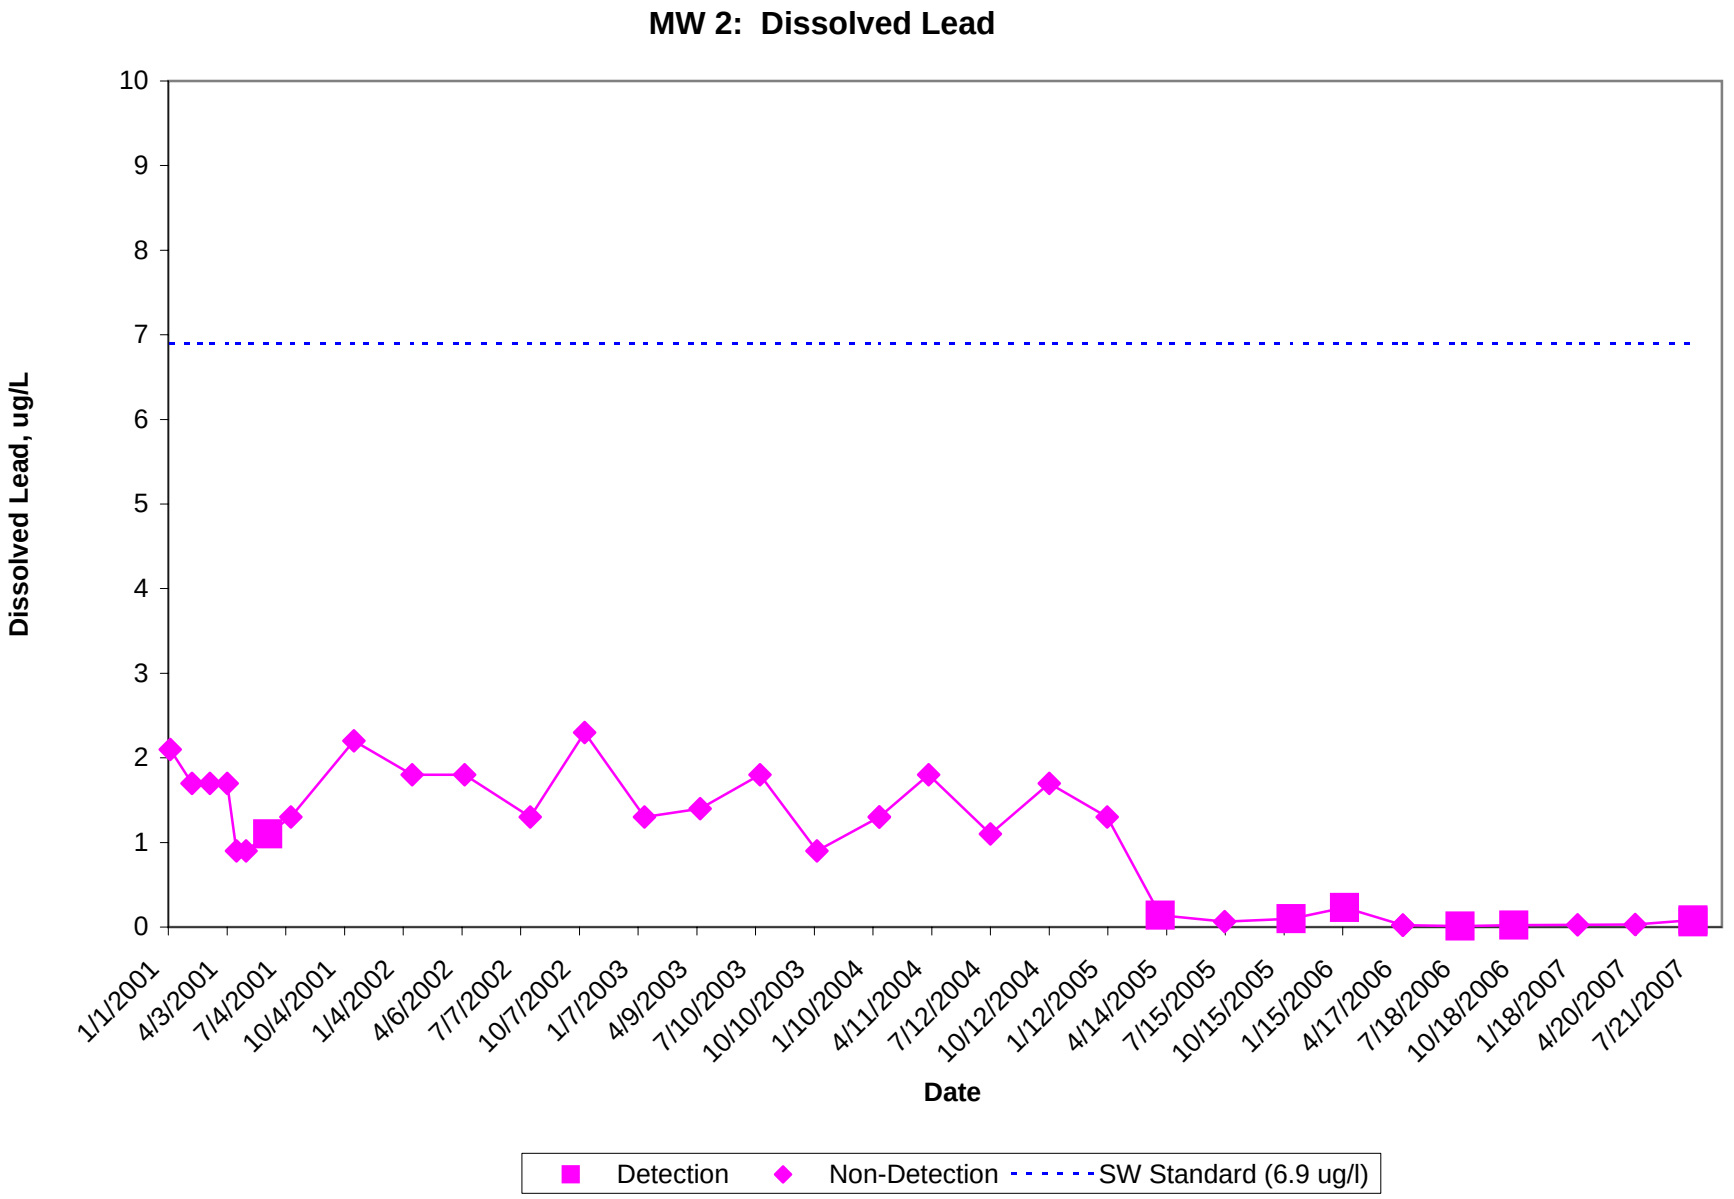
MW 2: Dissolved Lead
Dissolved Lead, ug/L
10
9
8
7
6
5
4
3
2
1
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

MW 3: Dissolved Lead

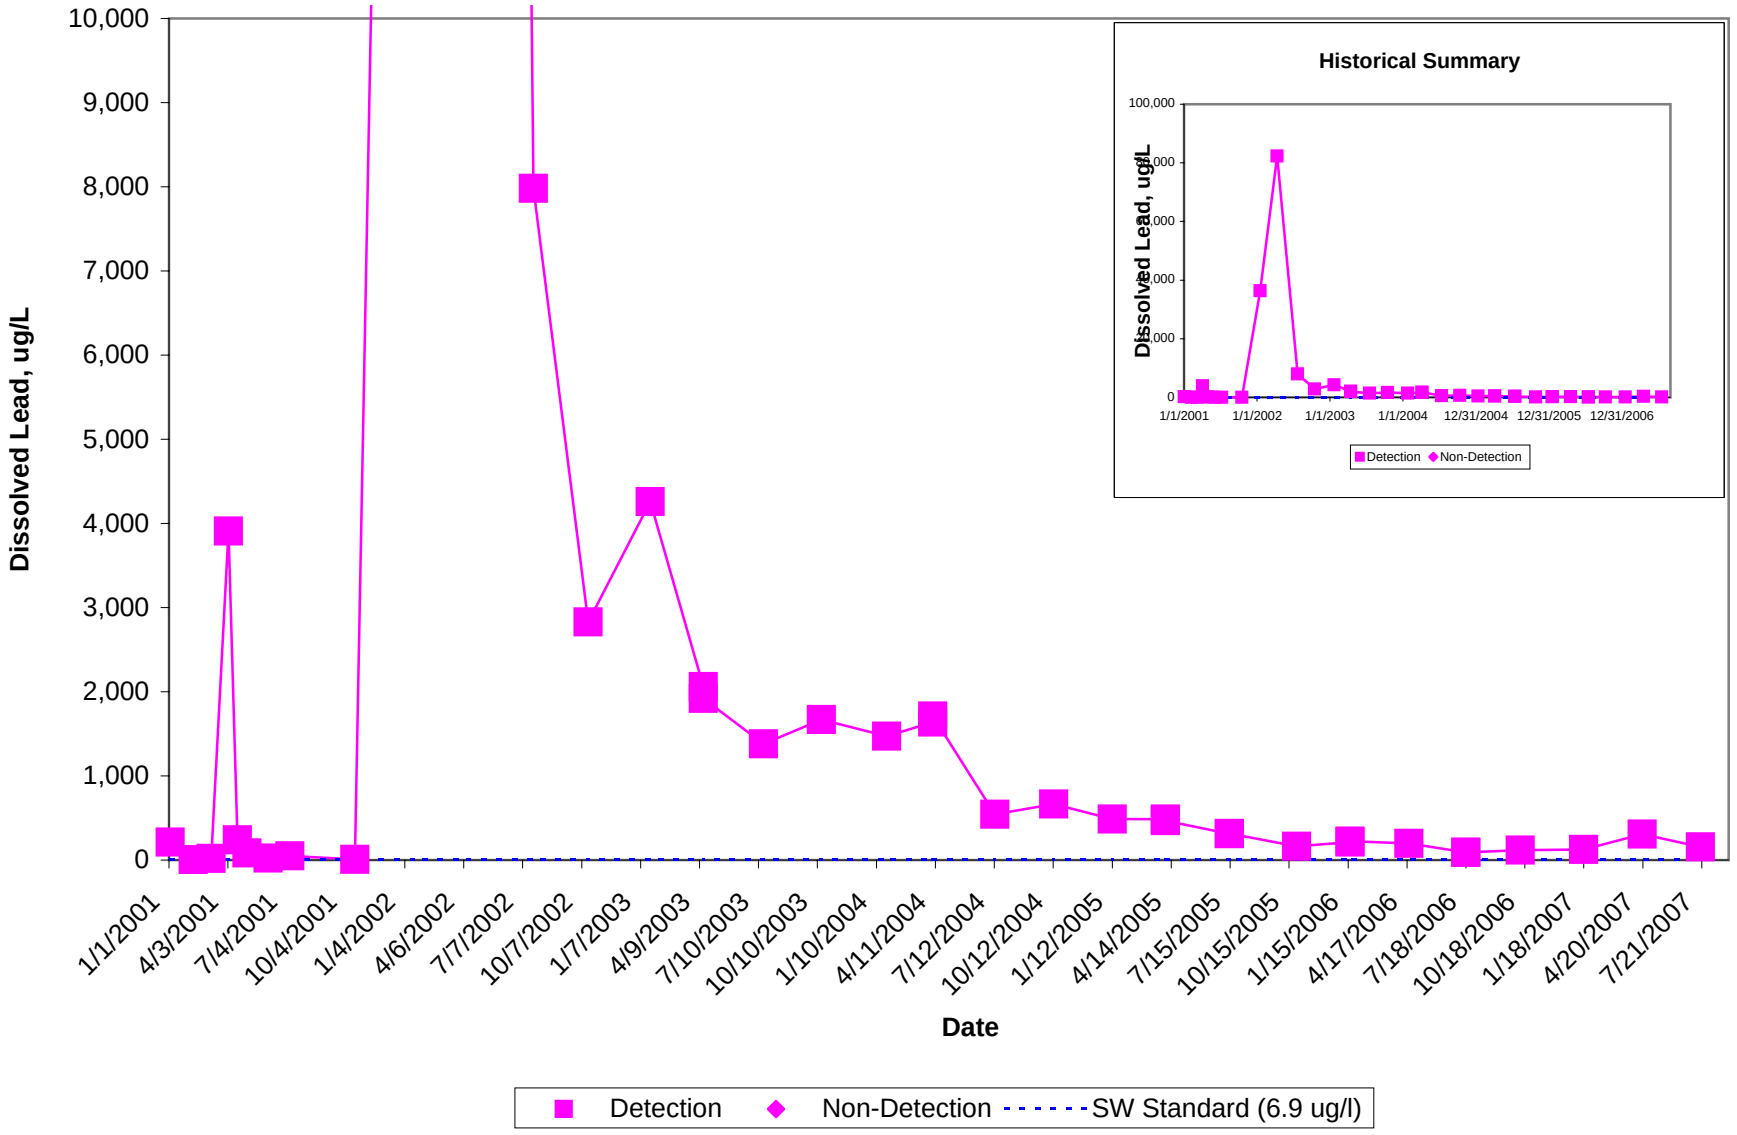

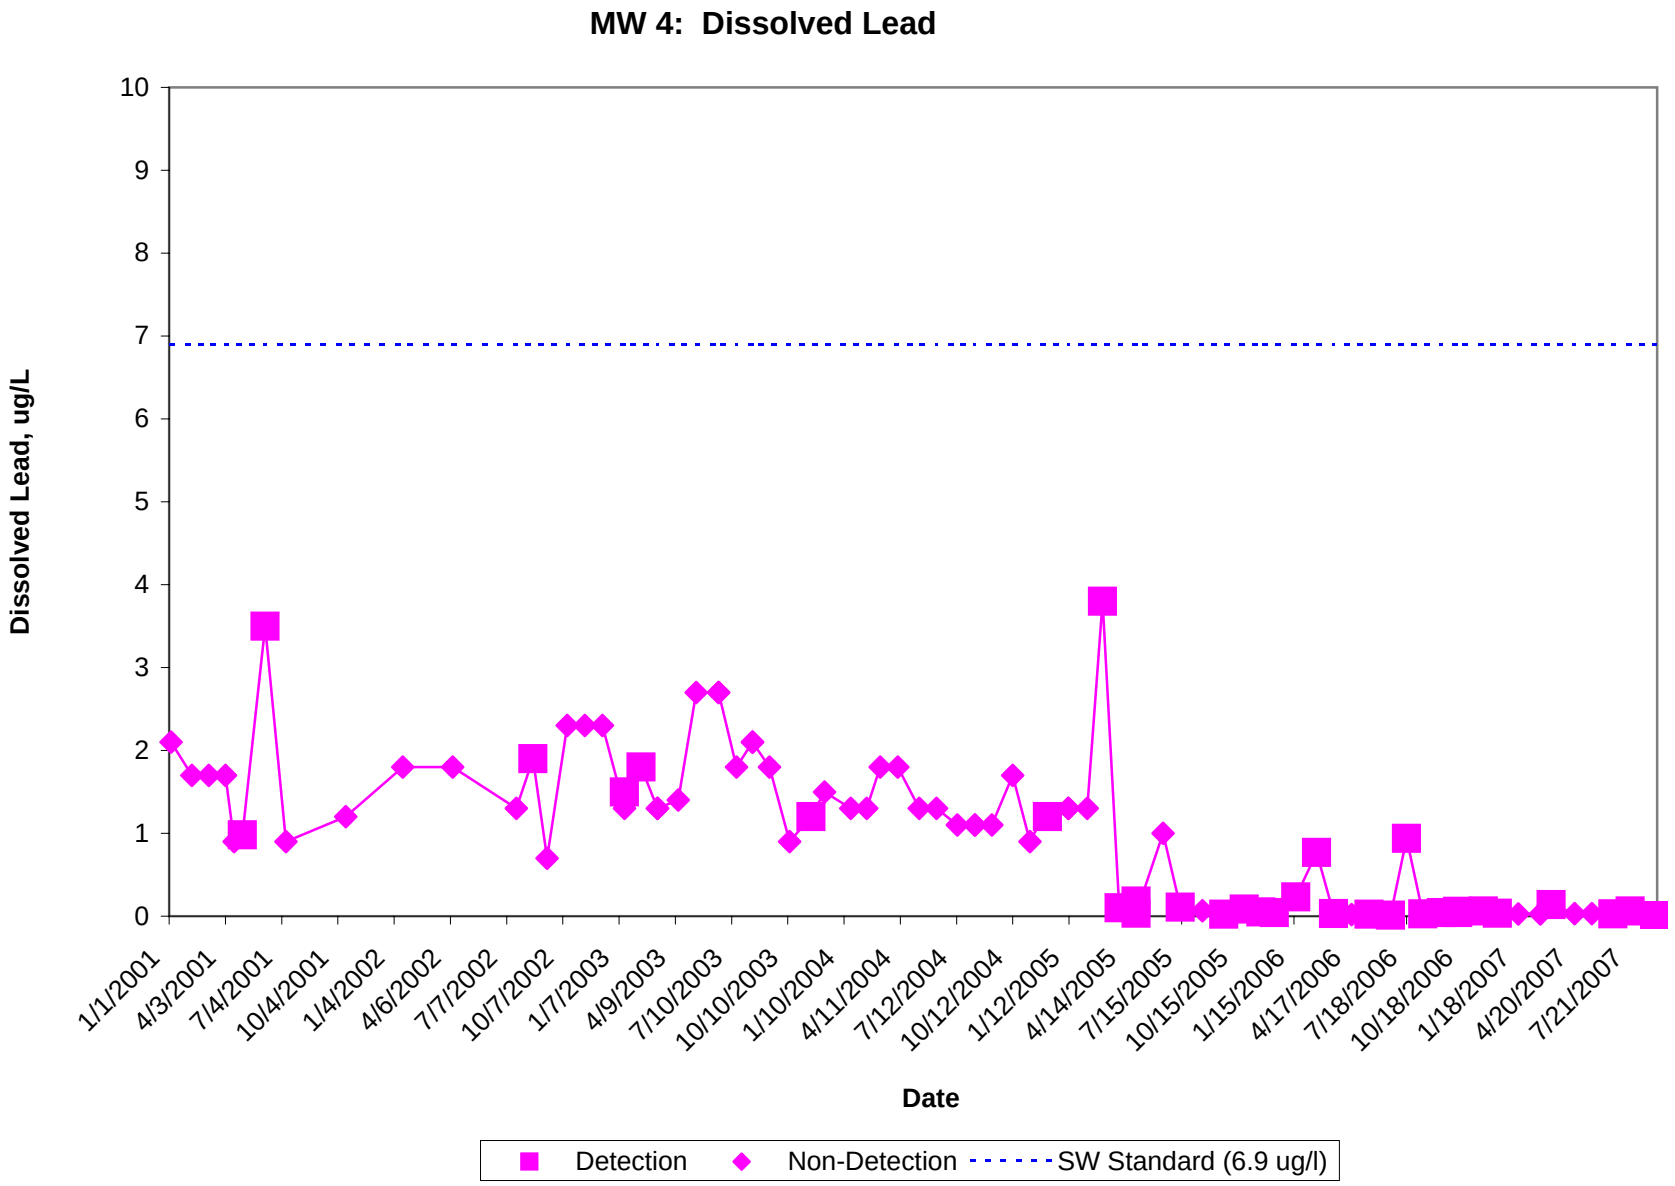
MW 4: Dissolved Lead
Dissolved Lead, ug/L
10
9
8
7
6
5
4
3
2
1
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

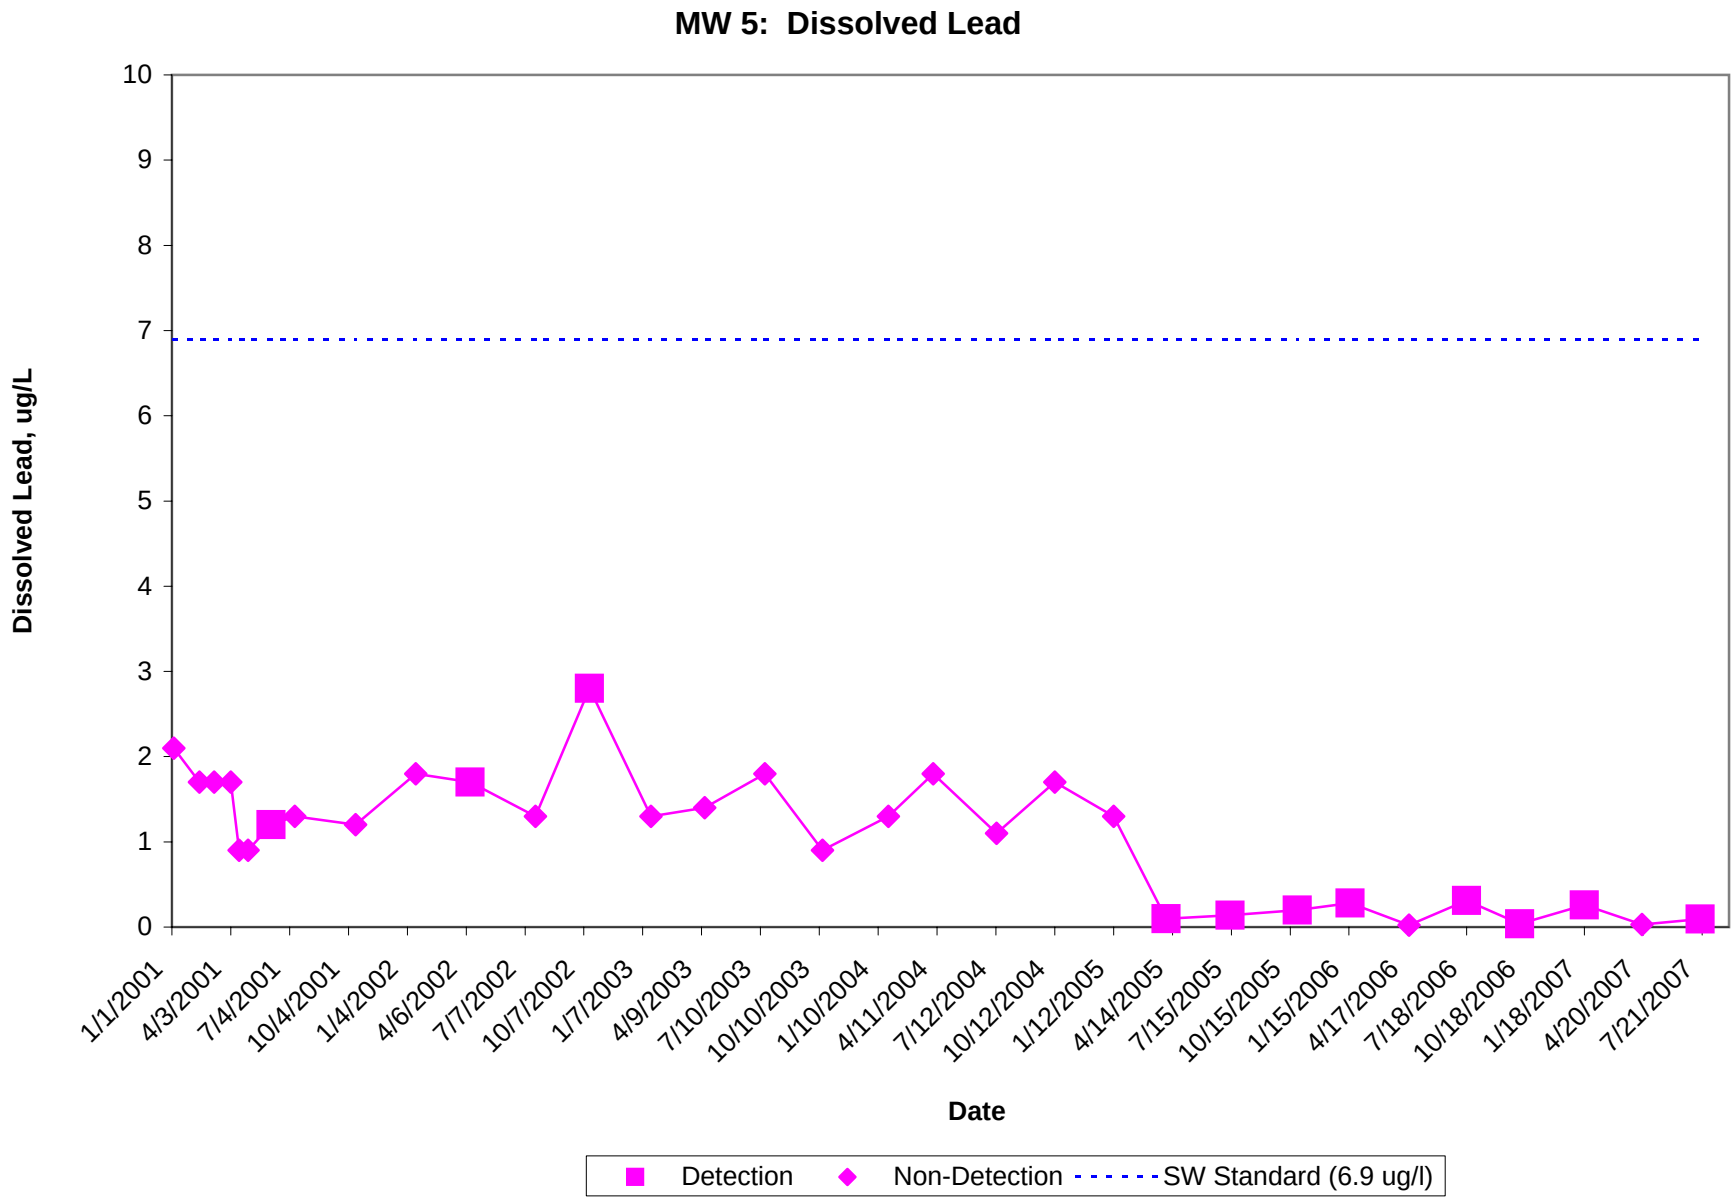
MW 5: Dissolved Lead
Dissolved Lead, ug/L
10
9
8
7
6
5
4
3
2
1
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

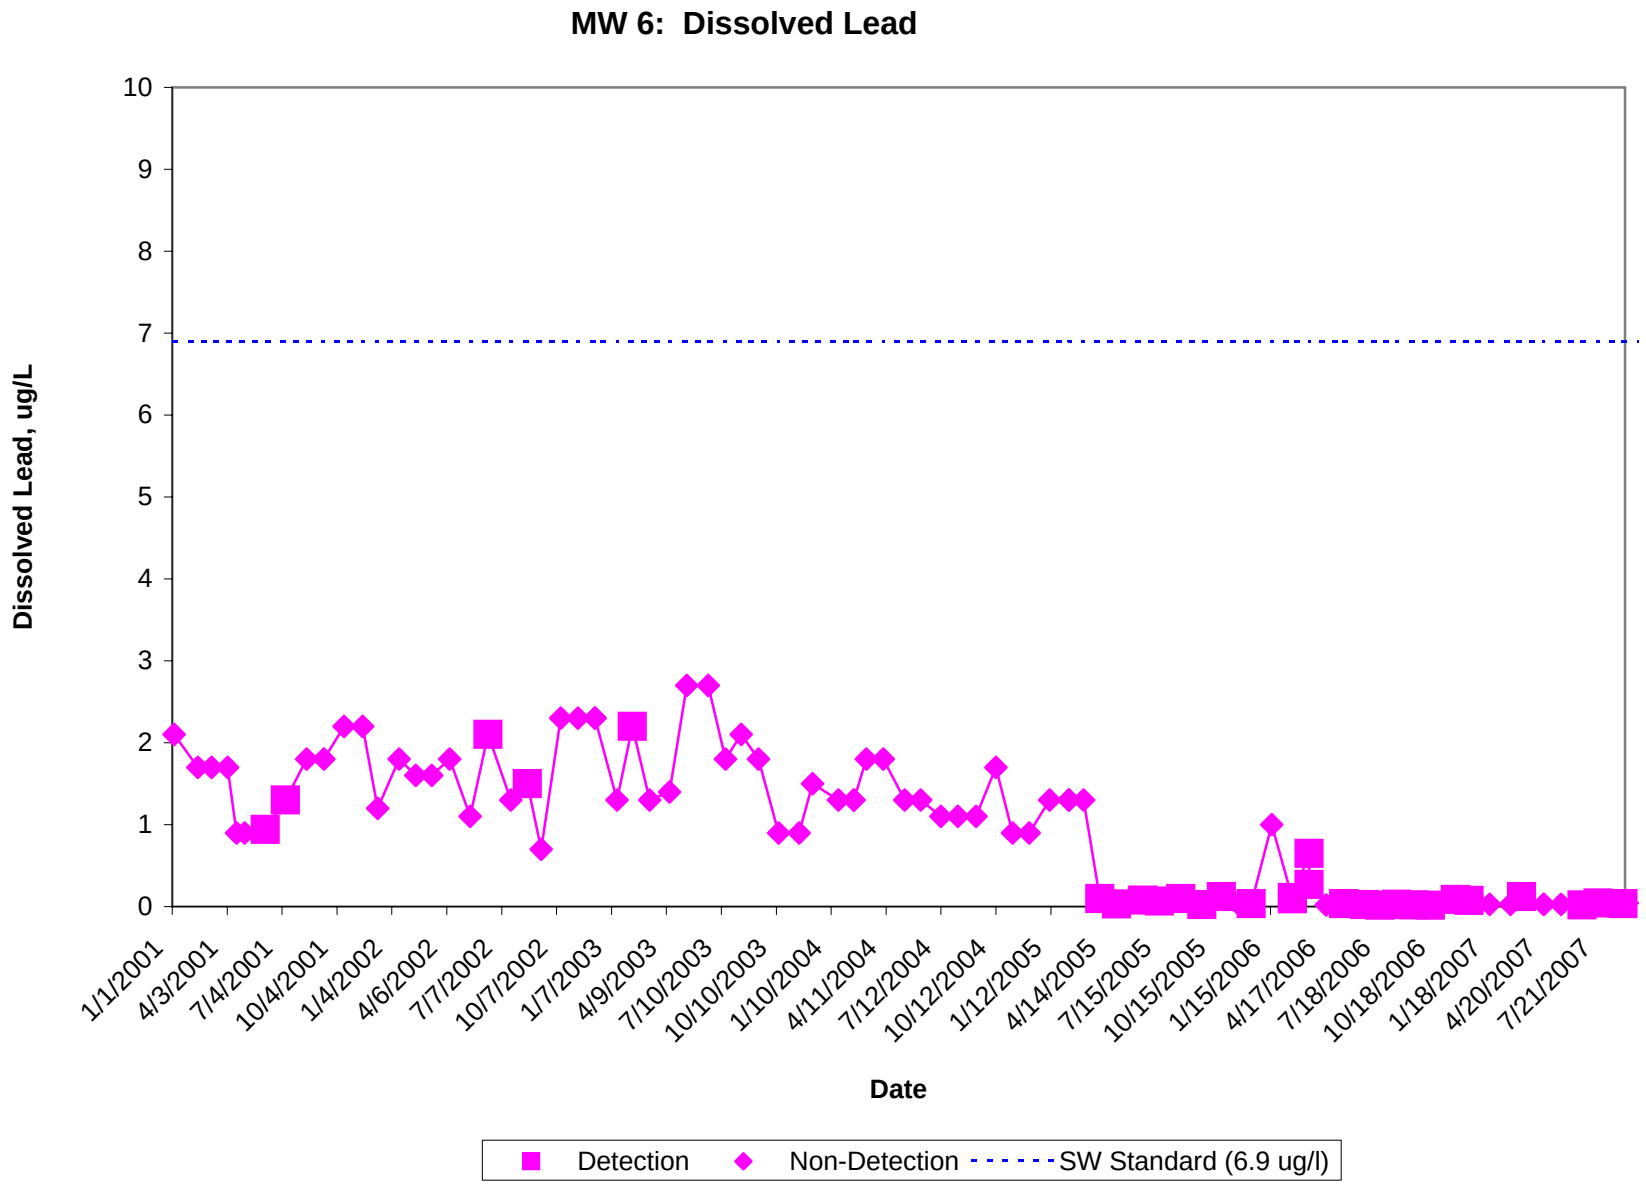
MW 6: Dissolved Lead
Dissolved Lead, ug/L
10
9
8
7
6
5
4
3
2
1
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

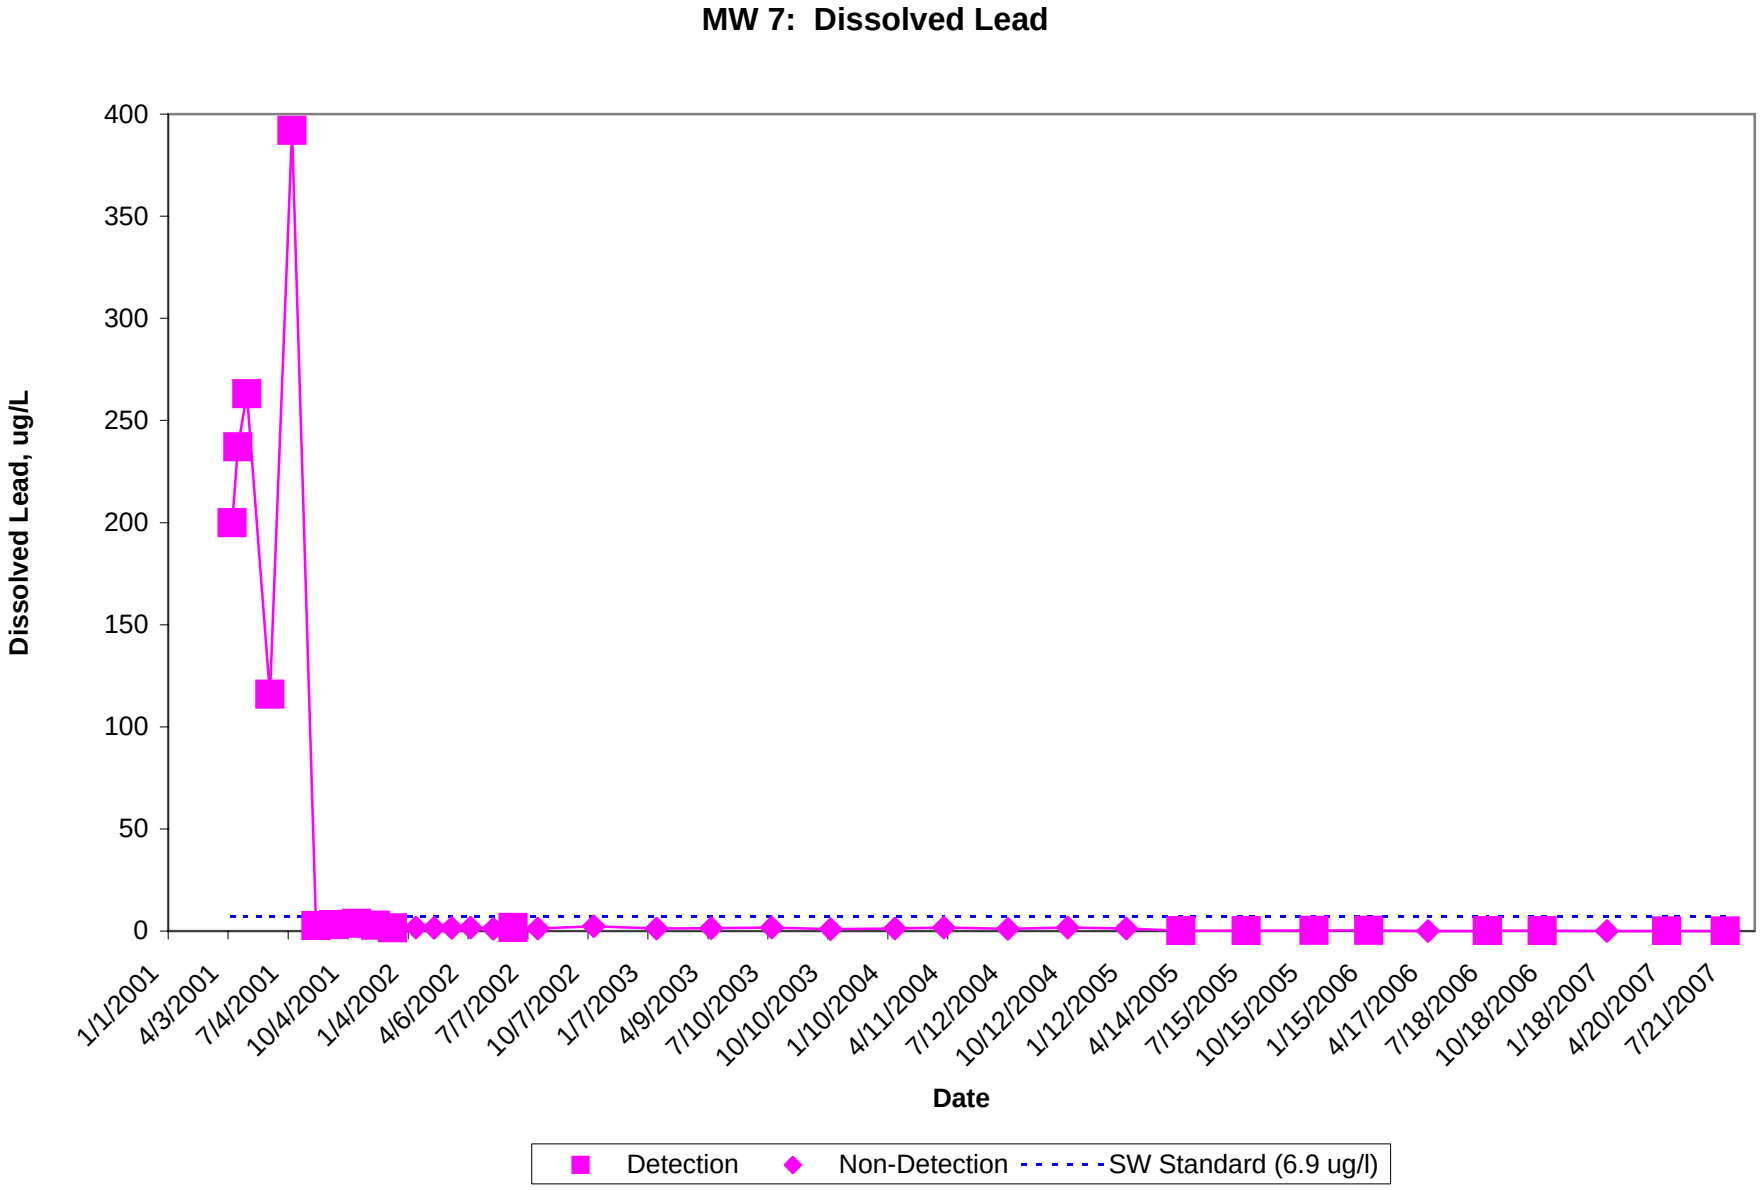
MW 7: Dissolved Lead
Dissolved Lead, ug/L
400
350
300
250
200
150
100
50
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

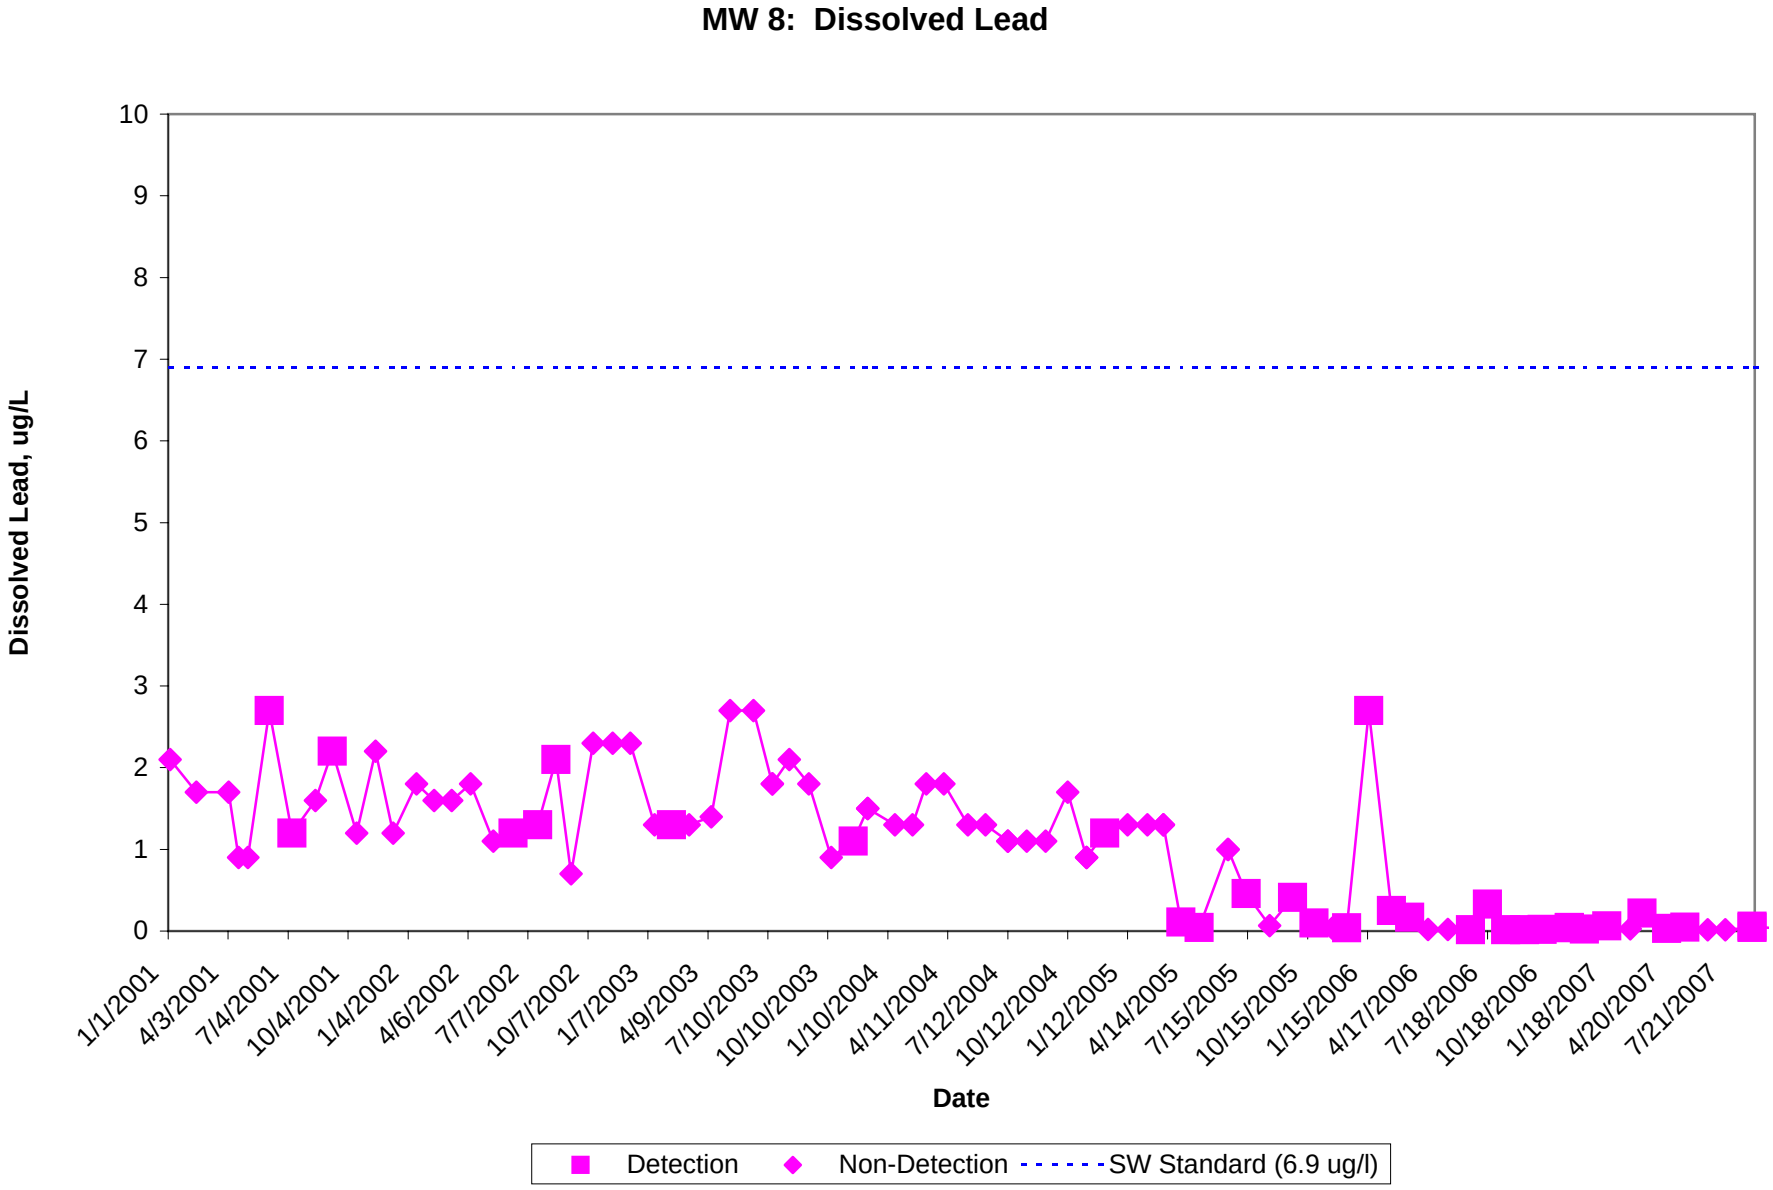
MW 8: Dissolved Lead
Dissolved Lead, ug/L
10
9
8
7
6
5
4
3
2
1
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

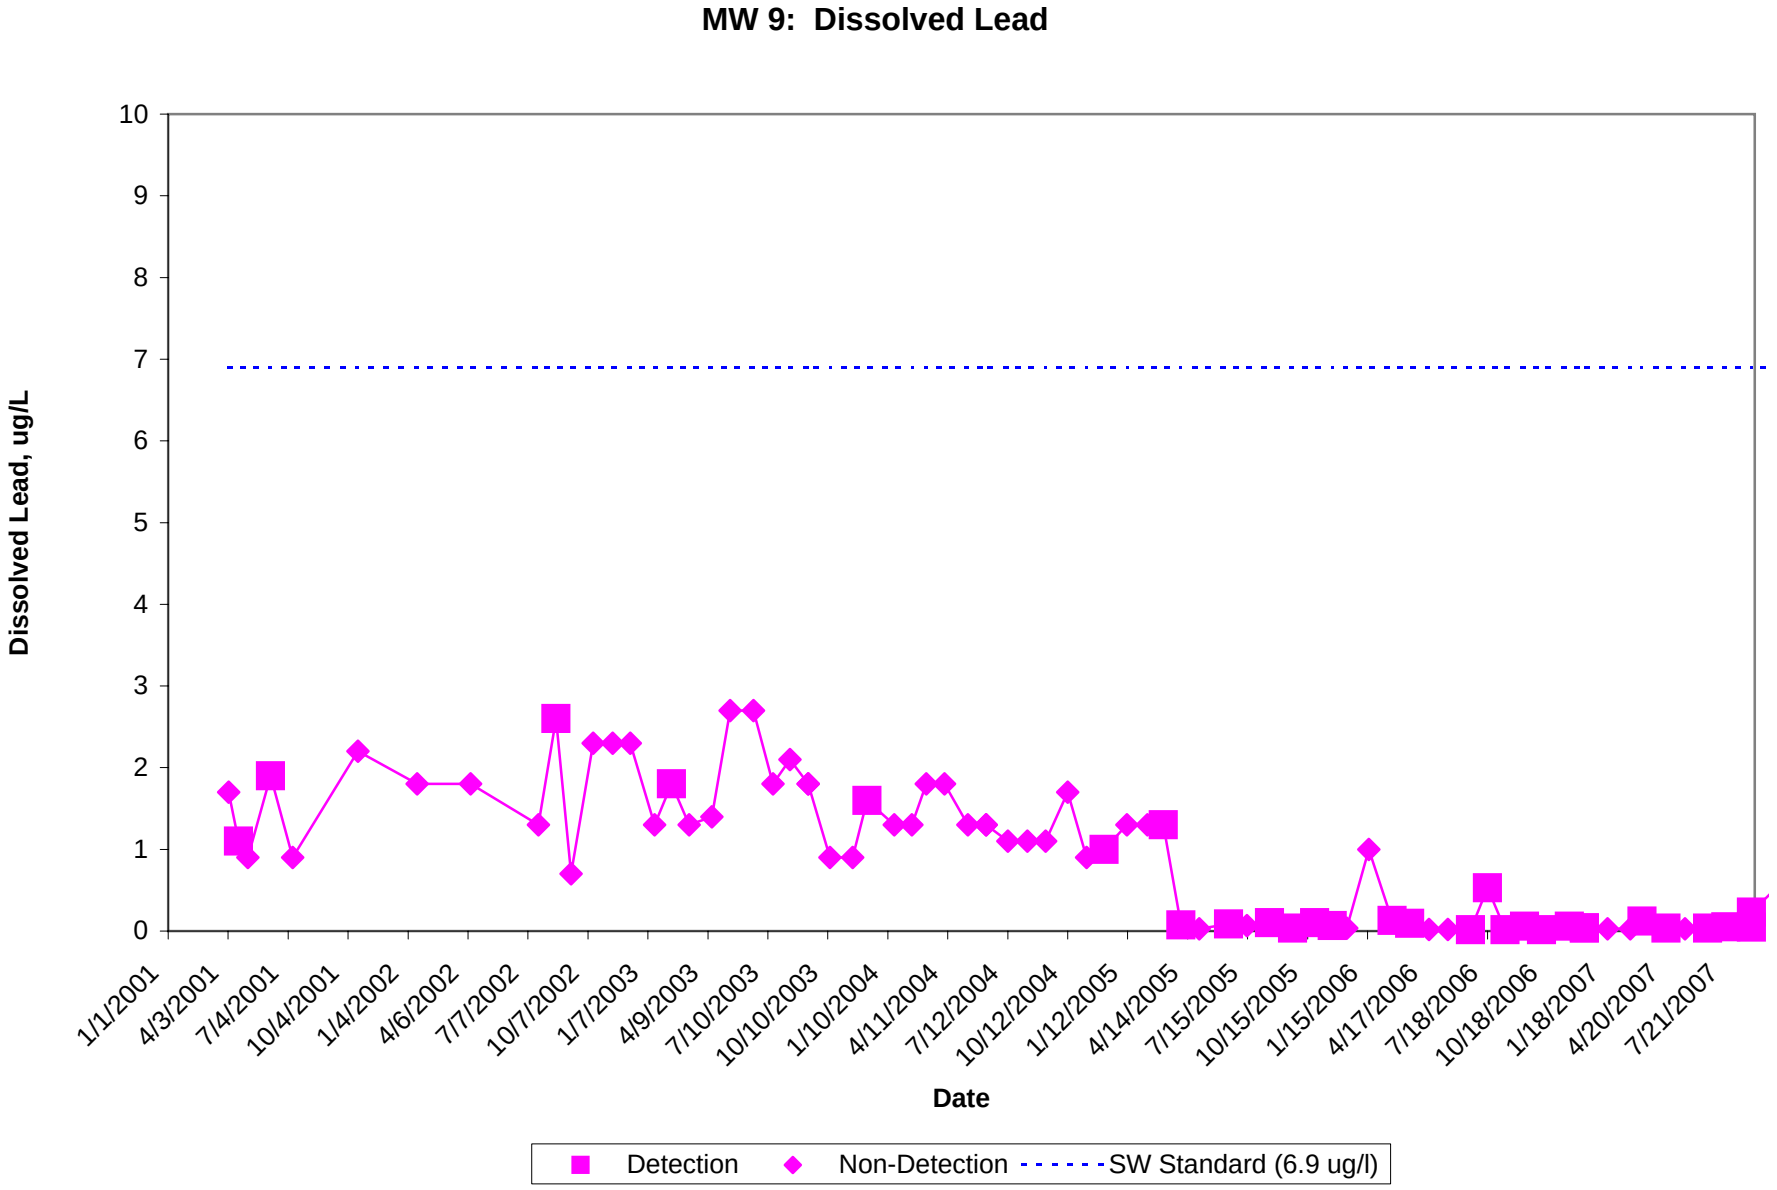
MW 9: Dissolved Lead
Dissolved Lead, ug/L
10
9
8
7
6
5
4
3
2
1
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

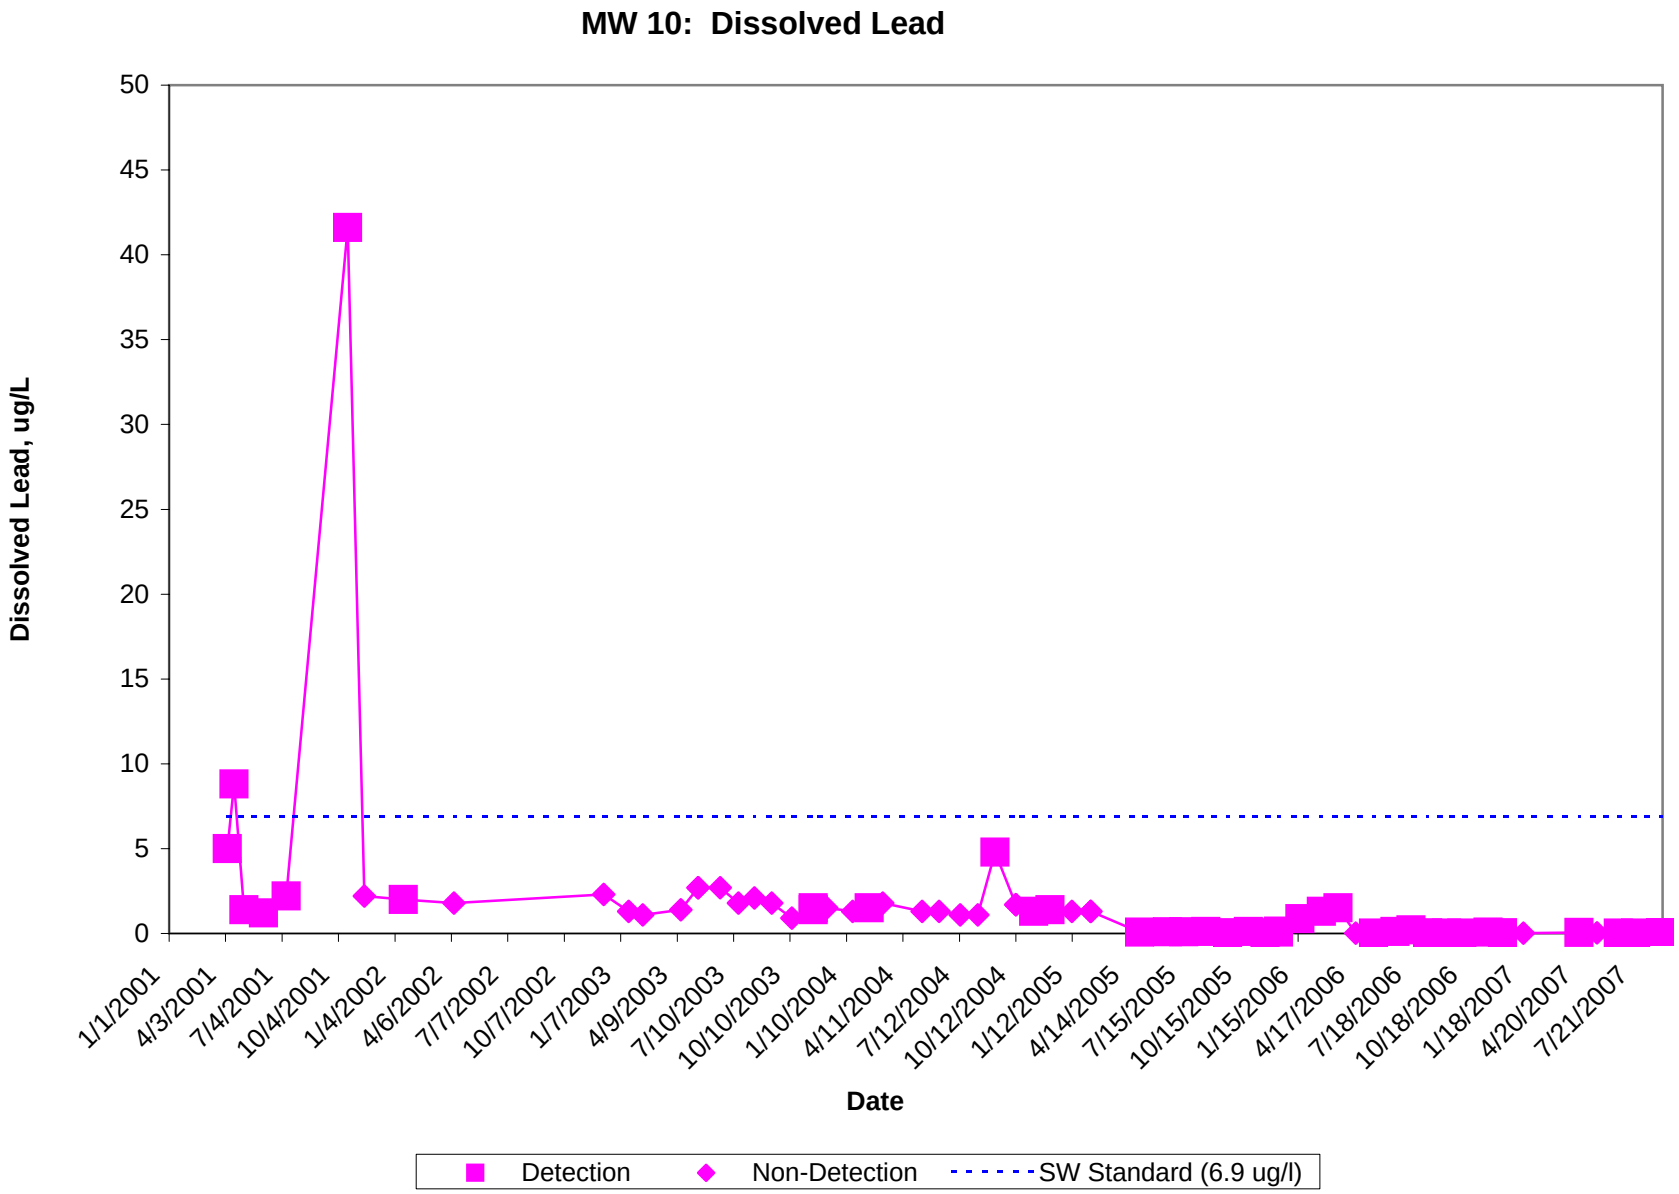
MW 10: Dissolved Lead
Dissolved Lead, ug/L
50
45
40
35
30
25
20
15
10
5
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

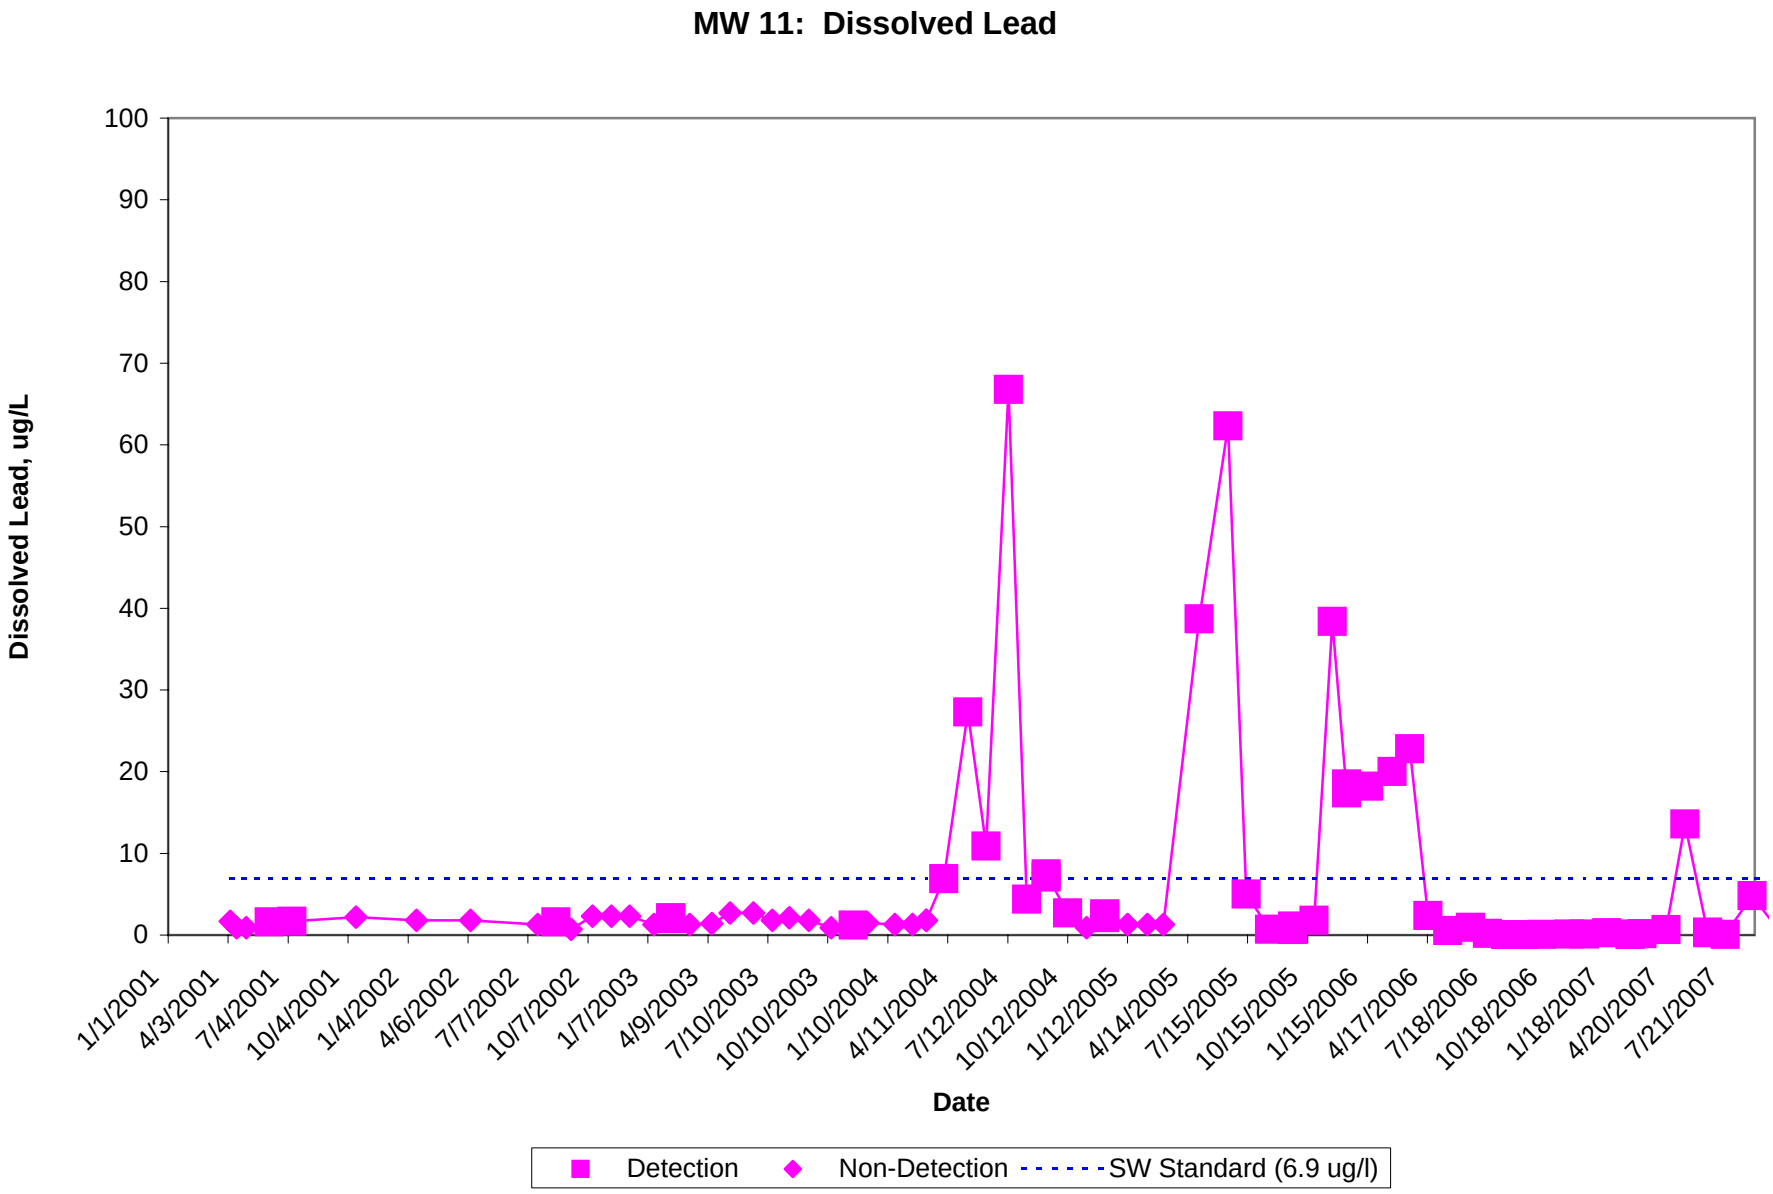
MW 11: Dissolved Lead
Dissolved Lead, ug/L
100
90
80
70
60
50
40
30
20
10
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

MW 12: Dissolved Lead

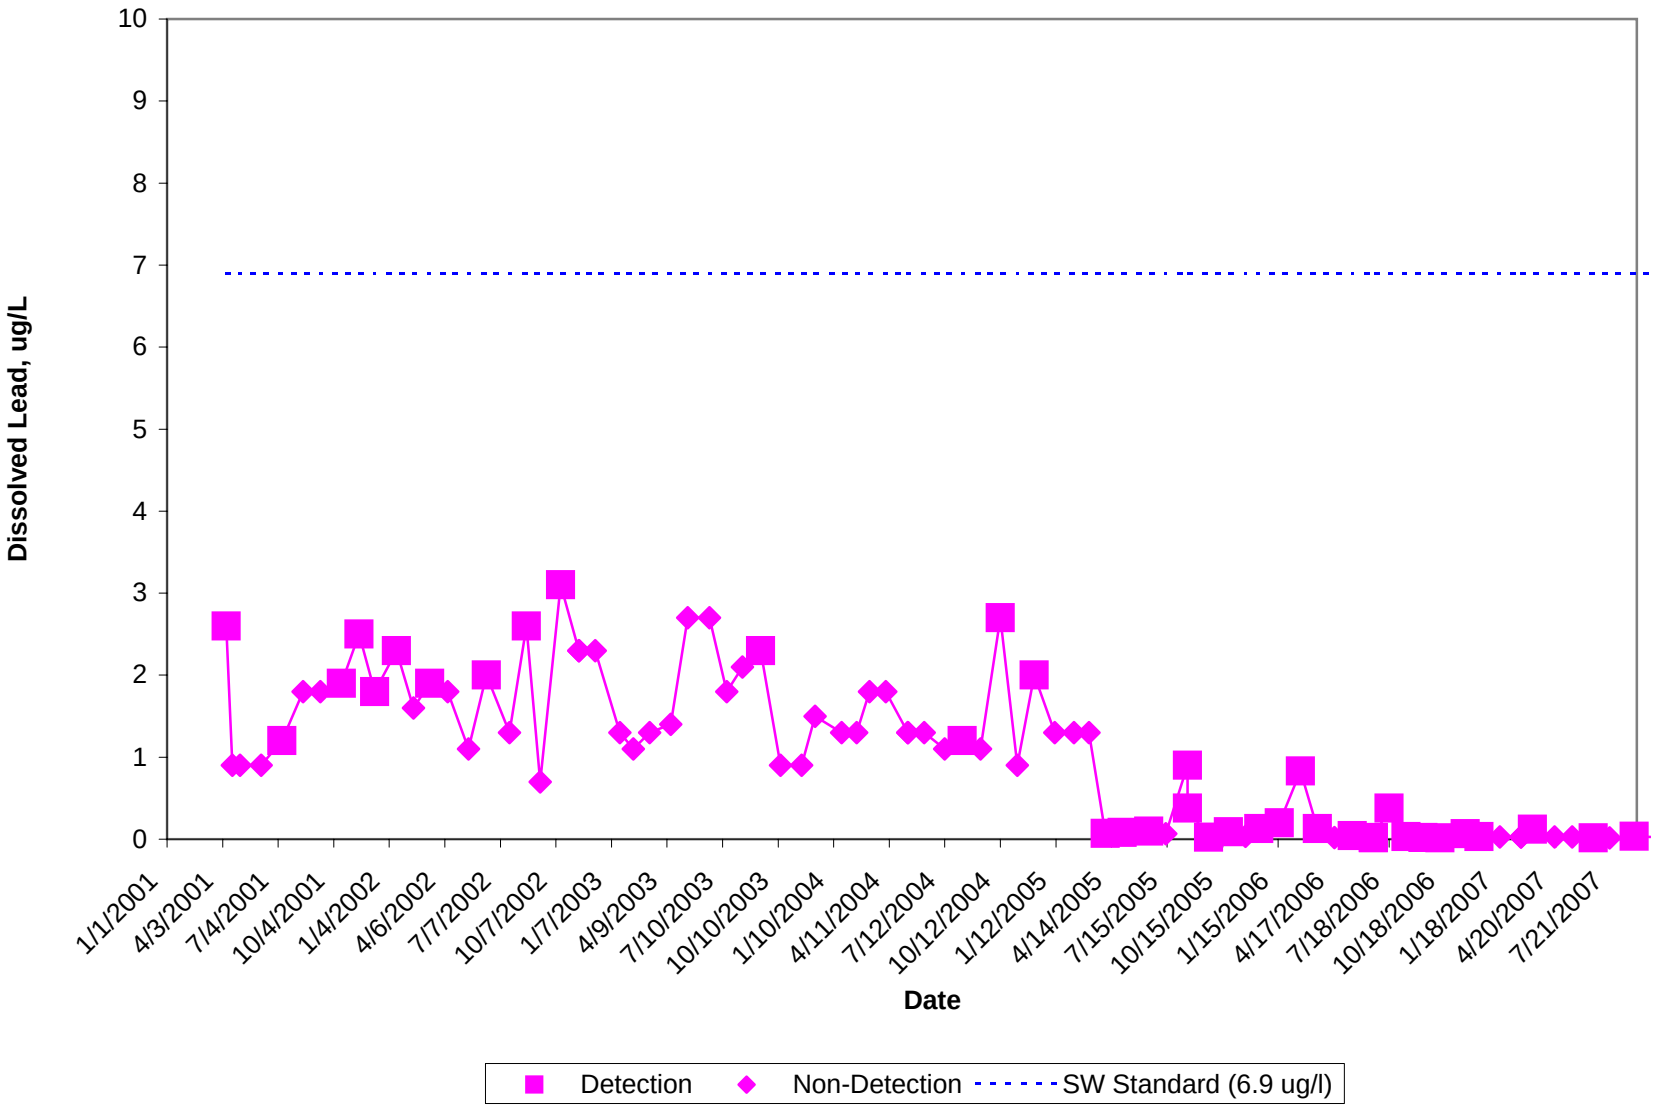

MW 13: Dissolved Lead

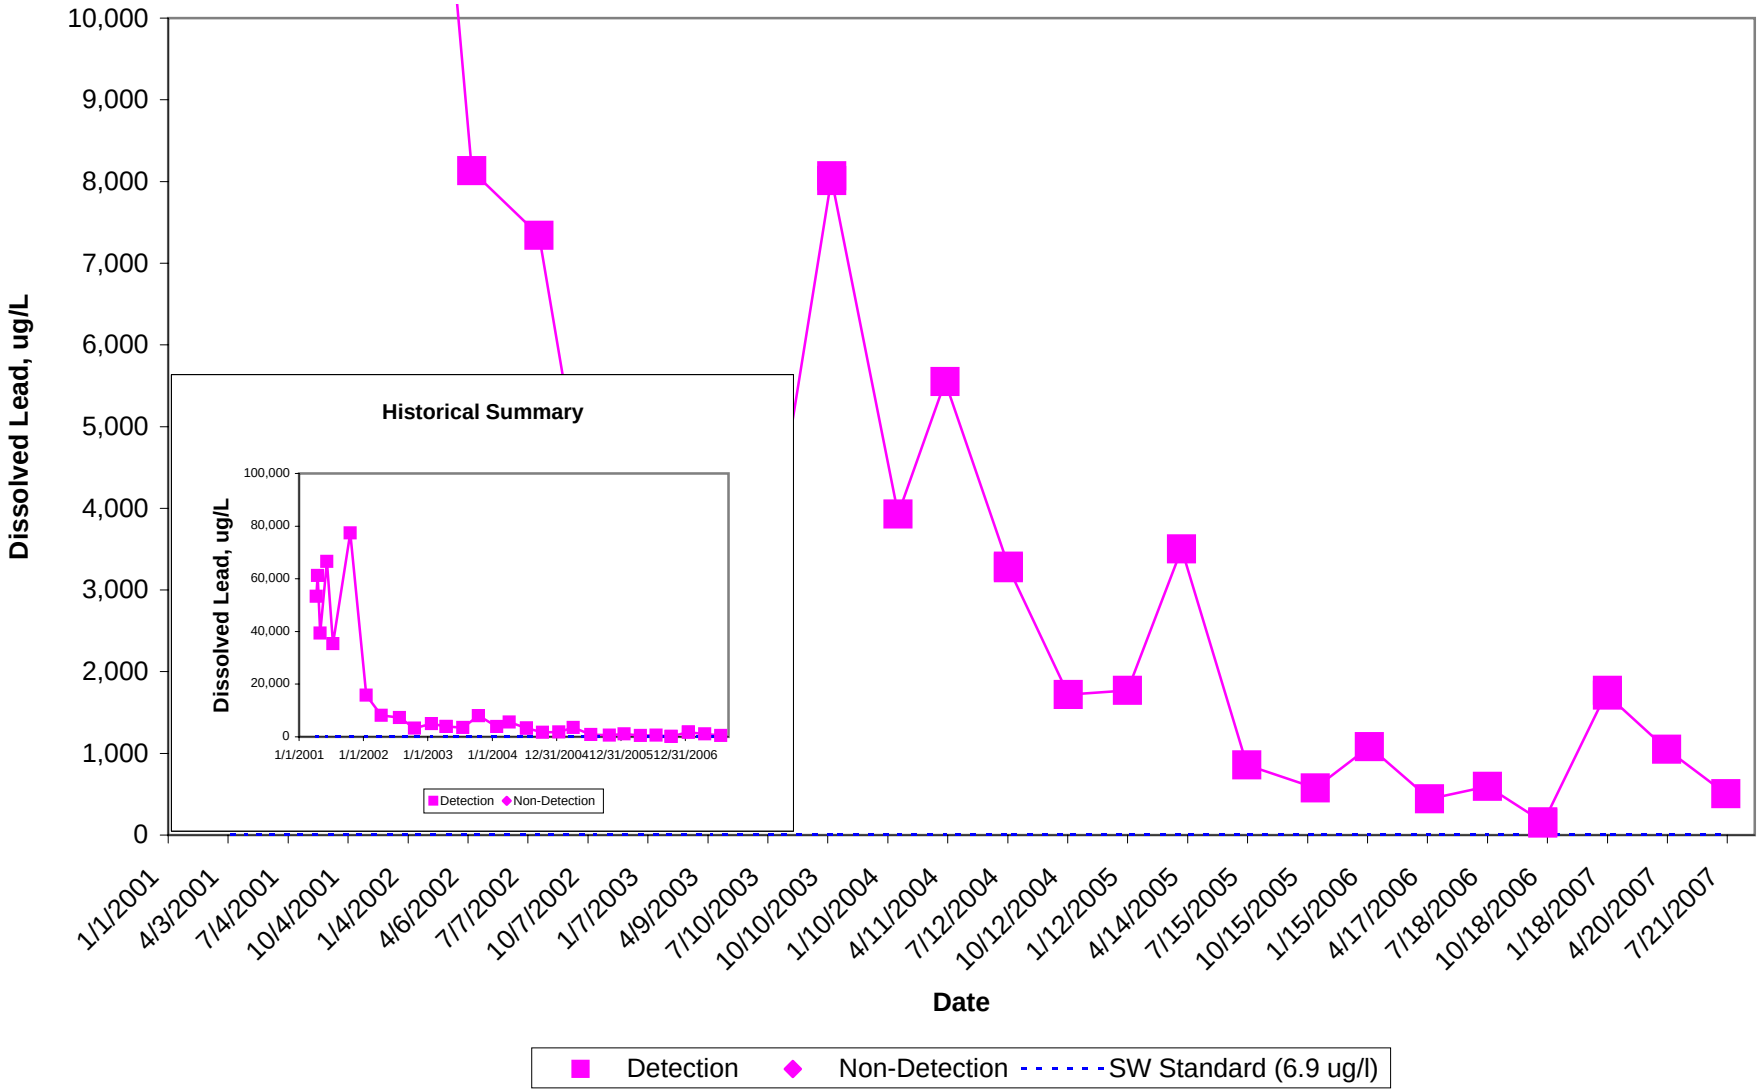

MW 14: Dissolved Lead

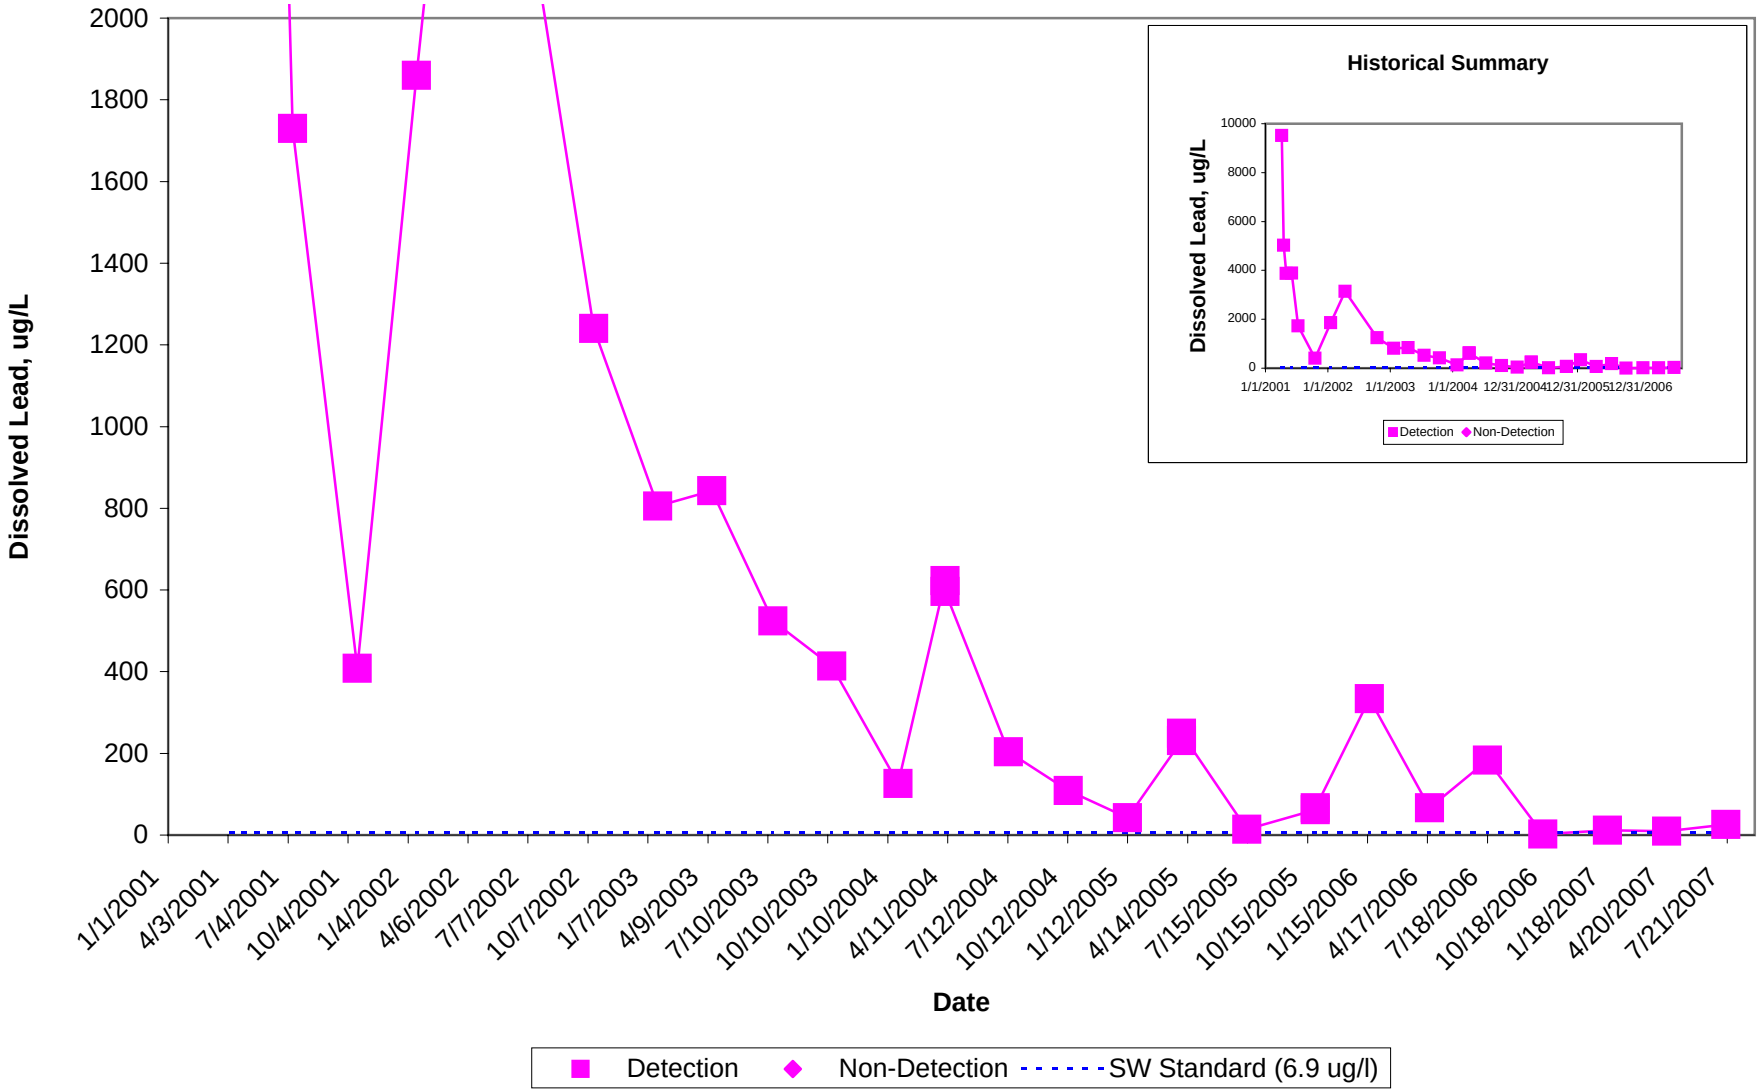

MW 15: Dissolved Lead

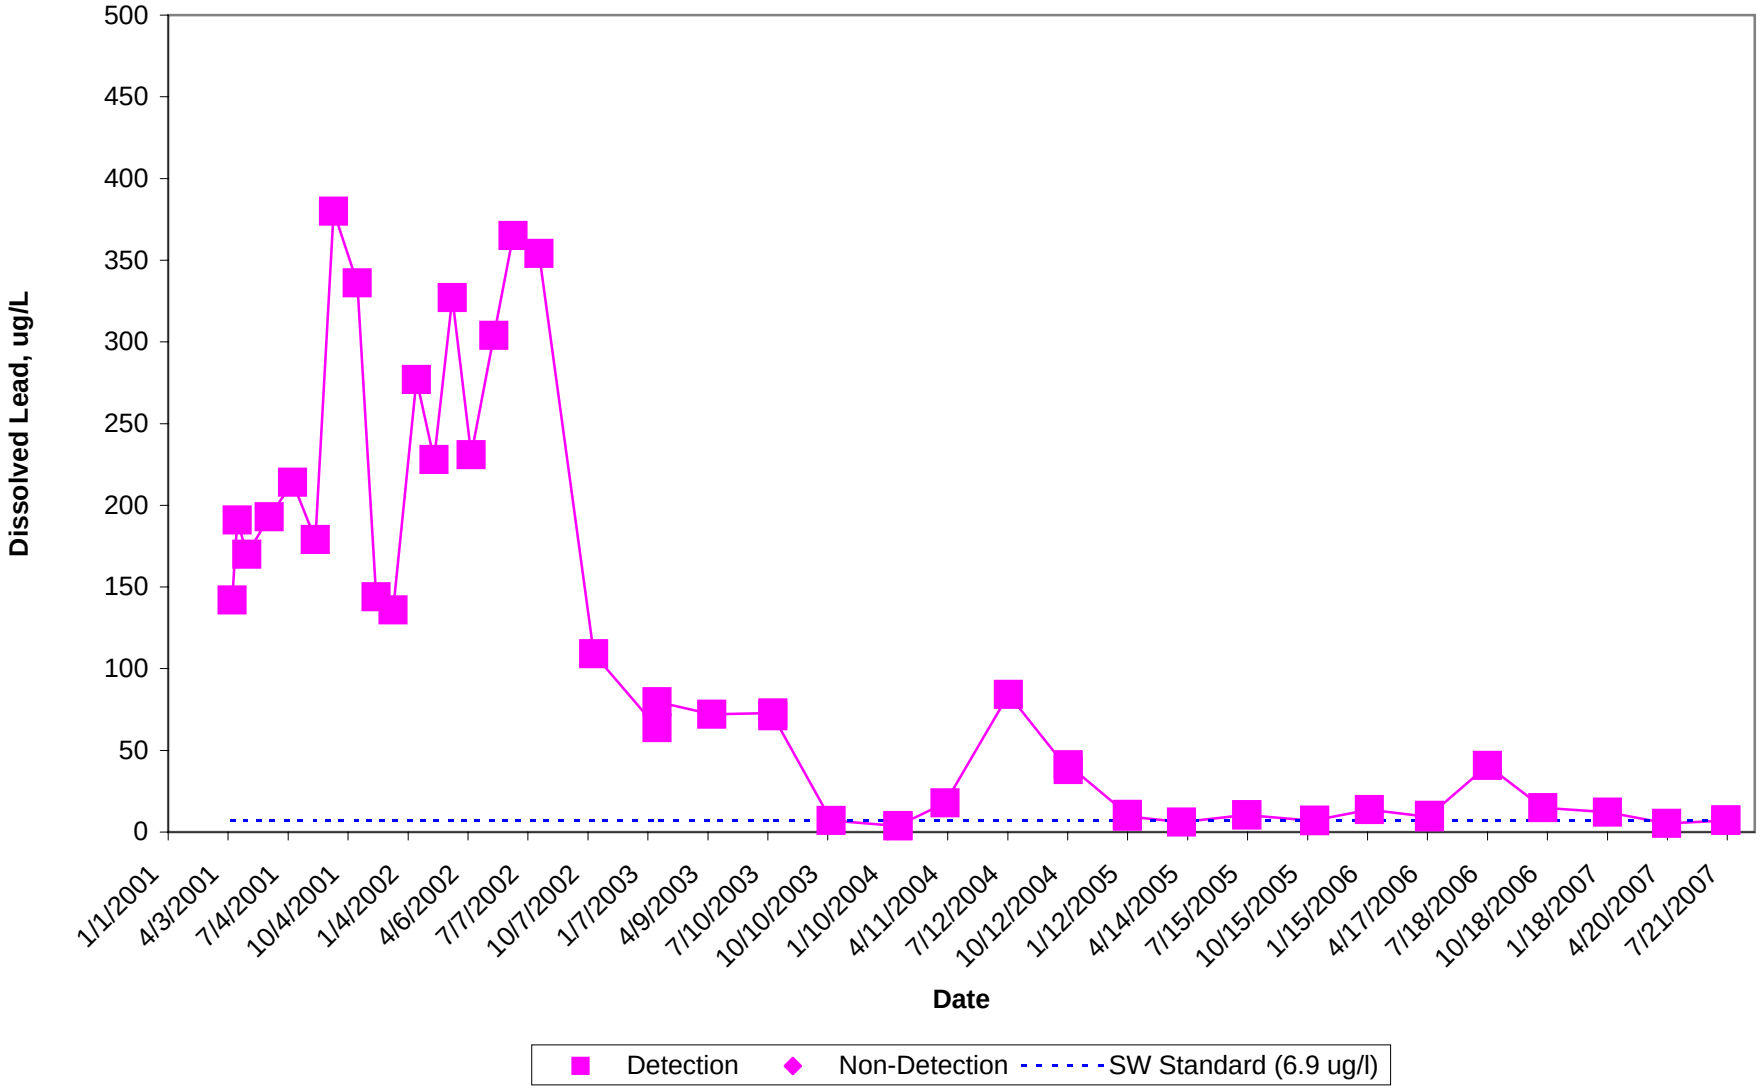

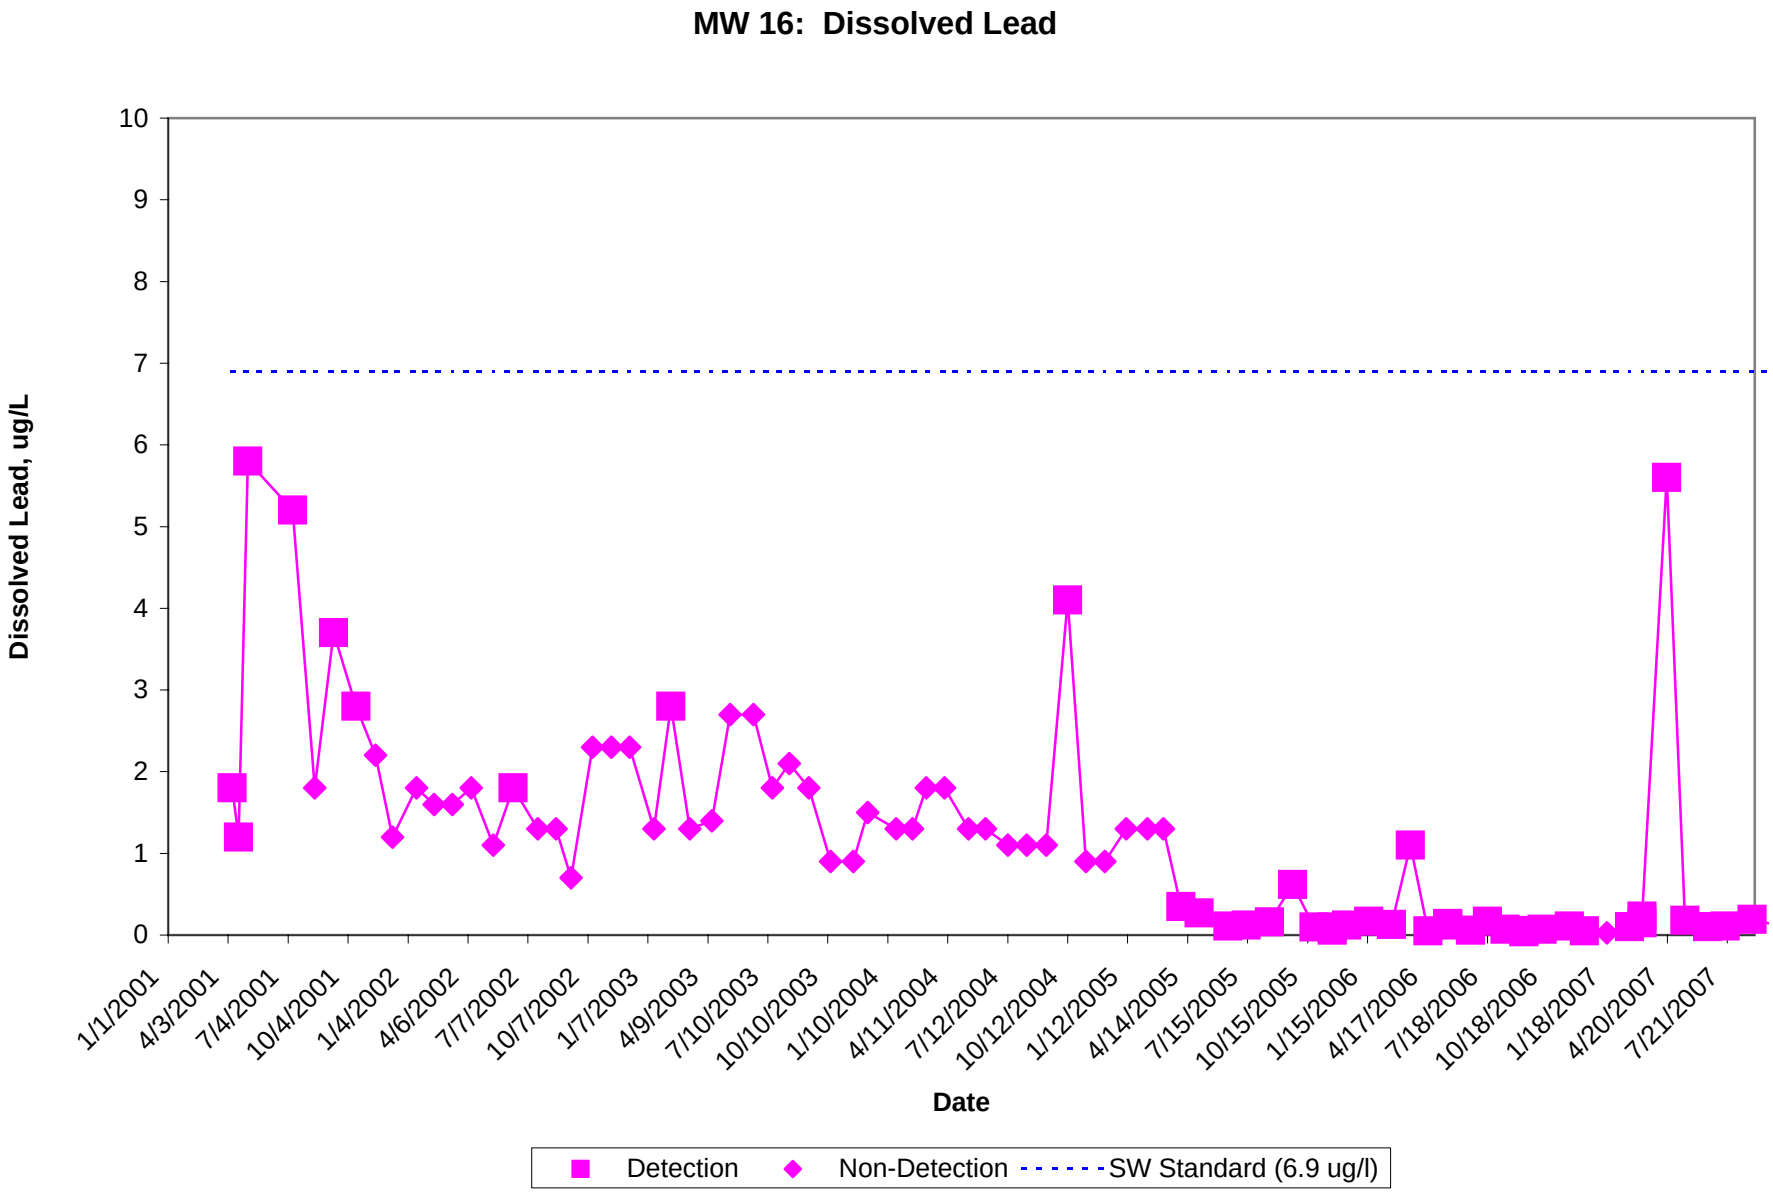
MW 16: Dissolved Lead
Dissolved Lead, ug/L
10
9
8
7
6
5
4
3
2
1
0
1/1/2001
4/3/2001
7/4/2001
10/4/2001
1/4/2002
4/6/2002
7/7/2002
10/7/2002
1/7/2003
4/9/2003
7/10/2003
10/10/2003
1/10/2004
4/11/2004
7/12/2004
10/12/2004
1/12/2005
4/14/2005
7/15/2005
10/15/2005
1/15/2006
4/17/2006
7/18/2006
10/18/2006
1/18/2007
4/20/2007
7/21/2007
Date
Detection
Non-Detection
SW Standard (6.9 ug/l)

Appendix C

FY 2007 Data Collection and Management

C.1 Data Collection, Management, and Presentation

APPENDIX C.1
DATA COLLECTION, MANAGEMENT, AND PRESENTATION

1.0 INTRODUCTION

A groundwater monitoring program was initiated in January 1984 to obtain water level and water quality data at TCAAP. Each year has been divided into quarters with each quarter assigned a number. Accordingly, FY 2007 was comprised of Quarter 93 (October through December), Quarter 94 (January through March), Quarter 95 (April through June), and Quarter 96 (July through September). Water sampling, water level measurements, and laboratory analysis were conducted in accordance with the TCAAP "Remedial Design/Remedial Action, Quality Assurance Project Plan" (Montgomery Watson, 1996).

Prior to November 1, 2001, data collected at TCAAP was stored in the U.S. Army Environmental Center (USAEC) Installation Restoration Data Management Information System (IRDMIS). The IRDMIS was managed by Potomac Research, Inc. (PRI) on behalf of the USAEC. USAEC replaced the IRDMIS System on November 1, 2001, with a new system, the Environmental Restoration Information System (ERIS), which incorporated all of the data that had previously been entered into IRDMIS.

2.0 GROUNDWATER LEVELS AND GROUNDWATER QUALITY

2.1 Data Collection and Management

Groundwater level and groundwater quality data were collected in accordance with the FY 2007 Annual Monitoring Plan (Appendix A), which established the monitoring responsibilities for both the Army and Alliant. Water level monitoring and water sampling were conducted by Wenck for the Army and by SECOR and CRA for Alliant. For all samples, laboratory analysis was performed by DataChem Laboratories, Salt Lake City, Utah.

Appendix A.4 contains lists of required analytes, as referenced by the monitoring plans in Appendix A. The lists are site-specific, based on the chemicals of concern. Halogenated volatile organic compounds were the parameters of primary interest, while select wells were sampled for aromatic volatile organic compounds, metals, and explosives. Appendix C.2 presents clarifications and deviations from the FY 2007 Annual Monitoring Plan.

Data assessment and validation was conducted in accordance with procedures and requirements outlined in the TCAAP QAPP. Flagging codes and data qualifiers assigned to data through data assessment/validation appear in the data tables included within the individual sections of this report (see table footnotes for definitions) and also in the historical databases (Appendix D). Data assessment and validation information was submitted to the MCPA and USEPA for review. Regulatory approvals for these submittals are included in Appendix C.3.

For water level measurements, the depth to water from the surveyed top of the well casing was measured. Groundwater elevations were calculated and data tables are included within the individual sections of this report and also in the historical database (Appendix D).

2.2 Groundwater Elevation Contour Maps

The most extensive water level monitoring event performed during FY 2007 was in June (Quarter 95). This data was used to prepare groundwater elevation contour maps for OU1, OU2, OU3, Building 102, Sites A, C, and K shallow groundwater. These maps are included within the individual sections of this report.

2.3 Groundwater Quality Contour Maps and Cross-Sections

The most extensive sampling event performed during FY 2007 was in June (Quarter 95). This data was used to prepare groundwater quality isoconcentration contour maps and/or cross-sections for OU1/OU3 deep groundwater, OU2 deep groundwater, Building 102 shallow groundwater and Sites A and K shallow groundwater. Contour maps were generated by hand,

based on the observed contaminant concentrations and the extent of past site contamination. These maps are included within the individual sections of this report.

For OU1/OU3 deep groundwater and OU2 deep groundwater, isoconcentration maps and cross-sections are provided for trichloroethene, as this is the principal contaminant on a concentration basis. Isoconcentration maps were prepared for OU1/OU3 deep groundwater (combined) and OU2 deep groundwater, with individual maps for Upper Unit 3, Lower Unit 3, and Upper Unit 4. To complement the isoconcentration maps, cross-sections have been prepared to illustrate the vertical distribution of trichloroethene. One section line passes through the source area at Site G and follows the north plume (OU1) off-TCAAP through well 582628 (NBM#15) of the New Brighton Contaminated Groundwater Recovery System (NBCGRS). A second section line passes through the source area at Site I and traces the south plume (OU3) off-TCAAP through the Plume Groundwater Recovery System (PGRS).

Contaminant concentrations for Middle Unit 3 wells and wells that fully penetrate Unit 3 (03F) (including any recovery wells that fully penetrate Unit 3 and that are being sampled as a monitoring well) are shown in parentheses on the Lower Unit 3 isoconcentration maps, but were not used for contouring purposes except when no Lower Unit 3 wells are in the vicinity. Similarly, wells completed in the Jordan aquifer (04J) and wells completed as open holes intersecting both the Prairie du Chien and Jordan aquifers (PJ#) are shown with the data in parentheses on the Upper Unit 4 isoconcentration maps, but were not used for contouring purposes.

For Site A, isoconcentration maps were developed for cis-1,2-dichloroethene, since this is the most widespread contaminant at Site A, and also for tetrachloroethene, which illustrates the source area. Site A cross-sections were also prepared which illustrate cis-1,2-dichloroethene. The isoconcentration maps for Site A were prepared only for Unit 1, since this is the only contaminated aquifer.

For Site K, an isoconcentration map was developed for trichloroethene (the primary contaminant). The map for Site K was prepared only for Unit 1, since this is the only contaminated aquifer.

Contaminant concentrations for recovery wells that are actively pumping are shown in parentheses on the isoconcentration maps. These values were considered, but were not used alone to prepare the isoconcentration contours. Concentrations of recovery wells generally represent an average contaminant value for all groundwater being drawn to the well; hence, the concentrations do not necessarily represent a discrete location or depth.

C.2 Deviations from Monitoring Program

APPENDIX C.2
DEVIATIONS FROM MONITORING PROGRAM

Fiscal Year 2007

OU2 TGRS

June 2007:

Well 03F319 (B13): Although well was sampled per the monitoring plan, the pump in the well was not pumping at the time the sample was collected. Hence, the sample collected represented stagnant water in the well piping and not of the aquifer being pumped. Well was resampled in July 2007.

Well PJ#310: Although well was sampled per the monitoring plan, the pump in the well was not pumping at the time the sample was collected. Hence, the sample collected represented stagnant water in the well piping and not of the aquifer being pumped.. Well was resampled in July 2007.

OU2 Site I

June 2007:

Well 01U064: Bailed dry after 2 gallons removed (just over 1 well volume).
Well I01MW: No sample collected, well was dry.
Well I05MW: Insufficient water to collect groundwater sample. Less than 1 inch water in well.
Well 01U667: Bailed dry after 3 gallons removed (just over 1 well volume).
Well 01U639: No sample collected, well was dry. A groundwater sample was collected from the alternate sampling location well I04MW.
Well I02MW: No sample collected, well was dry.
Well 01U632: No sample collected, well was dry.
Well 01U666: No sample collected, well was dry.
Well 01U668: No sample collected, well was dry.

OU2 Site K

June 2007:

Well 01U611: Bailed dry after 1.25 gallons removed (just over 1 well volume).
Well 01U617: Bailed dry after 6 gallons removed (just over 1 well volume).
Well 01U618: Bailed dry after 2 gallons removed (just over 1 well volume).
Well 01U604: Bailed dry after 1 gallon removed (just over 1 well volume).
Well 01U615: Bailed dry after 3 gallons removed (just over 1 well volume).
Well 03U621: Pumped down after 15 gallons removed (just over 1 well volume).

C.3 Regulatory Approvals for Data Assessments and Validation

UNITED STATES ENVIRONMENTAL PROTECTION AGENCY
REGION 5
77 WEST JACKSON BOULEVARD
CHICAGO, IL 60604-3590

March 27, 2008

REPLY TO THE ATTENTION OF SR-6J

Mr. Michael R. Fix
Commander's Representative
Twin Cities Army Ammunition Plant
470 West Highway 96 - Suite 100
Arden Hills MN 55126

Subject: **Approval of Data Usability Report Numbers 47, 49, 50, and 55**

Dear Mr. Fix:

This letter shall serve to document that the U.S. Environmental Protection Agency (USEPA) and the Minnesota Pollution Control Agency (MPCA) have completed their review of the U.S. Army's (Army) subject Data Usability Reports (DURs) Numbers 47, 49, 50 and 55. USEPA and MPCA review included review of:

- Final DUR No. 47 (1st Quarter FY 2007 Performance Monitoring), revised in accordance with the Army's June 21, 2007 responses to USEPA and MPCA comments;
- Final DUR No. 49 (2nd Quarter FY 2007 Performance Monitoring), revised in accordance with the Army's September 14, 2007 responses to USEPA and MPCA comments;
- Final DUR No. 50 (3rd Quarter FY 2007 Performance Monitoring), revised in accordance with the Army's February 12, 2008 responses to USEPA and MPCA comments;
- Final DUR No. 55 (4th Quarter FY 2007 Performance Monitoring), revised in accordance with the Army's February 12, 2008 responses to USEPA and MPCA comments;

Based upon our review of the information provided by the Army, USEPA and MPCA agree that the subject DURs are acceptable. You are hereby advised that the USEPA and the MPCA approve Data Usability Report Numbers 47, 49, 50and 55.

If you have any questions, please contact Tom Barounis of the EPA at (312) 353-5577 or Dagmar Romano of the MPCA at (651) 296-7776.

Sincerely,

Tom Barounis

Tom Barounis
Remedial Project Manager
U.S. Environmental Protection Agency
Region 5

for Tom Barounis

Dagmar Romano
Superfund Unit 2
Superfund Section
Majors and Remediation Division
Minnesota Pollution Control Agency

Recycled/Recyclable . Printed with Vegetable Oil Based Inks on 100% Recycled Paper (50% Postconsumer)

Appendix D

Comprehensive Groundwater Quality and Groundwater Level Databases

D.1 Comprehensive Groundwater Quality and Groundwater Level Databases

APPENDIX D.1
COMPREHENSIVE GROUNDWATER QUALITY AND GROUNDWATER LEVEL DATABASES

The historical groundwater tables are located on this CD-ROM in a directory named Appendix D. This directory contains three Microsoft Excel files:

File	Contents
Compelev.xls	Groundwater elevations
Comporwq.xls	Groundwater quality: organic data
Compinwq.xls	Groundwater quality: inorganic data

D.2 Operable Unit 1 Statistical Analysis

D.2.1 Well Groups and Statistical Evaluation Criteria Tables

Table D.2.1
Statistical Evaluation
Well Groups

Group 1 – Downgradient of TGRS

03U806	04U806	03L802	03U801
03M806	PJ#806	04U802	03U711
03L806	03M802	PJ#802*	04U711

Group 2 – Areal Extent of Plume

03U805	409557	04U841	04U875
03U672	04U673	04U843	04U877
03L848	04U832	04U833	206688
03L673	04U845	04U846	04U849
03L833	04U854	04U861	04U821
03L859	04U859	409549	191942

Group 3 ** – Downgradient Sentinel

04U871	04U875	04U851	

Group 4 – Lateral Sentinel

03U831 abandoned	03L846	409556	409548
03U811	03L832	04U855	04U839
03U804	03L861 abandoned	04U879	04U838
03U673	03L854	04U860	04U848
03U672	03L841	409547	04J839
03M843	03L811	04U863	

Group 5 – Global Plume

04J077	04U702	04U848	04U877
04J702	04U709	04U851	04U879
04J708	04U711	04U852 abandoned	04U880
04J713	04U713	04U855	04U881
04J834	04U802	04U859	04U882
04J864 abandoned	04U806	04U860	200154
04J866	04U832	04U861 abandoned	234546
04J882	04U833	04U863	234549
04U002	04U834	04U864 abandoned	409547
04U020	04U841	04U865 abandoned	409548
04U027	04U843	04U866	409549
04U077	04U844	04U871	409555
04U673	04U845	04U872	512761
04U701	04U846	04U875	PJ#318

Group 6 – Jordan Aquifer

04J077	04J838	04U713	04U882
04J702	04J839	04U834	NBM#3
04J708	04J882	04U836	NBM#4
04J713	04J847	04U837	NBM#5
04J822	04J849	04U838	NBM#6
04J834	04U077	04U839	
04J836	04U702	04U847	
04J837	04U708	04U849	

* PJ#802 will not be monitored or used for evaluation unless 04U802 shows TCE concentrations greater than 1 ppb.

** Group 3 is analyzed as a rectangular area taken from the Group 5 contouring.

Table D.2.2

MAROS Decision Matrix

Mann-Kendall S	Confidence	Coefficient of Variance	Trend Conclusion
S > 0	> 95%	NA	Increasing
S > 0	90-95%	NA	Probably Increasing
S > 0	< 90%	NA	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	NA	Probably Decreasing
S < 0	>95%	NA	Decreasing

Table D.2.3
Summary of Groups, Purpose, and Statistical Tests

Well Group	Purpose	Measure	Time Window/ Monitoring Frequency	Test	Response Threshold
Group 1	AWC Immediately Downgradient of TGRS	AWC Trend	6 years/annual	Mann-Kendall and MAROS	Stable, Increasing, or No Trend
Group 2	Defining Plume Size (Low Concentration Edges)	Individual Well Trend for TCE	12 years/biennial	Mann-Kendall and MAROS	Increasing or No Trend
Group 3	AWC Immediately Downgradient of NBCGRS	AWC Trend	12 years/biennial	Mann-Kendall and MAROS	Stable, Increasing, or No Trend
Group 4	Lateral (Clean) Sentinel Wells	Individual Well Concentration	12 years/biennial	Individual Concentrations	Greater than ROD goals
Group 5	Global Plume Mass Reduction	AWC Trend	12 years/biennial	Mann-Kendall and MAROS	Stable, Increasing, or No Trend
Group 6	Evaluating and comparing trends in Jordan Aquifer	Individual Well Trend for TCE	12 years/biennial	Mann-Kendall and MAROS	Stable, Increasing or No Trend

Note: A Response Threshold is the test result(s) that triggers further response. See text for additional explanation of response process.

AWC = Area-Weighted Concentration.

Table D.2.4
Group 1 – Downgradient of TGRS, Evaluation Process

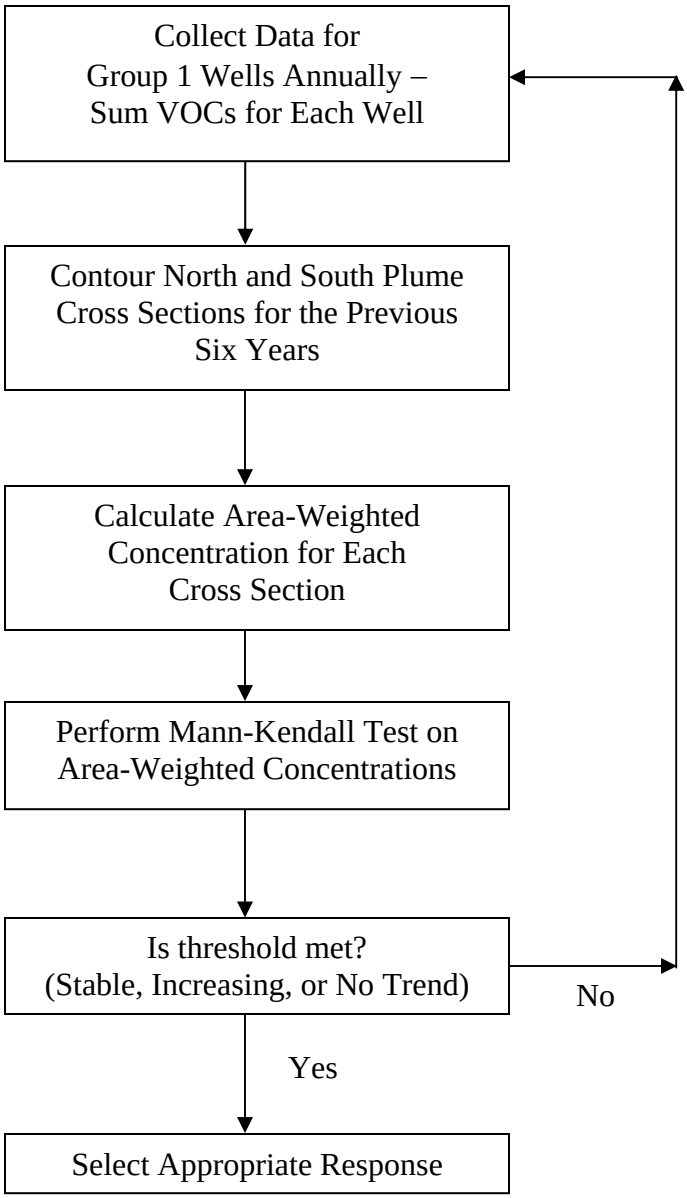

Table D.2.5
Group 2 – Areal Extent of Plume, Evaluation Process

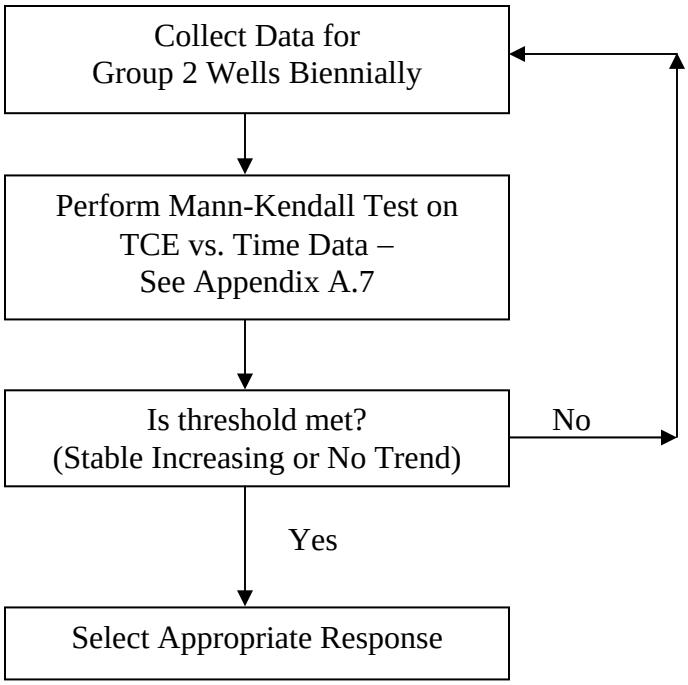

Table D.2.6
Group 3 and Group 5 – Downgradient Sentinel and Global Plume, Evaluation Processes

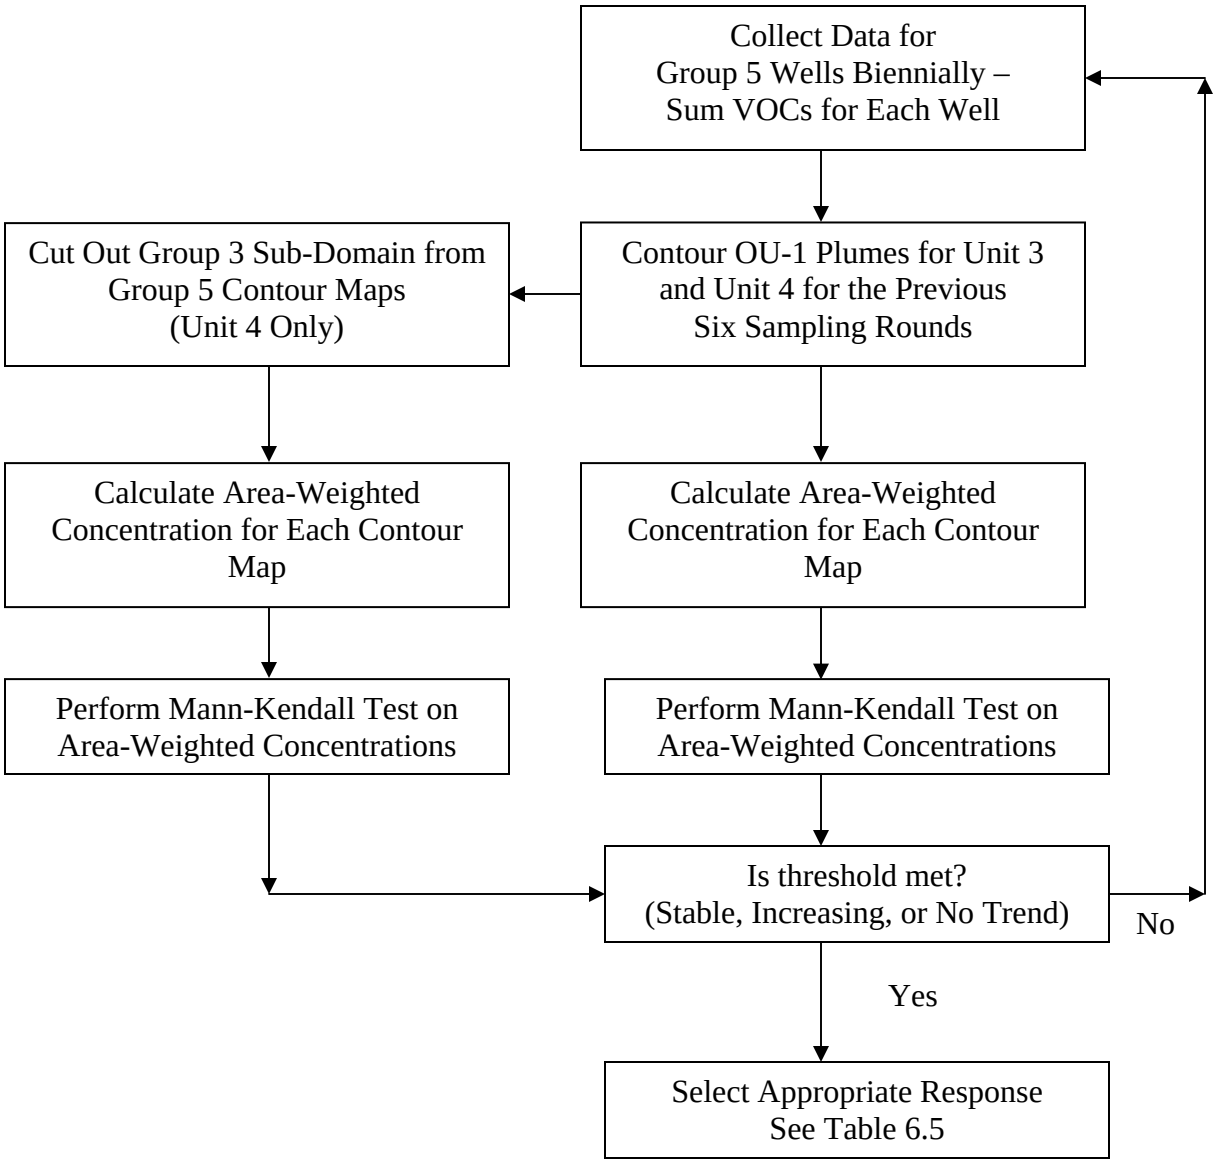

Table D.2.7
Group 4 – Lateral Sentinel Wells, Evaluation Process

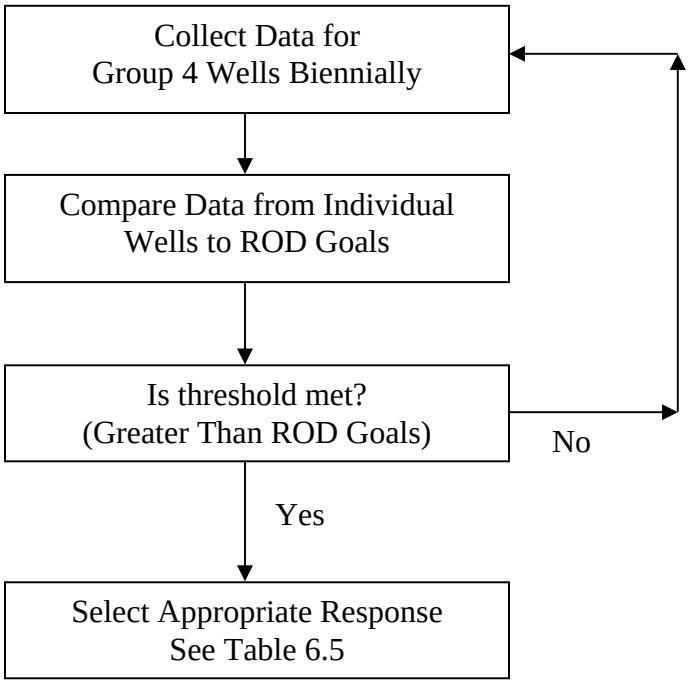

Table D.2.8

Responses to Threshold Indicators

Factors to Consider

- Contaminant concentrations
- Location (vertical and horizontal)
- Surrounding data
- Risks to human health or the environment
- Need for urgency in response

Possible Evaluation Responses

- Perform additional or confirmation sampling
- Write up in the Annual Performance Report
- Perform separate evaluation and write-up (Tech Memo)

Possible Long-Term Responses

- Increase sampling frequency
- Modify operation of remedial system(s)
- Perform new remedy evaluation
- Install additional monitoring well(s)
- Modify the Special Well Construction Area
- Control risk at the receptors

Note: Threshold responses to be described and evaluated in the Annual Performance Reports.

Table D.2.9

Group 6 – Jordan Aquifer, Evaluation Process

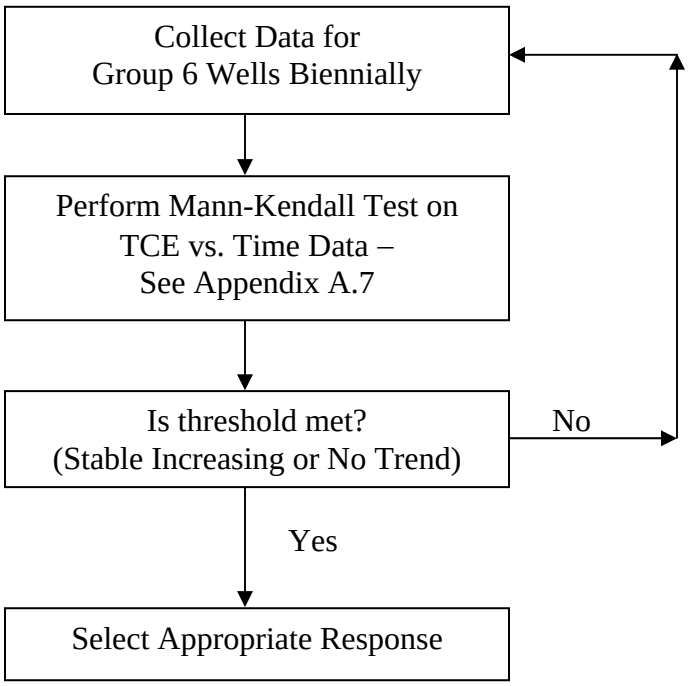

D.2.2 Group 1 Kriging Evaluation

1997

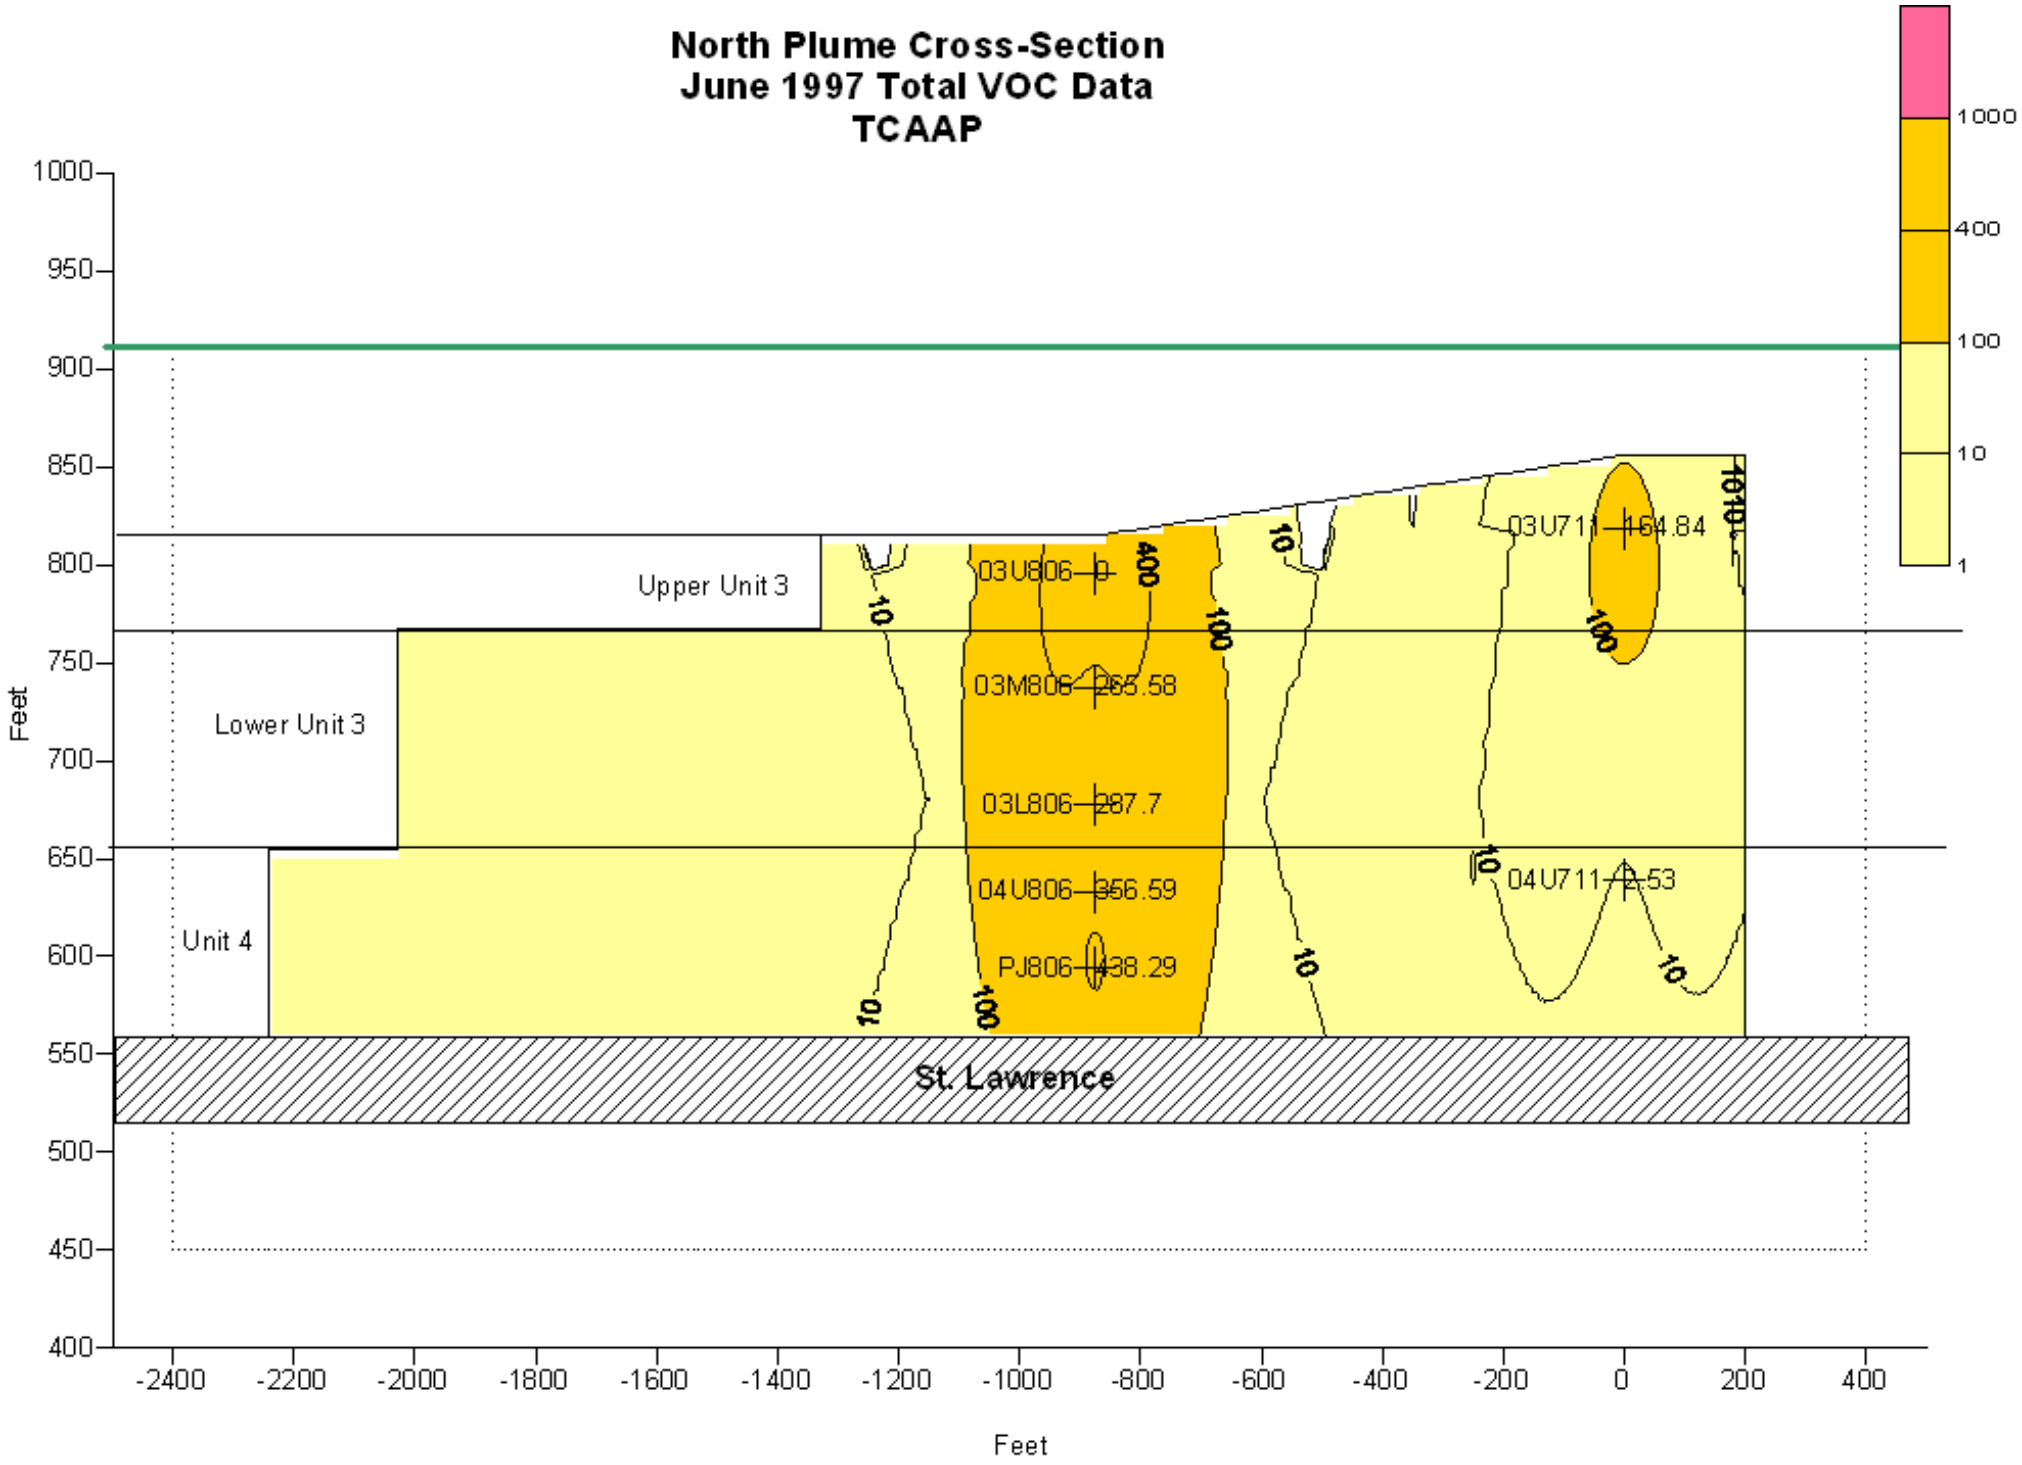
North Plume Cross-Section
June 1997 Total VOC Data
TCAAP
1000
400
100
10
1
Upper Unit 3
Lower Unit 3
Unit 4
St. Lawrence
03U806
03M806
03L806
04U806
PJ806
03U711
04U711
Feet
Feet

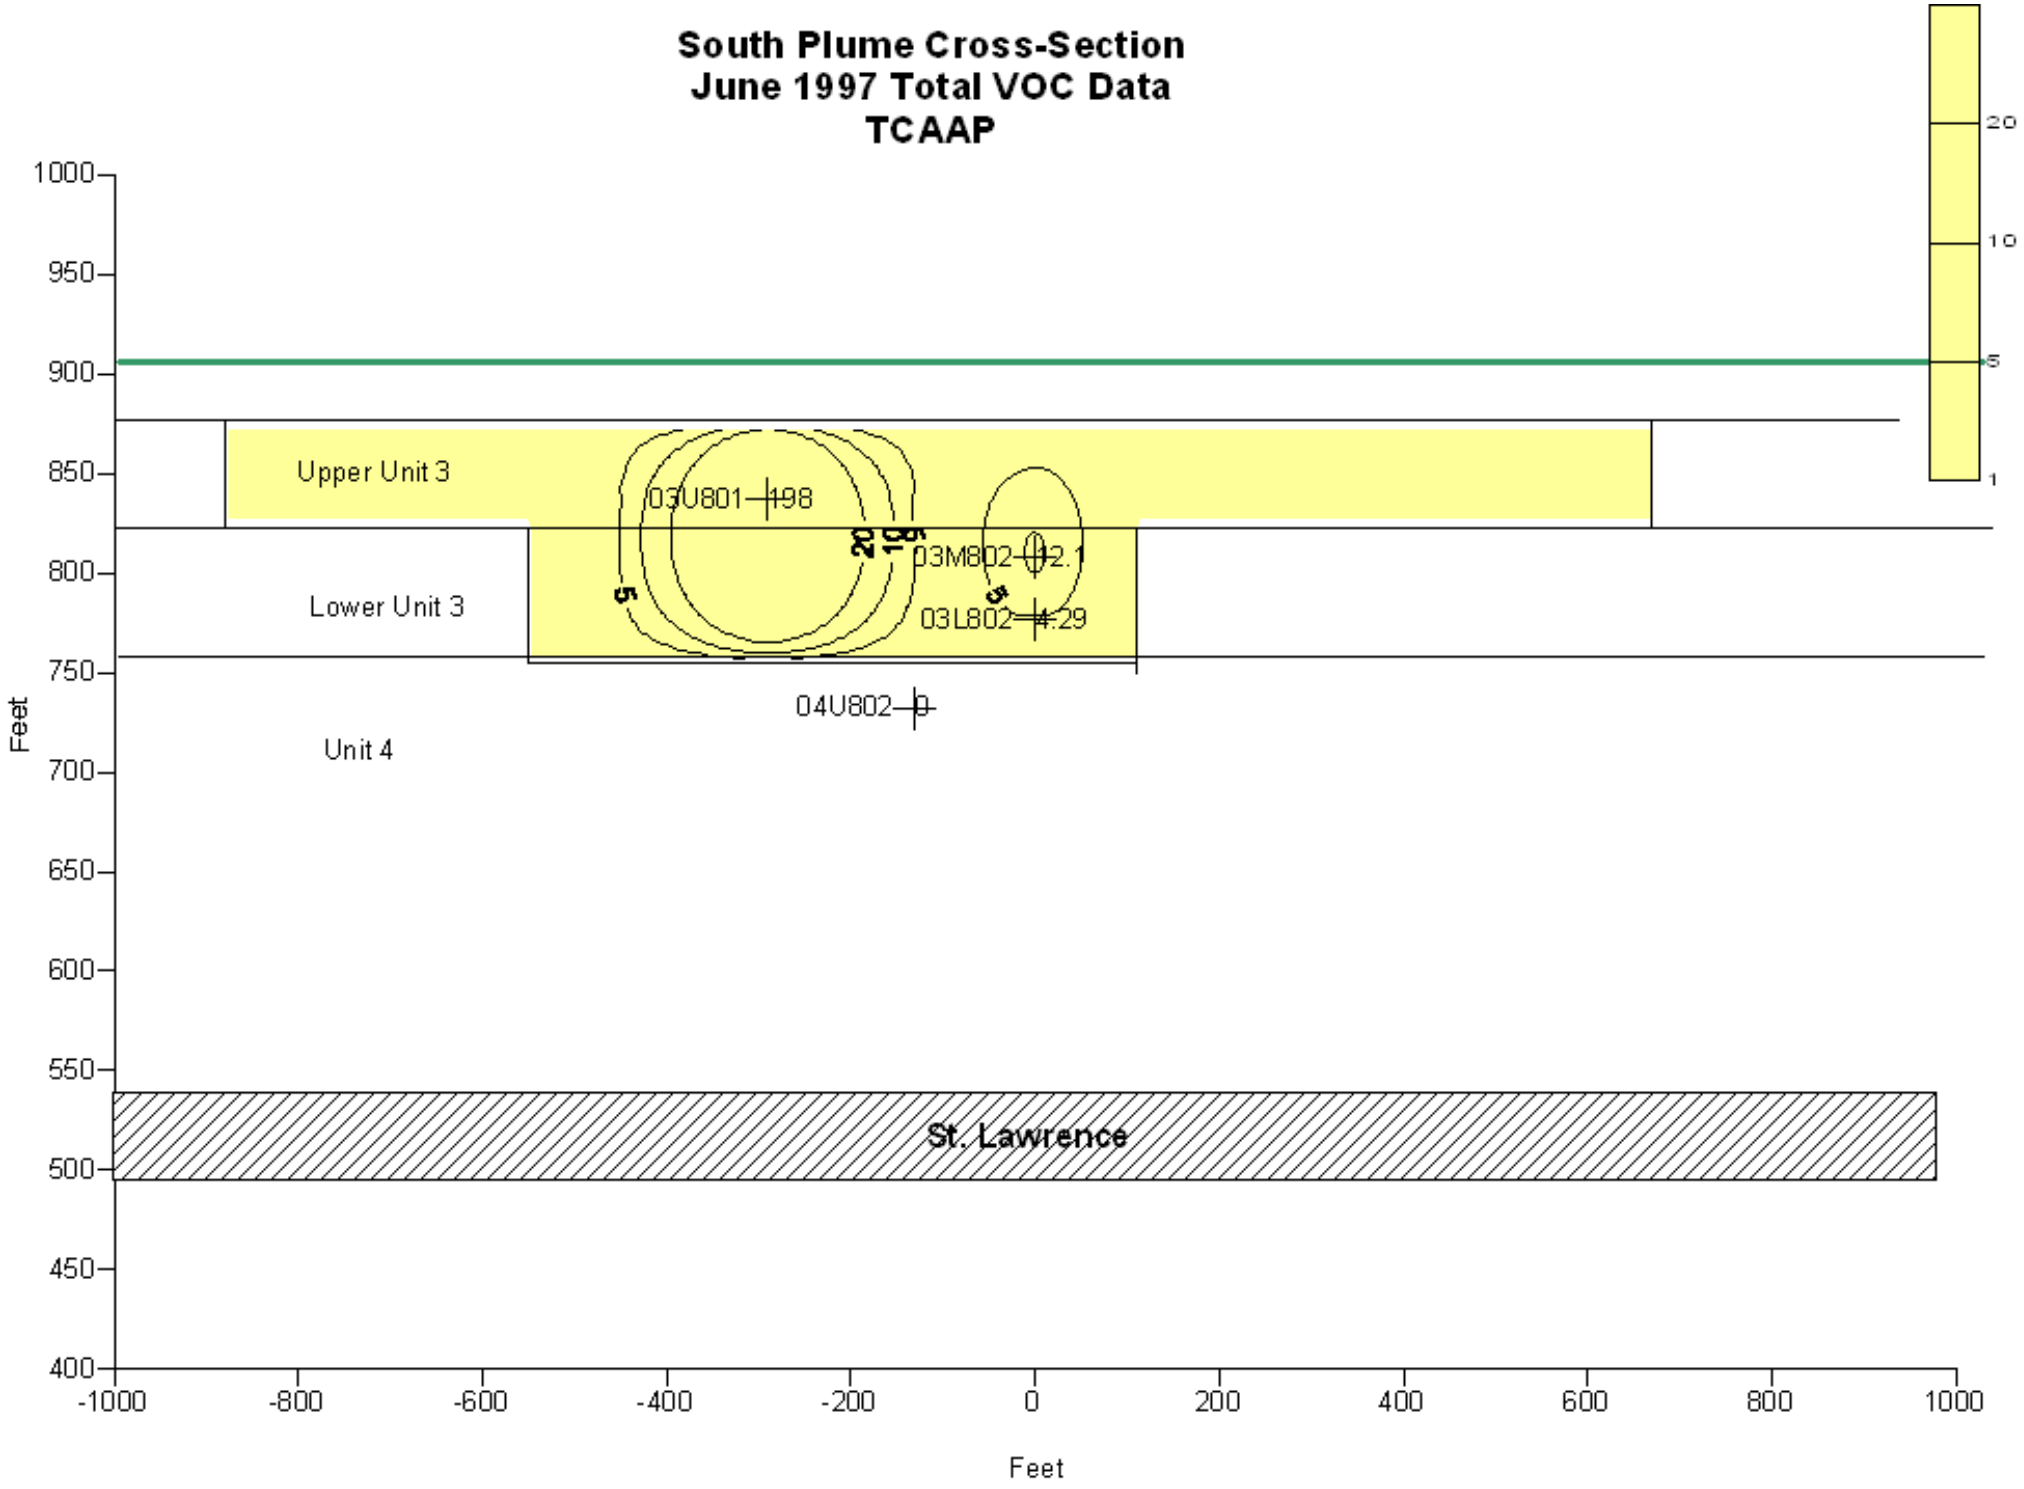
South Plume Cross-Section
June 1997 Total VOC Data
TCAAP
Upper Unit 3
Lower Unit 3
Unit 4
03U801—198
03M802—12.1
03L802—4.29
04U802—0
5
20
10
5
St. Lawrence
Feet
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-1000
-800
-600
-400
-200
0
200
400
600
800
1000
20
10
5
1

Groundwater Quality Data (Organics) - 1997		
Well	Date	TOTAL VOCs (ug/l)
03L806	6/25/1997	287.70
03M806	6/17/1997	265.58
03U711	6/13/1997	164.84
03U806*		986.00
04U711	6/13/1997	2.53
04U806	6/5/1997	356.59
PJ#806	6/5/1997	438.29
03L802	6/16/1997	4.29
03M802	6/16/1997	12.10
03U801	6/17/1997	201.66
04U802	6/16/1997	0.00

* Interpolated

South Plume

North plume

North Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Expanded Contouring and Blanking
TCAAP
June 1997

Concentration	Positive Planar Area (ft2)
Plume to 1	570490
Plume to 5	288525
Plume to 10	269887
Plume to 50	165775
Plume to 100	113709
Plume to 200	74691
Plume to 300	43287
Plume to 400	12634
Plume to 500	6612
Plume to 600	3768
Plume to 700	2021
Plume to 800	917
Plume to 900	191
Plume to 1000	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	281964	845893
5 to 10	7.5	18638	139786
10 to 50	30	104112	3123373
50 to 100	75	52065	3904904
100 to 200	150	39018	5852772
200 to 300	250	31404	7850995
300 to 400	350	30653	10728491
400 to 500	450	6022	2709721
500 to 600	550	2845	1564609
600 to 700	650	1746	1135058
700 to 800	750	1105	828667
800 to 900	850	725	616459
900 to 1000	950	191	181775
	Sum	570490	39482503

Area Wtd Conc	69	ug/L

South Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Contouring and Blanking
TCAAP
June 1997

Concentration	Positive Planar Area (ft2)
Plume to 1	115236
Plume to 5	40363
Plume to 10	26616
Plume to 25	15757
Plume to 50	8734
Plume to 100	2906
Plume to 200	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	74873	224619
5 to 10	7.5	13748	103107
10 to 25	17.5	10858	190020
25 to 50	37.5	7023	263376
50 to 100	75	5828	437100
100 to 200	150	2906	435878
	Sum	115236	1654100

Area Wtd Conc	14	ug/L

1998

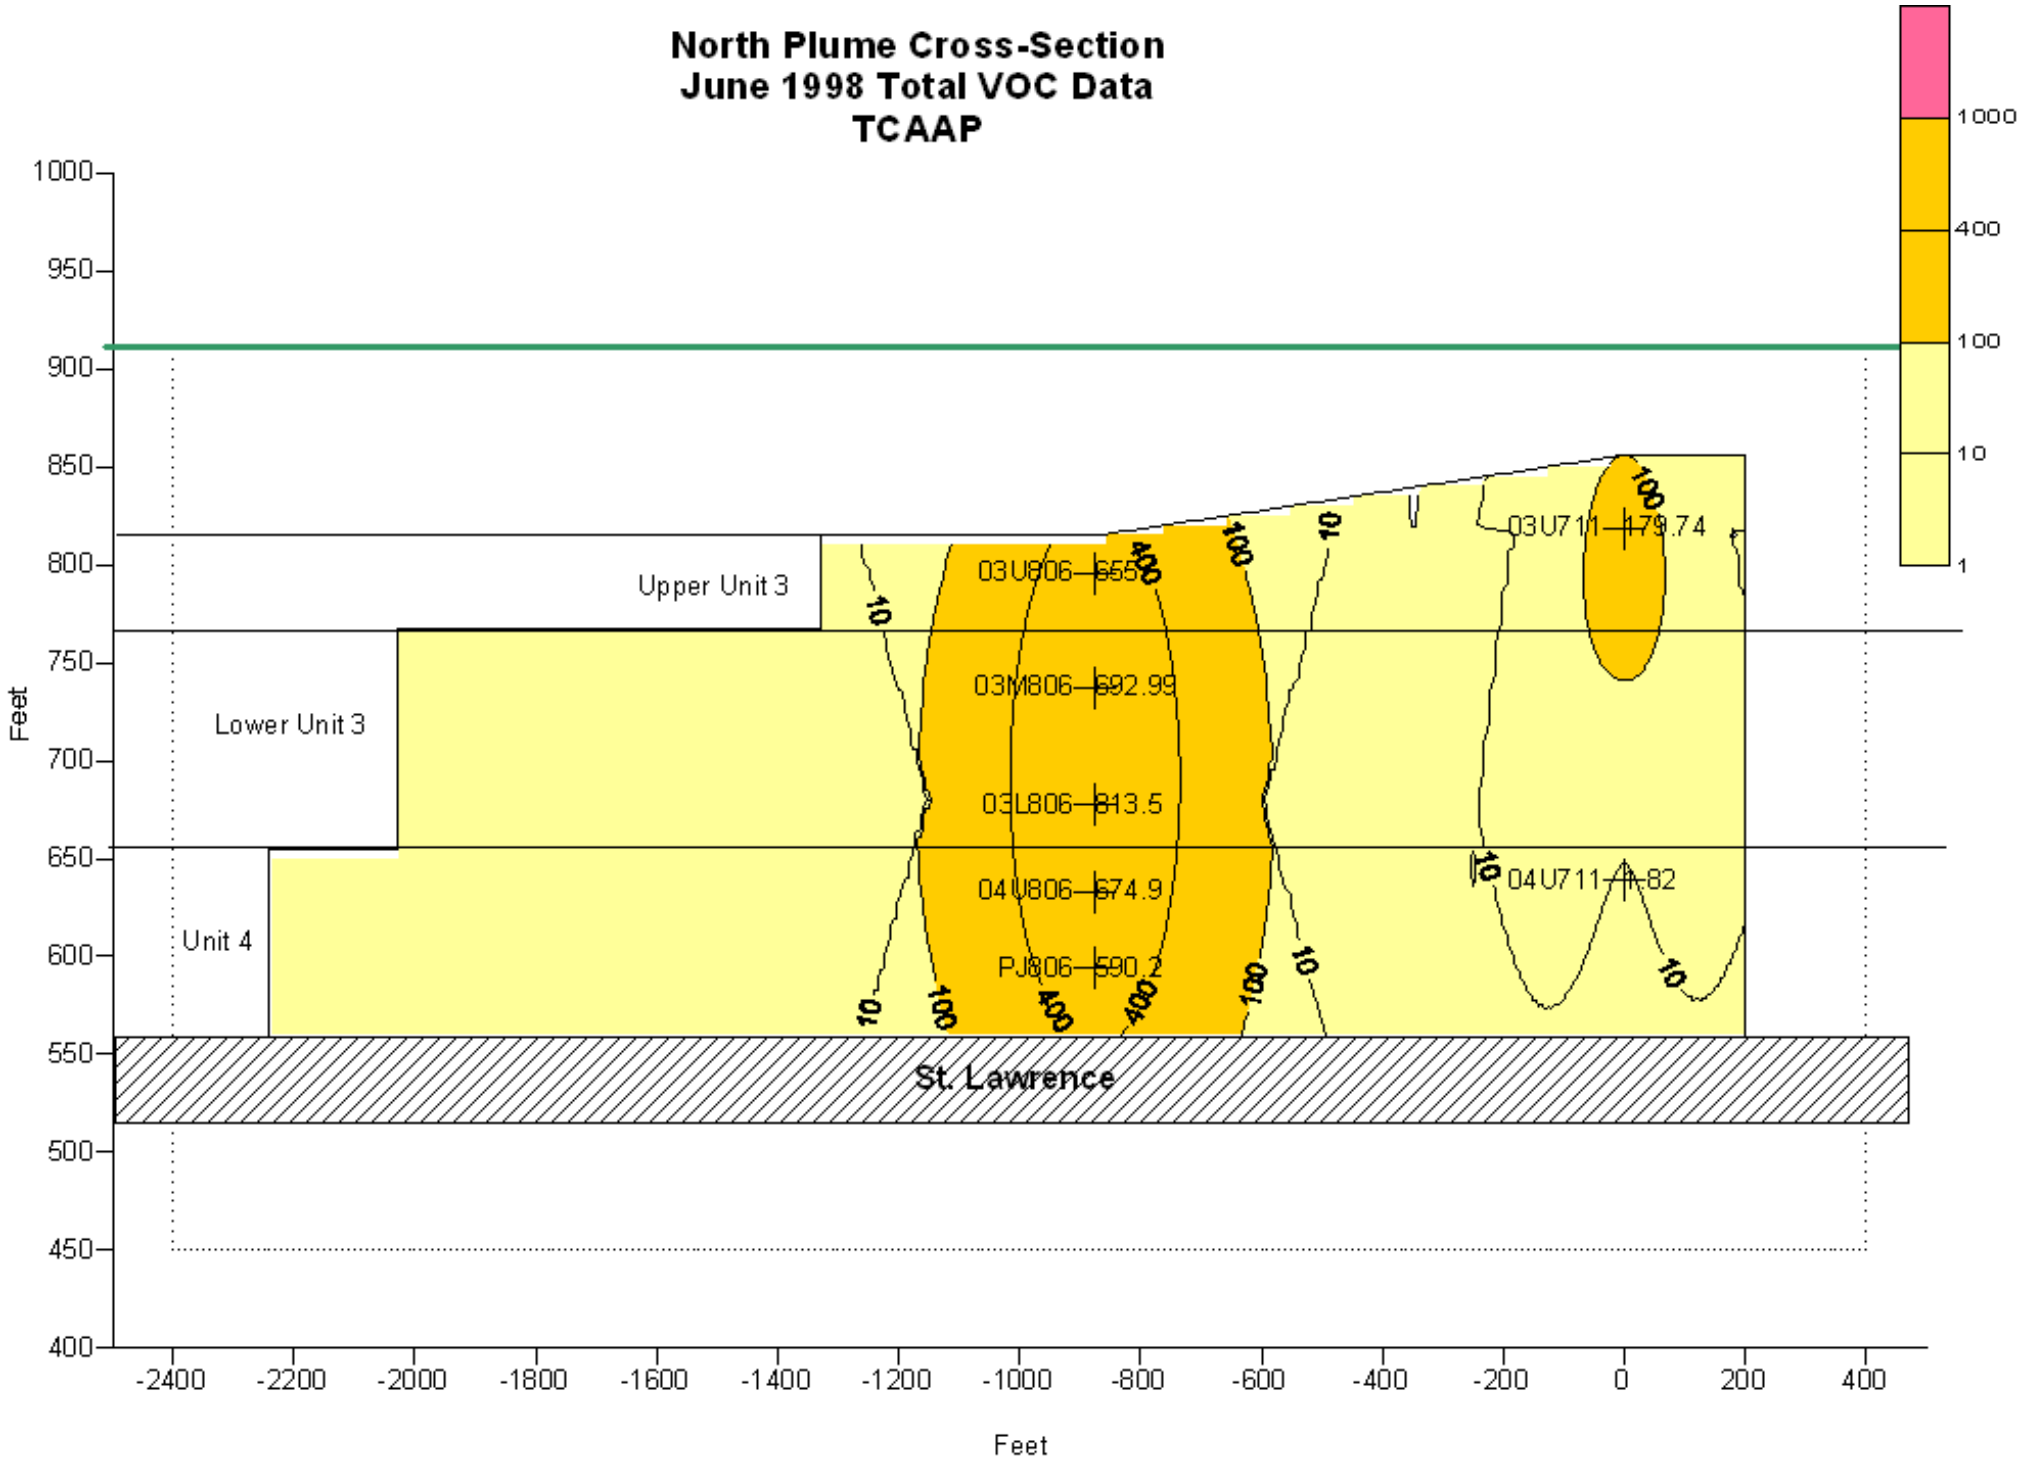
North Plume Cross-Section
June 1998 Total VOC Data
TCAAP
1000
400
100
10
1
Upper Unit 3
Lower Unit 3
Unit 4
St. Lawrence
03U806—655
03M806—692.99
03L806—813.5
04U806—674.9
PJ806—590.2
03U711—779.74
04U711—782
Feet
Feet

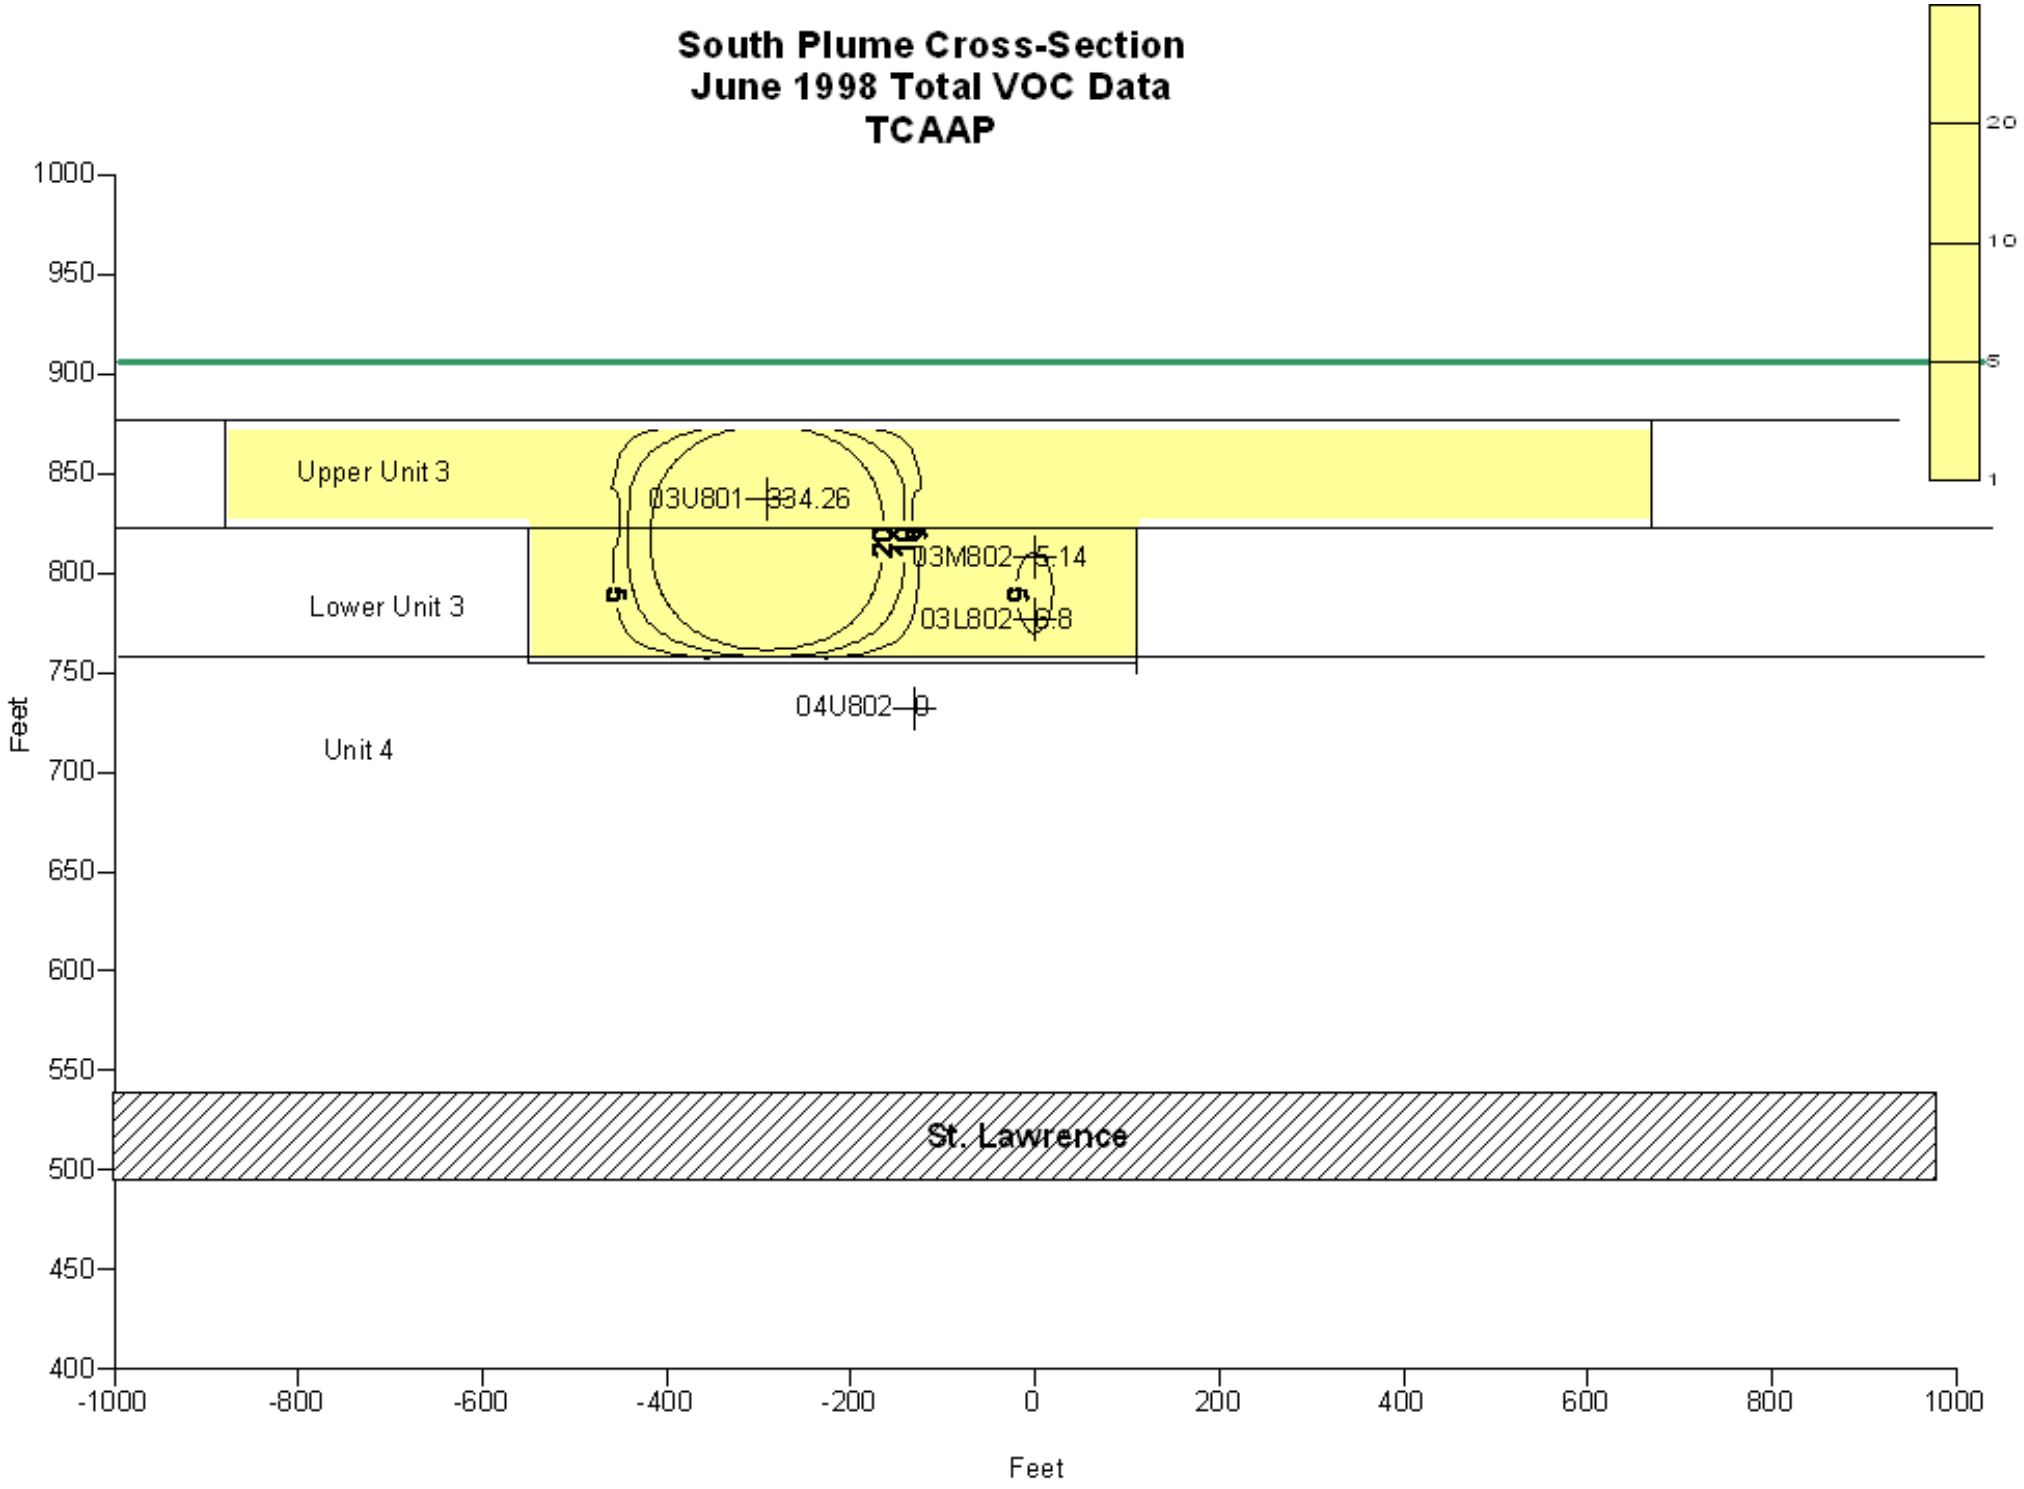
South Plume Cross-Section
June 1998 Total VOC Data
TCAAP
Upper Unit 3
Lower Unit 3
Unit 4
St. Lawrence
03U801
34.26
03M802
5.14
03L802
6.8
04U802
0
5
20
10
5
1
Feet
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-1000
-800
-600
-400
-200
0
200
400
600
800
1000

Groundwater Quality Data (Organics) - 1998		
Well	Date	TOTAL VOCs (ug/l)
03L806	6/12/1998	813.50
03M806	6/12/1998	692.99
03U711	6/16/1998	179.74
03U806*		655.00
04U711	6/9/1998	1.82
04U806	6/12/1998	674.90
PJ#806	6/12/1998	590.20
03L802	6/11/1998	6.80
03M802	6/17/1998	5.14
03U801	6/17/1998	334.26
04U802	6/11/1998	0.00

* Interpolated

South Plume

North plume

North Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Expanded Contouring and Blanking
TCAAP
June 1998

Concentration	Positive Planar Area (ft2)
Plume to 1	572327
Plume to 5	291283
Plume to 10	275277
Plume to 50	200943
Plume to 100	151271
Plume to 200	102729
Plume to 300	78851
Plume to 400	58828
Plume to 500	39484
Plume to 600	22174
Plume to 700	6155
Plume to 800	71
Plume to 900	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	281044	843132
5 to 10	7.5	16006	120046
10 to 50	30	74334	2230032
50 to 100	75	49671	3725356
100 to 200	150	48542	7281374
200 to 300	250	23877	5969303
300 to 400	350	20024	7008373
400 to 500	450	19344	8704734
500 to 600	550	17310	9520603
600 to 700	650	16018	10411811
700 to 800	750	6084	4563319
800 to 900	850	71	60279
	Sum	572327	60438362

Area Wtd Conc	106	ug/L

South Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Contouring and Blanking
TCAAP
June 1998

Concentration	Positive Planar Area (ft2)
Plume to 1	115236
Plume to 5	37221
Plume to 10	30498
Plume to 25	20858
Plume to 50	13520
Plume to 100	6920
Plume to 200	1673
Plume to 300	75
Plume to 400	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	78015	234045
5 to 10	7.5	6723	50426
10 to 25	17.5	9640	168693
25 to 50	37.5	7339	275194
50 to 100	75	6599	494951
100 to 200	150	5248	787167
200 to 300	250	1597	399360
300 to 400	350	75	26341
	Sum	115236	2436177

Area Wtd Conc	21	ug/L

1999

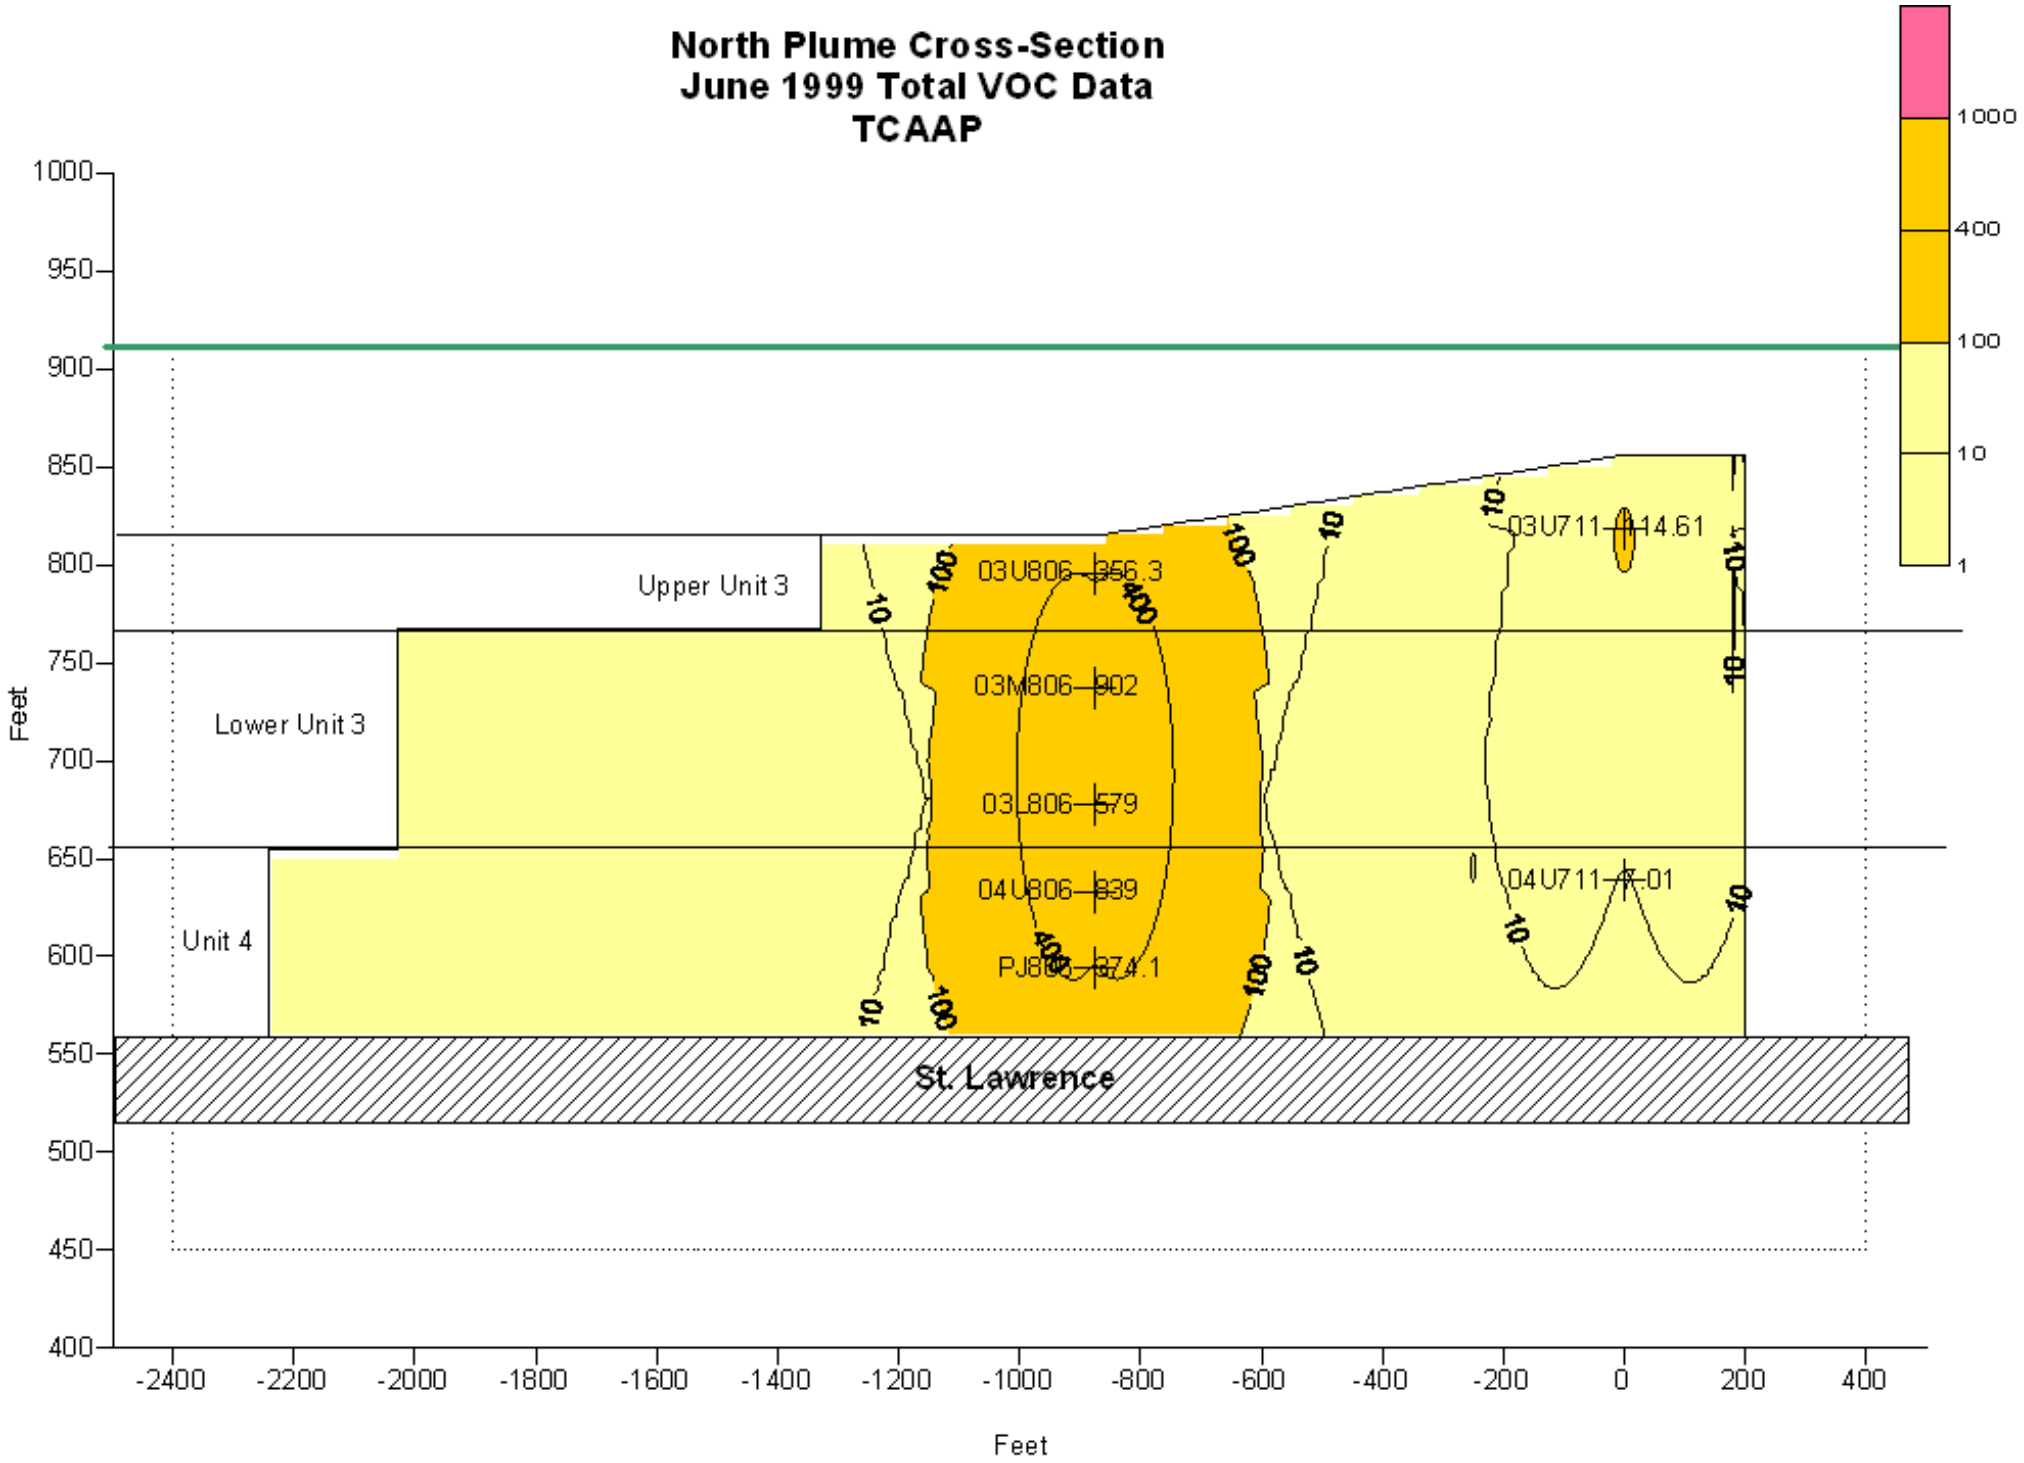
North Plume Cross-Section
June 1999 Total VOC Data
TCAAP
1000
400
100
10
1
Upper Unit 3
Lower Unit 3
Unit 4
St. Lawrence
03U806
356.3
03M806
902
03L806
579
04U806
839
PJ806
874.1
03U711
14.61
04U711
7.01
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-2400
-2200
-2000
-1800
-1600
-1400
-1200
-1000
-800
-600
-400
-200
0
200
400
Feet

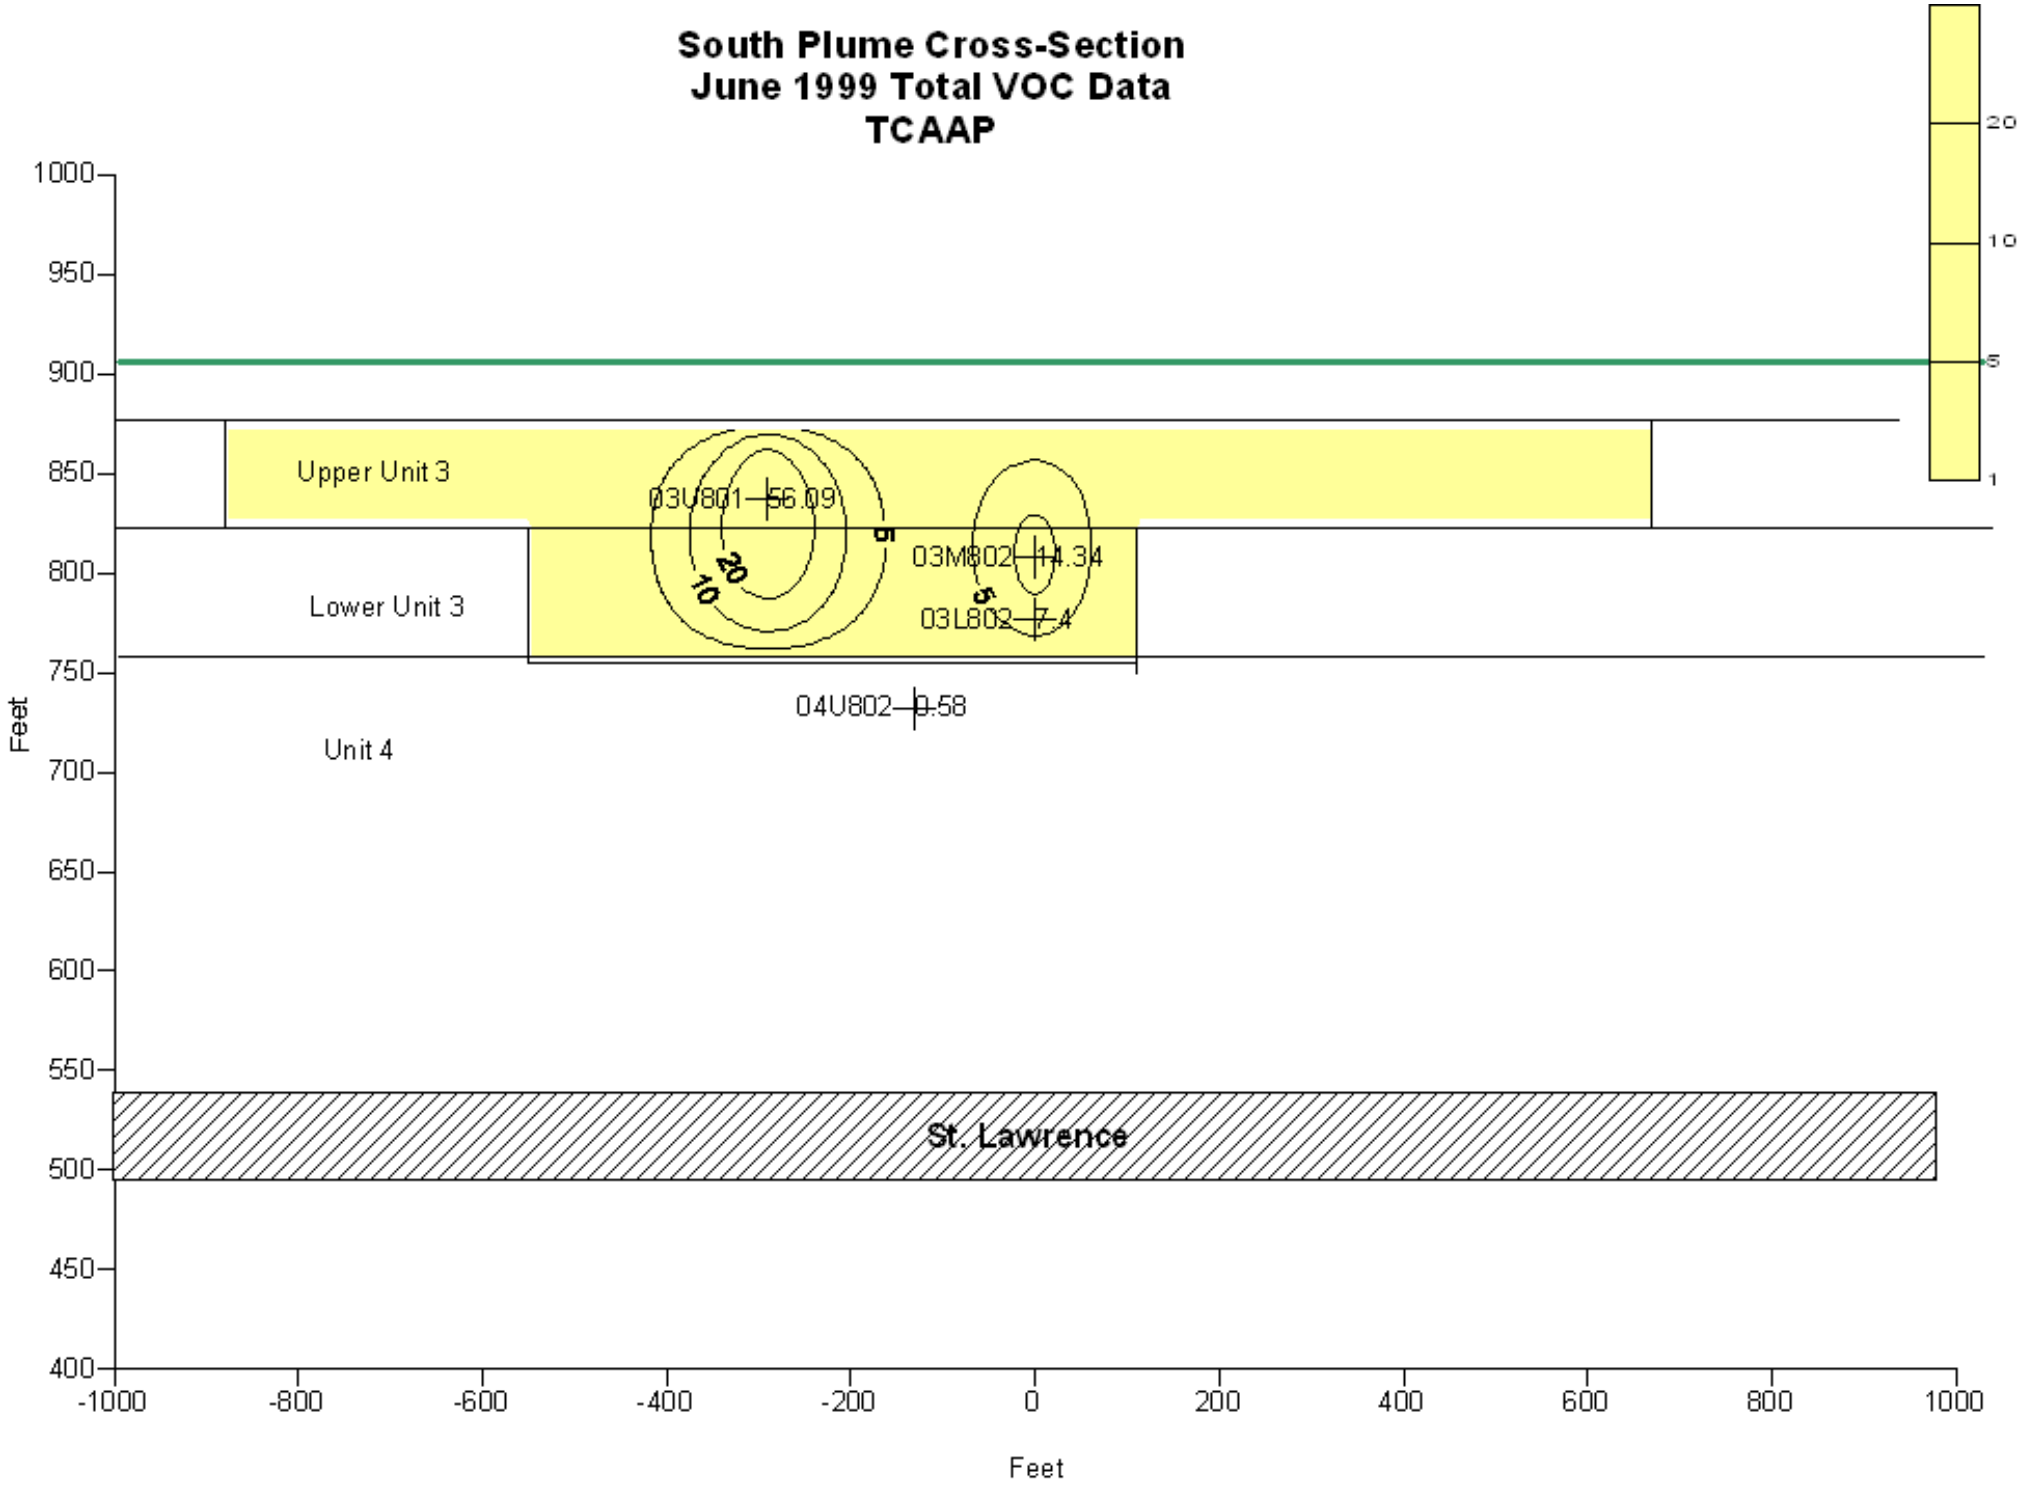
South Plume Cross-Section
June 1999 Total VOC Data
TCAAP
Upper Unit 3
Lower Unit 3
Unit 4
03U801 56.09
03M802 14.34
03L802 7.4
04U802 0.58
St. Lawrence
Feet
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-1000
-800
-600
-400
-200
0
200
400
600
800
1000
20
10
5
1

Groundwater Quality Data (Organics) - 1999		
Well	Date	TOTAL VOCs (ug/l)
03L802	6/23/1999	7.40
03M802	6/23/1999	14.34
03U801	6/29/1999	56.09
04U802	6/23/1999	0.58
03L806	6/23/1999	579.00
03M806*		902.00
03U711	6/28/1999	114.61
03U806	6/23/1999	356.30
04U711	6/28/1999	7.01
04U806	6/23/1999	839.00
PJ#806	6/23/1999	374.10

* Interpolated

South Plume

North plume

North Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Expanded Contouring and Blanking
TCAAP
June 1999

Concentration	Positive Planar Area (ft2)
Plume to 1	572514
Plume to 5	294922
Plume to 10	270495
Plume to 50	183129
Plume to 100	138286
Plume to 200	99392
Plume to 300	70102
Plume to 400	44570
Plume to 500	27825
Plume to 600	15887
Plume to 700	4664
Plume to 800	783
Plume to 900	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	277592	832777
5 to 10	7.5	24427	183204
10 to 50	30	87366	2620971
50 to 100	75	44843	3363213
100 to 200	150	38894	5834158
200 to 300	250	29290	7322437
300 to 400	350	25532	8936067
400 to 500	450	16746	7535697
500 to 600	550	11937	6565574
600 to 700	650	11223	7294904
700 to 800	750	3881	2910574
800 to 900	850	783	665891
	Sum	572514	54065467

Area Wtd Conc	94	ug/L

South Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Contouring and Blanking
TCAAP
June 1999

Concentration	Positive Planar Area (ft2)
Plume to 1	115236
Plume to 5	32196
Plume to 10	14726
Plume to 25	3947
Plume to 50	94
Plume to 100	0

TCE (ug/L)	Avg TCE (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	83040	249120
5 to 10	7.5	17470	131025
10 to 25	17.5	10779	188629
25 to 50	37.5	3854	144519
50 to 100	75	94	7016
	Sum	115236	720309

Area Wtd Conc	6	ug/L

2001

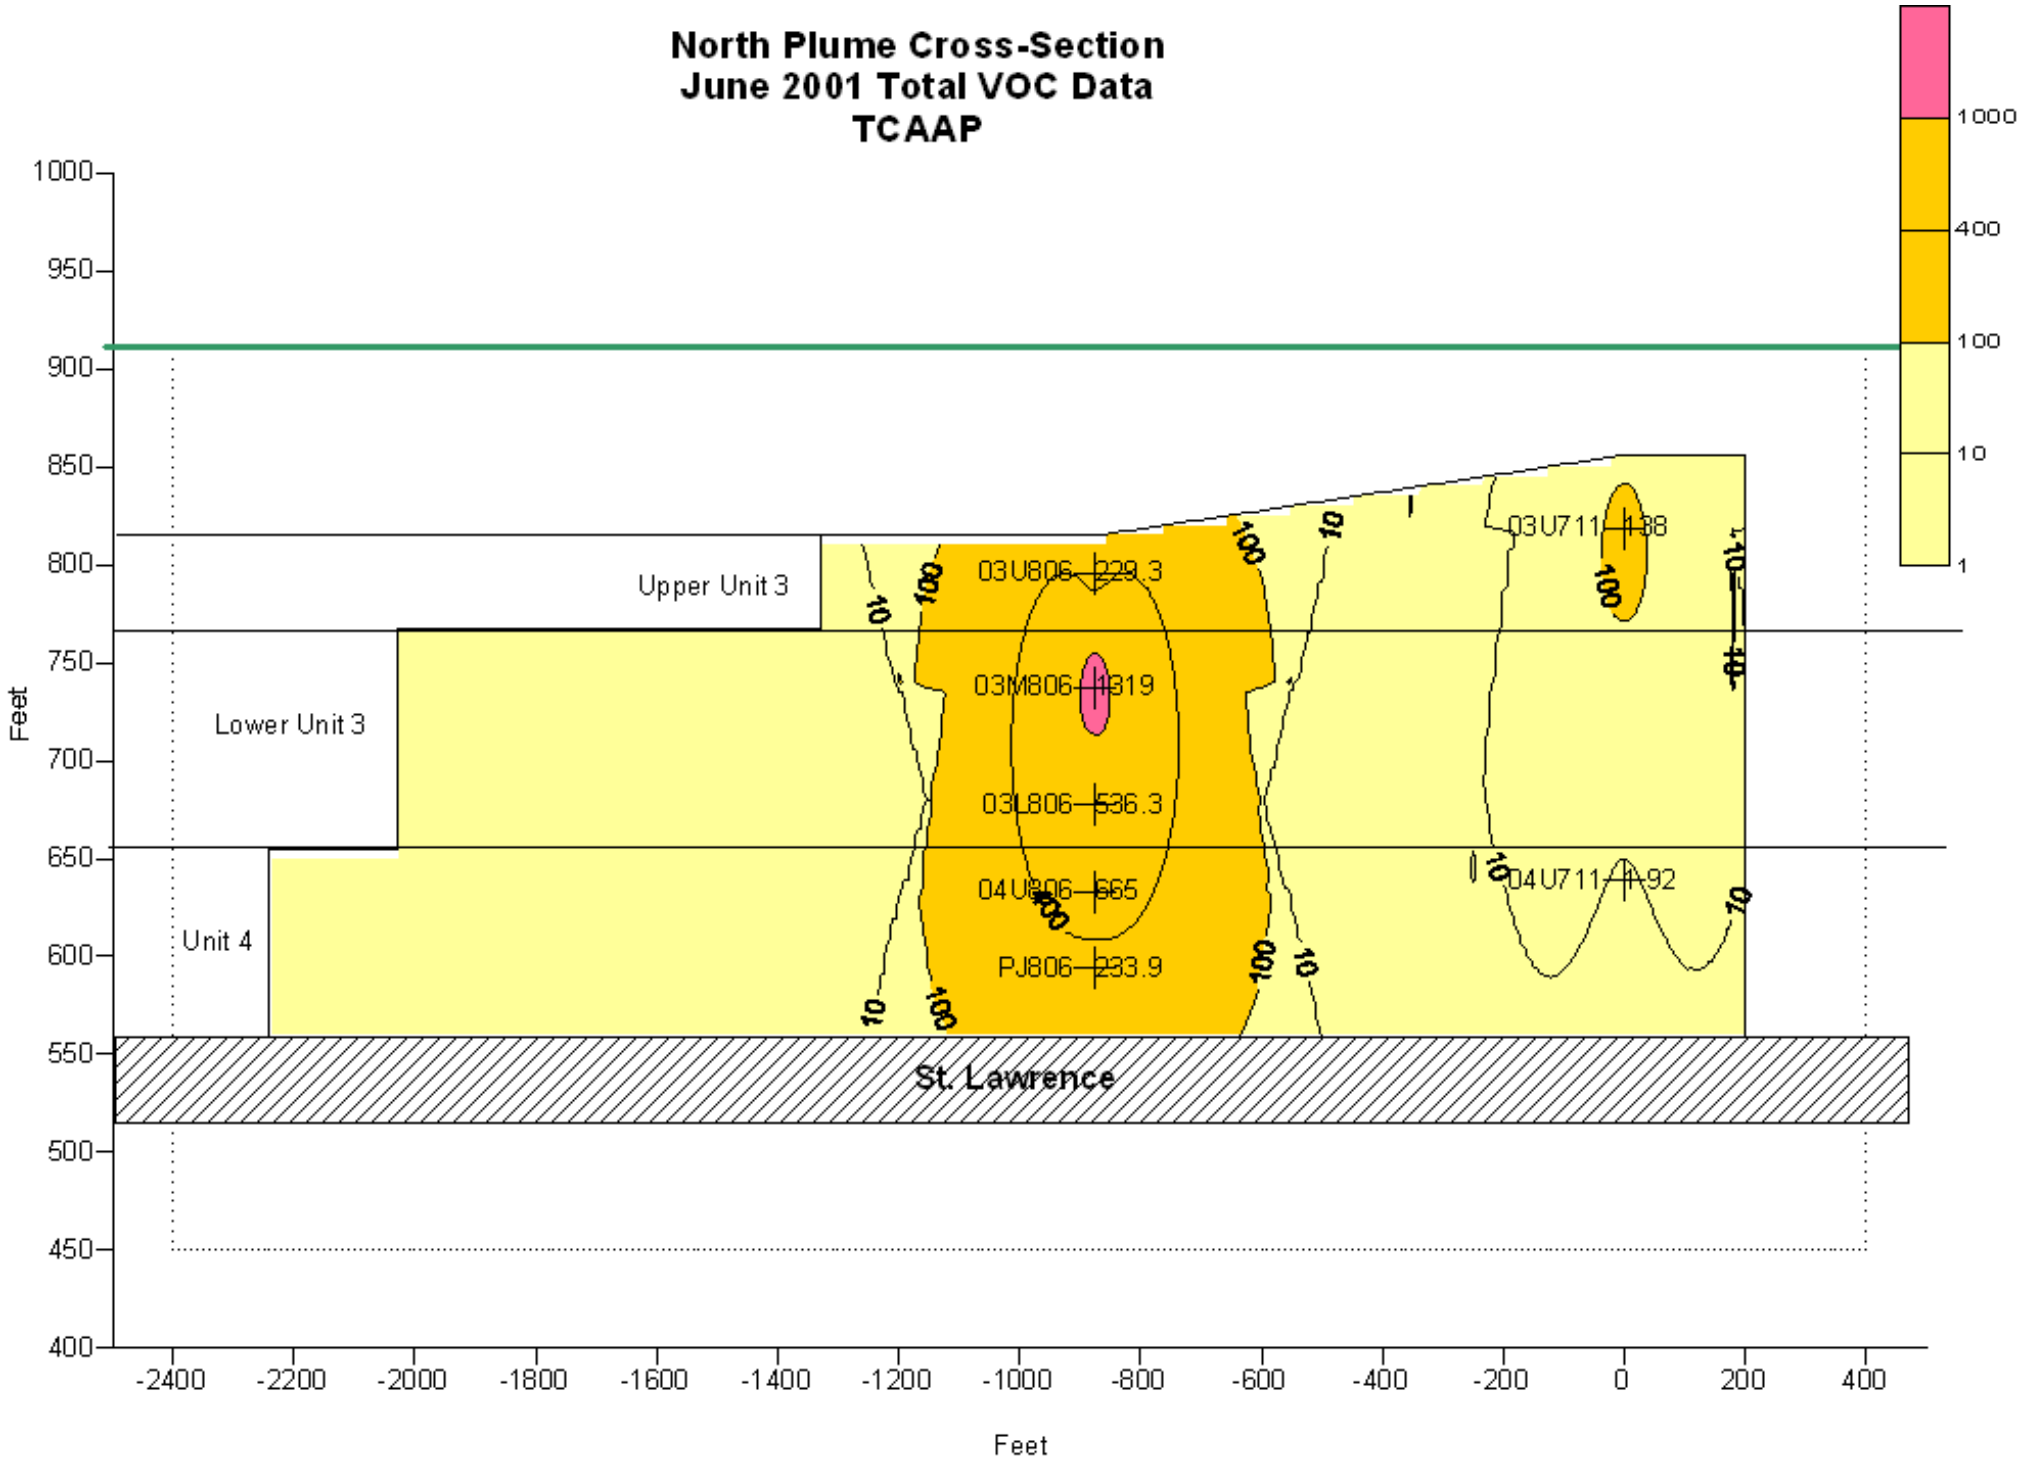
North Plume Cross-Section
June 2001 Total VOC Data
TCAAP
1000
400
100
10
1
Upper Unit 3
Lower Unit 3
Unit 4
St. Lawrence
03U806 229.3
03M806 819
03L806 536.3
04U806 665
PJ806 233.9
03U711 138
04U711 92
Feet
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-2400
-2200
-2000
-1800
-1600
-1400
-1200
-1000
-800
-600
-400
-200
0
200
400

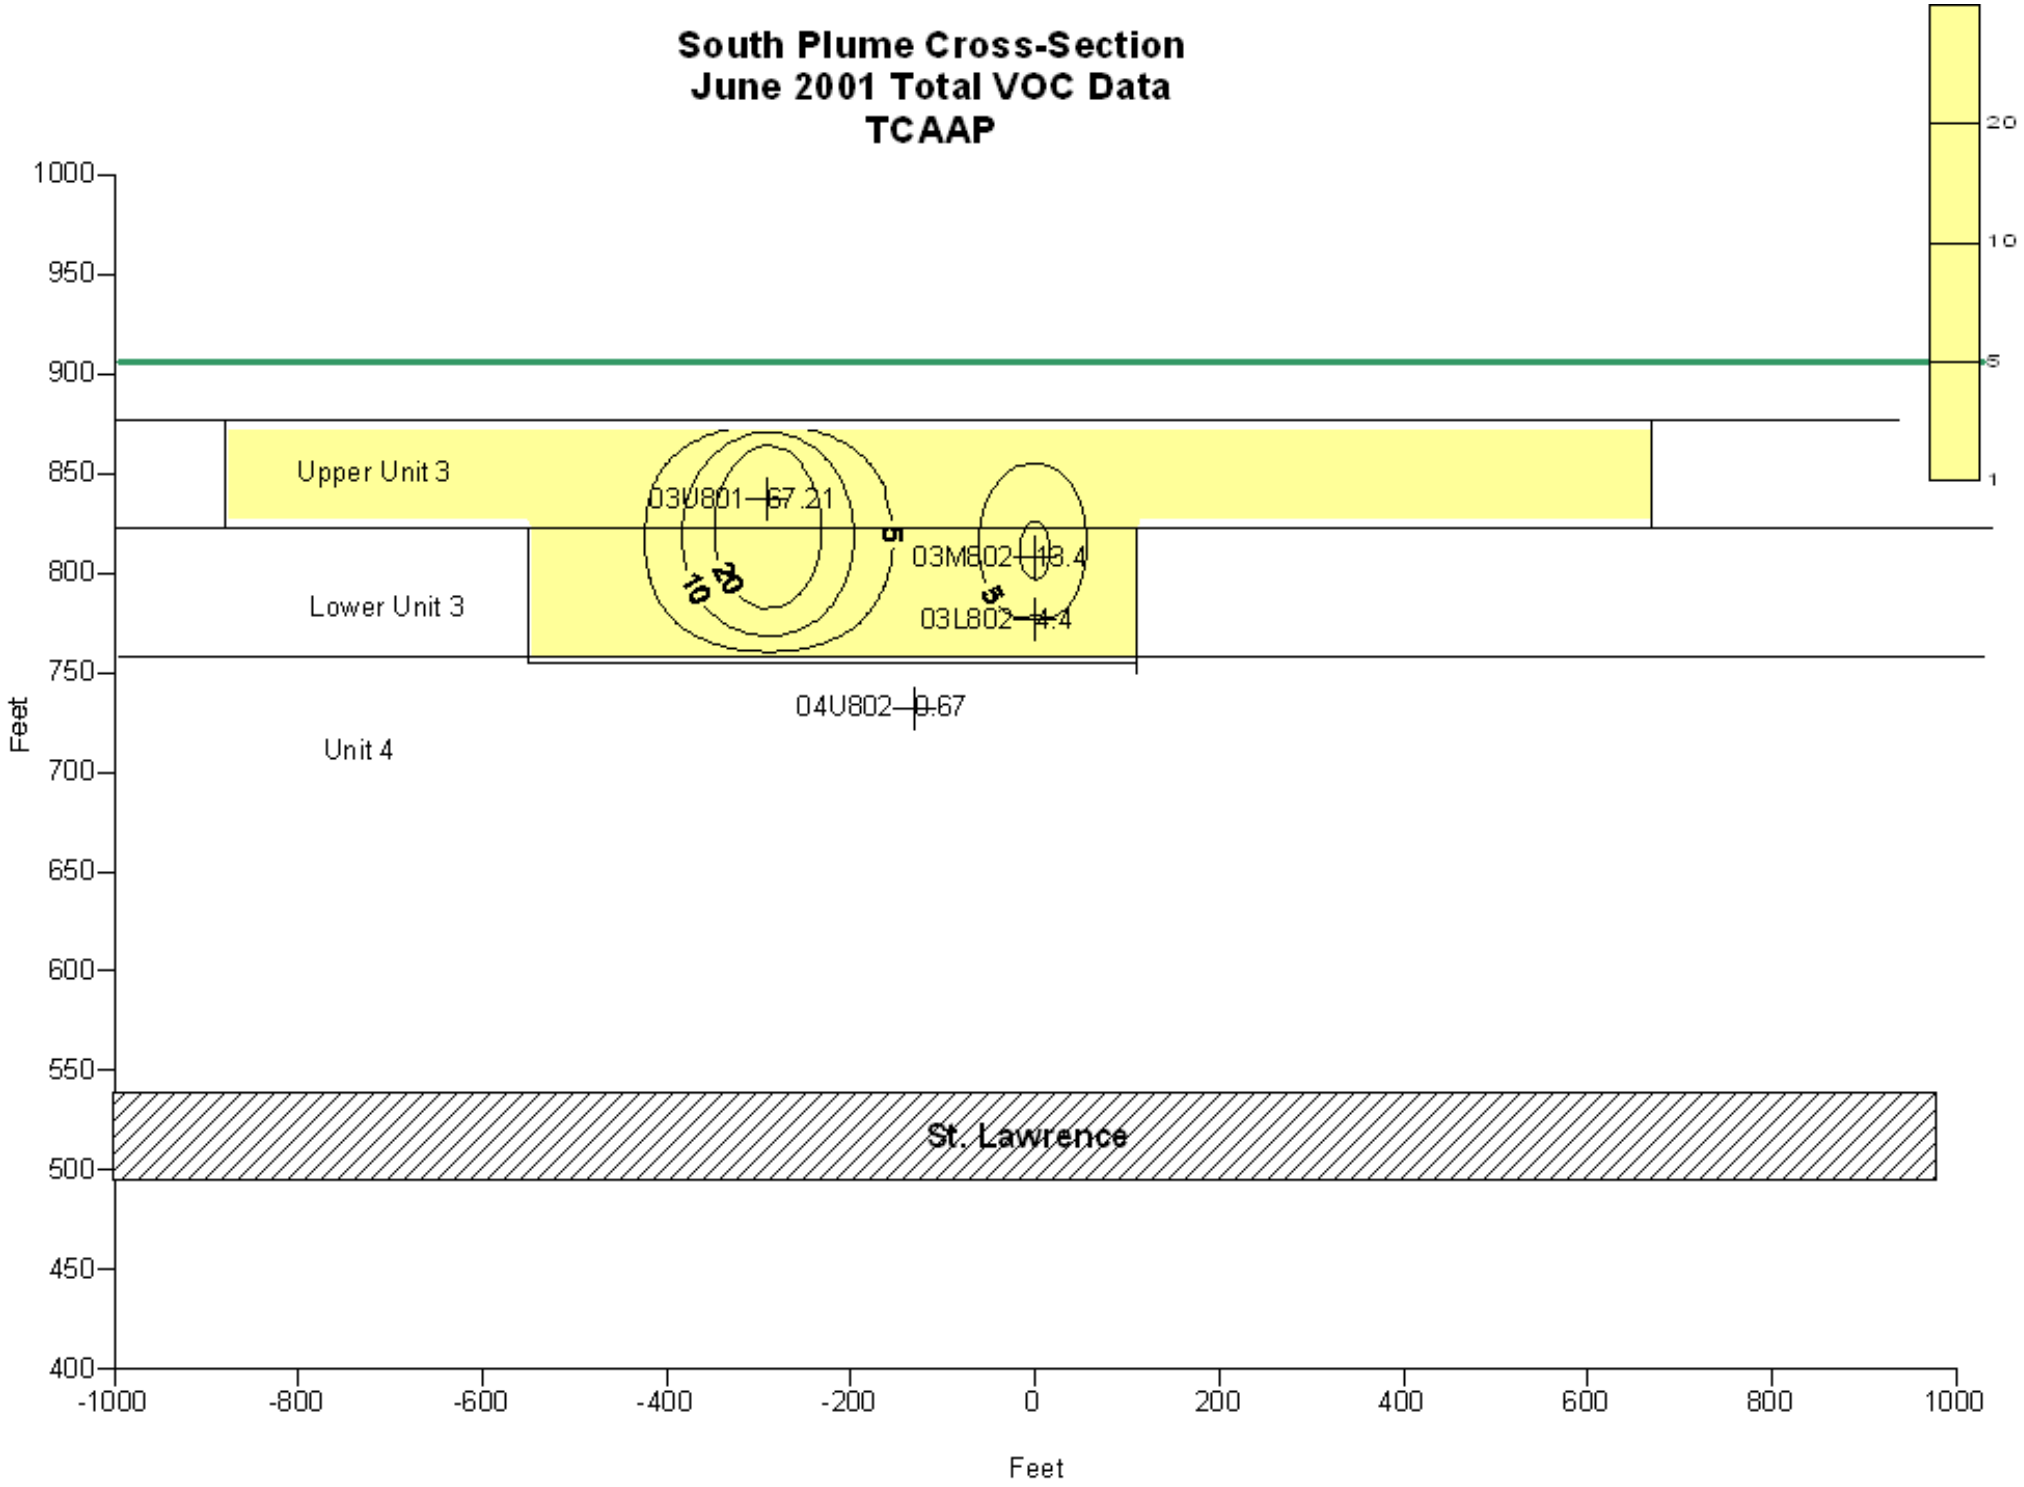
South Plume Cross-Section
June 2001 Total VOC Data
TCAAP
Upper Unit 3
Lower Unit 3
Unit 4
St. Lawrence
03U801—67.21
03M802—13.4
03L802—4.4
04U802—0.67
5
10
20
5
20
10
5
1
Feet
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-1000
-800
-600
-400
-200
0
200
400
600
800
1000

Groundwater Quality Data (Organics) - 2001		
Well	Date	TOTAL VOCs (ug/l)
03L806	6/15/2001	536.30
03M806*		1319.00
03U711	6/12/2001	138.00
03U806	6/15/2001	229.30
04U711	6/12/2001	1.92
04U806	6/15/2001	665.00
PJ#806	6/15/2001	233.90
03L802	6/19/2001	4.40
03M802	6/19/2001	13.40
03U801	6/18/2001	67.21
04U802	6/19/2001	0.67

* Interpolated

South Plume

North plume

North Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Expanded Contouring and Blanking
TCAAP
June 2001

Concentration	Positive Planar Area (ft2)
Plume to 1	572398
Plume to 5	288569
Plume to 10	267944
Plume to 50	191092
Plume to 100	143221
Plume to 200	103426
Plume to 300	65435
Plume to 400	42734
Plume to 500	28083
Plume to 600	16350
Plume to 700	9048
Plume to 800	5367
Plume to 900	3079
Plume to 1000	1615
Plume to 1100	697
Plume to 1200	184
Plume to 1300	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	283829	851488
5 to 10	7.5	20624	154683
10 to 50	30	76853	2305575
50 to 100	75	47871	3590299
100 to 200	150	39795	5969323
200 to 300	250	37991	9497682
300 to 400	350	22701	7945227
400 to 500	450	14651	6593110
500 to 600	550	11733	6453374
600 to 700	650	7302	4746206
700 to 800	750	3680	2760309
800 to 900	850	2288	1944735
900 to 1000	950	1465	1391325
1000 to 1100	1050	918	963849
1100 to 1200	1150	513	589863
1200 to 1300	1250	184	229853
	Sum	572398	55986901

Area Wtd Conc	98	ug/L

South Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Contouring and Blanking
TCAAP
June 2001

Concentration	Positive Planar Area (ft2)
Plume to 1	115236
Plume to 5	32494
Plume to 10	15927
Plume to 25	5422
Plume to 50	638
Plume to 100	0

TCE (ug/L)	Avg TCE (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	82743	248228
5 to 10	7.5	16567	124253
10 to 25	17.5	10505	183839
25 to 50	37.5	4783	179368
50 to 100	75	638	47878
	Sum	115236	783566

Area Wtd Conc	7	ug/L

2003

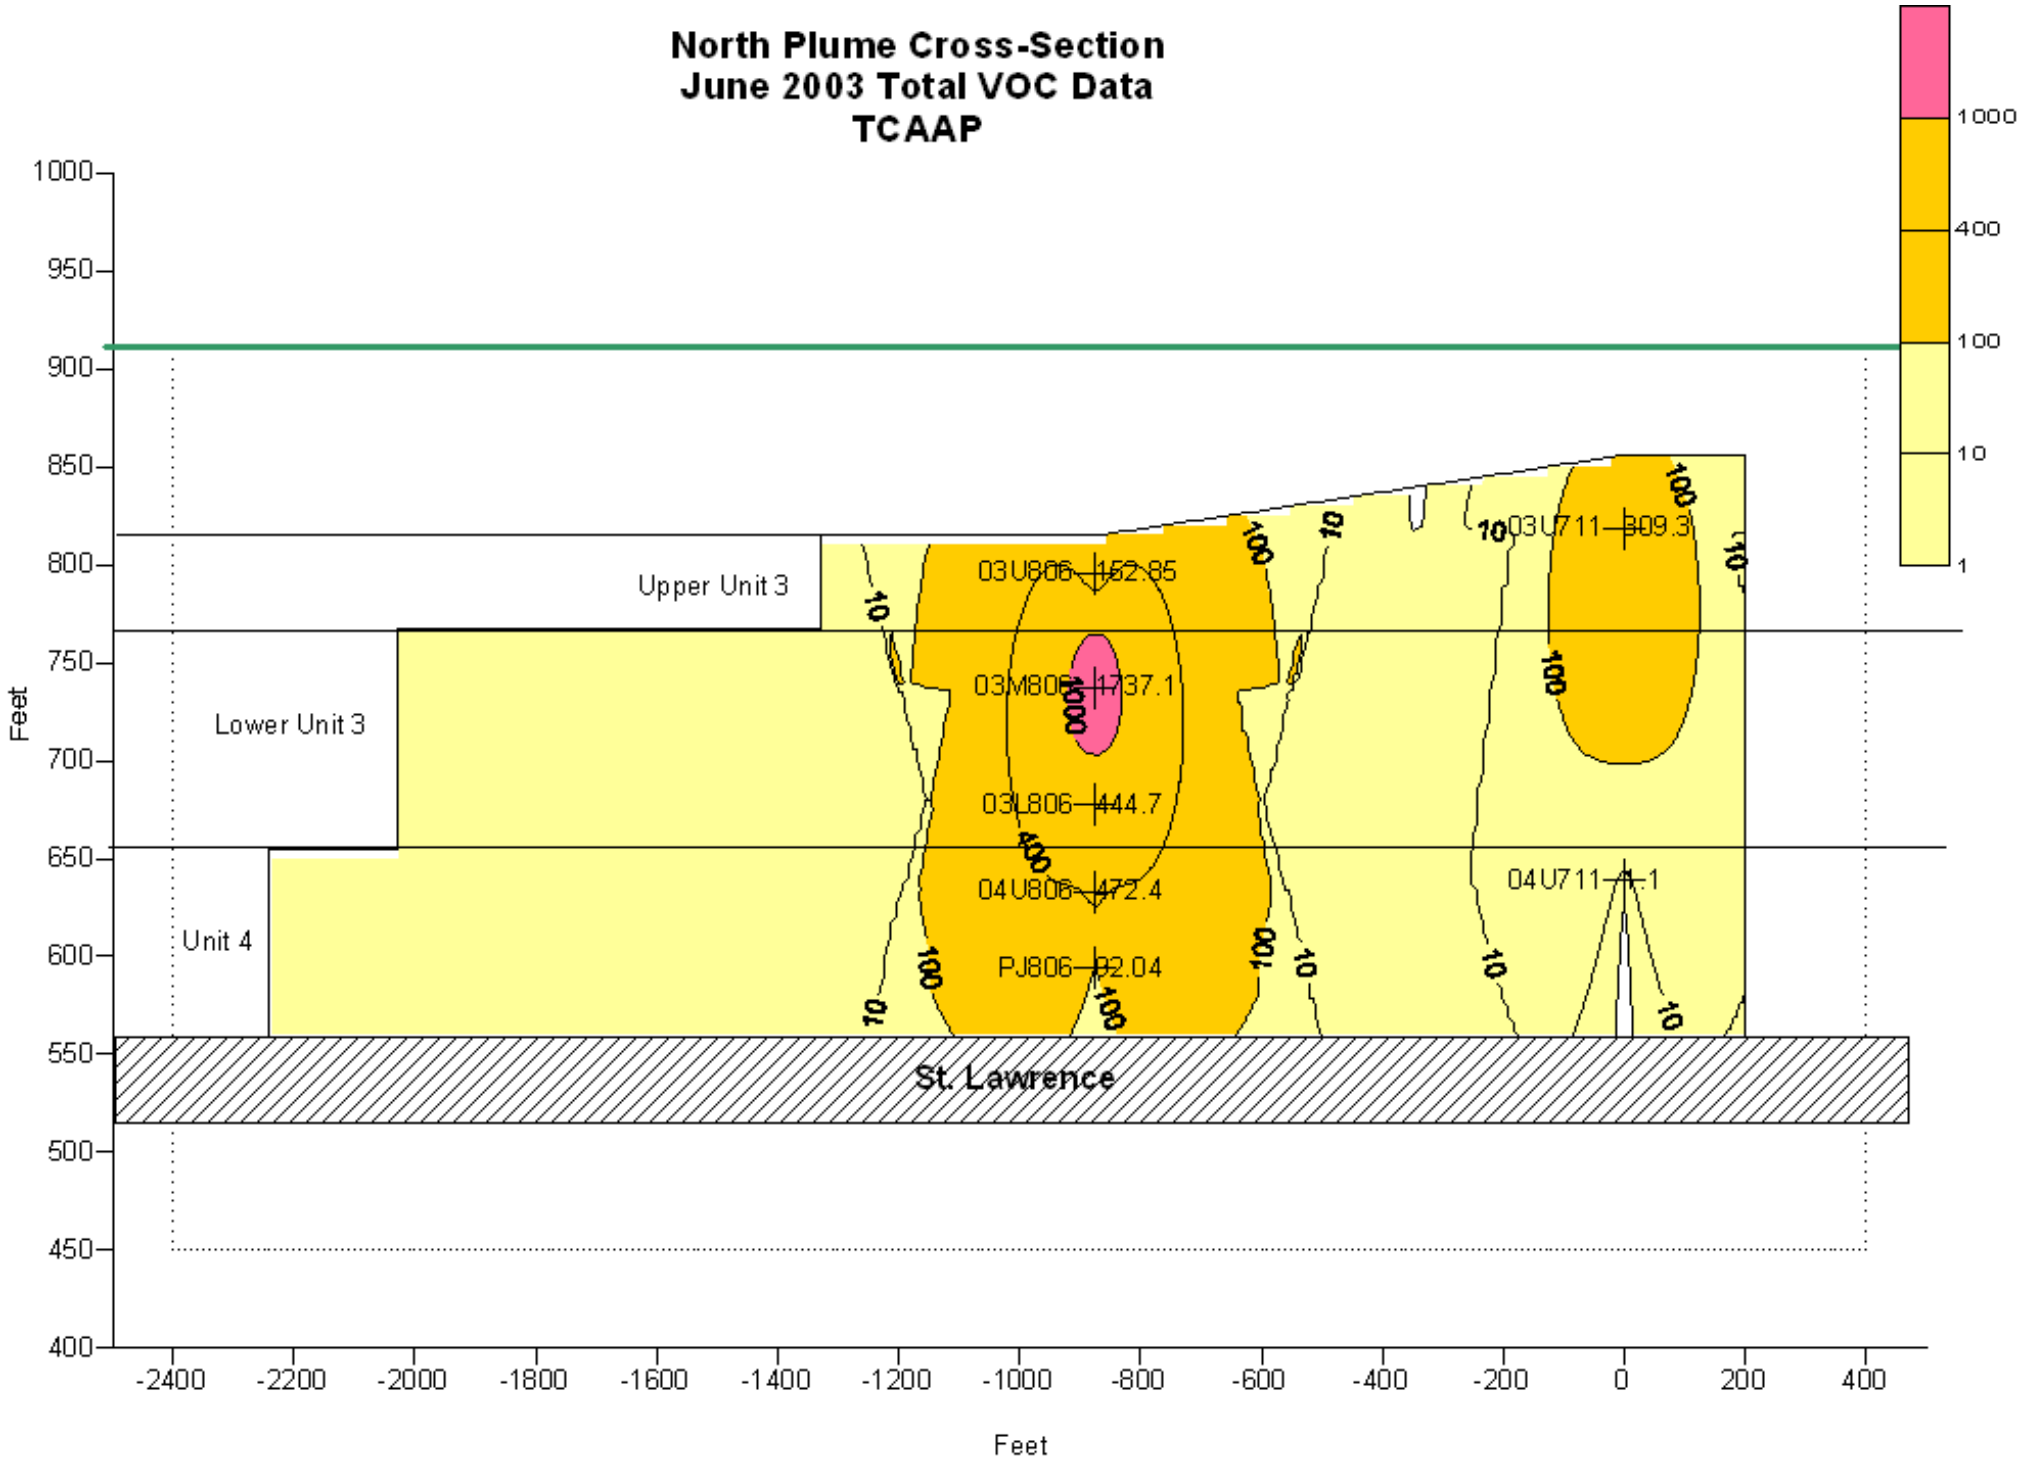
North Plume Cross-Section
June 2003 Total VOC Data
TCAAP
1000
400
100
10
1
Upper Unit 3
Lower Unit 3
Unit 4
St. Lawrence
03U806 152.85
03M806 1737.1
03L806 444.7
04U806 472.4
PJ806 92.04
03U711 309.3
04U711 1.1
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-2400
-2200
-2000
-1800
-1600
-1400
-1200
-1000
-800
-600
-400
-200
0
200
400
Feet

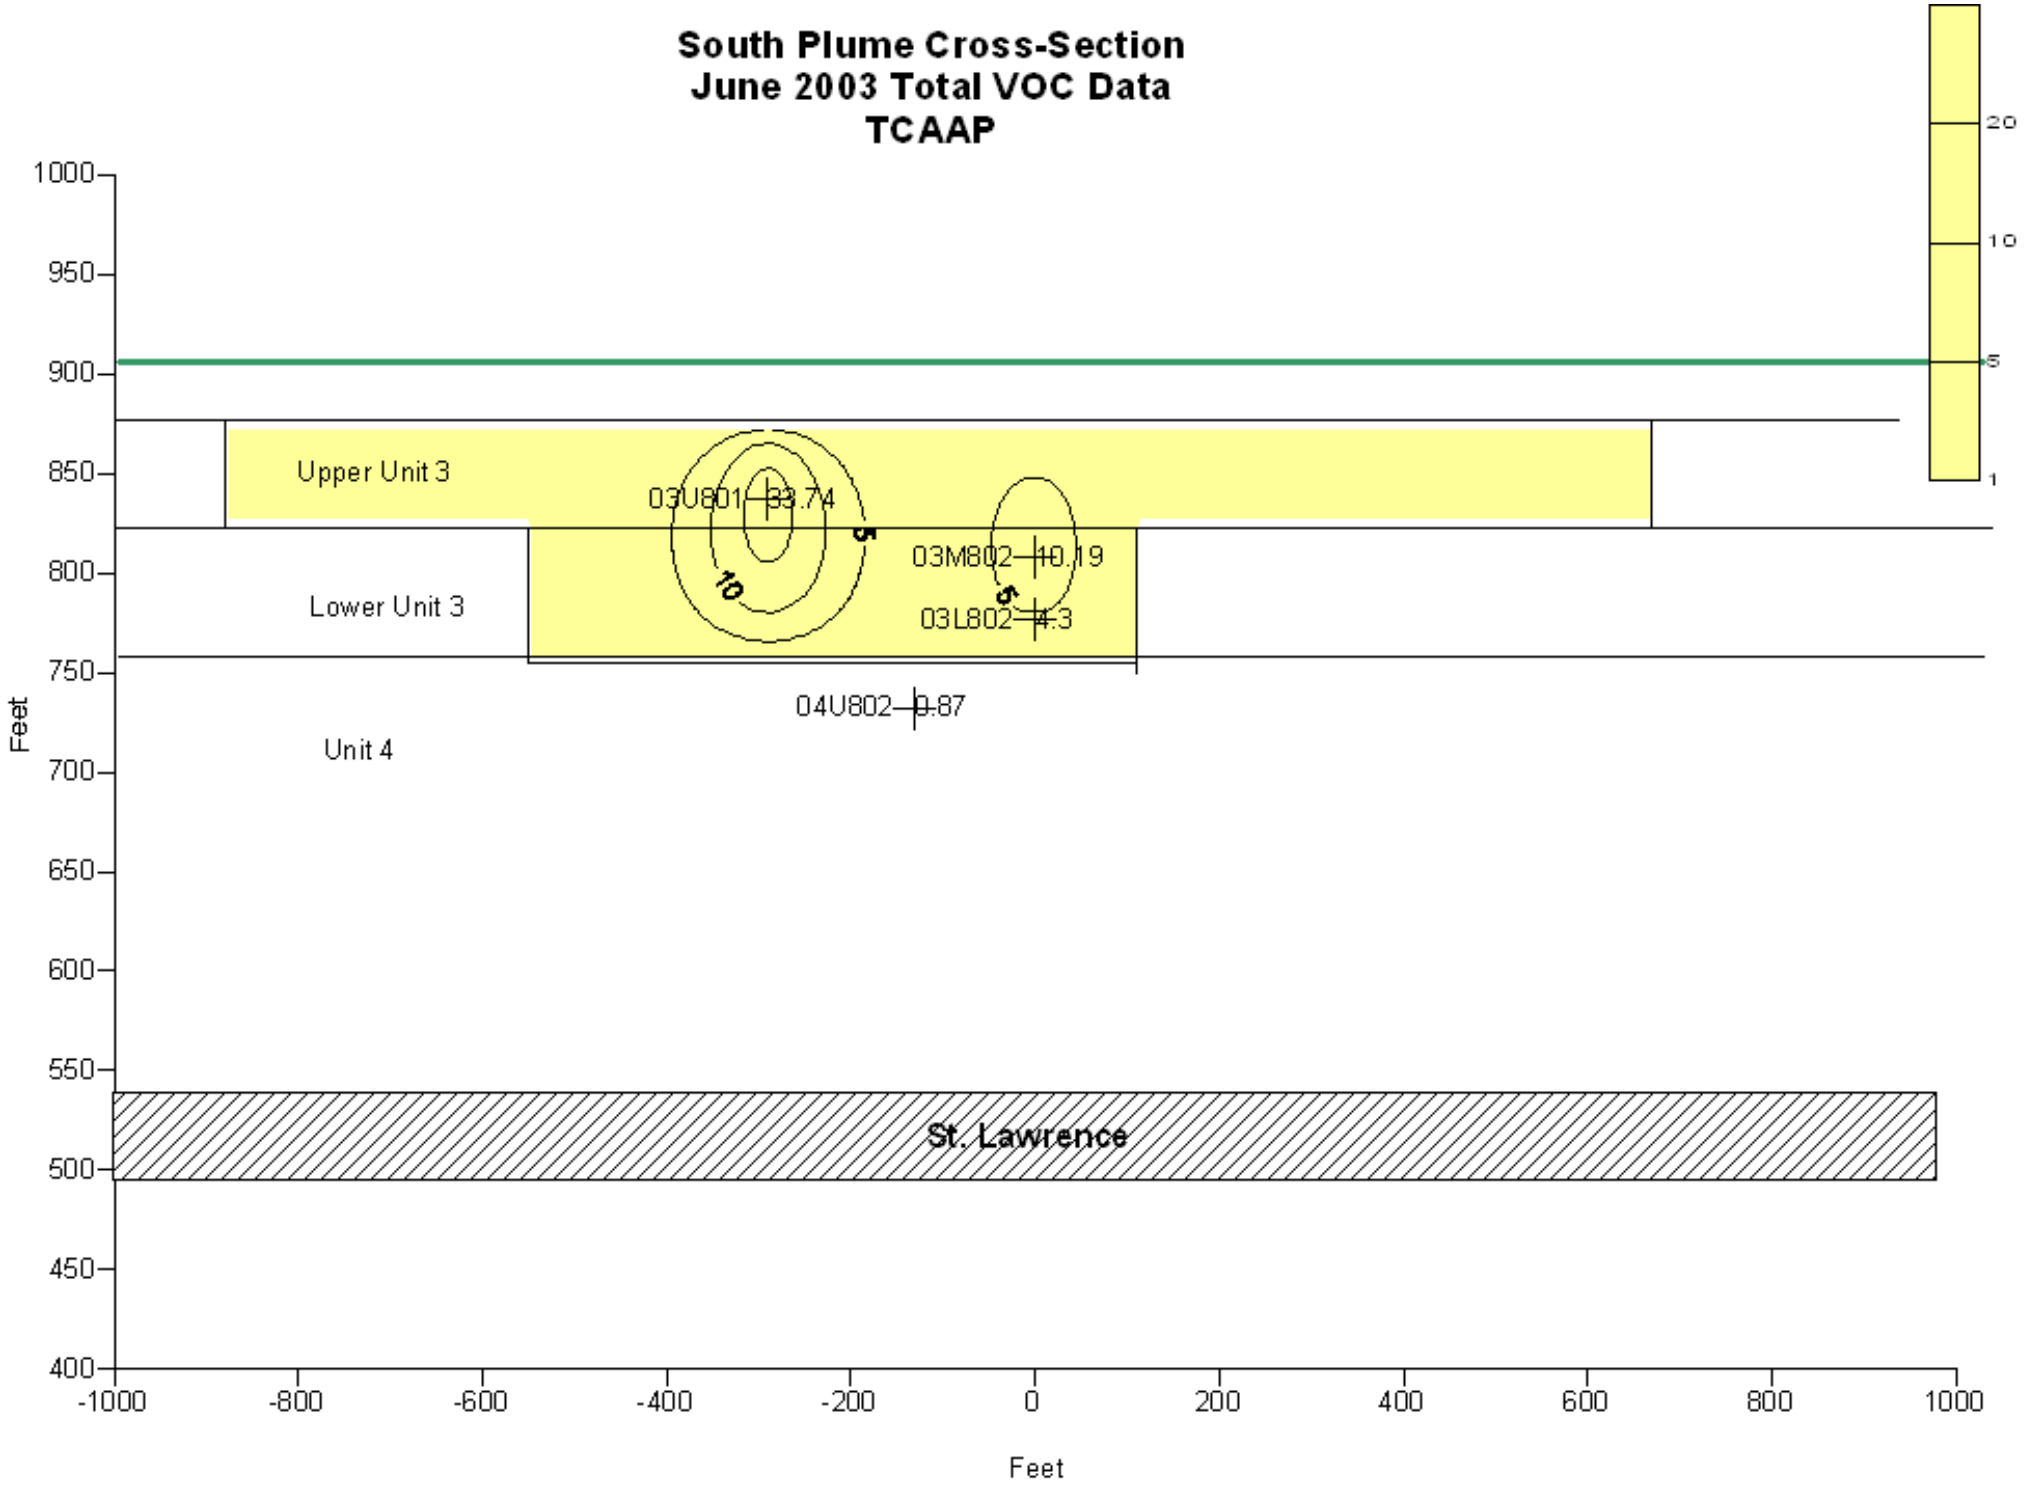
South Plume Cross-Section
June 2003 Total VOC Data
TCAAP
Upper Unit 3
Lower Unit 3
Unit 4
03U801 33.74
03M802 10.19
03L802 4.3
04U802 0.87
10
5
5
St. Lawrence
Feet
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-1000
-800
-600
-400
-200
0
200
400
600
800
1000
20
10
5
1

Groundwater Quality Data (Organics) - 2003		
Well	Date	TOTAL VOCs (ug/l)
03L806	6/12/2003	444.70
03M806	6/12/2003	1737.10
03U711	6/17/2003	309.30
03U806	6/16/2003	152.85
04U711	6/17/2003	1.10
04U806	6/16/2003	472.40
PJ#806	6/12/2003	92.04
03L802	6/17/2003	4.30
03M802	6/17/2003	10.19
03U801	6/17/2003	33.74
04U802	6/17/2003	0.87

South Plume
North plume

North Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Expanded Contouring and Blanking
TCAAP
June 2003

Concentration	Positive Planar Area (ft2)
Plume to 1	570970
Plume to 5	293399
Plume to 10	285615
Plume to 50	226380
Plume to 100	172784
Plume to 200	104726
Plume to 300	62076
Plume to 400	41078
Plume to 500	26311
Plume to 600	17751
Plume to 700	12321
Plume to 800	8684
Plume to 900	6147
Plume to 1000	4318
Plume to 1100	2971
Plume to 1200	1969
Plume to 1300	1227
Plume to 1400	687
Plume to 1500	318
Plume to 1600	93
Plume to 1700	0

TCE (ug/L)	Avg TCE (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	277571	832713
5 to 10	7.5	7784	58377
10 to 50	30	59235	1777060
50 to 100	75	53596	4019665
100 to 200	150	68058	10208666
200 to 300	250	42650	10662576
300 to 400	350	20998	7349150
400 to 500	450	14767	6645320
500 to 600	550	8560	4708004
600 to 700	650	5430	3529256
700 to 800	750	3638	2728383
800 to 900	850	2537	2156220
900 to 1000	950	1829	1737148
1000 to 1100	1050	1348	1414965
1100 to 1200	1150	1002	1151948
1200 to 1300	1250	742	927859
1300 to 1400	1350	539	728236
1400 to 1500	1450	369	534776
1500 to 1600	1550	226	349576
1600 to 1700	1650	93	153324
	Sum	570970	61673222

Area Wtd Conc	108	ug/L

South Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Contouring and Blanking
TCAAP
June 2003

Concentration	Positive Planar Area (ft2)
Plume to 1	115236
Plume to 5	22810
Plume to 10	8328
Plume to 25	701
Plume to 50	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	92426	277278
5 to 10	7.5	14482	108617
10 to 25	17.5	7627	133469
25 to 50	37.5	701	26296
	Sum	115236	545660

Area Wtd Conc	5	ug/L

2004

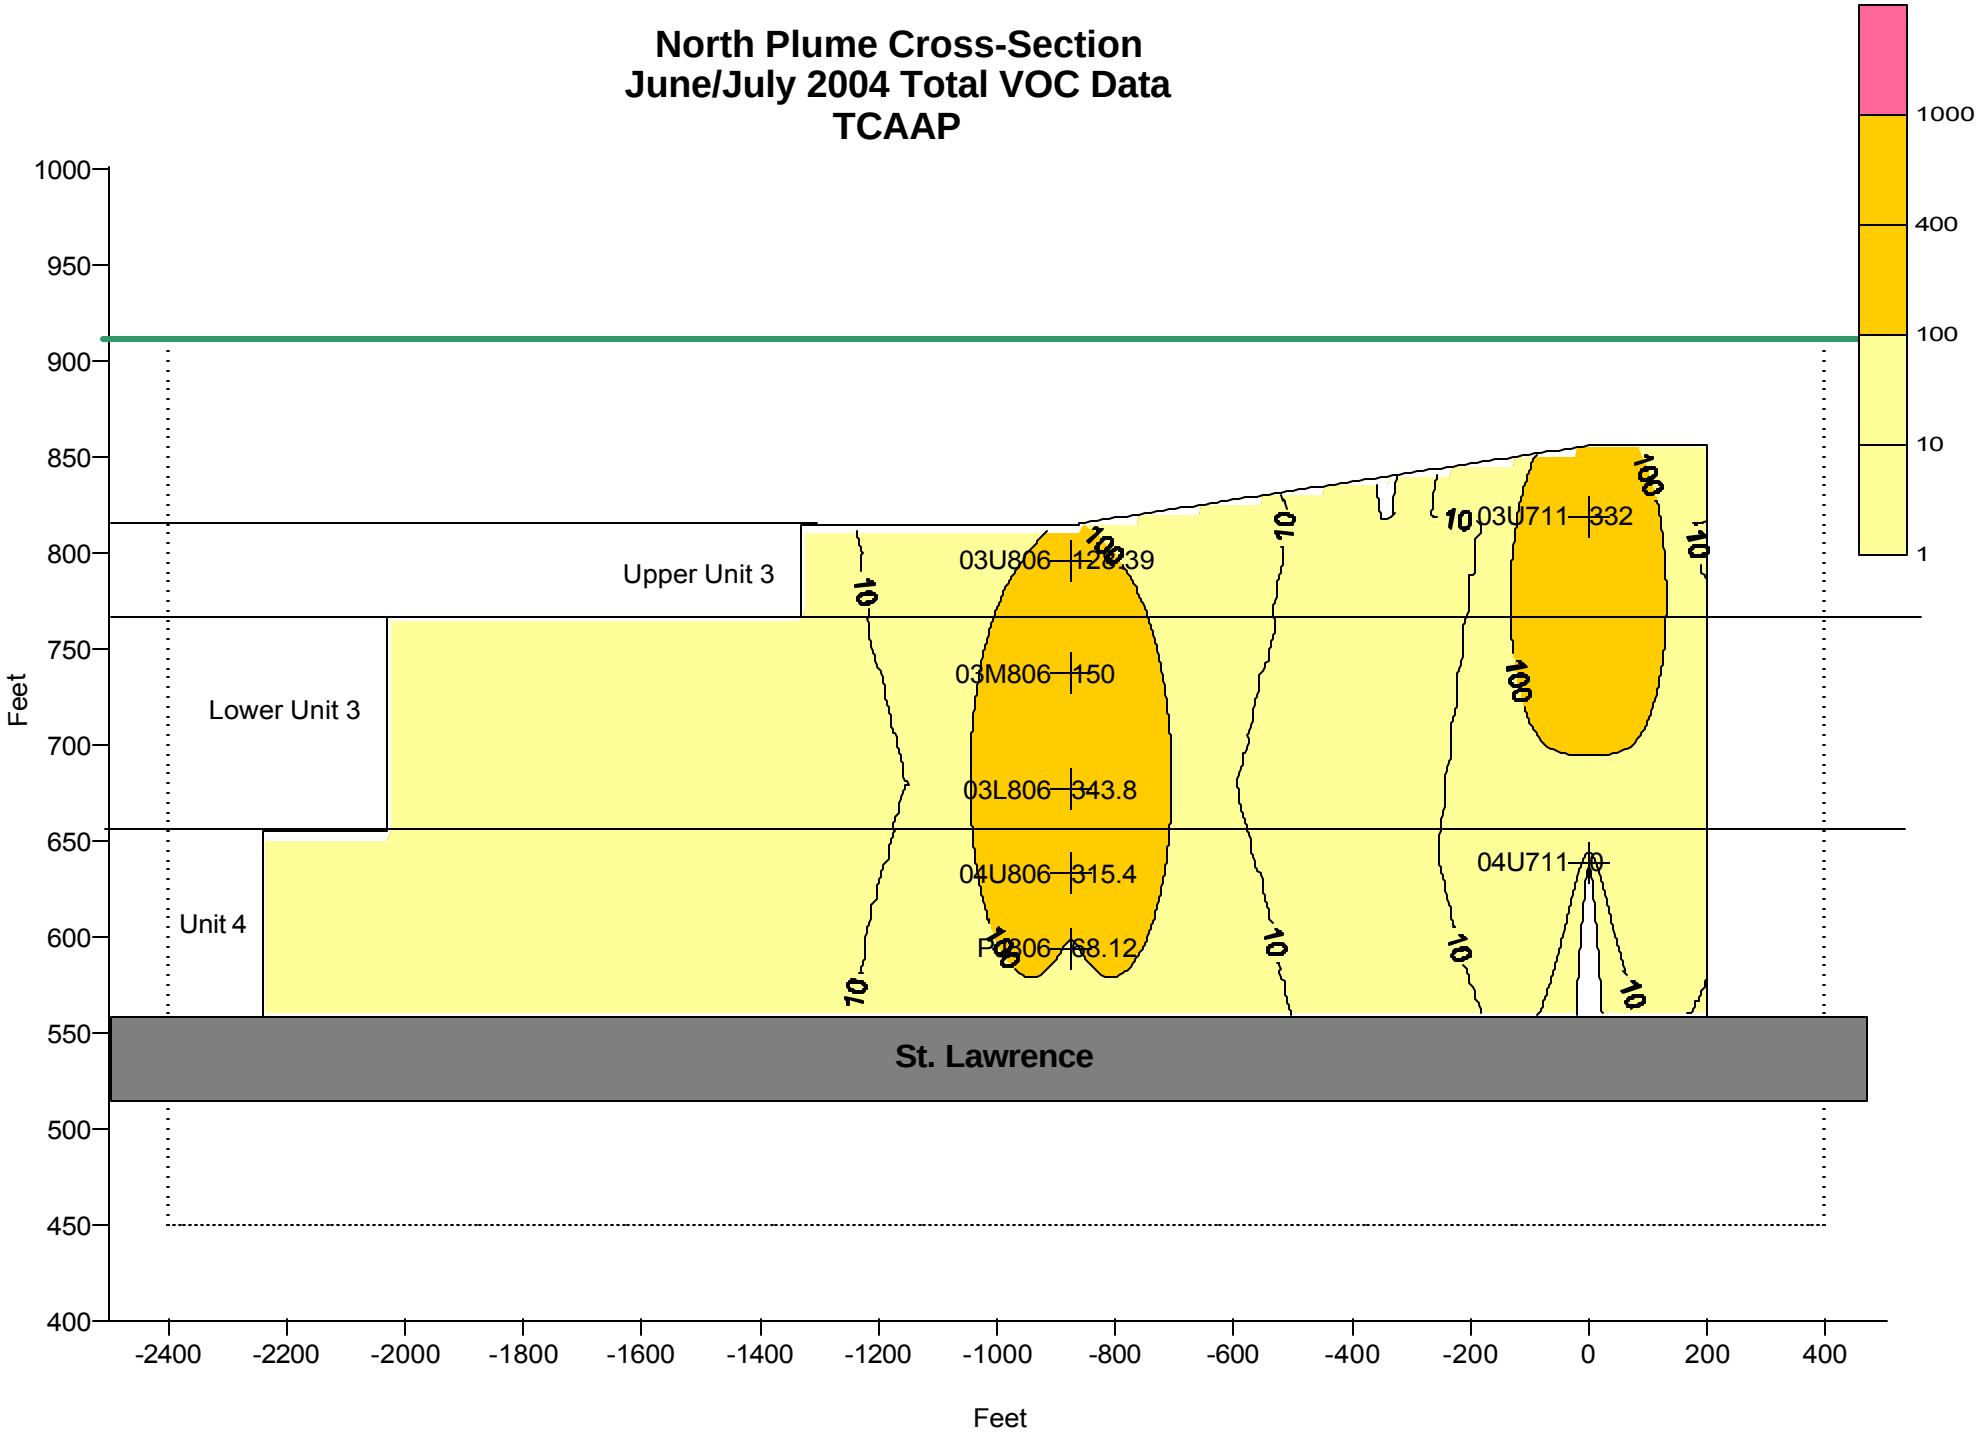
North Plume Cross-Section
June/July 2004 Total VOC Data
TCAAP
1000
400
100
10
1
Upper Unit 3
Lower Unit 3
Unit 4
03U806—128.39
03M806—150
03L806—343.8
04U806—315.4
P806—68.12
03U711—332
04U711—0
St. Lawrence
Feet
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-2400
-2200
-2000
-1800
-1600
-1400
-1200
-1000
-800
-600
-400
-200
0
200
400

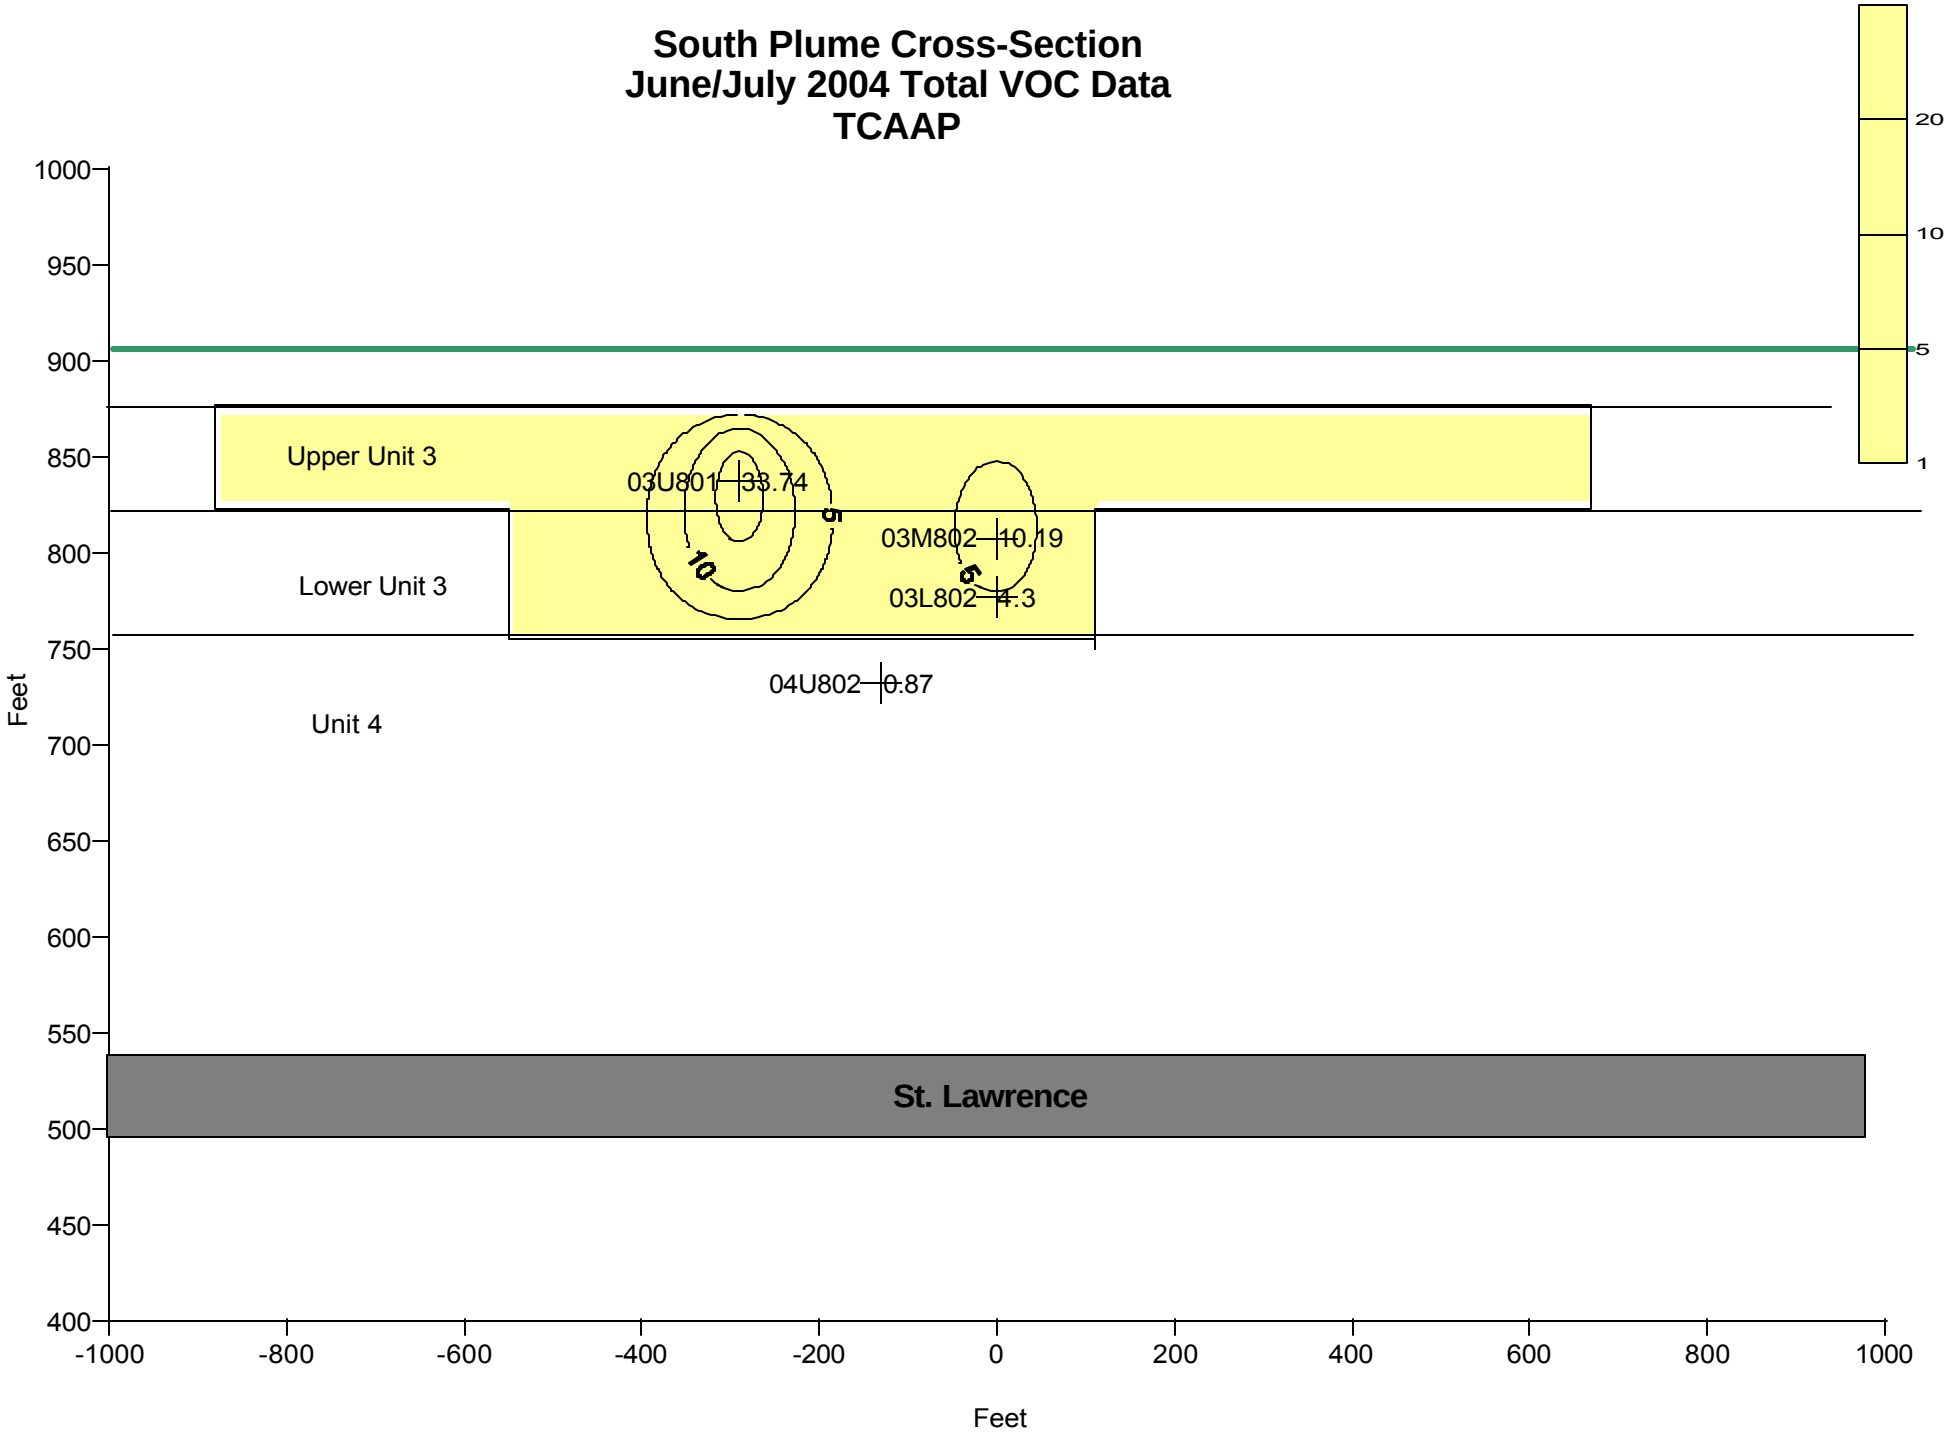
South Plume Cross-Section
June/July 2004 Total VOC Data
TCAAP
20
10
5
1
Upper Unit 3
Lower Unit 3
Unit 4
03U801 33.74
03M802 10.19
03L802 4.3
04U802 0.87
10
5
5
St. Lawrence
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-1000
-800
-600
-400
-200
0
200
400
600
800
1000
Feet

Groundwater Quality Data
Fiscal Year 2004
TGRS, TCAAP
Arden Hills, Minnesota

Location	Date	*1,1,1-Trichloroethane*	*1,1-Dichloroethane*	*1,1-Dichloroethene*	*1,2-Dichloroethane*	*cis-1,2-Dichloroethene*	*Tetrachloroethene*	*Trichloroethene*	*Total VOCs*
TGRS Cleanup Level[1]		200 µg/L	70 µg/L	6 µg/L	4 µg/L	70 µg/L	5 µg/L	5 µg/L	µg/L
03L802	7/7/04	<1	<1	<1	<1	<1	<1	4.2	4.2
03M802	6/17/04	<1	<1	<1	<1	<1	<1	11	11
03U801	6/17/04	<1	<1	<1	<1	0.6P	<1	34	34.61
04U802	7/7/04	<1	<1	<1	<1	<1	<1	<1	0
03L806	7/7/04	37	29	25	<1	2.8	<1	250	343.8
03M806	6/18/04	<1	19	9.9	<1	1.1	<1	120	150
03U711	7/6/04	51	10	14	<1	4.6	2.4	250	332
03U806	6/18/04	<1	3.6	2.9	<1	0.6P	1.3	120	128.39
04U711	7/6/04	<1	<1	<1	<1	<1	<1	<1	0
04U806	6/17/04	18	24	20	<1	3.4	<1	250	315.4
PJ#806	6/17/04	1.4	2.9	2.4	<1	0.4P	<1	61	68.12

Notes:
(1) Cleanup levels for TGRS are from the OU2 ROD. Shading indicates exceedence of the cleanup level.
D - Duplicate Analysis
J - Value is estimated
P - Results less than reporting level but greater than instrument detection limit.
South Plume
North Plume

Assumptions:
(<) values were treated as 0
any value with a text before or after number was treated as the detection.

North Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Expanded Contouring and Blanking
TCAAP
June/July 2004

Concentration	Positive Planar Area (ft2)
Plume to 1	569991
Plume to 5	288686
Plume to 10	271528
Plume to 50	186104
Plume to 100	120640
Plume to 200	51763
Plume to 300	26657
Plume to 400	15227
Plume to 500	9171
Plume to 600	5618
Plume to 700	3378
Plume to 800	1909
Plume to 900	950
Plume to 1000	358
Plume to 1100	52
Plume to 1200	0

TCE (ug/L)	Avg TCE (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	281305	843916
5 to 10	7.5	17158	128682
10 to 50	30	85425	2562744
50 to 100	75	65463	4909742
100 to 200	150	68878	10331672
200 to 300	250	25105	6276324
300 to 400	350	11430	4000556
400 to 500	450	6056	2725346
500 to 600	550	3553	1954040
600 to 700	650	2240	1455778
700 to 800	750	1469	1101604
800 to 900	850	960	815703
900 to 1000	950	591	561797
1000 to1100	1050	306	321663
1100 to1200	1150	52	59923
	Sum	569991	38049490

Area Wtd Conc	67	ug/L

South Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Contouring and Blanking
TCAAP
June/July 2004

Concentration	Positive Planar Area (ft2)
Plume to 1	115236
Plume to 5	26387
Plume to 10	9922
Plume to 25	705
Plume to 50	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	88849	266548
5 to 10	7.5	16465	123487
10 to 25	17.5	9217	161298
25 to 50	37.5	705	26443
	Sum	115236	577775

Area Wtd Conc	5	ug/L

2005

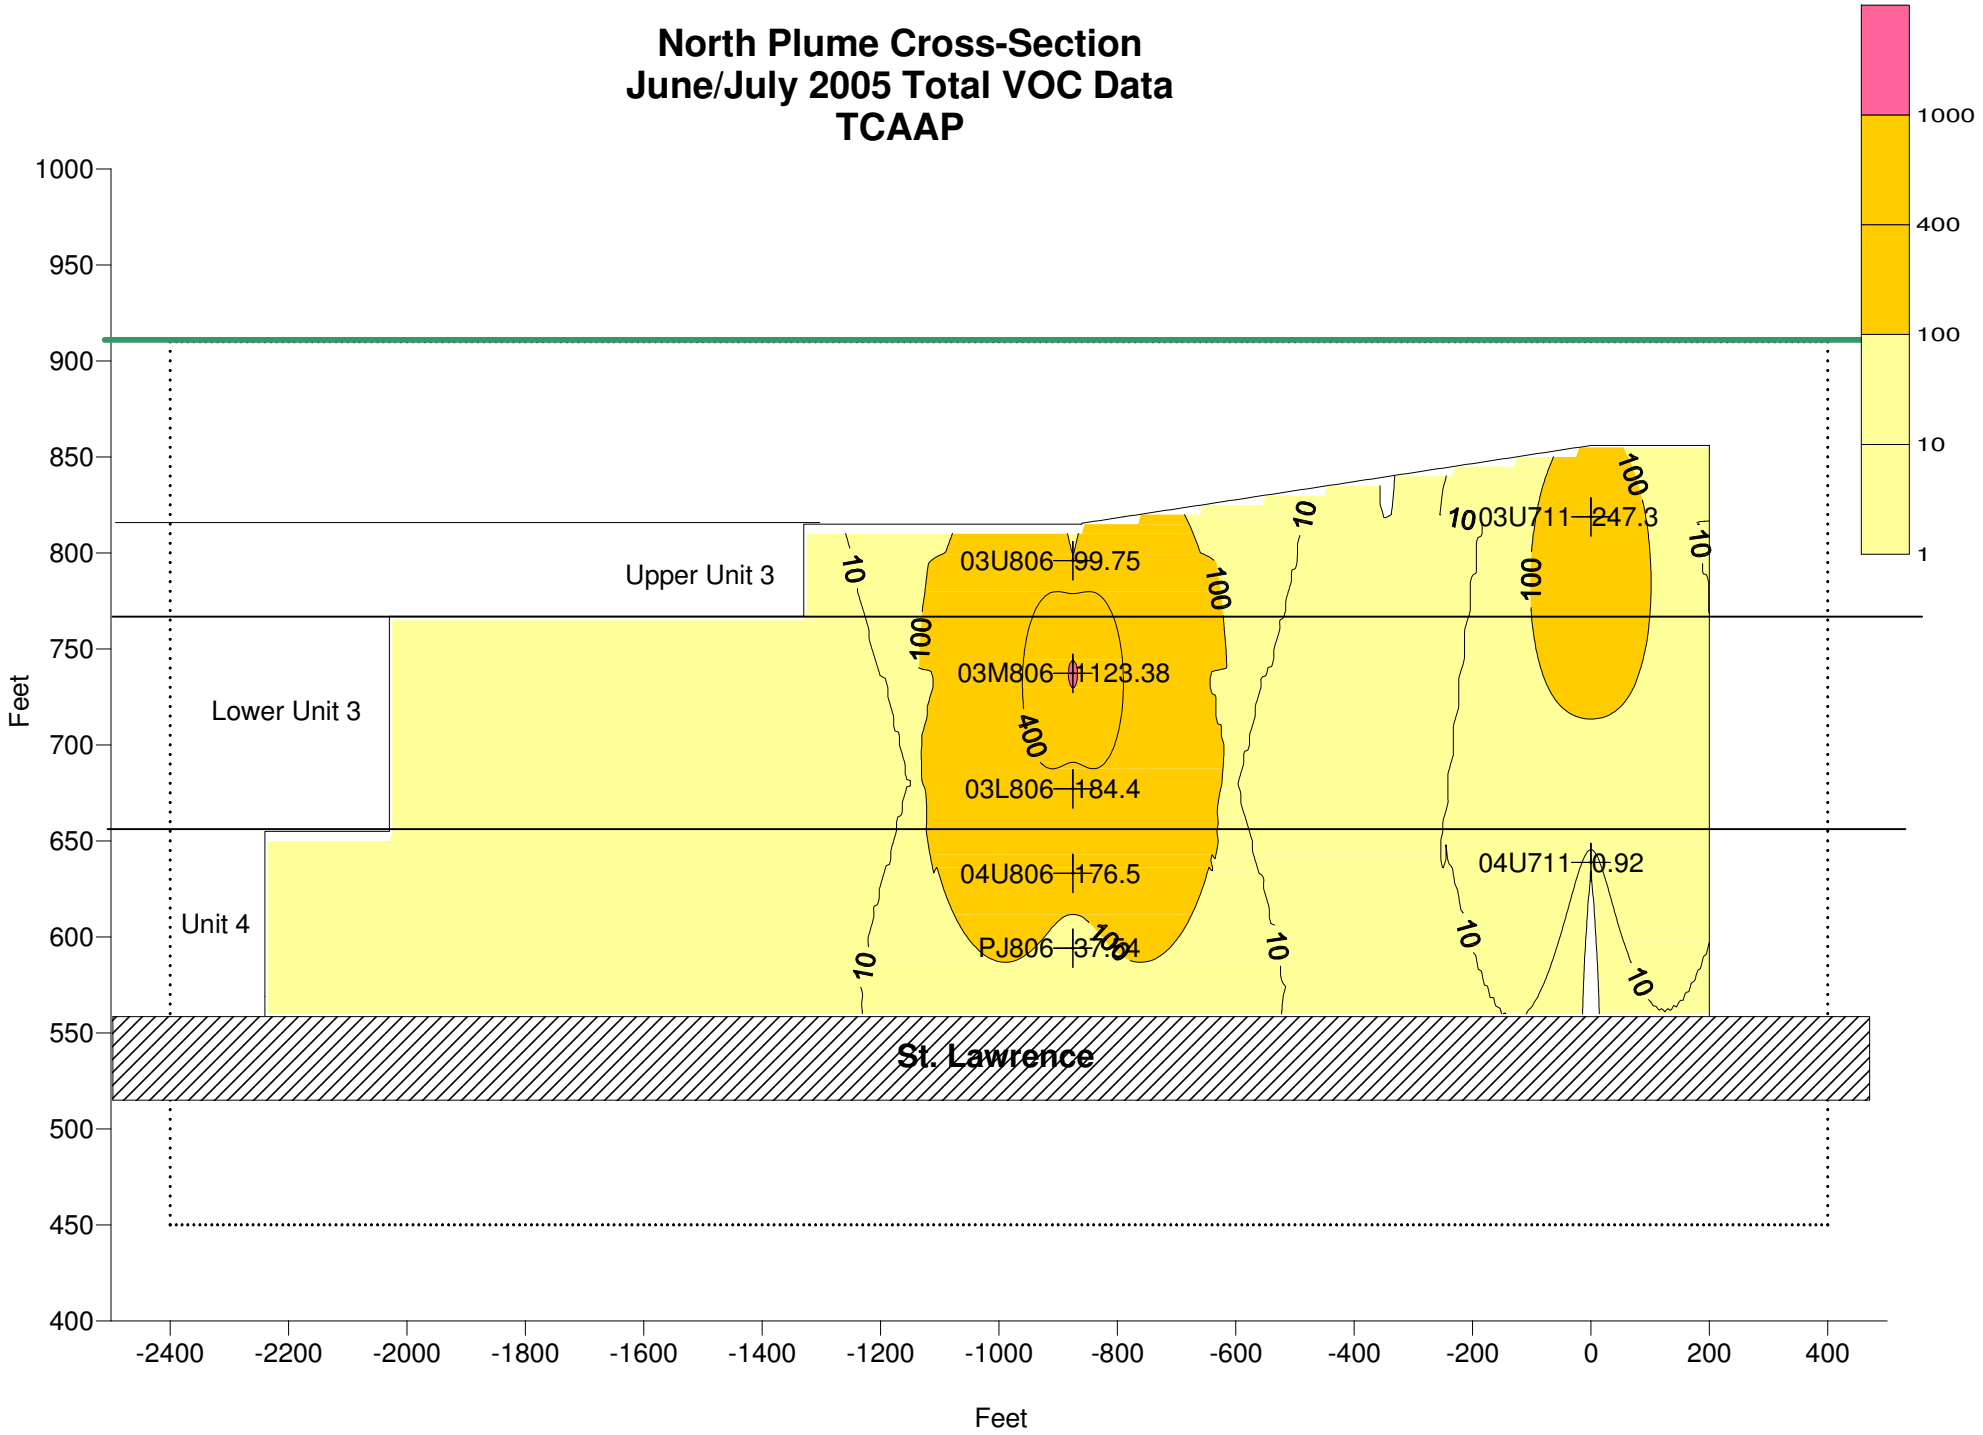
North Plume Cross-Section
June/July 2005 Total VOC Data
TCAAP
1000
400
100
10
1
Upper Unit 3
Lower Unit 3
Unit 4
St. Lawrence
03U806 99.75
03M806 1123.38
03L806 184.4
04U806 176.5
PJ806 37.64
03U711 247.3
04U711 0.92
Feet
Feet

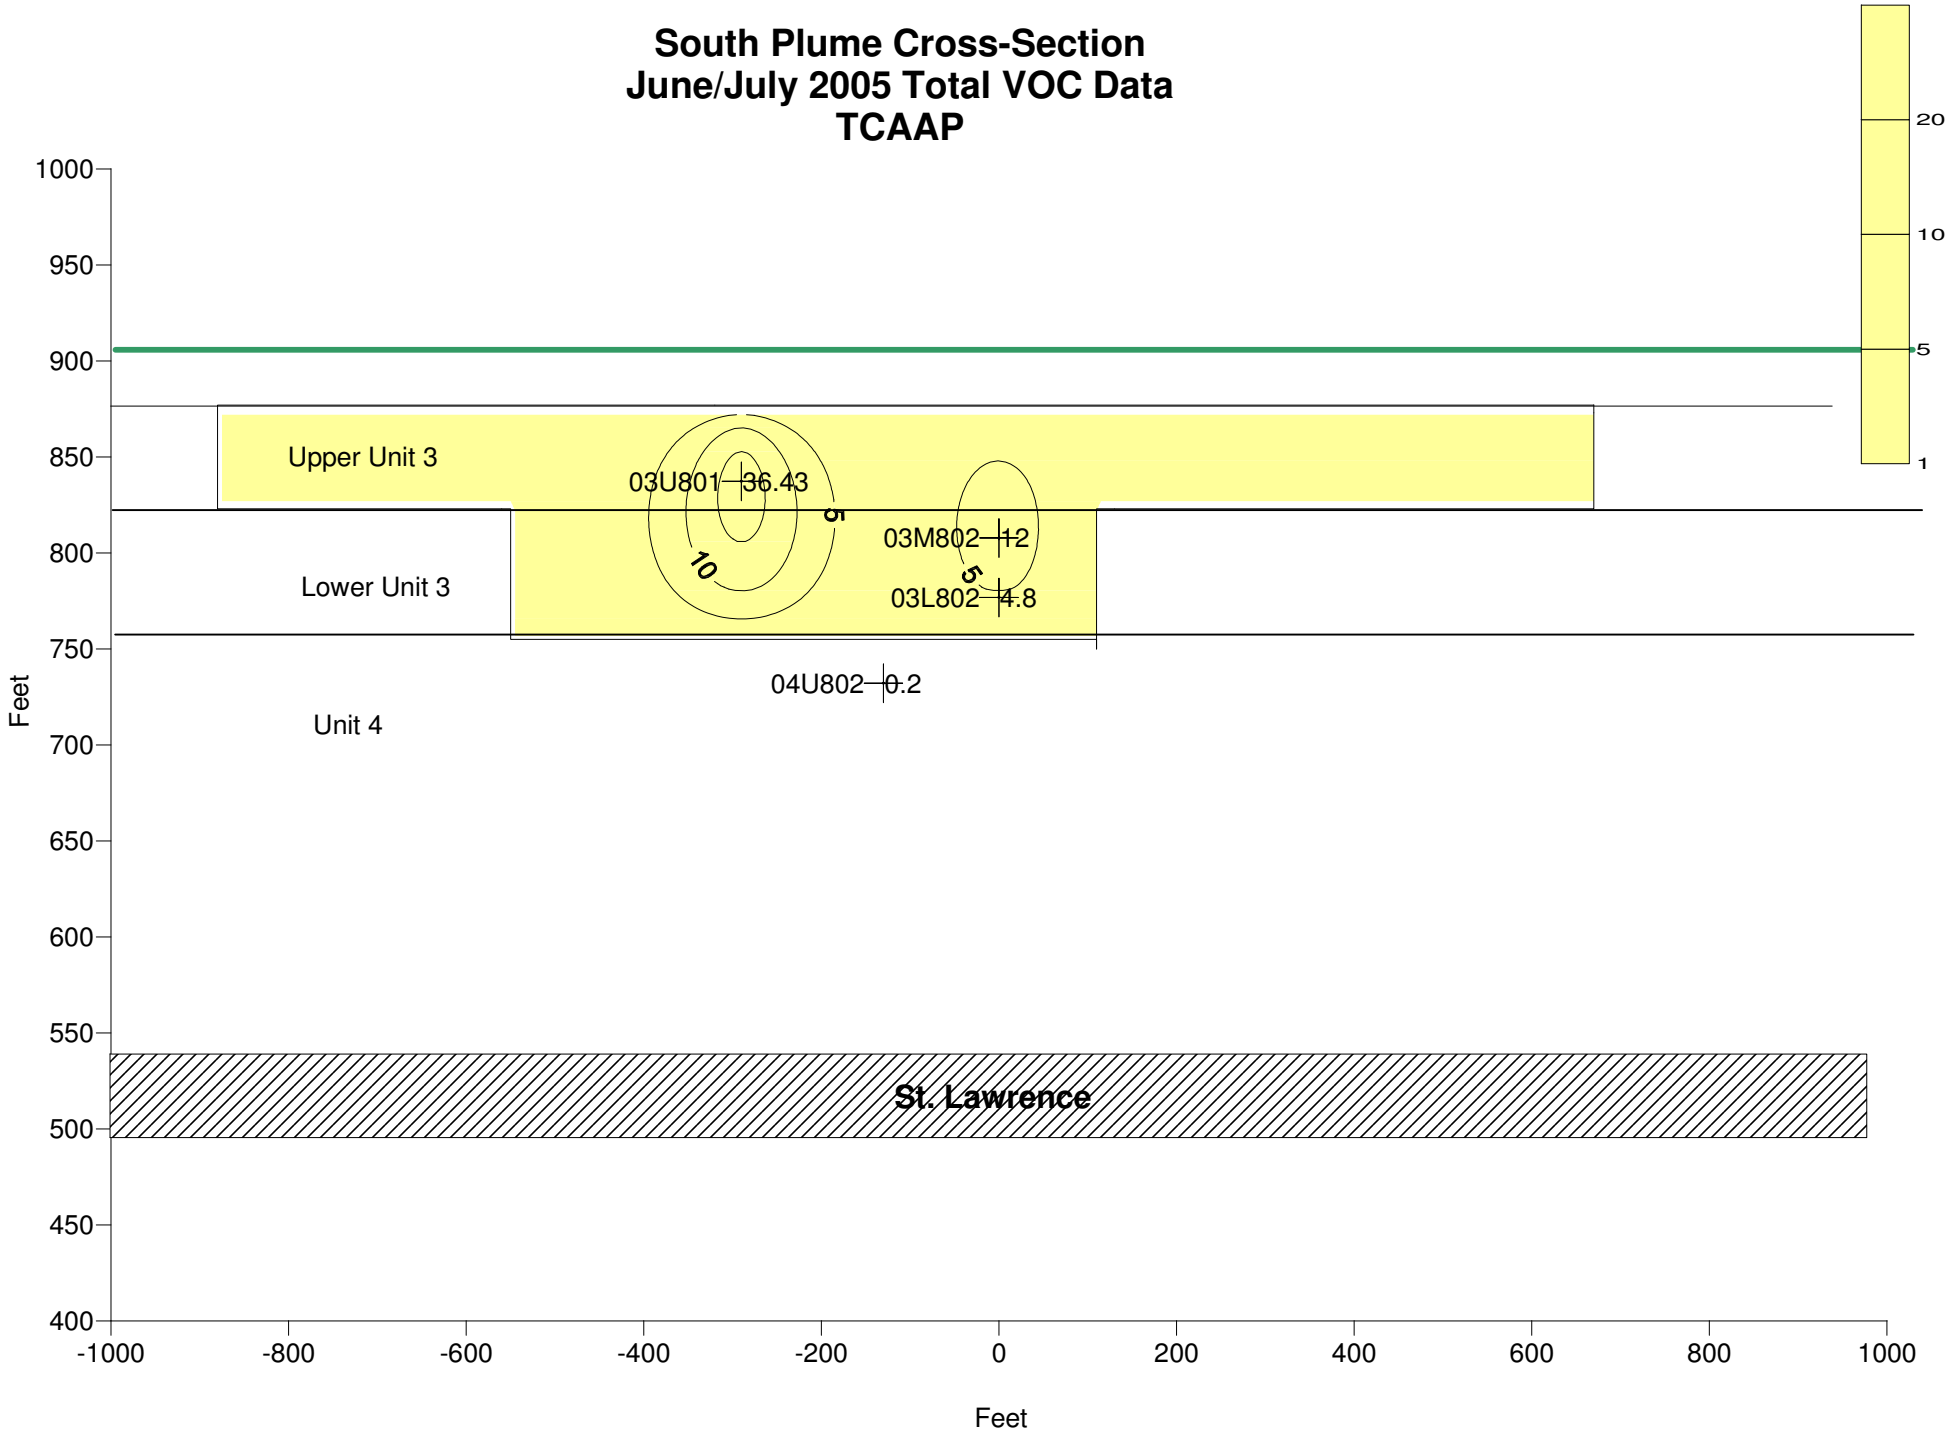
South Plume Cross-Section
June/July 2005 Total VOC Data
TCAAP
Upper Unit 3
Lower Unit 3
Unit 4
03U801 36.43
03M802 12
03L802 4.8
04U802 0.2
5
10
5
St. Lawrence
Feet
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-1000
-800
-600
-400
-200
0
200
400
600
800
1000
20
10
5
1

North Plume Cross Section Data

well	June 2005 - Total VOC Conc (ug/L)
03L806	184.4
03M806	1123.4
03U711	247.3
03U806	99.8
04U711	0.9
04U806	176.5
PJ806	37.5

North Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Expanded Contouring and Blanking
TCAAP
June 2005

Concentration	Positive Planar Area (ft2)
Plume to 1	570939
Plume to 5	291677
Plume to 10	280513
Plume to 50	197699
Plume to 100	127405
Plume to 200	49292
Plume to 300	24075
Plume to 400	13538
Plume to 500	8008
Plume to 600	4780
Plume to 700	2761
Plume to 800	1459
Plume to 900	638
Plume to 1000	174
Plume to 1100	0

TCE (ug/L)	Avg TCE (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	279263	837788
5 to 10	7.5	11164	83727
10 to 50	30	82814	2484409
50 to 100	75	70294	5272047
100 to 200	150	78113	11716958
200 to 300	250	25217	6304365
300 to 400	350	10537	3687899
400 to 500	450	5530	2488435
500 to 600	550	3228	1775257
600 to 700	650	2020	1312854
700 to 800	750	1302	976374
800 to 900	850	821	697839
900 to 1000	950	464	440980
1000 to1100	1050	174	182396
	Sum	570939	38261328

Area Wtd Conc	67	ug/L

South Plume Cross Section Data

well	June 2005 - Total VOC Conc (ug/L)
03L802	4.8
03M802	12
03U801	36.43
04U802	0.2

South Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Contouring and Blanking
TCAAP
June/July 2005

Concentration	Positive Planar Area (ft2)
Plume to 1	115236
Plume to 5	25368
Plume to 10	9422
Plume to 25	1068
Plume to 50	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	89869	269606
5 to 10	7.5	15946	119592
10 to 25	17.5	8354	146200
25 to 50	37.5	1068	40035
	Sum	115236	575434

Area Wtd Conc	5	ug/L

2006

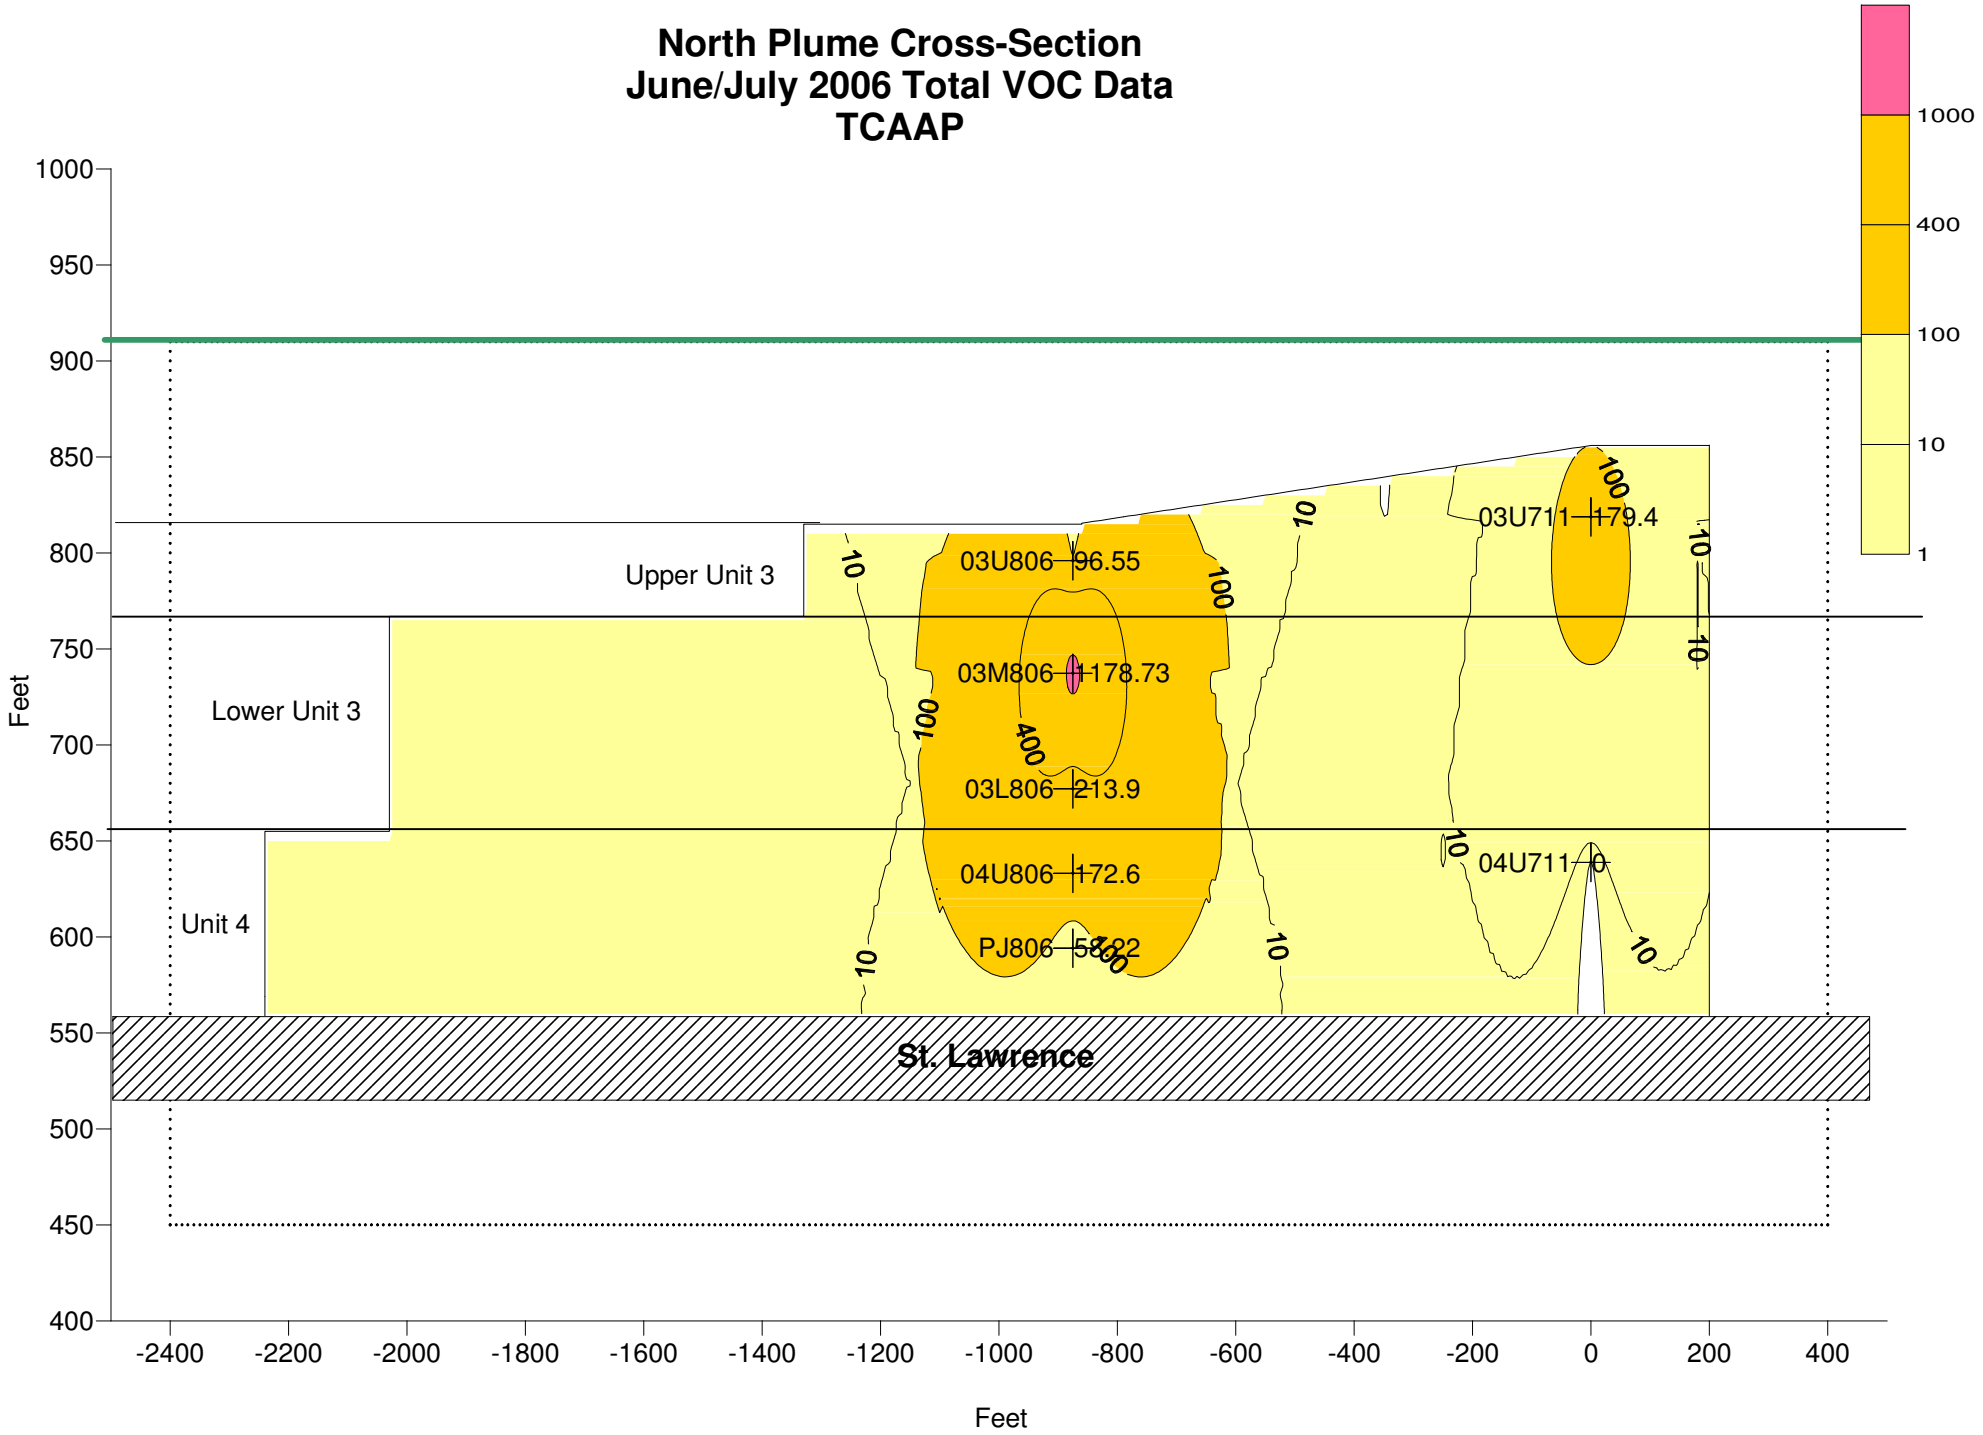
North Plume Cross-Section
June/July 2006 Total VOC Data
TCAAP
1000
400
100
10
1
Upper Unit 3
Lower Unit 3
Unit 4
St. Lawrence
03U806 96.55
03M806 1178.73
03L806 213.9
04U806 172.6
PJ806 5822
03U711 179.4
04U711 0
10
100
400
800
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-2400
-2200
-2000
-1800
-1600
-1400
-1200
-1000
-800
-600
-400
-200
0
200
400
Feet

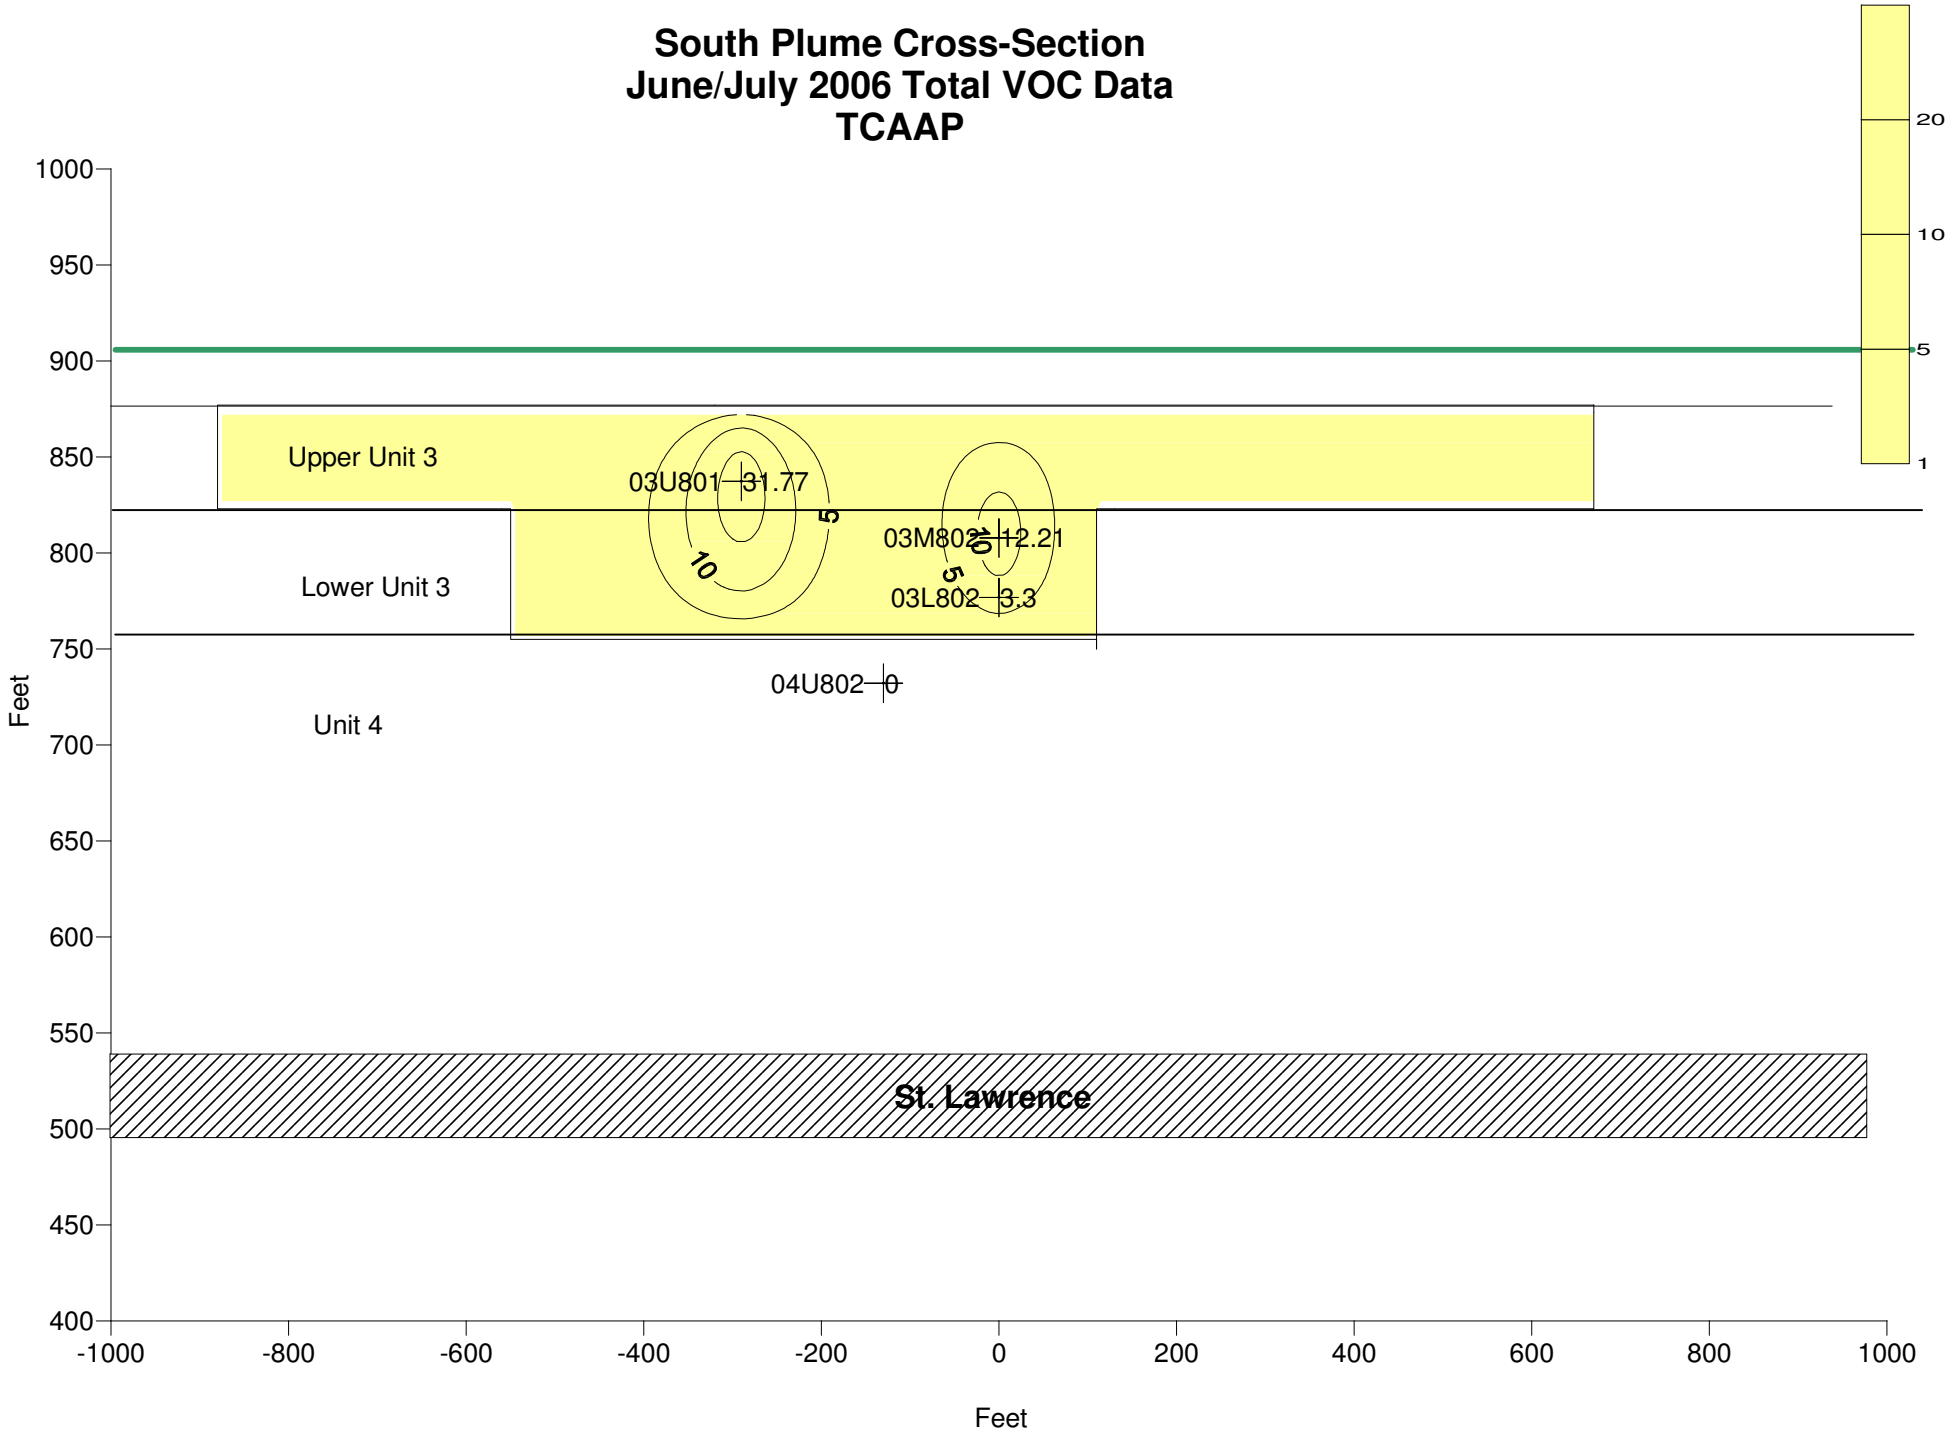
South Plume Cross-Section
June/July 2006 Total VOC Data
TCAAP
Upper Unit 3
Lower Unit 3
Unit 4
03U801 31.77
03M802 12.21
03L802 3.3
04U802 0
5
10
10
5
St. Lawrence
Feet
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-1000
-800
-600
-400
-200
0
200
400
600
800
1000
20
10
5
1

North Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Expanded Contouring and Blanking
TCAAP
June/July 2006

Concentration	Positive Planar Area (ft2)
Plume to 1	569991
Plume to 5	288686
Plume to 10	271528
Plume to 50	186104
Plume to 100	120640
Plume to 200	51763
Plume to 300	26657
Plume to 400	15227
Plume to 500	9171
Plume to 600	5618
Plume to 700	3378
Plume to 800	1909
Plume to 900	950
Plume to 1000	358
Plume to 1100	52
Plume to 1200	0

TCE (ug/L)	Avg TCE (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	281305	843916
5 to 10	7.5	17158	128682
10 to 50	30	85425	2562744
50 to 100	75	65463	4909742
100 to 200	150	68878	10331672
200 to 300	250	25105	6276324
300 to 400	350	11430	4000556
400 to 500	450	6056	2725346
500 to 600	550	3553	1954040
600 to 700	650	2240	1455778
700 to 800	750	1469	1101604
800 to 900	850	960	815703
900 to 1000	950	591	561797
1000 to1100	1050	306	321663
1100 to1200	1150	52	59923
	Sum	569991	38049490

Area Wtd Conc	67	ug/L

South Plume
Average Total VOC Concentration Calculations
Vertical Cross-Section
Contouring and Blanking
TCAAP
June/July 2006

Concentration	Positive Planar Area (ft2)
Plume to 1	115236
Plume to 5	26387
Plume to 10	9922
Plume to 25	705
Plume to 50	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	88849	266548
5 to 10	7.5	16465	123487
10 to 25	17.5	9217	161298
25 to 50	37.5	705	26443
	Sum	115236	577775

Area Wtd Conc	5	ug/L

2007

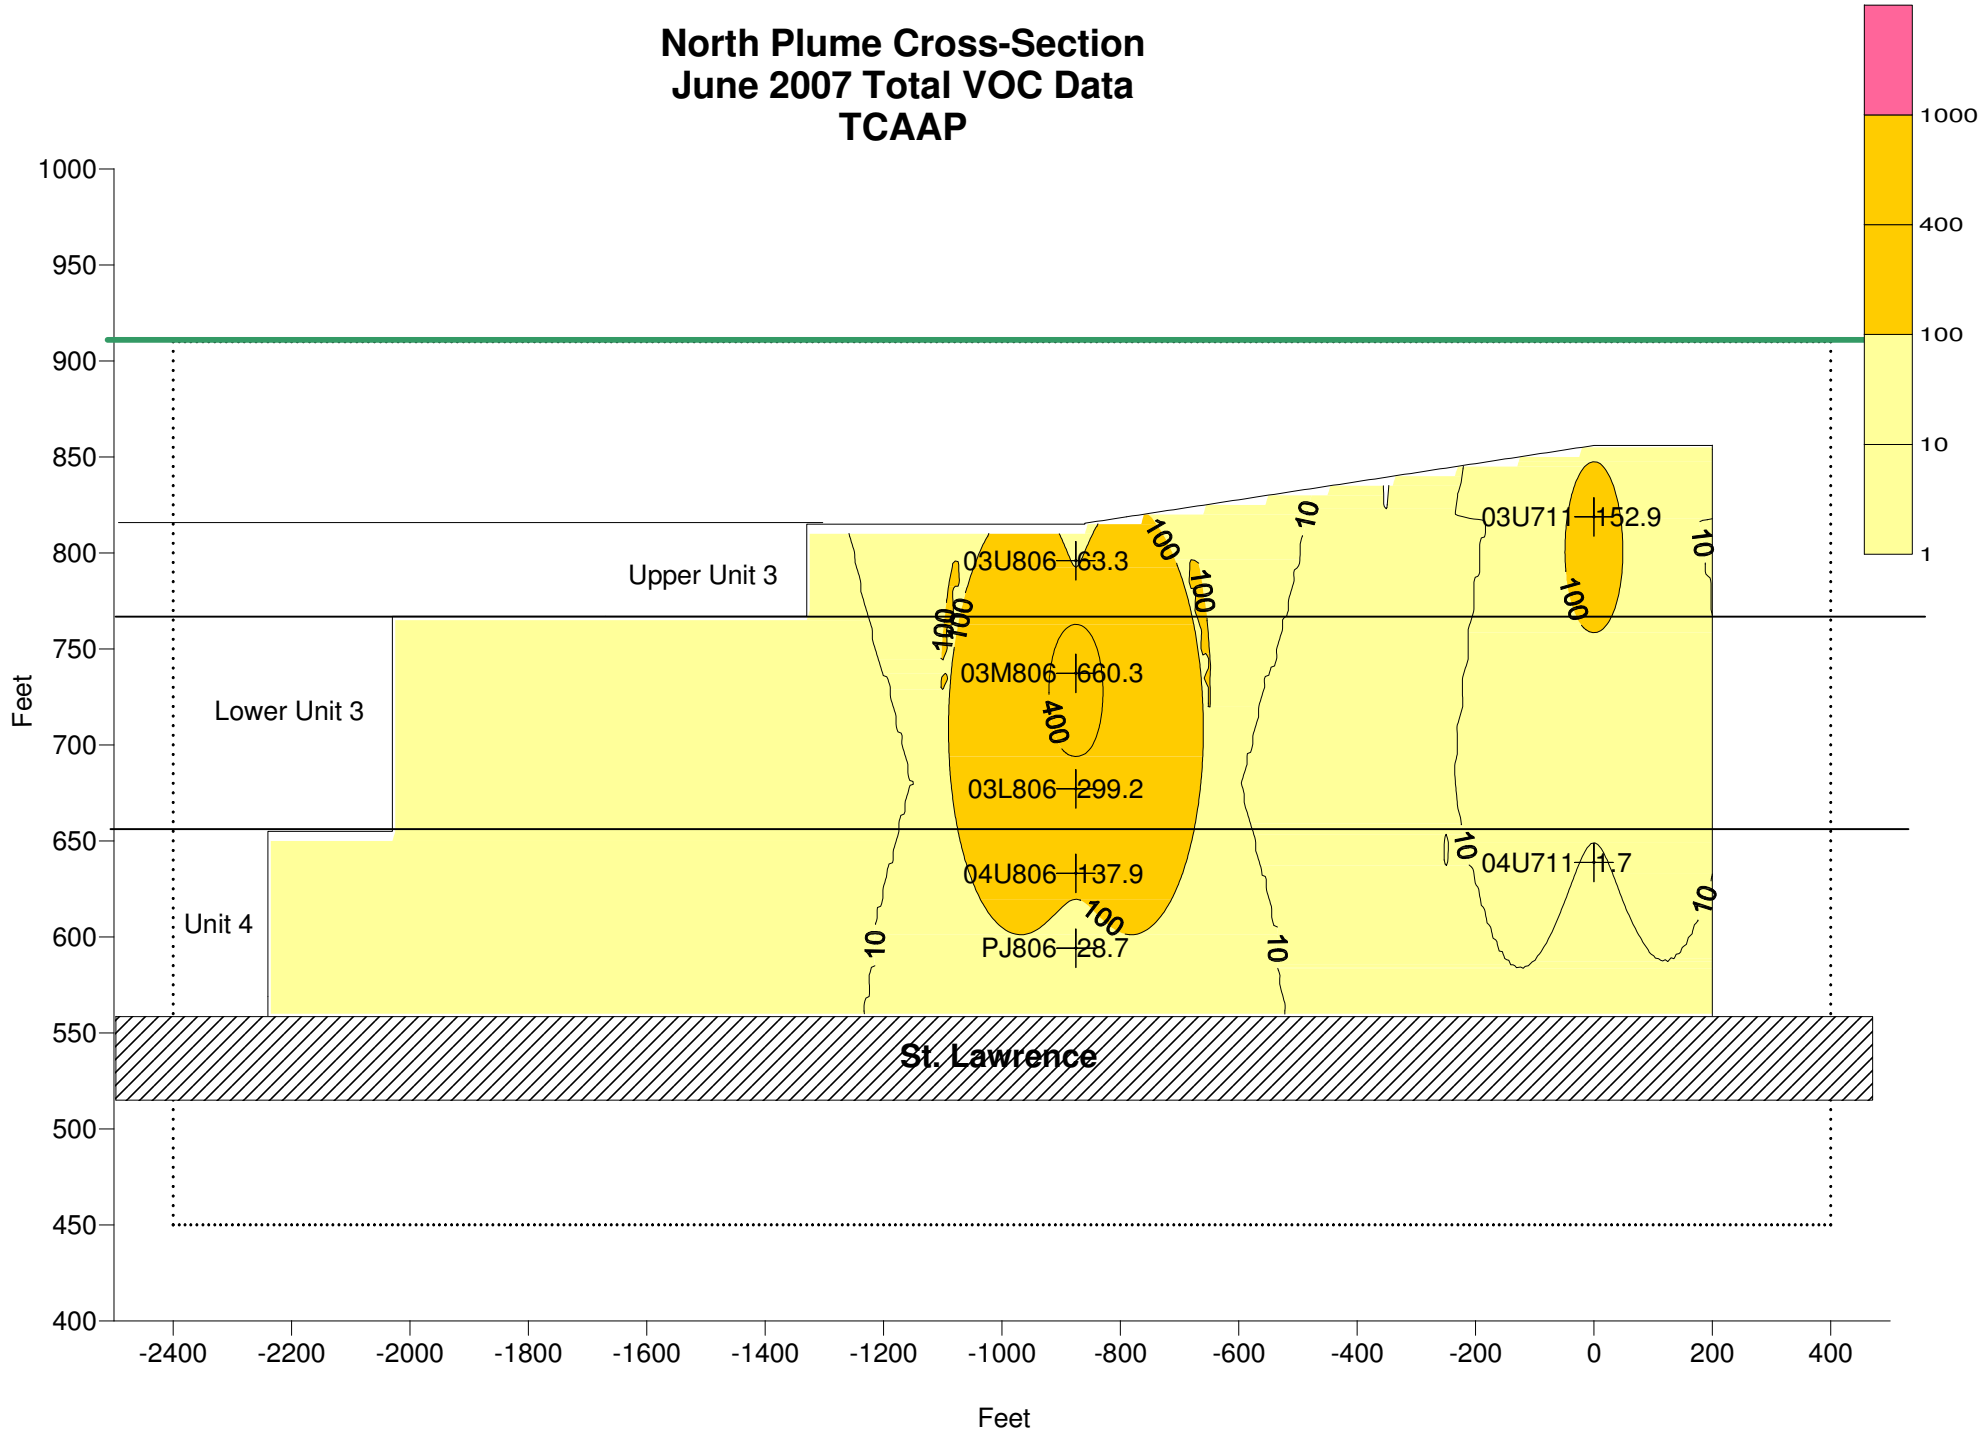
North Plume Cross-Section
June 2007 Total VOC Data
TCAAP
1000
400
100
10
1
Upper Unit 3
Lower Unit 3
Unit 4
St. Lawrence
03U806 63.3
03M806 660.3
03L806 299.2
04U806 137.9
PJ806 28.7
03U711 152.9
04U711 1.7
100
10
400
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-2400
-2200
-2000
-1800
-1600
-1400
-1200
-1000
-800
-600
-400
-200
0
200
400
Feet

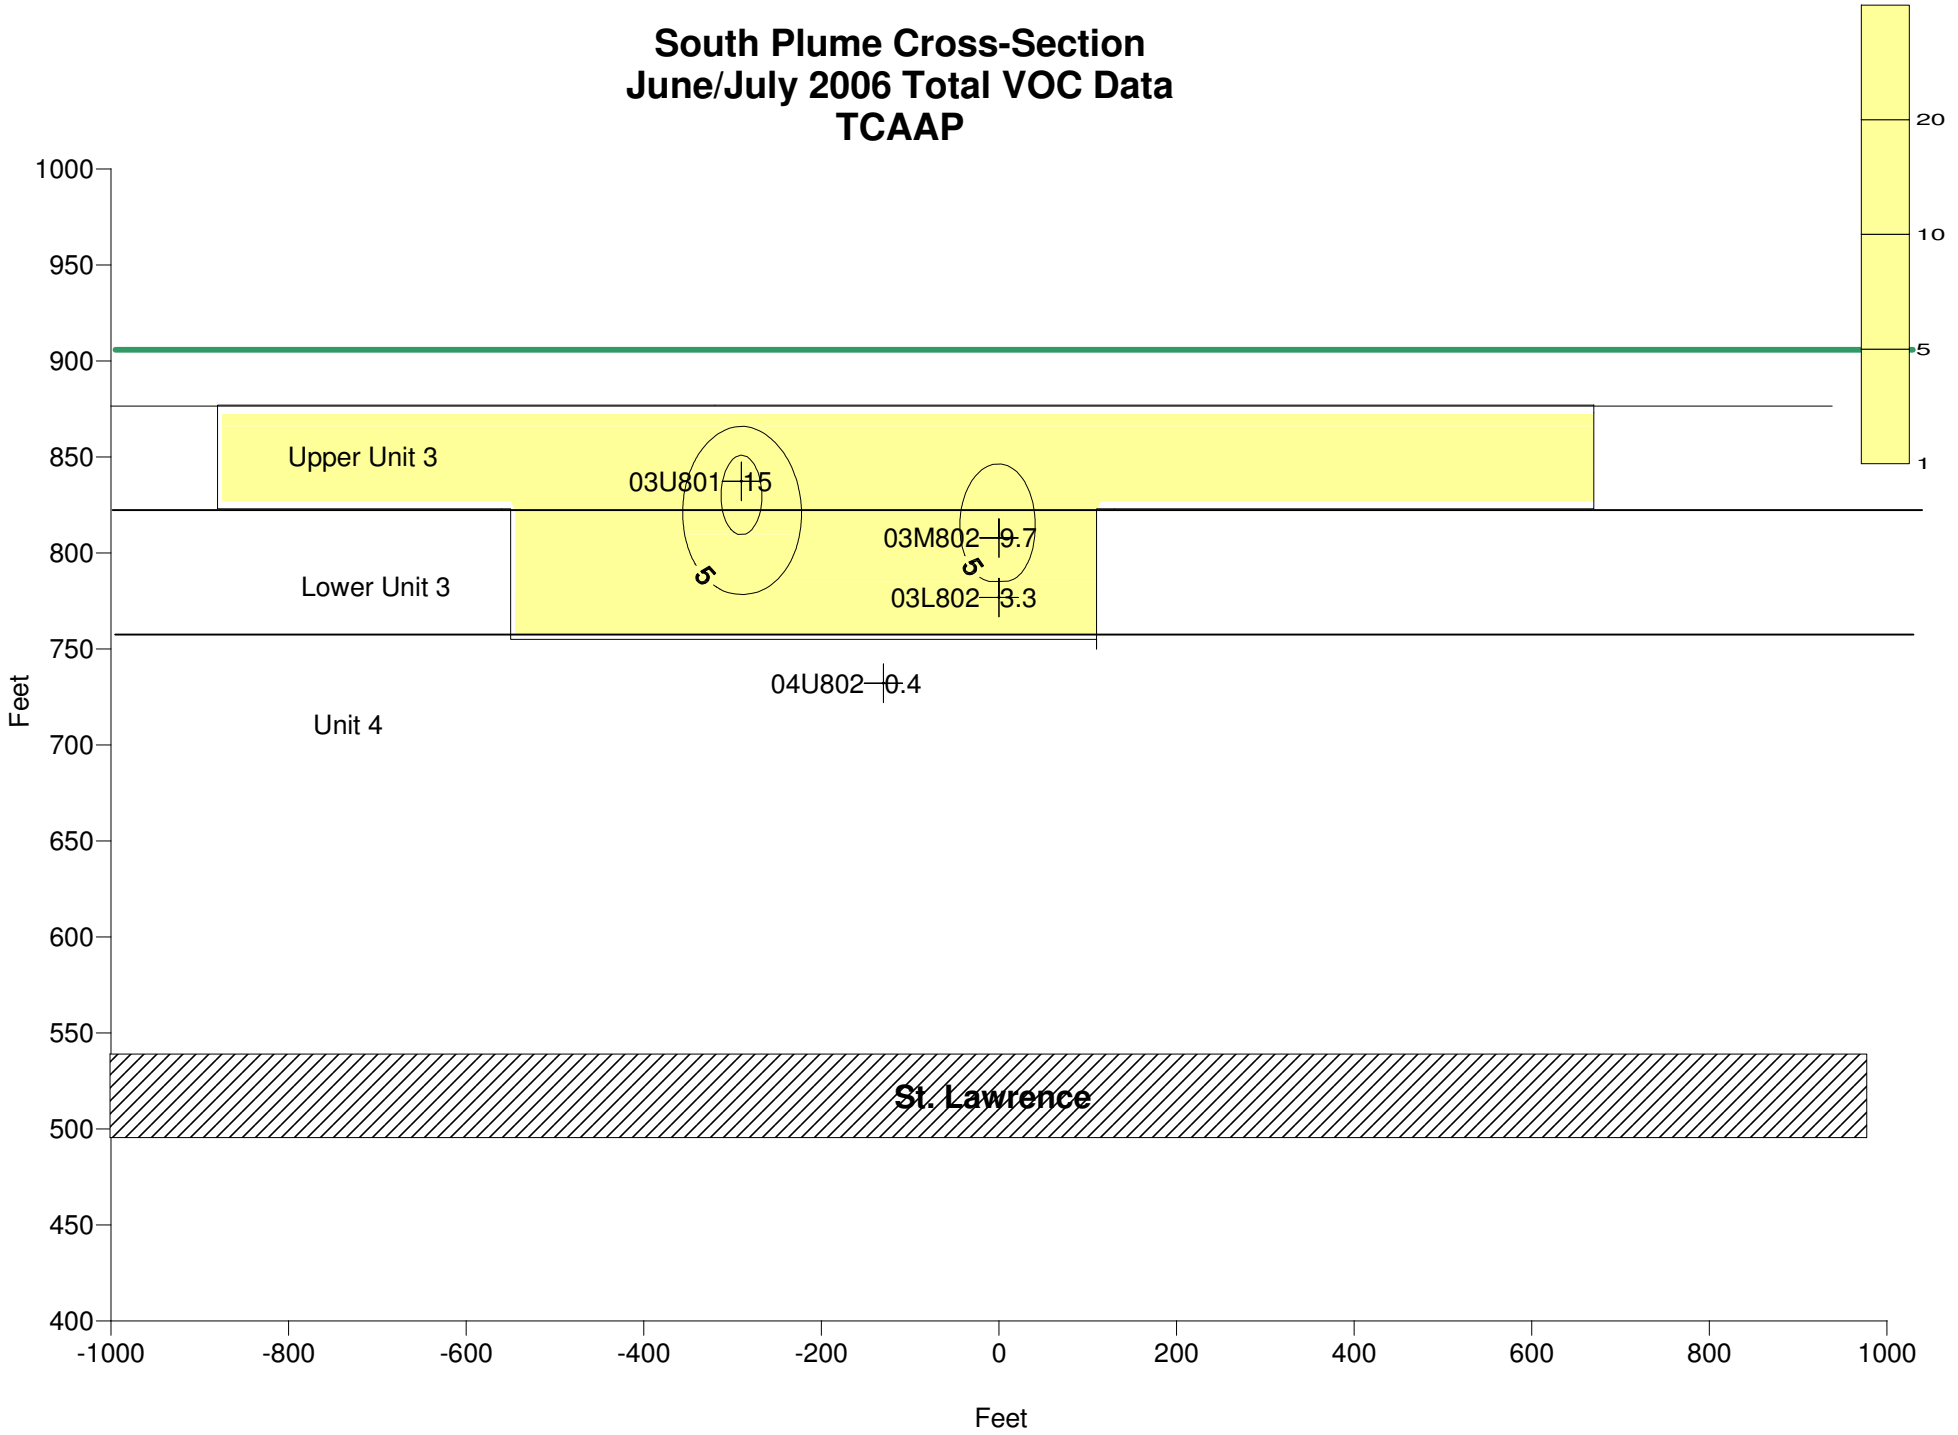
South Plume Cross-Section
June/July 2006 Total VOC Data
TCAAP
Upper Unit 3
Lower Unit 3
Unit 4
03U801 15
03M802 9.7
03L802 3.3
04U802 0.4
5
5
St. Lawrence
Feet
Feet
1000
950
900
850
800
750
700
650
600
550
500
450
400
-1000
-800
-600
-400
-200
0
200
400
600
800
1000
20
10
5
1

TABLE 1

VOC CONCENTRATIONS IN TGRS MONITORING WELLS
FY 2006--THROUGH 3rd QUARTER

		1,1,1-Trichloroethane	1,1-Dichloroethane	1,1-Dichloroethene	cis-1,2-Dichloroethene	Trichloroethene	
Location	**Date**	**µg/L**	**µg/L**	**µg/L**	**µg/L**	**µg/L**	**Total VOCs**
03L802	6/14/07	< 1	< 1	< 1	< 1	3.3	3.3
03M802	6/14/07	< 1	< 1	< 1	< 1	9.7	9.7
03U801	6/11/07	< 1	< 1	< 1	< 1	15	15
04U802	6/14/07	< 1	< 1	< 1	< 1	0.38 JP	0.4
03L806	6/12/07	3.6	41	31	3.6	220	299.2
03M806	6/12/07	< 2	93	42	5.3	520	660.3
03U711	6/14/07	19	5.5	6.5	1.9	120	152.9
03U806	6/12/07	< 1	2.1	1.2	< 1	60	63.3
04U711	6/14/07	< 1	< 1	< 1	< 1	1.7	1.7
04U806	6/12/07	3.5	23	14	1.4	96	137.9
PJ#806	6/12/07	0.6 JP	1.9	1.2	< 1	25	28.7

Notes:
South Plume
North Plume
Assumptions:
(<) values were treated as 0
Any value with a text before or after number was treated as the detection.

North Plume
Total VOC Concentration Calculations
Vertical Cross-Section
Expanded Contouring and Blanking
TCAAP
June 2007

Concentration	Positive Planar Area (ft2)
Plume to 1	572436
Plume to 5	288683
Plume to 10	268876
Plume to 50	165604
Plume to 100	86995
Plume to 200	29700
Plume to 300	12406
Plume to 400	5027
Plume to 500	1606
Plume to 600	190
Plume to 700	0

TCE (ug/L)	Avg TCE (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	283753	851259
5 to 10	7.5	19808	148559
10 to 50	30	103272	3098155
50 to 100	75	78609	5895680
100 to 200	150	57295	8594261
200 to 300	250	17294	4323421
300 to 400	350	7379	2582629
400 to 500	450	3421	1539433
500 to 600	550	1416	778920
600 to 700	650	190	123391
	Sum	572436	27935709

Area Wtd Conc	49	ug/L

South Plume
Total VOC Concentration Calculations
Vertical Cross-Section
Contouring and Blanking
TCAAP
June 2007

Concentration	Positive Planar Area (ft2)
Plume to 1	115236
Plume to 5	13400
Plume to 10	1496
Plume to 25	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (ft2)	Areal Conc (ug*ft2/L)
1 to 5	3	101836	305508
5 to 10	7.5	11904	89283
10 to 25	17.5	1496	26180
	Sum	115236	420971

Area Wtd Conc	4	ug/L

D.2.3 Group 1, 2, 3, 5, and 6 Mann-Kendall Evaluations

Summary Table

Group 1, 2, 3, and 5 Mann-Kendall Summary and MAROS Conlusion

Group	Kendall S	N	Raw Trend	Confidence	COV	Raw Trend Decision	MAROS Conclusion	Threshold Triggered?	Comments
Group 2 Wells:									
409549	7	6	Increasing	86.40%	0.6151	S or NT	**No Trend**	yes	No Trend
409557	9	6	Increasing	93.20%	0.8894	Probable	**Increasing**	yes	
03L673	-3	6	Decreasing	64.00%	0.8170	S or NT	**Stable**	no	
03L833	-15	6	Decreasing	99.00%	0.6269	Definite	**Decreasing**	no	
03L848	-5	6	Decreasing	76.50%	0.4384	S or NT	**Stable**	no	Stable
03L859	7	6	Increasing	86.40%	0.4150	S or NT	**No Trend**	yes	No Trend
03U672	-1	6	Decreasing	50.00%	2.4495	S or NT	**No Trend**	yes	No Trend
03U805	1	6	Increasing	50.00%	0.7348	S or NT	**No Trend**	yes	No Trend
04U673	-1	6	Decreasing	50.00%	0.6647	S or NT	**Stable**	no	Stable
04U832	5	6	Increasing	73.50%	0.7396	S or NT	**No Trend**	no	No Trend
04U833	-13	6	Decreasing	99.00%	0.9376	Definite	**Decreasing**	no	Stable
04U841	4	6	Increasing	70.00%	0.5049	S or NT	**No Trend**	yes	No Trend
04U843	7	6	Increasing	86.00%	0.7593	S or NT	**No Trend**	yes	No Trend
04U845	-5	6	Decreasing	76.50%	0.7263	S or NT	**Stable**	no	Stable
04U846	11	6	Increasing	97.00%	1.4588	Definite	**Increasing**	yes	No Trend
04U854	-12	6	Decreasing	99.00%	0.3928	Definite	**Decreasing**	no	Stable
04U859	-1	6	Decreasing	50.00%	0.6991	S or NT	**Stable**	no	Stable
04U861	11	6	Increasing	97.00%	1.0262	Definite	**Increasing**	yes	Abandoned after 2006 sample for Ne
04U875	-15	6	Decreasing	99.00%	0.6363	Definite	**Decreasing**	no	Stable
04U877	-11	6	Decreasing	97.00%	0.4755	Definite	**Decreasing**	no	Stable
206688	2	6	Increasing	56.00%	0.0835	S or NT	**No Trend**	no	No Trend
Group 5	-9	6	Decreasing	93.00%	0.1054	Probable	**Decreasing**	no	Stable
Group 3	-14	6	Decreasing	99.00%	0.5846	Definite	**Decreasing**	no	Stable
Group 1 NP	-7	6	Decreasing	86.00%	0.3397	S or NT	**Stable**	yes	Stable
Group 1 SP	-9	6	Decreasing	93.00%	0.1903	Probable	**Decreasing**	no	Stable

Notes:
S or NT = Stable or No Trend
N = number of data points
COV = Coefficient of Variance

MAROS Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Group 6 Mann-Kendall Summary and MAROS Conlusion

Group	Kendall S	N	Raw Trend	Confidence	COV	Raw Trend Decision	MAROS Conclusion	Threshold Triggered?	Comments
Group 6 OU1 Jordan Wells:									
04J822	9	6	Increasing	93.00%	0.5373	Probable	**Increasing**	Yes	
04J834	10	6	Increasing	95.00%	0.7873	Probable	**Increasing**	Yes	All detection below 0.5 ug/l
04J836	1	6	Increasing	50.00%	0.6140	S or NT	**No Trend**	Yes	All detection below 5 ug/l
04J838	-3	6	Decreasing	64.00%	0.5923	S or NT	**No Trend**	Yes	
04J837	-9	6	Decreasing	93.00%	1.1434	Probable	**Decreasing**	No	
04J839	1	6	Increasing	50.00%	0.7400	S or NT	**No Trend**	Yes	All detection below 5 ug/l
04J847	-4	5	Decreasing	71.00%	0.1243	S or NT	**Stable**	Yes	
04J849	7	6	Increasing	86.00%	1.5543	S or NT	**No Trend**	Yes	All detection below 0.5 ug/l
04J882	0	6	Zero	43.00%	NA	S or NT	**NA**	No	All ND
04J077	-11	6	Decreasing	97.00%	0.7160	Definite	**Decreasing**	No	
04J702	-12	6	Decreasing	99.00%	0.7096	Definite	**Decreasing**	No	
04J708	-6	6	Decreasing	73.50%	0.3549	S or NT	**Stable**	Yes	Last 4 rounds below 5 ug/L
04J713	-6	6	Decreasing	81.00%	1.8489	S or NT	**No Trend**	Yes	All detection below 5 ug/l, currently ND
Group 6 Nested Unit 4 wells:									
04U077	-11	6	Decreasing	97.00%	0.4877	Definite	**Decreasing**	No	
04U702	-13	6	Decreasing	99.00%	0.9188	Definite	**Decreasing**	No	
04U708	-6	6	Decreasing	81.00%	0.2497	S or NT	**Stable**	No	
04U713	-5	6	Decreasing	76.50%	0.8419	S or NT	**Stable**	Yes	
04U834	-13	6	Decreasing	99.00%	1.0277	Definite	**Decreasing**	No	
04U836	4	5	Increasing	70.00%	0.4223	S or NT	**No Trend**	Yes	
04U837	0	5	Zero	50.00%	0.8930	S or NT	**Stable**	Yes	
04U838	0	5	Zero	50.00%	1.0399	S or NT	**No Trend**	Yes	
04U839	-4	5	Decreasing	70.00%	0.7745	S or NT	**Stable**	Yes	
04U847	-4	6	Decreasing	70.00%	0.2213	S or NT	**Stable**	Yes	
04U849	-5	6	Decreasing	76.50%	0.2488	S or NT	**Stable**	No	

Notes:
S or NT = Stable or No Trend
N = number of data points
COV = Coefficient of Variance

MAROS Decsion Matrix

M-K S	Confidence	Trend
S > 0	> 95%	Increasing
S > 0	90-95%	Pr. Incr.
S > 0	< 90%	No Trend
S</= 0	< 90%	No Trend
S </= 0	< 90%	Stable
S < 0	90-95%	Pr. Decr.
S < 0	>95%	Decreasing

Group 5 Unit 3 Mann-Kendall Summary and MAROS Conlusion

Group	Kendall S	N	Raw Trend	Confidence	COV	Raw Trend Decision	MAROS Conclusion	Threshold Triggered?	Comments
Group 5 Unit 3 Wells:									
409550	-15	6	Decreasing	99.00%	0.8722	Definite	**Decreasing**	no	
409597	-11	6	Decreasing	99.00%	0.3885	Definite	**Decreasing**	no	
409596	-8	6	Decreasing	90.00%	0.6714	FALSE	**Decreasing**	no	
03U831	9	6	Increasing	93.20%	1.5885	Probable	**Increasing**	yes	Abandoned in 2006 for construction
03U821	-4	6	Decreasing	70.00%	0.6059	S or NT	**Stable**	no	
03U822	5	6	Increasing	76.50%	0.6302	S or NT	**No Trend**	yes	Appears to have peaked
03L822	-5	6	Decreasing	76.50%	0.4139	S or NT	**Stable**	no	Appears to have peaked
03L809	5	6	Increasing	76.50%	0.5997	S or NT	**No Trend**	yes	Stable since 2001

Notes:
S or NT = Stable or No Trend
N = number of data points
COV = Coefficient of Variance

MAROS Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Mann-Kendall Plots

Well: Group 1 NP

Date	TCE (ug/l)	Mann-Kendall Calculation:						
6/18/2001	98.00	1						
6/18/2003	108.00	1	1					
6/18/2004	49.00	1	-1	-1				
6/18/2005	67.00	1	-1	-1	1			
6/8/2006	67.00	1	-1	-1	1	0		
6/11/2007	49.00	1	-1	-1	0	-1	-1	
	N	6	5	4	3	2	1	15
	sum		-3	-4	2	-1	-1	-7
	Possibles	15						

Mean	73.00
STNDEV	24.79516
COV	0.33966
Trend:	Negative
Confidence (lookup)	86.00%

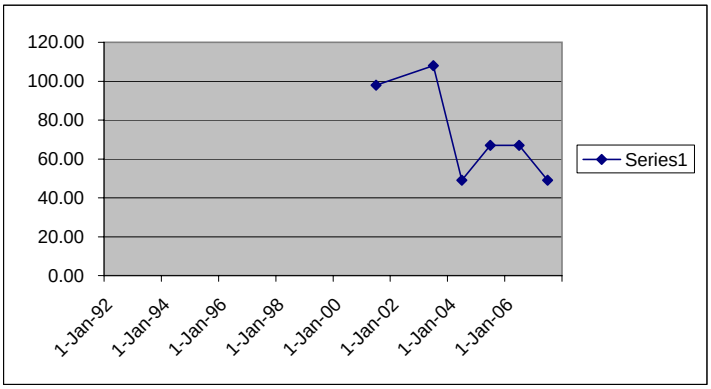

S	-7
tau	-0.466667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: Group 1 SP

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/18/1999	7.00	1					
6/18/2001	5.00	1	-1				
6/18/2003	5.00	1	-1	0			
6/18/2004	5.00	1	-1	0	0		
6/8/2006	5.00	1	-1	0	0	0	
6/11/2007	4.00	1	-1	-1	-1	-1	-1
	N	6	5	4	3	2	1
	sum		-5	-1	-1	-1	-1
	Possibles	15					

			15
			-9

Mean	5.17
STNDEV	0.983192
COV	0.190295
Trend:	Negative
Confidence (lookup)	93.00%

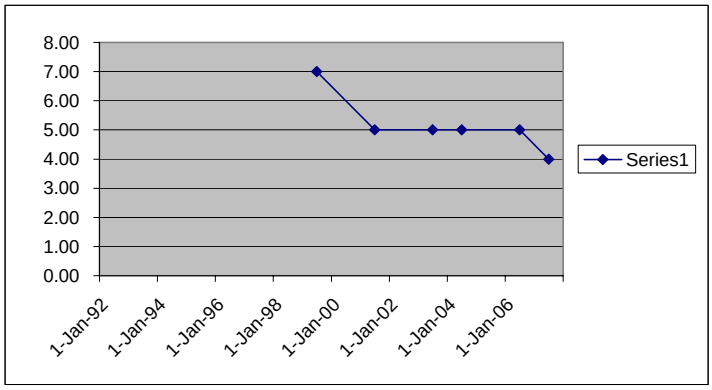

S	-9
tau	-0.6

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: Group 3

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/18/1998	67.00	1					
6/18/1999	48.00	1	-1				
6/18/2001	24.00	1	-1	-1			
6/18/2003	21.00	1	-1	-1	-1		
6/18/2005	21.00	1	-1	-1	-1	0	
6/11/2007	20.00	1	-1	-1	-1	-1	-1

N		6	5	4	3	2	1	15
	sum		-5	-4	-3	-1	-1	-14
Possibles		15						

Mean	33.50
STNDEV	19.58316
COV	0.584572

Trend: Negative

Confidence (lookup) 99.00%

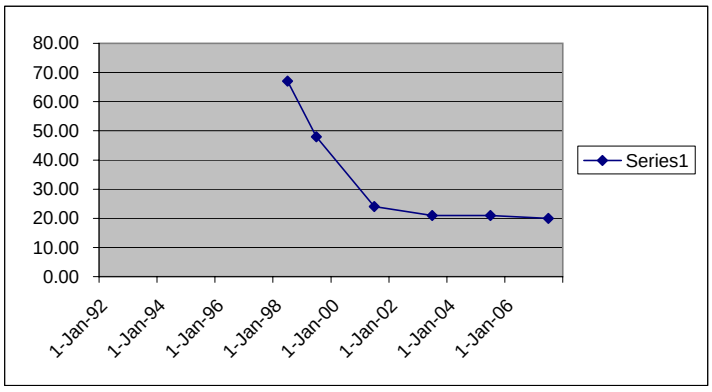

S	-14
tau	-0.933333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: Group 5

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/18/1998	43.00	1					
6/18/1999	45.00	1	1				
6/18/2001	41.00	1	-1	-1			
6/18/2003	34.00	1	-1	-1	-1		
6/18/2005	39.00	1	-1	-1	-1	1	
6/18/2005	36.00	1	-1	-1	-1	1	-1

N	6	5	4	3	2	1	0	-1	-2	-3	-4	5
sum		-3	-4	-3	2	-1	0	0	0	0	0	-9
Possibles	15											

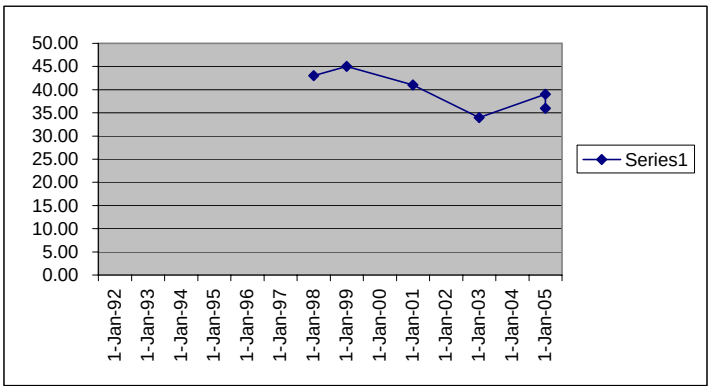

Mean	39.67
STNDEV	4.179314
COV	0.105361
Trend:	Negative
Confidence (lookup)	93.00%

S	-9
tau	-0.6

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 03U672

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/17/1998	0.0	1					
6/24/1999	0.0	1	0				
6/18/2001	3.1	1	1	1			
6/1/2003	0.0	1	0	0	-1		
6/17/2005	0.0	1	0	0	-1	0	
6/18/2007	0.0	1	0	0	-1	0	0

N		6	5	4	3	2	1	15
	sum		1	1	-3	0	0	-1
Possibles		15						

Mean	0.52
STNDEV	1.2655697
COV	2.44948974

Trend: Negative

Confidence (lookup) 50.0%

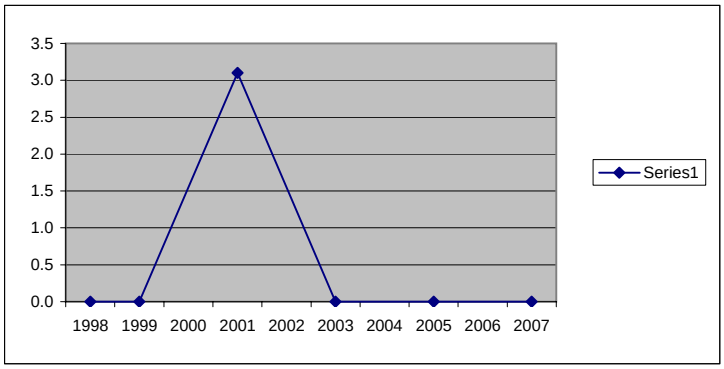

S	-1
tau	-0.066667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 03U805

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/16/1998	0.00	1					
6/29/1999	0.97	1	1				
6/15/2001	3.00	1	1	1			
6/1/2003	2.20	1	1	1	-1		
6/15/2005	1.50	1	1	1	-1	-1	
6/20/2007	0.94	1	1	-1	-1	-1	-1

N		6	5	4	3	2	1	15
	sum		5	2	-3	-2	-1	1
Possibles		15						

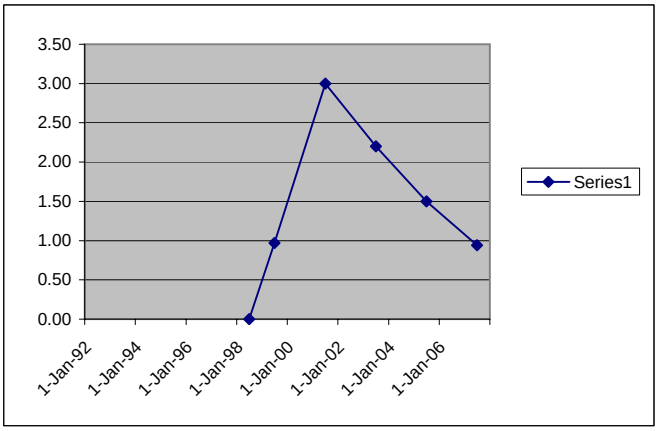

Mean	1.44
STNDEV	1.0544335
COV	0.7347969

S	1
tau	0.066667

Trend: Positive

Confidence (lookup) 50.00%

Decsion Matrix

M-K S	Confide	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 03U821

Date	TCE (ug/l)	Mann-Kendall Calculation:					
3/15/1995	17.20	1					
6/18/1996	65.60	1	1				
6/26/1997	47.00	1	1	-1			
6/16/2003	27.00	1	1	-1	-1		
6/10/2005	19.00	1	1	-1	-1	-1	
6/13/2007	19.00	1	1	-1	-1	-1	0

N	6	5	4	3	2	1	15
sum		5	-4	-3	-2	0	-4
Possibles	15						

Mean	32.47
STNDEV	19.67076
COV	0.605875

Trend: Negative

Confidence (lookup) 70.00%

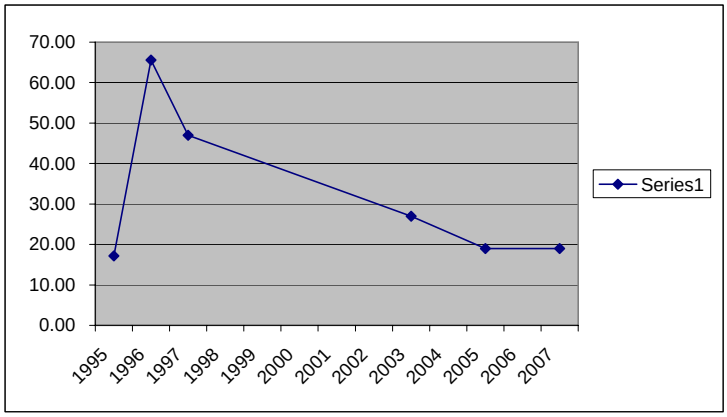

S	-4
tau	-0.266667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 03U822

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/22/1998	16.90	1					
6/16/1999	89.00	1	1				
6/25/2001	250.00	1	1	1			
6/16/2003	280.00	1	1	1	1		
6/10/2005	160.00	1	1	1	-1	-1	
6/15/07	140.00	1	1	1	-1	-1	-1

N		6	5	4	3	2	1	15
	sum		5	4	-1	-2	-1	5
Possibles		15						

Mean	155.98
STNDEV	98.30749
COV	0.630244

Trend: Positive

Confidence (lookup) 76.50%

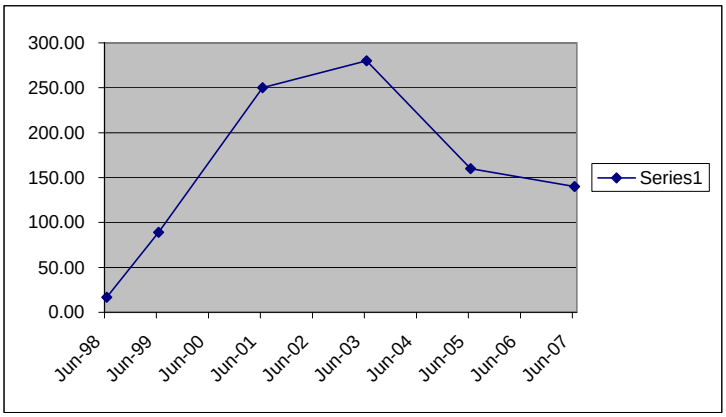

S	5
tau	0.333333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 03U831

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/23/1998	0.00	1					
6/15/1999	0.00	1	0				
6/15/2001	0.00	1	0	0			
6/9/2003	0.00	1	0	0	0		
6/7/2005	22.00	1	1	1	1	1	
2/1/2006	32.00	1	1	1	1	1	1

N		6	5	4	3	2	1	15
	sum		2	2	2	2	1	9
Possibles		15						

Mean	9.00
STNDEV	14.29685
COV	1.588539

Trend: Positive

Confidence (lookup) 93.20%

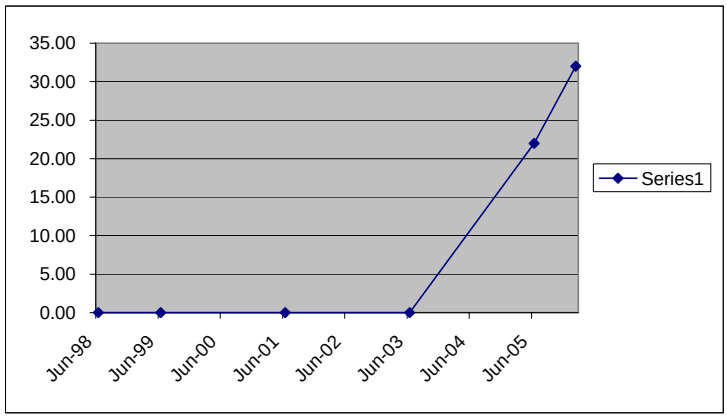

S	9
tau	0.6

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 03L673

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/4/1999	280.00	1					
6/12/2001	24.00	1	-1				
6/1/2003	6.30	1	-1	-1			
6/15/2004	180.00	1	-1	1	1		
6/22/2005	150.00	1	-1	1	1	-1	
6/21/2007	110.00	1	-1	1	1	-1	-1

N		6	5	4	3	2	1	0	15
	sum		-5	2	3	-2	-1	0	-3
Possibles		15							

Mean	125.05
STNDEV	102.16719
COV	0.8170107

Trend: Negative

Confidence (lookup) 64.0%

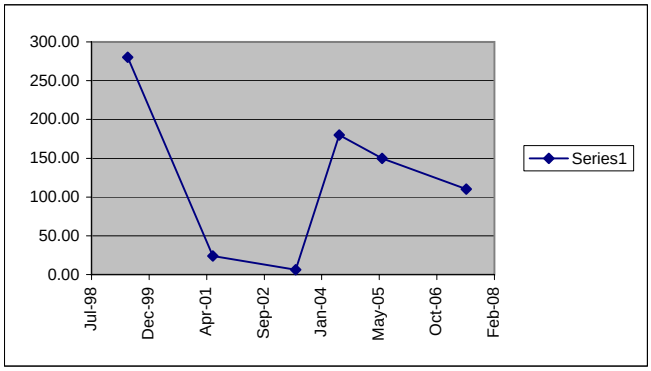

S	-3
tau	-0.2

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 03L809

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/17/1998	67.30	1					
6/29/1999	150.00	1	1				
6/18/2001	520.00	1	1	1			
6/19/2003	410.00	1	1	1	-1		
6/9/2005	440.00	1	1	1	-1	1	
6/20/2007	220.00	1	1	1	-1	-1	-1

N		6	5	4	3	2	1	15
	sum		5	4	-3	0	-1	5
Possibles		15						

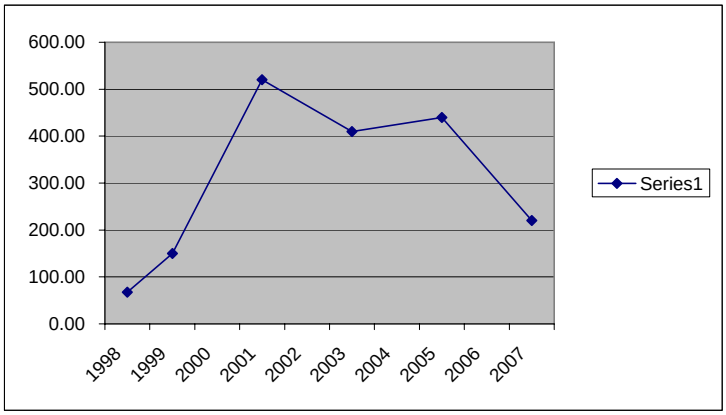

Mean	301.22
STNDEV	180.6324
COV	0.599676

S	5
tau	0.333333

Trend: Positive

Confidence (lookup) 76.50%

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 03L822

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/22/1998	219.0	1					
6/9/1999	650.0	1	1				
6/25/2001	640.0	1	1	-1			
6/16/2003	620.0	1	1	-1	-1		
6/14/2005	400.0	1	1	-1	-1	-1	
6/15/2007	280.0	1	1	-1	-1	-1	-1

N		6	5	4	3	2	1	15
	sum		5	-4	-3	-2	-1	-5
Possibles		15						

Mean	468.17
STNDEV	193.7941
COV	0.413943
Trend:	Negative
Confidence (lookup)	76.50%

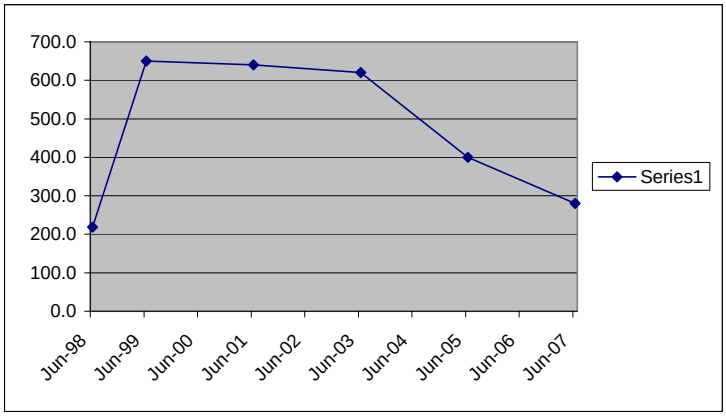

S	-5
tau	-0.333333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 03L848

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/29/1998	10.70	1					
6/4/1999	7.30	1	-1				
6/12/2001	3.5	1	-1	-1			
6/1/2003	3.8	1	-1	-1	1		
6/21/2005	5.8	1	-1	-1	1	1	
6/21/2007	5.3	1	-1	-1	1	1	-1

N		6	5	4	3	2	1	0	15
	sum		-5	-4	3	2	-1	0	-5
Possibles		15							

Mean	6.07
STNDEV	2.6598246
COV	0.4384326

Trend: Negative

Confidence (lookup) 76.5%

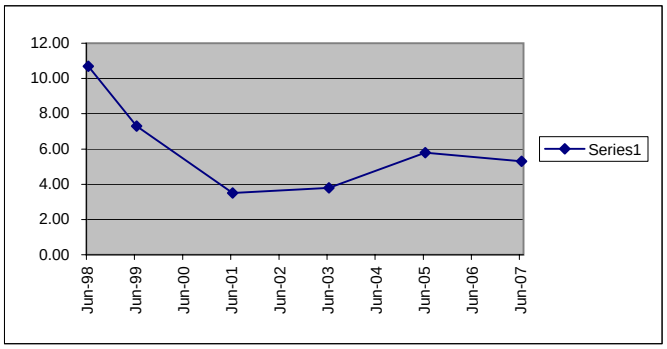

S	-5
tau	-0.33333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 03L833

Date	TCE (ug/l)	Mann-Kendall Calculation:						
6/11/1998	20.80	1						
6/22/1999	16.00	1	-1					29.70
6/13/2001	13.00	1	-1	-1				20.80
6/1/2003	7.80	1	-1	-1	-1			16.00
6/9/2005	4.90	1	-1	-1	-1	-1		13.00
6/14/2007	3.10	1	-1	-1	-1	-1	-1	7.80
	N	6	5	4	3	2	1	15
	sum		-5	-4	-3	-2	-1	-15
	Possibles	15						

Mean	10.93
STNDEV	6.853807
COV	0.626873
Trend:	Negative
Confidence (lookup)	99.0%

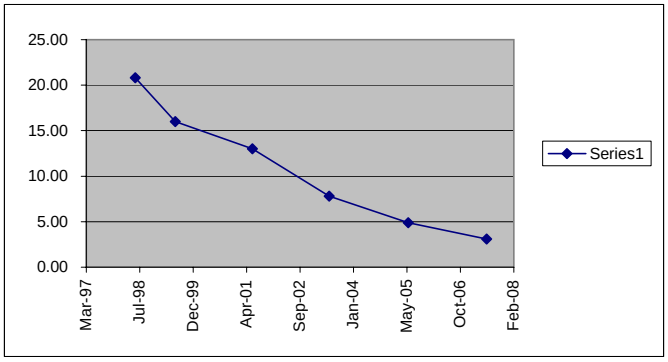

S	-15
tau	-1

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 03L859

Date	TCE (ug/l)	Mann-Kendall Calculation:					
3/10/1995	4.55	1					
6/3/1996	5.96	1	1				
6/4/1997	2.86	1	-1	-1			
6/15/2004	10.00	1	1	1	1		
6/22/2005	8.90	1	1	1	1	-1	
6/21/2007	9.00	1	1	1	1	-1	1
	N	6	5	4	3	2	1
	sum		3	2	3	-2	1
	Possibles	15					

15
7

Mean 6.88
STNDEV 2.8546413
COV 0.4150193

Trend: Positive

Confidence (lookup) 86.40%

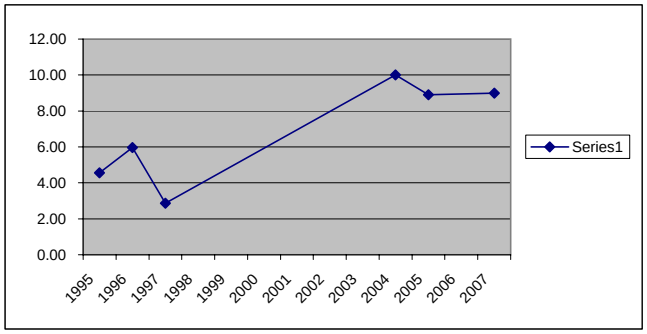

S 7

tau 0.466667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U077

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/12/1998	260.00	1					
6/22/1999	190.00	1	-1				
6/8/2001	110.00	1	-1	-1			
6/13/2003	94.00	1	-1	-1	-1		
6/7/2005	98.00	1	-1	-1	-1	1	
6/12/2007	95.00	1	-1	-1	-1	1	-1

N		6	5	4	3	2	1	15
	sum		-5	-4	-3	2	-1	-11
Possibles		15						

Mean	141.17
STNDEV	68.84306
COV	0.487672

Trend: Negative

Confidence (lookup) 97.00%

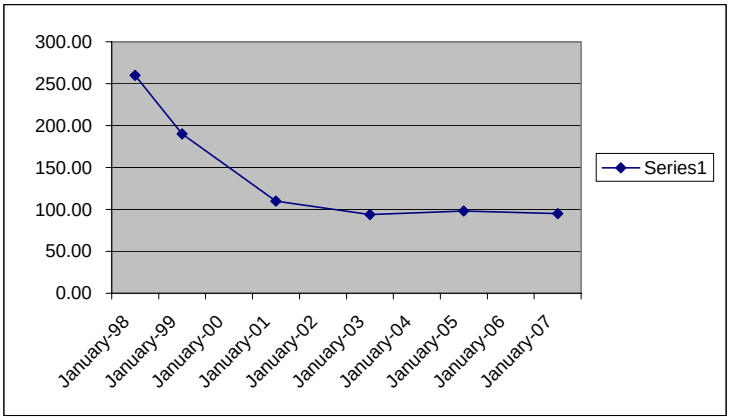

S	-11
tau	-0.733333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04U673

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/4/1999	74.00	1					
6/12/2001	2.9	1	-1				
6/1/03	15	1	-1	1			
6/15/2004	51	1	-1	1	1		
6/22/2005	49	1	-1	1	1	-1	
6/21/2007	42	1	-1	1	1	-1	-1

N		6	5	4	3	2	1	15
	sum		-5	4	3	-2	-1	-1
Possibles		15						

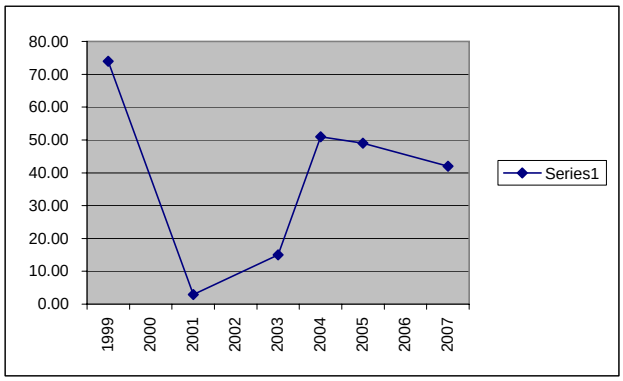

Mean	38.98
STNDEV	25.912191
COV	0.6646992

S	-1
tau	-0.066667

Trend: Negative

Confidence (lookup) 50.00%

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U702

Date	TCE (ug/l)		Mann-Kendall Calculation:					
6/11/1998	10.80	1						
6/21/1999	15.00	1	1					
6/7/2001	8.30	1	-1	-1				
6/16/2003	1.60	1	-1	-1	-1			
6/8/2005	1.40	1	-1	-1	-1	-1		
6/11/2007	1.20	1	-1	-1	-1	-1	-1	
	N	6	5	4	3	2	1	15
	sum		-3	-4	-3	-2	-1	-13
	Possibles	15						

Mean	6.38
STNDEV	5.865293
COV	0.918845
Trend:	Negative
Confidence (lookup)	99.00%

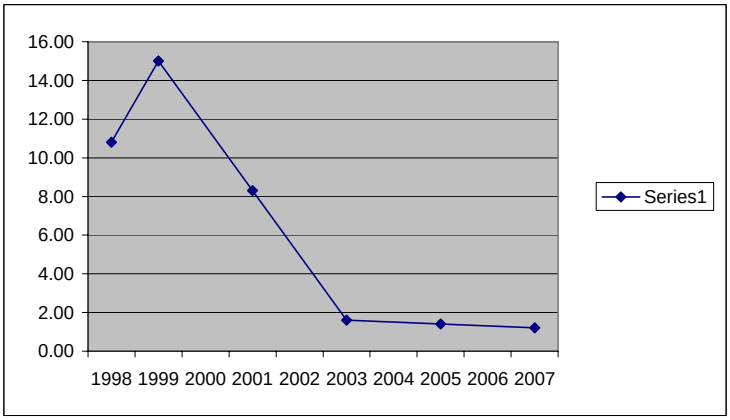

S	-13
tau	-0.866667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04U708

Date	TCE (ug/l)		Mann-Kendall Calculation:					
6/9/1998	1.63	1						
6/23/1999	1.20	1	-1					
6/7/2001	0.80	1	-1	-1				
6/20/2003	1.10	1	-1	-1	1			
6/9/2005	0.95	1	-1	-1	1	-1		
6/11/2007	1.10	1	-1	-1	1	0	1	
	N	6	5	4	3	2	1	15
	sum		-5	-4	3	-1	1	-6
	Possibles	15						

Mean	1.13
STNDEV	0.282135
COV	0.249677
Trend:	Negative
Confidence (lookup)	81.00%

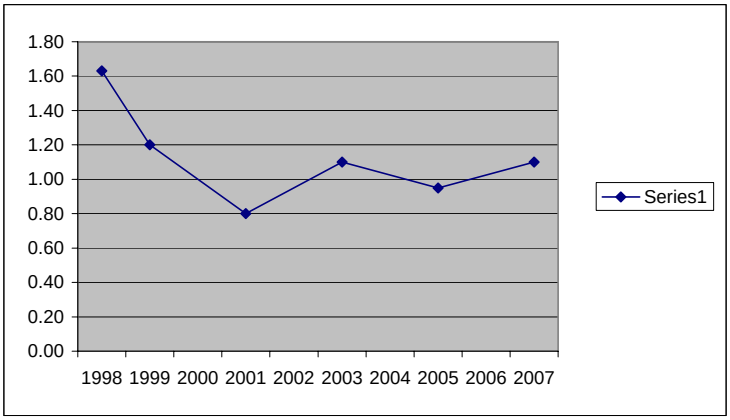

S	-6
tau	-0.4

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04U713

Date	TCE (ug/l)		Mann-Kendall Calculation:					
6/10/1998	0.00	1						
6/22/1999	1.60	1	1					
6/12/2001	1.20	1	1	-1				
6/12/2003	0.90	1	1	-1	-1			
6/9/2005	0.49	1	1	-1	-1	-1		
6/11/2007	0.19	1	1	-1	-1	-1	-1	
	N	6	5	4	3	2	1	15
	sum		5	-4	-3	-2	-1	-5
	Possibles	15						

Mean	0.73
STNDEV	0.614622
COV	0.841948
Trend:	Negative
Confidence (lookup)	76.50%

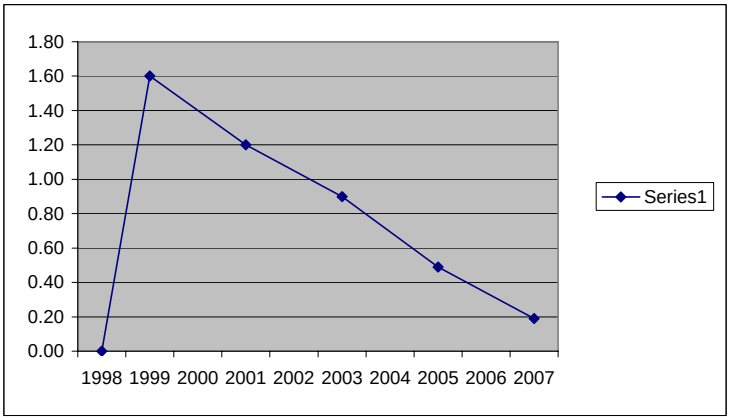

S	-5
tau	-0.333333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04U832

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/25/1998	36.40	1					
6/7/1999	29.00	1	-1				
6/14/2001	3.5	1	-1	-1			
6/1/2003	4.1	1	-1	-1	1		
6/23/2005	41	1	1	1	1	1	
6/22/2007	56	1	1	1	1	1	1

N	6	5	4	3	2	1	0	15
sum		-1	0	3	2	1	0	5
Possibles	15							

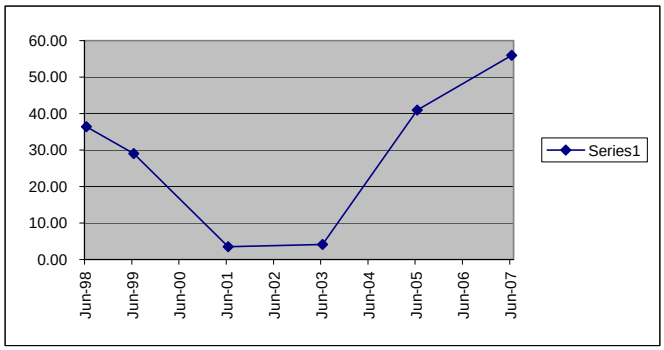

Mean	28.33
STNDEV	20.954013
COV	0.7395534

Trend: Positive

Confidence (lookup) 73.50%

S	5
tau	0.333333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U833

Date	TCE (ug/l)	Mann-Kendall Calculation:						
6/25/1998	35.20	1						
6/7/1999	36.40	1	1					
6/14/2001	29.00	1	-1	-1				
6/18/2004	3.50	1	-1	-1	-1			
6/9/2005	3.30	1	-1	-1	-1	-1		
6/14/2007	1.60	1	-1	-1	-1	-1	-1	
	N	6	5	4	3	2	1	15
	sum		-3	-4	-3	-2	-1	-13
	Possibles	15						

Mean	18.17
STNDEV	17.032518
COV	0.9375698
Trend:	Negative
Confidence (lookup)	99.00%

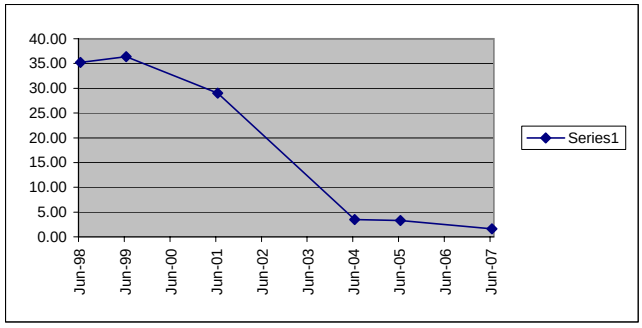

S	-13
tau	-0.866667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U834

Date	TCE (ug/l)	Mann-Kendall Calculation:						
6/29/1999	69.50	1						
6/25/2001	75.00	1	1					
6/17/2003	24.00	1	-1	-1				
6/24/2004	15.00	1	-1	-1	-1			
6/21/2005	3.70	1	-1	-1	-1	-1		
6/7/2007	2.50	1	-1	-1	-1	-1	-1	
	N	6	5	4	3	2	1	15
	sum		-3	-4	-3	-2	-1	-13
	Possibles	15						

Mean	31.62
STNDEV	32.49156
COV	1.027672
Trend:	Negative
Confidence (lookup)	99.00%

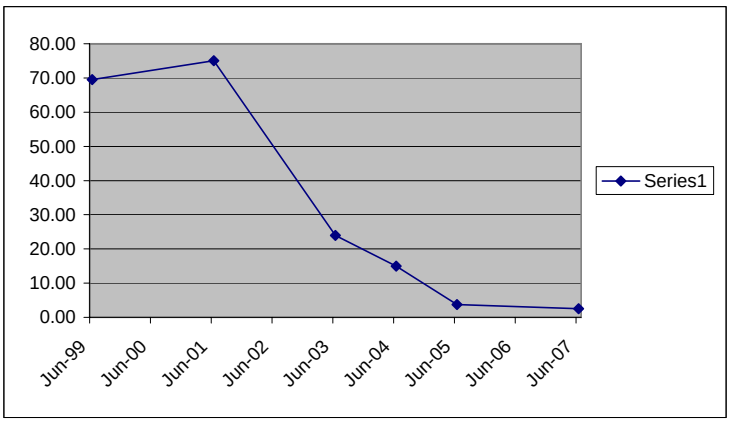

S	-13
tau	-0.866667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04U836

Date	TCE (ug/l)	Mann-Kendall Calculation:				
6/16/1999	26.00	1				
6/20/2001	11.00	1	-1			
6/10/2003	18.00	1	-1	1		
6/21/2005	37.00	1	1	1	1	
6/15/2007	32.00	1	1	1	1	-1

N		5	4	3	2	1	0	10
	sum		0	3	2	-1	0	4
Possibles		10						

Mean	24.80
STNDEV	10.47378
COV	0.42233

Trend: Positive

Confidence (lookup) 70.00%

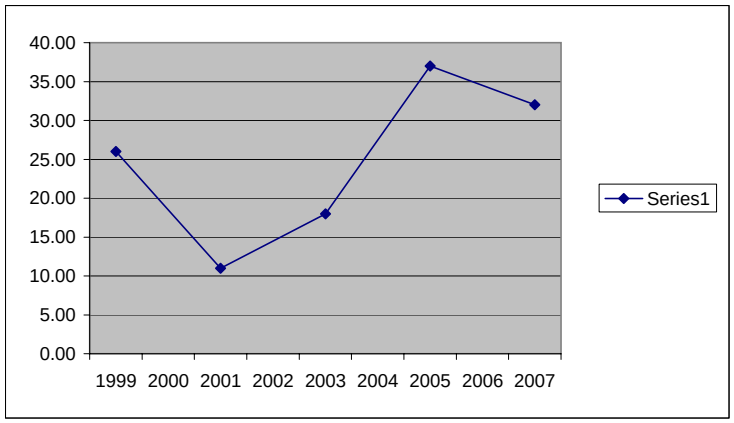

S	4
tau	0.4

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04U837

Date	TCE (ug/l)	Mann-Kendall Calculation:				
6/10/1999	16.00	1				
6/21/2001	2.60	1	-1			
6/10/2003	2.20	1	-1	-1		
6/15/2005	19.00	1	1	1	1	
6/12/2007	4.80	1	-1	1	1	-1

N		5	4	3	2	1	0	10
	sum		-2	1	2	-1	0	0
Possibles		10						

Mean	8.92
STNDEV	7.965676
COV	0.893013

Trend: Zero

Confidence (lookup) 50.00%

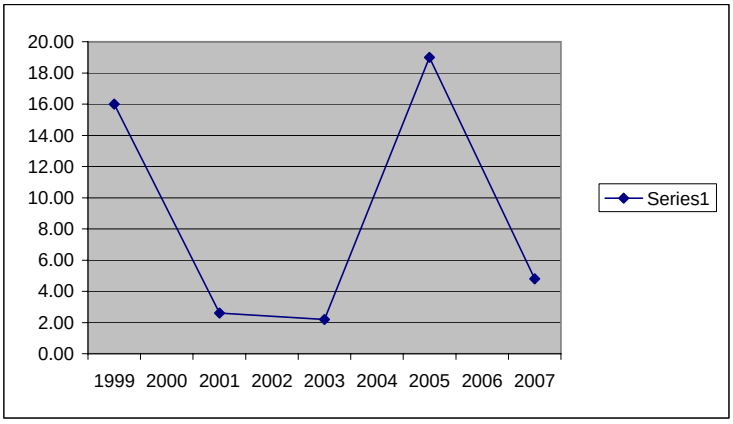

S	0
tau	0

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04U838

Date	TCE (ug/l)	Mann-Kendall Calculation:				
6/10/1999	11.00	1				
6/20/2001	1.40	1	-1			
6/9/2003	0.30	1	-1	-1		
6/7/2005	18.00	1	1	1	1	
6/12/2007	4.80	1	-1	1	1	-1

N		5	4	3	2	1	10
	sum		-2	1	2	-1	0
Possibles		10					

Mean	7.10
STNDEV	7.383089
COV	1.039872

Trend: Zero

Confidence (lookup) 50.00%

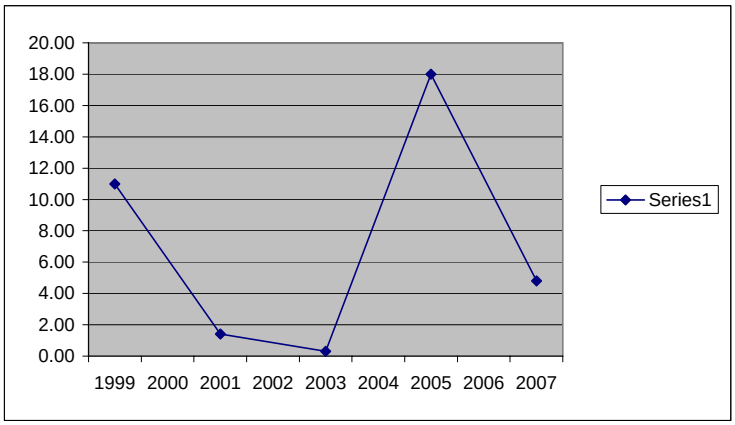

S	0
tau	0

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04U839

Date	TCE (ug/l)	Mann-Kendall Calculation:				
6/17/1999	2.70	1				
6/18/2001	1.00	1	-1			
6/6/2003	0.34	1	-1	-1		
6/7/2005	1.40	1	-1	1	1	
6/8/2007	0.57	1	-1	-1	1	-1

N	5	4	3	2	1		10
sum		-4	-1	2	-1		-4
Possibles	10						

Mean	1.20
STNDEV	0.930924
COV	0.774479
Trend:	Negative
Confidence (lookup)	70.00%

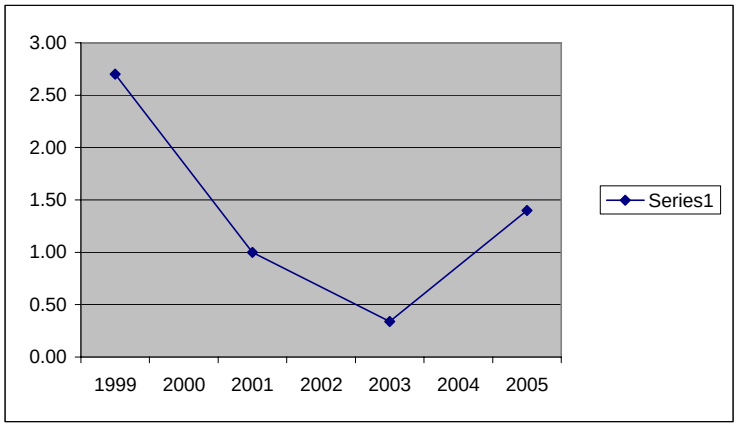

S	-4
tau	-0.4

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04U841

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/19/1998	18.80	1					
6/14/1999	19.00	1	1				
6/21/2001	25.00	1	1	1			
6/11/2003	5.00	1	-1	-1	-1		
6/9/2005	19.00	1	1	0	-1	1	
6/7/2007	24.00	1	1	1	-1	1	1

N	6	5	4	3	2	1	15
sum		3	1	-3	2	1	4
Possibles	15						

Mean	18.25
STNDEV	9.215024
COV	0.5049328
Trend:	Positive
Confidence (lookup)	70.00%

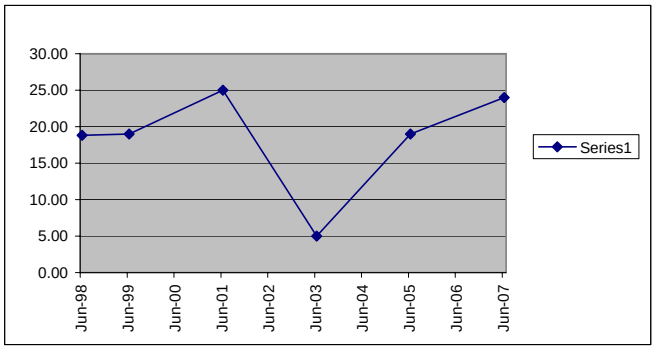

S	4
tau	0.266667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U843

Date	TCE (ug/l)	Mann-Kendall Calculation:						
6/18/1998	32.50	1						
6/14/1999	22.00	1	-1					
6/21/2001	38.00	1	1	1				
6/12/2003	0.00	1	-1	-1	-1			
6/7/2005	60.00	1	1	1	1	1		
6/14/2007	87.00	1	1	1	1	1	1	0

N		6	5	4	3	2	1	15
	sum		1	2	1	2	1	7
Possibles		15						

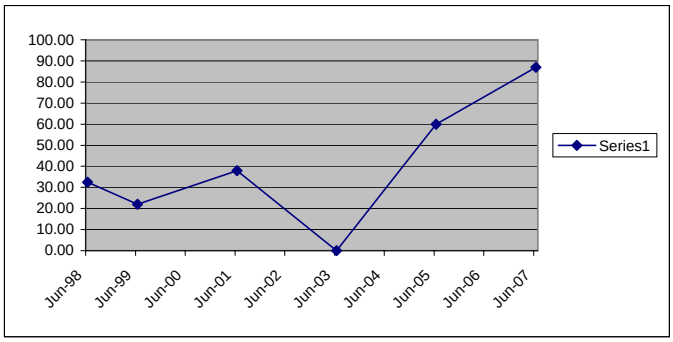

Mean	39.92
STNDEV	30.309102
COV	0.75930945

S	7
tau	0.466667

Trend: Positive

Confidence (lookup) 86.00%

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U845

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/25/1998	32.90	1					
6/7/1999	35.00	1	1				
6/13/2001	4.3	1	-1	-1			
6/1/2003	4	1	-1	-1	-1		
6/22/2005	20	1	-1	-1	1	1	
6/22/2007	15	1	-1	-1	1	1	-1

N		6	5	4	3	2	1	15
	sum		-3	-4	1	2	-1	-5
Possibles		15						

Mean	18.53
STNDEV	13.461005
COV	0.7263132

Trend: Negative

Confidence (lookup) 76.50%

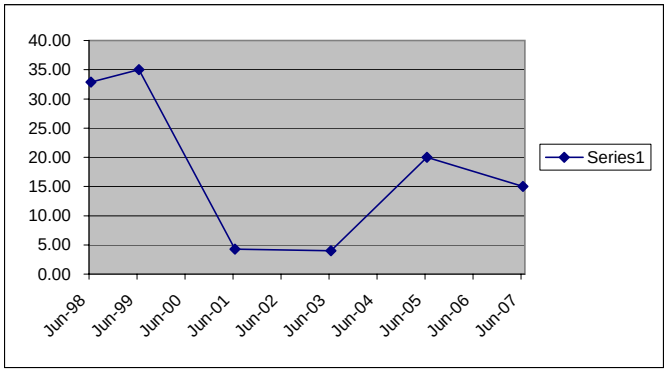

S	-5
tau	-0.333333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U846

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/17/1998	0.00	1					
6/9/1999	0.30	1	1				
6/15/2001	0.83	1	1	1			
6/9/2003	21.00	1	1	1	1		
6/10/2005	4.20	1	1	1	1	-1	
6/12/2007	6.70	1	1	1	1	-1	1

N	6	5	4	3	2	1		-1	14
sum		5	4	3	-2	1		0	11
Possibles	15								

Mean	5.51
STNDEV	8.0309246
COV	1.45884189
Trend:	Positive
Confidence (lookup)	97.00%

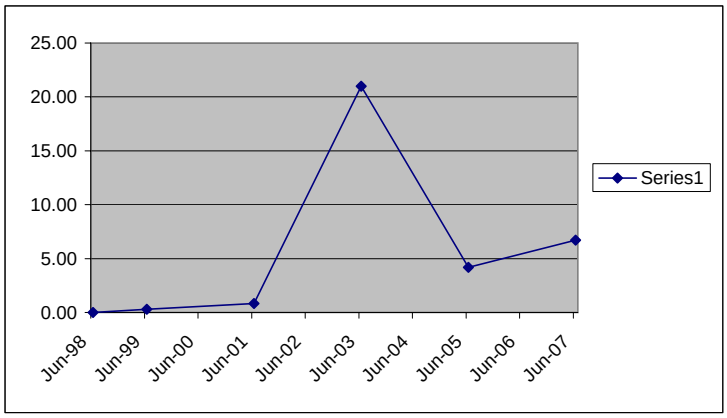

S	11
tau	0.733333

Decsion Matrix

	Confidence	COV	
M-K S	> 95%	na	**Trend**
S > 0	90-95%	na	Increasing
S > 0	< 90%	na	Prob. Incr.
S > 0	< 90%	>/= 1	No Trend
S</= 0	< 90%	< 1	No Trend
S </= 0	90-95%	na	Stable
S < 0	>95%	na	Prob Decr.
S < 0			Decreasing

Well: 04U847

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/29/1999	1300.0	1					
6/25/2001	1100.0	1	-1				
6/17/2003	680.0	1	-1	-1			
6/24/2004	1200.0	1	-1	1	1		
6/15/2005	1200.0	1	-1	1	1	0	
6/18/2007	880.0	1	-1	-1	1	-1	-1

N		6	5	4	3	2	1	15
	sum		-5	0	3	-1	-1	-4
Possibles		15						

Mean	1060.00
STNDEV	234.6061
COV	0.221326
Trend:	Negative
Confidence (lookup)	70.00%

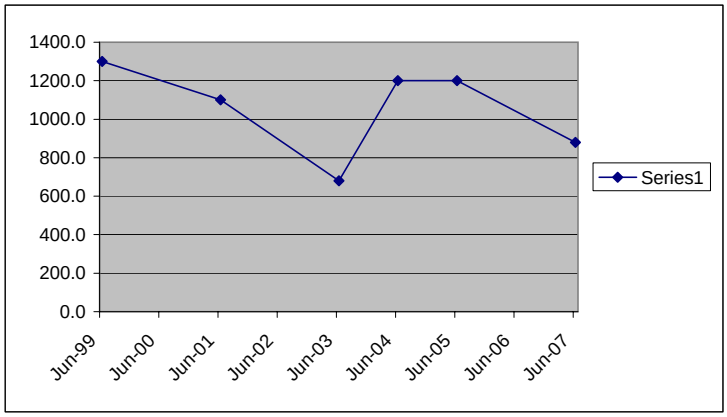

S	-4
tau	-0.266667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04U849

Date	TCE (ug/l)	Mann-Kendall Calculation:					
3/17/1993	50.90	1					
3/21/1994	70.00	1	1				
3/23/1995	46.60	1	-1	-1			
6/12/2003	43.0	1	-1	-1	-1		
6/16/2005	33.00	1	-1	-1	-1	-1	
6/11/2007	52.00	1	1	-1	1	1	1
	N	6	5	4	3	2	1
	sum		-1	-4	-1	0	1
	Possibles	15					

Mean	49.25
STNDEV	12.25557
COV	0.248844
Trend:	Negative
Confidence (lookup)	76.50%

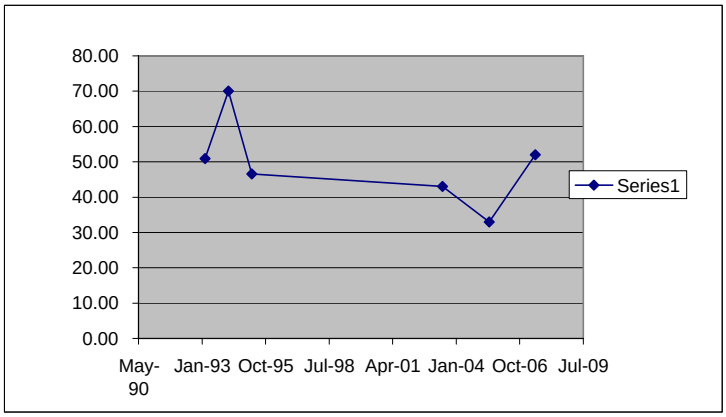

S	-5
tau	-0.333333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

120.00
50.90
70.00
46.60
43

Well: 04U854

Date	TCE (ug/l)	Mann-Kendall Calculation:					
3/9/1995	25.00	1					
6/4/1996	26.70	1	1				
6/5/1997	17.60	1	-1	-1			
6/16/2004	14.00	1	-1	-1	-1		
6/23/2005	11.00	1	-1	-1	-1	-1	
6/21/2007	11.00	1	-1	-1	-1	-1	0

	N	6	5	4	3	2	1	15
	sum		-3	-4	-3	-2	0	-12
	Possibles	15						

Mean	17.55
STNDEV	6.8939829
COV	0.3928195

Trend: Negative

Confidence (lookup) 99.00%

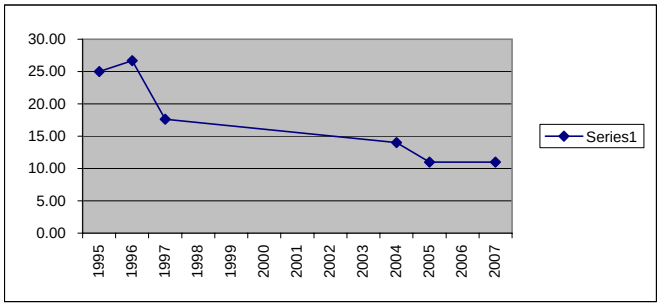

S	-12
tau	-0.8

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U859

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/25/1998	46.80	1					
6/7/1999	75.00	1	1				
6/13/2001	8.4	1	-1	-1			
6/1/2003	4.4	1	-1	-1	-1		
6/22/2005	71	1	1	-1	1	1	
6/21/2007	60	1	1	-1	1	1	-1

N		6	5	4	3	2	1	15
	sum		1	-4	1	2	-1	-1
Possibles		15						

Mean	44.27
STNDEV	30.9481286
COV	0.69912941
Trend:	Negative
Confidence (lookup)	50.0%

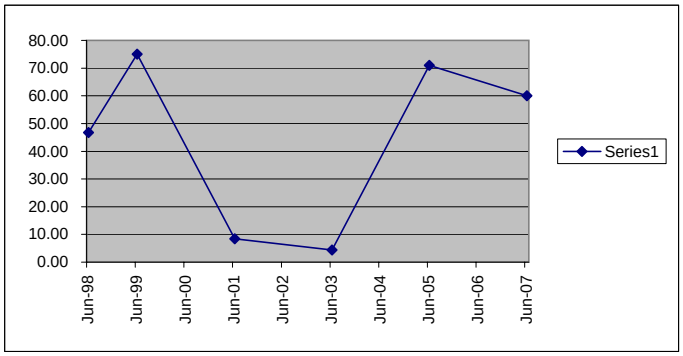

S	-1
tau	-0.066667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U861

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/29/1998	17.10	1					
6/7/1999	28.00	1	1				
6/11/2001	19	1	1	-1			
6/1/2003	46	1	1	1	1		
6/23/2005	200	1	1	1	1	1	
2/8/2006	160	1	1	1	1	1	-1
Abandoned							
	N	6	5	4	3	2	1
	sum		5	2	3	2	-1
	Possibles	15					

Mean	78.35	S	11
STNDEV	80.400342	tau	0.733333
COV	1.026169		
Trend:	Positive		
Confidence (lookup)	97.00%		

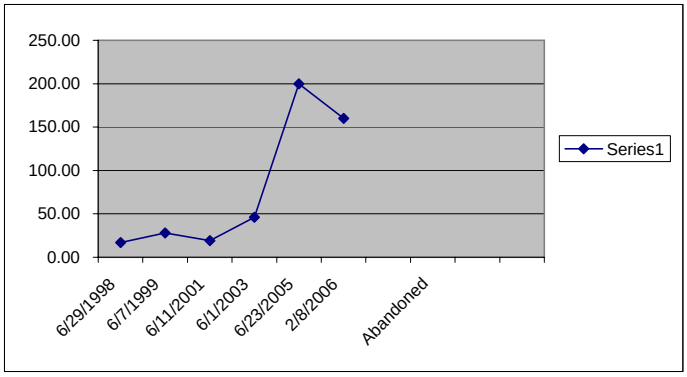

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U875

Date	TCE (ug/l)		Mann-Kendall Calculation:					
6/29/1998	12.60	1						
6/9/1999	12.00	1	-1					
6/19/2001	9.5	1	-1	-1				
6/12/2003	7.1	1	-1	-1	-1			
6/22/2005	2.5	1	-1	-1	-1	-1		
6/7/2007	1.3	1	-1	-1	-1	-1	-1	

N		6	5	4	3	2	1	15
	sum		-5	-4	-3	-2	-1	-15
Possibles		15						

Mean	7.50
STNDEV	4.7720017
COV	0.6362669
Trend:	Negative
Confidence (lookup)	99.0%

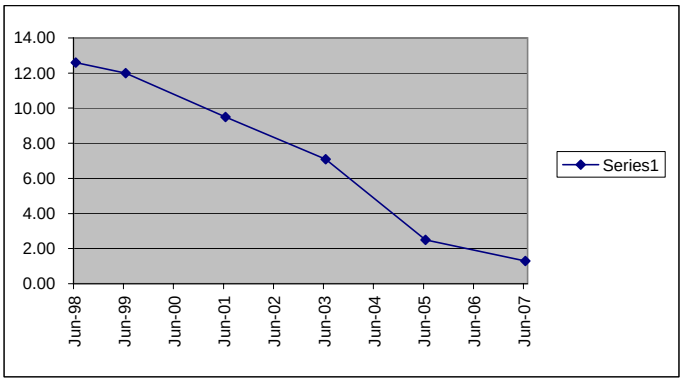

S	-15
tau	-1

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04U877

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/28/2002	2.20	1					
6/13/2003	1.90	1	-1				
6/23/2004	0.98	1	-1	-1			
6/16/2005	2.00	1	-1	1	1		
6/6/2006	0.80	1	-1	-1	-1	-1	
6/7/2007	0.68	1	-1	-1	-1	-1	-1

N		6	5	4	3	2	1	15
	sum		-5	-2	-1	-2	-1	-11
Possibles		15						

Mean	1.43
STNDEV	0.67831163
COV	0.47545208

Trend: Negative

Confidence (lookup) 97.0%

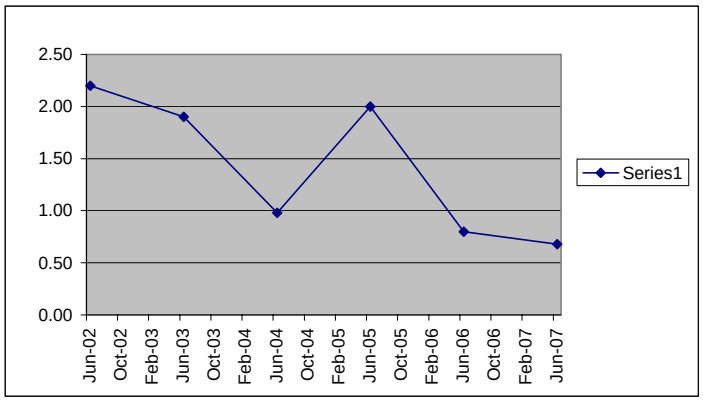

S	-11
tau	-0.733333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 04J077

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/7/2002	610	1					
6/13/2003	530	1	-1				
6/21/2004	300	1	-1	-1			
6/7/2005	140	1	-1	-1	-1		
6/9/2006	55	1	-1	-1	-1	-1	
6/12/2007	210	1	-1	-1	-1	1	1

N		6	5	4	3	2	1	15
	sum		-5	-4	-3	0	1	-11
Possibles		15						

Mean	307.50
STNDEV	220.1761
COV	0.71602
Trend:	Negative
Confidence (lookup)	97.00%

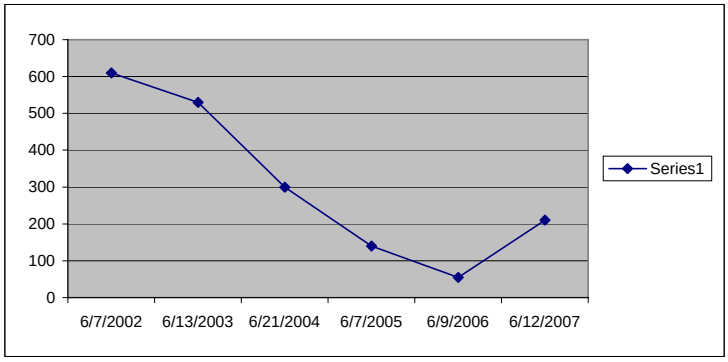

S	-11
tau	-0.733333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J702

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/11/1998	14.10	1					
6/21/1999	26.00	1	1				
6/7/2001	8.80	1	-1	-1			
6/16/2003	8.20	1	-1	-1	-1		
6/8/2005	8.20	1	-1	-1	-1	0	
6/11/2007	2.70	1	-1	-1	-1	-1	-1

N		6	5	4	3	2	1	15
	sum		-3	-4	-3	-1	-1	-12
Possibles		15						

Mean 11.33
STNDEV 8.041807
COV 0.709571

Trend: Negative

Confidence (lookup) 99.00%

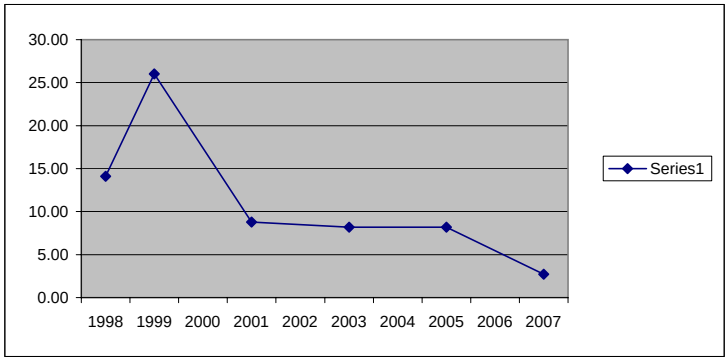

S -12

tau -0.8

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J708

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/9/1998	1.70	1					
6/23/1999	6.10	1	1				
6/7/2001	3.80	1	1	-1			
6/12/2003	3.70	1	1	-1	-1		
6/9/2005	4.50	1	1	-1	1	1	
6/6/2007	4.60	1	1	-1	1	1	1

N		6	5	4	3	2	1	15
	sum		5	-4	1	2	1	5
Possibles		15						

Mean	4.07
STNDEV	1.443145
COV	0.354872
Trend:	Positive
Confidence (lookup)	73.50%

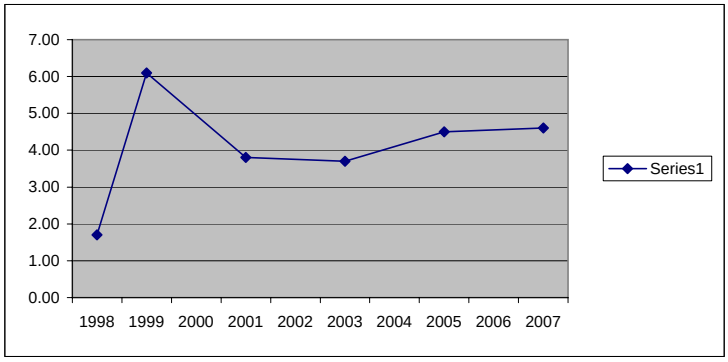

S	5
tau	0.333333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J713

Date	TCE (ug/l)	Mann-Kendall Calculation:						
6/10/1998	0.00	1						
6/22/1999	1.50	1	1					
6/12/2001	0.26	1	1	-1				
6/12/2003	0.15	1	1	-1	-1			
6/9/2005	0.00	1	0	-1	-1	-1		
6/11/2007	0.00	1	0	-1	-1	-1	0	

N		6	5	4	3	2	1	15
	sum		3	-4	-3	-2	0	-6
Possibles		15						

Mean	0.32
STNDEV	0.588572
COV	1.848916
Trend:	Negative
Confidence (lookup)	81.00%

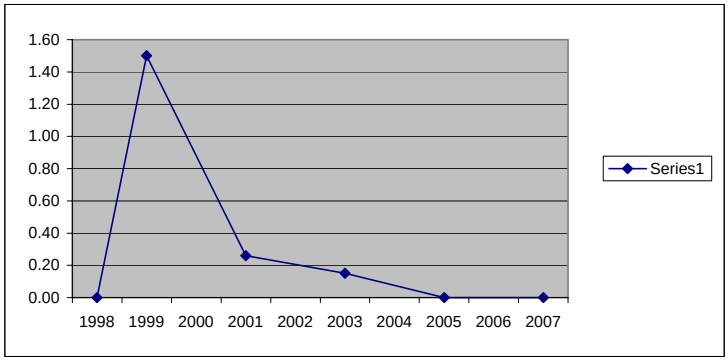

S	-6
tau	-0.4

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J822

Date	TCE (ug/l)	Mann-Kendall Calculation:					
12/28/2004	13.00	1					
6/30/2005	29.00	1	1				
1/11/2006	58.00	1	1	1			
6/6/2006	87.00	1	1	1	1		
12/11/2006	85.00	1	1	1	1	-1	
6/13/2007	83.00	1	1	1	1	-1	-1

N		6	5	4	3	2	1	15
	sum		5	4	3	-2	-1	9
Possibles		15						

Mean	59.17
STNDEV	31.7894112
COV	0.53728582
Trend:	Positive
Confidence (lookup)	93.00%

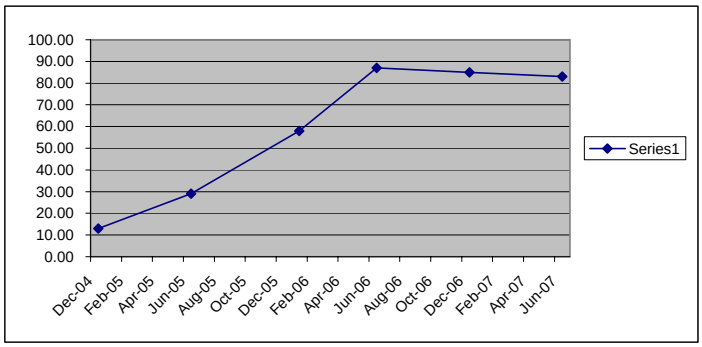

S	9
tau	0.6

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J834

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/18/1998	0.00	1					
6/10/1999	0.00	1	0				
6/15/2001	0.31	1	1	1			
6/9/2003	0.29	1	1	1	-1		
6/8/2005	0.38	1	1	1	1	1	
6/4/2007	0.35	1	1	1	1	1	-1

N		6	5	4	3	2	1	15
	sum		4	4	1	2	-1	10
Possibles		15						

Mean	0.22
STNDEV	0.174518
COV	0.787301
Trend:	Positive
Confidence (lookup)	95.00%

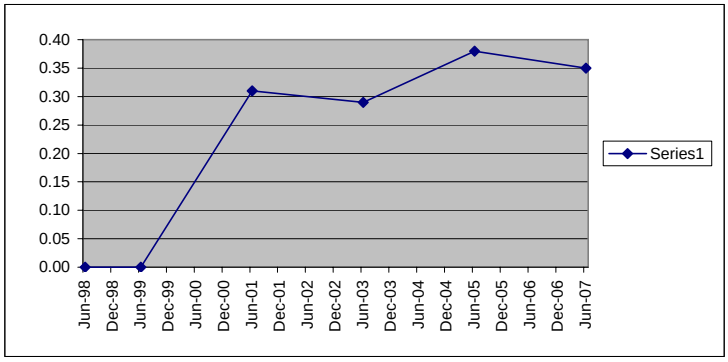

S	10
tau	0.666667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J836

Date	TCE (ug/l)	Mann-Kendall Calculation:					
9/4/1998	3.91	1					
6/16/1999	4.20	1	1				
6/20/2001	0.41	1	-1	-1			
6/10/2003	0.82	1	-1	-1	1		
6/21/2005	3.70	1	-1	-1	1	1	
6/13/2007	4.20	1	1	0	1	1	1

N		6	5	4	3	2	14
	sum		-1	-3	3	2	1
Possibles		15					

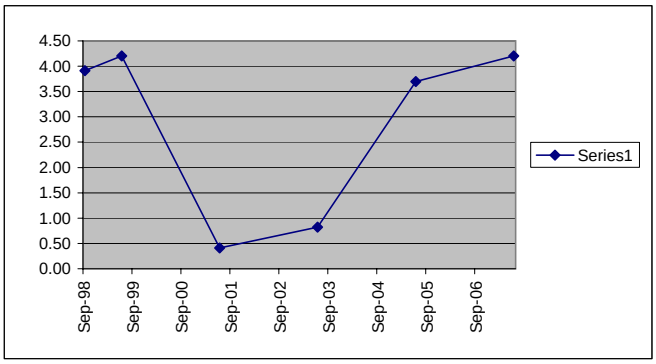

Mean	2.87
STNDEV	1.764218
COV	0.613997

S	1
tau	0.066667

Trend: Positive

Confidence (lookup) 50.00%

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J837

Date	TCE (ug/l)	Mann-Kendall Calculation:					
9/8/1998	147.00	1					
6/10/1999	60.00	1	-1				
6/23/2001	27.00	1	-1	-1			
6/16/2003	13.00	1	-1	-1	-1		
6/20/2005	14.00	1	-1	-1	-1	1	
6/8/2007	15.00	1	-1	-1	-1	1	1

N		6	5	4	3	2	1	15
	sum		-5	-4	-3	2	1	-9
Possibles		15						

Mean	46.00
STNDEV	52.59658
COV	1.143404

Trend: Negative

Confidence (lookup) 93.00%

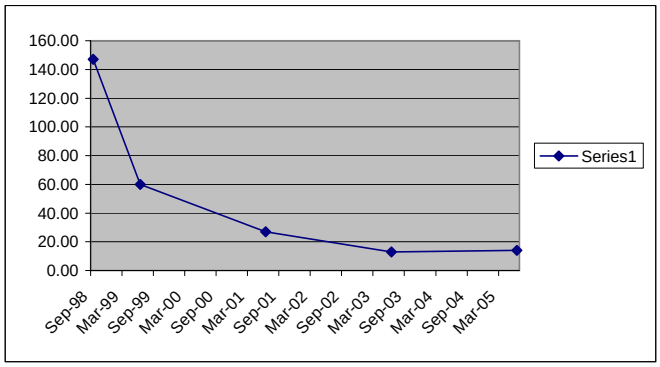

S	-9
tau	-0.6

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J838

Date	TCE (ug/l)	Mann-Kendall Calculation:					
9/3/1998	39.80	1					
6/10/1999	46.00	1	1				
6/23/2001	12.00	1	-1	-1			
6/9/2003	4.20	1	-1	-1	-1		
6/17/2005	30.00	1	-1	-1	1	1	
6/12/2007	31.00	1	-1	-1	1	1	1

N		6	5	4	3	2	1	15
	sum		-3	-4	1	2	1	-3
Possibles		15						

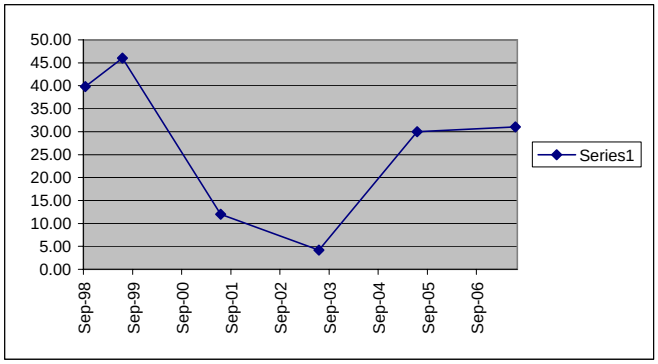

Mean	27.17
STNDEV	16.09045
COV	0.592287

Trend: Negative

Confidence (lookup) 64.00%

S	-3
tau	-0.2

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J839

Date	TCE (ug/l)	Mann-Kendall Calculation:					
9/4/1998	1.94	1					
6/17/1999	1.80	1	-1				
6/18/2001	0.00	1	-1	-1			
6/5/2003	0.48	1	-1	-1	1		
6/17/2005	3.20	1	1	1	1	1	
6/8/2007	1.90	1	-1	1	1	1	-1

N		6	5	4	3	2	1	15
	sum		-3	0	3	2	-1	1
Possibles		15						

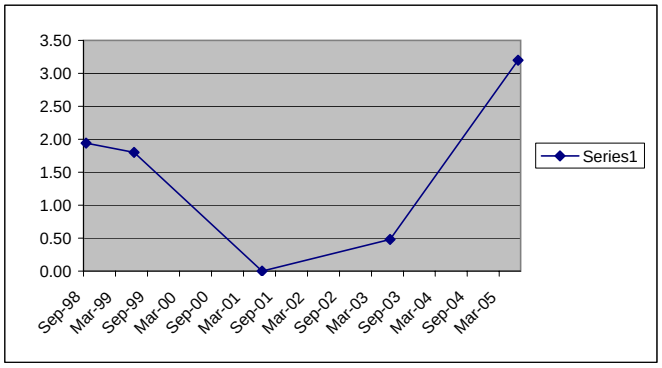

Mean	1.55
STNDEV	1.149516
COV	0.740032

S	1
tau	0.066667

Trend: Positive

Confidence (lookup) 50.00%

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J847

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/15/2005	950.00	1					
1/11/2006	840.00	1	-1				
6/6/2006	980.00	1	1	1			
12/11/2006	740.00	1	-1	-1	-1		
6/18/2007	770.00	1	-1	-1	-1	1	

N		5	4	3	2	1	0	10
	sum		-2	-1	-2	1	0	-4
Possibles		10						

Mean	856.00
STNDEV	106.4425
COV	0.124349

Trend: Negative

Confidence (lookup) 71.00%

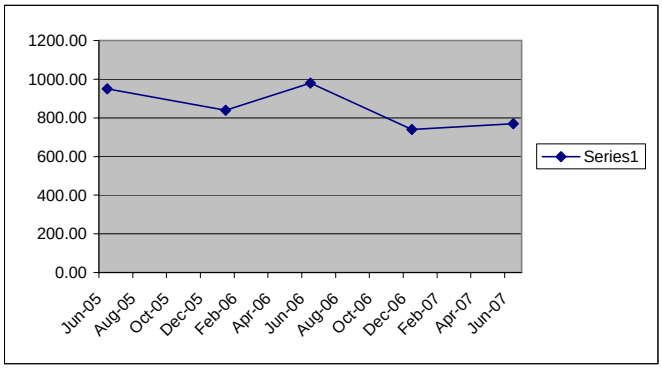

S	-4
tau	-0.4

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J849

Date	TCE (ug/l)	Mann-Kendall Calculation:					
12/28/2004	0.0	1					
6/9/2005	0.0	1	0				
1/11/2006	0.0	1	0	0			
6/5/2006	0.0	1	0	0	0		
12/11/2006	0.24	1	1	1	1	1	
6/12/2007	0.21	1	1	1	1	1	-1

	N	6	5	4	3	2	1	15
	sum		2	2	2	2	-1	7
	Possibles	15						

Mean	0.08
STNDEV	0.116576
COV	1.554349

Trend: Positive

Confidence (lookup) 86.00%

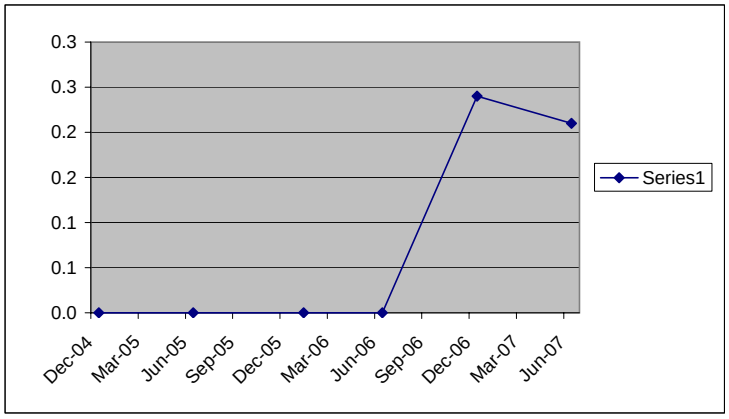

S	7
tau	0.466667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 04J882

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/19/1998	0.00	1					
6/10/1999	0.00	1	0				
6/15/2001	0.00	1	0	0			
6/6/2003	0.00	1	0	0	0		
6/8/2005	0.00	1	0	0	0	0	
6/6/2007	0.00	1	0	0	0	0	0

N		6	5	4	3	2	1	15
	sum		0	0	0	0	0	0
Possibles		15						

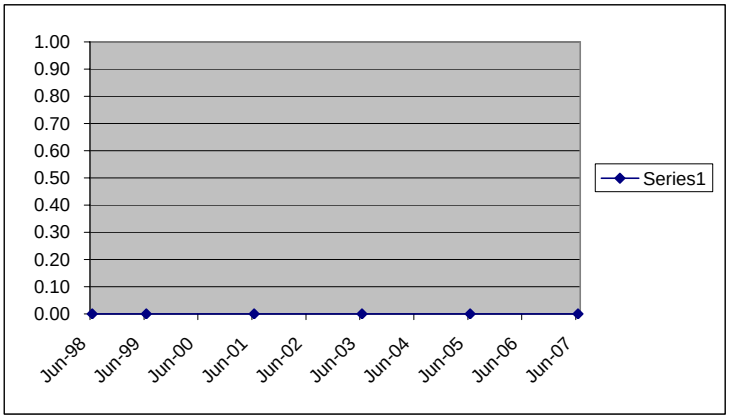

Mean	0.00
STNDEV	0
COV	#DIV/0!
Trend:	Zero
Confidence (lookup)	43.00%

S	0
tau	0

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 206688

Date	TCE (ug/l)	Mann-Kendall Calculation:					
7/3/1996	9.27	1					
6/26/1998	11.10	1	1				
6/9/1999	9.70	1	1	-1			
6/23/2004	11.00	1	1	-1	1		
6/6/2005	9.50	1	1	-1	-1	-1	
6/11/2007	11.00	1	1	-1	1	0	1

N		6	5	4	3	2	1	15
	sum		5	-4	1	-1	1	2
Possibles		15						

Mean	10.26
STNDEV	0.8569811
COV	0.0835129
Trend:	Positive
Confidence (lookup)	56.0%

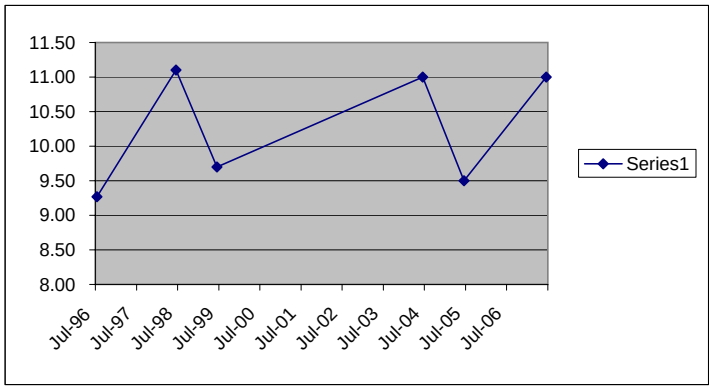

S	2
tau	0.133333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: **409549**

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/19/1998	8.18	1					
6/11/1999	5.00	1	-1				
6/19/2001	7.9	1	-1	1			
6/11/2003	20	1	1	1	1		
6/10/2005	28	1	1	1	1	1	
6/13/2007	18	1	1	1	1	-1	-1

N		6	5	4	3	2	1	15
	sum		1	4	3	0	-1	7
Possibles		15						

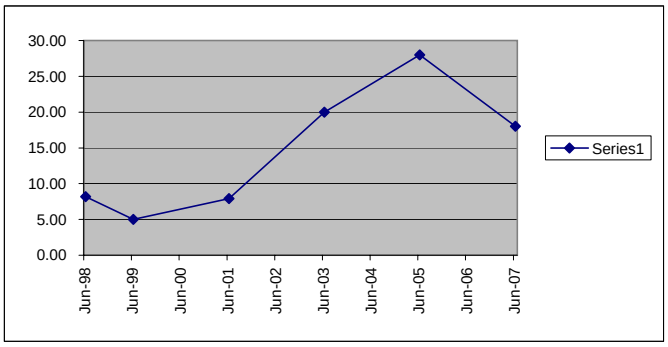

Mean	14.51
STNDEV	8.927501
COV	0.615124

Trend: Positive

Confidence (lookup) 86.40%

S	7
tau	0.466667

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 409550

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/23/1998	530.00	1					
6/15/1999	425.00	1	-1				
6/25/2001	200.00	1	-1	-1			
6/13/2003	100.00	1	-1	-1	-1		
6/14/2005	80.00	1	-1	-1	-1	-1	
6/15/2007	47.00	1	-1	-1	-1	-1	-1

N		6	5	4	3	2	1	15
	sum		-5	-4	-3	-2	-1	-15
Possibles		15						

Mean	230.33
STNDEV	200.9046
COV	0.872234
Trend:	Negative
Confidence (lookup)	99.00%

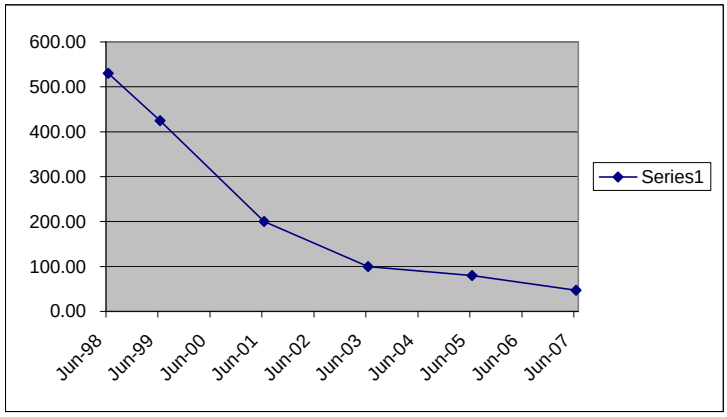

S	-15
tau	-1

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 409557

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/22/1998	0.00	1					
6/11/1999	16.00	1	1				
6/20/2001	13	1	1	-1			
6/1/2003	4.1	1	1	-1	-1		
6/9/2005	27	1	1	1	1	1	
6/11/2007	40	1	1	1	1	1	1

N	6	5	4	3	2	1	15
sum		5	0	1	2	1	9
Possibles	15						

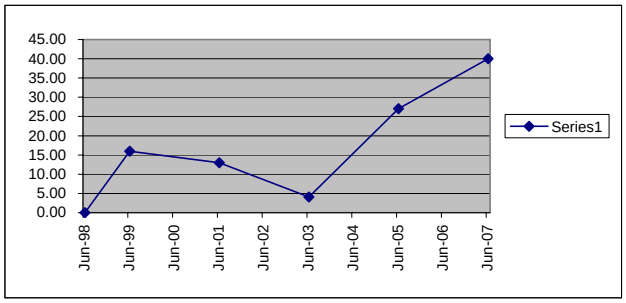

Mean	16.68
STNDEV	14.8378458
COV	0.88938136

Trend: Positive

Confidence (lookup) 93.20%

S	9
tau	0.6

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Prob. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Prob Decr.
S < 0	>95%	na	Decreasing

Well: 409596

Date	TCE (ug/l)	Mann-Kendall Calculation:					
3/15/1993	14.40	1					
3/18/1994	15.50	1	1				
3/20/1995	7.26	1	-1	-1			
6/13/2003	1.50	1	-1	-1	-1		
6/9/2005	5.40	1	-1	-1	-1	1	
6/14/2007	5.40	1	-1	-1	-1	1	0

N		6	5	4	3	2	1	15
	sum		-3	-4	-3	2	0	-8
Possibles		15						

Mean	8.24
STNDEV	5.534841
COV	0.671432

Trend: Negative

Confidence (lookup) 90.00%

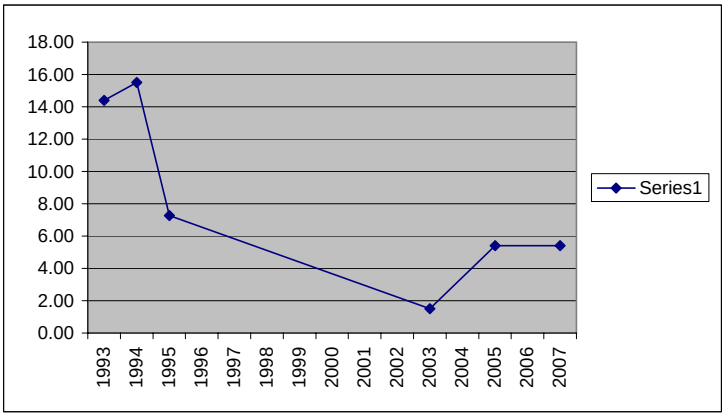

S	-8
tau	-0.533333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

Well: 409597

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/23/1998	147.00	1					
6/15/1999	180.00	1	1				
6/23/2001	110.00	1	-1	-1			
6/13/2003	87.00	1	-1	-1	-1		
6/14/2005	94.00	1	-1	-1	-1	1	
6/15/2007	59.00	1	-1	-1	-1	-1	-1

N		6	5	4	3	2	1	15
	sum		-3	-4	-3	0	-1	-11
Possibles		15						

Mean	112.83
STNDEV	43.8334
COV	0.388479
Trend:	Negative
Confidence (lookup)	99.00%

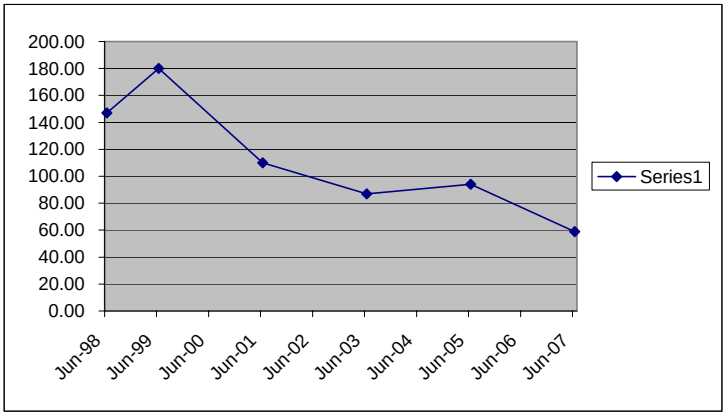

S	-11
tau	-0.733333

Decsion Matrix

M-K S	Confidence	COV	Trend
S > 0	> 95%	na	Increasing
S > 0	90-95%	na	Pr. Incr.
S > 0	< 90%	na	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	na	Pr. Decr.
S < 0	>95%	na	Decreasing

D.2.4 Group 3 and Group 5 Kriging Evaluation

Group 5

1997

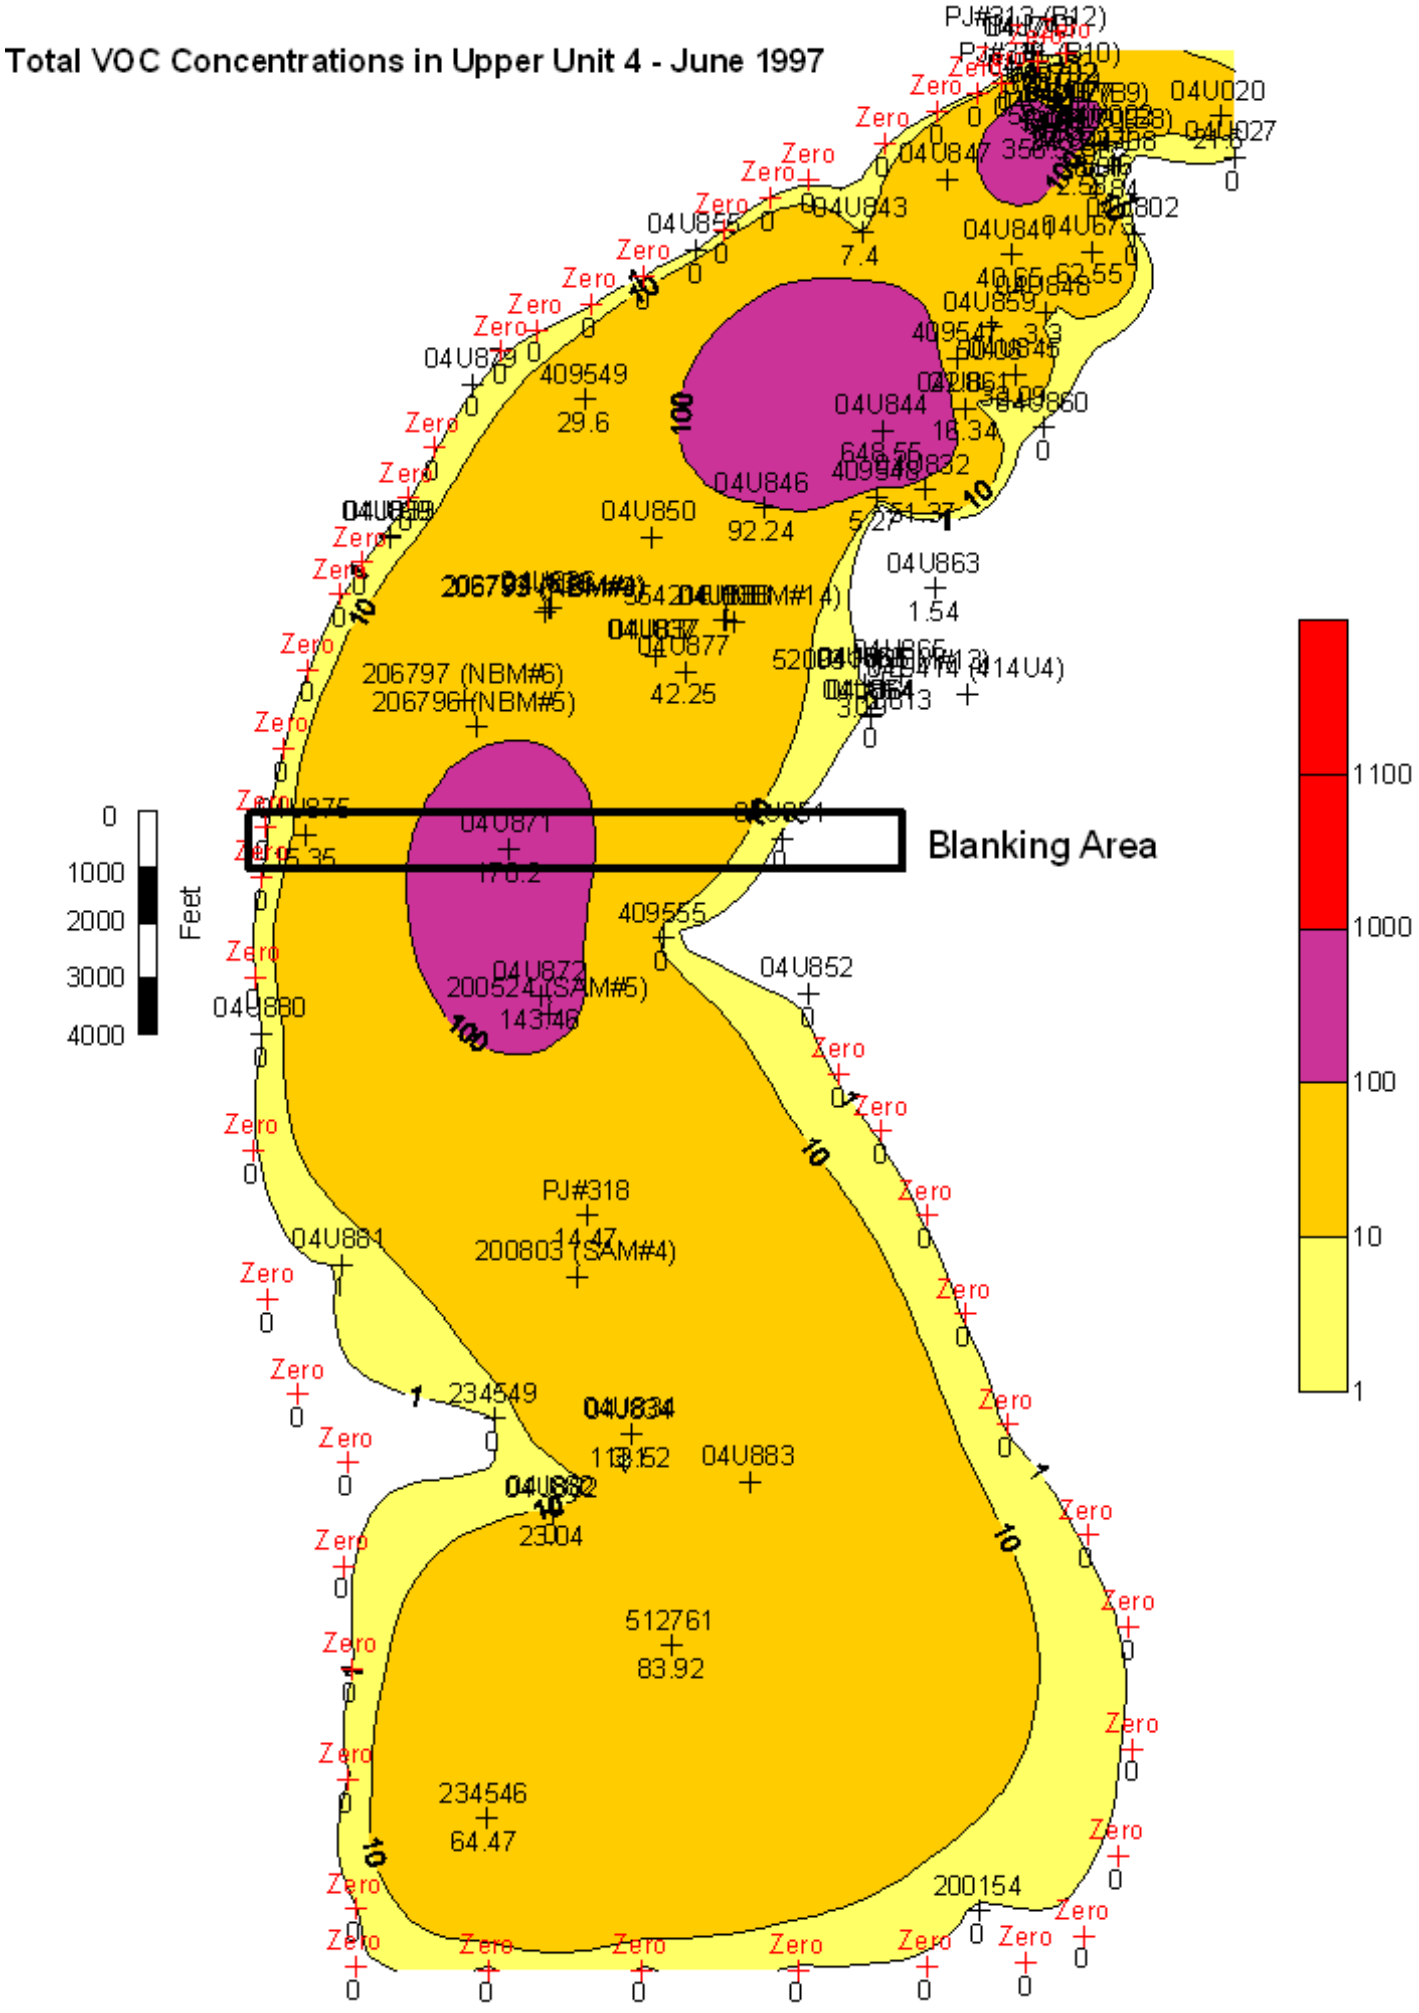
Total VOC Concentrations in Upper Unit 4 - June 1997
Blanking Area
0
1000
2000
3000
4000
Feet
1100
1000
100
10
1
Zero
04U020
04U847
04U843
04U855
04U840
04U802
04U859
04U829
409549
29.6
04U844
18.34
04U846
04U850
92.24
04U863
1.54
206797 (NBM#6)
206796 (NBM#5)
04U877
42.25
04U871
176.2
409555
04U852
04U880
200524 (SAM#5)
143.46
PJ#318
14.47
200803 (SAM#4)
04U881
234549
04U883
23.04
512761
83.92
234546
64.47
200154

Groundwater Quality Data (Organics) - 1997		
Well	Date	TOTAL VOCs (ug/l)
04J077	6/10/97	346.57
04J702	6/6/97	53.83
04J708	6/11/97	4.84
04J713	6/10/97	0.00
04J834	6/24/97	3.10
04J864	6/3/97	0.00
04J866	6/2/97	0.00
04J882	6/24/97	0.00
04U002	6/16/97	5.16
04U020	6/16/97	21.60
04U027	6/10/97	0.00
04U077	6/10/97	273.72
04U673	6/12/97	62.55
04U701	6/18/97	6.92
04U702	6/6/97	14.71
04U709	6/9/97	28.01
04U711	6/13/97	2.53
04U713	6/10/97	0.00
04U802	6/16/97	0.00
04U806	6/5/97	356.59
04U832	6/4/97	51.37
04U833	6/5/97	59.30
04U834	6/24/97	112.52
04U841	6/24/97	40.65
04U843	6/25/97	7.40
04U844	6/27/97	648.55
04U845	6/5/97	32.09
04U846	6/25/97	92.24
04U848	6/5/97	3.30
04U851	6/4/97	0.00
04U852	6/24/97	0.00
04U855	6/26/97	0.00
04U859	6/4/97	50.08
04U860	6/5/97	0.00
04U861	6/4/97	16.34
04U863	6/3/97	1.54
04U864	6/3/97	0.00
04U865	6/3/97	0.81
04U866	6/2/97	3.19
04U871	6/25/97	178.20
04U872	6/19/97	143.46
04U875	6/26/97	15.35
04U877	6/23/97	42.25
04U879	6/25/97	0.00
04U880	6/26/97	0.00
04U881	6/24/97	1.00
04U882	6/24/97	23.04
200154	6/27/97	0.00
234546	6/24/97	64.47
234549	6/27/97	0.00
409547	6/5/97	22.80
409548	6/4/97	5.27
409549	6/23/97	29.60
409555	6/26/97	0.00
512761	6/24/97	83.92
PJ#318	6/26/97	14.47

North Plume
Average Total VOC Concentration Calculations
Group 5
TCAAP
June 1997

Concentration	Positive Planar Area (m2)
Plume to 1	32684921
Plume to 5	29464761
Plume to 10	26448984
Plume to 50	10398696
Plume to 100	3199895
Plume to 200	745654
Plume to 300	317170
Plume to 400	127939
Plume to 500	32208
Plume to 600	100
Plume to 700	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	3220160	9660479
5 to 10	7.5	3015777	22618327
10 to 50	30	16050289	481508657
50 to 100	75	7198801	539910067
100 to 200	150	2454241	368136114
200 to 300	250	428484	107121047
300 to 400	350	189231	66230926
400 to 500	450	95731	43078773
500 to 600	550	32107	17659116
600 to 700	650	100	65324
	Sum	32684921	1655988831

Area Wtd Conc	51	ug/L

1998

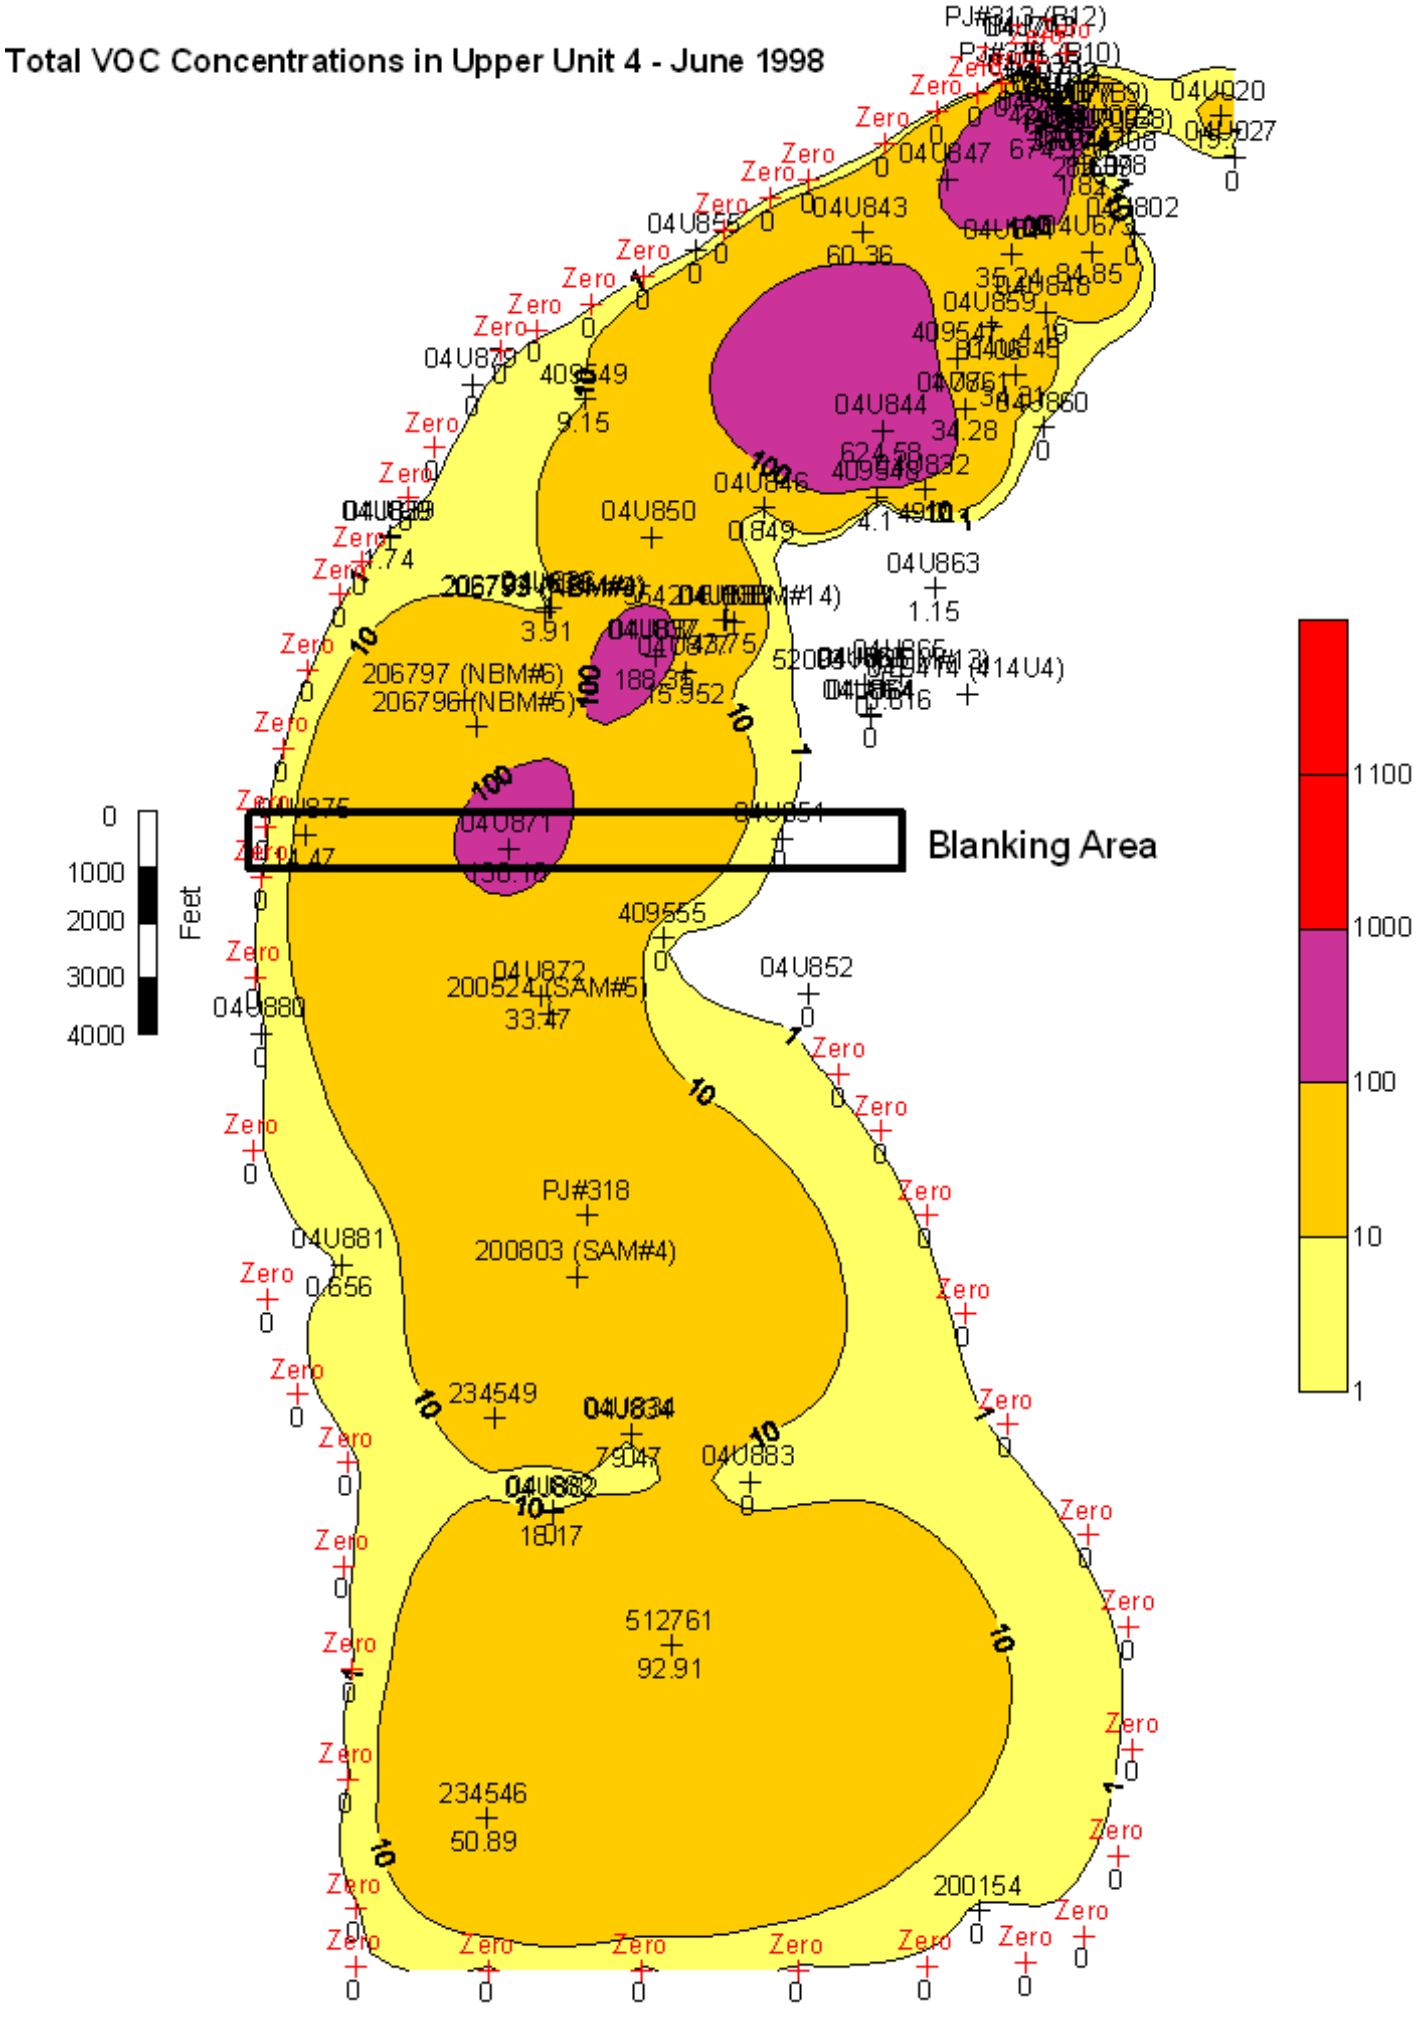
Total VOC Concentrations in Upper Unit 4 - June 1998
Blanking Area
Feet
0
1000
2000
3000
4000
1100
1000
100
10
1
Zero
04U847
04U843
04U844
04U846
04U850
04U863
04U871
04U851
04U852
04U872
04U880
04U881
04U834
04U883
04U882
04U802
04U673
04U848
04U859
04U860
04U861
04U879
04U855
04U020
04U027
409549
409555
206797 (NBM#6)
206796 (NBM#5)
200524 (SAM#5)
PJ#318
200803 (SAM#4)
234549
512761
92.91
234546
50.89
200154
60.36
35.24
84.85
9.15
34.28
624.58
4.19
1.15
3.91
33.47
79.47
18.17
0.656
1.74

Groundwater Quality Data (Organics) - 1998		
Well	Date	TOTAL VOCs (ug/l)
04J077	6/15/98	318.11
04J702	6/11/98	15.26
04J708	6/9/98	1.70
04J713	6/10/98	0.00
04J834	6/18/98	0.00
04J836	9/4/98	3.91
04J837	9/8/98	188.35
04J838	9/3/98	43.75
04J839	9/4/98	1.74
04J864	6/25/98	0.00
04J866	6/26/98	0.00
04J882	6/19/98	0.00
04U002	6/5/98	12.08
04U020	6/4/98	19.70
04U027	6/16/98	0.00
04U077	6/12/98	307.74
04U673	6/25/98	84.85
04U701	6/10/98	7.56
04U702	6/11/98	11.85
04U709	6/16/98	28.61
04U711	6/9/98	1.82
04U713	6/10/98	0.00
04U802	6/11/98	0.00
04U806	6/12/98	674.90
04U832	6/25/98	49.20
04U833	6/11/98	42.90
04U834	6/18/98	79.47
04U841	6/19/98	35.24
04U843	6/18/98	60.36
04U844	6/23/98	624.58
04U845	6/25/98	34.31
04U846	6/17/98	0.85
04U848	6/29/98	4.19
04U851	6/26/98	0.00
04U852	6/26/98	0.00
04U855	6/18/98	0.00
04U859	6/25/98	81.06
04U860	6/29/98	0.00
04U861	6/29/98	34.28
04U863	6/25/98	1.15
04U864	6/25/98	0.00
04U865	6/25/98	0.82
04U871	6/23/98	138.16
04U872	6/9/98	33.47
04U875	6/29/98	14.47
04U877	6/19/98	15.95
04U879	6/24/98	0.00
04U880	6/24/98	0.00
04U881	6/23/98	0.66
04U882	6/19/98	18.17
04U883	6/24/98	0.00
200154	6/26/98	0.00
234546	6/25/98	50.89
409547	6/22/98	1.77
409548	6/22/98	4.10
409549	6/19/98	9.15
409555	6/19/98	0.00
512761	6/25/98	92.91

North Plume
Average Total VOC Concentration Calculations
Group 5
TCAAP
June 1998

Concentration	Positive Planar Area (m2)
Plume to 1	32092171
Plume to 5	27662632
Plume to 10	23087160
Plume to 50	7346565
Plume to 100	2377485
Plume to 200	787450
Plume to 300	352369
Plume to 400	134661
Plume to 500	25717
Plume to 600	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	4429539	13288616
5 to 10	7.5	4575472	34316037
10 to 50	30	15740596	472217867
50 to 100	75	4969080	372680972
100 to 200	150	1590035	238505230
200 to 300	250	435081	108770344
300 to 400	350	217708	76197641
400 to 500	450	108945	49025219
500 to 600	550	25717	14144095
	Sum	32092171	1379146020

Area Wtd Conc	43	ug/L

1999

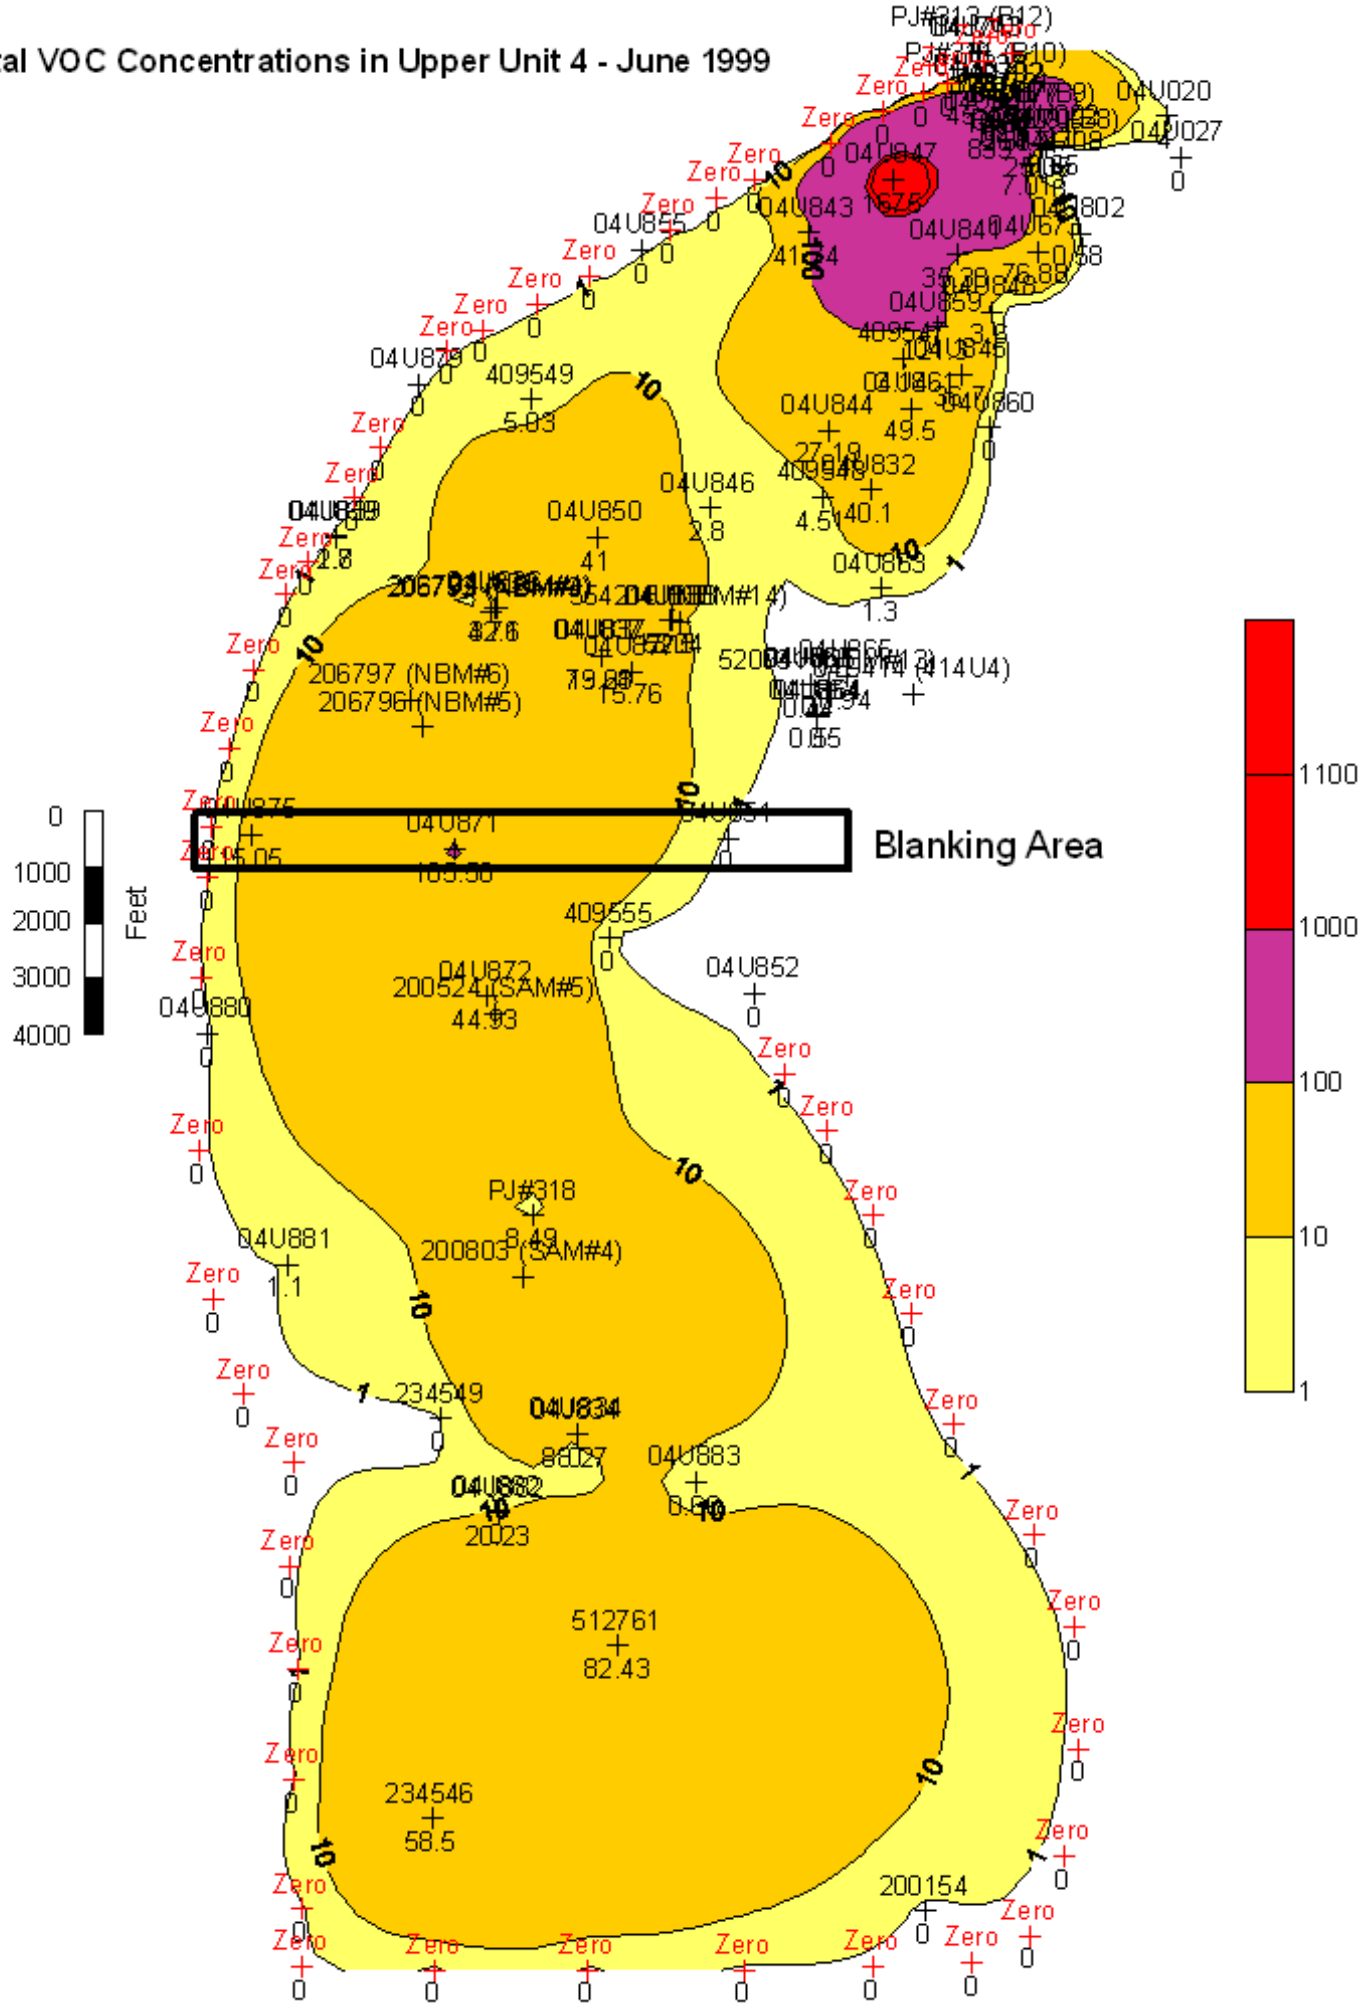
Total VOC Concentrations in Upper Unit 4 - June 1999
Blanking Area
Feet
0
1000
2000
3000
4000
1100
1000
100
10
1
Zero
04U847
04U843
1675
04U840
41.24
04U855
04U020
04U027
04U802
04U859
04U829
409549
5.03
04U844
49.5
04U846
2.8
04U850
41
04U832
4.5
140.1
04U863
1.3
206797 (NBM#6)
206796 (NBM#5)
15.76
04U871
105.56
409555
04U852
04U872
200524 (SAM#5)
44.93
04U880
PJ#318
8.49
200803 (SAM#4)
04U881
1.1
234549
04U834
8027
04U883
2023
512761
82.43
234546
58.5
200154

Groundwater Quality Data (Organics) - 1999		
Well	Date	TOTAL VOCs (ug/l)
04J077	6/22/99	1314.00
04J702	6/21/99	30.20
04J708	6/23/99	8.00
04J713	6/22/99	1.50
04J834	6/10/99	0.00
04J836	6/16/99	4.71
04J837	6/10/99	73.61
04J838	6/10/99	52.50
04J839	6/17/99	1.80
04J864	6/4/99	0.55
04J866	6/7/99	0.00
04J882	6/10/99	0.00
04U002	6/21/99	9.65
04U020	6/21/99	4.00
04U027	6/22/99	0.00
04U077	6/22/99	214.70
04U673	6/4/99	76.88
04U701	6/28/99	17.80
04U702	6/21/99	16.84
04U709	6/25/99	25.05
04U711	6/28/99	7.01
04U713	6/22/99	1.60
04U802	6/23/99	0.58
04U806	6/23/99	839.00
04U832	6/7/99	40.10
04U833	6/22/99	45.47
04U834	6/10/99	88.27
04U836	6/16/99	32.60
04U837	6/10/99	19.28
04U838	6/10/99	13.04
04U839	6/17/99	2.70
04U841	6/14/99	35.38
04U843	6/14/99	41.74
04U844	6/15/99	27.19
04U845	6/7/99	36.70
04U846	6/9/99	2.80
04U847	6/29/99	1675.00
04U848	6/4/99	3.60
04U850	6/9/99	41.00
04U851	6/8/99	0.00
04U852	6/8/99	0.00
04U855	6/11/99	0.00
04U859	6/7/99	121.30
04U860	6/7/99	0.00
04U861	6/7/99	49.50
04U863	6/7/99	1.30
04U864	6/4/99	0.00
04U865	6/8/99	0.94
04U866	12/18/00	0.44
04U871	6/11/99	105.58
04U872	6/9/99	44.93
04U875	6/9/99	15.05
04U877	6/14/99	15.76
04U879	6/11/99	0.00
04U880	6/14/99	0.00
04U881	6/15/99	1.10
04U882	6/10/99	20.23
04U883	6/14/99	0.66
200154	6/15/99	0.00
234546	6/15/99	58.50
234549	6/9/99	0.00
409547	6/11/99	3.14
409548	6/14/99	4.51
409549	6/11/99	5.03
409555	6/11/99	0.00
512761	6/15/99	82.43
PJ#318	6/10/99	8.49

North Plume
Average Total VOC Concentration Calculations
Group 5
TCAAP
June 1999

Concentration	Positive Planar Area (m2)
Plume to 1	32152197
Plume to 5	26871107
Plume to 10	21286747
Plume to 50	5028631
Plume to 100	1308233
Plume to 200	945626
Plume to 300	751118
Plume to 400	607728
Plume to 500	499154
Plume to 600	402501
Plume to 700	306873
Plume to 800	206371
Plume to 900	147267
Plume to 1000	102626
Plume to 1100	68502
Plume to 1200	43348
Plume to 1300	23382
Plume to 1400	1580
Plume to 1500	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	5281090	15843270
5 to 10	7.5	5584361	41882705
10 to 50	30	16258115	487743458
50 to 100	75	3720399	279029890
100 to 200	150	362607	54391038
200 to 300	250	194508	48627018
300 to 400	350	143390	50186427
400 to 500	450	108574	48858241
500 to 600	550	96653	53159057
600 to 700	650	95628	62158118
700 to 800	750	100502	75376593
800 to 900	850	59104	50238740
900 to 1000	950	44641	42409035
1000 to 1100	1050	34124	35830376
1100 to 1200	1150	25154	28927105
1200 to 1300	1250	19966	24957475
1300 to 1400	1350	21802	29432460
1400 to 1500	1450	1580	2290660
	Sum	32152197	1431341667

Area Wtd Conc	45	ug/L

\\stp_fs1\stpaul\0000-dan\total vocs\group3and5\1999\1999 conc group 3 and 5.xls

2001

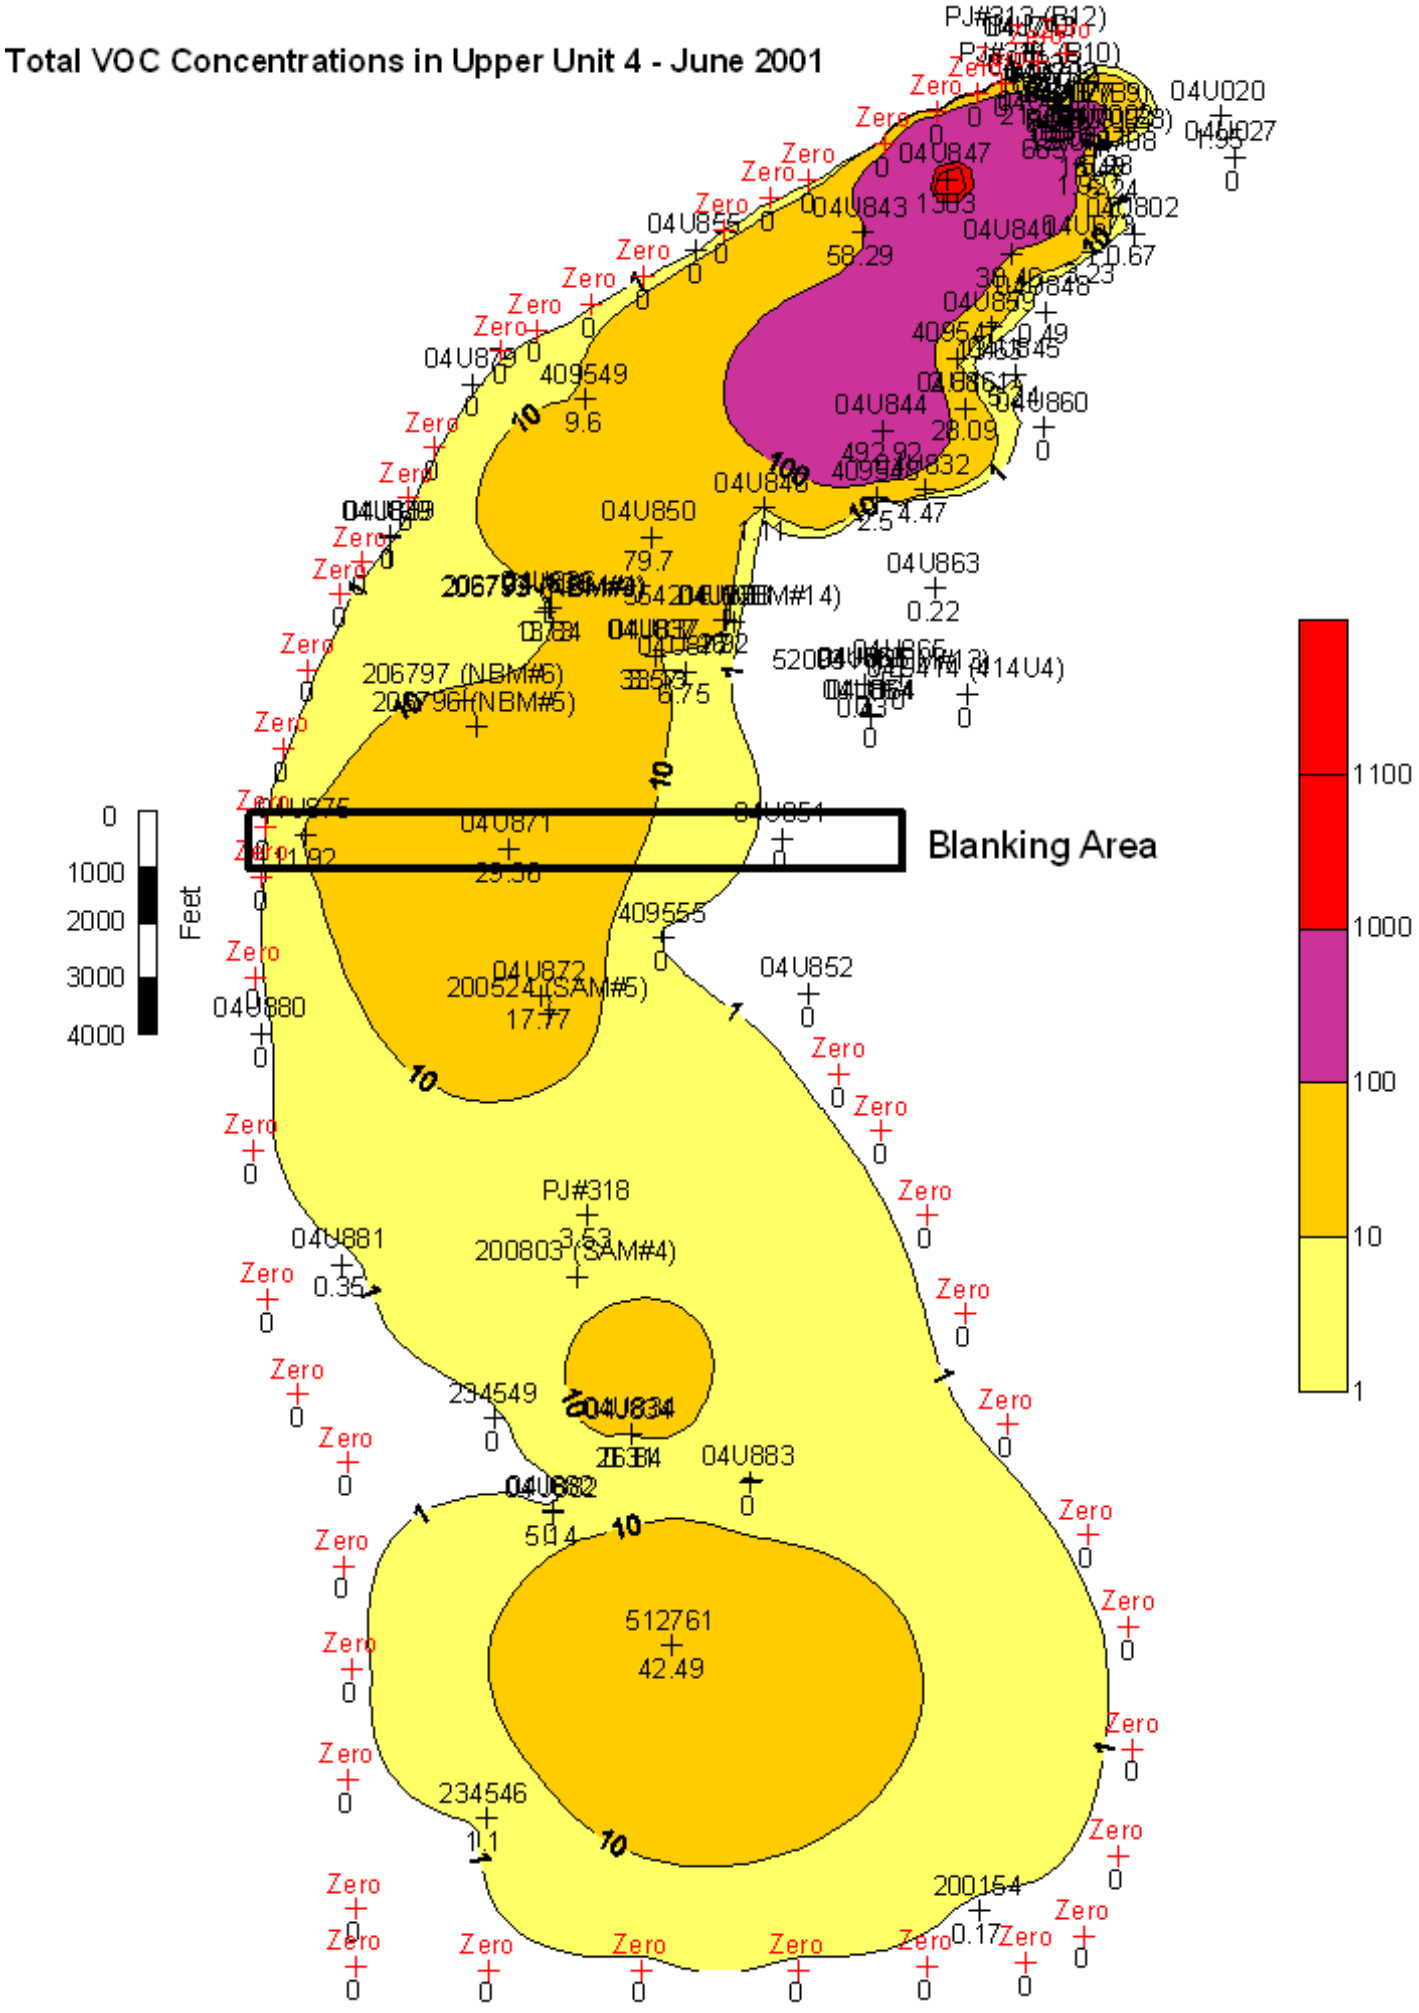
Total VOC Concentrations in Upper Unit 4 - June 2001
Blanking Area
Feet
0
1000
2000
3000
4000
1100
1000
100
10
1
04U847
1383
04U843
58.29
04U840
04U844
28.09
04U850
79.7
04U863
0.22
04U871
29.58
04U872
17.77
04U852
04U881
0.35
PJ#318
3.53
200803 (SAM#4)
234549
04U883
512761
42.49
234546
1.1
200154
0.17
206797 (NBM#6)
206796 (NBM#5)
409549
9.6
409555
04U880
04U851
04U020
Zero

Groundwater Quality Data (Organics) - 2001		
Well	Date	TOTAL VOCs (ug/l)
04J077	6/8/01	571.00
04J702	6/7/01	9.97
04J708	6/7/01	5.24
04J713	6/12/01	0.26
04J834	6/15/01	0.31
04J836	6/20/01	0.73
04J837	6/23/01	33.13
04J838	6/23/01	16.20
04J839	6/18/01	0.00
04J864	6/11/01	0.00
04J866	6/11/01	0.00
04J882	6/15/01	0.00
04U002	6/6/01	5.23
04U020	6/5/01	1.95
04U027	6/11/01	0.00
04U077	6/8/01	127.46
04U414 (414U4)	6/11/01	0.00
04U673	6/12/01	3.23
04U701	6/7/01	10.68
04U702	6/7/01	9.31
04U709	6/13/01	16.43
04U711	6/12/01	1.92
04U713	6/12/01	1.35
04U802	6/19/01	0.67
04U806	6/15/01	665.00
04U832	6/14/01	4.47
04U833	6/13/01	21.78
04U834	6/23/01	26.84
04U836	6/20/01	13.84
04U837	6/21/01	3.57
04U838	6/20/01	2.92
04U839	6/18/01	1.00
04U841	6/21/01	38.46
04U843	6/21/01	58.29
04U844	6/23/01	492.92
04U845	6/13/01	5.24
04U846	6/15/01	1.11
04U847	6/25/01	1383.00
04U848	6/12/01	0.49
04U850	6/22/01	79.70
04U851	6/12/01	0.00
04U852	6/12/01	0.00
04U855	6/15/01	0.00
04U859	6/13/01	13.63
04U860	6/13/01	0.00
04U861	6/11/01	28.09
04U863	6/14/01	0.22
04U864	6/11/01	0.00
04U865	6/12/01	0.00
04U866	6/11/01	0.43
04U871	6/25/01	29.36
04U872	6/21/01	17.77
04U875	6/19/01	11.92
04U877	6/20/01	6.75
04U879	6/18/01	0.00
04U880	6/14/01	0.00
04U881	6/18/01	0.35
04U882	6/21/01	5.14
04U883	6/15/01	0.00
200154	6/25/01	0.17
234546	6/15/01	1.10
234549	6/25/01	0.00
409547	6/14/01	2.81
409548	6/19/01	2.50
409549	6/19/01	9.60
409555	6/14/01	0.00
512761	6/25/01	42.49
PJ#318	6/19/01	3.53

North Plume
Average Total VOC Concentration Calculations
Group 5
TCAAP
June 2001

Concentration	Positive Planar Area (m2)
Plume to 1	28115641
Plume to 5	19249812
Plume to 10	12948481
Plume to 50	3342924
Plume to 100	2196190
Plume to 200	1277869
Plume to 300	771564
Plume to 400	512338
Plume to 500	375231
Plume to 600	257607
Plume to 700	174105
Plume to 800	115542
Plume to 900	71537
Plume to 1000	41011
Plume to 1100	17338
Plume to 1200	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	8865830	26597489
5 to 10	7.5	6301331	47259979
10 to 50	30	9605557	288166702
50 to 100	75	1146734	86005059
100 to 200	150	918321	137748138
200 to 300	250	506305	126576320
300 to 400	350	259226	90729057
400 to 500	450	137107	61698046
500 to 600	550	117625	64693598
600 to 700	650	83502	54276144
700 to 800	750	58563	43922147
800 to 900	850	44005	37403841
900 to 1000	950	30526	28999732
1000 to 1100	1050	23673	24856763
1100 to 1200	1150	17338	19939076
	Sum	28115641	1138872092

Area Wtd Conc	41	ug/L

\\stp_fs1\stpaul\0000-dan\total vocs\group3and5\2001\2001 conc group 3 and 5.xls

2003

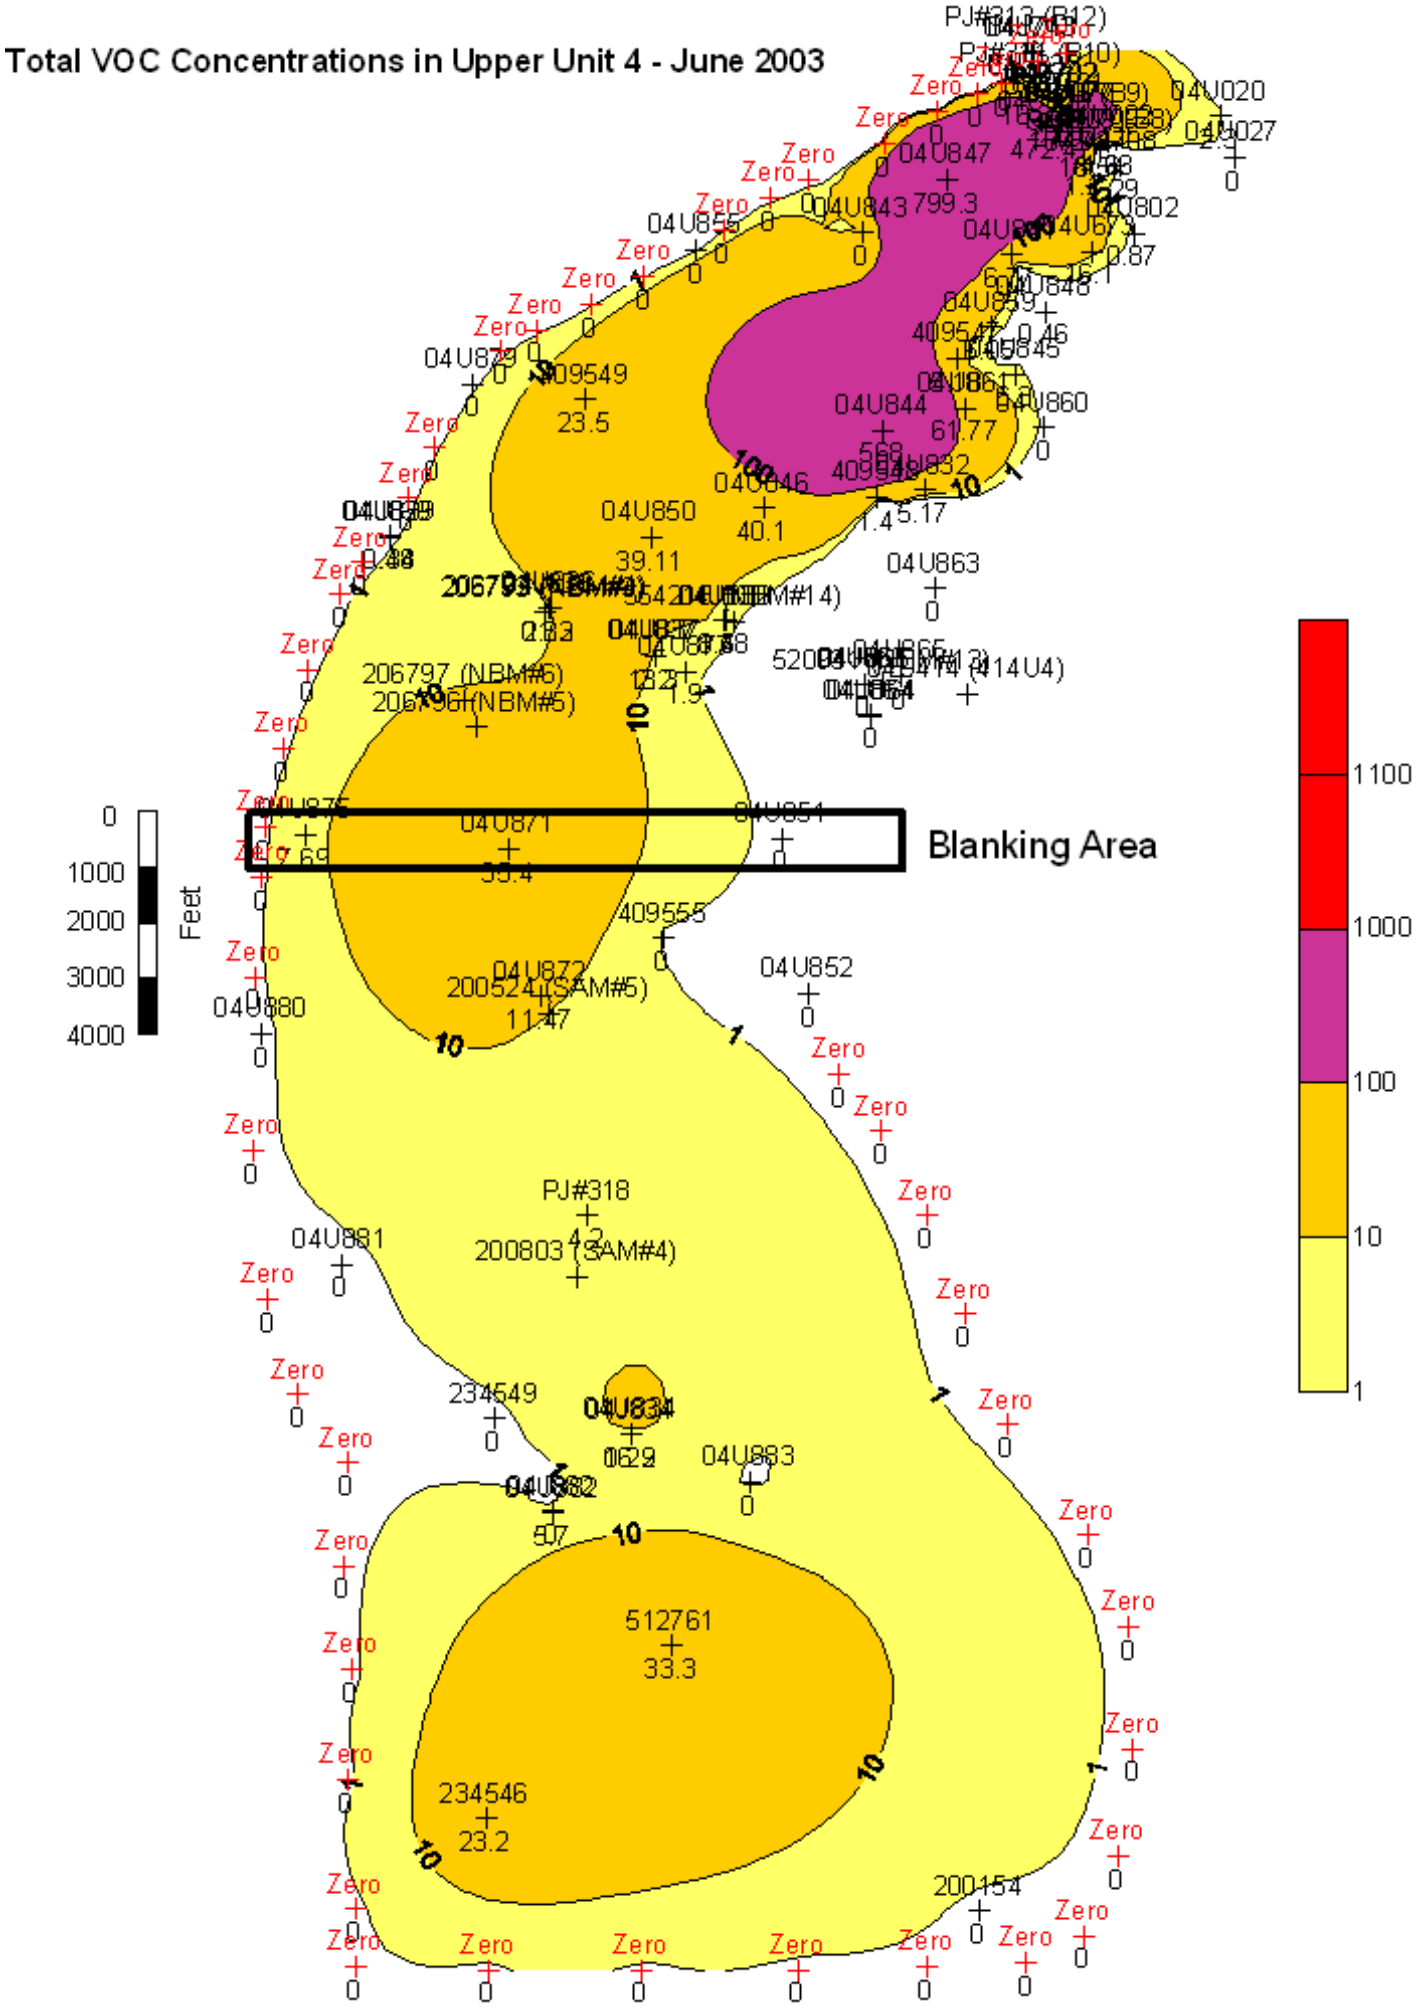
Total VOC Concentrations in Upper Unit 4 - June 2003
Blanking Area
Feet
0
1000
2000
3000
4000
1100
1000
100
10
1
Zero
04U847
799.3
04U843
04U844
61.77
04U846
40.1
04U850
39.11
04U863
206797 (NBM#6)
206796 (NBM#5)
04U871
55.4
409555
04U852
200524 (SAM#5)
11.47
04U880
04U881
PJ#318
42
200803 (SAM#4)
234549
04U834
04U883
512761
33.3
234546
23.2
200154
04U802
04U020
04U027
04U845
04U860
04U832
5.17
04U851
04U872

Groundwater Quality Data (Organics) - 2003		
Well	Date	TOTAL VOCs (ug/l)
04J077	6/13/03	747.00
04J702	6/16/03	9.07
04J708	6/12/03	4.29
04J713	6/12/03	0.15
04J834	6/9/03	0.29
04J836	6/10/03	0.82
04J837	6/16/03	13.30
04J838	6/9/03	8.58
04J839	6/5/03	0.48
04J864	6/3/03	0.00
04J866	6/3/03	0.00
04J882	6/6/03	0.00
04U002	6/11/03	4.63
04U020	6/11/03	2.30
04U027	6/12/03	0.00
04U077	6/13/03	107.93
04U673	6/10/03	16.10
04U701	6/16/03	7.79
04U702	6/16/03	1.60
04U709	6/19/03	16.54
04U711	6/17/03	1.10
04U713	6/12/03	0.90
04U802	6/17/03	0.87
04U806	6/16/03	472.40
04U832	6/11/03	5.17
04U833	6/13/03	16.34
04U834	6/16/03	16.20
04U836	6/10/03	21.30
04U837	6/10/03	2.20
04U838	6/9/03	1.43
04U839	6/6/03	0.34
04U841	6/11/03	6.77
04U843	6/12/03	0.00
04U844	6/17/03	568.00
04U845	6/9/03	6.30
04U846	6/9/03	40.10
04U847	6/17/03	799.30
04U848	6/11/03	0.46
04U850	6/12/03	39.11
04U851	6/11/03	0.00
04U852	6/11/03	0.00
04U855	6/9/03	0.00
04U859	6/11/03	6.05
04U860	6/9/03	0.00
04U861	6/10/03	61.77
04U863	6/3/03	0.00
04U864	6/3/03	0.00
04U865	6/3/03	0.00
04U866	6/3/03	0.00
04U871	6/17/03	35.40
04U872	6/13/03	11.47
04U875	6/12/03	7.69
04U877	6/13/03	1.90
04U879	6/10/03	0.00
04U880	6/11/03	0.00
04U881	6/9/03	0.00
04U882	6/11/03	5.70
04U883	6/11/03	0.00
200154	6/16/03	0.00
234546	6/17/03	23.20
234549	6/17/03	0.00
409547	6/9/03	5.18
409548	6/11/03	1.40
409549	6/11/03	23.50
409555	6/5/03	0.00
512761	6/17/03	33.30
PJ#318	6/12/03	4.20

North Plume
Average Total VOC Concentration Calculations
Group 5
TCAAP
June 2003

Concentration	Positive Planar Area (m2)
Plume to 1	28791345
Plume to 5	18699650
Plume to 10	12798074
Plume to 50	3142883
Plume to 100	2173590
Plume to 200	1123881
Plume to 300	608059
Plume to 400	280353
Plume to 500	90384
Plume to 600	31815
Plume to 700	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	10091695	30275084
5 to 10	7.5	5901576	44261822
10 to 50	30	9655191	289655727
50 to 100	75	969293	72696966
100 to 200	150	1049709	157456333
200 to 300	250	515822	128955417
300 to 400	350	327707	114697415
400 to 500	450	189969	85486073
500 to 600	550	58569	32212909
600 to 700	650	31815	20679505
	Sum	28791345	976377251

Area Wtd Conc	34	ug/L

2005

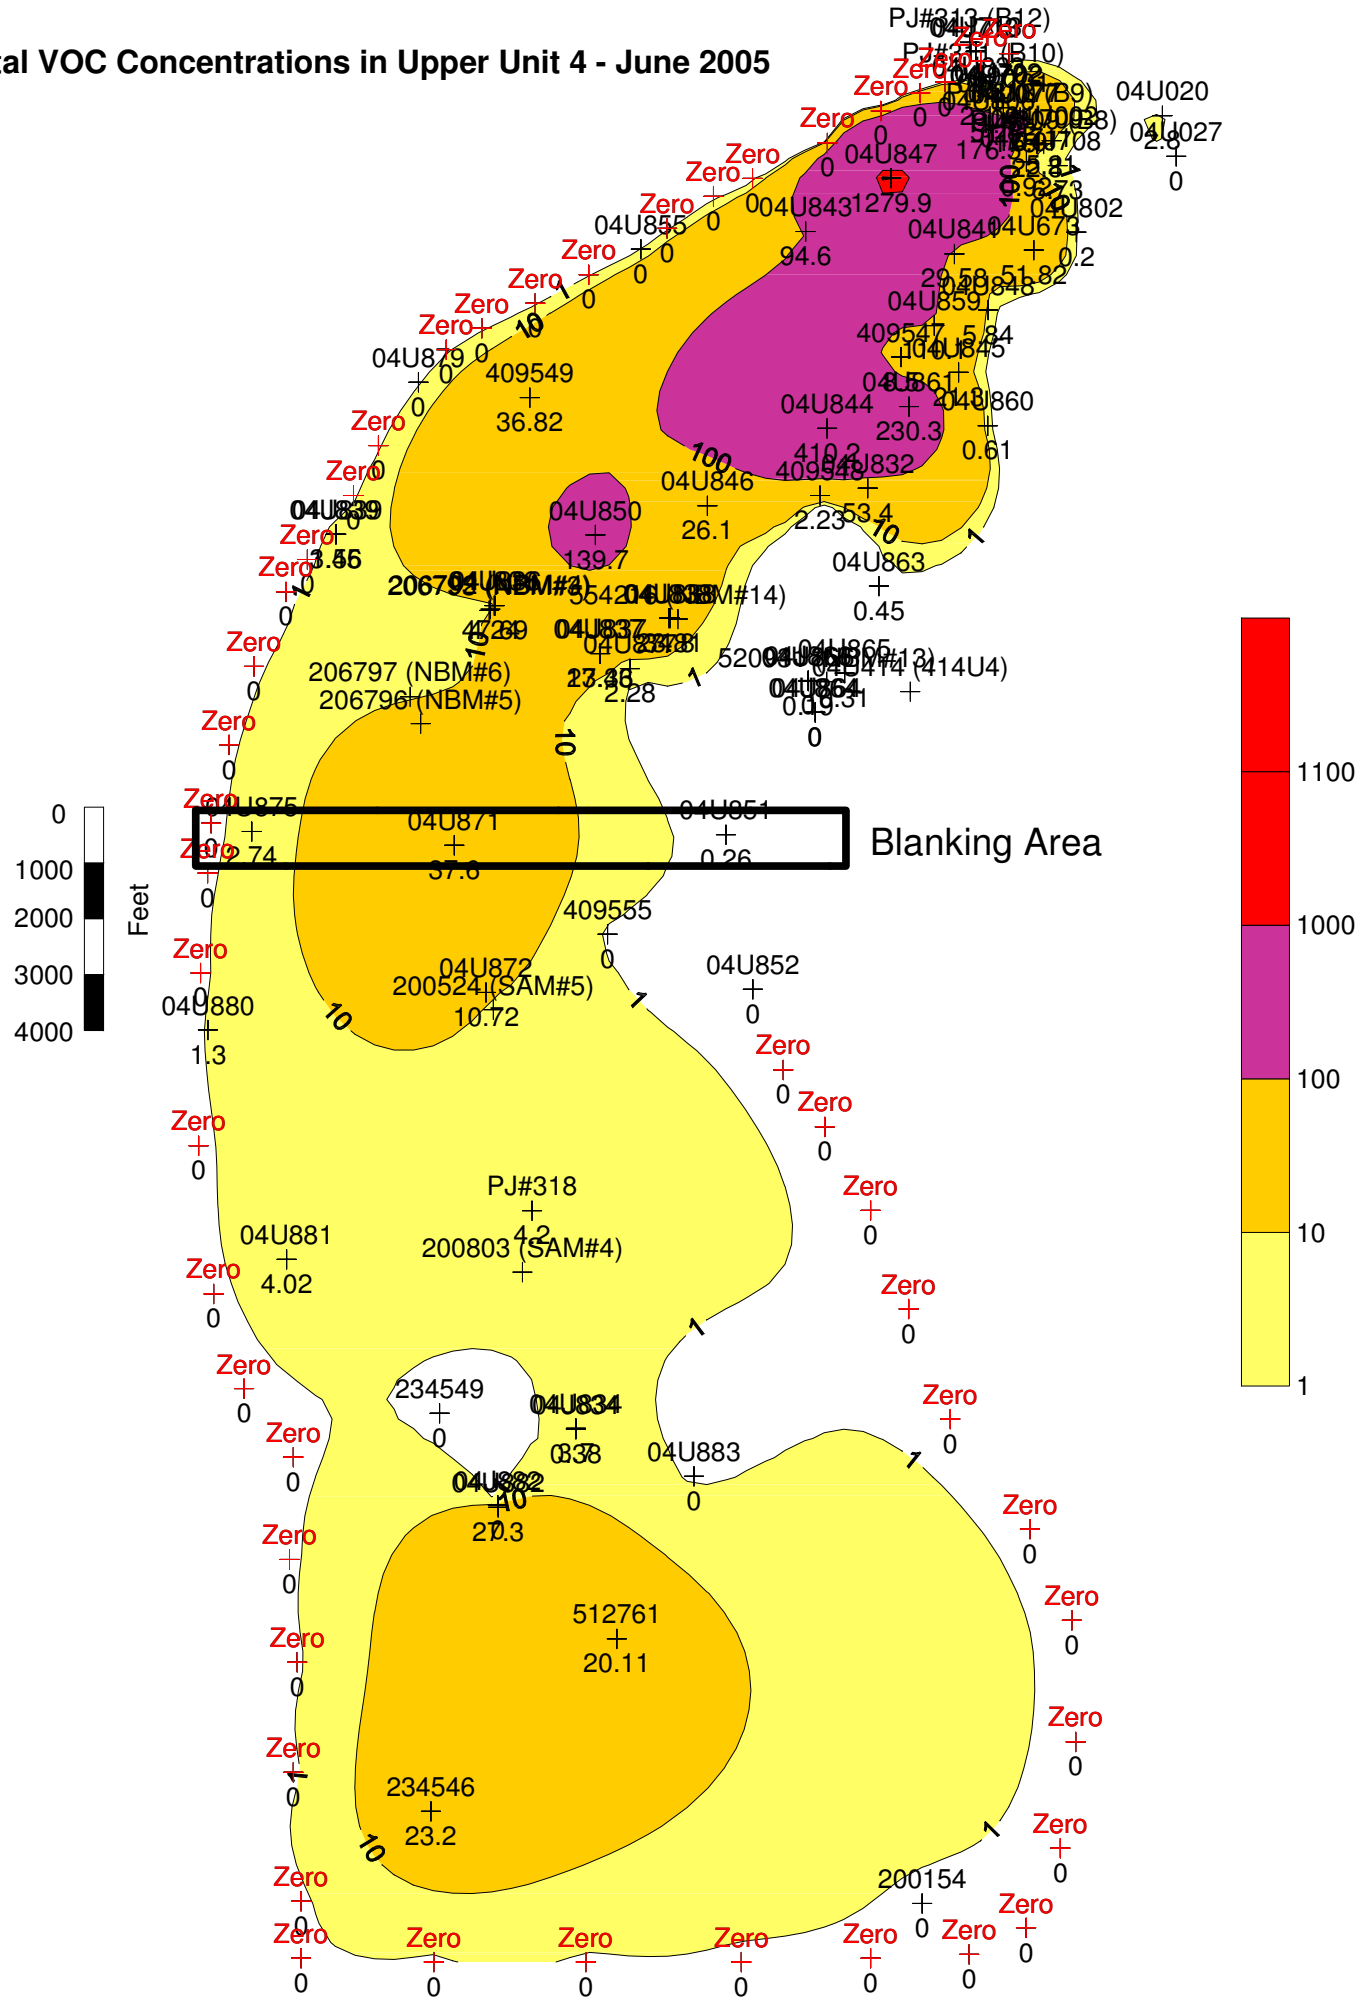
Total VOC Concentrations in Upper Unit 4 - June 2005
Blanking Area
Feet
0
1000
2000
3000
4000
1100
1000
100
10
1
PJ#313 (B12)
PJ#311 (B10)
04U020
04U027
04U847
1279.9
04U843
94.6
04U855
04U840
04U673
04U802
04U859
409547
04U845
04U879
409549
36.82
04U844
230.3
04U860
0.61
410.2
04U832
04U846
26.1
2.23
53.4
04U850
139.7
04U863
0.45
206797 (NBM#6)
206796 (NBM#5)
2.28
04U865
04U871
37.8
0.26
04U851
409555
04U872
200524 (SAM#5)
10.72
04U852
04U880
1.3
PJ#318
4.2
200803 (SAM#4)
04U881
4.02
234549
04U834
04U883
512761
20.11
234546
23.2
200154
Zero

Group 3 & 5 Total VOCs 2005		
Well	Date	Total VOCs for Surfer
04J077	6/7/05	175.0
04J702	6/8/05	9.5
04J708	6/9/05	6.7
04J713	6/9/05	0.0
04J834	6/8/05	0.4
04J836	6/21/05	4.2
04J837	6/20/05	17.4
04J838	6/17/05	34.8
04J839	6/17/05	3.5
04J864	10/27/04	0.0
04J866	6/21/05	0.0
04J882	6/8/05	0.0
04U002	6/16/05	5.2
04U020	6/16/05	2.8
04U027	6/13/05	0.0
04U077	6/7/05	116.9
04U673	6/22/05	51.8
04U701	6/8/05	51.8
04U702	6/8/05	1.4
04U709	6/13/05	22.8
04U711	6/15/05	0.9
04U713	6/9/05	0.5
04U802	6/15/05	0.2
04U806	6/10/05	176.5
04U832	6/23/05	53.4
04U833	6/9/05	2.1
04U834	6/21/05	3.7
04U836	6/21/05	47.7
04U837	6/15/05	23.4
04U838	6/7/05	23.8
04U839	6/7/05	1.6
04U841	6/9/05	29.6
04U843	6/7/05	94.6
04U844	6/14/05	410.2
04U845	6/22/05	21.3
04U846	6/10/05	26.1
04U847	6/15/05	1279.9
04U848	6/21/05	5.8
04U850	6/13/05	139.7
04U851	6/22/05	0.3
04U852	6/24/05	0.0
04U855	6/8/05	0.0
04U859	6/22/05	110.1
04U860	6/23/05	0.6
04U861	6/23/05	230.3
04U863	6/22/05	0.5
04U864	10/27/04	0.0
04U865	6/22/05	0.3
04U866	6/22/05	0.2
04U871	6/22/05	37.6
04U872	6/20/05	10.7

Well	Date	Total VOCs for Surfer
04U875	6/22/05	**2.7**
04U877	6/16/05	**2.3**
04U879	6/8/05	**0.0**
04U880	6/16/05	**1.3**
04U881	6/9/05	**4.0**
04U882	6/17/05	**27.3**
04U883	6/10/05	**0.0**
200154	6/24/05	**0.0**
234546	June 2003	**23.2**
234549	June 2003	**0.0**
409547	6/6/05	**8.5**
409548	6/8/05	**2.2**
409549	6/10/05	**36.8**
409555	6/8/05	**0.0**
512761	6/23/05	**20.1**
PJ#318	June 2003	**4.2**

North Plume
Average Total VOC Concentration Calculations
Group 5
TCAAP
June 2005

Concentration	Positive Planar Area (m2)
Plume to 1	28416504
Plume to 5	18057961
Plume to 10	12905641
Plume to 50	4370262
Plume to 100	2524385
Plume to 200	1170045
Plume to 300	577584
Plume to 400	357818
Plume to 500	255077
Plume to 600	178064
Plume to 700	120431
Plume to 800	75158
Plume to 900	41900
Plume to 1000	17798
Plume to 1100	841
Plume to 1200	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	10358544	31075631
5 to 10	7.5	5152320	38642403
10 to 50	30	8535378	256061350
50 to 100	75	1845877	138440801
100 to 200	150	1354340	203150983
200 to 300	250	592461	148115197
300 to 400	350	219766	76917976
400 to 500	450	102742	46233743
500 to 600	550	77013	42357132
600 to 700	650	57633	37461543
700 to 800	750	45272	33954190
800 to 900	850	33258	28269487
900 to 1000	950	24102	22897095
1000 to 1100	1050	16957	17804642
1100 to 1200	1150	841	967443
	Sum	28416504	1122349616

Area Wtd Conc	39	ug/L

2007

Total VOC Concentrations in Upper Unit 4 - 2007

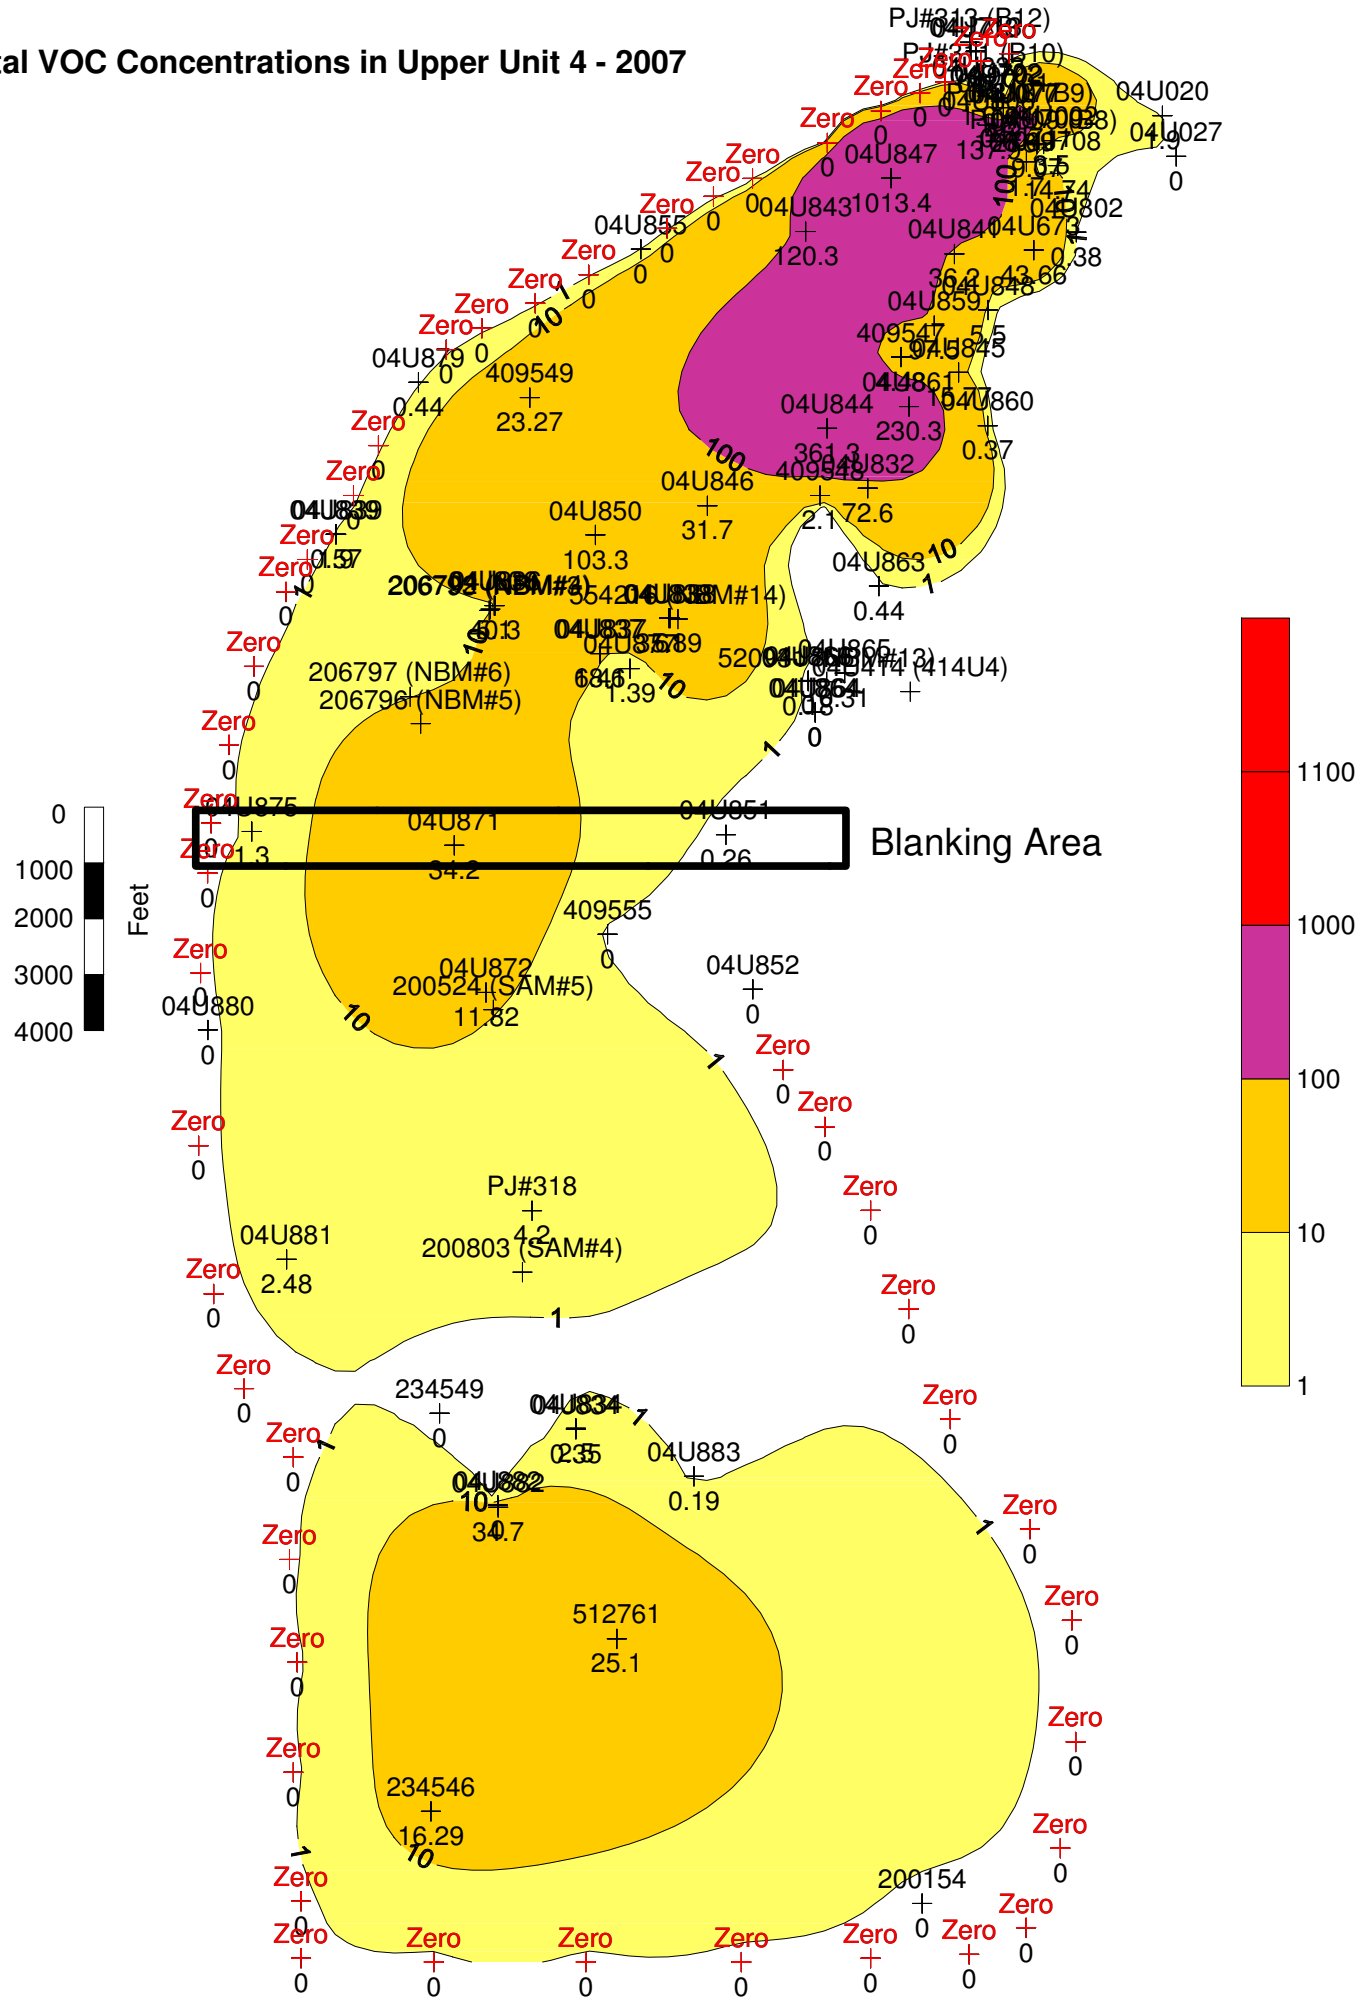

North Plume
Total VOC Concentration Calculations
Group 5
TCAAP
June 2007

Concentration	Positive Planar Area (m2)
Plume to 1	28567397
Plume to 5	18652728
Plume to 10	13282790
Plume to 50	4101237
Plume to 100	2234071
Plume to 200	979407
Plume to 300	434983
Plume to 400	262135
Plume to 500	164639
Plume to 600	96406
Plume to 700	48281
Plume to 800	16534
Plume to 900	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	9914669	29744007
5 to 10	7.5	5369938	40274538
10 to 50	30	9181553	275446590
50 to 100	75	1867166	140037434
100 to 200	150	1254664	188199591
200 to 300	250	544424	136105884
300 to 400	350	172848	60496852
400 to 500	450	97496	43873096
500 to 600	550	68234	37528435
600 to 700	650	48125	31281521
700 to 800	750	31747	23810133
800 to 900	850	16534	14053609
	Sum	28567397	1020851690

Area Wtd Conc	36	ug/L

Group 3 Blanking Area

North Plume
Average Total VOC Concentration Calculations
Group 3 Blanked Area
TCAAP
June 1996

Concentration	Positive Planar Area (m2)
Plume to 1	592601
Plume to 5	570392
Plume to 10	545894
Plume to 50	419898
Plume to 100	291064
Plume to 200	36252
Plume to 300	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	22209	66628
5 to 10	7.5	24498	183736
10 to 50	30	125996	3779882
50 to 100	75	128834	9662522
100 to 200	150	128834	19325043
200 to 300	250	254812	63702970
	Sum	685183	96720781

Area Wtd Conc	141	ug/L

North Plume
Average Total VOC Concentration Calculations
Group 3 Blanked Area
TCAAP
June 1997

Concentration	Positive Planar Area (m2)
Plume to 1	596512
Plume to 5	562636
Plume to 10	526681
Plume to 50	356729
Plume to 100	210760
Plume to 200	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	33877	101630
5 to 10	7.5	35954	269658
10 to 50	30	169953	5098579
50 to 100	75	145968	10947626
100 to 200	150	210760	31614023
	Sum	596512	48031516

Area Wtd Conc	81	ug/L

North Plume
Average Total VOC Concentration Calculations
Group 3 Blanked Area
TCAAP
June 1998

Concentration	Positive Planar Area (m2)
Plume to 1	594793
Plume to 5	557997
Plume to 10	519880
Plume to 50	320227
Plume to 100	129750
Plume to 200	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	36796	110387
5 to 10	7.5	38118	285882
10 to 50	30	199653	5989581
50 to 100	75	190477	14285783
100 to 200	150	129750	19462464
	Sum	594793	40134097

Area Wtd Conc	67	ug/L

North Plume
Average Total VOC Concentration Calculations
Group 3 Blanked Area
TCAAP
June 1999

Concentration	Positive Planar Area (m2)
Plume to 1	593106
Plume to 5	551228
Plume to 10	507677
Plume to 50	278285
Plume to 100	138
Plume to 200	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	41877	125632
5 to 10	7.5	43551	326636
10 to 50	30	229392	6881769
50 to 100	75	278147	20861018
100 to 200	150	138	20657
	Sum	593106	28215713

Area Wtd Conc	48	ug/L

North Plume
Average Total VOC Concentration Calculations
Group 3 Blanked Area
TCAAP
June 2001

Concentration	Positive Planar Area (m2)
Plume to 1	585543
Plume to 5	516681
Plume to 10	442357
Plume to 50	5028
Plume to 100	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	68862	206585
5 to 10	7.5	74324	557434
10 to 50	30	437329	13119874
50 to 100	75	5028	377079
	Sum	585543	14260972

Area Wtd Conc	24	ug/L

North Plume
Average Total VOC Concentration Calculations
Group 3 Blanked Area
TCAAP
June 2003

Concentration	Positive Planar Area (m2)
Plume to 1	558061
Plume to 5	458092
Plume to 10	367139
Plume to 50	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	99969	299907
5 to 10	7.5	90953	682144
10 to 50	30	367139	11014170
	Sum	558061	11996221

Area Wtd Conc	21	ug/L

North Plume
Average Total VOC Concentration Calculations
Group 3 Blanked Area
TCAAP
June 2005

Concentration	Positive Planar Area (m2)
Plume to 1	517277
Plume to 5	405408
Plume to 10	323683
Plume to 50	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	111868	335604
5 to 10	7.5	81725	612940
10 to 50	30	323683	9710493
	Sum	517277	10659037

Area Wtd Conc	21	ug/L

North Plume
Average Total VOC Concentration Calculations
Group 3 Blanked Area
TCAAP
June 2007

Concentration	Positive Planar Area (m2)
Plume to 1	533438
Plume to 5	401087
Plume to 10	311924
Plume to 50	0

Total VOCs (ug/L)	Avg Total VOCs (ug/L)	Area (m2)	Areal Conc (ug*m2/L)
1 to 5	3	132351	397053
5 to 10	7.5	89163	668723
10 to 50	30	311924	9357707
	Sum	533438	10423483

Area Wtd Conc	20	ug/L

D.2.5 Group 6 New Brighton Municipal Well Regression Analysis

NEW BRIGHTON MUNICIPAL WELLS: Regression Analysis Since 1998: TRICHLOROETHENE

TWIN CITIES ARMY AMMUNITION PLANT

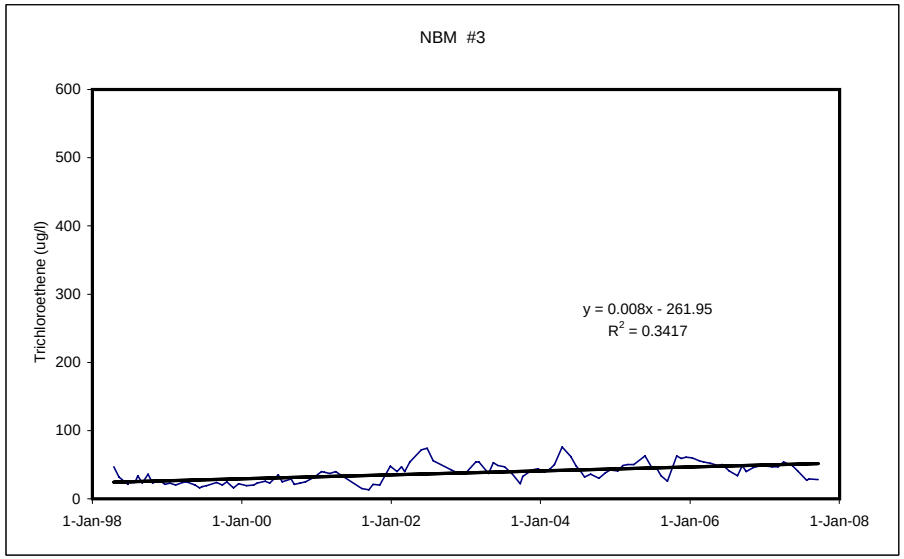

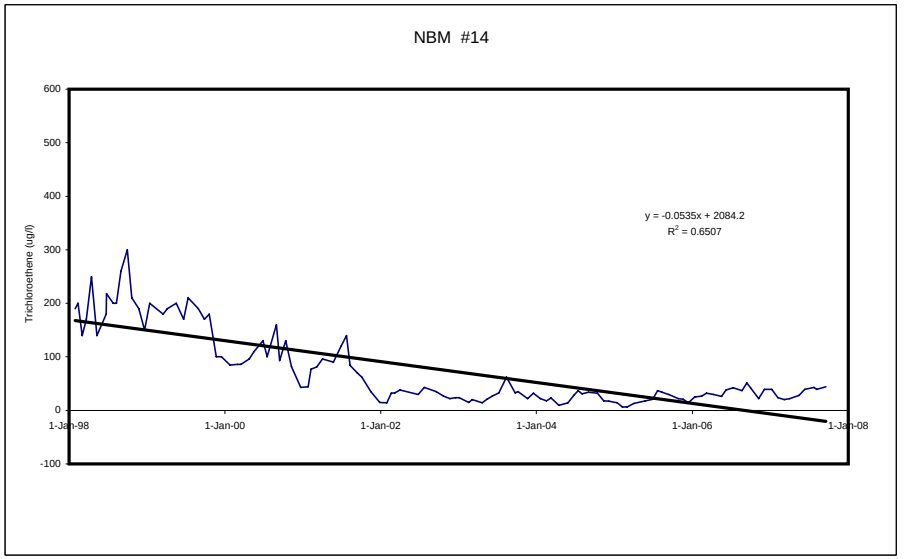

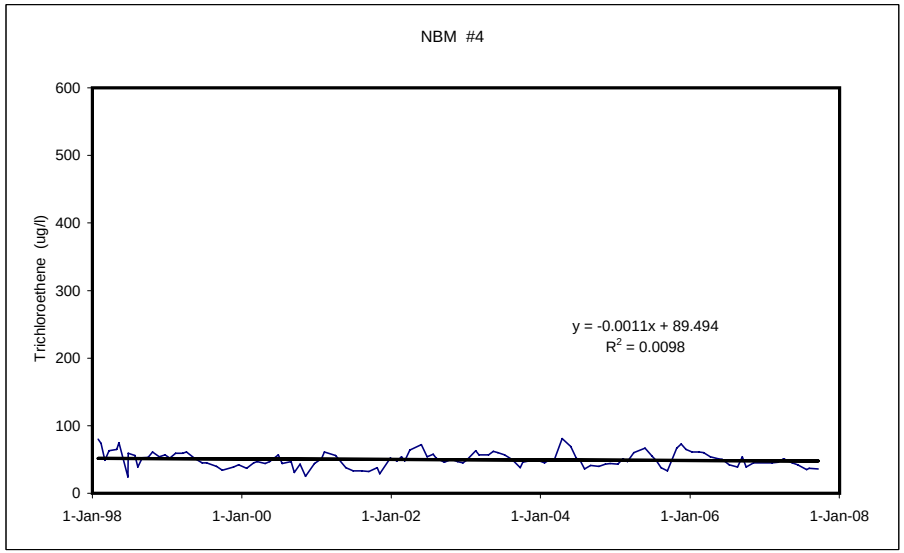

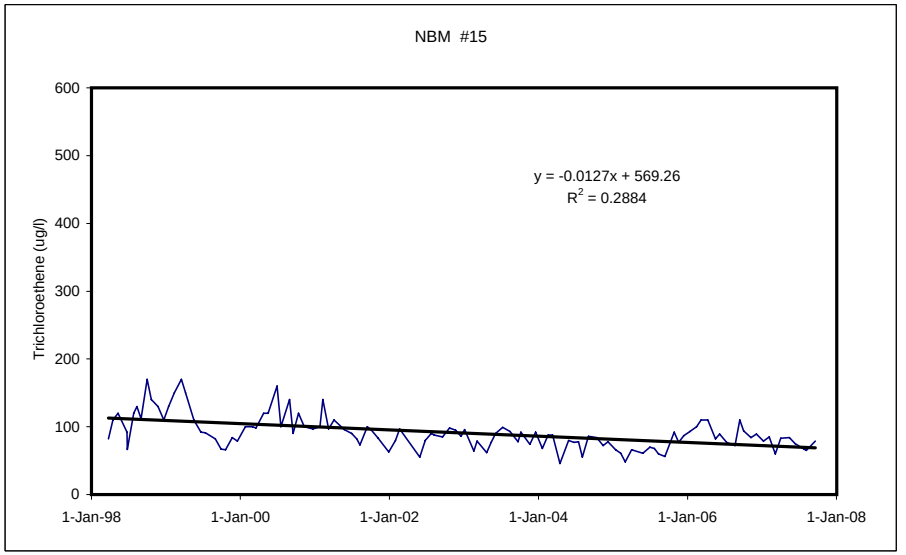

NEW BRIGHTON MUNICIPAL WELLS: Regression Analysis Since 1998: TRICHLOROETHENE

TWIN CITIES ARMY AMMUNITION PLANT

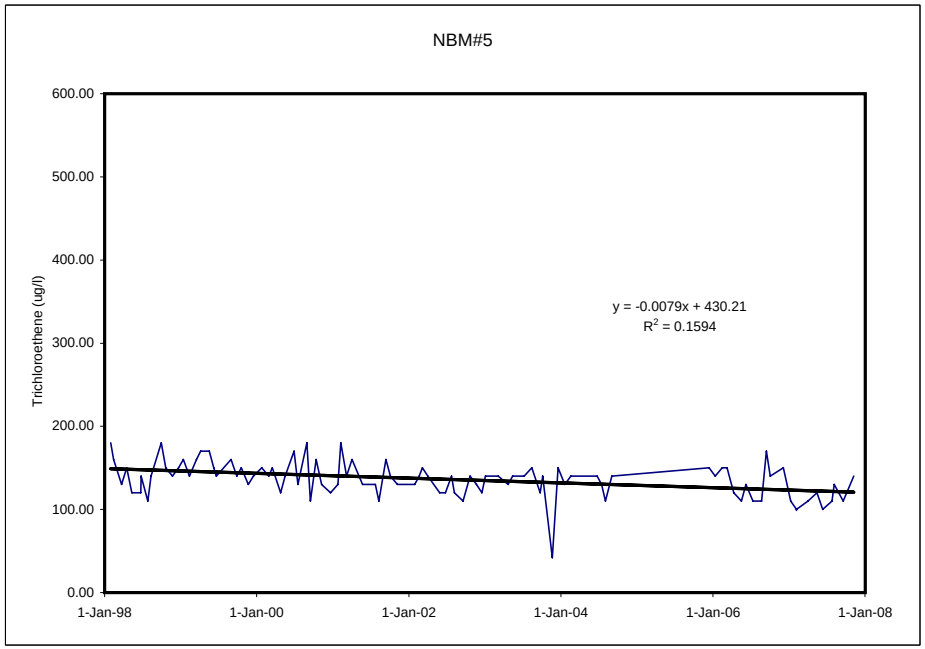

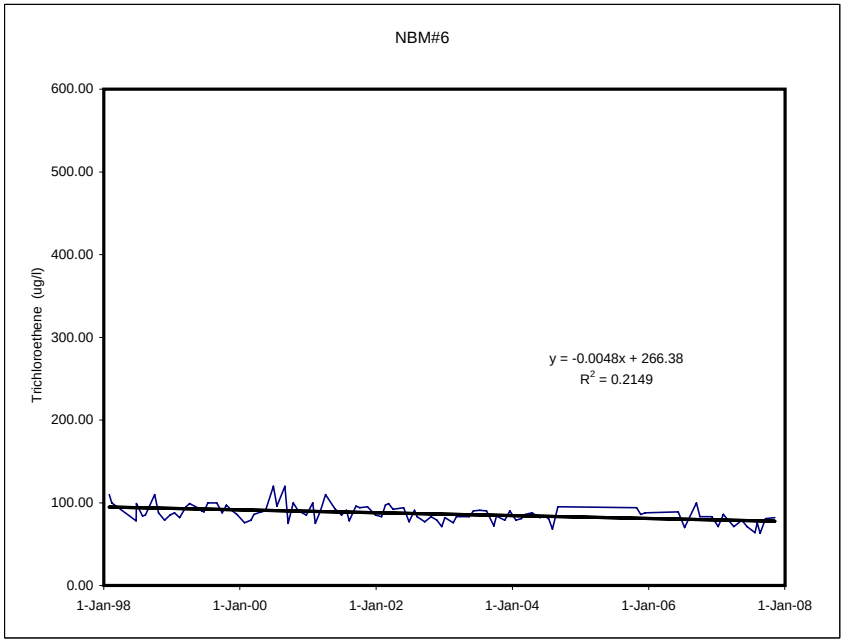

D.3 Site C Analytical and Water Level Database

APPENDIX D.3
SITE C ANALYTICAL AND WATER LEVEL DATABASE

The TCAAP Site C Analytical and Water Level Database is located on this CD-ROM in the following Microsoft Excel file:

App D3_Site C Chemical Database September 2007.xls

Appendix E

TCAAP Well Inventory Update, FY 2007

APPENDIX E
TCAAP WELL INVENTORY UPDATE

FISCAL YEAR 2007

Purpose

The purpose of well inventory is to identify wells that have been impacted by contaminants from TCAAP or that could potentially be impacted by TCAAP contaminants.

Background

Developing and maintaining the well inventory is a process that was initiated in 1991, with the work efforts documented in several update reports since that time. Beginning in FY 1999, the update reporting was incorporated into the Annual Performance Reports.

The well inventory "study area," as defined by the Minnesota Pollution Control Agency, is shown on Figure E-1, and coincides with the Minnesota Department of Health (MDH) Special Well Construction Area.

The aquifers of concern are defined by the 1 µg/l trichloroethene contour for the Unit 3 and Unit 4 aquifers, and the 1 µg/l cis-1,2-dichloroethene contour for the Unit 1 aquifer north of TCAAP.

The "area of concern" for the Unit 3 and Unit 4 aquifers is created by adding a quarter mile buffer area outside the 1 µg/l trichloroethene contour. The area of concern for the Unit 3 and Unit 4 aquifers is shown on Figure E-2.

The area of concern for the Unit 1 aquifer north of TCAAP is delineated by city streets. The area of concern for the Unit 1 aquifer is shown on Figure E-3.

Wells within the study area are categorized based on location, depth/aquifer, and use. Well categories for the well inventory are described in Table E-1.

Program Requirements

The well inventory program requirements have evolved over time, with changes documented through the update reports. A flowchart that describes the annual requirements for maintaining the TCAAP well inventory database is shown on Figure E-4. Requirements are summarized below.

Approximately in March of each year, a database of study area wells is acquired from the MDH. This MDH database query is limited to study area wells that were constructed, sealed, or disclosed in the previous fiscal year. The MDH database consists of three lists:

1. Constructed Wells (generated through drillers submitting Water Well Records);
2. Sealed Wells (generated through drillers submitting Well Sealing Records); and
3. Disclosed Wells (made known through property transfer).

With the new MDH information, the TCAAP well inventory database is updated by recategorizing wells, as necessary, and by adding any new wells that are within the study area. Any new wells found in Categories 1a, 1b, 1c, 2a, 2b, 2c, or 4a are targeted for sampling in that fiscal year; however, an attempt to reclassify any new category 4a wells will be made prior to sampling. Wells that are not sampled due to non-responsive well owners are targeted for sampling in the next major sampling event.

Category 4 wells are those with an unknown depth or unknown location, or both. Ideally, there should be no wells in Category 4. Each year, an attempt is made to reclassify Category 4 wells into one of the other categories. This is accomplished through phone calls, letters, and/or site visits in an attempt to obtain additional information. Any wells which are re-classified as Category 1a, 1b, 1c, 2a, 2b, or 2c are targeted for sampling in that fiscal year.

"Major" well inventory sampling events occur every four years and are shown in Appendix A.1. The major sampling events are scheduled to coincide with the biennial sampling events for performance purposes as delineated in the APR. For each major event, all wells in Categories 1a, 1b, 1c, 2a, 2b, 2c, and 4a are targeted for sampling. After every sampling event, each well owner is mailed a copy of their testing results. Wells that are not sampled due to non-responsive well owners are targeted for sampling in the next major sampling event.

For each sampling event, if any well has a detection which exceeds the applicable TCAAP groundwater cleanup level for that contaminant (or an additivity of 1.0, similar to the MDH Hazard Index calculation), the well is evaluated using the flow chart presented in Figure E-4 to determine the timing of additional sampling. Wells that are used for drinking water are sampled again within one month of data validation. Wells that are not used for drinking water, but have possible contact exposure risks, are sampled the next fiscal year. If a cleanup level exceedance is confirmed (two consecutive events), and the contaminant concentrations in the well are proportional to contaminant concentrations of the TCAAP OU1 plume, the Army offers to abandon the well and/or provide an alternate water supply.

The annual reporting requirements for the TCAAP well inventory will include:

- A list of any wells found or reclassified.
- Analytical results and a summary of sampling efforts from that fiscal year.
- Recommendations for participation in the Well Abandonment/Alternate Water Supply Program.
- An updated well inventory database that lists wells by well category.
- An updated database listing water quality of wells.

FY 2007 Update

The updated MDH database was provided to Wenck on December 20, 2006. MDH generates the database from specific Township, Range, and Section data. This comprehensive database was screened to extract the lists of wells that were constructed, disclosed, or sealed between October 1, 2005 and September 30, 2006. Further investigative efforts were primarily focused on determining each well's location (inside or outside the study area and/or area of concern), status (active, inactive, or sealed), and water use (supply/non-supply).

Newly constructed active and inactive wells, and wells of unknown status that were determined to be located within the study area, are presented in Table E-3. All 31 newly constructed wells were monitoring wells and were classified into Category 6.

Disclosed wells that were identified as being in use, inactive, or of unknown status (but not sealed) and that were determined to be located within the study area are identified in Table E-4. Five of these wells were outside of the area of concern and were classified into Category 3. Eleven of these wells were further investigated and determined to be monitoring wells, Category 6. One well could not be located physically and was classified into Category 4b.

Sealed wells were found by reviewing the MDH sealed well list, by screening the MDH disclosed and new construction lists (which also contain sealed wells), and by talking with well owners. Wells identified as sealed are shown in Table E-5. Disclosed wells that were located within the area of concern and that the MDH identified as having a change in status from active or inactive to sealed were further investigated for confirmation of their sealed status. Any wells that were already in the TCAAP well inventory database that the MDH identified as having a change in status from active or inactive to sealed are shown in Table E-5 with strikeouts through the old well category entry. Wells identified as sealed in the MDH database updates were assigned to Category 7a (documented as sealed/abandoned). Wells that were determined to be sealed through conversations with well owners were assigned to Category 7b (undocumented as sealed, or improperly abandoned).

Thirty-four Category 4 wells were field studied in FY 2007. This field study was accomplished through telephone calls, letters, and/or site visits in an attempt to reclassify Category 4 wells that were in the existing TCAAP well inventory database into one of the other categories. Contact information was updated; however, due to lack of information and/or response, no wells could be re-classified out of Category 4. A field investigation and sampling summary is included in Table E-6.

Through the FY 2007 well inventory update effort, no wells were sampled.

Information contained in Tables E-3 through E-6 has been updated in the well inventory database (Filename "Well_Inv", an Excel file included on this CD-ROM).

Recommendations

- At this time no wells are recommended for the Army to offer alternate water supply or well abandonment.
- Wells to be sampled during the next sampling event in FY 2008 are:
    - Any previously undiscovered wells determined to be in Categories 1a, 1b, 1c, 2a, 2b, 2c, or 4a based on the FY 2008 review of the MDH database.
    - Any Category 4 wells that are determined, from further investigation, to be in Category 1a, 1b, 1c, 2a, 2b, or 2c.
- The next "major" well inventory sampling event will occur in FY 2009.

TABLE E-1
WELL INVENTORY CATEGORY DESCRIPTIONS

Category	*Subcategory*	*Explanation*
1		Water supply wells screened in an aquifer of concern, inside the 1 μg/l contour. Wells are divided into the following subcategories:
	1a	• Drinking water well
	1b	• Nondrinking but possible contact water
	1c	• Nondrinking, noncontact water
	1d	• Well is inoperable or has not been used for several years
	1e	• Well for which the owner has refused (or has been unresponsive to) an Army offer for abandonment, or for which the water use has been deemed acceptable
2		Water supply wells in an area of concern, inside the buffer lines, but outside the 1 μg/l contour, screened in an aquifer of concern. Wells are divided into the following subcategories:
	2a	• Drinking water well
	2b	• Nondrinking but possible contact water
	2c	• Nondrinking, noncontact water
	2d	• Well is inoperable or has not been used for several years
3		Water supply wells within the Study Area that are either outside the area of concern, or are within the area of concern but are not screened in an aquifer of concern.
4		Water supply wells with missing information, divided into the following subcategories:
	4a	• Unknown depth or aquifer, but located in the area of concern.
	4b	• Unknown location, but potentially located within the Study Area. Wells with both an unknown depth and an unknown location are included in 4b.
5		Wells that are in the study area, but that have been field checked and not located. No further action is recommended for these wells.
6		Nonsupply wells (primarily monitoring wells).
7		Sealed or abandoned wells. Wells are divided into the following subcategories:
	7a	• Documented as sealed/abandoned
	7b	• Undocumented as sealed, or improperly abandoned

TABLE E-2

WELL INVENTORY SAMPLING RESULTS
Fiscal Year 2007

No sampling conducted in FY07.

TABLE E-3
CONSTRUCTED WELLS

Unique Number	Category	Last Name or Business Name	Street	City	Use	Depth	Date Drilled
717790	6	Ashland, Inc.	2931 Central Avenue NE	Minneapolis	Monitoring	42	10/1/2005
717791	6	Canadian Pacific Railway	2847 Central Avenue NE	Minneapolis	Monitoring	174	11/1/2005
717792	6	Canadian Pacific Railway	2847 Central Avenue NE	Minneapolis	Monitoring	85	11/1/2005
717793	6	Canadian Pacific Railway	2847 Central Avenue NE	Minneapolis	Monitoring	43	11/1/2005
725252	6	Kunz Oil Co.	5493 Erickson Road	Mounds View	Monitoring	22	7/1/2006
731577	6	Canadian Pacific Railway	2823 Polk Street	Minneapolis	Monitoring	44	10/1/2005
733226	6	University of Minnesota	2315 University Avenue SE	Minneapolis	Monitoring	20	2/1/2006
733227	6	University of Minnesota	2328 Fourth Street SE	Minneapolis	Monitoring	20	2/1/2006
733232	6	University of Minnesota	800 23rd Avenue SE	Minneapolis	Monitoring	21	3/1/2006
733233	6	University of Minnesota	800 23rd Avenue SE	Minneapolis	Monitoring	22	3/1/2006
733234	6	University of Minnesota	800 23rd Avenue SE	Minneapolis	Monitoring	17	3/1/2006
733235	6	University of Minnesota	800 23rd Avenue SE	Minneapolis	Monitoring	17	3/1/2006
735000	6	Canadian Pacific Railway	2823 Polk Street	Minneapolis	Monitoring	80	11/1/2005
735003	6	Ashland, Inc.	Central Avenue		Env. Boring	35	12/1/2005
735004	6	Ashland, Inc.	Central Avenue		Env. Boring	25	12/1/2005
736137	6	Bell, Tom	1008 County Road E W	New Brighton	Recovery	59	8/1/2006
736138	6	Bell Lumber and Pole	1008 County Road E W	New Brighton	Monitoring	55	8/1/2006
737658	6	Ashland, Inc.	2931 Central Avenue NE	Minneapolis	Env. Boring	35	10/1/2005
737659	6	Canadian Pacific Railway	2729 Central Avenue	Minneapolis	Monitoring	283	4/1/2006
737674	6	Canadian Pacific Railway			Monitoring	239	5/1/2006
738362	6	Canadian Pacific Railway	2827 Central Avenue NE	Minneapolis	Monitoring	180	3/1/2006
738363	6	Canadian Pacific Railway	2827 Central Avenue NE	Minneapolis	Monitoring	125	3/1/2006
738364	6	Canadian Pacific Railway	2827 Central Avenue NE	Minneapolis	Monitoring	41	3/1/2006
740362	6	Columbia Heights, City of	3939 Central Avenue NE	Columbia Heights	Monitoring	21	5/1/2006
740363	6	Columbia Heights, City of	3939 Central Avenue NE	Columbia Heights	Monitoring	20	5/1/2006
740364	6	Columbia Heights, City of	3927 Central Avenue NE	Columbia Heights	Monitoring	23	5/1/2006
740365	6	Columbia Heights, City of	3927 Central Avenue NE	Columbia Heights	Monitoring	21	5/1/2006
740366	6	Columbia Heights, City of	3905 Central Avenue NE	Columbia Heights	Monitoring	18	5/1/2006
742739	6	Davis Frost, Inc.	1209 Tyler Street NE	Minneapolis	Monitoring	25	8/1/2006
742740	6	Davis Frost, Inc.	1209 Tyler Street NE	Minneapolis	Monitoring	22	8/1/2006
743455	6	Shaw Stewart Lumber	421 Johnson Street NE	Minneapolis	Monitoring	30	6/1/2006

TABLE E-4
WELLS DISCLOSED THROUGH PROPERTY TRANSFER

Unique Number	Category	Last Name or Business Name	Street	City	Use	Status	Date Sealed	Depth	Aquifer	Date Drilled
	3		2129 Larpenteur Avenue W	Falcon Heights		Not In Use				
	3		5619 Schutta Road	Shoreview		In Use				
	3		7594 Groveland Road	Mounds View		In Use				
	3	Edgetown Acres	1742 Lois Drive	Shoreview		In Use				
	3		6229 Central Avenue NE	Fridley		In Use				
	4b	Murray Heights				Not In Use				
420990	6		800 23rd Avenue SE	Minneapolis		In Use				
420991	6		800 23rd Avenue SE	Minneapolis		In Use				
	6		800 23rd Avenue SE	Minneapolis		In Use				
	6		800 23rd Avenue SE	Minneapolis		In Use				
	6		800 23rd Avenue SE	Minneapolis		In Use				
	6		800 23rd Avenue SE	Minneapolis		In Use				
	6		1275 Highway 8, Old	New Brighton		In Use				
	6		1275 Highway 8, Old	New Brighton		In Use				
	6		1275 Highway 8, Old	New Brighton		In Use				
	6		1275 Highway 8, Old	New Brighton		In Use				
	6		1275 Highway 8, Old	New Brighton		In Use				

TABLE E-5
SEALED WELLS

Unique Number	Category	Last Name or Business Name	Street	City	Status	Date Sealed
490810	7a	Arnel Oil Company	383 Old Highway 8	New Brighton	Sealed	1/4/2006
490811	7a	Arnel Oil Company	383 Old Highway 8	New Brighton	Sealed	1/4/2006
490812	7a	Arnel Oil Company	383 Old Highway 8	New Brighton	Sealed	1/4/2006
544143	7a	Holiday Companies	5695 Hackmann Avenue NE	Fridley	Sealed	7/14/2006
616545	7a	Arnel Oil Company	383 Old Highway 8	New Brighton	Sealed	1/4/2006
616546	7a	Arnel Oil Company	383 Old Highway 8	New Brighton	Sealed	1/4/2006
H0080420	7a	Roberts Plat 2	1945 Tatum Street	Roseville	Sealed	11/3/2005
H0102359	7a		4651 Highway 10	Arden Hills	Sealed	11/9/2005
H0129000	7a	Moore Lake Park First	6620 Stinson Boulevard	Fridley	Sealed	1/3/2006
H0222074	7a	Cutter	1966 Eustis Street	Lauderdale	Sealed	10/6/2005
H0223146	7a	Whitney	4920 Tyler Street NE	Columbia Heights	Sealed	10/24/2005
H0231277	7a	Happ	2505 27th Avenue NE	St. Anthony	Sealed	5/23/2006
H0232399	7a	University of Minnesota	2324 University Avenue SE	Minneapolis	Sealed	7/27/2006
H0232989	7a	Valero Logistics Operations	2288 W County Road C	Roseville	Sealed	12/29/2005
H0237811	7a	Ives	2015 Thom Drive	Arden Hills	Sealed	10/14/2005
H0237829	7a	Thatcher	2071 Rosewood Lane S	Roseville	Sealed	5/13/2006
H0237837	7a	Steinberg	2088 S Rosewood Lane	Roseville	Sealed	9/16/2006
H0239090	7a	Canadian Pacific Railway	2823 Polk Street	Minneapolis	Sealed	10/7/2005
H0239525	7a	Veit and Co.	600 Malcolm Avenue SE		Sealed	10/19/2005
H0239613	7a	Brunning	2268 Laurie Road W	Roseville	Sealed	10/19/2005
H0239631	7a	Hannah	2812 St. Anthony Boulevard	St. Anthony	Sealed	1/13/2006
H0240713	7a	Herschman	3105 39th Avenue NE	St. Anthony	Sealed	3/30/2006
H0240926	7a	Bennet and Koch Construction	191 S Highway 8, Old	New Brighton	Sealed	1/23/2006
H0240928	7a	Galloway	2605 Eastman Drive	New Brighton	Sealed	2/14/2006
H0240929	7a	Galloway	2605 Eastman Drive	New Brighton	Sealed	2/14/2006
H0240934	7a	Leyk	2919 Fairview Avenue N	Roseville	Sealed	4/14/2006
H0241041	7a	Hempel Properties	2216 W County Road D	Roseville	Sealed	11/28/2005
H0241047	7a	Minneapolis	Malcolm Avenue	Minneapolis	Sealed	12/12/2005
H0241255	7a	Metro Transit		Columbia Heights	Sealed	6/16/2006
H0241636	7a	Davis Frost, Inc.	1209 Tyler Street NE	Minneapolis	Sealed	8/22/2006
H0241775	7a	MN Diversified Industries	670 Pelham Boulevard	St. Paul	Sealed	10/19/2005
H0241795	7a	Wall Development Company	501 Malcolm Avenue SE	Minneapolis	Sealed	11/3/2005
H0241838	7a	Thorin	2720 29th Avenue NE	St. Anthony	Sealed	3/9/2006
H0241840	7a	Gill	2524 Pahl Avenue NE	St. Anthony	Sealed	6/5/2006
H0243209	7a	Sakariason	5965 Oakwood Manor	Fridley	Sealed	11/30/2005
H0243227	7a	Johnson	1758 Gramsie Road	Arden Hills	Sealed	12/12/2005
H0243518	7a	Combs	1245 Norton Avenue NE	Fridley	Sealed	12/23/2005
H0243531	7a	SPS Real Estate	1883 County Road D W	Arden Hills	Sealed	2/6/2006
H0243538	7a	Belair Excavating	2287 University Avenue W	St. Paul	Sealed	2/3/2006

TABLE E-5
SEALED WELLS

Unique Number	Category	Last Name or Business Name	Street	City	Status	Date Sealed
H0243539	7a	Belair Excavating	2289 University Avenue W	St. Paul	Sealed	2/3/2006
H0243666	7a	Hecht	1620 Oak Avenue	Arden Hills	Sealed	4/1/2006
H0243668	7a	Hendricks	1762 Carl Street	Lauderdale	Sealed	4/19/2006
H0243683	7a	Graff	3114 Wilder Street	Roseville	Sealed	6/26/2006
H0243692	7a	Clarence Lamotte Estate	2201 St. Stephens Street	Roseville	Sealed	8/29/2006
H0243844	7a	Old Dominion	2750 Cleveland Avenue N	Roseville	Sealed	6/12/2006
H0244427	7a	Hudoba	1840 Lake Lane	Arden Hills	Sealed	3/2/2006
H0244443	7a	Veit and Co.	2369 Fulham Street	Roseville	Sealed	3/7/2006
H0244927	7a	Union Pacific Railroad	525 Kasota Avenue Se	St. Paul	Sealed	3/29/2006
H0245060	7a	Belair Excavating	2285 University Avenue W	St. Paul	Sealed	3/29/2006
H0245081	7a	All City Elevator			Sealed	4/25/2006
H0245272	7a		418 Harding Street NE	Minneapolis	Sealed	6/15/2006
H0245340	7a	Flour Sack Flats	521 Second Street SE	Minneapolis	Sealed	4/14/2006
H0245507	7a	Peterson	1974 Autumn Street	Falcon Heights	Sealed	2/15/2006
H0245547	7a	Vennerstrom	1901 Edgewater Avenue	Arden Hills	Sealed	5/9/2006
H0245554	7a	Krish	1655 Oak Avenue	Arden Hills	Sealed	5/24/2006
H0245591	7a	Birkelo	1781 Long Lake Road	New Brighton	Sealed	8/29/2006
H0245986	7a	Dunn	2911 Fairview Avenue N	Roseville	Sealed	4/3/2006
H0245987	7a	Stone	1400 Mississippi Street NE	Fridley	Sealed	4/3/2006
H0246075	7a	Christianson	1327 66Th Avenue NE	Fridley	Sealed	6/1/2006
H0246096	7a	MN DOT	2543 Como Avenue	Lauderdale	Sealed	6/27/2006
H0246464	7a	Columbia Heights, City of	3955 Univeristy Avenue NE	Columbia Heights	Sealed	5/18/2006
H0247133	7a	Heroux	248 Second Avenue SE	New Brighton	Sealed	8/25/2006
H0247529	7a	Caillier	1677 Glenview Court	Arden Hills	Sealed	5/15/2006
H0247662	7a	Belair Excavating	701 Stinson Boulevard NE	Minneapolis	Sealed	5/22/2006
H0247694	7a	Johnson	778 Eighth Avenue NW	New Brighton	Sealed	7/25/2006
H0247696	7a	Schindler Elevator	800 16th Avenue SE	Minneapolis	Sealed	7/19/2006
H0247974	7a	Mt Properties	2400 Traffic Street	Minneapolis	Sealed	7/10/2006
H0248769	7a	New Brighton, City of	1400 Highway 8, Old NW	New Brighton	Sealed	9/8/2006
H0249187	7a	Veit and Co.	1901 13th Street NE	Arden Hills	Sealed	7/11/2006
H0250360	7a	Friedland	4021 Macalaster Drive NE	St. Anthony	Sealed	9/9/2006
H0252972	7a	Patio Enclosures, Inc.	2123 Highway 8, Old	New Brighton	Sealed	9/28/2006
	7a	Borstad	1330 Amble Road	Arden Hills	Sealed	4/3/2006
	7a	Falcon Woods	1957 Autumn Street	Falcon Heights	Sealed	11/9/2005
	7a	Falcon Woods No. 2	1969 Summer Street	Falcon Heights	Sealed	11/9/2005
	7a		2115 29th Avenue NW	New Brighton	Sealed	2/16/2006
	7a	Manson Hills	2195 Marion Road	Roseville	Sealed	2/16/2006
	7a	Sunnyside Heights	2378 Long Lake Road	New Brighton	Sealed	2/15/2006
	7a	Kowil	2426 Ridge Lane	Mounds View	Sealed	4/3/2006

TABLE E-5
SEALED WELLS

Unique Number	Category	Last Name or Business Name	Street	City	Status	Date Sealed
	7a		2520 29th Avenue NE	Minneapolis	Sealed	10/3/2005
	7a		2860 Mississippi Street	New Brighton	Sealed	2/15/2006
	7a		6435 Pierce Street	Fridley	Sealed	7/6/2006
	7a	Spring Lake Park Knolls	7373 Knollwood Drive	Mounds View	Sealed	2/15/2006
200153	~~3~~, 7a	University of Minnesota	Cleveland (& Roselawn) Avenue	Roseville	~~Inactive~~, Sealed	1/18/2006
206771	~~3~~, 7a	~~Control Data Co~~, Guidant Corp.	4201 Lexington Avenue	Arden Hills	Sealed	8/29/2006
426863	~~6~~, 7a	US Army TCAAP		Arden Hills	~~Active~~, Sealed	3/3/2006
434034	~~6~~, 7a	US Army TCAAP		Arden Hills	~~Active~~, Sealed	3/3/2006
434039	~~6~~, 7a	US Army TCAAP		Arden Hills	~~Active~~, Sealed	3/3/2006
480957	~~6~~, 7a	Arnel Oil Company	~~390~~ 383 Old Highway 8	New Brighton	Sealed	1/4/2006
481682	~~6~~, 7a	~~Mike's Fixture Company, Inc.~~ Shaw Stewart Lumber	409 Johnson Street NE	Minneapolis	Sealed	12/6/2005
523372	~~6~~, 7a	Arnel Oil Company	383 Old Highway 8	New Brighton	Sealed	1/4/2006
523391	~~6~~, 7a	Arnel Oil Company	383 Old Highway 8	New Brighton	Sealed	1/4/2006
544142	~~6~~, 7a	Holiday Companies	5695 Hackmann Avenue NE	Fridley	~~Active~~, Sealed	7/14/2006
632277	~~6~~, 7a	Mixon, Inc.	2286 Capp Road	St. Paul	~~Active~~, Sealed	4/24/2006
632278	~~6~~, 7a	Mixon, Inc.	2286 Capp Road	St. Paul	~~Active~~, Sealed	4/24/2006
632279	~~6~~, 7a	Mixon, Inc.	2286 Capp Road	St. Paul	~~Active~~, Sealed	4/24/2006
632280	~~6~~, 7a	Mixon, Inc.	2286 Capp Road	St. Paul	~~Active~~, Sealed	4/24/2006
632281	~~6~~, 7a	Mixon, Inc.	2286 Capp Road	St. Paul	~~Active~~, Sealed	4/25/2006
644723	~~6~~, 7a	Holiday Companies (Stationstores)	5695 Hackmann Avenue NE	Fridley	~~Active~~, Sealed	7/14/2006
653903	~~6~~, 7a	US Army TCAAP - Grenade Range	4700 Highway 10	Arden Hills	~~Active~~, Sealed	5/11/2006
653904	~~6~~, 7a	US Army TCAAP - Grenade Range	4700 Highway 10	Arden Hills	~~Active~~, Sealed	5/11/2006
653905	~~6~~, 7a	US Army TCAAP - Grenade Range	4700 Highway 10	Arden Hills	~~Active~~, Sealed	5/11/2006
662094	~~6~~, 7a	Viacom, Inc.	2303 Kennedy Street	Minneapolis	~~Active~~, Sealed	8/23/2006
671171	~~6~~, 7a	Viacom, Inc.	2303 Kennedy Street	Minneapolis	~~Active~~, Sealed	7/10/2006
675976	~~6~~, 7a	US Army TCAAP	4700 Highway 10	Arden Hills	~~Active~~, Sealed	5/11/2006
687134	~~6~~, 7a	Viacom, Inc.	2303 Kennedy Street	Minneapolis	~~Active~~, Sealed	8/23/2006
694184	~~6~~, 7a	Holiday Companies (Stationstores)	5695 Hackmann Avenue NE	Fridley	~~Active~~, Sealed	7/14/2006
694198	~~6~~, 7a	Holiday Companies (Stationstores)	5695 Hackmann Avenue NE	Fridley	~~Active~~, Sealed	7/14/2006
719143	~~6~~, 7a	Holiday Companies (Stationstores)	5695 Hackman Avenue	Fridley	Sealed	7/14/2006
719144	~~6~~, 7a	Holiday Companies (Stationstores)	5695 Hackman Avenue	Fridley	Sealed	7/14/2006

TABLE E-6
FY 2007 FIELD INVESTIGATION AND SAMPLING SUMMARY

Unique Number	Category	Last Name or Business Name	Street	City	Date Last Sampled	Status	Depth	Comments
	4a	Amundsen	2816 St. Anthony Blvd	St. Anthony		Not in Use		Well remains inoperable per owner.
	4a	Bryant, Jr.	615 12th Ave NW	New Brighton		Not in Use		Well remains inoperable per owner.
	4a	Burton	2073 10th St NW	New Brighton		Inactive		Well remains inoperable per owner.
	4a	City of New Brighton	19 14th St NW	New Brighton		Active		Could not locate.
	4a	Cuddihy	2933 Troseth Road	Roseville		Not in Use		Well remains inoperable per owner.
	4a	Hermes	2935 Old Hwy 8	Roseville	6/22/2005	Active		Scheduled to sample in 2009.
	4a	Olson	4439 Old Hwy 10	Arden Hills		In Use		No response.
	4a	Tabaika	2512 27th Ave NE	St. Anthony		Inactive		No response.
	4a	Weisenberger	2816 Silver Lake Rd	St. Anthony		Inactive		No response.
	4a	Willig	2600 Pahl Ave	St. Anthony		Inactive		Well remains inoperable per owner.
249185	4a	Novotny	1706 Malvern St	Lauderdale		Unknown		No response.
S00295	4a	Alfson	2351 Summer St	Lauderdale		Unknown		No response.
	4b	Meridian Properties Real Estate Dev., LLC.	3700 Silver Lake Rd	St. Anthony		Active		Could not locate.
	4b	New Brighton Alano Society, Inc.		Mounds View		Active		Could not locate.
	4b	New Brighton Alano Society, Inc.		Mounds View		Active		Could not locate.
	4b	Murray Heights				Not in Use		Could not locate.
105242	4b	Weber, Nordeen Jr.				Active	214	Could not locate.
105271	4b	Nelson				Active	137	Could not locate.
126463	4b	B & M Construction	Nordeen Estates			Active	216	Could not locate.
130000	4b	550 Associates		Arden Hills		Inactive		Could not locate.
130000	4b	550 Associates		Arden Hills		Inactive		Could not locate.
180922	4b					Active		Could not locate.
192091	4b			Elmwood		Active		Could not locate.
201192	4b					Active		Could not locate.
234434	4b	Marquart		Arden Hills		Unknown		Could not locate.
234532	4b							Could not locate.
234537	4b							Could not locate.
234545	4b				PHASE I			Could not locate.
234568	4b	Thomsen	4 88th NE	Minneapolis			200	No response.
234658	4b				6/7/1982			Could not locate.
239465	4b	Lennox				Active	256	Could not locate.
S00471	4b	R Komarek/Nelson-Miller Cons				Inactive		Could not locate.
S00551	4b	Tamarack Care Temp			2/17/1982	Unknown		Could not locate.
S00650	4b	CME		New Brighton	6/24/1984			Could not locate.

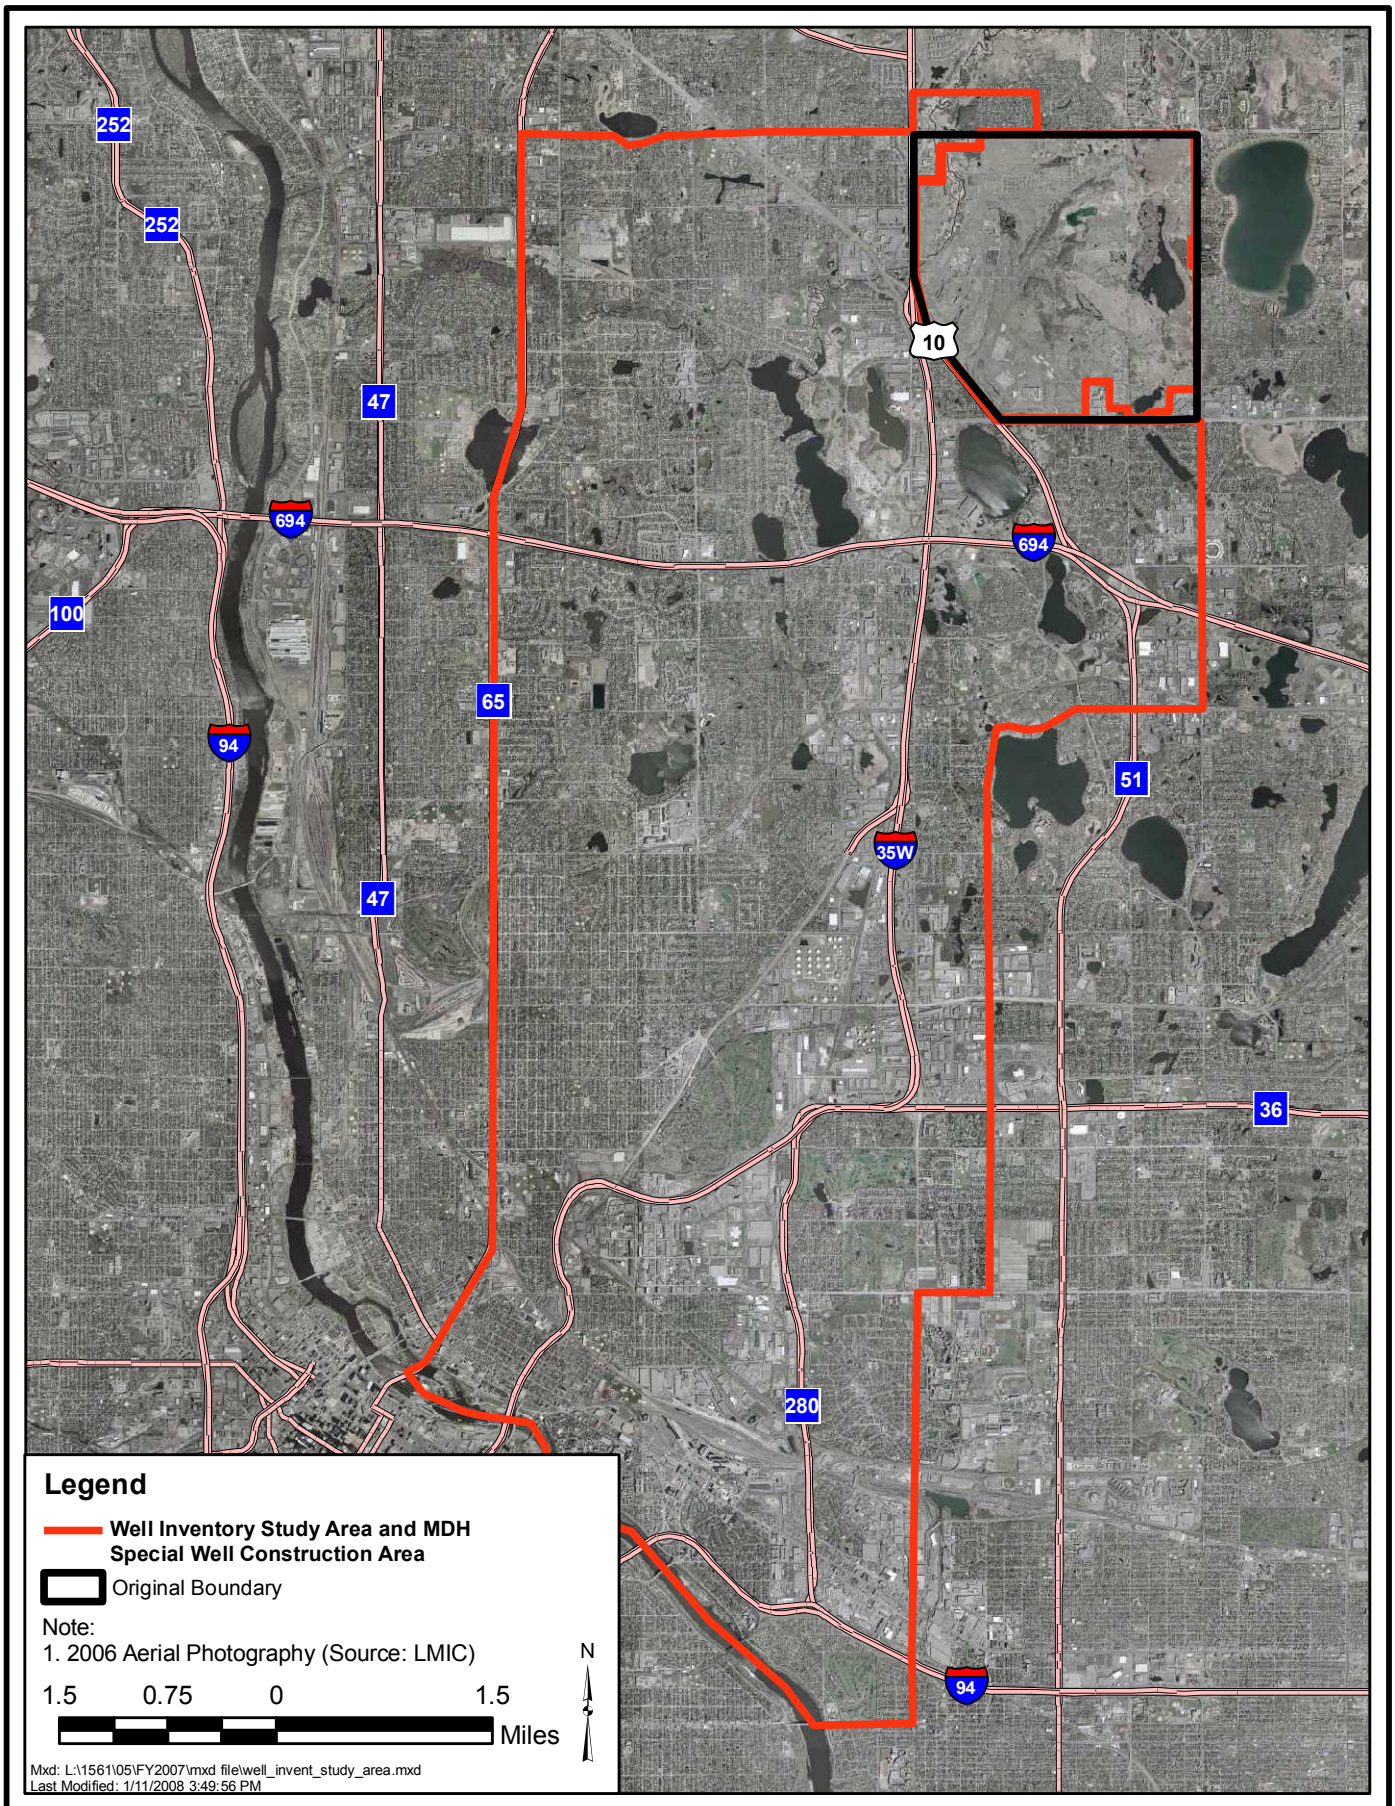

TWIN CITIES ARMY AMMUNITION PLANT

Well Inventory Study Area

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure E-1

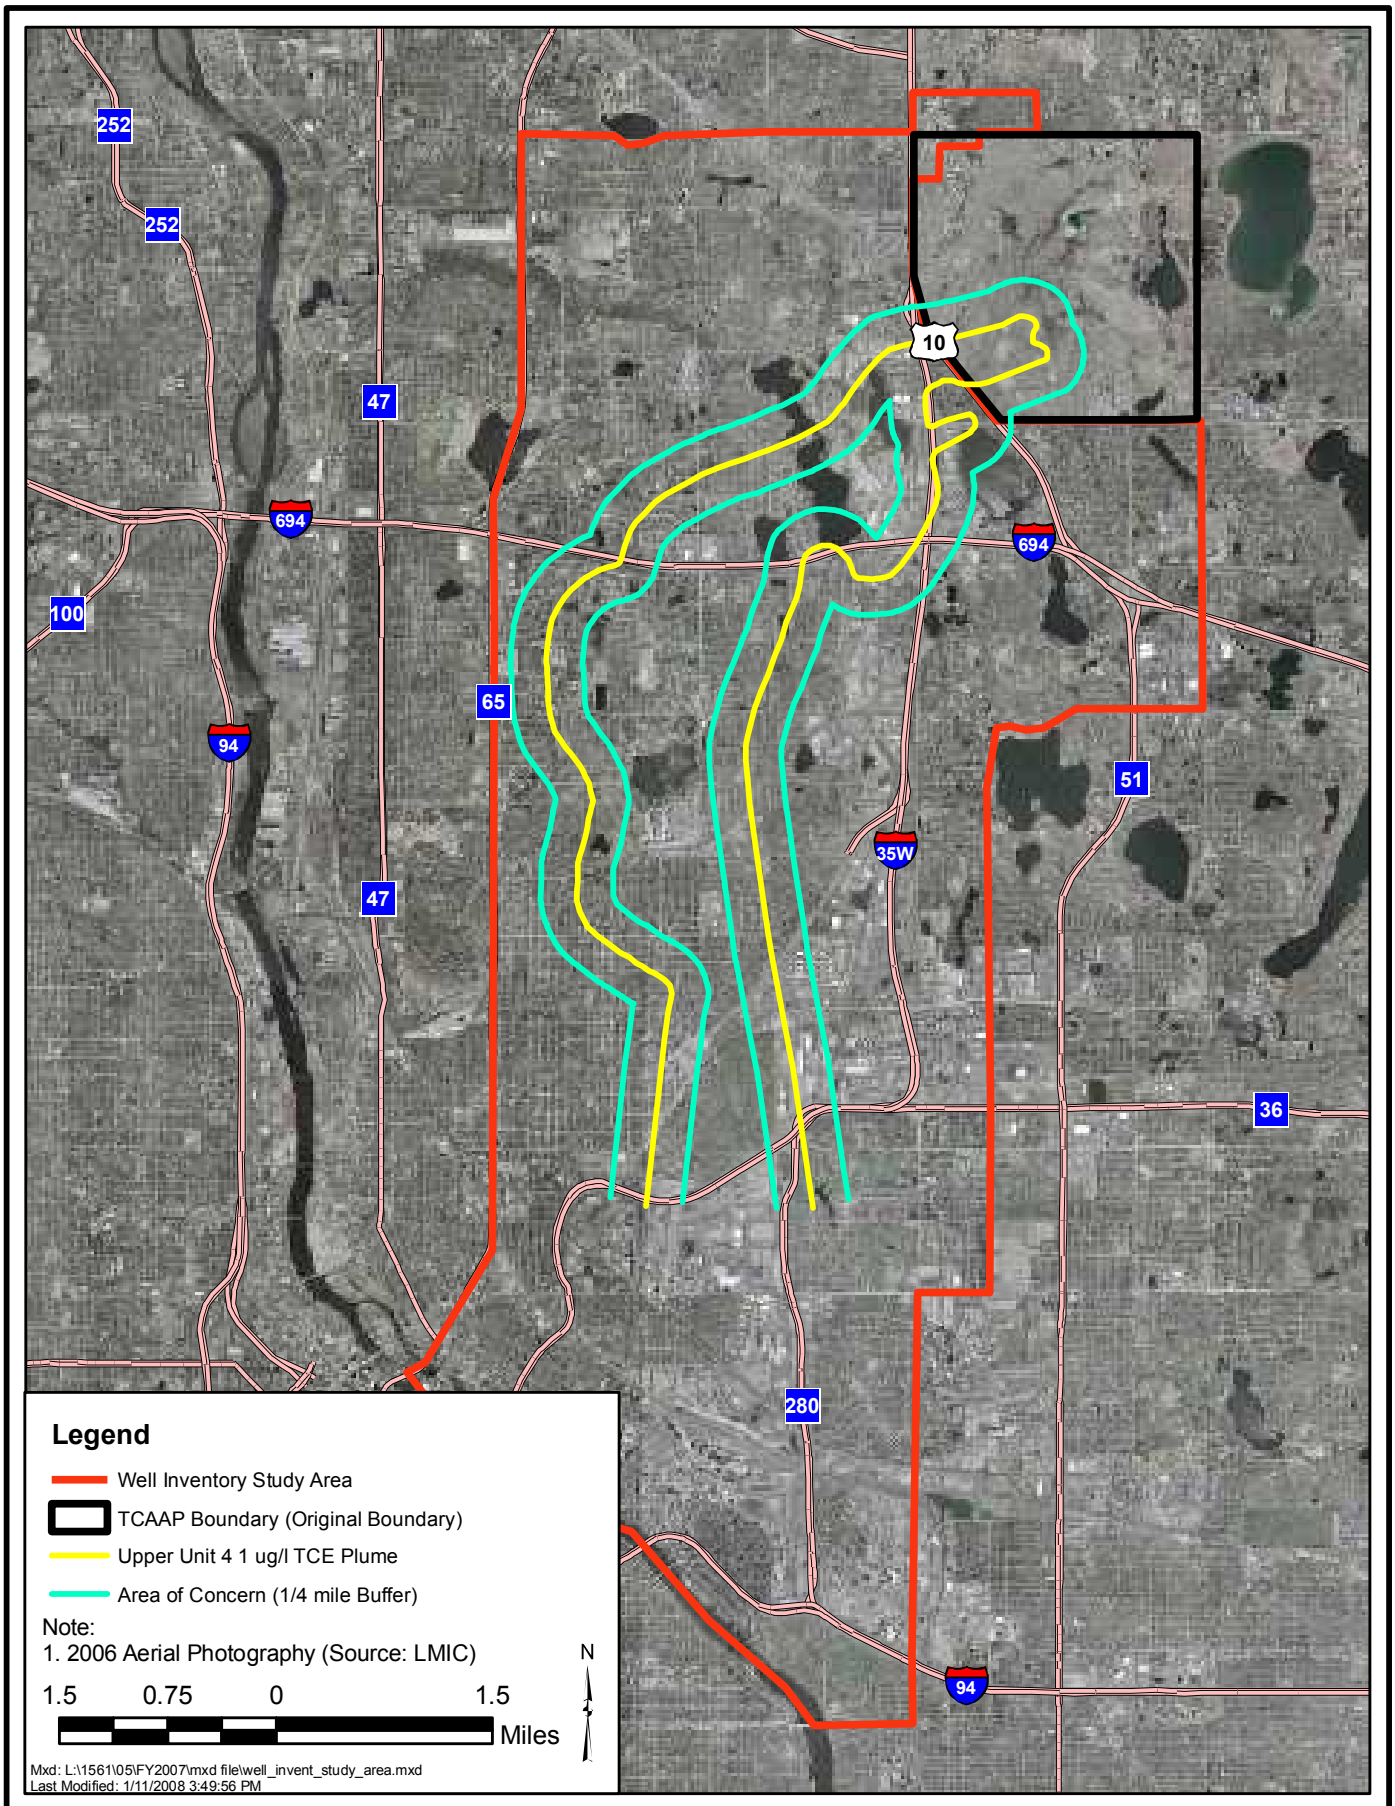

TWIN CITIES ARMY AMMUNITION PLANT

Areas of Concern (Unit 3 and Unit 4)

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0429

FY 2007

Figure E-2

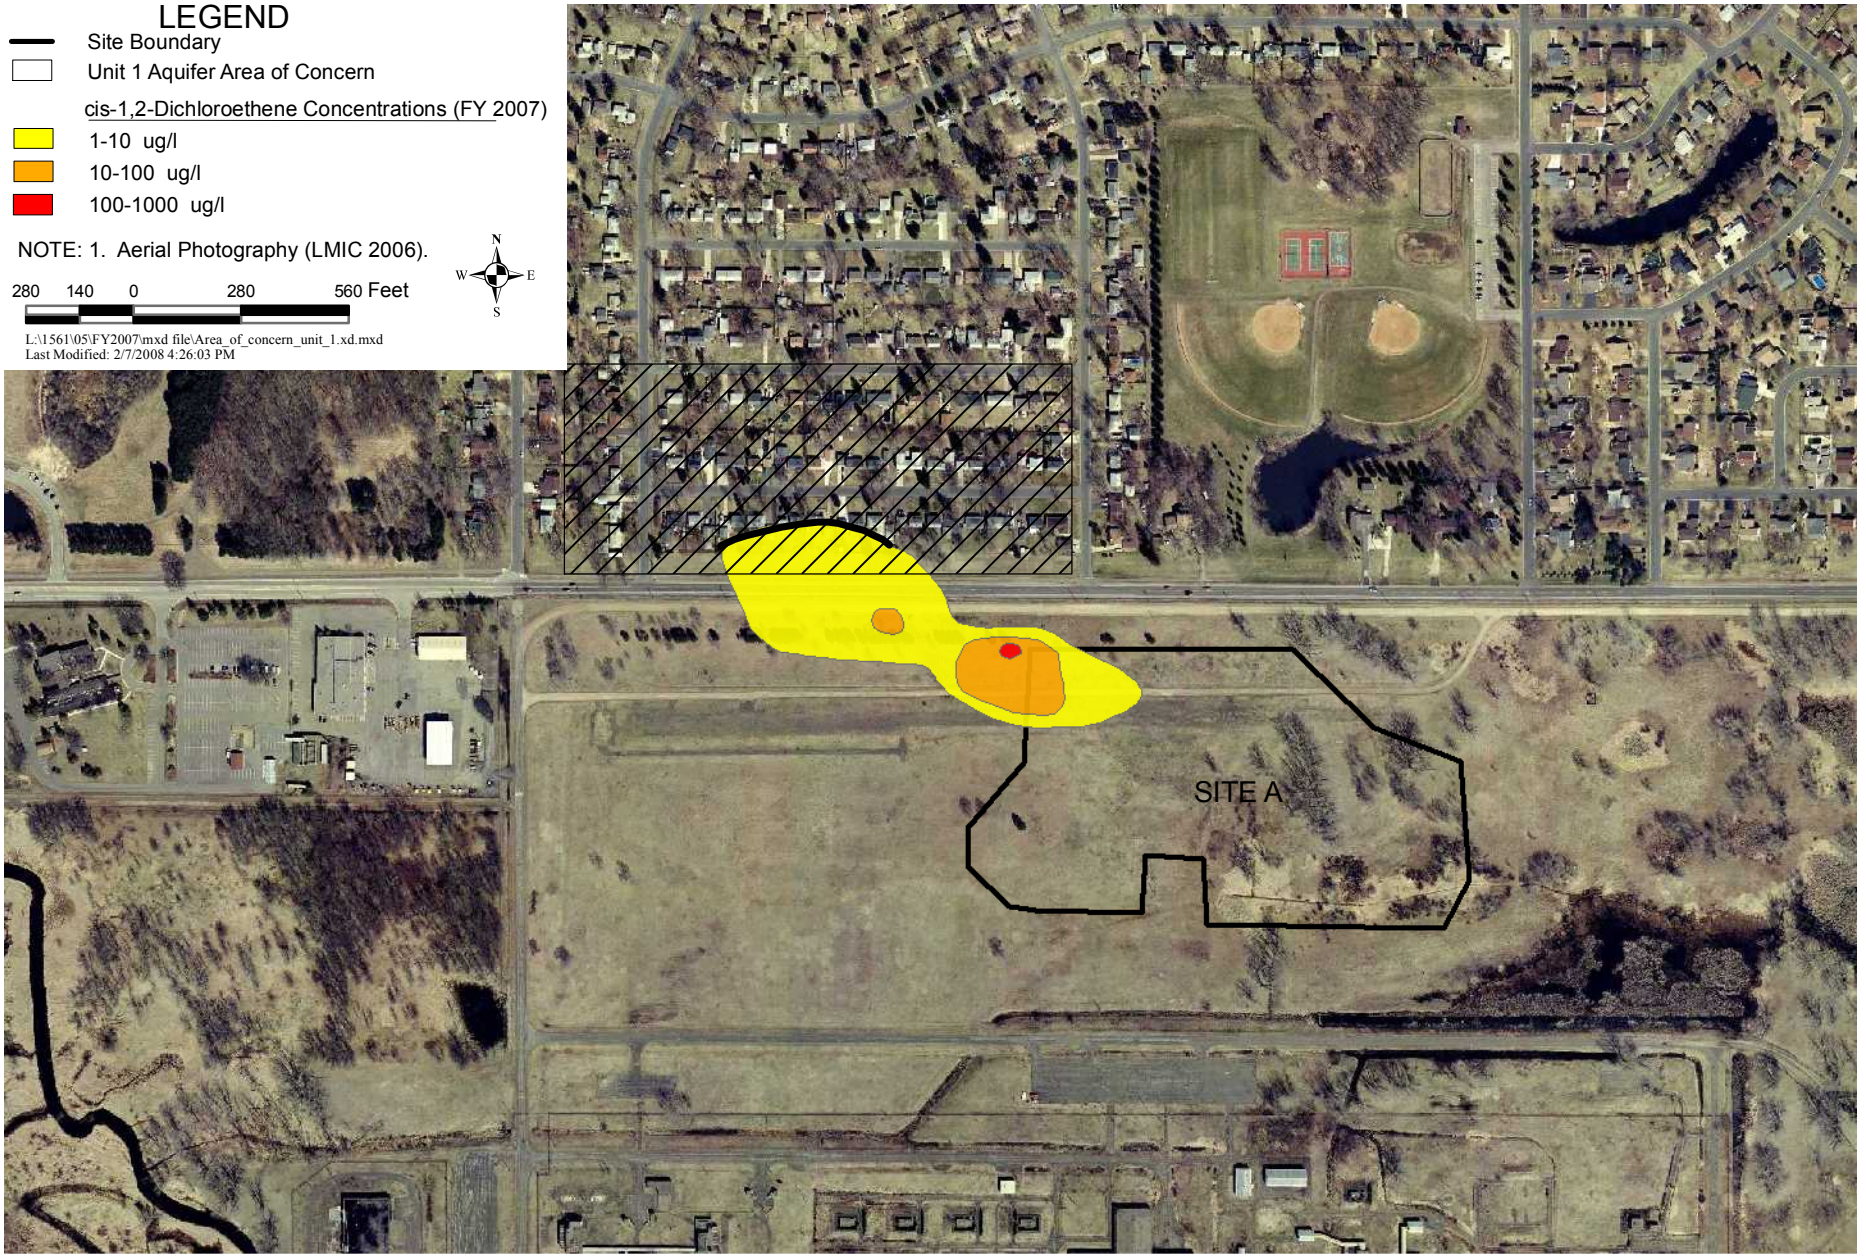

TWIN CITIES ARMY AMMUNITION PLANT

Area of Concern (Unit 1)

COPYRIGHT

Wenck

Wenck Associates, Inc. 1800 Pioneer Creek Center
Environmental Engineers Maple Plain, MN 55359-0249

FY 2007

Figure E-3

Figure E-4

Annual Requirements for Maintaining TCAAP Well Inventory Database

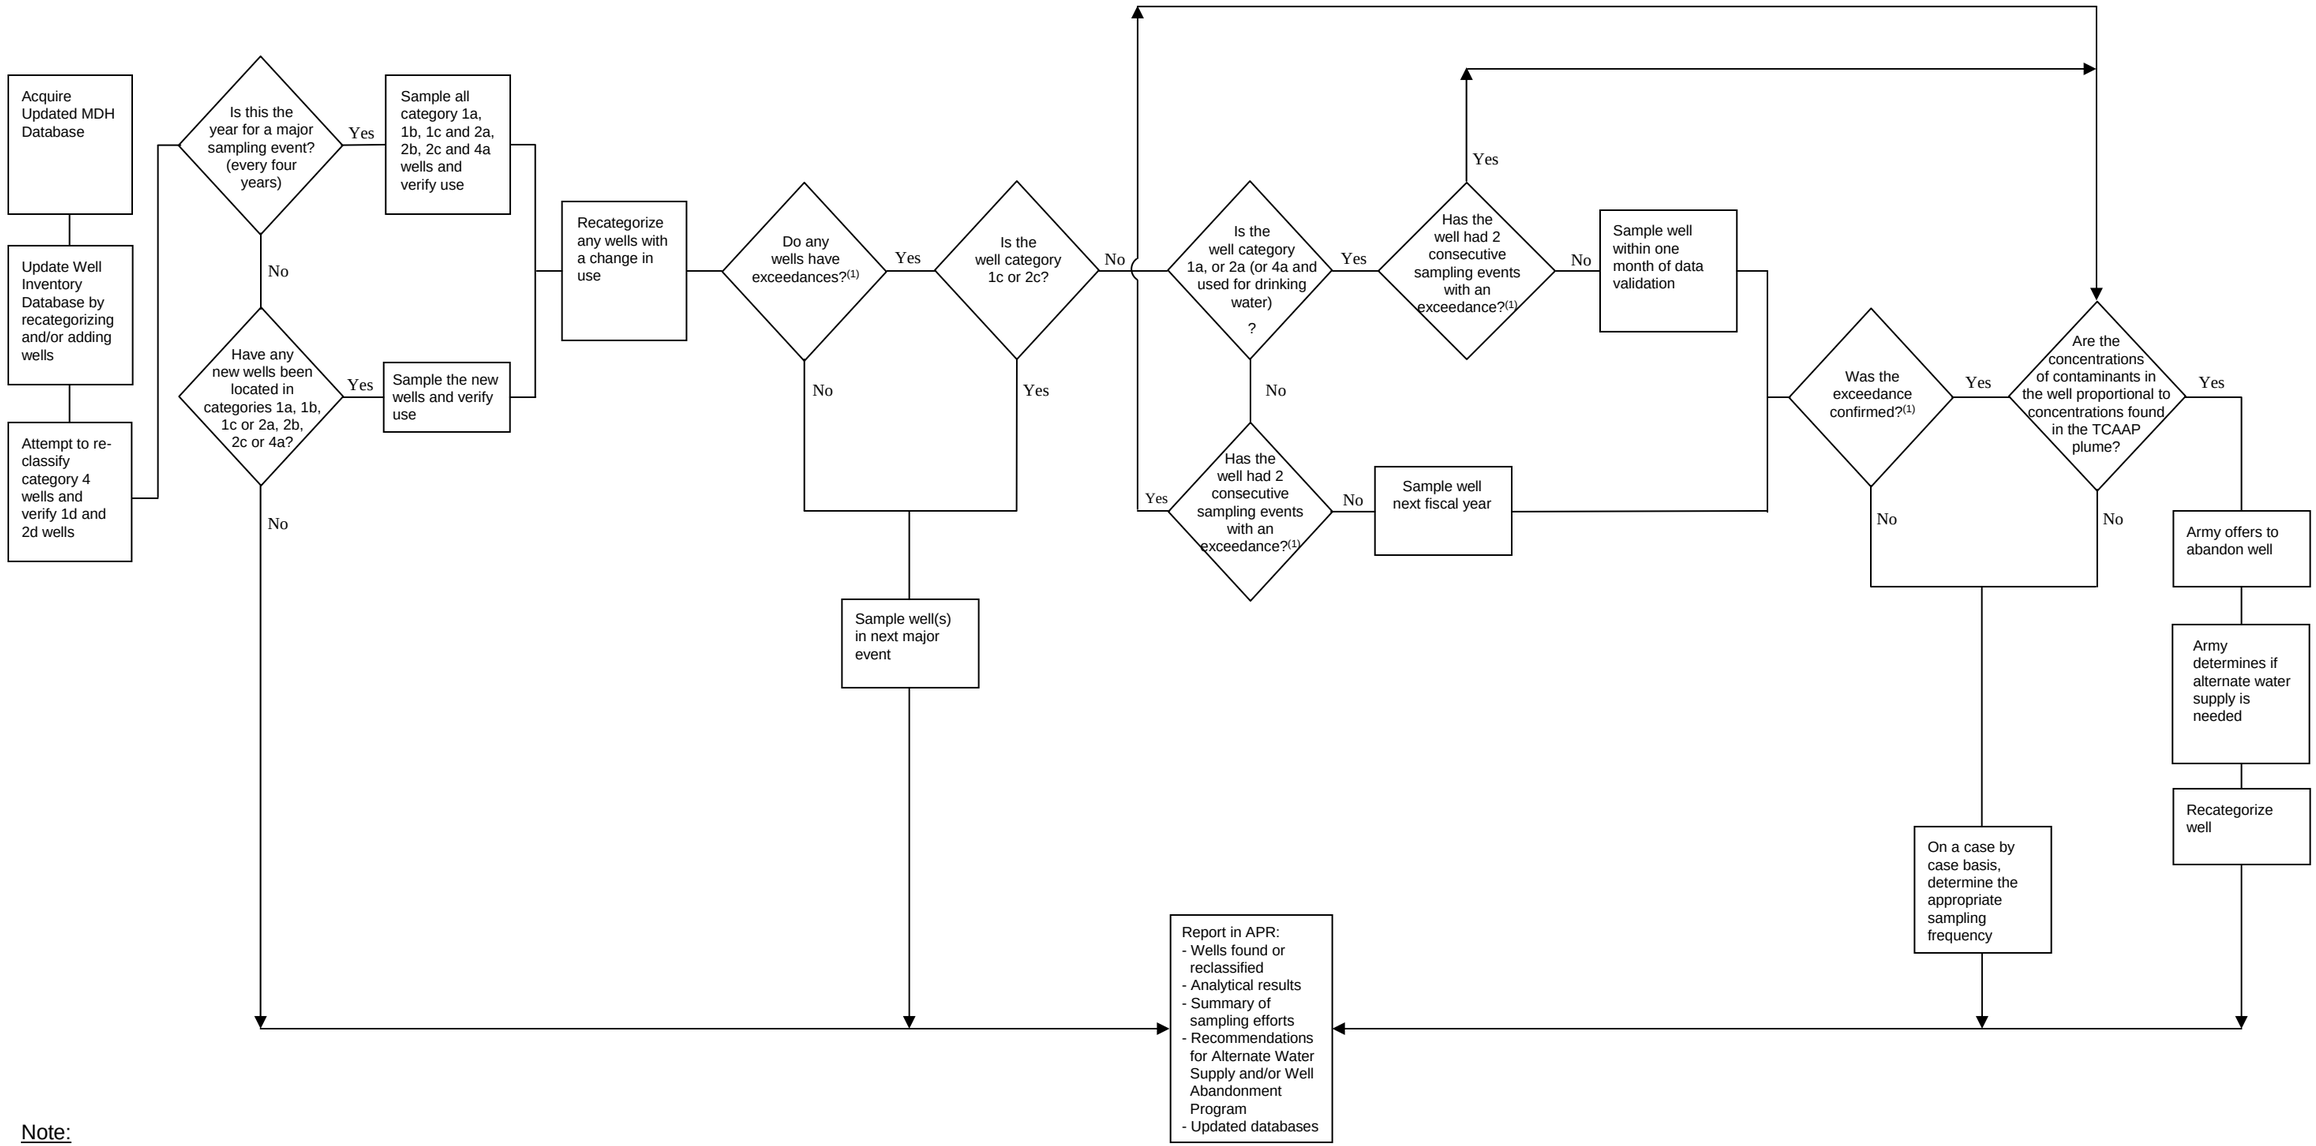

Note:

(1) = Exceedance of a TCAAP Groundwater Cleanup Level

TCAAP WELL INVENTORY DATABASE

The TCAAP Well Inventory Database is located on this CD-ROM in the following Microsoft Excel file:

Well_Inv.xls

Appendix F

Site K, TGRS, and PGRS Operational Data

F.1 Inspection and Maintenance Activities, Fiscal Year 2007, Site K, TCAAP

APPENDIX F.1

INSPECTION AND MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
SITE K, TCAAP
ARDEN HILLS, MINNESOTA

October 2006

1) 10/3/06 - Clean spray nozzle in tower, system downtime approximately 30 minutes.

2) 10/17/06 - Shut down system due to excessive fan vibration. System shut down until new fan could be installed. System down time approximately 15 days.

3) 10/31/06 - Performed monthly O&M.

November 2006

1) 11/1/06 - New blower fan installed. System downtime approximately 13 hours.

2) 11/3/06 - Adjusted air flow rate of blower. System downtime: None.

3) 11/15/06 - System in suspense. System downtime: None.

4) 11/17/06 - System in suspense. System downtime: None.

5) 11/27/06 - System in suspense. System downtime: None.

6) 11/29/06 - System in suspense. System downtime: None.

7) 11/30/06 - Pump seal failure. System shut down to repair pump. System downtime approximately 24 hours.

December 2006

1) 12/01/06 - Pump seal failure. System shut down to repair pump. System downtime approximately 159 hours.

2) 12/12/06 - System in suspense. System downtime: None.

3) 12/13/06 - System in suspense. Adjusted air flow rate of blower. System downtime: None.

4) 12/21/06 - System in suspense. System downtime: None.

5) 12/22/06 - Performed Monthly PM, System in suspense. System downtime: None.

January 2007

1) 01/08/07 - Monthly preventative maintenance. System downtime: None.

2) 01/17/07 - System in suspense. System downtime: None.

3) 01/18/07 - System in suspense. System downtime: None.

4) 01/23/07 - System in suspense. System downtime: None.

5) 01/31/07 - System in suspense. System downtime: None.

APPENDIX F.1

INSPECTION AND MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
SITE K, TCAAP
ARDEN HILLS, MINNESOTA

February 2007

1) 02/01/07 - Monthly preventative maintenance. System downtime: None.

2) 02/14/07 - System in suspense. System downtime: None.

3) 02/20/07 - System low air flow alarm tripped; system reset. System downtime: None.

4) 02/23/07 - System low air flow alarm tripped; system reset. System downtime: None.

5) 02/26/07 - System low air flow alarm tripped; system reset. System downtime: None.

6) 02/27/07 - System in suspense. System downtime: None.

7) 02/28/07 - System in suspense. System downtime: None.

March 2007

1) 03/01/07 - Monthly preventative maintenance. System downtime: None.

2) 03/08/07 - System in suspense. System downtime: None.

3) 03/09/07 - System in suspense. System downtime: None.

4) 03/12/07 - System in suspense. System downtime: None.

5) 03/15/07 - System in suspense. System downtime: None.

6) 03/16/07 - System in suspense. System downtime: None.

7) 03/19/07 - System in suspense. System downtime: None.

April 2007

1) 04/02/07 - Monthly preventative maintenance. System downtime: None.

2) 04/23/07 - Increased system flow to 17 gallons per minute (gpm).

3) 04/25/07 - System in suspense. System downtime: None.

4) 04/26/07 - Reduced system flow to 15 gpm.

May 2007

1) 05/01/07 - Monthly preventative maintenance. System downtime: None.

2) 05/17/07 - System in suspense. System downtime: None.

APPENDIX F.1

INSPECTION AND MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
SITE K, TCAAP
ARDEN HILLS, MINNESOTA

June 2007

1) 06/06/07 - Collected quarterly influent and effluent samples. System downtime: None:

2) 06/07/07 - Monthly preventative maintenance. System downtime: None.

3) 06/13/07 - System in suspense. System downtime: None.

4) 06/18/07 - System control panel was hot to touch. Cycled off system and adjusted thermostat panel heater. Restarted system. System downtime: None.

July 2007

1) 07/09/07 - Monthly preventative maintenance. System downtime: None.

2) 07/13/07 - System in suspense. System downtime: None.

3) 07/19/07 - Increased airflow static pressure to 19 inches H_2O. System downtime: None.

August 2007

1) 08/02/07 - System in suspense. System downtime: None.

2) 08/03/07 - Monthly preventative maintenance. System downtime: None.

3) 8/16/07 - System in suspense. System downtime: None.

4) 8/22/07 - System in suspense. System downtime: None.

5) 8/23/07 - System in suspense. System downtime: None.

6) 8/24/07 - System in suspense. System downtime: None.

September 2007

1) 09/06/07 - Monthly preventative maintenance. System downtime: None.

2) 09/28/07 - Annual system cleaning. System downtime 8 hours.

F.2 Maintenance Activities, Fiscal Year 2007, TGRS, TCAAP

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

October 2006

9/29-10/3/2006	Pumphouse SC5; ECV will not open without emergency shut down solenoid energized; Wire emergency shut down solenoid and observe normal operation. October down time: 71 hours.
10/3-5/2006	Treatment System; Turned off Pump 2 in the treatment center to dry out water distribution system at the top of tower 2; Turned off several wells to minimize well field cycling. Down time: 2.5 hours at B6; 53 hours at B11 and SC2; 58 hours at B3, B8 and B9.
10/11/2006	Pumphouse B4; Pump is off; Starter coil is tripped; Reset at control panel and observed normal operation. Down time: 15 hours.
10/11-25/2006	Pumphouses SC2 and SC5; Communication failure between pumphouses and PLC in Building 116; Hans Halpern on site to troubleshoot; No continuity found between pumphouses and Building 116; Inspection of communication cable in hand hole finds the cables have been severed most likely by a rodent chewing threw them; Laughlin Electric splices the communication lines and normal operation resumes. Down time: 276 hours at SC2 and SC5
10/24/2006	Treatment System; Wet well pump 2 float switch will not activate; Perform repairs and observe normal operation. Down time: 6 hours at B3 and B4; 2 hours at B6.
10/26/2006	Laughlin Electric on site to install a new heater in pumphouse SC3. Down time: None.
10/29/2006	Pumphouse B11; Pump will not pump water; Motor draws approximately 14 amps; Likely a failed pump end. October down time: 30.5 hours.
10/30-31/2006	Water Tower, Well Field and Treatment System; Increased pressure at Snelling Avenue Valve to overflow the water tower; Following water tower flushing, the Snelling Avenue Valve was re-adjusted but the pressure did not decrease resulting in the well field cycling overnight. Down time: B6 for 2 hours; B3 for 6 hours and B4 for 4 hours.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

November 2006

10/30-11/7/2006	Pumphouse B11; Pump will not pump water; Motor is pulling 14 amps so it is likely a failed pump (wet end); Remove lift system and replace the pump, motor, check valve and one length of drop pipe. November Down time: 168 hours.
11/3/2006	Altitude Valve; Call from Time Communications, "Altitude valve failed to open or close"; Troubleshooting indicates a communication error between the PLC in Building 116 and the PLC in the altitude valve vault. Reset the PLC and observed normal operation. Down time: None.
11/6/2006	Treatment System; ECV 4 will not close and likely has a failed seal inside the valve; Open the valve, remove the piston, remove manganese and iron scale from the piston, valve body and cover plate; Replace the old valve seals with new. Down time: B13 for 10 hours, B3 for 5 hours, B8 for 4 hours and B9 for 3 hours.
11/7/2006	Treatment System; Following seal replacement work at ECV 4, incorrectly adjusted control piping valves so the valve would not open all the way on command; Well field cycled overnight; Re-adjusted control piping and observed normal operation. Down time: 9 hours at B13, 4.5 hours at B3, 3 hours at B8 and 2 hours at B9.
11/14-22/2006	Pumphouse SC2; Remove lift system, acid treat, brush and surge well screen and riser to re-develop well. Down time: 189 hours.
11/16/2006	Snelling Avenue Valve; Pressure is too high causing the well field to cycle; Decrease the pressure to 32 psi and observe normal operation. Down time: B13 and B4 for 2 hours each.
11/24/2006	Treatment System; Call from Time Communications, "TGRS fail"; ECV 3 failed to open, reset, adjusted open control valve, changed filter and flushed pipes; Cycled valve and observed normal operation. Down time: None.
11/25/2006	Altitude Valve; Call from Time Communications; Drain fail, tower low, RTU 1 and 2 communication failure; Acknowledged alarms and increased the pressure at Snelling Avenue valve to increase the flow rate to the tower. Down time: None.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

11/26/2006	Altitude Valve; RTU 1 and 2 communication fail; Tower did not dump since 10/25/2006; Switch to summer operation and notify Keres Consulting, Inc. Down time: None.
11/27/2006	Treatment System; Replaced operating solenoid valve filter for ECV 3 control piping; Slight buildup noted. Down time: None.
11/28/2006	Treatment System; Turned the TGRS off to investigate why the filter to ECV 3 is becoming plugged with very fine sediment more quickly than usual; Installed a filter over the discharge of the recycle valve in wet well 3 and observed no evidence of sediment. Down time: 1.5 hours at B4.
11/29/2006	Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem. Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.
December 2006	
12/11/2004	Snelling Avenue Valve; Low pressure at Snelling Avenue Valve, The valve will not allow the water tower to fill as quickly as necessary for winter operation; Clean strainer valve, flush control piping and adjust pilot; Pressure now at 32 psi and normal operation resumes. Down time: None.
12/12/2006	Pumphouse SC1; Xcel Energy on site to investigate new way to bring power to SC1 after power is discontinued to Building 502. Down time: None.
12/13/2006.	Pumphouse B11; Opened a section of fenceline near B11 to shorten the time duration of the daily inspections. Down time: None.
12/14/2006	Recycle Valve; Call out from autodialer to Time Communications "Recycle valve fail"; Acknowledged alarm and reviewed the trending graph; Normal graph lines observed; Cycled the recycle valve and observed normal operation. Down time: None.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

12/15/2006	Recycle Valve; The valve will not close on command; Cleaned manganese off of the inlet screen and cycled the valve several times; Normal operation observed. Down time: None.
12/16-18/2006	Pumphouse B9; No power to pumphouse; Xcel Energy called and finds the splice on the overhead line to the pumphouse is in poor condition; They repair the splice and power to B9 is restored. Down time: 46.5 hours.
12/21/2006	Pumphouse B3; Removed a piece of metal from the inlet to the flow meter; Reinstalled the meter and observed normal operation. Down time: None.
January 2007	
1/8/2007	Altitude Valve; Call from Time Communication: Altitude valve fail; Communication failure with no current alarms, acknowledged Autodialer. Down time: None.
1/8/2007	Recycle Valve; Call from Time Communications- Drain Fail light is lit; Upon arrival, the recycle valve operates normally but there is a communication error between the PLC in Building 116 and the PLC in the altitude valve vault; Contact Keres Consulting and switch to summer operation for the night; Keres resets communications and normal operation resumes. Down time: None.
1/13-18/2007	Recycle valve; Drain fail; Intermittent alarms and autodialer call outs during this time period; Cycled altitude valve and recycle valve several times then reset PLC and autodialer, but during the next elevated tank fill cycle, the alarm and call out would reoccur; Flushed the control piping, changed out strainer screens and increased the pressure at the Snelling Avenue Valve to 32 psi; Normal operation resumed. Down time: None.
1/14/2007	Snelling Avenue Valve; High pressure at valve causes well field to cycle; Adjust pilot to lower the pressure. Down time: B13, B11 and SC1 for 22 hours each; B3 and B8 for 20 hours each and B4 and B6 for 18 hours each.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

1/18/2007	Altitude Valve; Valve will not open or close when activated; Removed, acid washed and replaced solenoid valve; Cycled valve several times and observed normal operation. Down time: None.
1/19/2007	Recycle valve; Valve closed at 20.2'. Opened recycle valve to lower level below 20', then put system in auto; Altitude valve opened normally and tower filled. Down time: None.
1/17/2006	Pumphouse B1; Changed out flow meter with new; Old one out at 94549900 and new one in at 34445000 at 16:30. Down time: None.
1/20/2007	Recycle valve; Call from Time Communications- "recycle valve fail". Tower is at 20.7' and the tower is taking longer than 3.5 hours to dump; Cycled recycle valve and observed normal operation. Down time: None.
1/23/2007	Treatment System; ECV 3 will not close on command; Change filter, flush control piping, adjust speed control valves and cycle the valve several times; Normal operation observed. Down time: None.
1/25/2007	Pumphouse B5; Changed out flow meter with new; Old one out at 61653500 and new one in at 88759800 at 13:40. Down time: None.
1/29-31/2007	Pumphouse SC5; Active light is flickering on I/O Adapter module; Laughlin Electric to troubleshoot; Troubleshooting indicates a faulty water level control board in pumphouse SC5; Changed out water level board and observed normal operation. January Down time: 52.5 hours.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

February 2007

1/30-2/1/2007	Pumphouse SC5; Pump will not pump water in "Auto" but will pump water in "Hand" indicating a communication problem; Switch out I/O Adapter, Input and Output cards but pump will not start; Inspect recently spliced cables in hand hole and they look good; Change out water level control board in pumphouse and pump restarts normally. February Down time: 26 hours.
2/2/2007	Pumphouse B4; Laughlin Electric removed old electrical wire and installed new number 6 wire from well head to control panel. Down time: None.
2/6/2007	Recycle valve; Recycle valve failed to open due to a communication error; Repeated "Communication failure" followed immediately by "Communications restored" on trending; Operate recycle valve manually and dump tower from 30.4' to 24.8' and then open altitude valve manually to fill water tower to 30.8'. Down time: None.
2/12/2007	Pumphouse B4; T. L. Stevens Well Company on site to replace the pump and motor with new. Down time: 2 hours.
2/15/2007	Pumphouse B4; Increased the forcemain pressure to decrease the flow rate to approximately 210 gpm. Down time: None.
2/15/2007	Treatment System; Call out from Time Communication-"TGRS Fail"; Upon arrival, ECV will not open on command; Change filter, flush control piping, adjust speed control valves but valve still will not open; Replace pilot with new, adjust opening and closing speed control valves and cycle valve several times; Normal operation observed. Down time: 2 hours at B1 and B13.
2/17/2007	Pumphouse B11; Light flashing on PLC in Building 116; Reset PLC and B11 relit normally. Down time: 20 hours.
2/24-27/2007	Pumphouse B1; Failed cold water flow meter; Replace with new and adjust flow rates for each day to what they would have been if the flow meter hadn't failed. Down time: None.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

2/27/2007	Treatment System; ECV 4 would not close on command; Change filter, flush control piping, adjust speed control valves and observe normal operation. Down time: None.
March 2007	
3/12/2007	Pumphouse B4; Pumphouse forcemain pressure is too high; ECV not responding to pilot adjustment; Flush control piping, clean strainer screen and adjust speed control valves; Reset pressure and normal operation resumes. Down time: 3 hours.
3/13/2007	Treatment System; Gland packing at pump1 is leaking; Replaced gland packing with new. Down time: 2.5 hours at B1 and B13.
3/19/2007	Pumphouse B13; Pump and motor are failing; Replaced with new. Down time: 3 hours.
3/21/2007 .	Treatment System; Gland packing at pump 2 is leaking; Replaced gland packing with new. Down time: None.
3/22/2007	Pumphouse SC5; The ECV is all the way open indicating the control piping requires maintenance; Clean strainer screen, adjust opening and closing speeds and flush control piping. Down time: None.
3/25-26/07	Pumphouses B1, B13, B3 and B11; Panel lights for B1, B13, B3 and B11 are off on PLC in Building 116; At power pole between pumphouses B2 and B3, all three fusible switches are open and the crossarm on the pole is burnt; Contact and schedule Xcel Energy to repair on 3/26/2007. Down time: 38.5 hours at B1, B13 and B3 and 24 hours at B11.
3/26/2007	Pumphouse B11; ECV not responding to pilot adjustment; Flush control piping, clean strainer screen, adjust speed control valves and change out pilot; Normal operation observed. Down time: None.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

3/28/2007	Elevated Storage Tank; Switched from winter operation to summer operation. Down time: None.
April 2007	
4/3-12/2007	Pumphouse SC1; Xcel Energy turns off power to Building 502 which turns off power to pumphouse; Xcel Energy installs 2 new power poles and a 3 transformer bank on the power pole nearest Building 960/SC1 pumphouse to provide a new source of power to SC1; They energize the new connection and Laughlin Electric on Site to wire proper rotation. Down time: 212 hours.
4/11/2007	Treatment System; Installed a new type of packing in gland shaft to stop leaking at pump 2. Down time: None.
4/15/2007	Elevated Storage Tank/Groundwater Storage Reservoir; Audible alarm on arrival; RTU 1 and 2 communication failure; Acknowledged alarm. Down time: None.
4/16/2007	Pumphouse SC1; Installed a new pressure gauge on pump discharge piping. Down time: None.
4/19/2007	Altitude Valve; The water level in the water tower is declining with time; Upon inspection, the valve will not close completely; Change filter, flush control piping and adjust opening and closing speed and observe the altitude valve closes properly; Water is leaking out the vent port while the valve is closed indicating the valve needs new seals. Down time: None.
4/27/2007	Treatment System; Call from Time Communication-TGRS fail; Upon arrival, ECV 3 failed to open on command; Acid washed operating solenoid valve; Cycled valve and observed normal operation. Down time: 1 hour at B13.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

May 2007

5/1/2007	Treatment System; Call from Time Communcations-TGRS Fail; Upon arrival, ECV 3 would not open on command; Change filter, flush control piping, adjust open and closing speed control valves and problem persists; Replace operating solenoid with new; Cycle valve three times and observe normal operation. Down time: B13 for 1 hour.
5/5/2007	Treatment System, Call from Time Communications; ECV 3 failed to open; Adjusted open speed valve and observed normal operation. Down time: None.
5/7-8/2007	Pumphouses B4, B5, B6, B8 and B9; Power outage to pumphouses; Smoke odor coming from inside the control panel in each pumphouse; Some pumphouses still have 110 volt power; Contacted Xcel Energy to respond. Down time: B4, B5, B6, B8 and B9 for 23 hours each.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/9/2007	Treatment System; Blower belt failed at blower 2; Replaced with new. Down time: None.
5/15/2007	Building 116; Audible alarm on indicating low temp and high tank level; Acknowledge alarm. Down time: None.
5/21-22/2007	Pumphouse B4; ECV opened overnight; Perform maintenance on ECV control piping and reset pressure to 135 psi. Down time: None.
5/22/2007	Pumphouses B1, B2, B3, B4, B5 and B8; Set mouse traps and ant poison in the pumphouses to control mice and ants. Down time: None.
5/23/2007	Laughlin Electric installs new mini-breaker in pumphouse B6 control cabinet. Down time: None.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

5/23-25/2007	Treatment System; Laughlin Electric on site to inspect treatment center exhaust fans; Troubleshooting indicates new motors needed; Install new motors and normal operation resumes. Down time: None.
5/24/2007	Pumphouse B9; Light flashing on PLC in Building 116; Reset PLC and observe normal operation. Down time: 23 hours.
5/26/2007	Treatment System; Installed new pressure gauge on TGRS effluent forcemain. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
5/31/2007	Pumphouse B4; Light not on at PLC in Building 116; Reset PLC and pump did not restart; At pumphouse, reset starter and pump restarted normally. Down time: 7 hours.
June 2007	
6/2/2007	Pumphouses B13, B4, B8 and B9; Lights are off on PLC in Building 116; Attempt to reset PLC but the lights remain off; Trending does not indicate the pumps have shut off; Further troubleshooting indicates a fault with the input/output adapter communication cards; Replace cards in B13, B4 and B9. Down time: 20.5 hours at B4 and B8; 42 hours at B9 and 67.5 hours at B13.
6/7/2007	Pumphouse SC5; Power out to SC5; Xcel Energy on site to repair problem. Down time: 5.5 hours.
6/16-18/2007	Pumphouse B8; Pump will not pump water in "Auto"; I/O Adapter Fault; Removed failed I/O Adapter and replaced with new. Down time: 70 hours.
6/21, 27-28/2007	Pumphouse B4; Pump off on PLC at Building 116; Attempt to reset the PLC but light remains off; Upon further inspection, starter is tripped in control panel at pumphouse; Reset starter and observe normal operation. Down time: 19 hours.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

6/26/2007	Pumphouse SC2; Cold water flow meter ceased to total volume of water; Replaced with new and adjusted previous days flow rates to 25 gpm; New meter in at 14:26 at 1500 gallons. Down time: None.
July 2007	
7/3/2007	Treatment System; ECV 3 would not close on command; Changed filter and flushed control piping and observed normal operation. Down time: None.
7/2-7/2007	Pumphouse B4; Pump off on arrival several days during this period; Reset starter and pump restarted normally; On 7/6/2007, starter would not reset; Laughlin Electric on Site to replace heaters; Restarted pump, checked amps all legs and observed normal operation. Down time: 20 hours total for the period.
7/6/2007	Treatment System; ECV 3 will not close on command; Changed filter, flushed control piping and adjusted opening and closing speed valves; Cycled valve on and off several times and observed normal operation. Down time: B3 for 1 hour.
7/8-9/2007	Treatment System; Call from Time Communication-TGRS fail; ECV 3 will not open on command; Flushed control piping and adjusted opening and closing speed valves; Cycled valve on and off several times and observed normal operation. Down time: B13 for 1.6 hours.
7/9/2007	Pumphouse B3; Pump will not turn on in "Auto" but will turn on in "Hand"; The control panel low level light is on; Secure water level sensor jumper and adjust opening and closing speed valves; Flush ECV control piping and adjust pilot; Observe normal operation. Down time: 8 hours.
7/16/2007	Pumphouse B6; Light flashing on PLC in Building 116; Reset PLC and B6 light came on back on normally. Down time: 9.5 hours.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

7/17/2007	Pumphouse B3; Piece of riser check valve and pin stuck in inlet of flow meter. Removed and cleaned meter. Down time: 3 hours.
7/17/2007	Pumphouse B4; Removed and cleaned flow meter. Down time: None.
7/22/2007	Water Tower; Water level at 36 feet; Opened recycle valve and drained tower to 32'. Down time: None.
7/26/2007	Treatment System; Call out from Time Communications: TGRS Fail; ECV3 would not open on command; Changed filter, flushed control piping and adjusted opening and closing speed valves; Cycled valve on and off several times and observed normal operation. Down time: 1.5 hours at B3 and 2.5 hours at B8.
August 2007	
8/1/2007	Treatment System; Remove demister pads from towers 3 and 4; Inspect treatment center roof for areas of leakage; Prepare to drill drain holes in treatment center floor. Down time: None.
8/3 & 6/2007	Treatment System; Drill holes in concrete floor to drain standing water. Down time: None.
8/11-12/2007	Pumphouses B3, SC5, B6 and B9; Power outage to the pumps due to the storm last night; Reset the PLC and B3, SC5 and B6 relit and restarted normally; B9, however remained off; At pumphouse, cycled power to the communication cards and then restarted B9. Down time: B3 for 1 hour, SC5 for 6.5 hours, B6 for 5 hours and B9 for 37 hours.
8/14/2007	Water Tower; Storm last night knocked out communication between the PLC in the altitude valve vault and the PLC at Building 116; Reset both PLCs and communication was restored. Down time: None.
8/17/2007	Pumphouse B13; Replaced cold water flow meter with new; Old one out at 25923500, new one in at 61735200. Down time: None.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

8/20-21/2007	Treatment System; Install new potable water line to assist ECVs 1 and 2 in closing; Source of water from downstream side of ECV 3. Down time: None.
8/22-23/2007	Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration. Down time: None.
8/27/2007	Pumphouses B3, B4, B8, B9 and B11; Lights are off on PLC in Building 116; Attempt to reset PLC but lights remain off; Drive to pumphouses and begin troubleshooting; Troubleshooting indicates that last nights storm short circuited the I/O adapter cards at B4 and B8 (which are paired with B3 and B11) ; Replaced the I/O adapter cards at B4 and B8 and restarted the pumphouses normally. Down time: 12 hours at B3, 11 hours at B4 and 13 hours at B8.
8/28/2007	Pumphouse B4; Installed a new operating solenoid valve, flushed control piping and reset pump forcemain pressure to 125 psi. Down time: 1.5 hours.
8/30/2007	Pumphouse B1; Stevens Well Company mobilized 3,000 gallon water tank on site to prepare for redevelopment work scheduled to begin on September 10, 2007. Down time: None.
8/30/2007	Pumphouse B6; Changed out cold water flow meter with new; Old meter out at 94865000 and new meter in at 91869800 all at 12:50 PM. Down time: None.
8/30/2007	Pumphouse B13; Pumping water level is at 120.1 ft btoc. Down time: None.
8/30/2007	Pumphouse B11; Pumping water level is at 122.7 ft btoc. Down time: None.

APPENDIX F-2

MAINTENANCE ACTIVITIES
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

September 2007

9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/7-18/2007	Pumphouse B1; Redevelop well using acid, chlorine and surging methods. Down time: 203 hours.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.
9/21/2007	Treatment System: Remove the influent pressure gauge and sample port from the compressor room in Building 116 to the tower 2 influent line in the treatment center. Down time: None, the system was already down to install a blind flange in the altitude valve vault.
9/21/2007	Treatment System; Applied traction adhesive to the tops of the air stripping towers for safety purposes. Down time: None, the system was already down to install a blind flange in the altitude valve vault.
9/24/2007	Snelling Avenue Valve; Bled all of the water off the top of the valve and closed the control piping ball valves to maintain the valve in the fully open position. Down time: None.
9/24/2007	Treatment Center; Laughlin Electric on Site to install three 5000 watt electric heaters; Two installed in the treatment center and one installed in the work bench room. Down time: None.
9/26/2007	Treatment System: Removed airflow measurement banks from each of the four air stripping towers; Cleaned and repaired the banks and reinstalled them. Down time: None.
9/30/2007	Pumphouse B8; Pump is showing signs of wearing down; Schedule pump replacement. Down time: 3.5 hours.

F.3 Maintenance Activities by Location, Fiscal Year 2007, TGRS, TCAAP

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Pumphouse B1

11/29/2006	Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem. Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.
1/17/2006	Pumphouse B1; Changed out flow meter with new; Old one out at 94549900 and new one in at 34445000 at 16:30. Down time: None.
2/15/2007	Treatment System; Call out from Time Communication-"TGRS Fail"; Upon arrival, ECV will not open on command; Change filter, flush control piping, adjust speed control valves but valve still will not open; Replace pilot with new, adjust opening and closing speed control valves and cycle valve several times; Normal operation observed. Down time: 2 hours at B1 and B13.
2/24-27/2007	Pumphouse B1; Failed cold water flow meter; Replace with new and adjust flow rates for each day to what they would have been if the flow meter hadn't failed. Down time: None.
3/13/2007	Treatment System; Gland packing at pump1 is leaking; Replaced gland packing with new. Down time: 2.5 hours at B1 and B13.
3/25-26/07	Pumphouses B1, B13, B3 and B11; Panel lights for B1, B13, B3 and B11 are off on PLC in Building 116; At power pole between pumphouses B2 and B3, all three fusible switches are open and the crossarm on the pole is burnt; Contact and schedule Xcel Energy to repair on 3/26/2007. Down time: 38.5 hours at B1, B13 and B3 and 24 hours at B11.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/22/2007	Pumphouses B1, B2, B3, B4, B5 and B8; Set mouse traps and ant poison in the pumphouses to control mice and ants. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

8/22-23/2007	Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration. Down time: None.
8/30/2007	Pumphouse B1; Stevens Well Company mobilized 3,000 gallon water tank on site to prepare for redevelopment work scheduled to begin on September 10, 2007. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/7-18/2007	Pumphouse B1; Redevelop well using acid, chlorine and surging methods. Down time: 203 hours.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.

Pumphouse B3

10/3-5/2006	Treatment System; Turned off Pump 2 in the treatment center to dry out water distribution system at the top of tower 2; Turned off several wells to minimize well field cycling. Down time: 2.5 hours at B6; 53 hours at B11 and SC2; 58 hours at B3, B8 and B9.
10/24/2006	Treatment System; Wet well pump 2 float switch will not activate; Perform repairs and observe normal operation. Down time: 6 hours at B3 and B4; 2 hours at B6.
10/30-31/2006	Water Tower, Well Field and Treatment System; Increased pressure at Snelling Avenue Valve to overflow the water tower; Following water tower flushing, the Snelling Avenue Valve was re-adjusted but the pressure did not decrease resulting in the well field cycling overnight. Down time: B6 for 2 hours; B3 for 6 hours and B4 for 4 hours.
11/6/2006	Treatment System; ECV 4 will not close and likely has a failed seal inside the valve; Open the valve, remove the piston, remove manganese and iron scale from the piston, valve body and cover plate; Replace the old valve seals with new. Down time: B13 for 10 hours, B3 for 5 hours, B8 for 4 hours and B9 for 3 hours.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

11/7/2006	Treatment System; Following seal replacement work at ECV 4, incorrectly adjusted control piping valves so the valve would not open all the way on command; Well field cycled overnight; Re-adjusted control piping and observed normal operation. Down time: 9 hours at B13, 4.5 hours at B3, 3 hours at B8 and 2 hours at B9.
11/29/2006	Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem. Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.
12/21/2006	Pumphouse B3; Removed a piece of metal from the inlet to the flow meter; Reinstalled the meter and observed normal operation. Down time: None.
1/14/2007	Snelling Avenue Valve; High pressure at valve causes well field to cycle; Adjust pilot to lower the pressure. Down time: B13, B11 and SC1 for 22 hours each; B3 and B8 for 20 hours each and B4 and B6 for 18 hours each.
3/25-26/07	Pumphouses B1, B13, B3 and B11; Panel lights for B1, B13, B3 and B11 are off on PLC in Building 116; At power pole between pumphouses B2 and B3, all three fusible switches are open and the crossarm on the pole is burnt; Contact and schedule Xcel Energy to repair on 3/26/2007. Down time: 38.5 hours at B1, B13 and B3 and 24 hours at B11.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/22/2007	Pumphouses B1, B2, B3, B4, B5 and B8; Set mouse traps and ant poison in the pumphouses to control mice and ants. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
7/6/2007	Treatment System; ECV 3 will not close on command; Changed filter, flushed control piping and adjusted opening and closing speed valves; Cycled valve on and off several times and observed normal operation. Down time: B3 for 1 hour.
7/9/2007	Pumphouse B3; Pump will not turn on in "Auto" but will turn on in "Hand"; The control panel low level light is on; Secure water level sensor jumper and adjust opening and closing speed valves; Flush ECV control piping and adjust pilot; Observe normal operation.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

	Down time: 8 hours.
7/17/2007	Pumphouse B3; Piece of riser check valve and pin stuck in inlet of flow meter. Removed and cleaned meter. Down time: 3 hours.
7/26/2007	Treatment System; Call out from Time Communications: TGRS Fail; ECV3 would not open on command; Changed filter, flushed control piping and adjusted opening and closing speed valves; Cycled valve on and off several times and observed normal operation. Down time: 1.5 hours at B3 and 2.5 hours at B8.
8/11-12/2007	Pumphouses B3, SC5, B6 and B9; Power outage to the pumps due to the storm last night; Reset the PLC and B3, SC5 and B6 relit and restarted normally; B9, however remained off; At pumphouse, cycled power to the communication cards and then restarted B9. Down time: B3 for 1 hour, SC5 for 6.5 hours, B6 for 5 hours and B9 for 37 hours.
8/22-23/2007	Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration. Down time: None.
8/27/2007	Pumphouses B3, B4, B8, B9 and B11; Lights are off on PLC in Building 116; Attempt to reset PLC but lights remain off; Drive to pumphouses and begin troubleshooting; Troubleshooting indicates that last nights storm short circuited the I/O adapter cards at B4 and B8 (which are paired with B3 and B11) ; Replaced the I/O adapter cards at B4 and B8 and restarted the pumphouses normally. Down time: 12 hours at B3, 11 hours at B4 and 13 hours at B8.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.

Pumphouse B4

10/11/2006	Pumphouse B4; Pump is off; Starter coil is tripped; Reset at control panel and observed normal operation. Down time: 15 hours.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

10/24/2006	Treatment System; Wet well pump 2 float switch will not activate; Perform repairs and observe normal operation. Down time: 6 hours at B3 and B4; 2 hours at B6.
10/30-31/2006	Water Tower, Well Field and Treatment System; Increased pressure at Snelling Avenue Valve to overflow the water tower; Following water tower flushing, the Snelling Avenue Valve was re-adjusted but the pressure did not decrease resulting in the well field cycling overnight. Down time: B6 for 2 hours; B3 for 6 hours and B4 for 4 hours.
11/16/2006	Snelling Avenue Valve; Pressure is too high causing the well field to cycle; Decrease the pressure to 32 psi and observe normal operation. Down time: B13 and B4 for 2 hours each.
11/28/2006	Treatment System; Turned the TGRS off to investigate why the filter to ECV 3 is becoming plugged with very fine sediment more quickly than usual; Installed a filter over the discharge of the recycle valve in wet well 3 and observed no evidence of sediment. Down time: 1.5 hours at B4.
11/29/2006	Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem. Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.
1/14/2007	Snelling Avenue Valve; High pressure at valve causes well field to cycle; Adjust pilot to lower the pressure. Down time: B13, B11 and SC1 for 22 hours each; B3 and B8 for 20 hours each and B4 and B6 for 18 hours each.
2/2/2007	Pumphouse B4; Laughlin Electric removed old electrical wire and installed new number 6 wire from well head to control panel. Down time: None.
2/12/2007	Pumphouse B4; T. L. Stevens Well Company on site to replace the pump and motor with new. Down time: 2 hours.
2/15/2007	Pumphouse B4; Increased the forcemain pressure to decrease the flow rate to approximately 210 gpm. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

3/12/2007	Pumphouse B4; Pumphouse forcemain pressure is too high; ECV not responding to pilot adjustment; Flush control piping, clean strainer screen and adjust speed control valves; Reset pressure and normal operation resumes. Down time: 3 hours.
5/7-8/2007	Pumphouses B4, B5, B6, B8 and B9; Power outage to pumphouses; Smoke odor coming from inside the control panel in each pumphouse; Some pumphouses still have 110 volt power; Contacted Xcel Energy to respond. Down time: B4, B5, B6, B8 and B9 for 23 hours each.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/21-22/2007	Pumphouse B4; ECV opened overnight; Perform maintenance on ECV control piping and reset pressure to 135 psi. Down time: None.
5/22/2007	Pumphouses B1, B2, B3, B4, B5 and B8; Set mouse traps and ant poison in the pumphouses to control mice and ants. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
5/31/2007	Pumphouse B4; Light not on at PLC in Building 116; Reset PLC and pump did not restart; At pumphouse, reset starter and pump restarted normally. Down time: 7 hours.
6/2/2007	Pumphouses B13, B4, B8 and B9; Lights are off on PLC in Building 116; Attempt to reset PLC but the lights remain off; Trending does not indicate the pumps have shut off; Further troubleshooting indicates a fault with the input/output adapter communication cards; Replace cards in B13, B4 and B9. Down time: 20.5 hours at B4 and B8; 42 hours at B9 and 67.5 hours at B13.
6/21, 27-28/2007	Pumphouse B4; Pump off on PLC at Building 116; Attempt to reset the PLC but light remains off; Upon further inspection, starter is tripped in control panel at pumphouse; Reset starter and observe normal operation. Down time: 19 hours.
7/2-7/2007	Pumphouse B4; Pump off on arrival several days during this period; Reset starter and pump restarted normally; On 7/6/2007, starter would not reset; Laughlin Electric on Site to replace heaters; Restarted pump, checked amps all legs and observed normal operation.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Down time: 20 hours total for the period.

7/17/2007 Pumphouse B4; Removed and cleaned flow meter.
Down time: None.

8/22-23/2007 Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration.
Down time: None.

8/27/2007 Pumphouses B3, B4, B8, B9 and B11; Lights are off on PLC in Building 116; Attempt to reset PLC but lights remain off; Drive to pumphouses and begin troubleshooting; Troubleshooting indicates that last nights storm short circuited the I/O adapter cards at B4 and B8 (which are paired with B3 and B11) ; Replaced the I/O adapter cards at B4 and B8 and restarted the pumphouses normally.
Down time: 12 hours at B3, 11 hours at B4 and 13 hours at B8.

8/28/2007 Pumphouse B4; Installed a new operating solenoid valve, flushed control piping and reset pump forcemain pressure to 125 psi.
Down time: 1.5 hours.

9/3/2007 The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th.
Down time: None.

9/21/2007 Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve.
Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.

Pumphouse B5

11/29/2006 Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem.
Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.

1/25/2007 Pumphouse B5; Changed out flow meter with new; Old one out at 61653500 and new one in at 88759800 at 13:40.
Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

5/7-8/2007	Pumphouses B4, B5, B6, B8 and B9; Power outage to pumphouses; Smoke odor coming from inside the control panel in each pumphouse; Some pumphouses still have 110 volt power; Contacted Xcel Energy to respond. Down time: B4, B5, B6, B8 and B9 for 23 hours each.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/22/2007	Pumphouses B1, B2, B3, B4, B5 and B8; Set mouse traps and ant poison in the pumphouses to control mice and ants. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
8/22-23/2007	Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.

Pumphouse B6

10/3-5/2006	Treatment System; Turned off Pump 2 in the treatment center to dry out water distribution system at the top of tower 2; Turned off several wells to minimize well field cycling. Down time: 2.5 hours at B6; 53 hours at B11 and SC2; 58 hours at B3, B8 and B9.
10/24/2006	Treatment System; Wet well pump 2 float switch will not activate; Perform repairs and observe normal operation. Down time: 6 hours at B3 and B4; 2 hours at B6.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

10/30-31/2006	Water Tower, Well Field and Treatment System; Increased pressure at Snelling Avenue Valve to overflow the water tower; Following water tower flushing, the Snelling Avenue Valve was re-adjusted but the pressure did not decrease resulting in the well field cycling overnight. Down time: B6 for 2 hours; B3 for 6 hours and B4 for 4 hours.
11/29/2006	Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem. Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.
1/14/2007	Snelling Avenue Valve; High pressure at valve causes well field to cycle; Adjust pilot to lower the pressure. Down time: B13, B11 and SC1 for 22 hours each; B3 and B8 for 20 hours each and B4 and B6 for 18 hours each.
5/7-8/2007	Pumphouses B4, B5, B6, B8 and B9; Power outage to pumphouses; Smoke odor coming from inside the control panel in each pumphouse; Some pumphouses still have 110 volt power; Contacted Xcel Energy to respond. Down time: B4, B5, B6, B8 and B9 for 23 hours each.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/23/2007	Laughlin Electric installs new mini-breaker in pumphouse B6 control cabinet. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
7/16/2007	Pumphouse B6; Light flashing on PLC in Building 116; Reset PLC and B6 light came on back on normally. Down time: 9.5 hours.
8/11-12/2007	Pumphouses B3, SC5, B6 and B9; Power outage to the pumps due to the storm last night; Reset the PLC and B3, SC5 and B6 relit and restarted normally; B9, however remained off; At pumphouse, cycled power to the communication cards and then restarted B9. Down time: B3 for 1 hour, SC5 for 6.5 hours, B6 for 5 hours and B9 for 37 hours.
8/22-23/2007	Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

8/30/2007	Pumphouse B6; Changed out cold water flow meter with new; Old meter out at 94865000 and new meter in at 91869800 all at 12:50 PM. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.

Pumphouse B8

10/3-5/2006	Treatment System; Turned off Pump 2 in the treatment center to dry out water distribution system at the top of tower 2; Turned off several wells to minimize well field cycling. Down time: 2.5 hours at B6; 53 hours at B11 and SC2; 58 hours at B3, B8 and B9.
11/6/2006	Treatment System; ECV 4 will not close and likely has a failed seal inside the valve; Open the valve, remove the piston, remove manganese and iron scale from the piston, valve body and cover plate; Replace the old valve seals with new. Down time: B13 for 10 hours, B3 for 5 hours, B8 for 4 hours and B9 for 3 hours.
11/7/2006	Treatment System; Following seal replacement work at ECV 4, incorrectly adjusted control piping valves so the valve would not open all the way on command; Well field cycled overnight; Re-adjusted control piping and observed normal operation. Down time: 9 hours at B13, 4.5 hours at B3, 3 hours at B8 and 2 hours at B9.
11/29/2006	Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem. Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.
1/14/2007	Snelling Avenue Valve; High pressure at valve causes well field to cycle; Adjust pilot to lower the pressure. Down time: B13, B11 and SC1 for 22 hours each; B3 and B8 for 20 hours each and B4 and B6 for 18 hours each.
5/7-8/2007	Pumphouses B4, B5, B6, B8 and B9; Power outage to pumphouses; Smoke odor coming from inside the control panel in each pumphouse; Some pumphouses still have 110 volt power; Contacted Xcel Energy to respond.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

	Down time: B4, B5, B6, B8 and B9 for 23 hours each.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/22/2007	Pumphouses B1, B2, B3, B4, B5 and B8; Set mouse traps and ant poison in the pumphouses to control mice and ants. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
6/2/2007	Pumphouses B13, B4, B8 and B9; Lights are off on PLC in Building 116; Attempt to reset PLC but the lights remain off; Trending does not indicate the pumps have shut off; Further troubleshooting indicates a fault with the input/output adapter communication cards; Replace cards in B13, B4 and B9. Down time: 20.5 hours at B4 and B8; 42 hours at B9 and 67.5 hours at B13.
6/16-18/2007	Pumphouse B8; Pump will not pump water in "Auto"; I/O Adapter Fault; Removed failed I/O Adapter and replaced with new. Down time: 70 hours.
7/26/2007	Treatment System; Call out from Time Communications: TGRS Fail; ECV3 would not open on command; Changed filter, flushed control piping and adjusted opening and closing speed valves; Cycled valve on and off several times and observed normal operation. Down time: 1.5 hours at B3 and 2.5 hours at B8.
8/22-23/2007	Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration. Down time: None.
8/27/2007	Pumphouses B3, B4, B8, B9 and B11; Lights are off on PLC in Building 116; Attempt to reset PLC but lights remain off; Drive to pumphouses and begin troubleshooting; Troubleshooting indicates that last nights storm short circuited the I/O adapter cards at B4 and B8 (which are paired with B3 and B11) ; Replaced the I/O adapter cards at B4 and B8 and restarted the pumphouses normally. Down time: 12 hours at B3, 11 hours at B4 and 13 hours at B8.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.
9/30/2007	Pumphouse B8; Pump is showing signs of wearing down; Schedule pump replacement. Down time: 3.5 hours.

Pumphouse B9

10/3-5/2006	Treatment System; Turned off Pump 2 in the treatment center to dry out water distribution system at the top of tower 2; Turned off several wells to minimize well field cycling. Down time: 2.5 hours at B6; 53 hours at B11 and SC2; 58 hours at B3, B8 and B9.
11/6/2006	Treatment System; ECV 4 will not close and likely has a failed seal inside the valve; Open the valve, remove the piston, remove manganese and iron scale from the piston, valve body and cover plate; Replace the old valve seals with new. Down time: B13 for 10 hours, B3 for 5 hours, B8 for 4 hours and B9 for 3 hours.
11/7/2006	Treatment System; Following seal replacement work at ECV 4, incorrectly adjusted control piping valves so the valve would not open all the way on command; Well field cycled overnight; Re-adjusted control piping and observed normal operation. Down time: 9 hours at B13, 4.5 hours at B3, 3 hours at B8 and 2 hours at B9.
11/29/2006	Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem. Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.
12/16-18/2006	Pumphouse B9; No power to pumphouse; Xcel Energy called and finds the splice on the overhead line to the pumphouse is in poor condition; They repair the splice and power to B9 is restored. Down time: 46.5 hours.
5/7-8/2007	Pumphouses B4, B5, B6, B8 and B9; Power outage to pumphouses; Smoke odor coming from inside the control panel in each pumphouse; Some pumphouses still have 110 volt power; Contacted Xcel Energy to respond. Down time: B4, B5, B6, B8 and B9 for 23 hours each.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

5/24/2007	Pumphouse B9; Light flashing on PLC in Building 116; Reset PLC and observe normal operation. Down time: 23 hours.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
6/2/2007	Pumphouses B13, B4, B8 and B9; Lights are off on PLC in Building 116; Attempt to reset PLC but the lights remain off; Trending does not indicate the pumps have shut off; Further troubleshooting indicates a fault with the input/output adapter communication cards; Replace cards in B13, B4 and B9. Down time: 20.5 hours at B4 and B8; 42 hours at B9 and 67.5 hours at B13.
8/11-12/2007	Pumphouses B3, SC5, B6 and B9; Power outage to the pumps due to the storm last night; Reset the PLC and B3, SC5 and B6 relit and restarted normally; B9, however remained off; At pumphouse, cycled power to the communication cards and then restarted B9. Down time: B3 for 1 hour, SC5 for 6.5 hours, B6 for 5 hours and B9 for 37 hours.
8/22-23/2007	Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration. Down time: None.
8/27/2007	Pumphouses B3, B4, B8, B9 and B11; Lights are off on PLC in Building 116; Attempt to reset PLC but lights remain off; Drive to pumphouses and begin troubleshooting; Troubleshooting indicates that last nights storm short circuited the I/O adapter cards at B4 and B8 (which are paired with B3 and B11) ; Replaced the I/O adapter cards at B4 and B8 and restarted the pumphouses normally. Down time: 12 hours at B3, 11 hours at B4 and 13 hours at B8.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.

Pumphouse B11

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

10/3-5/2006	Treatment System; Turned off Pump 2 in the treatment center to dry out water distribution system at the top of tower 2; Turned off several wells to minimize well field cycling. Down time: 2.5 hours at B6; 53 hours at B11 and SC2; 58 hours at B3, B8 and B9.
10/29/2006	Pumphouse B11; Pump will not pump water; Motor draws approximately 14 amps; Likely a failed pump end. October down time: 30.5 hours.
10/30-11/7/2006	Pumphouse B11; Pump will not pump water; Motor is pulling 14 amps so it is likely a failed pump (wet end); Remove lift system and replace the pump, motor, check valve and one length of drop pipe. November Down time: 168 hours.
11/29/2006	Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem. Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.
12/13/2006	Pumphouse B11; Opened a section of fenceline near B11 to shorten the time duration of the daily inspections. Down time: None.
1/14/2007	Snelling Avenue Valve; High pressure at valve causes well field to cycle; Adjust pilot to lower the pressure. Down time: B13, B11 and SC1 for 22 hours each; B3 and B8 for 20 hours each and B4 and B6 for 18 hours each.
2/17/2007	Pumphouse B11; Light flashing on PLC in Building 116; Reset PLC and B11 relit normally. Down time: 20 hours.
3/25-26/07	Pumphouses B1, B13, B3 and B11; Panel lights for B1, B13, B3 and B11 are off on PLC in Building 116; At power pole between pumphouses B2 and B3, all three fusible switches are open and the crossarm on the pole is burnt; Contact and schedule Xcel Energy to repair on 3/26/2007. Down time: 38.5 hours at B1, B13 and B3 and 24 hours at B11.
3/26/2007	Pumphouse B11; ECV not responding to pilot adjustment; Flush control piping, clean strainer screen, adjust speed control valves and change out pilot; Normal operation observed. Down time: None.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
8/22-23/2007	Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration. Down time: None.
8/27/2007	Pumphouses B3, B4, B8, B9 and B11; Lights are off on PLC in Building 116; Attempt to reset PLC but lights remain off; Drive to pumphouses and begin troubleshooting; Troubleshooting indicates that last nights storm short circuited the I/O adapter cards at B4 and B8 (which are paired with B3 and B11) ; Replaced the I/O adapter cards at B4 and B8 and restarted the pumphouses normally. Down time: 12 hours at B3, 11 hours at B4 and 13 hours at B8.
8/30/2007	Pumphouse B11; Pumping water level is at 122.7 ft btoc. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.

Pumphouse B13

11/6/2006	Treatment System; ECV 4 will not close and likely has a failed seal inside the valve; Open the valve, remove the piston, remove manganese and iron scale from the piston, valve body and cover plate; Replace the old valve seals with new. Down time: B13 for 10 hours, B3 for 5 hours, B8 for 4 hours and B9 for 3 hours.
11/7/2006	Treatment System; Following seal replacement work at ECV 4, incorrectly adjusted control piping valves so the valve would not open all the way on command; Well field cycled overnight; Re-adjusted control piping and observed normal operation. Down time: 9 hours at B13, 4.5 hours at B3, 3 hours at B8 and 2 hours at B9.
11/16/2006	Snelling Avenue Valve; Pressure is too high causing the well field to cycle; Decrease the pressure to 32 psi and observe normal operation.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

	Down time: B13 and B4 for 2 hours each.
11/29/2006	Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem. Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.
1/14/2007	Snelling Avenue Valve; High pressure at valve causes well field to cycle; Adjust pilot to lower the pressure. Down time: B13, B11 and SC1 for 22 hours each; B3 and B8 for 20 hours each and B4 and B6 for 18 hours each.
2/15/2007	Treatment System; Call out from Time Communication-"TGRS Fail"; Upon arrival, ECV will not open on command; Change filter, flush control piping, adjust speed control valves but valve still will not open; Replace pilot with new, adjust opening and closing speed control valves and cycle valve several times; Normal operation observed. Down time: 2 hours at B1 and B13.
3/13/2007	Treatment System; Gland packing at pump1 is leaking; Replaced gland packing with new. Down time: 2.5 hours at B1 and B13.
3/19/2007	Pumphouse B13; Pump and motor are failing; Replaced with new. Down time: 3 hours.
3/25-26/07	Pumphouses B1, B13, B3 and B11; Panel lights for B1, B13, B3 and B11 are off on PLC in Building 116; At power pole between pumphouses B2 and B3, all three fusible switches are open and the crossarm on the pole is burnt; Contact and schedule Xcel Energy to repair on 3/26/2007. Down time: 38.5 hours at B1, B13 and B3 and 24 hours at B11.
4/27/2007	Treatment System; Call from Time Communication-TGRS fail; Upon arrival, ECV 3 failed to open on command; Acid washed operating solenoid valve; Cycled valve and observed normal operation. Down time: 1 hour at B13.
5/1/2007	Treatment System; Call from Time Communcations-TGRS Fail; Upon arrival, ECV 3 would not open on command; Change filter, flush control piping, adjust open and closing speed control valves and problem persists; Replace operating solenoid with new; Cycle valve three times and observe normal operation. Down time: B13 for 1 hour.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

5/22/2007	Pumphouses B1, B2, B3, B4, B5 and B8; Set mouse traps and ant poison in the pumphouses to control mice and ants. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
6/2/2007	Pumphouses B13, B4, B8 and B9; Lights are off on PLC in Building 116; Attempt to reset PLC but the lights remain off; Trending does not indicate the pumps have shut off; Further troubleshooting indicates a fault with the input/output adapter communication cards; Replace cards in B13, B4 and B9. Down time: 20.5 hours at B4 and B8; 42 hours at B9 and 67.5 hours at B13.
7/8-9/2007	Treatment System; Call from Time Communication-TGRS fail; ECV 3 will not open on command; Flushed control piping and adjusted opening and closing speed valves; Cycled valve on and off several times and observed normal operation. Down time: B13 for 1.6 hours.
8/17/2007	Pumphouse B13; Replaced cold water flow meter with new; Old one out at 25923500, new one in at 61735200. Down time: None.
8/30/2007	Pumphouse B13; Pumping water level is at 120.1 ft btoc. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.

Pumphouse SC1

12/12/2006	Pumphouse SC1; Xcel Energy on site to investigate new way to bring power to SC1 after power is discontinued to Building 502. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

1/14/2007	Snelling Avenue Valve; High pressure at valve causes well field to cycle; Adjust pilot to lower the pressure. Down time: B13, B11 and SC1 for 22 hours each; B3 and B8 for 20 hours each and B4 and B6 for 18 hours each.
4/3-12/2007	Pumphouse SC1; Xcel Energy turns off power to Building 502 which turns off power to pumphouse; Xcel Energy installs 2 new power poles and a 3 transformer bank on the power pole nearest Building 960/SC1 pumphouse to provide a new source of power to SC1; They energize the new connection and Laughlin Electric on Site to wire proper rotation. Down time: 212 hours.
4/16/2007	Pumphouse SC1; Installed a new pressure gauge on pump discharge piping. Down time: None.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.

Pumphouse SC2

10/3-5/2006	Treatment System; Turned off Pump 2 in the treatment center to dry out water distribution system at the top of tower 2; Turned off several wells to minimize well field cycling. Down time: 2.5 hours at B6; 53 hours at B11 and SC2; 58 hours at B3, B8 and B9.
10/11-25/2006	Pumphouses SC2 and SC5; Communication failure between pumphouses and PLC in Building 116; Hans Halpern on site to troubleshoot; No continuity found between pumphouses and Building 116; Inspection of communication cable in hand hole finds the cables have been severed most likely by a rodent chewing threw them; Laughlin Electric splices the communication lines and normal operation resumes. Down time: 276 hours at SC2 and SC5
11/14-22/2006	Pumphouse SC2; Remove lift system, acid treat, brush and surge well screen and riser to re-develop well. Down time: 189 hours.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
6/26/2007	Pumphouse SC2; Cold water flow meter ceased to total volume of water; Replaced with new and adjusted previous days flow rates to 25 gpm; New meter in at 14:26 at 1500 gallons. Down time: None.
8/22-23/2007	Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.

Pumphouse SC3

10/26/2006	Laughlin Electric on site to install a new heater in pumphouse SC3. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.

Pumphouse SC5

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

9/29-10/3/2006	Pumphouse SC5; ECV will not open without emergency shut down solenoid energized; Wire emergency shut down solenoid and observe normal operation. October down time: 71 hours.
10/11-25/2006	Pumphouses SC2 and SC5; Communication failure between pumphouses and PLC in Building 116; Hans Halpern on site to troubleshoot; No continuity found between pumphouses and Building 116; Inspection of communication cable in hand hole finds the cables have been severed most likely by a rodent chewing threw them; Laughlin Electric splices the communication lines and normal operation resumes. Down time: 276 hours at SC2 and SC5
1/29-31/2007	Pumphouse SC5; Active light is flickering on I/O Adapter module; Laughlin Electric to troubleshoot; Troubleshooting indicates a faulty water level control board in pumphouse SC5; Changed out water level board and observed normal operation. January Down time: 52.5 hours.
1/30-2/1/2007	Pumphouse SC5; Pump will not pump water in "Auto" but will pump water in "Hand" indicating a communication problem; Switch out I/O Adapter, Input and Output cards but pump will not start; Inspect recently spliced cables in hand hole and they look good; Change out water level control board in pumphouse and pump restarts normally. February Down time: 26 hours.
3/22/2007	Pumphouse SC5; The ECV is all the way open indicating the control piping requires maintenance; Clean strainer screen, adjust opening and closing speeds and flush control piping. Down time: None.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
6/7/2007	Pumphouse SC5; Power out to SC5; Xcel Energy on site to repair problem. Down time: 5.5 hours.
8/11-12/2007	Pumphouses B3, SC5, B6 and B9; Power outage to the pumps due to the storm last night; Reset the PLC and B3, SC5 and B6 relit and restarted normally; B9, however remained off; At pumphouse, cycled power to the communication cards and then restarted B9. Down time: B3 for 1 hour, SC5 for 6.5 hours, B6 for 5 hours and B9 for 37 hours.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

8/22-23/2007	Pumphouses B1, B3, B4, B5, B6, B8, B9, B11, SC2 and SC5; Compared existing flow meter readings with a calibrated flow meter and replaced flow meters that were out of calibration. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.

TREATMENT SYSTEM

10/3-5/2006	Treatment System; Turned off Pump 2 in the treatment center to dry out water distribution system at the top of tower 2; Turned off several wells to minimize well field cycling. Down time: 2.5 hours at B6; 53 hours at B11 and SC2; 58 hours at B3, B8 and B9.
10/24/2006	Treatment System; Wet well pump 2 float switch will not activate; Perform repairs and observe normal operation. Down time: 6 hours at B3 and B4; 2 hours at B6.
10/30-31/2006	Water Tower, Well Field and Treatment System; Increased pressure at Snelling Avenue Valve to overflow the water tower; Following water tower flushing, the Snelling Avenue Valve was re-adjusted but the pressure did not decrease resulting in the well field cycling overnight. Down time: B6 for 2 hours; B3 for 6 hours and B4 for 4 hours.
11/6/2006	Treatment System; ECV 4 will not close and likely has a failed seal inside the valve; Open the valve, remove the piston, remove manganese and iron scale from the piston, valve body and cover plate; Replace the old valve seals with new. Down time: B13 for 10 hours, B3 for 5 hours, B8 for 4 hours and B9 for 3 hours.
11/7/2006	Treatment System; Following seal replacement work at ECV 4, incorrectly adjusted control piping valves so the valve would not open all the way on command; Well field cycled overnight; Re-adjusted control piping and observed normal operation. Down time: 9 hours at B13, 4.5 hours at B3, 3 hours at B8 and 2 hours at B9.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

11/24/2006	Treatment System; Call from Time Communications, "TGRS fail"; ECV 3 failed to open, reset, adjusted open control valve, changed filter and flushed pipes; Cycled valve and observed normal operation. Down time: None.
11/27/2006	Treatment System; Replaced operating solenoid valve filter for ECV 3 control piping; Slight buildup noted. Down time: None.
11/28/2006	Treatment System; Turned the TGRS off to investigate why the filter to ECV 3 is becoming plugged with very fine sediment more quickly than usual; Installed a filter over the discharge of the recycle valve in wet well 3 and observed no evidence of sediment. Down time: 1.5 hours at B4.
11/29/2006	Treatment System and B1, B13, B3, B4, B5, B6, B8, B9 and B11; Power outage to boundary wells; Xcel Energy on Site and repairs problem. Down time: 2.5 hours at B1, B3, B6, B8 and B9; 4 hours at B13 and 4.5 hours at B4.
1/23/2007	Treatment System; ECV 3 will not close on command; Change filter, flush control piping, adjust speed control valves and cycle the valve several times; Normal operation observed. Down time: None.
2/15/2007	Treatment System; Call out from Time Communication-"TGRS Fail"; Upon arrival, ECV will not open on command; Change filter, flush control piping, adjust speed control valves but valve still will not open; Replace pilot with new, adjust opening and closing speed control valves and cycle valve several times; Normal operation observed. Down time: 2 hours at B1 and B13.
2/27/2007	Treatment System; ECV 4 would not close on command; Change filter, flush control piping, adjust speed control valves and observe normal operation. Down time: None.
3/13/2007	Treatment System; Gland packing at pump1 is leaking; Replaced gland packing with new. Down time: 2.5 hours at B1 and B13.
3/21/2007	Treatment System; Gland packing at pump 2 is leaking; Replaced gland packing with new. Down time: None.
4/11/2007	Treatment System; Installed a new type of packing in gland shaft to stop leaking at pump 2. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

4/27/2007	Treatment System; Call from Time Communication-TGRS fail; Upon arrival, ECV 3 failed to open on command; Acid washed operating solenoid valve; Cycled valve and observed normal operation. Down time: 1 hour at B13.
5/1/2007	Treatment System; Call from Time Communcations-TGRS Fail; Upon arrival, ECV 3 would not open on command; Change filter, flush control piping, adjust open and closing speed control valves and problem persists; Replace operating solenoid with new; Cycle valve three times and observe normal operation. Down time: B13 for 1 hour.
5/5/2007	Treatment System, Call from Time Communications; ECV 3 failed to open; Adjusted open speed valve and observed normal operation. Down time: None.
5/8-10/2007	TGRS; Laughlin performs annual electrical inspection on treatment system and pumphouses. Down time: None.
5/9/2007	Treatment System; Blower belt failed at blower 2; Replaced with new. Down time: None.
5/23-25/2007	Treatment System; Laughlin Electric on site to inspect treatment center exhaust fans; Troubleshooting indicates new motors needed; Install new motors and normal operation resumes. Down time: None.
5/26/2007	Treatment System; Installed new pressure gauge on TGRS effluent forcemain. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
7/3/2007	Treatment System; ECV 3 would not close on command; Changed filter and flushed control piping and observed normal operation. Down time: None.
7/6/2007	Treatment System; ECV 3 will not close on command; Changed filter, flushed control piping and adjusted opening and closing speed valves; Cycled valve on and off several times and observed normal operation. Down time: B3 for 1 hour.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

7/8-9/2007	Treatment System; Call from Time Communication-TGRS fail; ECV 3 will not open on command; Flushed control piping and adjusted opening and closing speed valves; Cycled valve on and off several times and observed normal operation. Down time: B13 for 1.6 hours.
7/26/2007	Treatment System; Call out from Time Communications: TGRS Fail; ECV3 would not open on command; Changed filter, flushed control piping and adjusted opening and closing speed valves; Cycled valve on and off several times and observed normal operation. Down time: 1.5 hours at B3 and 2.5 hours at B8.
8/1/2007	Treatment System; Remove demister pads from towers 3 and 4; Inspect treatment center roof for areas of leakage; Prepare to drill drain holes in treatment center floor. Down time: None.
8/3 & 6/2007	Treatment System; Drill holes in concrete floor to drain standing water. Down time: None.
8/20-21/2007	Treatment System; Install new potable water line to assist ECVs 1 and 2 in closing; Source of water from downstream side of ECV 3. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/21/2007	Treatment System: Remove the influent pressure gauge and sample port from the compressor room in Building 116 to the tower 2 influent line in the treatment center. Down time: None, the system was already down to install a blind flange in the altitude valve vault.
9/21/2007	Treatment System; Applied traction adhesive to the tops of the air stripping towers for safety purposes. Down time: None, the system was already down to install a blind flange in the altitude valve vault.
9/24/2007	Treatment Center; Laughlin Electric on Site to install three 5000 watt electric heaters; Two installed in the treatment center and one installed in the work bench room. Down time: None.
9/26/2007	Treatment System: Removed airflow measurement banks from each of the four air stripping towers; Cleaned and repaired the banks and reinstalled them. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

FORCEMAIN

10/30-31/2006	Water Tower, Well Field and Treatment System; Increased pressure at Snelling Avenue Valve to overflow the water tower; Following water tower flushing, the Snelling Avenue Valve was re-adjusted but the pressure did not decrease resulting in the well field cycling overnight. Down time: B6 for 2 hours; B3 for 6 hours and B4 for 4 hours.
11/3/2006	Altitude Valve; Call from Time Communications, "Altitude valve failed to open or close"; Troubleshooting indicates a communication error between the PLC in Building 116 and the PLC in the altitude valve vault. Reset the PLC and observed normal operation. Down time: None.
11/16/2006	Snelling Avenue Valve; Pressure is too high causing the well field to cycle; Decrease the pressure to 32 psi and observe normal operation. Down time: B13 and B4 for 2 hours each.
11/25/2006	Altitude Valve; Call from Time Communications; Drain fail, tower low, RTU 1 and 2 communication failure; Acknowledged alarms and increased the pressure at Snelling Avenue valve to increase the flow rate to the tower. Down time: None.
11/26/2006	Altitude Valve; RTU 1 and 2 communication fail; Tower did not dump since 10/25/2006; Switch to summer operation and notify Keres Consulting, Inc.. Down time: None.
12/11/2004	Snelling Avenue Valve; Low pressure at Snelling Avenue Valve, The valve will not allow the water tower to fill as quickly as necessary for winter operation; Clean strainer valve, flush control piping and adjust pilot; Pressure now at 32 psi and normal operation resumes. Down time: None.
12/14/2006	Recycle Valve; Call out from autodialer to Time Communications "Recycle valve fail"; Acknowledged alarm and reviewed the trending graph; Normal graph lines observed; Cycled the recycle valve and observed normal operation. Down time: None.
12/15/2006	Recycle Valve; The valve will not close on command; Cleaned manganese off of the inlet screen and cycled the valve several times; Normal operation observed. Down time: None.
1/8/2007	Altitude Valve; Call from Time Communication: Altitude valve fail; Communication failure with no current alarms, acknowledged Autodialer.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

	Down time: None.
1/8/2007	Recycle Valve; Call from Time Communications- Drain Fail light is lit; Upon arrival, the recycle valve operates normally but there is a communication error between the PLC in Building 116 and the PLC in the altitude valve vault; Contact Keres Consulting and switch to summer operation for the night; Keres resets communications and normal operation resumes. Down time: None.
1/13-18/2007	Recycle valve; Drain fail; Intermittent alarms and autodialer call outs during this time period; Cycled altitude valve and recycle valve several times then reset PLC and autodialer, but during the next elevated tank fill cycle, the alarm and call out would reoccur; Flushed the control piping, changed out strainer screens and increased the pressure at the Snelling Avenue Valve to 32 psi; Normal operation resumed. Down time: None.
1/14/2007	Snelling Avenue Valve; High pressure at valve causes well field to cycle; Adjust pilot to lower the pressure. Down time: B13, B11 and SC1 for 22 hours each; B3 and B8 for 20 hours each and B4 and B6 for 18 hours each.
1/18/2007	Altitude Valve; Valve will not open or close when activated; Removed, acid washed and replaced solenoid valve; Cycled valve several times and observed normal operation. Down time: None.
1/19/2007	Recycle valve; Valve closed at 20.2'. Opened recycle valve to lower level below 20', then put system in auto; Altitude valve opened normally and tower filled. Down time: None.
1/20/2007	Recycle valve; Call from Time Communications- "recycle valve fail". Tower is at 20.7' and the tower is taking longer than 3.5 hours to dump; Cycled recycle valve and observed normal operation. Down time: None.
2/6/2007	Recycle valve; Recycle valve failed to open due to a communication error; Repeated "Communication failure" followed immediately by "Communications restored" on trending; Operate recycle valve manually and dump tower from 30.4' to 24.8' and then open altitude valve manually to fill water tower to 30.8'. Down time: None.
3/28/2007	Elevated Storage Tank; Switched from winter operation to summer operation. Down time: None.

APPENDIX F-3

MAINTENANCE ACTIVITIES BY LOCATION
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

4/15/2007	Elevated Storage Tank/Groundwater Storage Reservoir; Audible alarm on arrival; RTU 1 and 2 communication failure; Acknowledged alarm. Down time: None.
4/19/2007	Altitude Valve; The water level in the water tower is declining with time; Upon inspection, the valve will not close completely; Change filter, flush control piping and adjust opening and closing speed and observe the altitude valve closes properly; Water is leaking out the vent port while the valve is closed indicating the valve needs new seals. Down time: None.
5/15/2007	Building 116; Audible alarm on indicating low temp and high tank level; Acknowledge alarm. Down time: None.
5/28/2007	The daily inspection was not performed due to the Memorial Day holiday. Down time: None.
7/22/2007	Water Tower; Water level at 36 feet; Opened recycle valve and drained tower to 32'. Down time: None.
8/14/2007	Water Tower; Storm last night knocked out communication between the PLC in the altitude valve vault and the PLC at Building 116; Reset both PLCs and communication was restored. Down time: None.
9/3/2007	The daily inspection was not performed due to Labor Day; The meter readings were averaged between September 2nd and September 4th. Down time: None.
9/21/2007	Water tower; Shut down the TGRS and drain the water tower completely; Install a blind flange on the 12" piping in the altitude valve vault upstream of the altitude valve. Down time: 7 hours at B1, B13, B3, B5, B6, B8, B9 and SC5; 4.5 hours at B4 and SC2; 2 hours at B11 and SC1.
9/24/2007	Snelling Avenue Valve; Bled all of the water off the top of the valve and closed the control piping ball valves to maintain the valve in the fully open position. Down time: None.

Appendix G

TGRS Chemical Data

G.1 TGRS Extraction Wells – TRCLE Versus Time

APPENDIX G-1

EXTRACTION WELL B1 - TRCLE VS.TIME

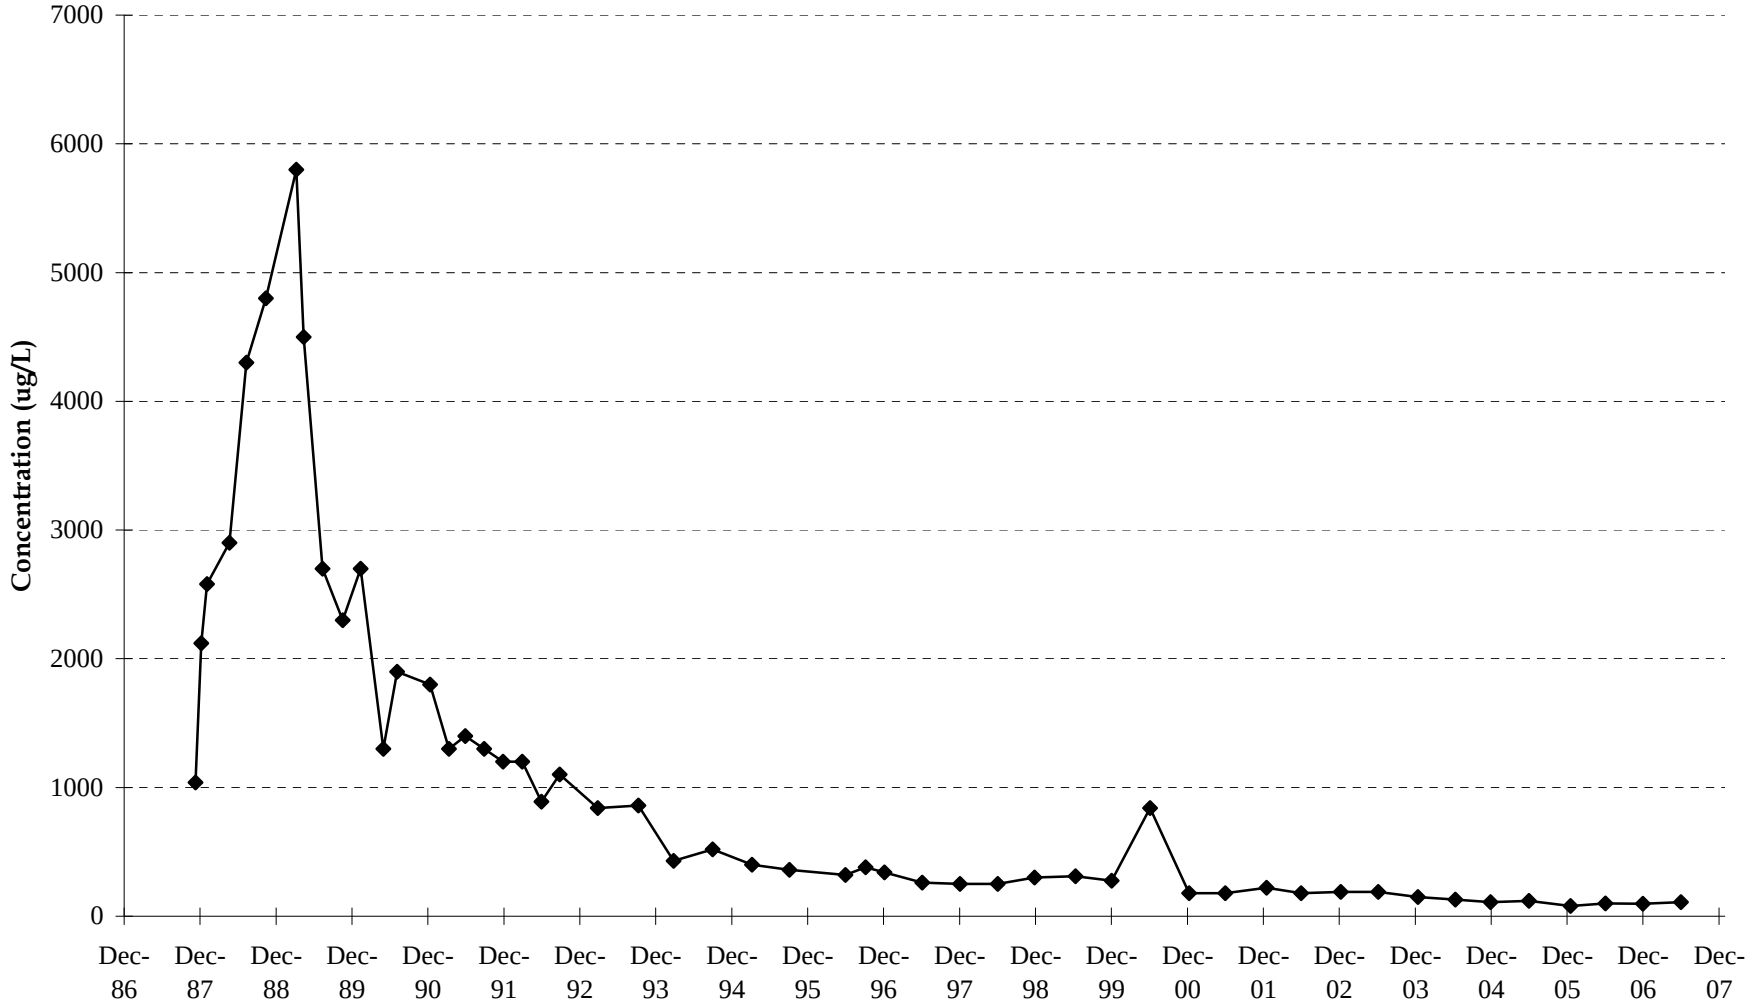

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B2 - TRCLE VS. TIME

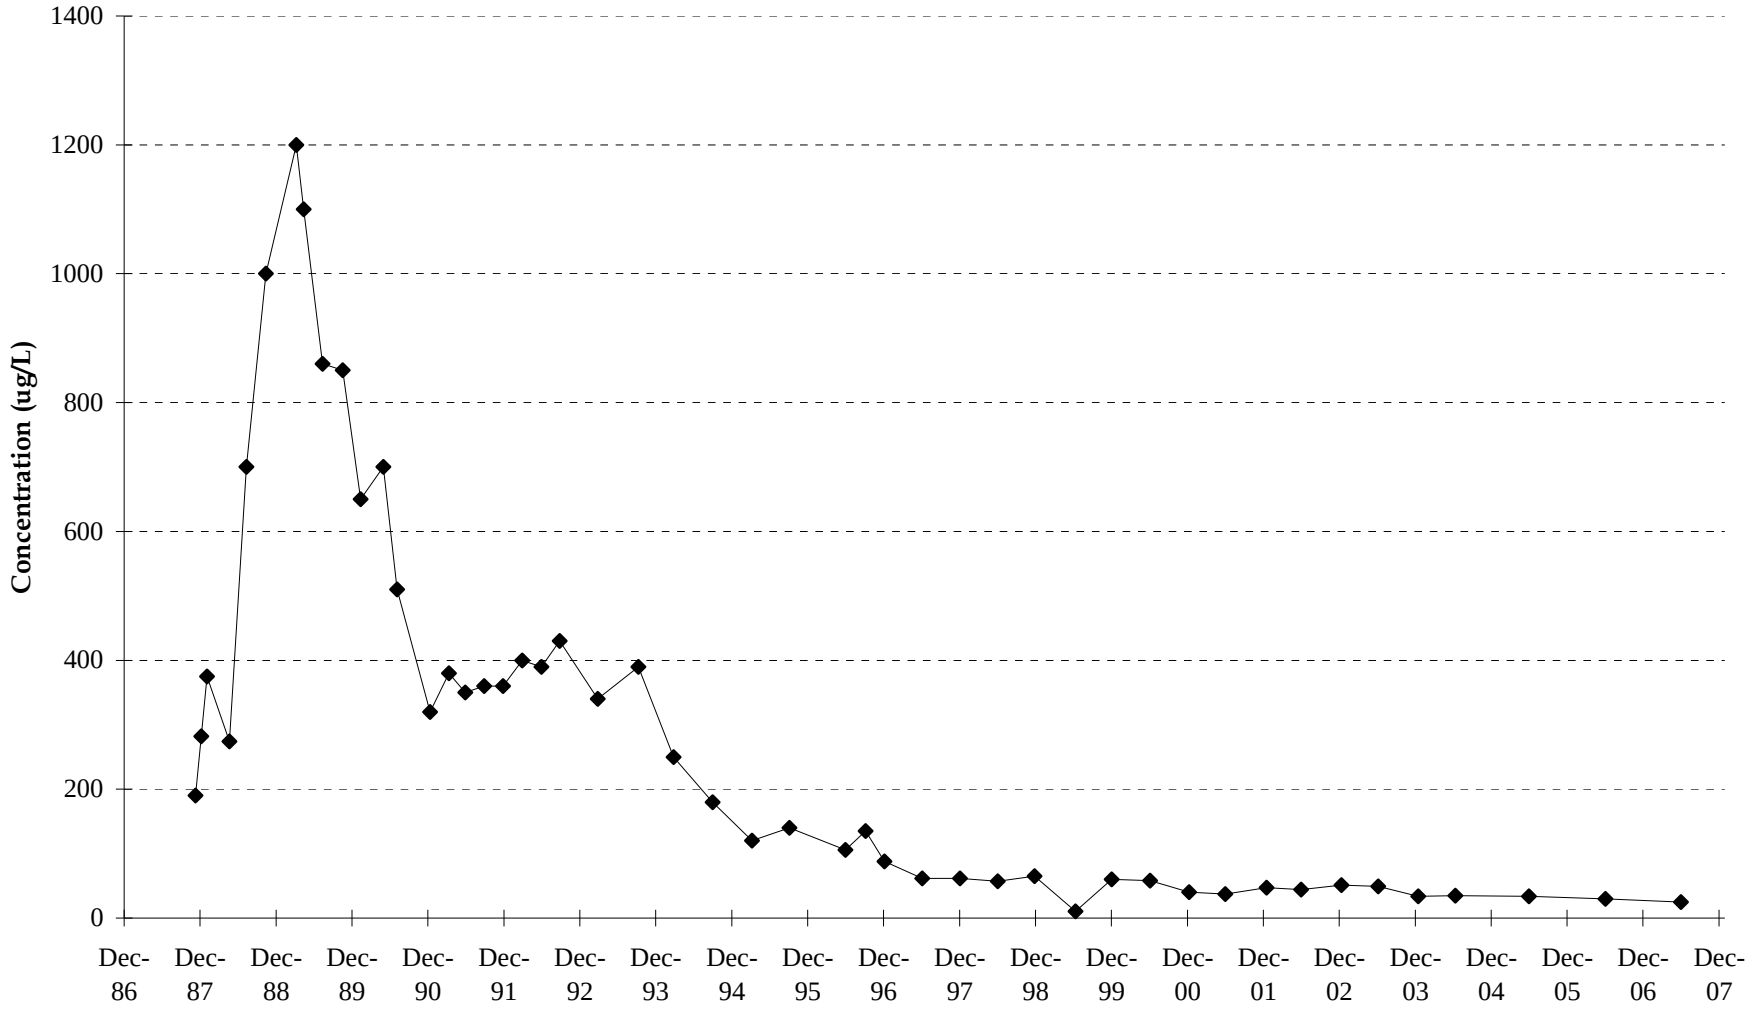

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B3 - TRCLE VS. TIME

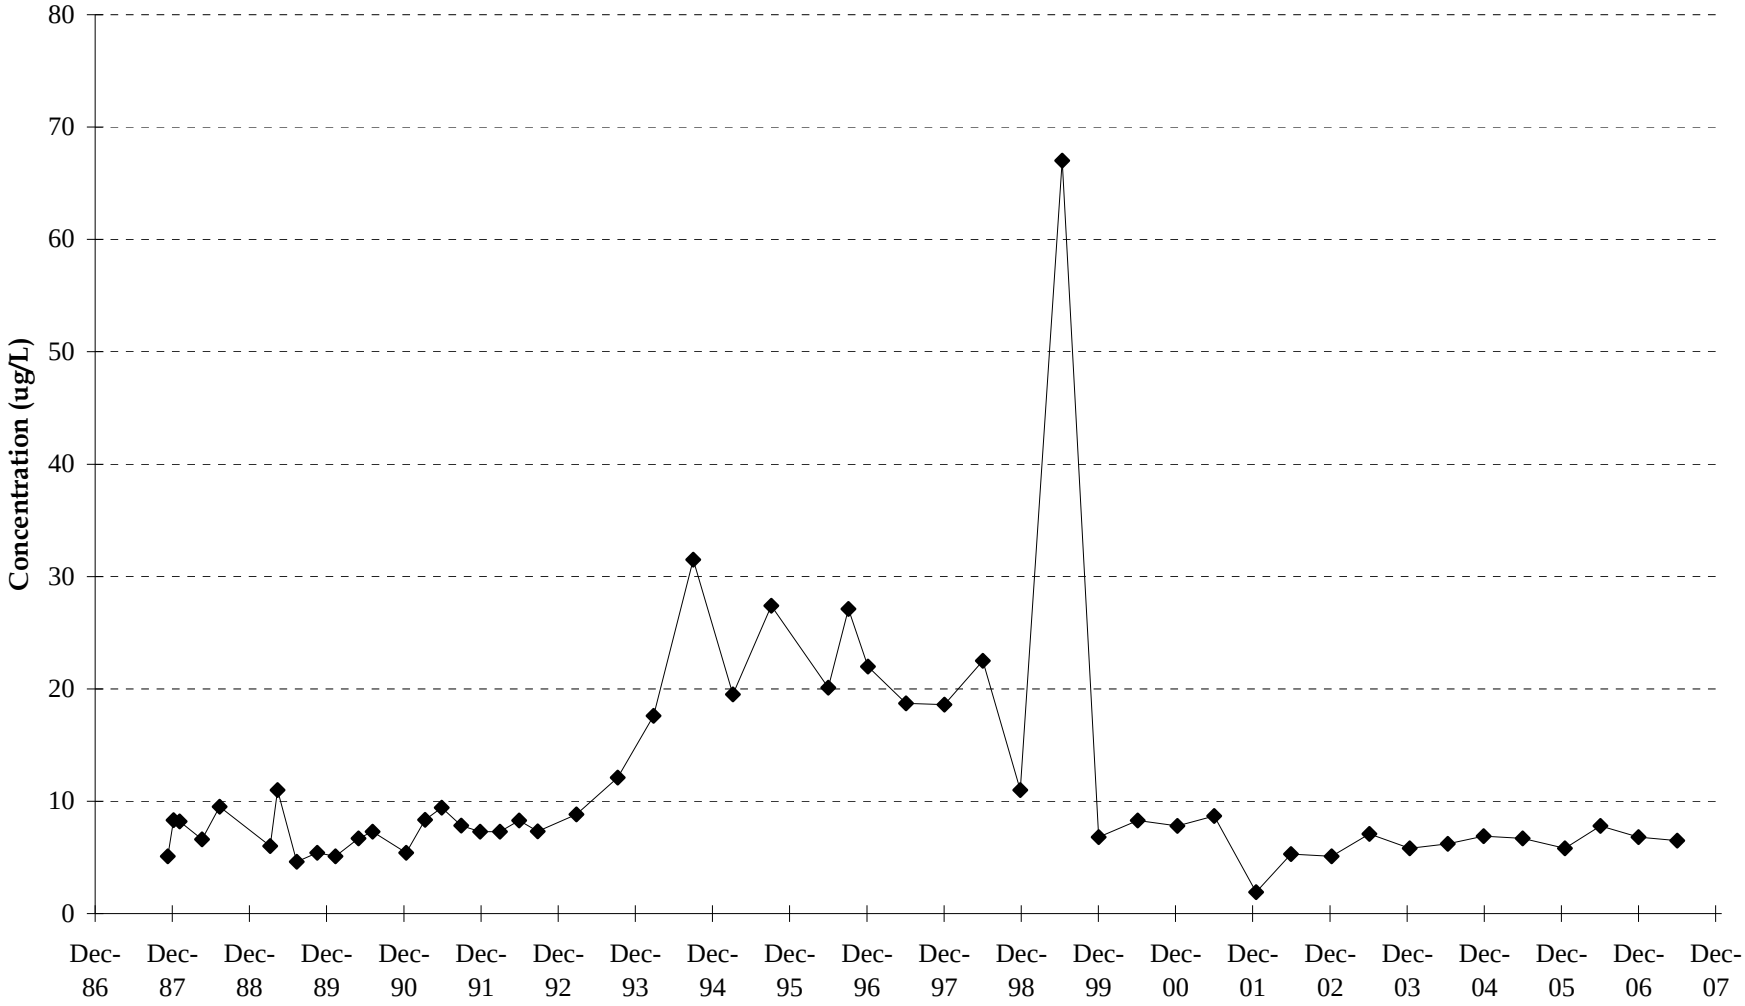

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B4 - TRCLE VS. TIME

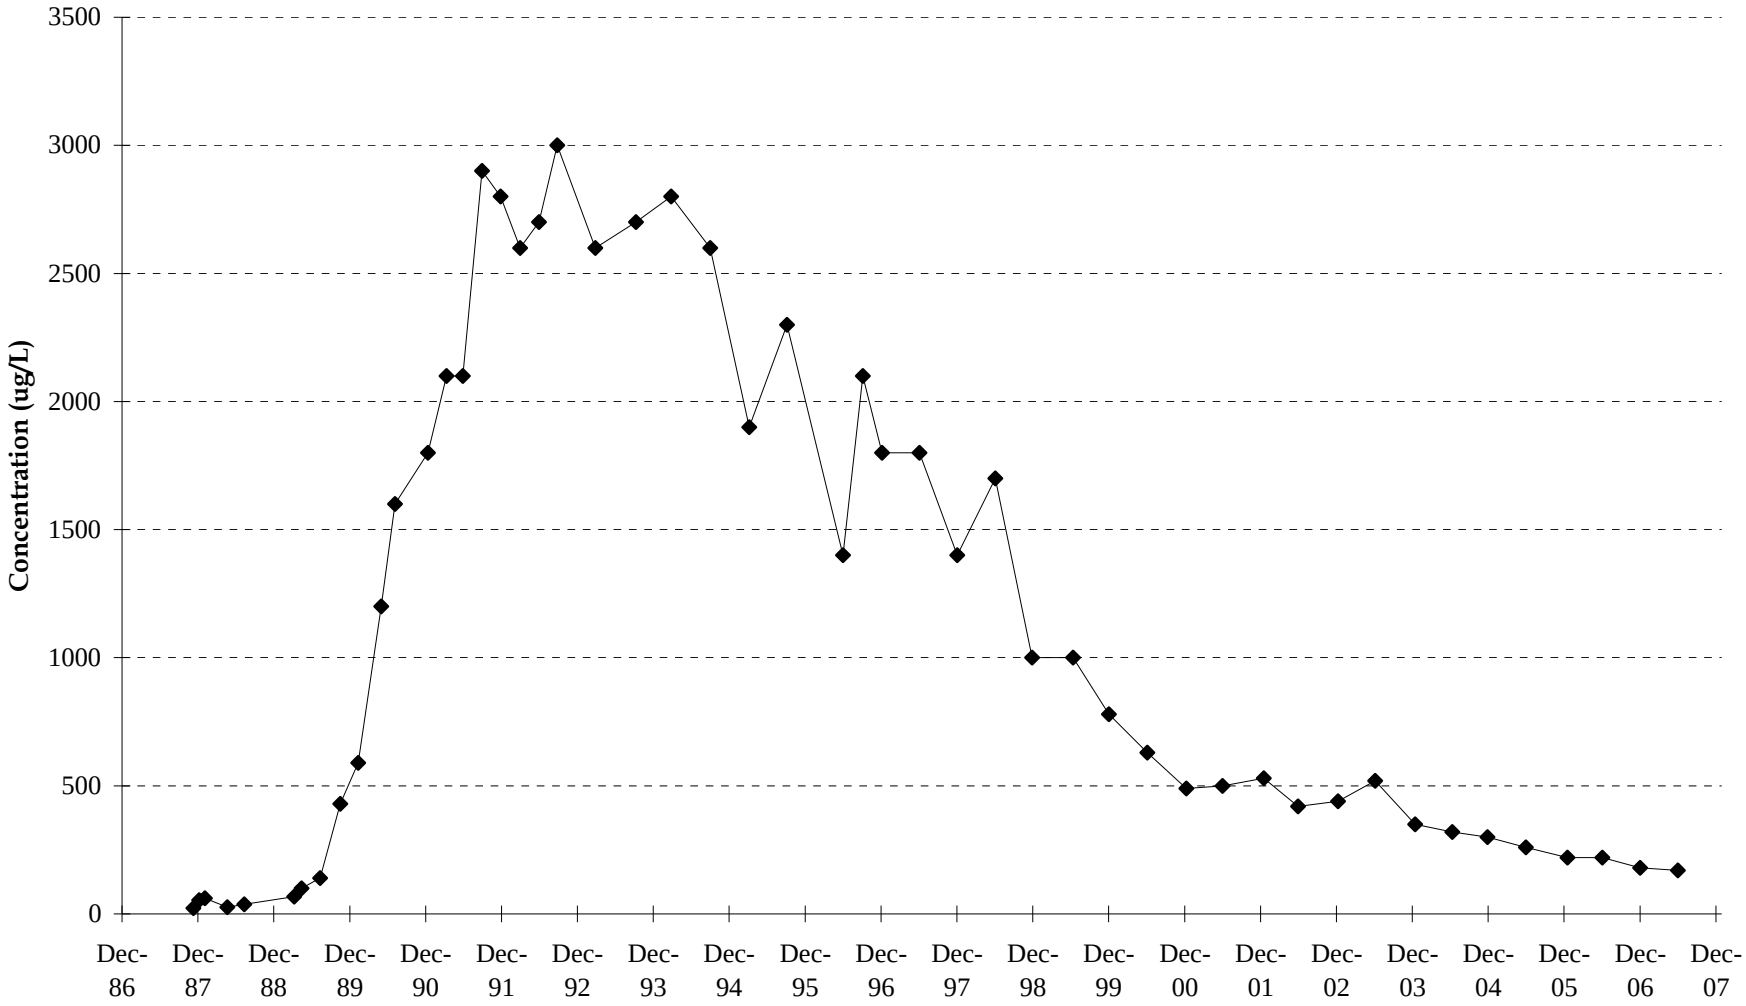

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B5 - TRCLE VS. TIME

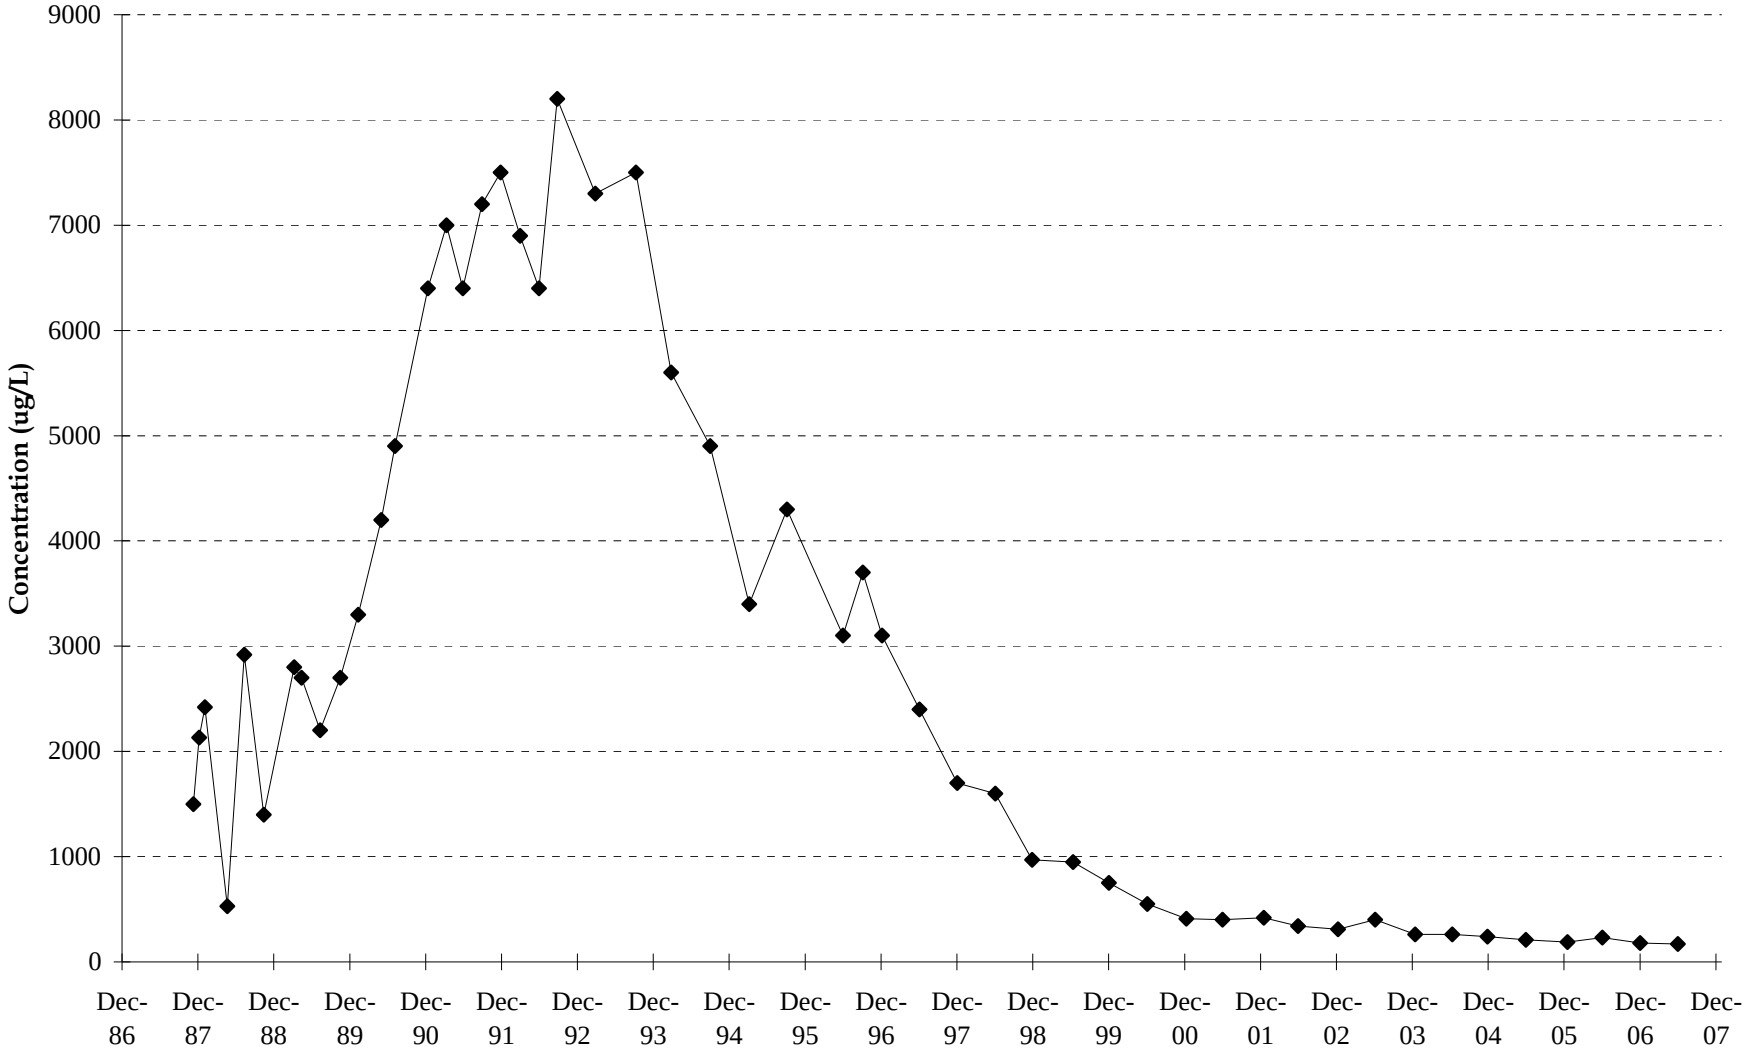

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B6 - TRCLE VS. TIME

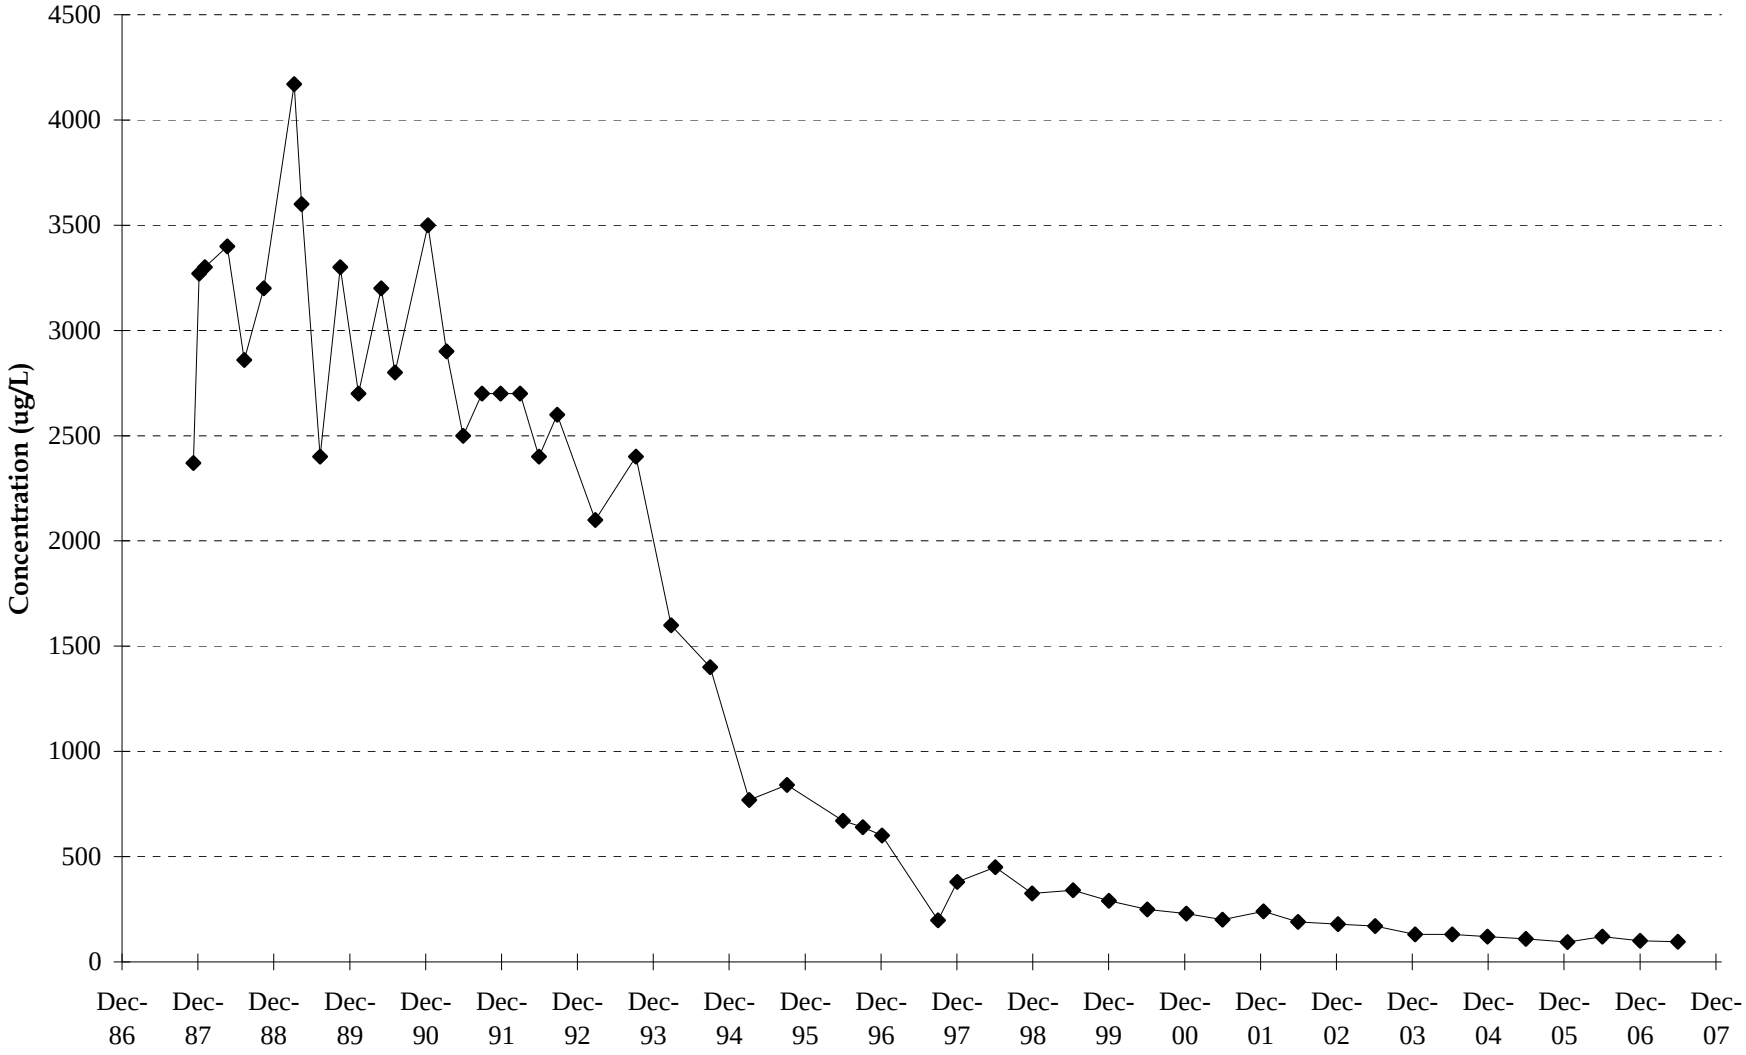

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B7 - TRCLE VS. TIME

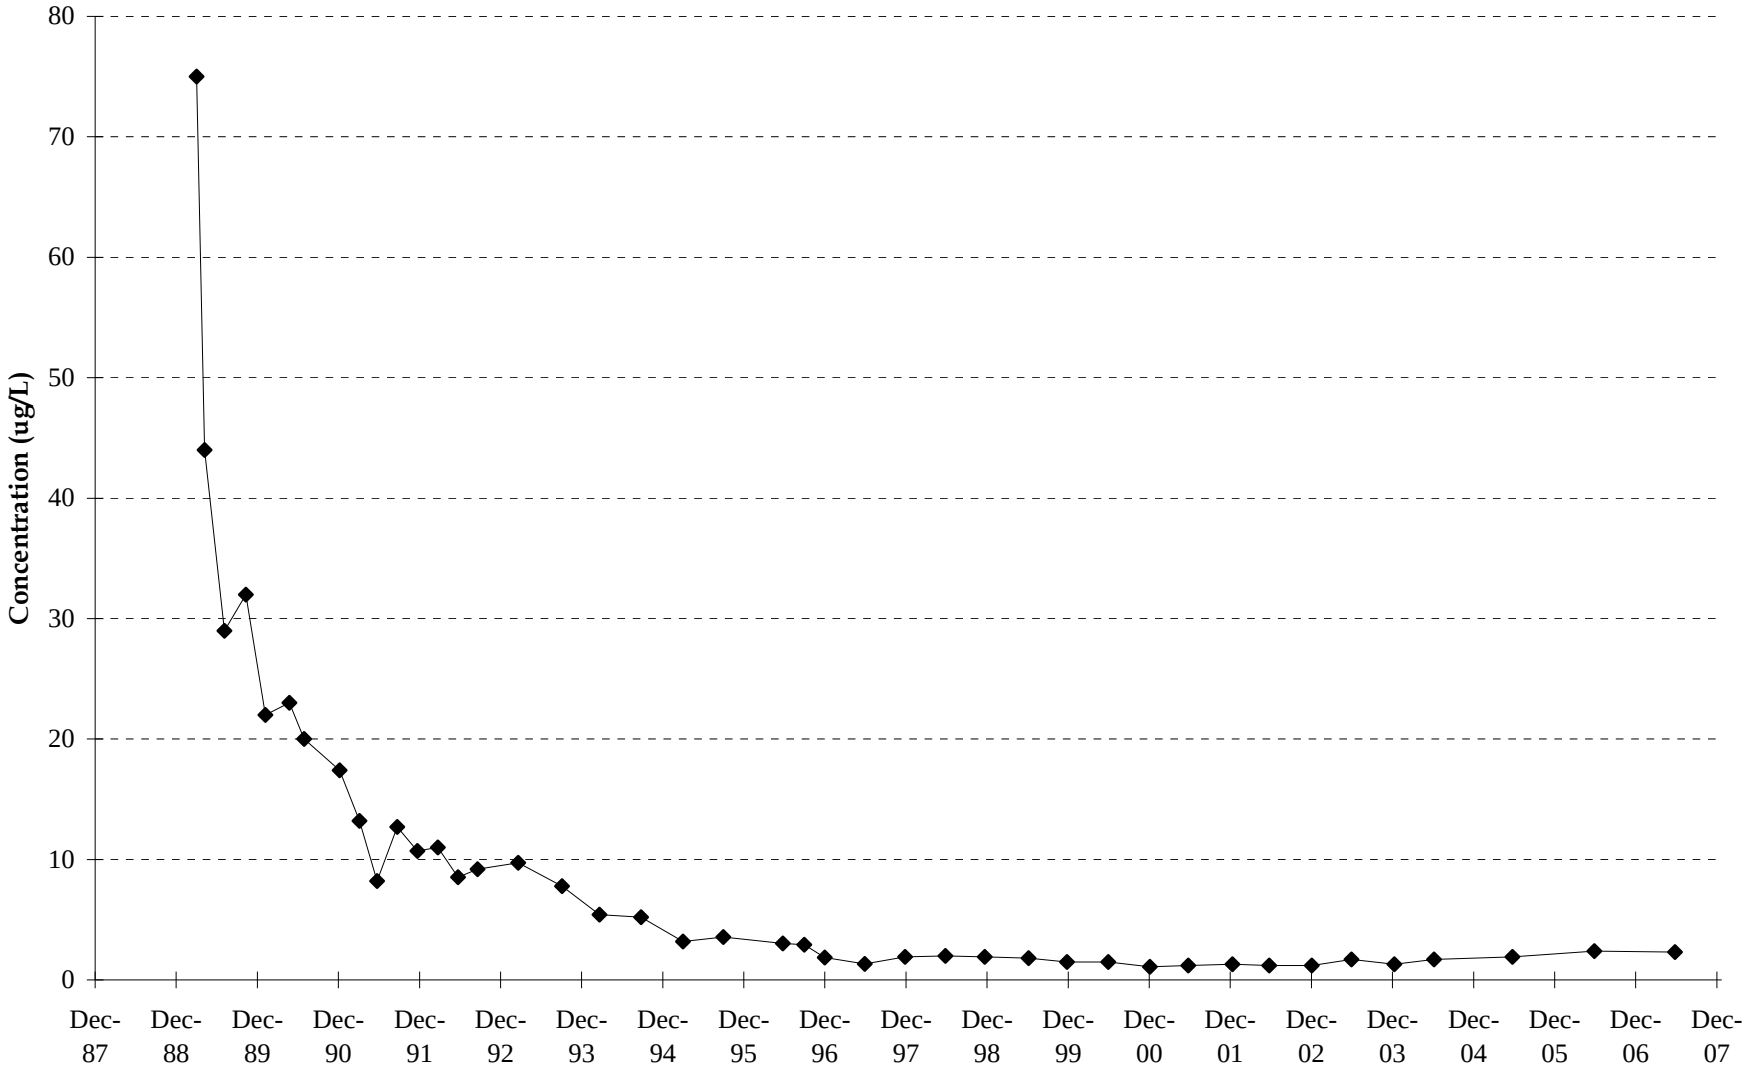

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B8 - TRCLE VS. TIME

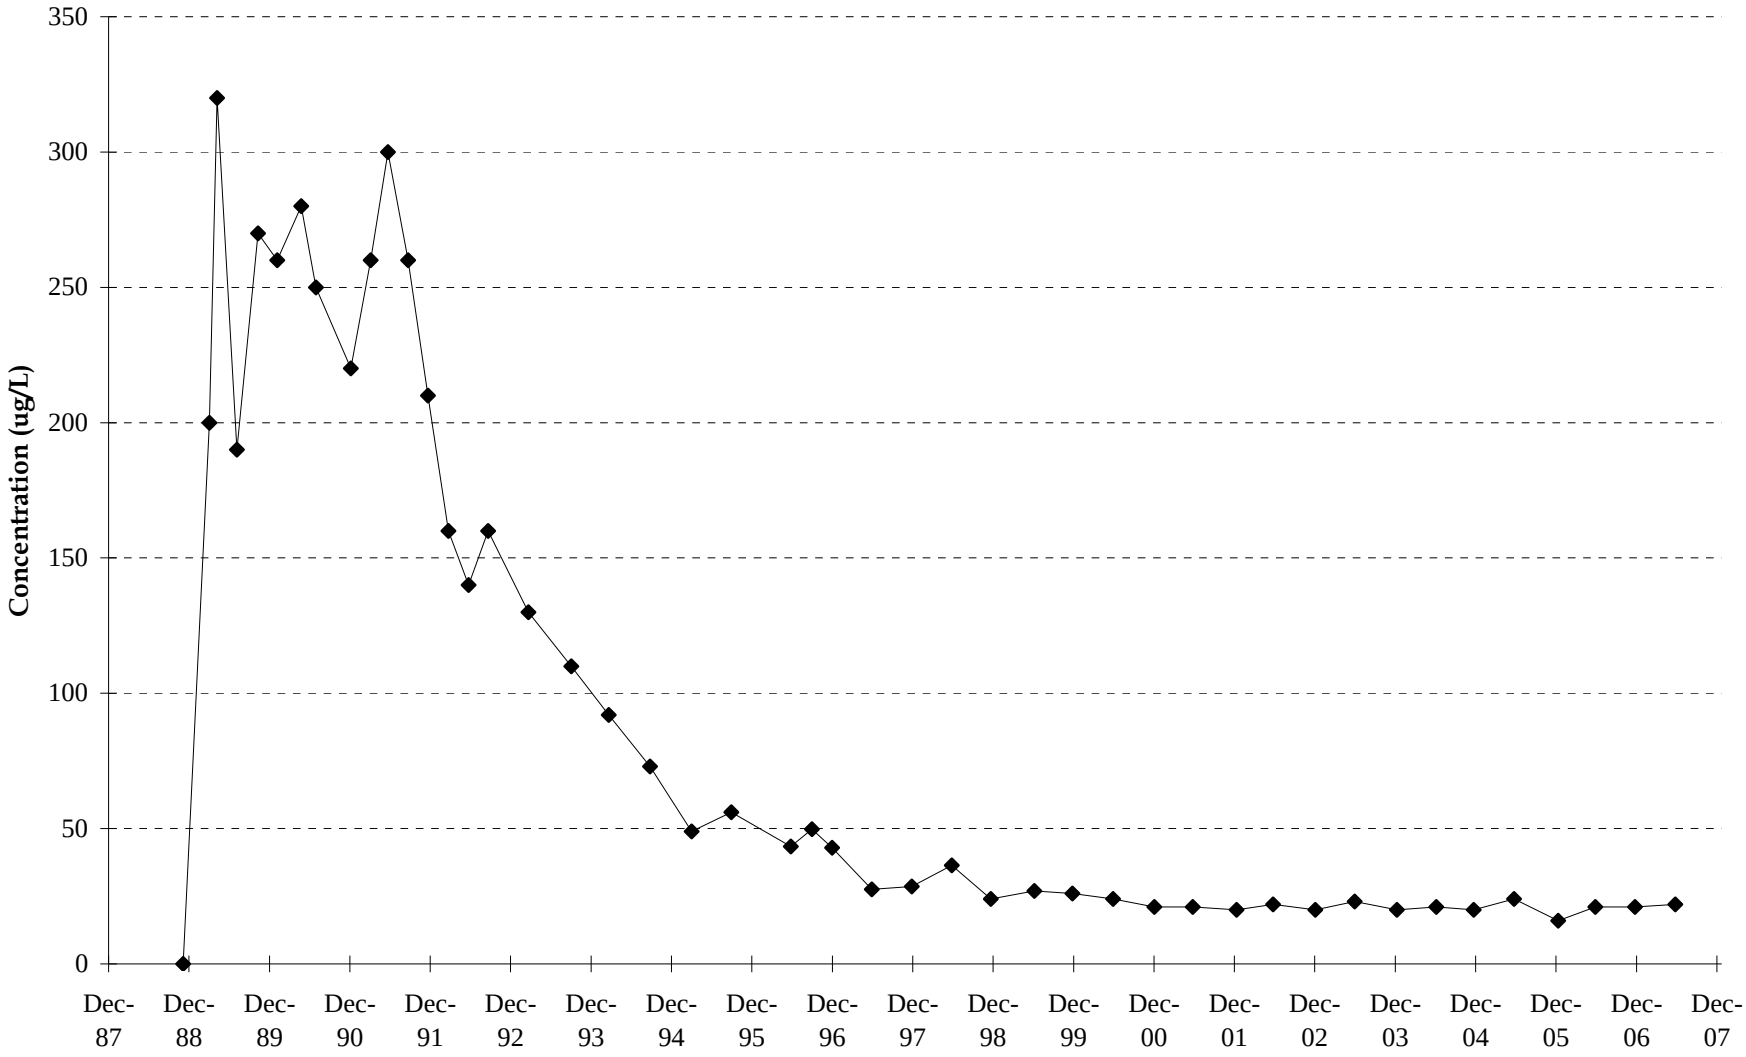

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B9 - TRCLE VS. TIME

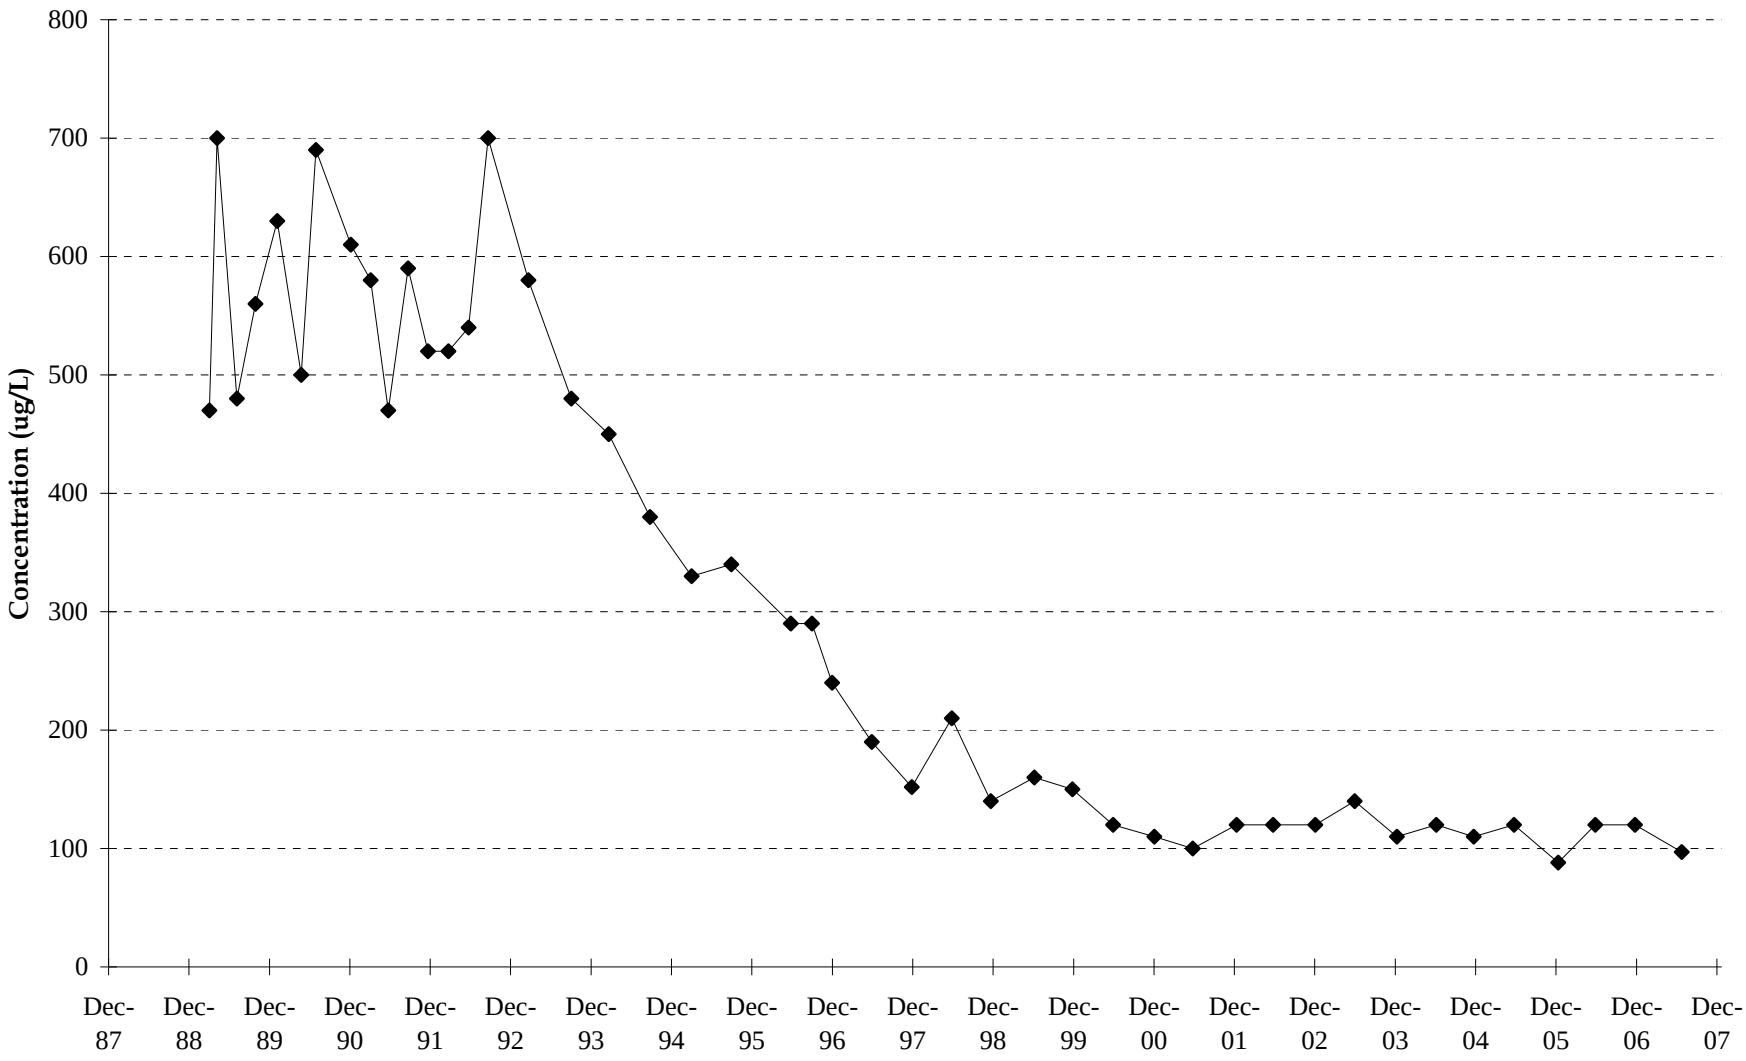

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B10 - TRCLE VS. TIME

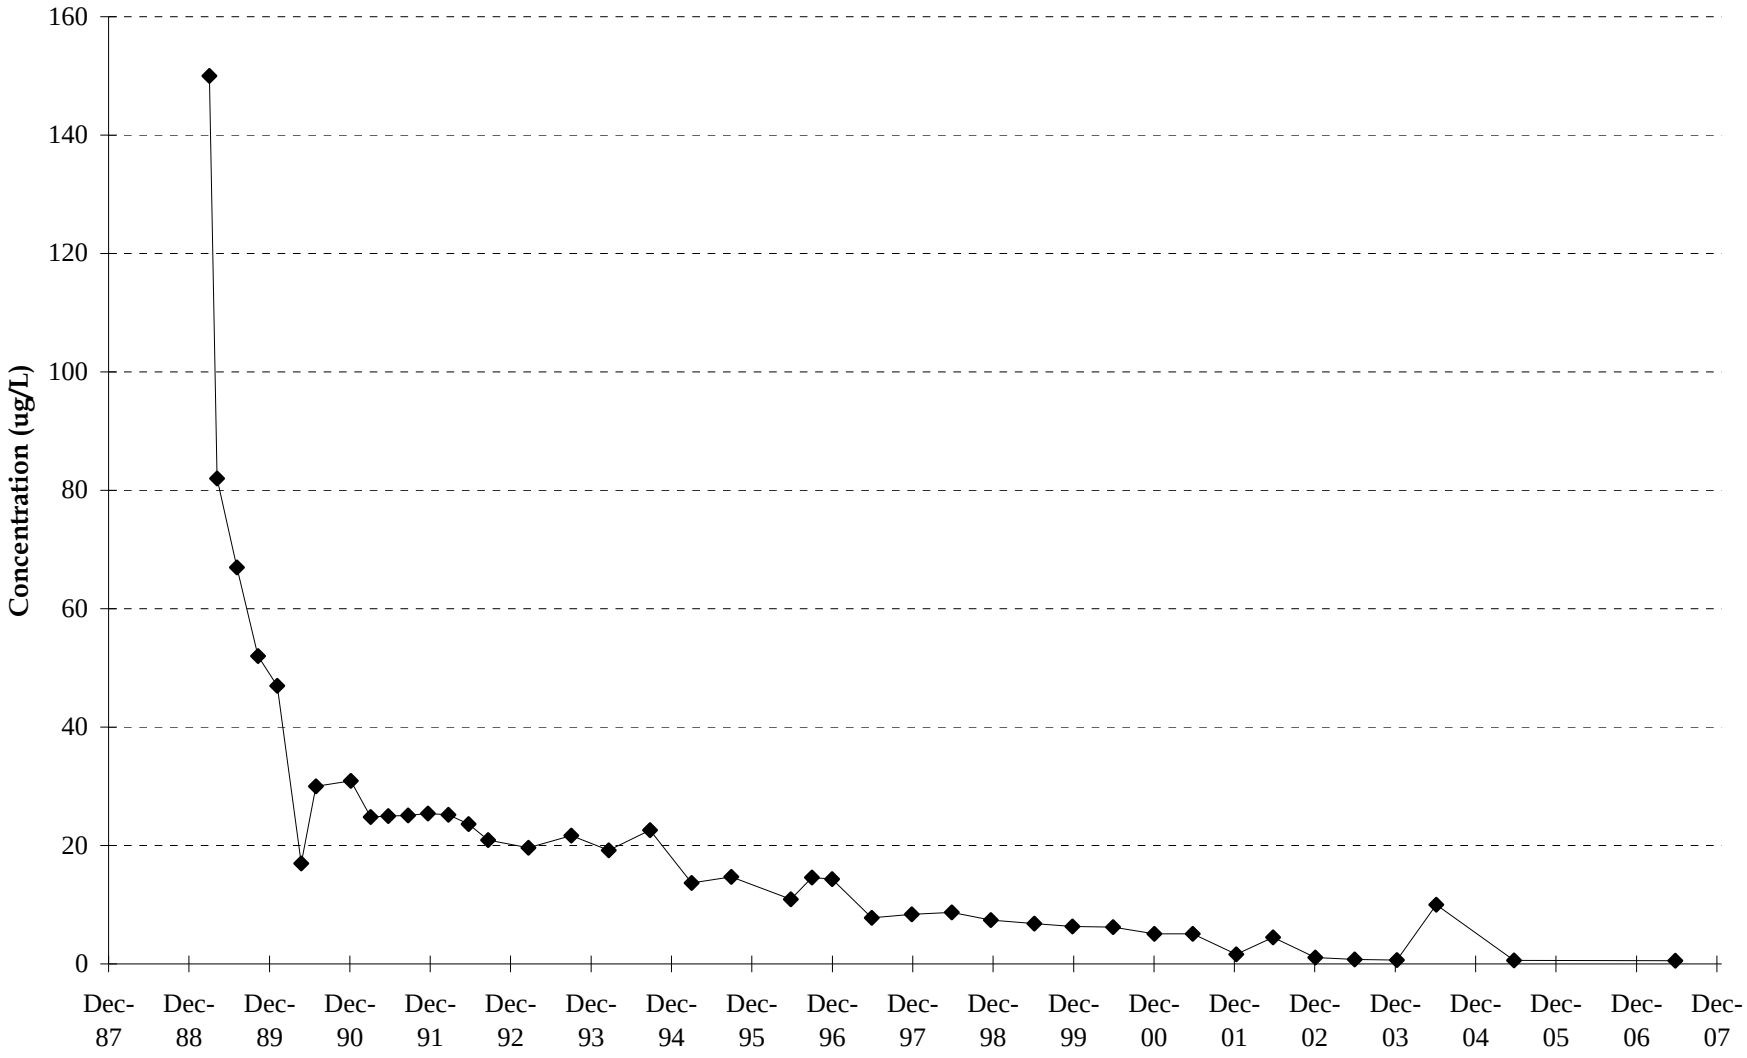

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B11 - TRCLE VS. TIME

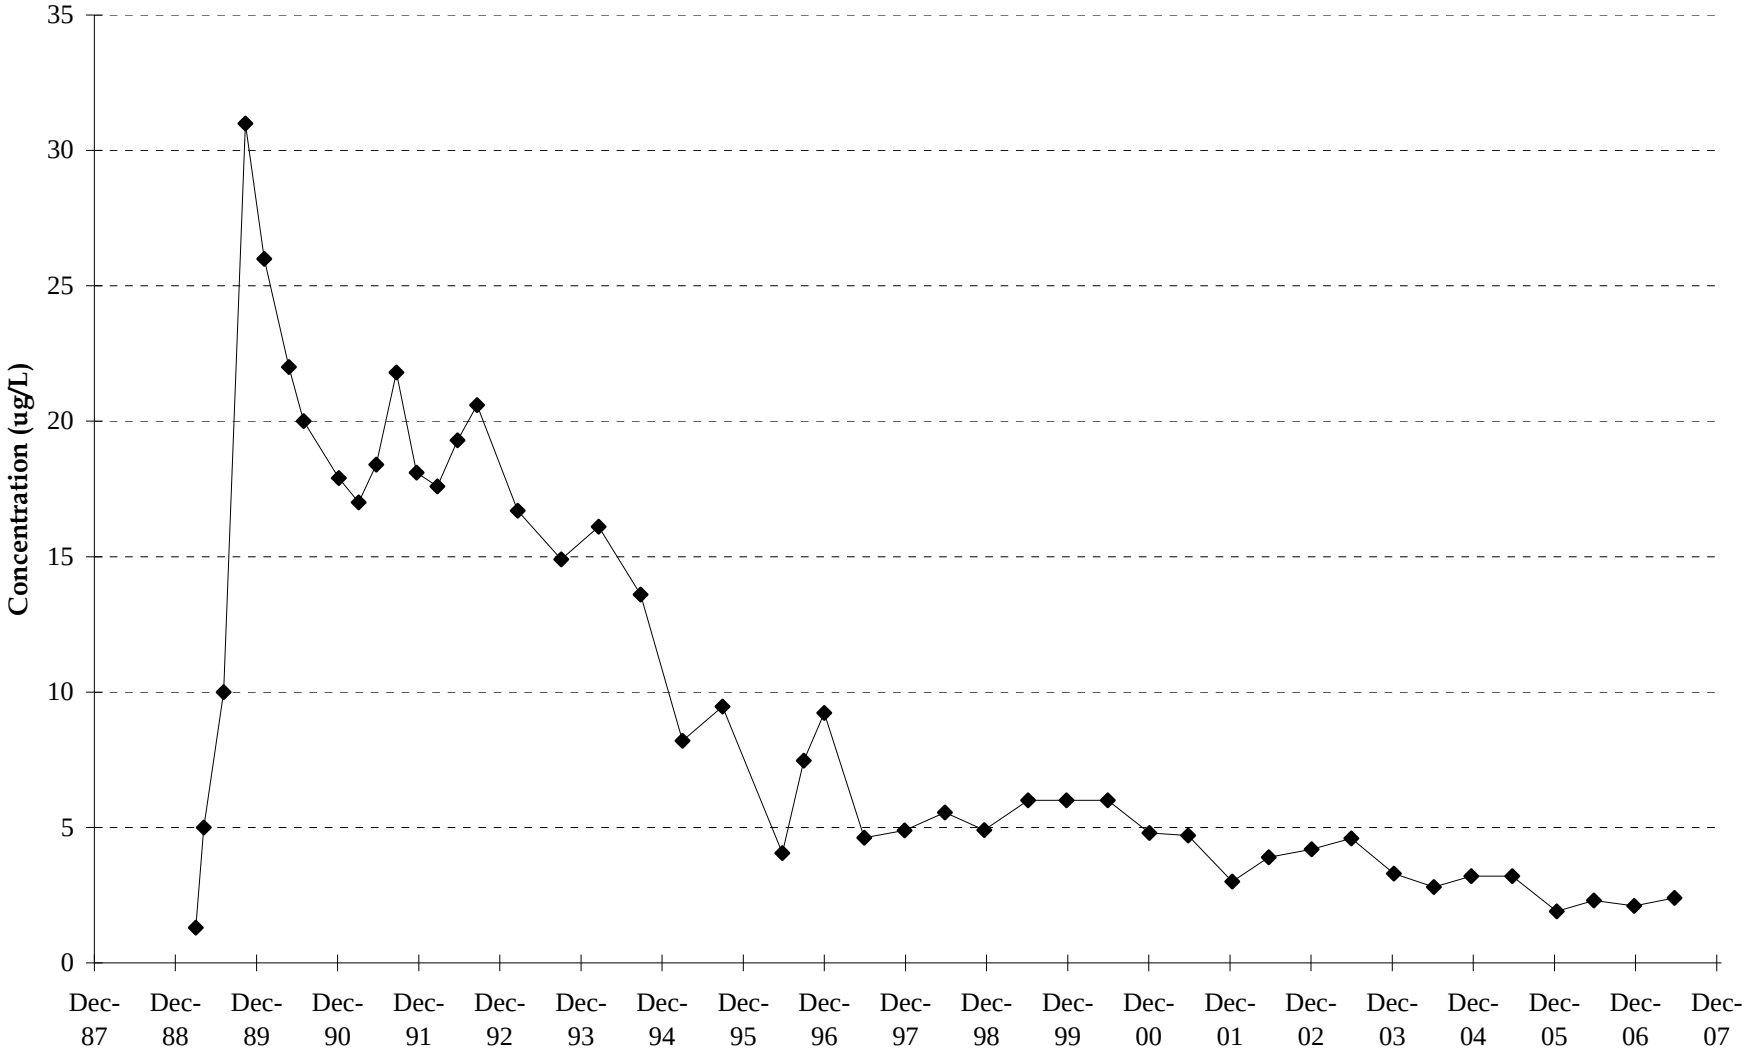

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B12 - TRCLE VS. TIME

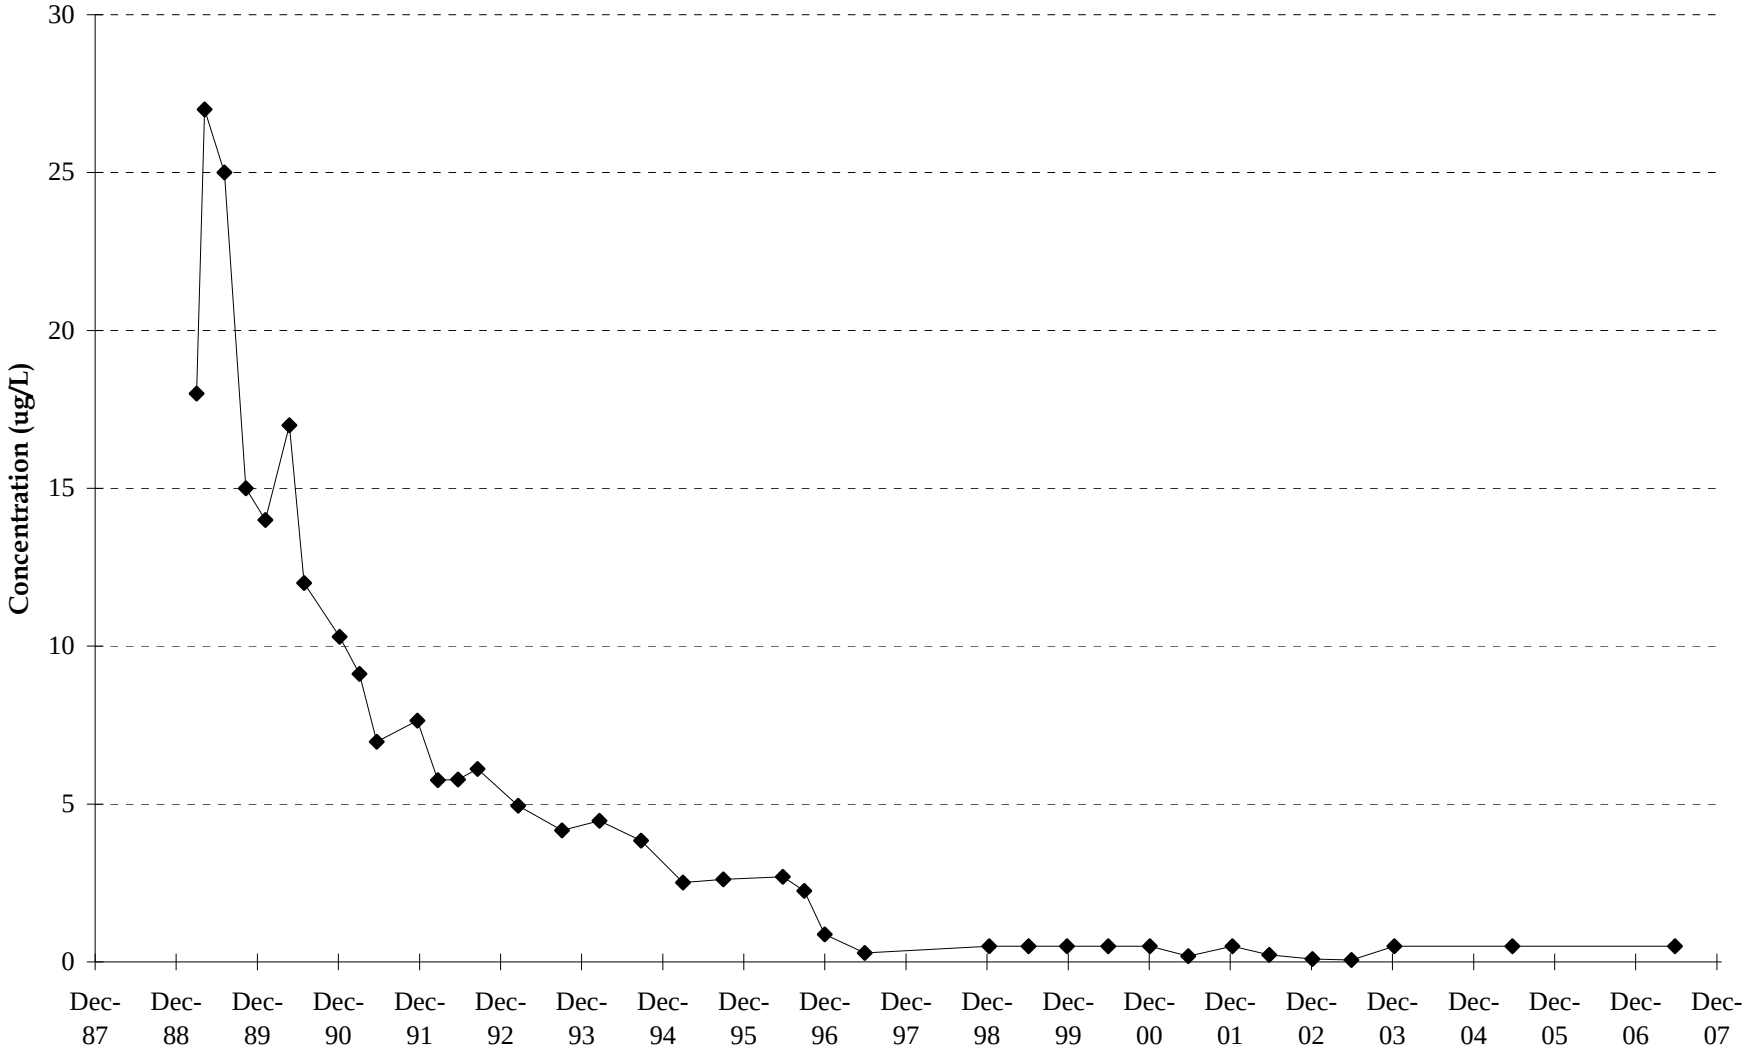

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL B13 - TRCLE VS. TIME

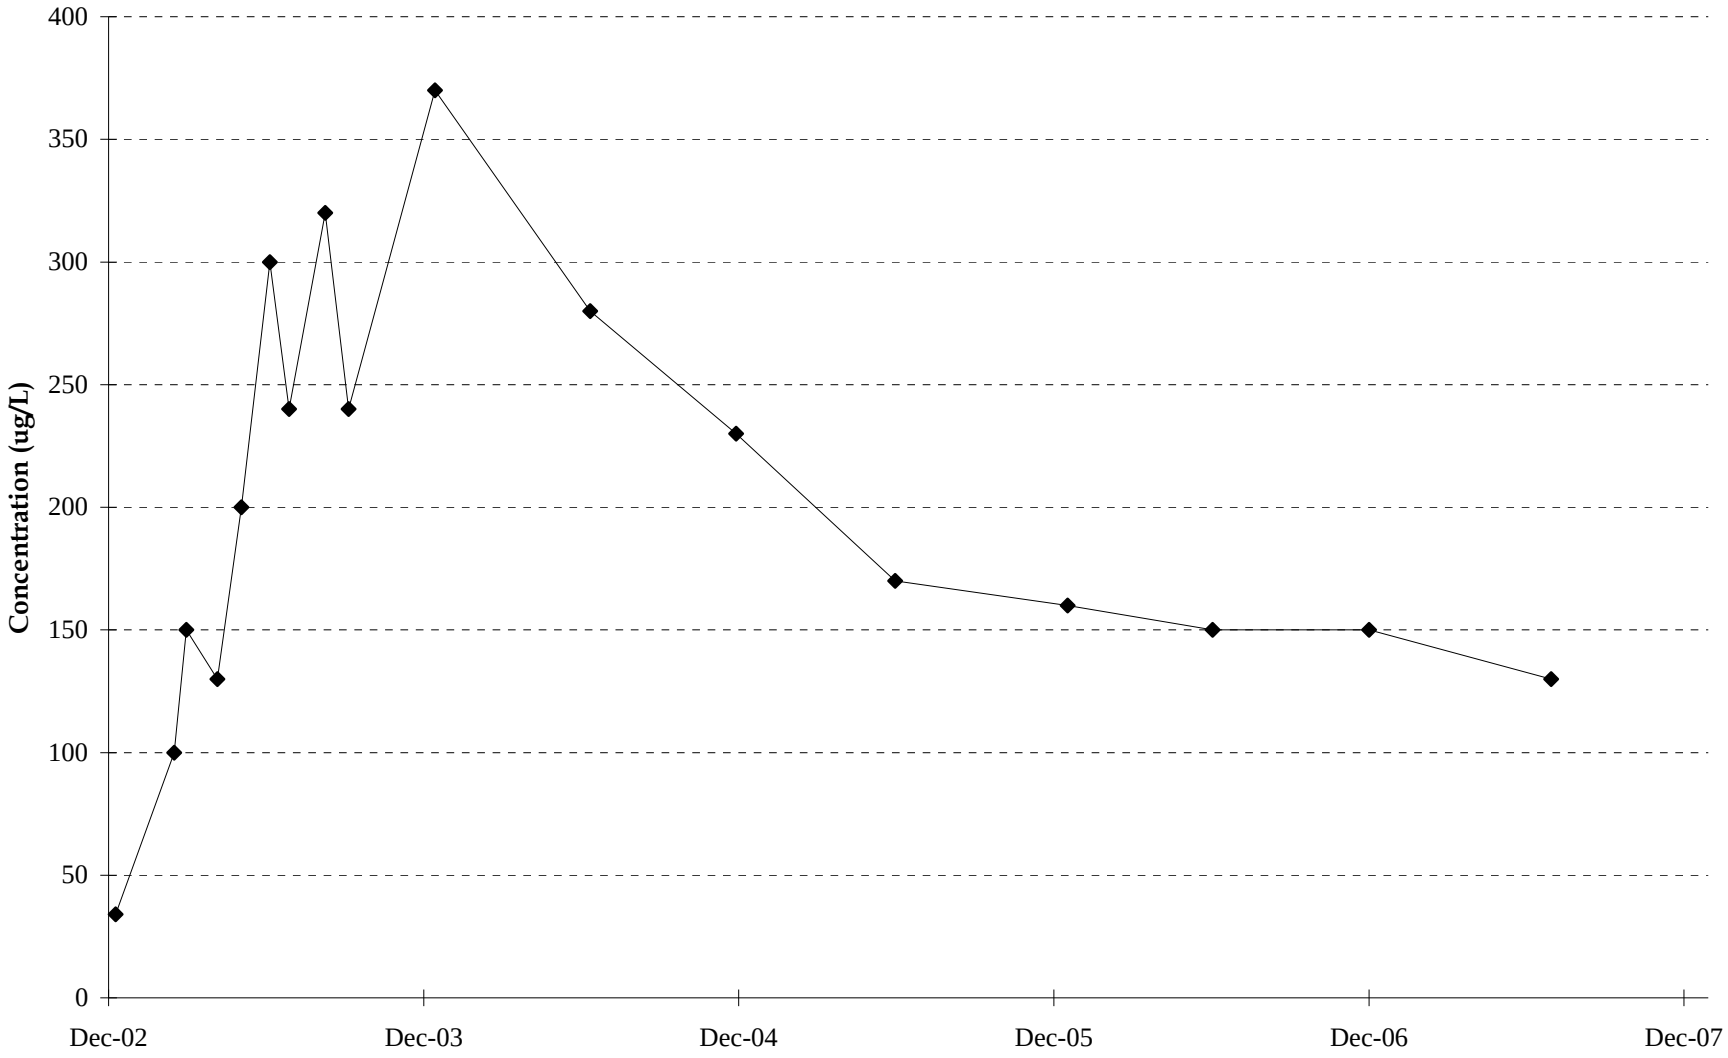

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL SC1 - TRCLE VS. TIME

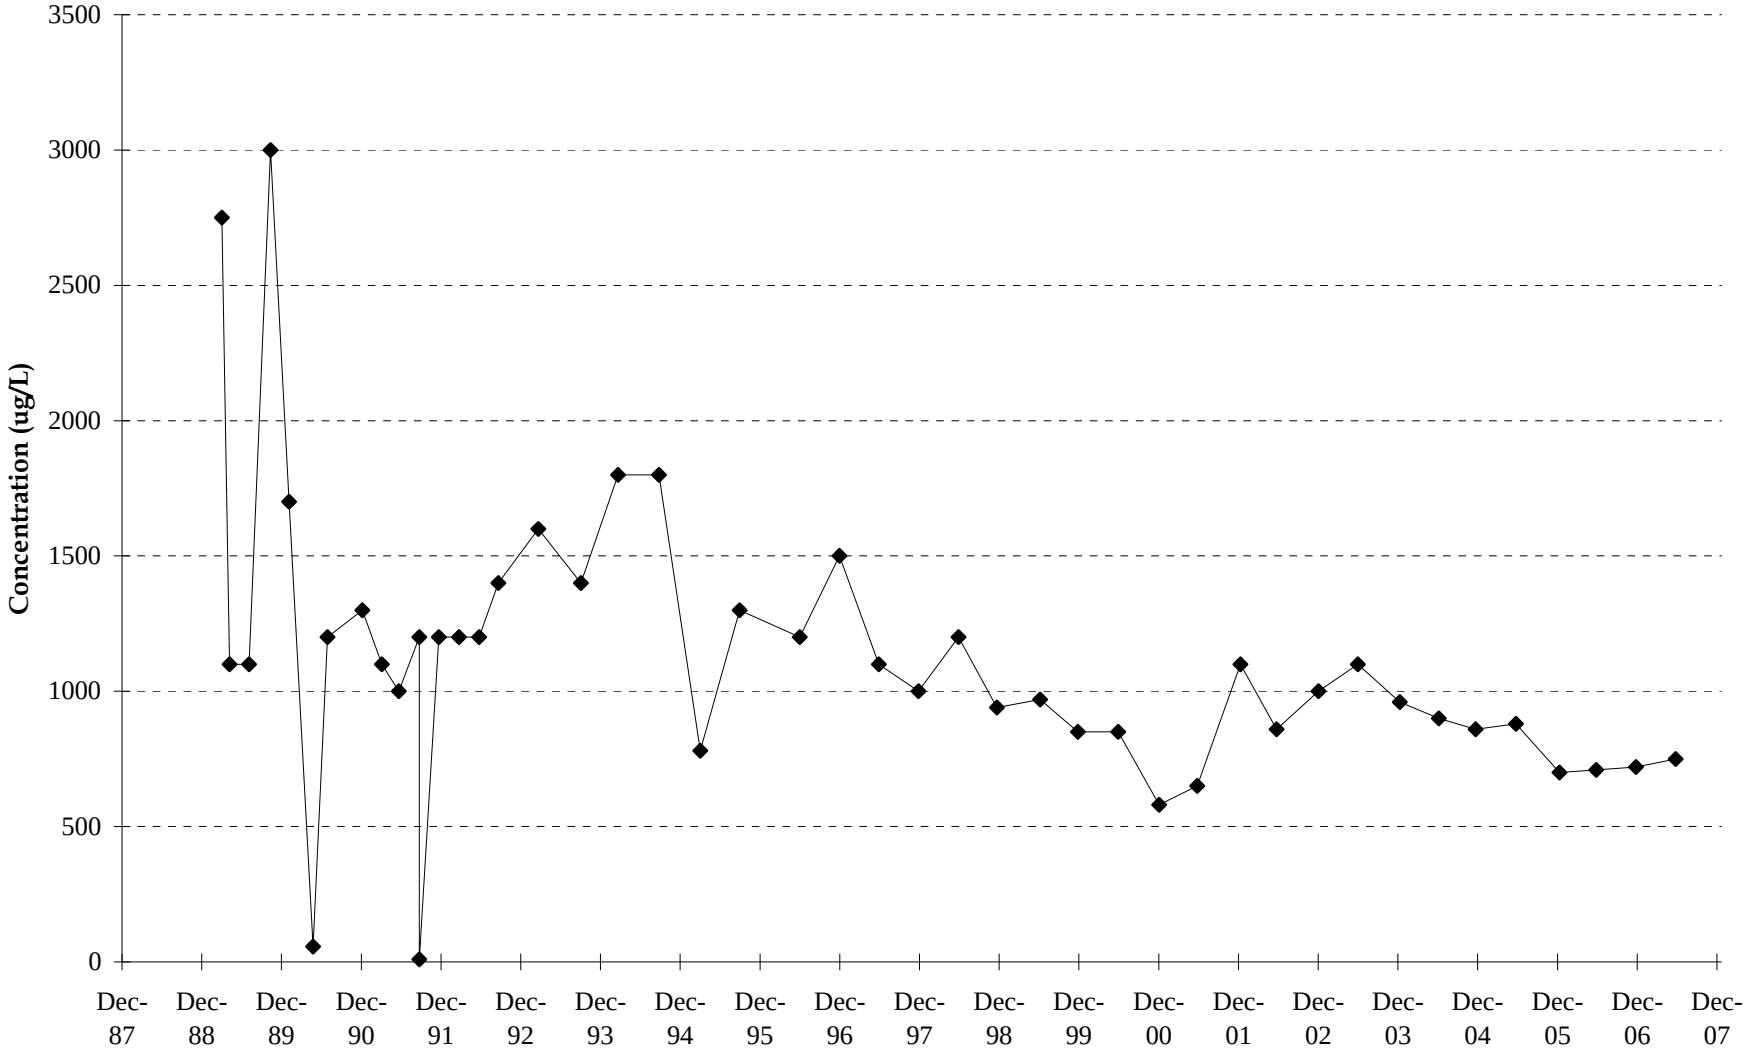

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL SC2 - TRCLE VS. TIME

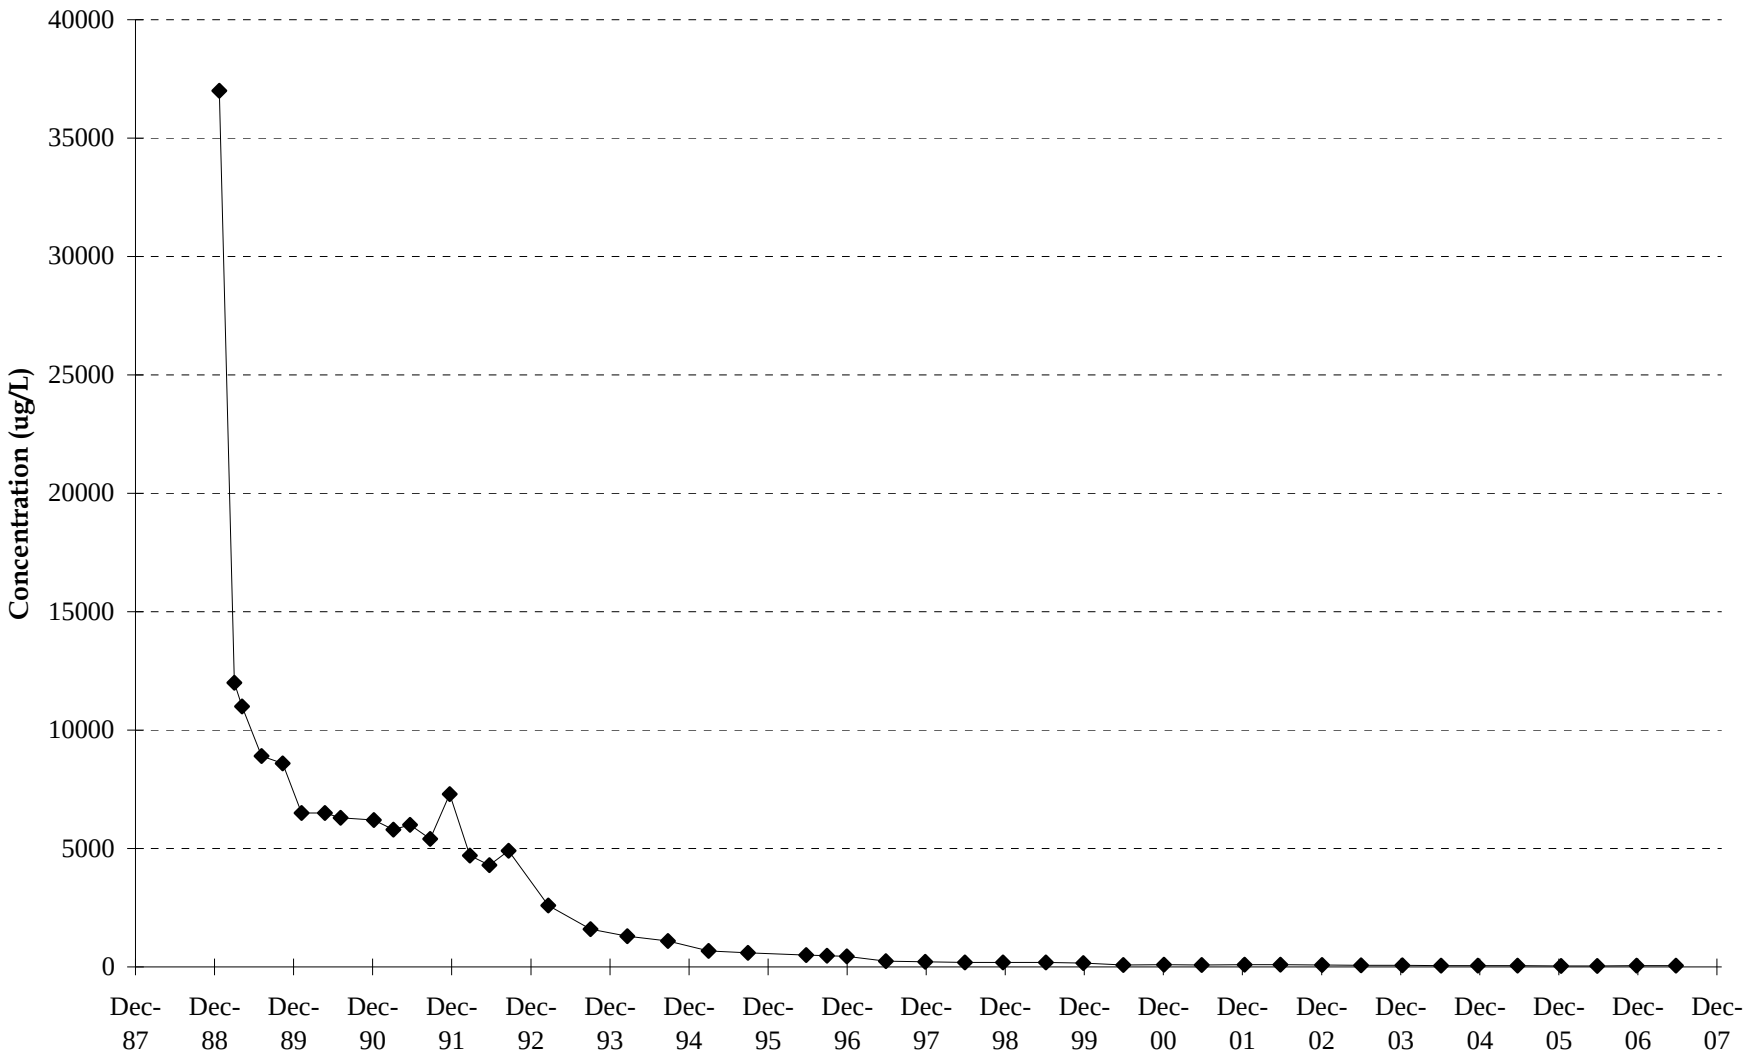

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL SC3 - TRCLE VS. TIME

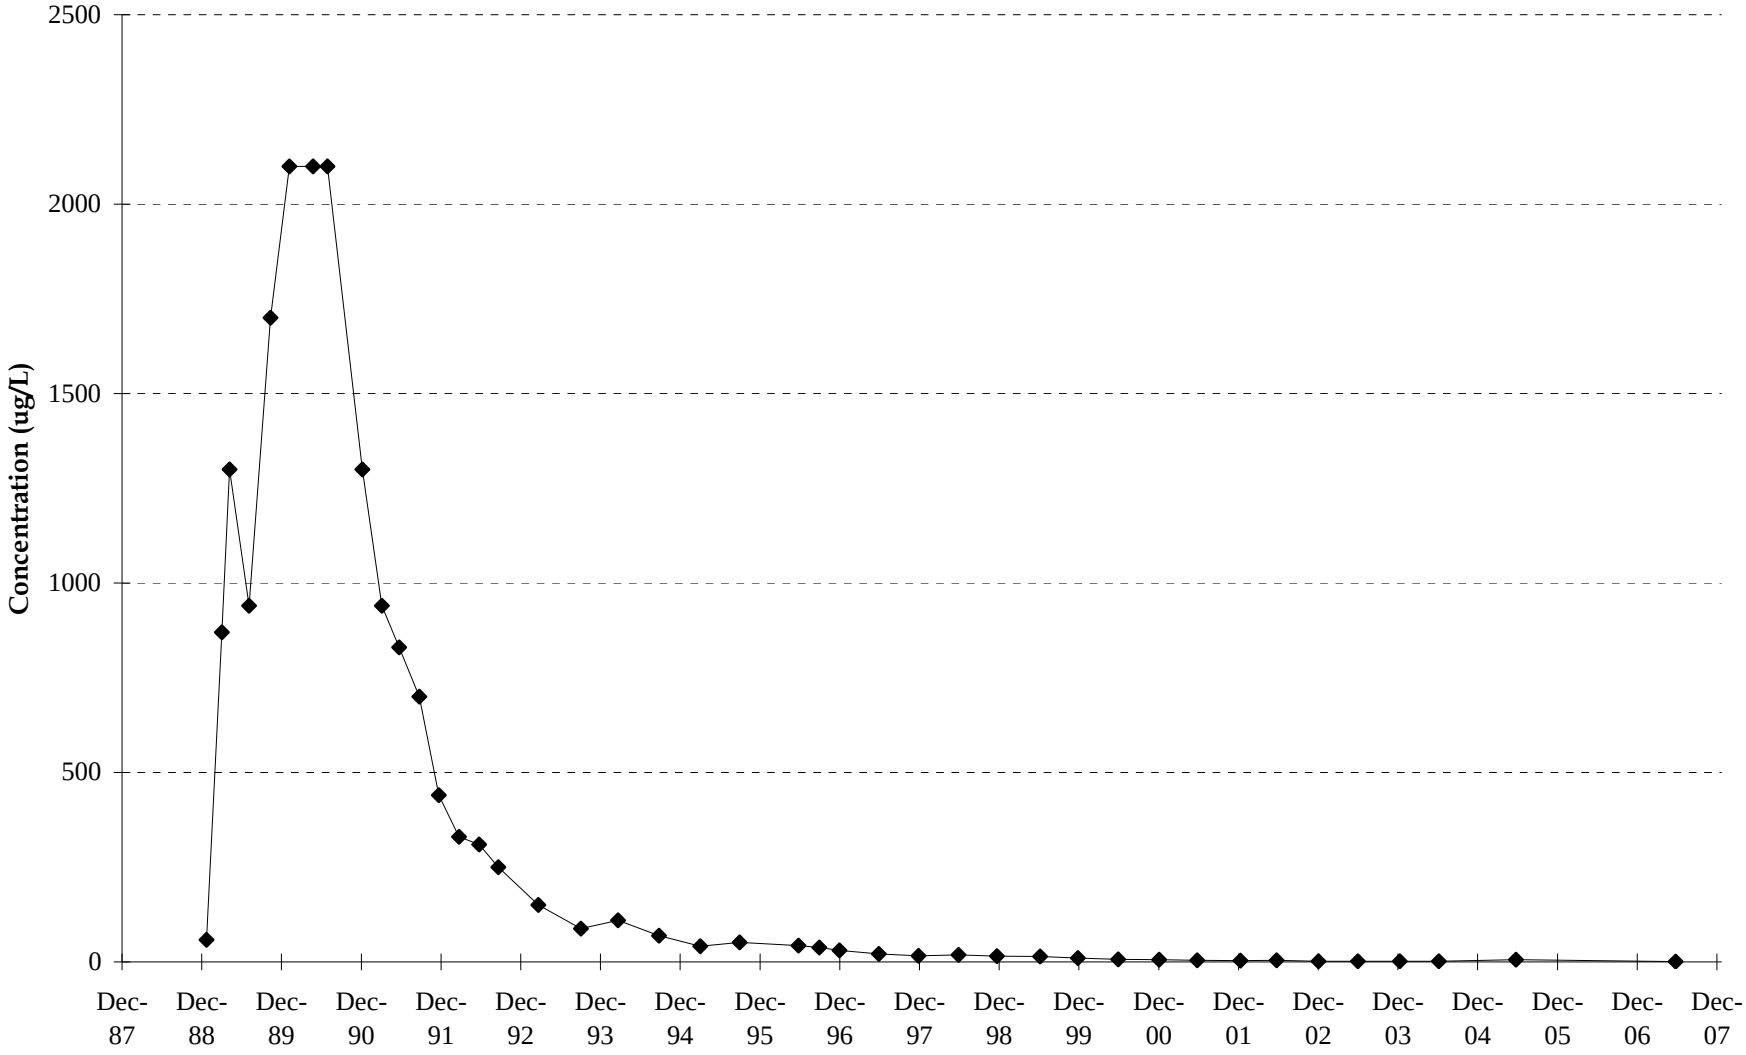

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL SC4 - TRCLE VS. TIME

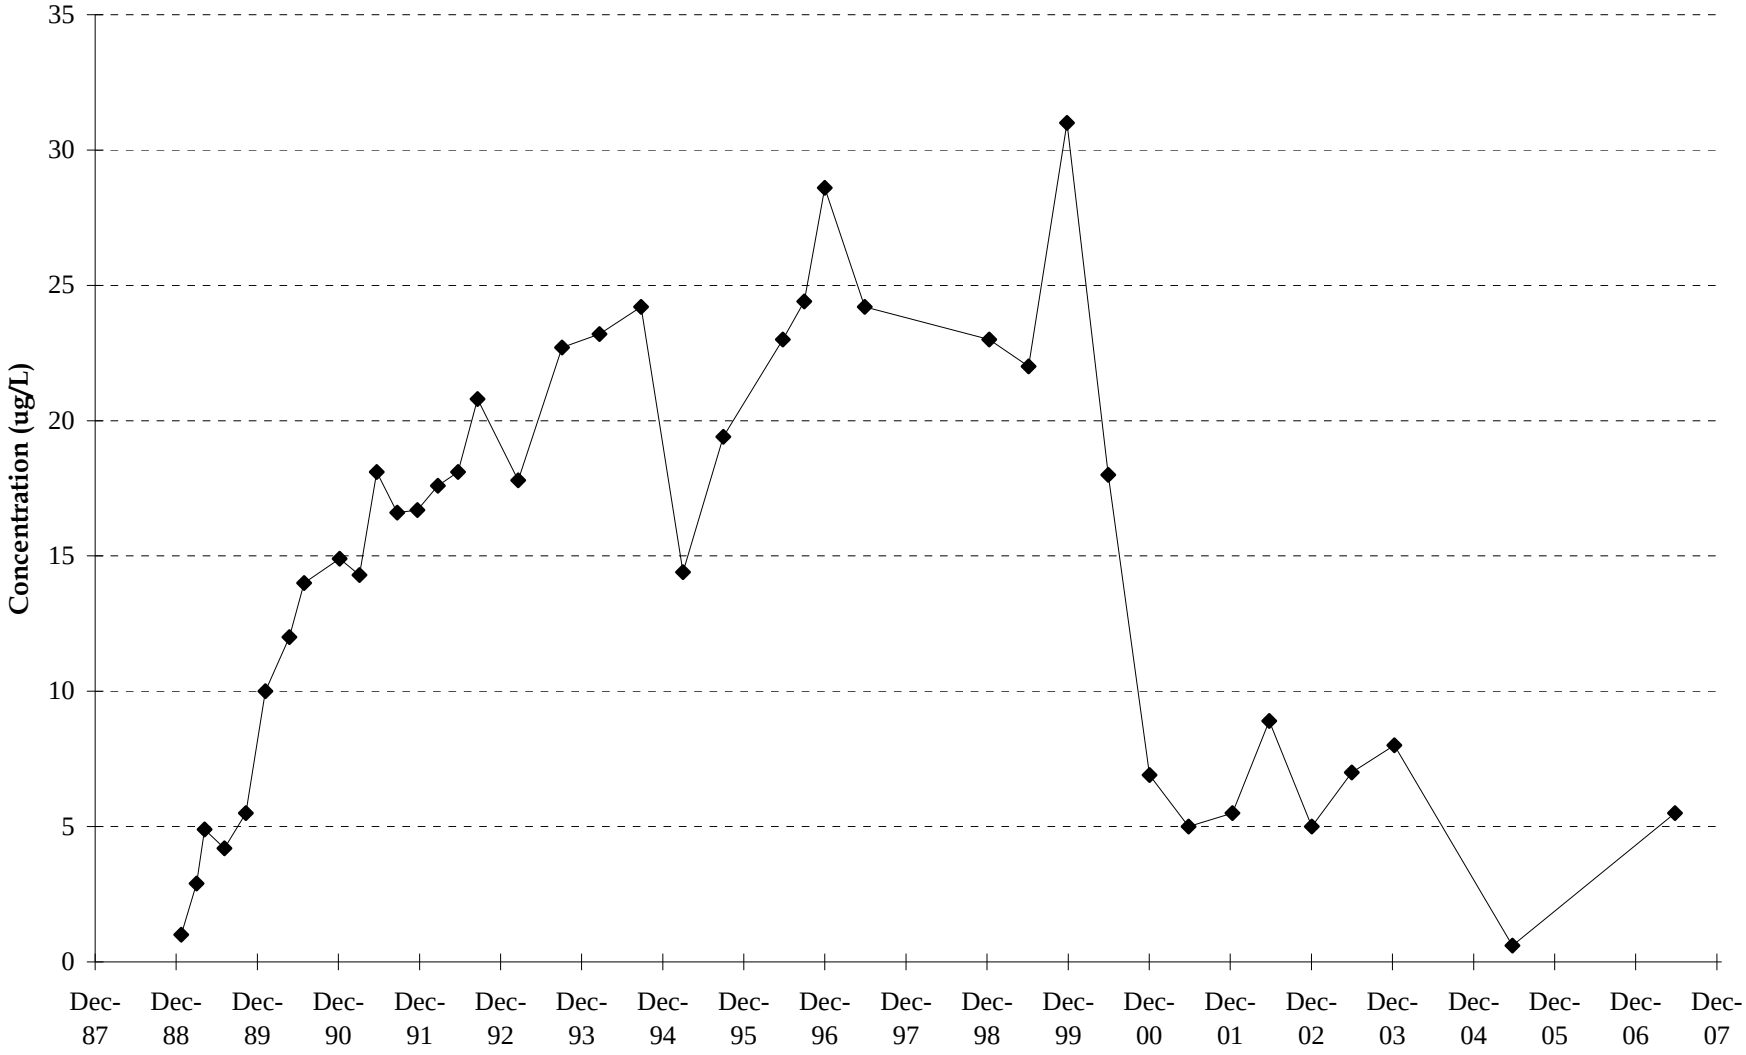

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

APPENDIX G-1

EXTRACTION WELL SC5 - TRCLE VS. TIME

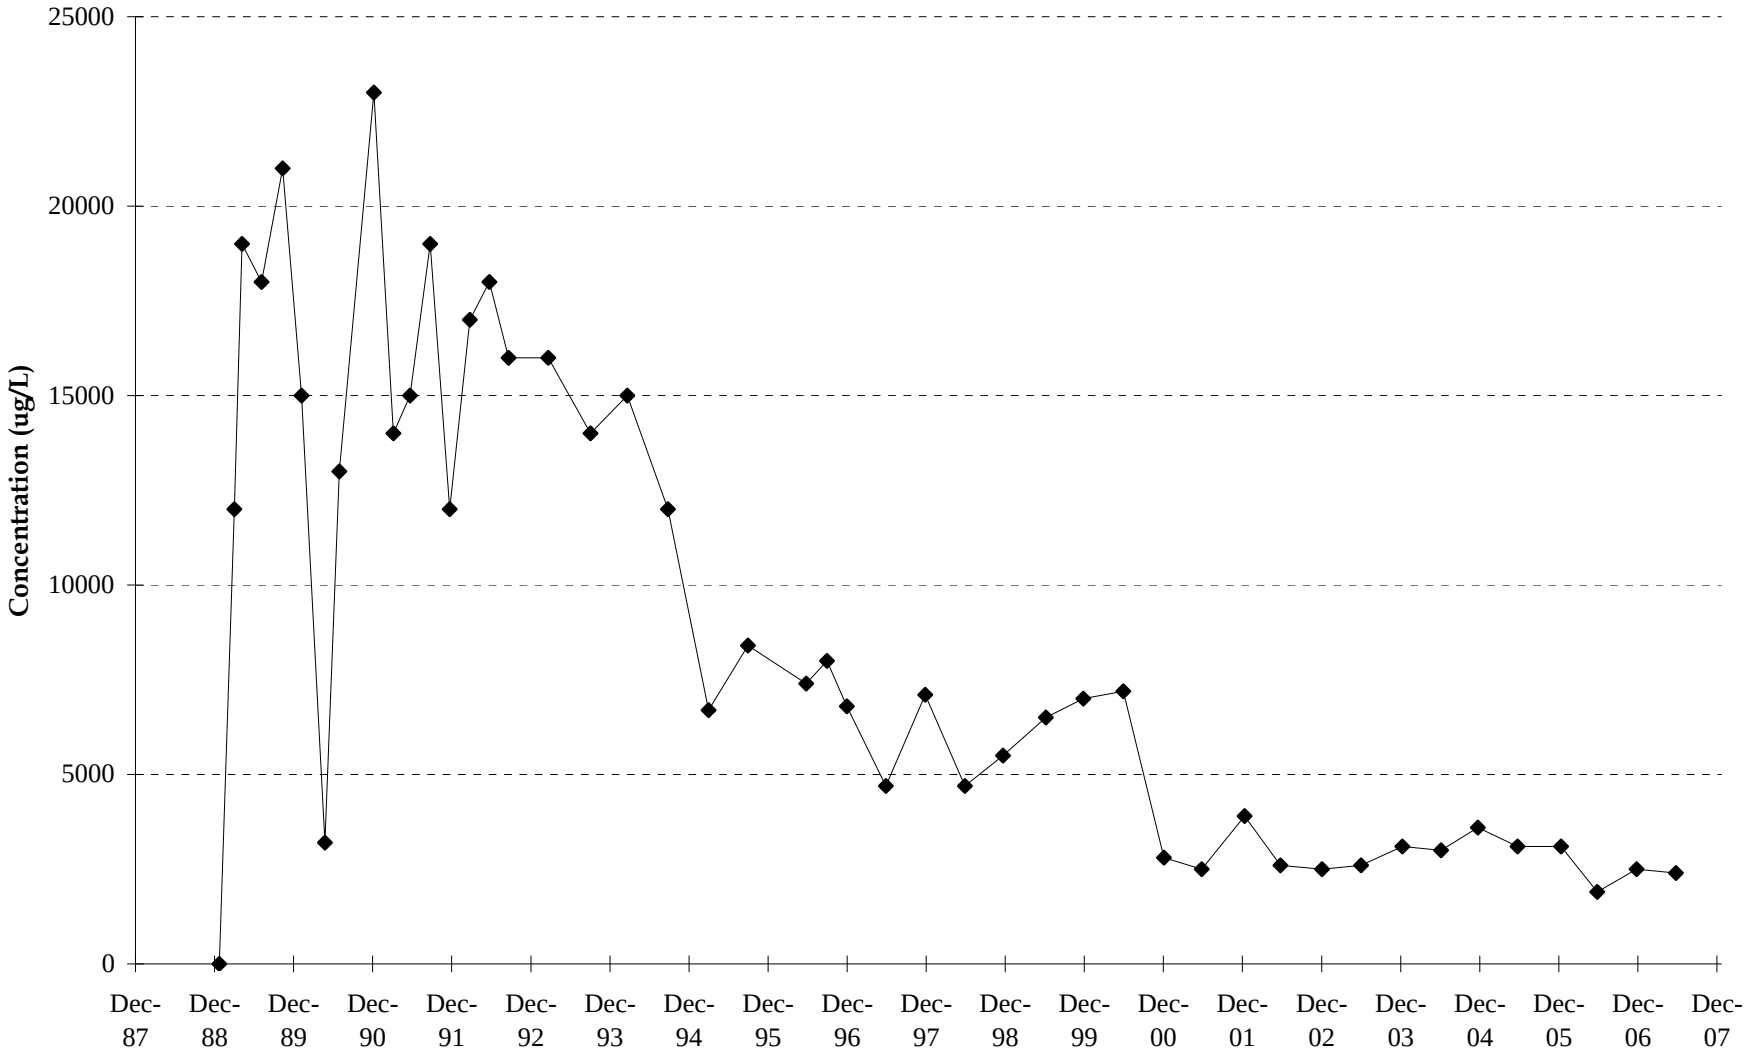

Note: Samples reporting concentrations less than the detection limit were plotted as half the detection limit.

G.2 Influent/Effluent Database, Fiscal Year 2007, TGRS, TCAAP

APPENDIX G-2

INFLUENT/EFFLUENT DATABASE (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date		1,1,1-Trichloroethane	1,1,2-Trichloroethane	1,1-Dichloroethane	1,1-Dichloroethene	1,2-Dichloroethane	Carbon Tetrachloride	Chloroform	cis-1,2-Dichloroethene	Freon 113	Methylene Chloride	Tetrachloroethene	trans-1,2-Dichloroethene	Trichloroethene
TGRS Cleanup Level [1]			*200*	--	*70*	*6*	*4*	--	--	*70*	--	--	*5*	--	*5*
TGRSE	10/16/06		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
TGRSE	10/16/06	D	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
TGRSE	11/2/06		< 1	< 1	< 1	< 1	< 1	< 1	0.49 JP	< 1	< 1	< 1	< 1	< 1	0.42 JP
TGRSE	11/2/06	D	< 1	< 1	< 1	< 1	< 1	< 1	0.24 JP	< 1	< 1	< 1	< 1	< 1	0.37 JP
TGRSE	12/4/06		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.43 JP
TGRSE	12/4/06	D	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.39 JP
TGRSE	1/4/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.44 JP
TGRSE	1/4/07	D	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.47 JP
TGRSE	2/6/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.31 JP
TGRSE	3/5/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.54 JP
TGRSE	3/5/07	D	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.55 JP
TGRSE	4/5/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.44 JP
TGRSE	4/5/07	D	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.39 JP
TGRSE	5/1/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.32 JP
TGRSE	5/1/07	D	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.36 JP
TGRSE	6/5/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.44 JP
TGRSE	6/5/07	D	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.37 JP
TGRSE	7/3/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.49 JP
TGRSE	8/3/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.52 JP
TGRSE	8/3/07	D	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.51 JP
TGRSE	9/4/07		< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.39 JP
TGRSE	9/4/07	D	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	0.4 JP

APPENDIX G-2

INFLUENT/EFFLUENT DATABASE (µg/L)
FISCAL YEAR 2007
TGRS, TCAAP
ARDEN HILLS, MINNESOTA

Location	Date		1,1,1-Trichloroethane	1,1,2-Trichloroethane	1,1-Dichloroethane	1,1-Dichloroethene	1,2-Dichloroethane	Carbon Tetrachloride	Chloroform	cis-1,2-Dichloroethene	Freon 113	Methylene Chloride	Tetrachloroethene	trans-1,2-Dichloroethene	Trichloroethene
TGRS Cleanup Level [1]			200	--	70	6	4	--	--	70	--	--	5	--	5
TGRSI	10/16/06		7.7	< 1	4	4.5	< 1	< 1	< 1	3.4	< 1	< 1	1.2	< 1	110
TGRSI	11/2/06		71	< 1	4.8	6.4	< 1	< 1	0.27 JP	3.3	1	0.35 JP	1.4	< 1	300
TGRSI	12/4/06		77	< 1	5.3	7.5	< 1	< 1	< 1	3.5	1.3	< 1	2.1	< 1	250
TGRSI	1/4/07		65	< 1	4.9	6.6	< 1	< 1	< 1	3.2	0.99 JP	< 1	1.8	< 1	250
TGRSI	2/6/07		69	< 1	4.6	6.3	< 1	< 1	< 1	3.2	1	< 1	1.4	< 1	290
TGRSI	2/6/07	D	71	< 1	4.8	6.3	< 1	< 1	< 1	3.1	1.1	< 1	1.4	< 1	290
TGRSI	3/5/07		56	< 1	5.1	5.9	< 1	< 1	< 1	3.4	0.81 JP	< 1	1.5	< 1	280
TGRSI	4/5/07		51	< 1	5.3	5.4	< 1	< 1	< 1	2.4	0.55 JP	0.33 JP	1.3	< 1	230
TGRSI	5/1/07		49	< 1	5.2	5.1	< 1	< 1	< 1	3.3	0.47 JP	< 1	1.3	< 1	240
TGRSI	6/5/07		45	< 1	4.5	4.5	< 1	< 1	< 1	2.6	0.42 JP	< 1	1.2	< 1	230
TGRSI	7/3/07		46	< 1	4.7	5.5	< 1	< 1	< 1	3.2	0.77 JP	< 1	1.6	< 1	190
TGRSI	7/3/07	D	47	< 1	4.8	5.4	< 1	< 1	< 1	3.3	0.82 JP	< 1	1.6	< 1	200
TGRSI	8/3/07		53	< 1	5	4.9	< 1	< 1	< 1	3.3	0.48 JP	< 1	1.3	< 1	240
TGRSI	9/4/07		55	< 1	5	6	< 1	< 1	< 1	3.3	0.93 JP	< 1	1.6	< 1	240

Notes:
D - Duplicate analysis
JP - Results less than reporting level but greater than instrument detection limit.

Appendix H

Operable Unit 3 Statistical Analysis

TABLE H.2

MAROS DECISION MATRIX

Kendall S	*Confidence*	*Coefficient of Varience*	*Trend*
S > 0	> 95%	NA	Definitely Increasing
S > 0	90-95%	NA	Probably Increasing
S > 0	< 90%	NA	No Trend
S</= 0	< 90%	>/= 1	No Trend
S </= 0	< 90%	< 1	Stable
S < 0	90-95%	NA	Probably Decreasing
S < 0	>95%	NA	Definitely Decreasing

WELL 03L673
MANN-KENDALL STATISTICAL ANALYSIS
OU3 - 2007

Date	TCE (ug/l)	Mann-Kendall Calculation:						
6/4/99	**280**	1						
6/12/01	**24**	1	-1					
Jun-03	**6.3**	1	-1	-1				
Jun-04	**180**	1	-1	1	1			
6/22/2005	**150**	1	-1	1	1	-1		
6/21/2007	**110**	1	-1	1	1	-1	-1	

	N	6	5	4	3	2	1	0	15
	sum		-5	2	3	-2	-1	0	Kendall S -3
	Possibles	15							
									Kendall tau -0.2

Mean	125.05
STNDEV	102.1671914
COV	0.817010727

Trend: Negative

Confidence (lookup) 64.00%

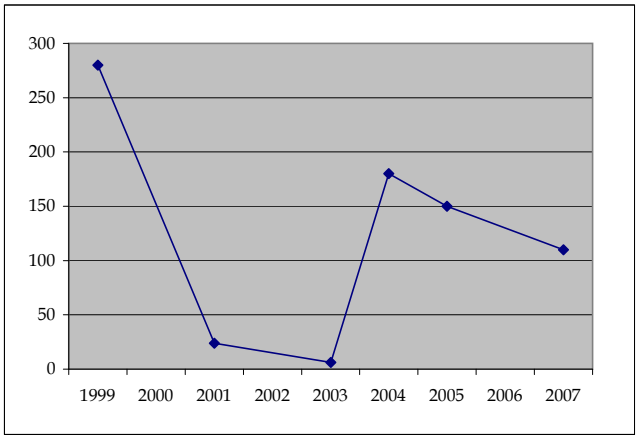

Raw Data 03L673	Date	TCE
	11/12/87	**1200**
	5/2/90	**3200**
	3/11/91	2000
	3/11/91	1900
	6/17/91	**5500**
	3/12/92	**3900**
	3/3/93	**2100**
	3/4/94	3300
	6/6/94	2000
	6/6/94	**2000**
	9/14/94	1600
	12/8/94	1400
	3/15/95	**910**
	6/12/96	**650**
	6/12/97	**240**
	6/25/98	**270**
	6/4/99	**280**
	6/12/01	**24**
	Jun-03	**6.3**
	Jun-04	**180**
	6/22/2005	**150**
	6/21/2007	**110**

WELL 03L848
MANN-KENDALL STATISTICAL ANALYSIS
OU3 - 2007

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/29/1998	**10.7**	1					
6/4/1999	**7.3**	1	-1				
6/12/2001	**3.5**	1	-1	-1			
Jun-03	**3.8**	1	-1	-1	1		
6/21/2005	**5.8**	1	-1	-1	1	1	
6/21/2007	**5.4**	1	-1	-1	1	1	-1

	N	6	5	4	3	2	1	0	15
	sum		-5	-4	3	2	-1	0	Kendall S -5
	Possibles	15							
									Kendall tau -0.33333

Mean	6.08
STNDEV	2.65436747
COV	0.436334379

Trend: Negative

Confidence (lookup) 76.50%

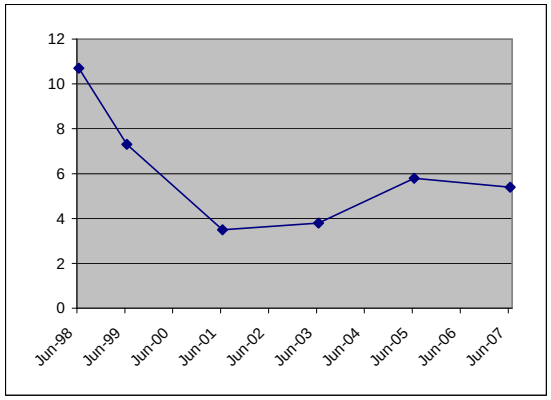

Raw Data 03L848	Date	TCE
	12/2/1987	**570**
	5/3/1989	**270**
	7/20/1989	130
	10/19/1989	**610**
	4/19/1990	**460**
	7/19/1990	260
	3/18/1991	**250**
	3/18/1992	**92**
	3/9/1993	**52.9**
	6/6/1994	27
	9/15/1994	**27.1**
	12/8/1994	22
	3/10/1995	**16.6**
	6/3/1996	**11.3**
	6/5/1997	**9.34**
	6/5/1997	8.57
	6/29/1998	**10.7**
	6/4/1999	**7.3**
	6/12/2001	**3.5**
	Jun-03	**3.8**
	6/21/2005	**5.8**
	6/21/2007	**5.4**
	6/21/2007	5.3

WELL 409548
MANN-KENDALL STATISTICAL ANALYSIS
OU3 - 2007

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/22/98	**2.91**	1					
6/14/99	**2.90**	1	-1				
6/19/01	**1.60**	1	-1	-1			
6/11/03	**1.40**	1	-1	-1	-1		
6/8/05	**1.1**	1	-1	-1	-1	-1	
6/12/07	**1.3**	1	-1	-1	-1	-1	1

N		6	5	4	3	2	1	0		15
	sum		-5	-4	-3	-2	1	0	Kendall S	-13
Possibles		15								
									Kendall tau	-0.86667

Mean 1.87
STNDEV 0.81903398
COV 0.4383768

Trend: Negative

Confidence (lookup) 99.17%

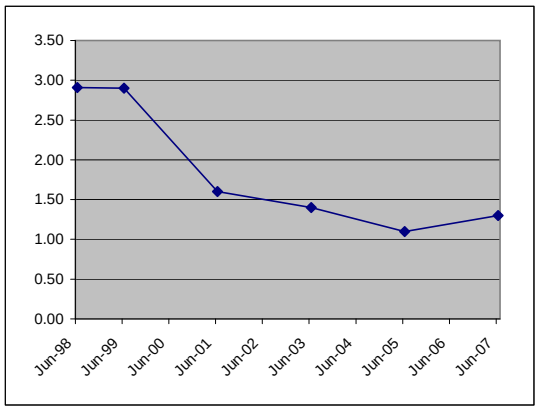

Raw Data 409548	Date	TCE
	5/10/89	<0.50
	7/20/89	<1.10
	10/18/89	**<1.10**
	4/17/90	**1.17**
	3/18/91	**0.88**
	3/25/92	**>50.10**
	3/18/93	1.05
	3/18/93	**2**
	3/21/94	2.66
	3/21/94	2.96
	6/9/94	2.8
	9/16/94	2.73
	12/9/94	**22.7**
	3/10/95	**2.03**
	6/4/96	**2.84**
	6/4/97	**2.7** JP
	6/22/98	**2.91**
	6/14/99	2.8
	6/14/99	**2.9**
	6/19/01	**1.6**
	6/11/03	**1.4**
	6/8/05	**1.1**
	6/12/07	**1.3**

WELL 04U673
MANN-KENDALL STATISTICAL ANALYSIS
OU3 - 2007

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/4/1999	**74.0**	1					
6/12/2001	**2.9**	1	-1				
Jun-03	**15.0**	1	-1	1			
Jun-04	**51**	1	-1	1	1		
6/22/2005	**49**	1	-1	1	1	-1	
6/21/2007	**42**	1	-1	1	1	-1	-1

	N	6	5	4	3	2	1	15
	sum		-5	4	3	-2	-1	Kendall S -1
	Possibles	15						
								Kendall tau -0.06667

Mean	38.98
STNDEV	25.9121915
COV	0.66469923
Trend:	Negative
Confidence (lookup)	50.00%

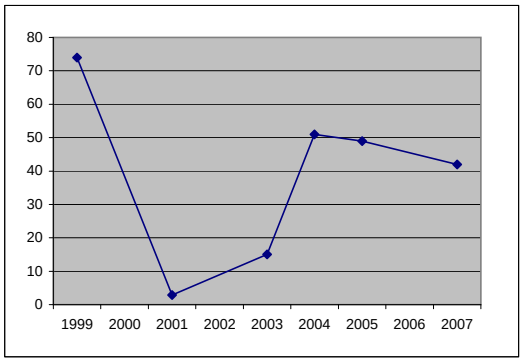

Raw Data 04U673	Date	TCE
	11/24/1987	**145.0**
	1/21/1988	580.0
	5/16/1988	560.0
	8/4/1988	253.0
	11/1/1988	**1700.0**
	5/3/1989	700.0
	7/21/1989	**1200.0**
	10/19/1989	1100.0
	5/1/1990	**3100.0**
	3/11/1991	**990.0**
	3/11/1991	940.0
	6/17/1991	410.0
	3/12/1992	460.0
	6/4/1992	430.0
	9/8/1992	**540.0**
	3/3/1993	**280.0**
	9/13/1993	190.0
	3/3/1994	**270.0**
	6/6/1994	210.0
	9/8/1994	170.0
	12/8/1994	190.0
	3/15/1995	160.0
	3/15/1995	140.0
	9/12/1995	**260.0**
	6/12/1996	**125.0**
	6/12/1997	**60.4**
	6/25/1998	**81.9**
	6/4/1999	**74.0**
	6/12/2001	**2.9**
	Jun-03	**15.0**
	Jun-04	**51**
	6/22/2005	**49**
	6/21/2007	**42**

WELL 04U832
MANN-KENDALL STATISTICAL ANALYSIS
OU3 - 2007

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/7/1999	**29.00**	1					
6/14/2001	**3.50**	1	-1				
Jun-03	**4.10**	1	-1	1			
6/23/2005	**41**	1	1	1	1		
6/13/2006	**54**	1	1	1	1	1	
6/22/2007	**56**	1	1	1	1	1	1

N	6	5	4	3	2	1	0		15
sum		1	4	3	2	1	0	Kendall S	11
Possibles	15								
								Kendall tau	0.733333

Mean	31.27
STNDEV	23.398433
COV	0.748350735
Trend:	Positive
Confidence (lookup)	97.20%

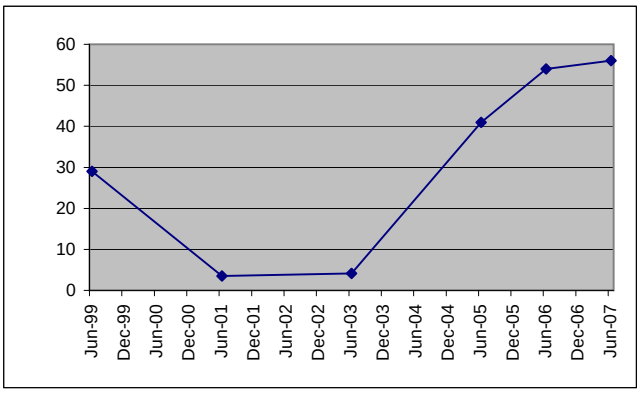

Raw Data 04U832	Date	TCE
	11/24/1987	**100.00**
	12/16/1988	**65.00**
	4/25/1990	**69.53**
	3/19/1991	**47.60**
	3/25/1992	**52.50**
	3/16/1993	42.00
	3/16/1993	**45.90**
	6/10/1994	49.00
	9/13/1994	**49.50**
	12/7/1994	43.30
	12/7/1994	47.10
	3/10/1995	**56.00**
	6/3/1996	**41.00**
	6/4/1997	**35.20**
	6/25/1998	**36.40**
	6/7/1999	**29.00**
	6/14/2001	**3.50**
	Jun-03	**4.10**
	6/23/2005	**41**
	6/13/2006	**54**
	6/22/2007	**56**

WELL 04U845
MANN-KENDALL STATISTICAL ANALYSIS
OU3 - 2007

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/7/1999	**35.00**	1					
6/13/2001	**4.30**	1	-1				
6/1/2003	**4.00**	1	-1	-1			
6/22/2005	**20**	1	-1	1	1		
6/13/2006	**14**	1	-1	1	1	-1	
6/22/2007	**15**	1	-1	1	1	-1	1

	N	6	5	4	3	2	1		15
	sum		-5	2	3	-2	1	Kendall S	-1
	Possibles	15							
								Kendall tau	-0.06667

Mean	15.38
STNDEV	11.4944189
COV	0.7471995
Trend:	Negative
Confidence (lookup)	50.00%

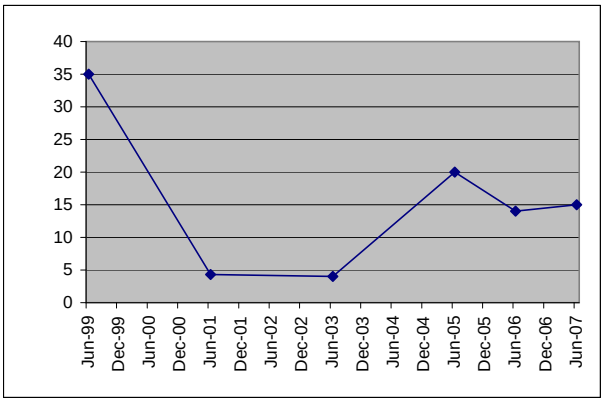

Raw Data 04U845	Date	TCE
	12/1/1987	**59.00**
	12/16/1988	**155.00**
	5/4/1989	100.00
	7/20/1989	**160.00**
	10/20/1989	62.00
	4/26/1990	**38.00**
	3/20/1991	**100.00**
	3/23/1992	>50.10
	3/23/1992	**100.00**
	3/15/1993	**84.00**
	6/8/1994	64.00
	9/13/1994	**70.00**
	12/7/1994	54.00
	3/10/1995	**39.50**
	6/4/1996	**51.20**
	6/5/1997	**30.80**
	6/25/1998	**32.90**
	6/7/1999	**35.00**
	6/13/2001	**4.30**
	6/1/2003	**4.00**
	6/22/2005	**20**
	6/13/2006	**14**
	6/13/2006	14
	6/22/2007	**15**

WELL 04U848
MANN-KENDALL STATISTICAL ANALYSIS
OU3 - 2007

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/29/98	**4.19**	1					
6/4/99	**3.60**	1	-1				
6/12/01	**0.49**	1	-1	-1			
6/1/03	**0.46**	1	-1	-1	-1		
6/21/05	**5.60**	1	1	1	1	1	
6/21/07	**5.30**	1	1	1	1	1	-1

N		6	5	4	3	2	1	0	15
	sum		-1	0	1	2	-1	0	Kendall S 1
Possibles		15							
									Kendall tau 0.066667

Mean	3.27
STNDEV	2.286024205
COV	0.698378067
Trend:	Positive
Confidence (lookup)	50.00%

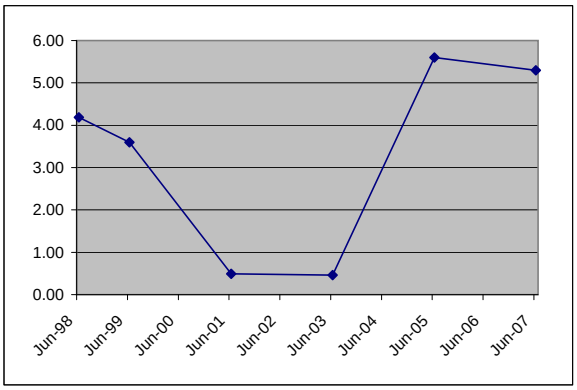

Raw Data 04U848	Date	TCE
	12/2/87	**700.00**
	8/24/88	**470.00**
	5/3/89	150.00
	7/20/89	**700.00**
	10/19/89	280.00
	4/19/90	**240.00**
	7/19/90	140.00
	9/17/90	150.00
	3/18/91	**64.00**
	3/18/92	22.50
	3/18/92	**23.40**
	3/10/93	**26.00**
	6/6/94	12.20
	9/15/94	**16.80**
	12/8/94	15.60
	3/10/95	**9.94**
	6/3/96	**6.15**
	6/5/97	**3.30**
	6/29/98	**4.19**
	6/4/99	**3.60**
	6/12/01	**0.49** J
	6/1/03	**0.46** JP
	6/21/05	**5.60**
	6/21/07	**5.30**

WELL 03M848
MANN-KENDALL STATISTICAL ANALYSIS
OU3 - 2007

Date	TCE (ug/l)	Mann-Kendall Calculation:					
6/4/1999	**700**	1					
6/12/2001	**370**	1	-1				
6/1/2003	**450**	1	-1	1			
6/21/2005	**230**	1	-1	-1	-1		
6/13/2006	**190**	1	-1	-1	-1	-1	
6/21/2007	**150**	1	-1	-1	-1	-1	-1

	N	6	5	4	3	2	1	0	15
	sum		-5	-2	-3	-2	-1	0	Kendall S -13
	Possibles	15							
									Kendall tau -0.86667

Mean	348.33
STNDEV	206.341141
COV	0.59236691
Trend:	Negative
Confidence (lookup)	99.17%

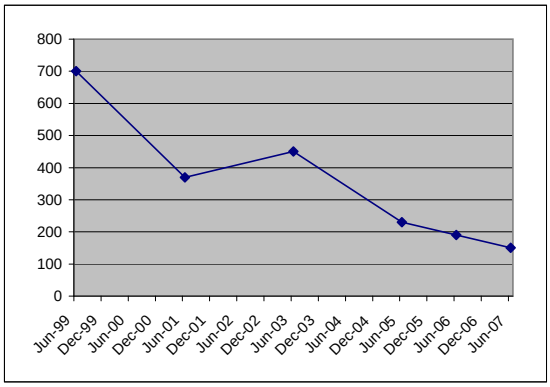

Raw Data 03M848	Date	TCE
	12/2/1987	**440.00**
	4/19/1990	190.00
	7/19/1990	190.00
	9/17/1990	**330.00**
	3/18/1991	310.00
	6/4/1991	**730.00**
	9/3/1991	700.00
	3/18/1992	**640.00**
	6/3/1992	>50.10
	6/3/1992	570.00
	9/3/1992	>50.10
	3/9/1993	**1300**
	3/9/1993	970
	3/17/1994	**910**
	3/16/1995	**59**
	6/21/1996	**1400**
	6/26/1997	**510**
	6/29/1998	**660**
	6/4/1999	**700**
	6/4/1999	650
	6/12/2001	**370**
	6/1/2003	**450**
	6/21/2005	**230**
	6/13/2006	**190**
	6/21/2007	**150**

WELL 04U859
MANN-KENDALL STATISTICAL ANALYSIS
OU3 - 2007

Date	TCE (ug/l)	Mann-Kendall Calculation:						
6/25/1998	**46.80**	1						
6/7/1999	**75.00**	1	1					
6/13/2001	**8.40**	1	-1	-1				
Jun-03	**4.40**	1	-1	-1	-1			
6/22/2005	**71**	1	1	-1	1	1		
6/21/2007	**60**	1	1	-1	1	1	-1	

N		6	5	4	3	2	1	0	15
	sum		1	-4	1	2	-1	0	Kendall S -1
Possibles		15							
									Kendall tau -0.06667

Mean	44.27
STNDEV	30.94812865
COV	0.699129412
Trend:	Negative
Confidence (lookup)	50.00%

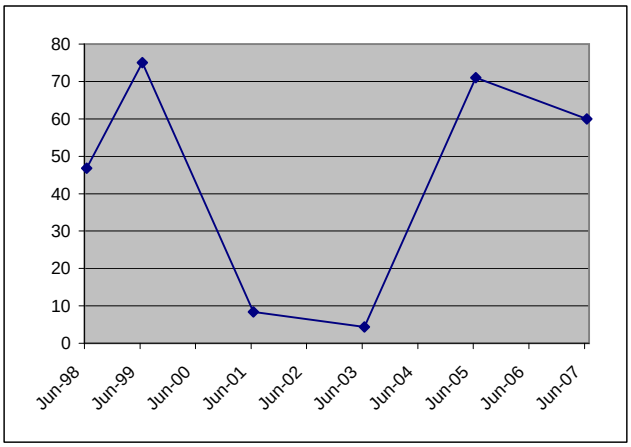

Raw Data 04U859	Date	TCE
	11/13/1987	**0.30**
	12/15/1988	**8.50**
	4/30/1990	**5.59**
	3/19/1991	**5.24**
	3/20/1992	**9.29**
	3/11/1993	**40.50**
	3/18/1994	47.00
	3/18/1994	49.50
	6/9/1994	48.90
	9/14/1994	**64.00**
	12/7/1994	52.50
	3/10/1995	**43.80**
	6/3/1996	**50.80**
	6/4/1997	**31.90**
	6/25/1998	42.00
	6/25/1998	**46.80**
	6/7/1999	**75.00**
	6/13/2001	**8.40**
	Jun-03	**4.40**
	6/22/2005	**71**
	6/21/2007	**60**

Appendix I

Other Installation Restoration Activities During FY 2007

APPENDIX I

OTHER INSTALLATION RESTORATION ACTIVITIES DURING FY 2007

This appendix is intended to give the reader a brief overview of other activities at TCAAP that are related to the Installation Restoration Program, but are not required by the RODs for OU1 through OU3.

A. DEEP GROUNDWATER BACKGROUND MONITORING

In order to assess the quality of deep groundwater flowing from off-site to beneath TCAAP, monitoring is performed at locations near the upgradient side of TCAAP (the northeast corner and east side). Locations of these wells are shown on Figure B-3 in Appendix B. The FY 2007 results were:

Well	Trichloroethene
03U007	<1.0
03U009	0.27 JP
03L007	<1.0
04U007	<1.0
04U510	<1.0

The results indicate that no significant contamination is flowing into TCAAP from off-site.

These locations will be sampled again in FY 2009 as shown in Appendix A.1 (the wells are listed under TCAAP Groundwater Recovery System in the appendix).

B. AQUATIC STUDIES

The Tier II Ecological Risk Assessment Report for aquatic sites, prepared by the U.S. Army Center for Health Promotion and Preventative Medicine (USACHPPM), was approved by the MPCA and USEPA in December 2004. In June 2005, the Army submitted a draft feasibility study (FS) to support the Risk Manager's decision with respect to "No Further Action" or "Implement a Remedy" for each aquatic site. As a result of comments on the draft FS, it was agreed to conduct additional sampling of Marsden Lake and Pond G. A Quality Assurance Project Plan was approved in FY 2007, and monthly sampling is being conducted from March 2007 – February 2008. When the sampling has been completed, a report of findings will be prepared. In addition to this sampling, a Technical Working Group was convened to address issues related to Round Lake. The group consists of representatives for the Army, MPCA, USEPA, and the U.S. Fish and Wildlife Service. It is possible that additional data collection will be necessary in order to complete the FS for Round Lake.

C. GRENADE RANGE

The removal action to address contaminated soils was completed in early FY 2000. The Grenade Range Closeout Report received partial regulatory approval in FY 2002, with land use control issues still needing resolution. There was no activity related to this site in FY 2007.

D. OUTDOOR FIRING RANGE

The removal action to address metals-contaminated soils was completed in early FY 2000 and the Outdoor Firing Range Closeout Report received partial regulatory approval in FY 2002, with land use control issues still needing resolution. Construction was completed in October 2004 of a soil cover over a portion of the 1900-yard range that is contaminated with polynuclear aromatic hydrocarbons (PAHs). In FY 2006, the Army prepared an addendum (subsequently approved) to the above-referenced closeout report to document the work at the 1900-yard range. There was no activity related to this site in FY 2007.

E. 135 AND 535 PRIMER/TRACER AREAS

Preliminary Assessment reports for both of these sites received regulatory approval in FY 2002. It was recommended that a Site Inspection be conducted for both areas. The Site Inspection (SI) investigation report for each of these sites received MPCA and USEPA approval in FY 2005. The SI reports recommended that an Engineering Evaluation/Cost Analysis (EE/CA) be conducted for both areas to determine what, if any, remediation is required to address contamination observed in the soils. The 135 Primer/Tracer Area is on property that is proposed to be transferred to the City of Arden Hills. It is the Army's current intention to have the City, and/or its developer, conduct further work at this area as part of the transfer negotiations. At the end of FY 2007, the Army was in the process of preparing a Quality Assurance Project Plan to undertake additional sampling in support of the EE/CA for the 535 Primer/Tracer Area.

F. PROPERTY TRANSFER-RELATED ENVIRONMENTAL ACTIVITIES

In 2002, the remaining 774 acres that were still under the control of TCAAP, were declared excess to the needs of the Department of Defense. The Army Base Realignment and Closure Office funded environmental site assessment (ESA) work to collect reliable information regarding the environmental condition of the property in order to facilitate property transfer. The work included document reviews and field sampling of various media. The findings were published in "Environmental Site Assessment for 774-Acre Excess Parcel, Phase I and Phase II Report, Twin Cities Army Ammunition Plant" (Plexus Scientific Corporation, February 20, 2004, final report). Based on comments from the MPCA and USEPA, additional samples were collected and analyzed in FY 2005. The Army prepared an "ESA Addendum Report" that was approved in FY 2006. In FY 2007, a developer collected additional samples of various media on the property proposed for transfer to the City of Arden Hills. The data from this work has not yet been made available to the Army.

Appendix J

Annual Site Inspection Checklist for Land Use Controls

ANNUAL SITE INSPECTION CHECKLIST FOR LAND USE CONTROLS

Twin Cities Army Ammunition Plant

Date: July 24, 2007 Inspected By: Mike Fix (TCAAP), Dave Hamernick (Nat'l Guard), Keith Benker (Wenck)

Sites:	A	C	D	E	G	H	I	K
Site is located on property held by:	N.G.	BRAC	N.G.	N.G.	N.G.	N.G.	BRAC	BRAC
Is the fence surrounding federally-controlled property intact?	Yes	→	→	→	→	→	→	→
Is access to the federally-controlled property still controlled by BRAC & the National Guard?	Yes	→	→	→	→	→	→	→
Is the current land use consistent with the land use scenario upon which the cleanup levels were based?	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
Has there been any excavation or other man-made soil disturbance at the site?	No	No(1)	No	No	No	No	No	No
If excavation or soil disturbance has occurred, was prior approval given by BRAC or National Guard?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
If excavation or soil disturbance was authorized, was the work done in accordance with the approved plan?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Have any new structures or facilities (including new wells) been constructed on the site?	No	No	No	No	No	No	No	No
If new facilities or structures were constructed, was prior approval given by BRAC or National Guard?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
If new facilities or structures were authorized, was constuction in accordance with the approved plan?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Has there been any damage to or removal/modification of groundwater remediation systems?	No	No	N/A	N/A	N/A	N/A	N/A	No
If such systems were removed or modified, was prior approval given by BRAC or National Guard?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
If system removal/modification was authorized, was removal/modification in accordance with approved plan?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
If a protective soil cover is present, is adequate vegetation present throughout the soil cover area?	N/A	N/A(2)	Yes	Yes	Yes	Yes	N/A	N/A
If a protective soil cover is present, is there any woody vegetation > 2" diameter present on the soil cover area?	N/A	N/A	N/A	N/A	No	N/A	N/A	N/A
If a protective soil cover is present, are run-on/runoff controls in good condition (swales, berms, riprap, etc.)?	N/A	N/A(2)	Yes	Yes	Yes	Yes	N/A	N/A
If a protective soil cover is present, are signs marking the edge of the soil cover present and in good condition?	N/A	N/A(2)	Yes	Yes	Yes	Yes	N/A	N/A

Comments (Attach additional pages as necessary):

(1) Field crews were mobilizing to complete the soil remediation at Site C in 2007.

(2) When the soil remedy is completed in 2007, there will be a soil cover so this form will need to be revised for future years.

ANNUAL SITE INSPECTION CHECKLIST FOR LAND USE CONTROLS

Twin Cities Army Ammunition Plant

Sites:	129-3	129-5	129-15	Grenade Range	Outdoor Firing Range	Bldg 135 P/T Area	Bldg 535 P/T Area	Unchar. Land
Site is located on property held by:	N.G.	N.G.	N.G.	N.G.	N.G.	BRAC	N.G.	BRAC/N.G.
Is the fence surrounding federally-controlled property intact?	Yes							
Is access to the federally-controlled property still controlled by BRAC & the National Guard?	Yes							
Is the current land use consistent with the land use scenario upon which the cleanup levels were based?	Yes	Yes	Yes	Yes	Yes	Yes	Yes	N/A
Has there been any excavation or other man-made soil disturbance at the site?	No	No	No	No	No	No	No	N/A
If excavation or soil disturbance has occurred, was prior approval given by BRAC or National Guard?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
If excavation or soil disturbance was authorized, was the work done in accordance with the approved plan?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Have any new structures or facilities (including new wells) been constructed on the site?	No	No	No	No	No	No	No	N/A
If new facilities or structures were constructed, was prior approval given by BRAC or National Guard?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
If new facilities or structures were authorized, was constuction in accordance with the approved plan?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
Has there been any damage to or removal/modification of groundwater remediation/monitoring systems?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
If such systems were removed or modified, was prior approval given by BRAC or National Guard?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
If system removal/modification was authorized, was removal/modification in accordance with approved plan?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
If a protective soil cover is present, is adequate vegetation present throughout the soil cover area?	N/A	N/A	Yes	N/A	Yes	N/A	N/A	N/A
If a protective soil cover is present, is there any woody vegetation > 2" diameter present on the soil cover area?	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
If a protective soil cover is present, are run-on/runoff controls in good condition (swales, berms, riprap, etc.)?	N/A	N/A	Yes	N/A	Yes	N/A	N/A	N/A
If a protective soil cover is present, are signs marking the edge of the soil cover present and in good condition?	N/A	N/A	Yes	N/A	Yes	N/A	N/A	N/A

Comments (Attach additional pages as necessary):